
P1F18-00

Fault diagnosis code
P1F18-00：Air conditioner compressor high pressure interlock failure
Detection tools
1 Multimeter and diagnostic apparatus
Possible causes
• Circuit,terminal and adapting piece fault • High voltage interlock circuit fault
Conditions for fault code operation
Turn the ignition switch to ON position.
Conditions for fault code setting
P1F18-00
To set the effect of a fault code condition
Description of circuit diagram

Circuit diagram

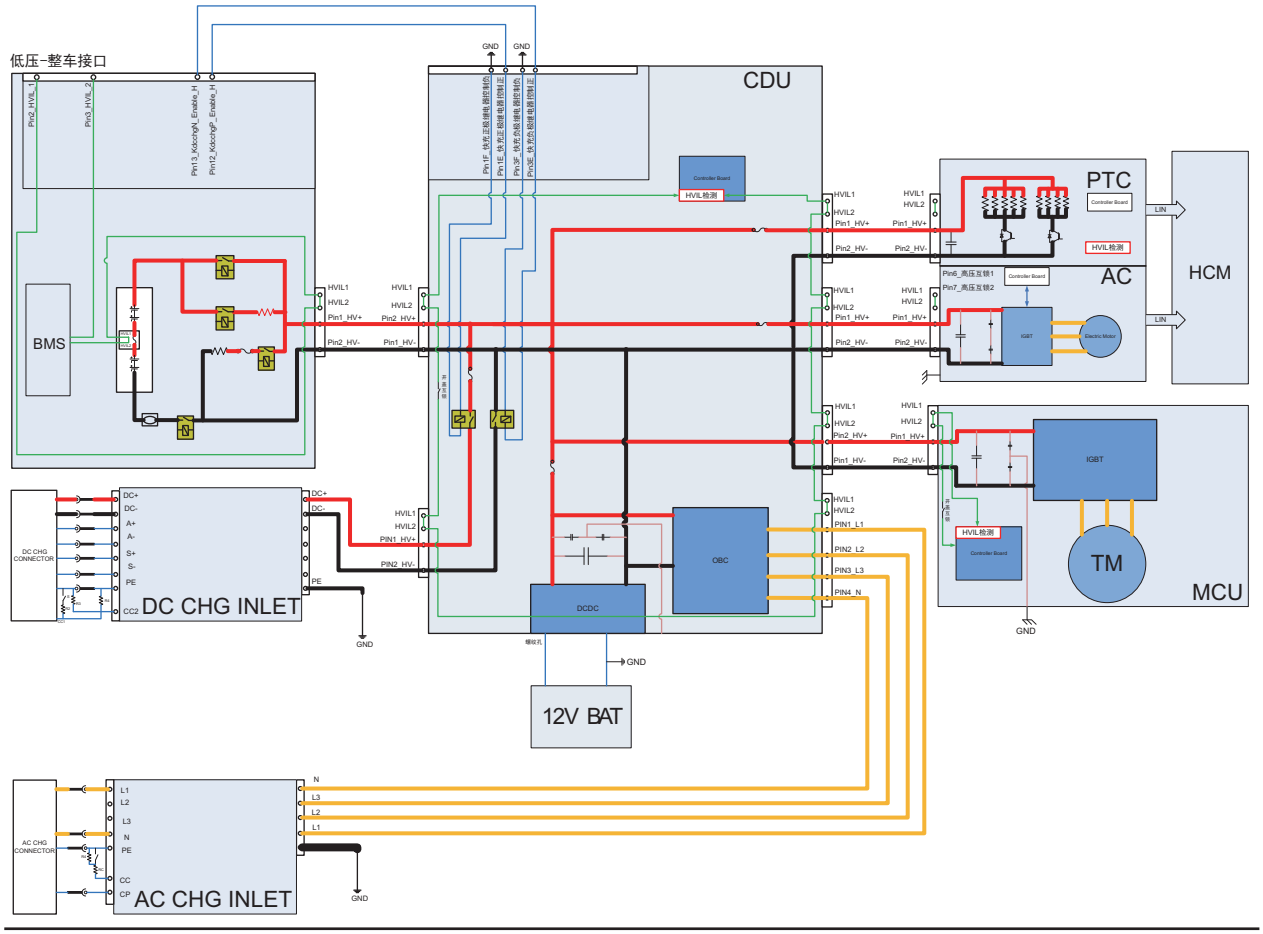

EV904014

Troubleshooting steps		
Step 1	General inspection.	
		1 Check the fuse for damage. 2 Check battery capacity. 3 Check the harness plug of CDU for damage, poor contact, aging and looseness. 4 Check whether the result is normal or not?
		NO → Repair or replace the faulted parts.
YES ↓		
Step 2	Check fault codes.	
		1 Connect the fault diagnosis instrument to the diagnosis interface. 2 Turn the ignition switch to ON position. 3 Diagnose the GAW module with diagnostic apparatus. 4 Is there any other fault code except for P1F18-00?
		YES → Refer to:DTC Summary list(CDU).
NO ↓		
Step 3	Check air conditioner compressor high-voltage interlock circuit of CDU.	
		1 Turn the ignition switch to OFF. 2 Make protective preparations according to the safety operation specifications of the high voltage voltage in the maintenance manual. 3 Disconnect the harness plug battery pack high voltage. 4 Disconnect air conditioner compressor high-voltage interlock circuit of CDU. 5 Check whether the CDU connection cable is rotten, damaged, and water enters. 6 Check whether the interlock circuit of air conditioner compressor high-voltage exist the situation of open or short circuit. 7 Check whether the result is normal or not?
		NO → Repair or replace the faulted parts.
YES ↓		

Step 4	Check air conditioner compressor high-voltage interlock circuit.	
		1 Turn the ignition switch to OFF. 2 Make protective preparations according to the safety operation specifications of the high voltage voltage in the maintenance manual. 3 Disconnect air conditioner compressor high-voltage interlock circuit of CDU. 4 Disconnect air conditioner compressor high-voltage interlock circuit. 5 Check whether the air conditioner compressor high-voltage interlock circuit is open. 6 Check whether the result is normal or not?
		NO → Repair or replace the faulted parts.
YES ↓		
Step 5	Check air conditioner compressor high-voltage cable interlock circuit.	
		1 Turn the ignition switch to OFF. 2 Make protective preparations according to the safety operation specifications of the high voltage voltage in the maintenance manual. 3 Disconnect air conditioner compressor high-voltage harness plug. 4 Check whether the interlock circuit of air conditioner compressor high-voltage exist the situation of open or short circuit. 5 Check whether the result is normal or not?
		NO → Repair or replace the faulted parts.
YES ↓		
Step 6	Check CDU internal circuit.	
		1 Turn the ignition switch to OFF. 2 Make protective preparations according to the safety operation specifications of the high voltage voltage in the maintenance manual. 3 Open the CDU end cover. 4 Check CDU internal circuit. 5 Check whether the result is normal or not?
		NO → Repair or replace the faulted parts.
YES ↓		

Step 7	Test whether CDU is norm.
	1 Turn the ignition switch to OFF. 2 Disconnect and check the harness plug EB1004、BT1001、BTN_1001、BTN_1002 of CDU. 3 Check and repair. • Corrosion(install new adapting piece or terminal-cleaning module and pin). • Pin damaged or bent-install new terminal/pin. 4 Fly out of pins-install new pins as needed. 5 Reconnect the CDU plug and all other previously disconnected plug. Make sure the pin is properly positioned and fixed. 6 Run the system and determine if the problem persists?
	YES → Change the CDU Module
NO ↓	
At this point the system is functioning normally. The problem may be caused by module connections. Address the root cause of any connector or pin problems.	
Next Step ↓	
Diagnosis end.	