

U0073-88, U0101-87, U0101-87, U0121-87、U0126-87、U0140-87、U0155-87、U1D01-81、U1D02-81、U1D03-81、 U1D04-81、 U1D09-81、 U1D0E-81

Fault diagnosis code
U0073-88：Control Module Communication Bus Off
U0101-87：Lost Communication With TCU(Transmission Control Unit)
U0121-87：Lost Communication With ABS/ESP
U0126-87：Lost Communication With SAS(Steering Angle Sensor) Module
U0140-87：Lost Communication With BCM(Body Control Management)
U0155-87：Lost Communication With IPK(Instrument Park)
U1D01-81：LDW(Lane Departure Warning) disabled due to invalid data received
U1D02-81：FCW(Front Colision Warning) disabled due to invalid data received
U1D03-81：ACC(Adaptive Cruise Control) disabled due to invalid data received
U1D04-81：AEB(Automatic Electronic Braking) disabled due to invalid data received
U1D05-81：TSR(Trafic Sign Recognition) disabled due to invalid data received
U1D09-81：AHB(Automatic High Beam) disabled due to invalid data received
U1D0E-81：LKA(Lane Keeping Assistance) disabled due to invalid data received
Detection tools
1 Multimeter and diagnostic apparatus
Possible causes
• Circuit,terminal and adapting piece fault • DAS Module
Conditions for fault code operation
Turn the ignition switch to ON position.
Conditions for fault code setting
U0073-88
Bus off
U0101-87
TCU node lost
U0121-87
ABS/ESP node lost
U0126-87
SAS node lost
U0140-87
BCM node lost
U0155-87
IPK node lost


U1D01-81
LDW function cannot be accessed because the conditions are not met. The certain condition refer to function description document.
U1D02-81
FCW function cannot be accessed because the conditions are not met. The certain condition refer to function description document.
U1D03-81
ACC function cannot be accessed because the conditions are not met. The certain condition refer to function description document.
U1D04-81
AEB function cannot be accessed because the conditions are not met. The certain condition refer to function description document.
U1D05-81
TSR function cannot be accessed because the conditions are not met. The certain condition refer to function description document.
U1D09-81
AHB function cannot be accessed because the conditions are not met. The certain condition refer to function description document.
U1D0E-81
LKA function cannot be accessed because the conditions are not met. The certain condition refer to function description document.
To set the effect of a fault code condition
1. LDW\FCW\AEB\LKA\AHB function cannot be accessed. 2. FCW\AEB\ACC\LKA function cannot be accessed.
Description of circuit diagram
The device is connected to serial data circuit, which is used to monitor the communication situation of serial data during normal operation of vehicle. The devices will exchange the operation information and commands mutually. The device has programming information required to be exchanged on the serial data circuit. The receiver device will also monitor such information; in addition, there are some regular information indication transmitter devices available.

Circuit diagram

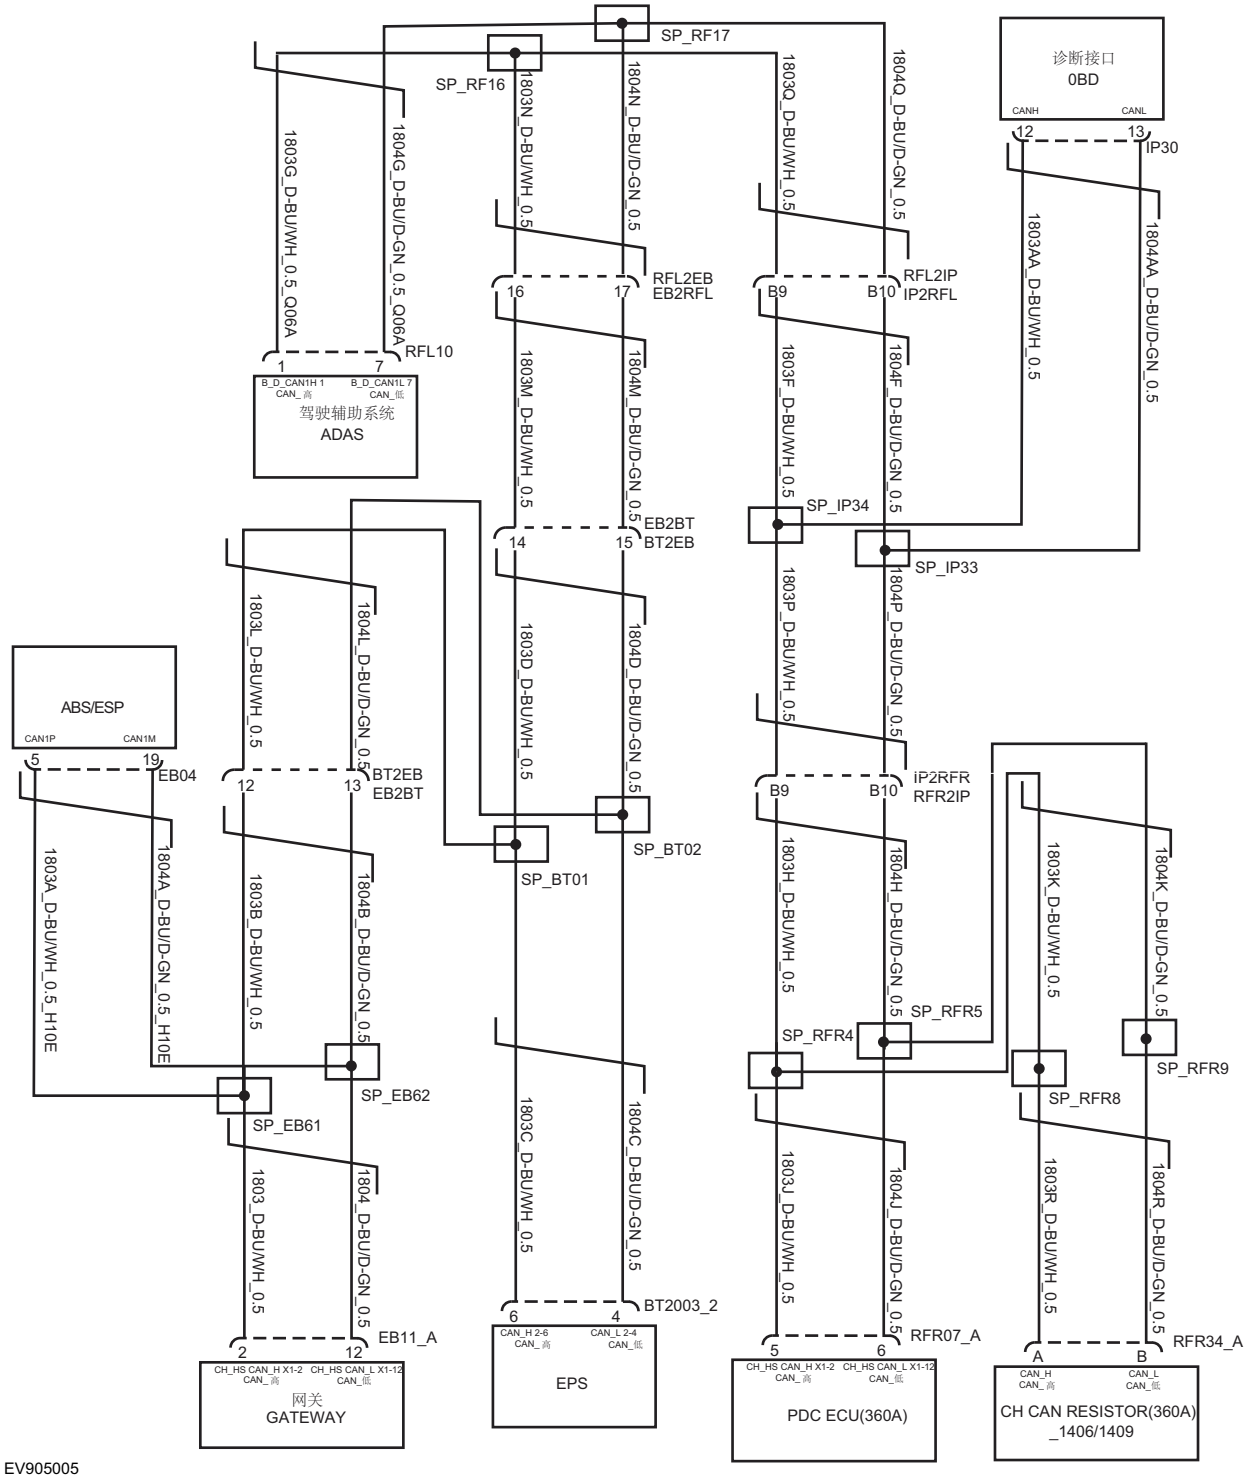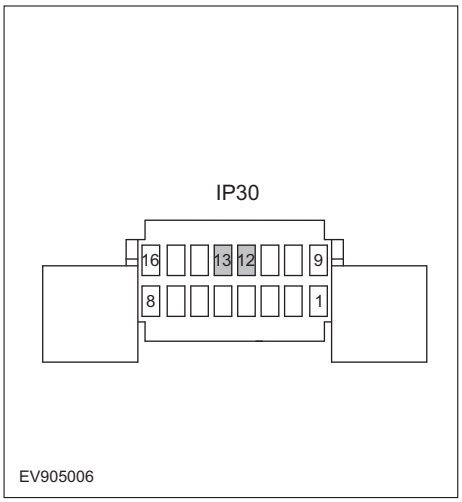

<table>
<tr><td colspan="3">Troubleshooting steps</td></tr>
<tr><td>Step 1</td><td colspan="2">General inspection.</td></tr>
<tr><td colspan="2"></td><td>1 Check the fuse for damage.
2 Check battery capacity.
3 Check the harness plug of DAS for damage, poor contact, aging and looseness.
4 Check whether the result is normal or not?</td></tr>
<tr><td colspan="2"></td><td>NO ➞ Repair or replace the faulted parts.</td></tr>
<tr><td colspan="3">YES ↓</td></tr>
<tr><td>Step 2</td><td colspan="2">Check fault codes.</td></tr>
<tr><td colspan="2"></td><td>1 Connect the fault diagnosis instrument to the diagnosis interface.
2 Turn the ignition switch to ON position.
3 Diagnose the DAS with diagnostic apparatus.
4 If there is any fault code except for U0073-88, U0101-87, U0101-87, U0121-87, B12B4-12、U0126-87、U0140-87、U0155-87、U1D01-81、U1D02-81、U1D03-81、U1D05-81、 U1D09-81?</td></tr>
<tr><td colspan="2"></td><td>YES ➞ Refer to:DTC Summary list(DAS).</td></tr>
<tr><td colspan="3">NO ↓</td></tr>
<tr><td>Step 3</td><td colspan="2">Inspection for CAN communication network completeness.</td></tr>
<tr><td colspan="2"> 
</td><td>1 Turn the ignition switch to OFF.
2 Measure the resistance between the harness terminals of diagnose interface.
Measuring circuit: the resistance between terminal 12 and 13 on plug IP30.
Standard value: ≈ 60Ω
3 Check whether the result is normal or not?</td></tr>
<tr><td colspan="2"></td><td>NO ➞ Repair or replace the faulted parts.</td></tr>
<tr><td colspan="3">YES ↓</td></tr>
</table>

Step 4	Check the terminating resistance of network gateway module and CH resistor.

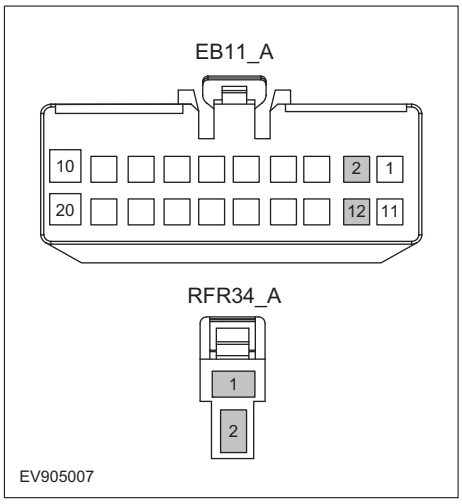

1 Turn the ignition switch to OFF.

2 Disconnect the harness plug EB11_A of network gateway module.

3 Measure the resistance between harness terminals on network gateway module.

Measuring circuit: the resistance between terminal 2 and 12 on plug EB11_A.

Standard value: 110~130Ω

4 Connect the harness plug EB11_A of network gateway module.

5 Disconnect the harness plug RFR34_A of CH CAN resistor.

6 Measure the resistance between the harness terminals of CH CAN resistor.

Measuring circuit: resistance between terminal 1 and terminal 2 on plug RFR34_A.

Standard value: 110~130Ω

7 Check whether the result is normal or not?

NO ➞ Repair or replace the faulted parts.

YES ↓

Step 5	Test whether DAS is norm.

1 Turn the ignition switch to OFF.

2 Disconnect and check the harness plug RFL10 of DAS.

3 Check and repair.

- Corrosion(install new adapting piece or terminal-cleaning module and pin).
- Pin damaged or bent-install new terminal/pin.
- Fly out of pins-install new pins as needed.

4 Reconnect the DAS plug and all other previously disconnected plug. Make sure the pin is properly positioned and fixed.

5 Run the system and determine if the problem persists?

YES ➞ Change the DAS Module

NO ↓

At this point the system is functioning normally. The problem may be caused by module connections. Address the root cause of any connector or pin problems.

Next Step ↓

Diagnosis end.