

P062C、 P215A、 P1725


故障诊断码说明	Fault diagnosis code
P062C-62：参考信号不正确导致车速信号不合理	P062C-62：Vehicle speed implausible due to Refernece Signal Check
P062C-64：车速信号不合理	P062C-64：Plausibility defect for vehicle speed
P215A-02：指示车速信号故障	P215A-02：Fault identifier for Error in vehicle speed from CAN
P215A-08：来自 CAN 总线的车速信号故障	P215A-08：Signal error for vehicle speed over CAN
P1725-F0：来自 CAN 总线的车速信号故障	P1725-F0：Signal error for vehicle speed over CAN
P215A-F0：车轮故障	P215A-F0：Defect fault check for wheel error detection
检测工具	
1 万用表、诊断仪	
故障可能原因	
• 线束或线束插头故障	
电路图说明	
车速信号并不是直接连接到发动机控制模块上，而是 ABS 输出给组合仪表处理后，再通过 CAN 通讯输入给发动机控制模块。	

电路图

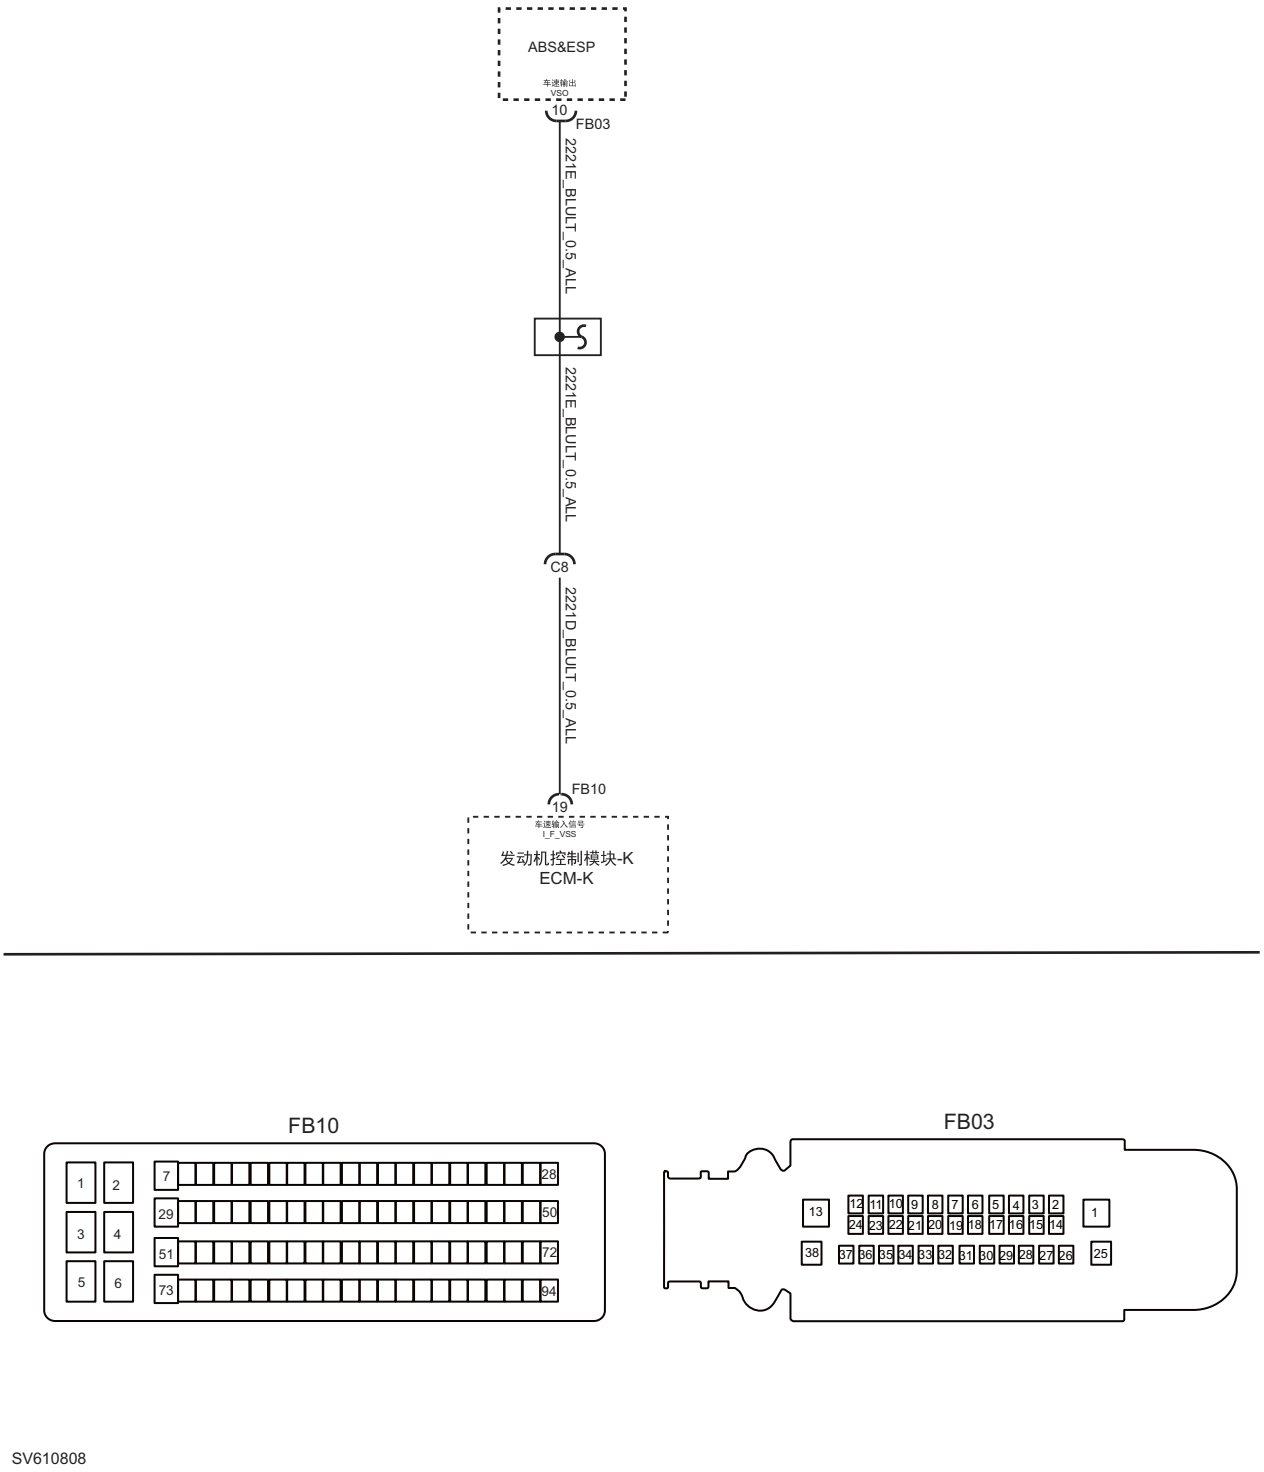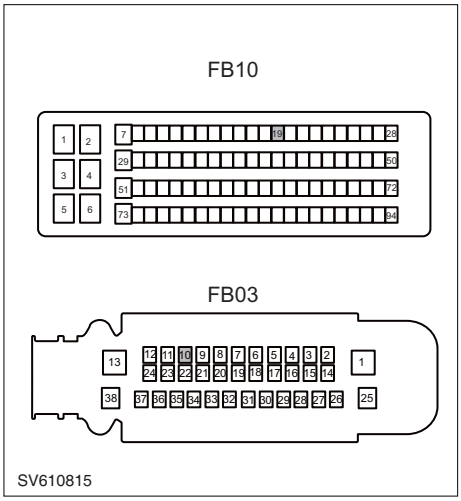

SV610808

故障排除的步骤		
步骤 1	一般检查。	
		1 检查保险丝是否损坏。 2 检查蓄电池电量是否充足。 3 检查发动机控制模块线束插头有无破损、接触不良、老化、松脱现象。 4 检查结果是否正常？
		否 → 维修或更换检测到故障的零件。
是 ↓		
步骤 2	检查故障码。	
		1 连接故障诊断仪至诊断接口。 2 操将点火开关转至 ON 位置。 3 使用诊断仪诊断发动机控制系统。 4 是否有 P062C、 P215A、 P1725 之外的故障码？
		是 → 参见：DTC 总列表 (EU5)。
否 ↓		
步骤 3	检查车速输入信号电路 (开路)。	
		1 将点火开关转至 OFF 位置。 2 断开发动机控制模块线束插头。 3 断开 ABS&ESP 线束插头。 4 测量发动机控制模块线束插头端子与 ABS&ESP 线束插头端子之间的电阻。 测量电路：FB10 插头 19 号端子与 FB03 插头 10 号端子之间的电阻。 **标准值：≈ 0Ω** 5 检查结果是否正常？
		否 → 维修或更换检测到故障的零件。
是 ↓		

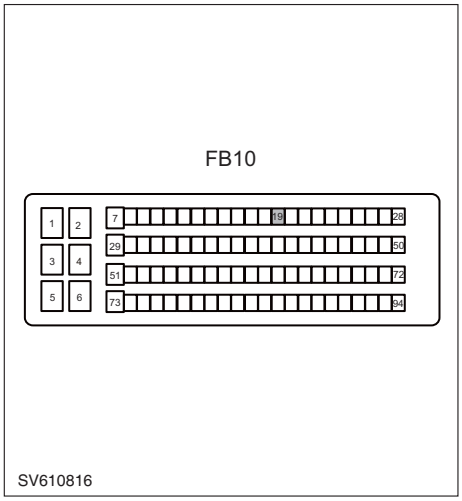步骤 4	检查车速输入信号电路 (短路)。
	1 将点火开关转至 OFF 位置。 2 断开发动机控制模块线束插头。 3 断开 ABS&ESP 线束插头。 4 测量发动机控制模块线束端子与接地之间的电路。 测量电路：FB10 插头 19 号端子与接地之间的电阻。 **标准值：无穷大** 测量电路：FB10 插头 19 号端子与接地之间的电压。 **标准值：≈ 0V** 5 检查结果是否正常？
	否 → 维修或更换检测到故障的零件。
下一步 ↓	
步骤 5	检查结束，确认系统工作正常。