



Service: Full Home Inspection

Prepared for: Patrick De Leon

WIN Inspector

Dominic Van Der Jagt

License No: 1938

✉ dvanderjagt@wini.com

☎ (253) 939-1144

🌐 WIN Home Inspection Auburn

Table Of Content

Inspection Information	3
Explanation Of Terms	4
Summary	6
Full Home Inspection	13
 Exterior	13
 Decks, Balconies, Paved Surfaces	14
 Roof	15
 Garage	18
 Electrical	19
 HVAC	21
 Plumbing	23
 Water Heating Equipment	25
 Interior	26
 Appliances	28
 Fireplace	30
 Structural Components	31
 Insulation And Ventilation	32

Inspection Information

Order Details

Site Address: 11409 107th Pl NE, Kirkland, WA 98033
Service Date And Time: September 01, 2025 At 12:30 PM
Work Order Number: 14895780

Property Details

Approximate Year Built: 1982	Bedrooms: 3
Approximate Square Footage: 1550	Baths: 2.5
Occupied: No	Floors: 2
Main Entry Door Faces: North	

Inspector Details

Name: Dominic Van Der Jagt
License Number: 1938
Contact Number: (253) 939-1144
Email: dvanderjagt@wini.com

Listing Agent

Name: Patrick De Leon
Email: patrick@windermere.com

Present At Inspection: Client

Explanation Of Terms

This report was prepared and written with the age and type of structure taken into consideration. Below is an explanation of the terms used in the report

Action Required

Items marked Action Required appear to be in need of immediate repair or replacement. Delay in repair or replacement may result in a dramatic shortening of the life expectancy of the item, have immediate effect on the item, system, structure, or other related items, or present a potential health and/or safety hazard.

Repairs Recommended

Items marked Repairs Recommended are in need of repair or replacement in order to make the item functional and/or prevent further deterioration.

Attention

Items marked Attention should be monitored or evaluated further. These items may not require immediate repair, but they show signs of wear or minor deficiencies that, if left unaddressed, could develop into more significant issues over time.

Preventive Measures

Items marked Preventive Measure are in need of routine maintenance or service to ensure continued functionality and prevent potential future issues. The inspector may recommend budgeting for this maintenance or obtaining further evaluation from a third-party professional to clarify or assess the condition of the item.

Functional

Items marked Functional appear to be in serviceable condition using normal operating controls. There was no visible indication of failure at the time the services were performed.

Limitation

Items marked limitation have limited access or limited ability to test or inspect fully, We recommend gaining further information on items marked as a limitation from the owner of the property or from a third party.

Not Inspected

Items marked Not Inspected may be present at the time the services were performed and were not inspected due to obstruction, accessibility, visibility, limitation, weather conditions or the inspection of the item is not within the scope of the services performed.

Informational

Items marked informational are included in the inspection as a courtesy or to add information to the customer to help them live in and maintain their home.

Summary

We have identified various items on the subject structure that either require maintenance now or require periodic maintenance in the normal course of ownership. This is only a summary report and is intended as a guide to be used in both short and long term scheduling of maintenance items. Please read the complete report carefully as additional information and details are contained therein. It is always advisable to use experienced tradespeople or a qualified handyperson when contracting for work that may not be within the scope of your capabilities.

Summary

Exterior

1 Fascia Paint 🚧 Repairs Recommended

The fascia boards around the structure are showing wear and require painting to avoid damage to the wood fascia. Recommend a qualified person paint and repair or replace any fascia boards as needed.



Decks, Balconies, Paved Surfaces

2 Concrete Cracking 🚧 Repairs Recommended

Cracking was observed in the concrete walkways and driveways. Cracking in concrete can occur due to various reasons such as shrinkage, settling of the ground, or temperature changes. While some minor cracks may not be a cause for major concern, evaluating the extent and severity of the cracking is recommended to prevent further damage. Contacting a qualified concrete contractor to assess the cracks and determine the best course of action is advised. This may include repairing the cracks to prevent water penetration and potential tripping hazards. Regular maintenance, like sealing the cracks and keeping the surface clean, can help prolong the life of the concrete and minimize further deterioration.



Roof

3 Debris On Roof

▮ Repairs Recommended


There is a small amount of debris on the roof. Leaves, branches, and/or other material that should be removed at some time in the near future. The debris can clog gutters, down spouts and/or drains. Debris can hold moisture that can cause damage to the roof system if large accumulations develop. Debris should be cleaned off the roof surface on an annual basis as a proper care and maintenance recommendation.



4 Maintenance Advised

▮ Repairs Recommended

The gutters need cleaning at this time. There is gutter screen material available on the market that can help keep leaves and other debris out of the gutter system to prevent clogging of the gutters, downspouts, and drain system. The roof also has some buildup of pine needles that needs to be removed. Buildup of debris on the roof can cause premature deterioration of the roofing material. It is recommended to inspect and clean the gutter system and roof surface on an annual basis.

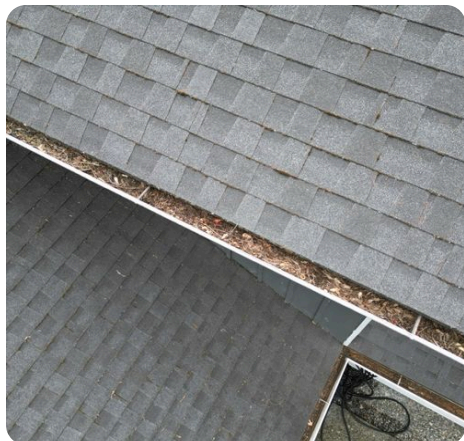

Garage

5 Cracks In Garage Floor

🚧 Repairs Recommended

There are cracks noted in the garage floor. The size of the cracks do not indicate a significant issue at this time. It is recommended to evaluate and repair as needed to prevent further deterioration.



Electrical

6 Electrical Panel Labeling

🚧 Repairs Recommended

The electrical panel lacks full and proper labeling. It is recommended to label all circuits clearly for easier identification and safety purposes.




Interior

7 Install Deadbolt Lock

✚ Repairs Recommended

The door to the garage does not have a deadbolt lock. Adding a deadbolt lock can enhance security and deter unauthorized entry. Installing a deadbolt lock on this door is recommended to safeguard the property. This task can be completed by a qualified locksmith or a professional door installation service.

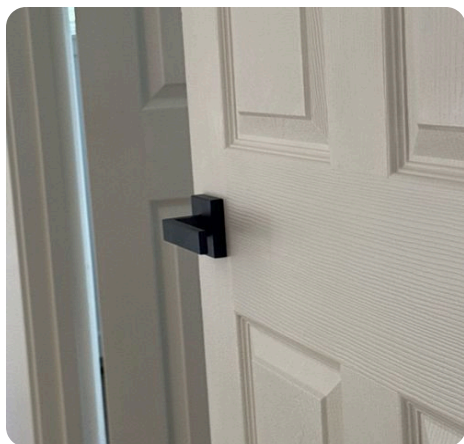

8 Hollow Core Door

✚ Repairs Recommended

The door to the garage is a hollow core door. The door should be a solid core for security and durability. Replacement of the door by a qualified trades person is advised.




Fireplace

9 Flue Cleaning

🚧 Repairs Recommended

The amount of soot and creosote buildup identified in the chimney flue would substantiate cleaning at this time. Contacting a qualified chimney sweeping company to clean and inspect the flue is recommended prior to the first use.

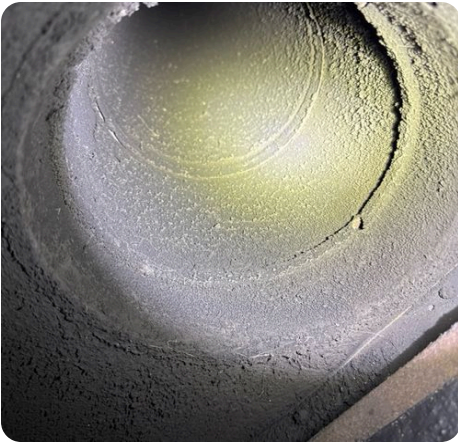

10 Damper Missing

🚧 Repairs Recommended

The fireplace damper was found to be missing at the time of inspection. Recommend contacting a qualified fireplace contractor for repairs and replacement.



Full Home Inspection

Full Home Inspection

1.1 Exterior > Siding and Trim

About the Siding and Trim

Siding Material: Wood

Siding And Trim Evaluation

Informational

It is important to proactively maintain these materials in order to preserve the integrity, weather protection and aesthetics of your home. Regular cleaning, re-painting, and periodic inspections can help prevent damage and ensure the longevity of the exterior surfaces.

1.2 Exterior > Paint/Coating and Caulking

General Maintenance Tips

Informational

Touching up the structure caulking around the tops and sides of the window and door trim, and any openings/gaps is often needed in between paintings. Touching up of all voids is recommended in the fall, prior to the rainy season. The caulking keeps rainwater from penetrating behind the siding material and causing premature deterioration of the material.

1.3 Exterior > Exterior Windows

About the Exterior Windows

Window Type: Dual-Pane, Vinyl

1.4 Exterior > Eaves, Soffits, and Fascia

Fascia Paint

 (Included in Summary)

Repairs Recommended

The fascia boards around the structure are showing wear and require painting to avoid damage to the wood fascia. Recommend a qualified person paint and repair or replace any fascia boards as needed.



1.5 Exterior > Vegetation, Grading, Surface Drainage

Vegetation Recommendations

 Informational

All vegetation should be kept trimmed 12 inches away from the structure to eliminate a common avenue for pest infestation and damage to the exterior structure material. Maintenance of overhanging trees, vines and other plant material is recommended.

Grading Recommendations

 Informational

The grading around the perimeter of the foundation should be maintained to adequately drain excessive surface and roof runoff water away from the structure. Due to the soil type and/or amount of water from surrounding areas, even flat lots may hold water. It is recommended that the grade slope away from the structure at least 6" for the first 6'-10' away from the foundation.

1.6 Exterior > Exhaust Hoods, Vents, and Other Penetrations

Exterior Vents And Penetrations Evaluated

 Functional

The exterior vents and siding penetrations appeared to be in functional condition at the time of the inspection. It is recommended to routinely check and maintain these areas to ensure proper functionality, prevent blockages, damage, and optimize ventilation. Regular visual checks and cleaning can help maintain efficiency and avoid potential issues.

2.1 Decks, Balconies, Paved Surfaces > Deck Installation, Foundation

Structure Installation Evaluated

 Functional

The inspection included checking for proper anchoring, material integrity, and the condition of support beams and footings. No issues with the installation and foundation were noted during the inspection.

2.2 Decks, Balconies, Paved Surfaces > Walkways, Driveway

About the Walkways, Driveway

Address Identification: Visible

Visible: The property's address is visible from the street, facilitating easy location by first responders. It's advisable to verify the visibility of house numbers twice annually to ensure they remain clear.

Concrete Cracking

 (Included in Summary)

 Repairs Recommended

Cracking was observed in the concrete walkways and driveways. Cracking in concrete can occur due to various reasons such as shrinkage, settling of the ground, or temperature changes. While some minor cracks may not be a cause for major concern, evaluating the extent and severity of the cracking is recommended to prevent further damage. Contacting a qualified concrete contractor to assess the cracks and determine the best course of action is advised. This may include repairing the cracks to prevent water penetration and potential tripping hazards. Regular maintenance, like sealing the cracks and keeping the surface clean, can help prolong the life of the concrete and minimize further deterioration.



3.1 Roof > Roof Covering

About the Roof Covering

Pitch: Pitched

Pitched: A pitched roof is characterized by sloped surfaces that meet at an angle, designed to facilitate water runoff and add architectural appeal.

Roof Covering Material: Composition Shingle



Composition Shingle: Asphalt shingles are categorized by their warranty duration, such as 20, 25, 30, 40, and 50 years.

Apparent Number of Layers: 1 Layer

Not A Roof Warranty

 Limitation

The inspector is NOT a licensed roofing contractor, and does not provide a leak-tight guarantee or a warranty for the roof system. The inspector only provides a general condition report on the visible surface areas based on his experience. For a more detailed inspection of the installation and remaining service life of the roof cover, contact a qualified roofing contractor for further review.

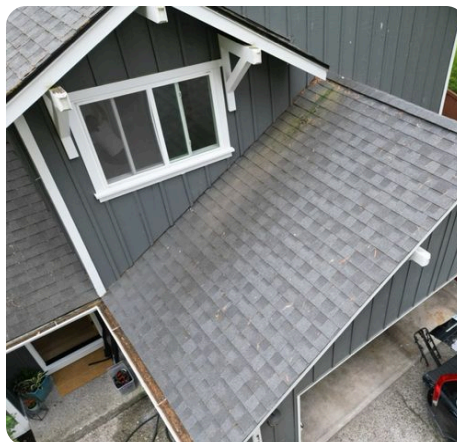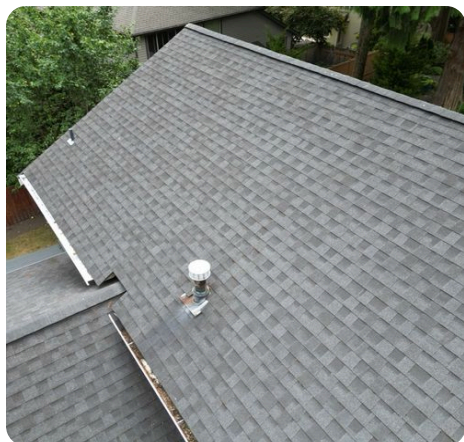



Debris On Roof

 (Included in
Summary)

 **Repairs Recommended**

There is a small amount of debris on the roof. Leaves, branches, and/or other material that should be removed at some time in the near future. The debris can clog gutters, down spouts and/or drains. Debris can hold moisture that can cause damage to the roof system if large accumulations develop. Debris should be cleaned off the roof surface on an annual basis as a proper care and maintenance recommendation.



3.2 Roof > Flashing and Valleys

Proper Care And Maintenance

i Informational

It is recommended that the sealant around any chimney, roof vents, and flashing material be inspected and touched up on an annual basis. Removing any rust and corrosion if present is recommended annually to prevent deterioration and damage. Rainwater leaking into the main structure from the roof is a common and avoidable condition if the roofing system is maintained routinely.

3.3 Roof > Roof Vents and Penetrations

Roof Penetrations Evaluated

✓ Functional

All accessible roof penetrations, such as roof vents, vent covers, and plumbing vents, were inspected and appeared functional.


3.4 Roof > Gutters, Downspouts, and Drainage

Maintenance Advised

 (Included in Summary)

✚ Repairs Recommended

The gutters need cleaning at this time. There is gutter screen material available on the market that can help keep leaves and other debris out of the gutter system to prevent clogging of the gutters, downspouts, and drain system. The roof also has some buildup of pine needles that needs to be removed. Buildup of debris on the roof can cause premature deterioration of the roofing material. It is recommended to inspect and clean the gutter system and roof surface on an annual basis.

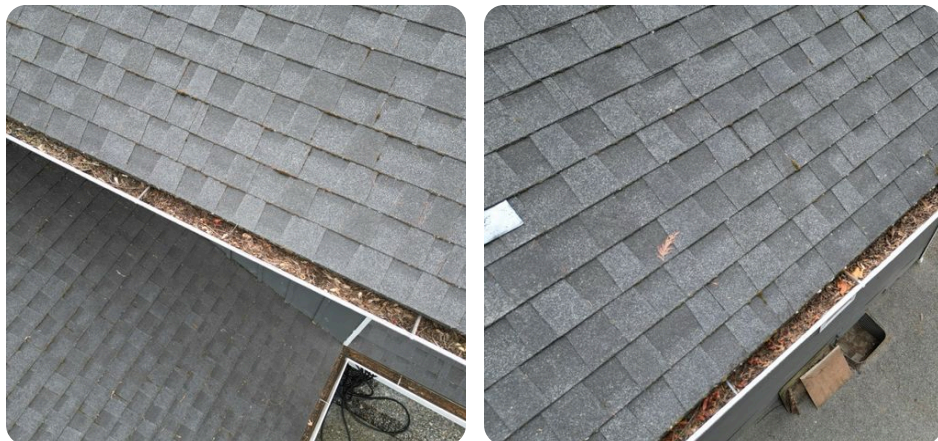

3.5 Roof > Evaluation Method

About the Evaluation Method

Method of Inspection: Drone

4.1 Garage > Garage Vehicle Door

About the Garage Vehicle Door

Size of Garage: 2 Car

Garage Vehicle Door Evaluated

✓ Functional

The garage door was inspected and appeared to be functional at the time of the inspection.

4.2 Garage > Garage Door Opener and Safety

Maintenance Recommendations

i Informational

Periodic inspections, greasing, adjustments, and tightening of brackets are suggested as part of normal preventative maintenance. We recommend contacting the manufacturer or an overhead door company for proper installation and maintenance questions.

4.3 Garage > Fire Separation

Firewall Protection

i Informational

All openings of more than 1/8" are recommended to be sealed to maintain a proper firewall barrier.

4.4 Garage > Garage Floor and Surfaces

Cracks In Garage Floor

(Included in
Summary)

🔧 Repairs Recommended

There are cracks noted in the garage floor. The size of the cracks do not indicate a significant issue at this time. It is recommended to evaluate and repair as needed to prevent further deterioration.



5.1 Electrical > Service Entrance and Grounding

About the Service Entrance and Grounding


Main Service: Underground

Main Service Conductor: Multi-Stranded Aluminum

Service Entrance And Grounding Evaluated

✓ Functional

The service entrance components and grounding system were in serviceable condition at the time of the inspection.

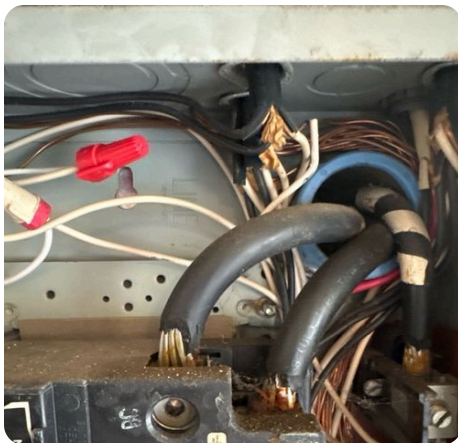

5.2 Electrical > Main Service Panels and Disconnects

About the Main Service Panels and Disconnects

Main Panel Location: Garage

Main Panel Capacity: 200 amps/240 Volt

Service Panels Evaluated

Informational

The service panels and main disconnects have been evaluated and covers removed.

Electrical Panel Labeling

(Included in Summary)

Repairs Recommended

The electrical panel lacks full and proper labeling. It is recommended to label all circuits clearly for easier identification and safety purposes.



5.3 Electrical > Interior Components of Main Service Panels




About the Interior Components of Main Service Panels

Panel Cover Removed: Yes

Interior Components Evaluated

Functional

The interior components of the service panels were evaluated during the inspection, and they were found to be in working condition. It is always recommended to conduct regular maintenance and/or evaluation on the electrical panels to ensure continued performance.

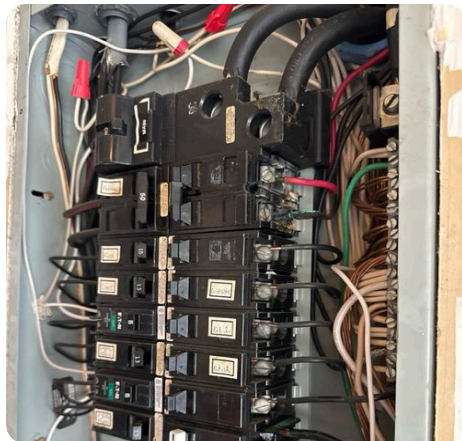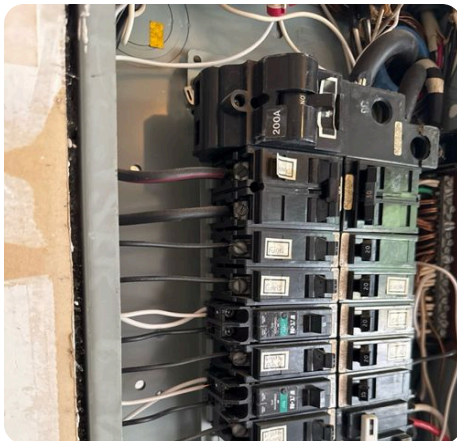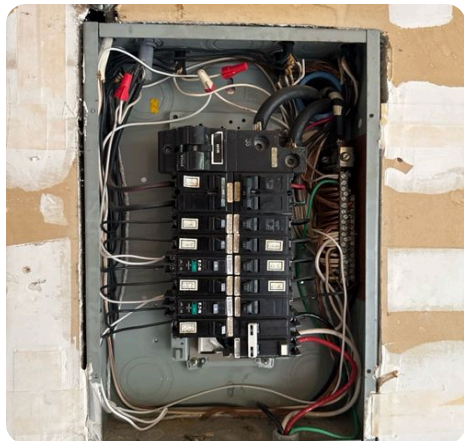

5.4 Electrical > Breakers/Fuses

Over Current Protection Devices Evaluated

✓ Functional

The overcurrent protection devices in the electrical system were evaluated and found to be without visible flaws. It is essential to ensure these devices are kept in good working condition to protect the electrical system from overloads and short circuits. Note: The inspector does not operate or physically test any of the breakers during this visual examination.

5.5 Electrical > Wiring

About the Wiring

Wire Type: Non-Metallic Sheathed (Romex)


Wire Material: Copper, Multi-Strand Aluminum

5.6 Electrical > GFCIs

GFCI Recommendation

i Informational

The current electrical code requires that ground fault circuit interrupters (GFCI) be located in areas with a potential danger of electrical shock (living spaces and internal rooms, garages, exterior outlets, etc.) The year the requirement was adopted for GFCI outlet installation varied for specific areas of the structure. As a safety upgrade, we recommend that GFCI outlets be installed in all areas susceptible to moisture.

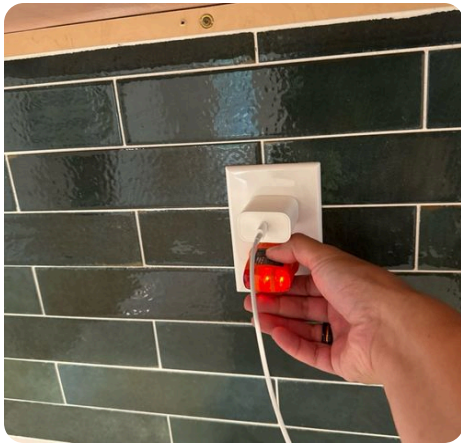

5.7 Electrical > Fixtures, Switches, and Receptacles

Visual Inspection

i Informational

The condition of the outlets, switches, and junction boxes that were visible and accessible at the time of the inspection, were evaluated. Electrical outlets are recommended to be replaced if cracked/damaged to prevent arcs which might be caused by a worn outlet. Occupied homes often have furniture and stored items covering electrical outlets, switches, and junction boxes that limit their accessibility.

6.1 HVAC > Heating Equipment

About the Heating Equipment

Location of Heating System: Garage

Heating Method: Forced Air

Heating System Energy Source: Natural Gas


Approximate Manufactured Date of Heating System: 2006

Service Notes: None Visible

Heating System Average Life Expectancy

i Informational

The average life expectancy of a heating system is approximately 15-25 years depending on the type and maintenance of the system. If the system is near or over this life span, consideration into saving for a replacement or a more efficient model, should be considered. The inspector is not required to remove flame guards or view/identify the condition of the heat exchanger. This inspection checks on the general function of the heating system and in no way guarantees any mechanical components for useful life, serviceability, or efficiency. It is also recommended you contact an HVAC company annually, or as needed, to perform servicing and maintenance on the unit.

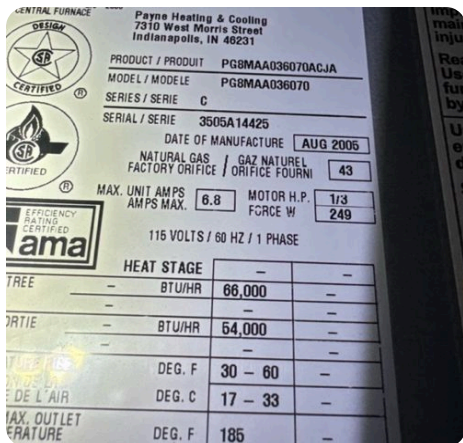



6.2 HVAC > Thermostats and Controls

Generally Serviceable

✓ Functional

The thermostats and controls appeared to be serviceable at the time of inspection.

7.1 Plumbing > Water Supply and Piping

About the Water Supply and Piping

Structure Pipe Material: Copper

Incoming Water Line Pipe Material: Copper

Water Source: Public

Water Supply System Evaluated

✓ Functional

The water supply and piping were found to be functional during the inspection, with no visible signs of leaks or damage. To maintain the plumbing system's efficiency and prevent potential issues, regular maintenance and periodic inspections by a qualified professional are strongly recommended.

7.2 Plumbing > Main Water Shutoff

About the Main Water Shutoff

Water Meter Location: Near Street, Front of House

Water Shutoff Location: Garage

Generally Serviceable

✓ Functional

The main water shutoff appeared to be serviceable at the time of inspection.



7.3 Plumbing > Drain, Waste, and Vent Systems

About the Drain, Waste, and Vent Systems

Waste Pipe Material: ABS, PVC

Main Sewer Clean-Out Location: Garage

Sewer Type: Public

Plumbing Drainage System Evaluated ✓ Functional

The visible portions of the plumbing drain, waste, and vent system were inspected and found to be in proper working condition, with no signs of leaks or blockages observed. To ensure continued functionality and avoid potential issues, regular maintenance and periodic inspections by a qualified professional are recommended.

7.4 Plumbing > Fuel Supply

About the Fuel Supply

Fuel Service: Natural Gas

Natural Gas: Gas line inspections are typically conducted only if problems are suspected. Corrosion on visible lines should prompt an inspection by the utility provider.

Fuel Shut Off Location: At Gas Meter and Appliances

7.5 Plumbing > Toilets

Toilets Inspection General Information i Informational

The toilets were flushed and inspected for cracks, leaks, and serviceability. The toilets should be inspected periodically for indications of cracking in the toilet bowl, tank, or base. Also, periodic replacement of flapper valves and water towers should be expected as typical homeowner maintenance.

7.6 Plumbing > Tubs, Showers, and Fixtures

Plumbing Fixtures Maintenance Information i Informational

Routine preventive maintenance and/or replacement of fixtures is needed periodically. Faucets and valves have a typical life expectancy of 5-15 years. General wear, depending on the quality of fixture, is expected. Preventative measures, such as the installation of a soft water or water conditioning unit is recommended.

Water Exposed Areas

i Informational

Routine preventive maintenance should include applying and maintaining caulking in and around tubs and shower surrounds to prevent moisture penetration behind tub and shower wall/floor cover materials.

7.7 Plumbing > Sewage Ejectors, Sump Pumps, and Piping

Sump Pump

✓ Functional

The sump pump installed at the property appeared to be serviceable at the time of inspection. Periodic inspections of the sump pump are recommended. It is recommended to keep the bottom of the sump pit free of debris that can clog the intake ports of the pump and checking the pump discharge line after heavy rain for proper drainage. Consideration should be given to a backup pump and/or battery backup for power failures if the pump cycles on and off frequently during damp periods. This inspection is not an assurance that the sump pump will continue to work in the future. Sump pumps can fail at any time.

8.1 Water Heating Equipment > Water Heater

About the Water Heater

Water Heater Location: Garage

Water Heater Type: Gas

Water Heater Capacity : Approximately 40 Gallons

Approximate Manufactured Date of Water Heater: 2018


Approximate Water Temperature: Under 120 Degrees

Seismic Strapping: Yes

Water Heater

i Informational

The water heater was visually inspected. The life expectancy of a water heater is typically 8-12 years from the date of installation, although there are exceptions on both sides. As a preventative maintenance recommendation, the water heater should be drained periodically to remove sediment buildup in the tank. The recommended setting for a residential water heater is under 120 degrees Fahrenheit. for safety.

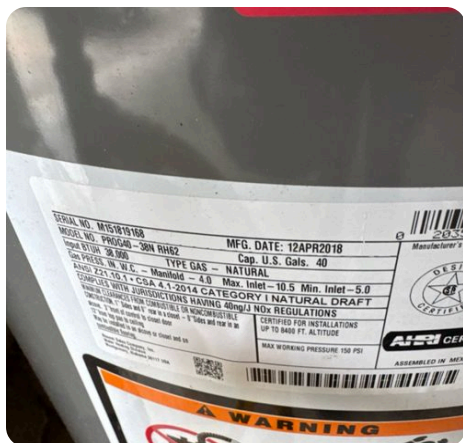

8.2 Water Heating Equipment > TPR Valve/Discharge Pipe

TPR Valve And Discharge Pipe

✓ Functional

The water heater's temperature/pressure relief valve is equipped with an approved discharge pipe. The pipe serves the purpose of preventing someone from being sprayed with scalding water in the event that the valve were to discharge. These components were in satisfactory condition at the time of the inspection.

9.1 Interior > Walls, Ceilings, and Floors

Interior Walls Functional

✓ Functional

The interior walls, ceiling, and flooring were inspected and there did not appear to be any major deficiencies. There may be areas of minor cracking of drywall seams and nail pops at the wall/ceiling junctions that are not of structural concern. Caulking and repainting to address these conditions is recommended. Contact a qualified professional to perform this maintenance. This reporting does not comment on whether interior finishes are square, straight, level, or plumb.

9.2 Interior > Steps, Stairways, and Railings

Interior Stairways, And Components Evaluated

✓ Functional

The interior stairway and its associated components were found to be in satisfactory condition at the time of inspection. All steps, handrails, and railings were secure and functional, with no signs of significant wear or damage.


9.3 Interior > Doors

Install Deadbolt Lock

(Included in Summary)

✚ Repairs Recommended

The door to the garage does not have a deadbolt lock. Adding a deadbolt lock can enhance security and deter unauthorized entry. Installing a deadbolt lock on this door is recommended to safeguard the property. This task can be completed by a qualified locksmith or a professional door installation service.

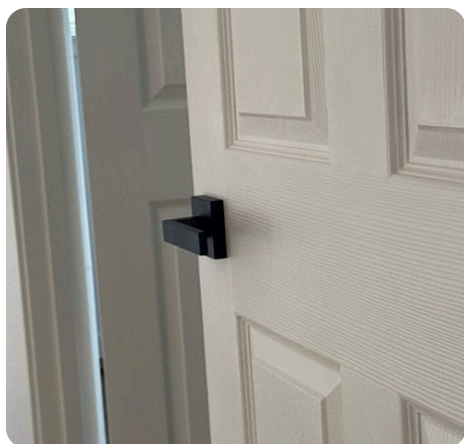


Hollow Core Door

(Included in Summary)

✚ Repairs Recommended

The door to the garage is a hollow core door. The door should be a solid core for security and durability. Replacement of the door by a qualified trades person is advised.

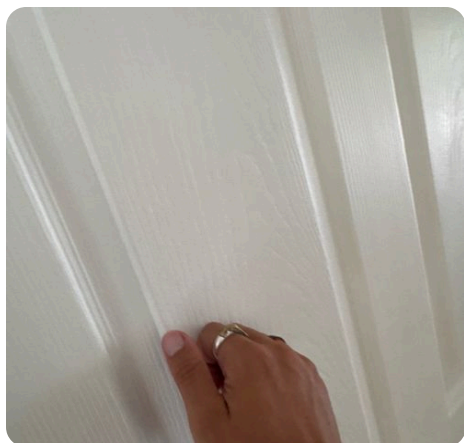

9.4 Interior > Smoke Alarms

Smoke Alarm Information

Informational

Determining the functionality of smoke detectors is outside the scope of this inspection as the units should be checked monthly. Any unit greater than 10 years of age should be replaced as they are considered to be at the end of their service life. Functional smoke/fire detectors are recommended inside and outside each sleeping area for increased safety awareness.

9.5 Interior > Carbon Monoxide Alarms

Carbon Monoxide Alarms Present

Functional

The carbon monoxide alarms are installed in the appropriate locations throughout the property. It is recommended to regularly test and replace the batteries in the alarms to ensure they are functioning properly. In case of any malfunction or consistent beeping, evaluate and repair as needed to maintain safety.

9.6 Interior > Caulking, Grout, and Enclosures

Caulking, Grout & Enclosures Evaluated

Functional

The caulking, grout, and enclosures in wet areas were evaluated for signs of cracking, wear, and general deterioration. The inspected areas were found to be intact and functional, showing no immediate need for repair.

9.7 Interior > Windows

Window Seals

Informational

A visual inspection of the windows may not detect seals that have failed between the panes of glass or other issues, such as deficiencies in UV coatings or films. These issues are often only visible under specific climatic or lighting conditions. Additionally, during a home inspection, it may not be possible to thoroughly examine all windows or seals due to obstructions such as furnishings, window coverings, debris, or films on the glass. If there are concerns about the windows, we recommend having all windows professionally cleaned and/or re-inspected to ensure their condition is thoroughly evaluated.

9.8 Interior > Additional Information

Mold Disclaimer

i Informational

The inspector is not a qualified mold inspector or expert in bio-organic growth. We are not qualified to inspect, identify, or give opinions regarding molds or airborne agents. Many times, the presence of mold is not readily visible and can appear in a short period. If the residence is vacant, leaks have occurred, past or present evidence of sub-area moisture/dampness, and/or heat has been turned off to the home, molds may be present. This inspection is limited to visible and accessible areas at the time of the inspection. To determine what types of bio-organic agents may be located at the property, we recommend you hire a certified mold inspection company for further evaluations and/or to conduct a thorough inspection before closing.

Asbestos General Statement

i Informational

The scope of this inspection does not include an asbestos-in-material sampling and/or identification inspection. Houses built before or near 1978 may contain this material in certain substrates (drywall, flooring, acoustic texture, etc.) or building materials (exhaust pipes, insulation, heat registers, etc). If there is a concern, we recommend you contact an appropriate testing facility for further evaluation.

Furniture/Storage General Statement

🔍 Not Inspected

Note that furniture, storage, and personal items were not moved by the inspector during the inspection. It is recommended to inspect all areas when vacant, as part of the final walk-through process.

10.1 Appliances > Stove, Cooktop

About the Stove, Cooktop

Energy Source: Electric

Cooktop Tested

✓ Functional

An on / off test was performed to determine if the cooktop was functioning. Periodic cleaning and maintenance is recommended for continued use.



10.2 Appliances > Oven

About the Oven

Energy Source: Electric

Oven On/Off Tested

✓ Functional

The bake and broil cycles were functional at the time of the inspection. This is an on/off test conducted on the oven.



Oven General Statement

 Informational

Timers, clocks, convection fans, and self-cleaning systems are not tested and are beyond the scope of a home inspection.

10.3 Appliances > Dishwasher

Dishwasher Tested

 Functional

The dishwasher was tested and appears to be working. A simple on/off check of the dishwasher was performed to determine if it was operational. A full cycle check is often not possible at the time of this inspection; therefore, we cannot comment on the full extent of its functions or its ability to clean. The average life of a dishwasher is 8-12 years. Periodic cleaning of the interior filters is required to extended use.

10.4 Appliances > Refrigerator

Refrigerator Evaluated

 Functional

The interior of the refrigerator and freezer were cold when opened and functional at the time of inspection.



10.5 Appliances > Microwave

Microwave Tested ✓ Functional

This is an on/off test conducted on the microwave oven. The unit was functional at the time of inspection.

10.6 Appliances > Garbage Disposal

Garbage Disposal Tested ✓ Functional

The garbage disposal was on/off tested and found functional. The unit was not tested to determine if it could grind food. The typical life expectancy of a garbage disposal is 7-15 years.

10.7 Appliances > Washer, Hookups, and Drains

Washer General Statement i Informational

The washing machine was spot tested. The inspector does not run the clothes washer or drain water. We recommend you ask the current owner if the drain is working properly, or if any past or present issues exist.

10.8 Appliances > Dryer and Vent System

About the Dryer and Vent System

Dryer Energy Source: 240 V Electric

240 V Electric: Proper wiring or power to the 240v outlet cannot always be detected without the removal of the cover plate. The inspector will try using a voltage detector if the outlet is easily accessible.

Dryer Vent Recommendations i Informational

The entire dryer ventilation system is often not completely visible for examination. We recommend the dryer ventilation system be cleaned periodically. A build-up of debris can be a safety hazard if left unchecked. Recommend checking with the seller regarding the last time the vent ducting has been cleaned. If it has not been cleaned recently, I recommend contacting a qualified professional to clean the ducting prior to use.

11.1 Fireplace > Flues and Dampers

Visual Inspection i Informational


Only the firebox, damper, and visible portions of the chimney system are checked for obvious defects. This inspection in no way qualifies as a certification or determines the chimney system as being safe and/or functional. We recommend the system be thoroughly inspected by a qualified chimney contractor prior to use.

Flue Cleaning

 (Included in Summary)

 Repairs Recommended

The amount of soot and creosote buildup identified in the chimney flue would substantiate cleaning at this time. Contacting a qualified chimney sweeping company to clean and inspect the flue is recommended prior to the first use.

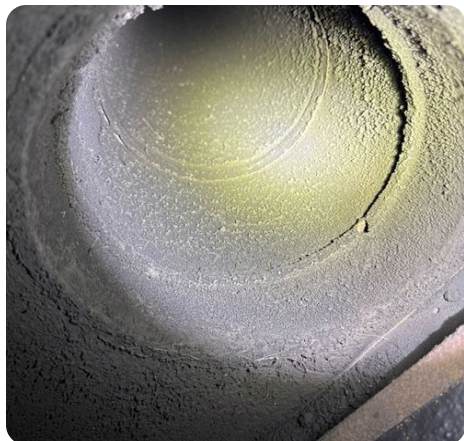

Damper Missing

*(Included in
Summary)*

Repairs Recommended

The fireplace damper was found to be missing at the time of inspection. Recommend contacting a qualified fireplace contractor for repairs and replacement.



12.1 Structural Components > Foundation and Slab

About the Foundation and Slab

Foundation Type: Raised Foundation/Crawlspace

Foundation/Slab Evaluated

Functional

The foundation/slab was visually assessed during the inspection and appeared to be in functional condition with no immediate concerns noted. As part of routine maintenance, we recommend regularly monitoring the foundation for any signs of cracks, shifting, or water intrusion to address potential issues promptly and ensure long-term structural integrity.

12.2 Structural Components > Joists and Framing

About the Joists and Framing

Wall Structure: Wood

Floor Structure: Wood

Ceiling Structure: Wood Framing

12.3 Structural Components > Roof Structure and Attic Components

About the Roof Structure and Attic Components

Roof Structure Type: Trusses

13.1 Insulation and Ventilation > Insulation and Ventilation in Attic

About the Insulation and Ventilation in Attic

Attic Access Location: Upstairs Hallway, Hall

Attic Evaluation Method: Head and Shoulders

Head and Shoulders: The Inspection was limited to at or near the attic entrance due to access issues.




Insulation Type: Blown-In Cellulose



Attic Insulation Approximate Depth: 6-12 Inches

Insulation And Ventilation Evaluated

✓ Functional

The insulation depth and material were inspected. Additionally, passive ventilation in the area appears satisfactory.

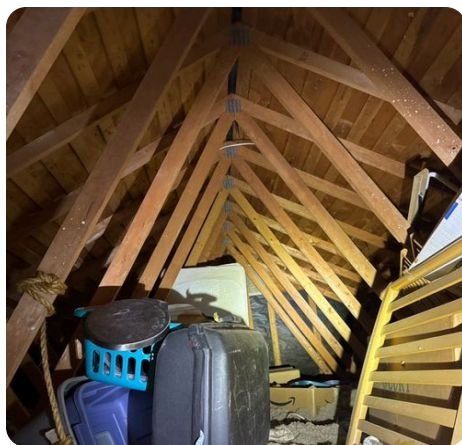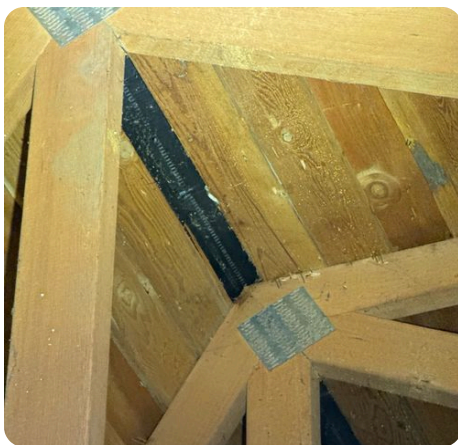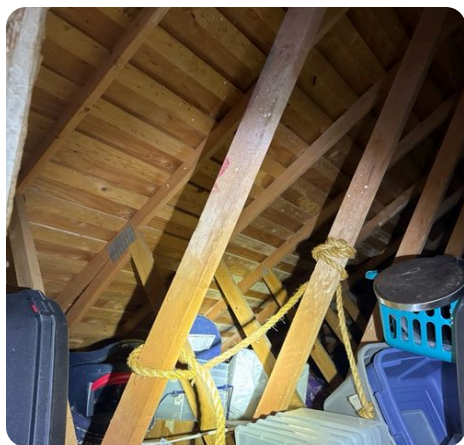

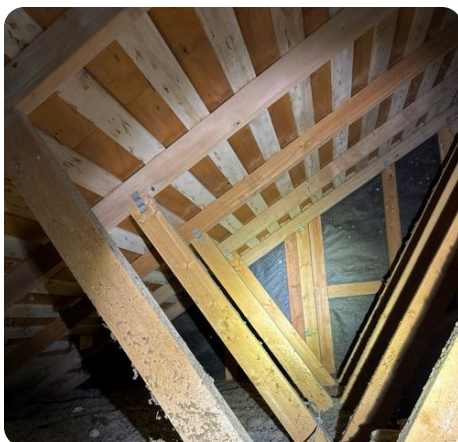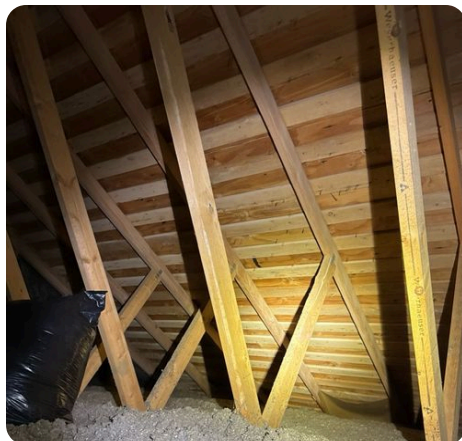

13.2 Insulation and Ventilation > Insulation and Ventilation in Crawl Space

About the Insulation and Ventilation in Crawl Space

Crawl Space Evaluation Method: Entrance

Entrance: The accessible areas of the crawl space were entered and evaluated at the time of the inspection.

Crawl Space Access Location: Exterior

Lack Of Insulation In Crawlspace

i Informational

The crawlspace does not have any insulation present. Insulating the crawlspace is essential to improve energy efficiency, maintain consistent indoor temperatures, and prevent issues such as frozen pipes. It is recommended to evaluate and install proper insulation by a qualified insulation contractor.



13.3 Insulation and Ventilation > Vapor Barriers

Periodic Inspections

 Informational

Vapor barriers prevent moisture from evaporating in a manner that may cause microbial growth and/or wood damage when installed properly. Periodic inspections of the sub-area for moisture and/or dampness are recommended.