A run that shared the machine with other simulations swung into a 45° roll; runs alone never did

Leg 2 of the 50 m square at 5 m/s, no wind, the same profile in both. A sway of about 1 Hz appeared 1.5 s before braking and peaked once the pusher cut out. Beside other simulations 6 of 11 squares wobbled like this, alone 0 of 13: Gazebo does not wait for PX4, so a busy machine delays the motor commands. It is an artefact of the simulation, not of the vehicle.

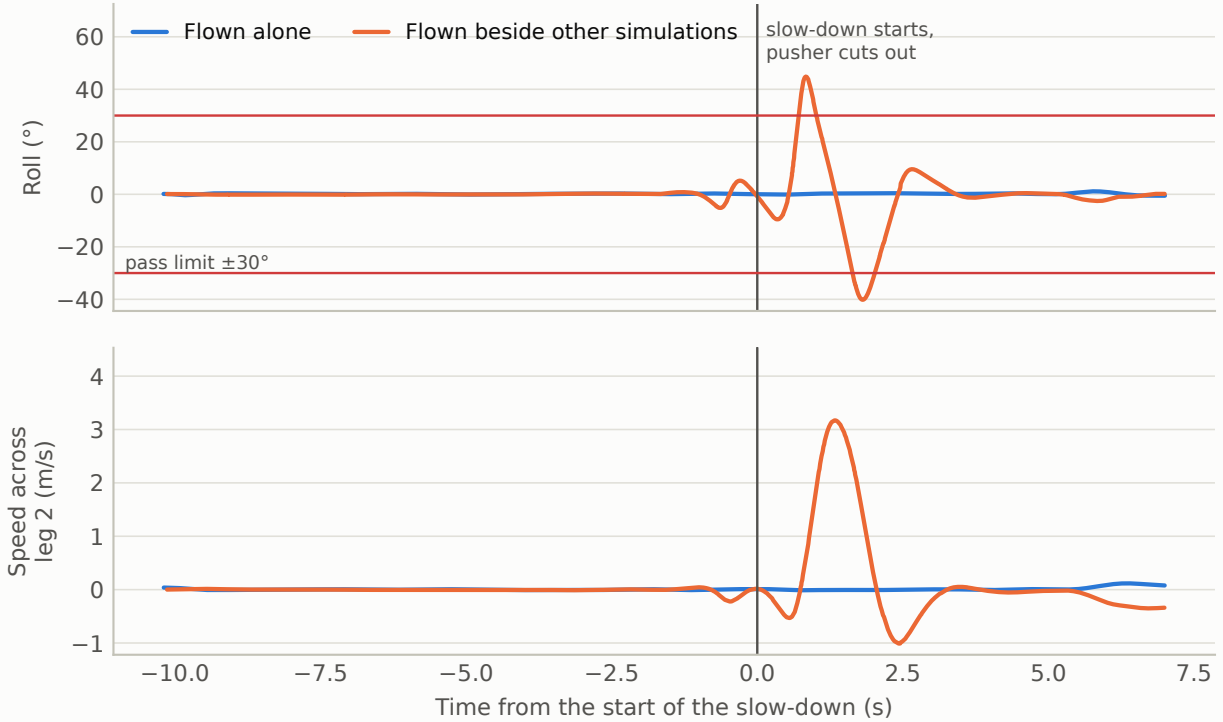

PX4 v1.17.0 SITL with Gazebo and assumed vehicle coefficients; simulation, not flight data.