AIRFIELD AUDIT & GROUND INSPECTION REPORT

Formal Non-Conformance Notice & Spoken Spoken Briefing Dossier • St. Exupéry Aerodrome (LFSE)

AERODROME	AUDIT SCOPE	LEGAL AUTHORITY	INSPECTORATE TEAM
St. Exupéry Int'l (LFSE)	**Apron, RGL & GSE Staging**	**Reg. (EU) 139/2014 Part-ADR**	**Lead Inspector P. PARRIS & Team**

1. STATUTORY FRAMEWORK: LEVEL 1 VS. LEVEL 2 NON-CONFORMANCE

PART-ADR.AR.C.055

Under European Commission Regulation (EU) No 139/2014 (Part-ADR.AR.C.055), aerodrome inspectors identify, document, and categorize safety deficiencies into two distinct levels based on the immediate risk to flight and ramp operations:

LEVEL 1 FINDING — Critical Hazard

Definition: Any significant non-compliance which lowers safety or seriously hazards aircraft operations.

Enforcement: Immediate prohibition or restriction of the aircraft stand, taxiway, or operation until urgent corrective measures eliminate the danger.

LEVEL 2 FINDING — Systemic Issue

Definition: Any non-compliance which could lower safety or hazard aircraft operations if left uncorrected.

Enforcement: Formal 30-day corrective action plan (CAP) required. Failure to correct within deadline elevates finding to Level 1.

2. EXECUTIVE SUMMARY OF AUDIT OBSERVATIONS

3 FIELD INSPECTIONS

FINDING ID	LOCATION	REGULATORY STANDARD	CLASSIFICATION	OBSERVED PHYSICAL CONDITION
FIND-01	Stand 14 (Apron)	ADR.OPS.B.010 / 025	Level 1 Finding	Uncontained Jet A-1 kerosene spill (42 m²) actively flowing towards unprotected stormwater drain (8.2 m). Absence of booms.
FIND-02	Holding Point B2	CS-ADR-DSN.M.710	Level 2 Finding	Elevated Runway Guard Lights obscured by 650 mm overgrown airfield grass; yellow flasher beam intensity reduced by ~60%.
FIND-03	Stand 12 Staging	ADR.OPS.B.016	Level 2 Finding	Complete absence of magnetic FOD bins in high-density GSE staging zone; metallic safety wire offcuts within 12 m of stand.

INSPECTORATE SPOKEN INSTRUCTION FOR WORKING GROUPS:

Student teams will review one finding in detail on the following pages, analyze the CAD schematic, use past modal deductions (*must have*, *could have*, *should have*) to deduce how the deficiency occurred, and deliver a formal 2-minute oral audit debrief to the Airport Director.

1. PHYSICAL NON-CONFORMANCE OBSERVATION

CRITICAL FIRE & ENVIRONMENTAL THREAT

At 09:42 local time during turnaround servicing of an Airbus A330 on Stand 14, inspectors observed an active fuel spill of Jet A-1 kerosene surrounding fuel hydrant pit HP-14. The spill expanded across approximately 42 square meters of concrete apron pavement, directly invading the aircraft servicing zone.

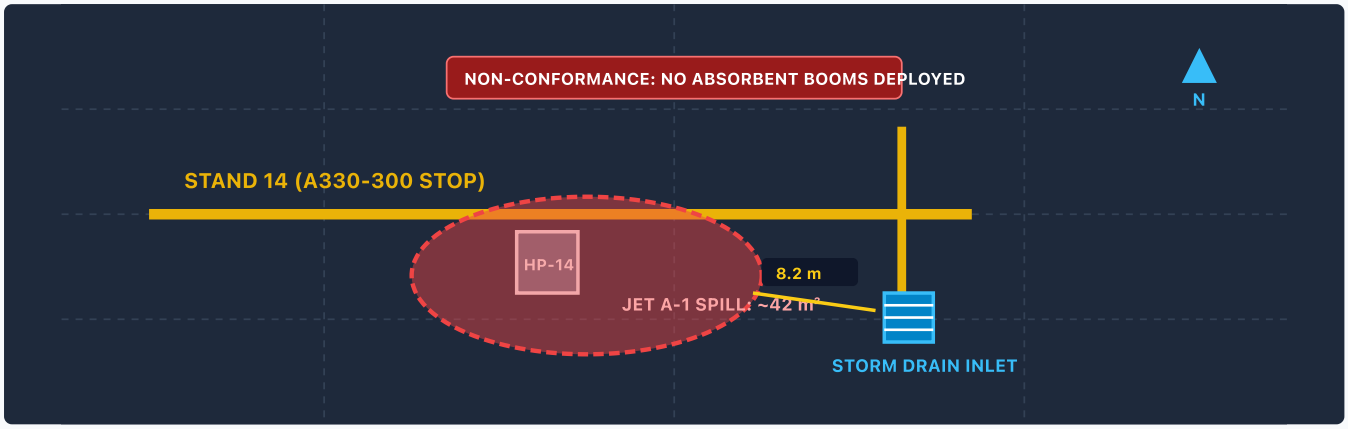


EXHIBIT 1.1: STAND 14 LAYOUT SHOWING JET A-1 FUEL SPILL PERIMETER & CRITICAL PROXIMITY TO UNSEALED STORM DRAIN

2. REGULATORY VIOLATIONS & IMMEDIATE HAZARD

ENVIRONMENTAL & IGNITION RISK

- **Point ADR.OPS.B.010:** Failure to maintain fuel servicing equipment in a safe, leak-free condition; deadman control mechanism was jammed with an unauthorized wire wedge.
- **Point ADR.OPS.B.025:** Uncontained fuel was actively migrating toward the unprotected storm drain (8.2 meters away), presenting an immediate risk of hydrocarbon contamination to the local water table.
- **Absence of First-Response Gear:** Neither the refueling bowser crew nor the handling agent deployed pneumatic drain covers, absorbent granules, or containment booms.

SPEAKING FOCUS: PAST MODAL DEDUCTIONS & CAUSAL ANALYSIS

- *"The fuel handler **must have jammed** the deadman valve to avoid holding it manually during the high-pressure uplift."*
- *"The kerosene **could have entered** the main river catchment if the inspector had not ordered the emergency drain plug."*
- *"The ramp supervisor **should have inspected** the hydrant coupling before authorizing fuel flow."*

FIELD AUDIT EXHIBIT 02 • OBSCURED RUNWAY GUARD LIGHTS (RGL)

CS-ADR-DSN.M.710 • TAXIWAY BRAVO 2 HOLDING POSITION RUNWAY 08L

LEVEL 2 FINDING

30-Day Corrective Action Issued

1. PHYSICAL NON-CONFORMANCE OBSERVATION

RUNWAY INCURSION PROTECTION DEGRADED

During twilight taxiway visual checks at 18:15 local time, inspectors evaluated the elevated Runway Guard Lights (Configuration A flasher units) installed on Taxiway Bravo 2 adjacent to the Runway 08L holding position line. Overgrown wild grasses and weeds reaching up to 650 mm in height severely obscured the yellow alternating light beams.

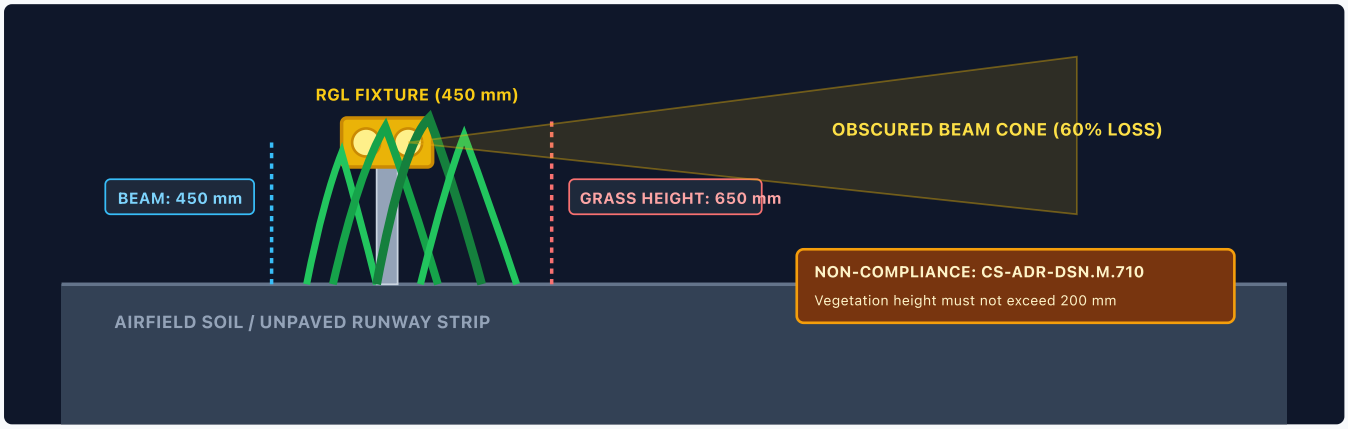


EXHIBIT 2.1: ELEVATION PROFILE OF TAXIWAY B2 RUNWAY GUARD LIGHT OBSCURATION BY UNMAINTAINED AIRFIELD VEGETATION

2. REGULATORY VIOLATIONS & SAFETY CONSEQUENCES

INCURSION HOT SPOT RISK

- **CS-ADR-DSN.M.710:** Runway guard lights must remain fully conspicuous and unobstructed to warn taxiing flight crews that they are approaching an active runway crossing point.
- **Point ADR.OPS.B.015:** The aerodrome operator's groundskeeping and grass-cutting regime failed to maintain unpaved runway strips within the certified maximum vegetation threshold of 200 mm.
- **Human Factors Hazard:** Flight crews taxiing under night or low-visibility conditions are deprived of the high-intensity yellow flashers, increasing the risk of inadvertent runway incursions.

SPEAKING FOCUS: PAST MODAL DEDUCTIONS & MAINTENANCE FAILURES

- *"The maintenance team **must have missed** Taxiway Bravo 2 during their scheduled bi-weekly mowing cycle."*
- *"A taxiing Boeing 737 **could have crossed** the stop line inadvertently if the flight crew was distracted."*
- *"The airfield safety officer **should have caught** the overgrown vegetation during morning runway inspections."*

1. PHYSICAL NON-CONFORMANCE OBSERVATION

ENGINE INGESTION HAZARD

Inspectors conducted a ramp walkaround of the Equipment Staging Area (ESA) serving Stand 12. The mandatory covered, magnetized FOD disposal receptacle was completely missing. Loose metallic lockwire offcuts, sheared bolt heads, and loose baggage stretch-wrap were strewn across the apron within 12 meters of an operating aircraft engine ingestion hazard zone.

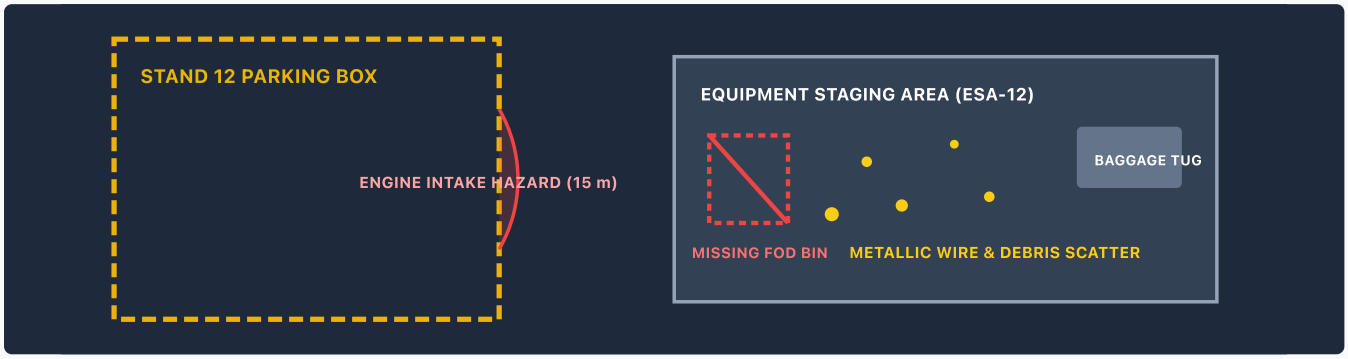


EXHIBIT 3.1: STAND 12 STAGING AREA LAYOUT SHOWING UNCONTAINED FOD SCATTER IN PROXIMITY TO ENGINE INGESTION HAZARD ZONE

2. SPOKEN TASK: FORMAL 3-BULLET AUDIT NOTICE TO AIRPORT DIRECTOR

SPEAKING ASSESSMENT TEMPLATE

Working in your assigned inspection pairs/trios, synthesize your group's finding and deliver a concise 2-minute oral audit debrief addressing the Airport Director using this professional 3-bullet structure:

- **Bullet 1 (Finding Classification & Location):** *"Director, our team has identified a [Level 1 / Level 2] finding at [Location], in direct non-compliance with [EASA Rule]..."*
- **Bullet 2 (Past Modal Deduction of Cause):** *"Based on the physical evidence, the ground operator **must have failed to...** and the condition **could have caused...**"*
- **Bullet 3 (Immediate Operational Action & Deadline):** *"We have immediately enacted [prohibition/restriction], and the operator **shall submit** a formal Corrective Action Plan within [immediate / 30 calendar days]."*