AI-Powered DDR Generator Output

This report combines the uploaded inspection report and thermal report to produce a client-friendly building diagnosis.

Property Address	Flat 202, UrbanRoof Sample Site, Baner Road, Pune, Maharashtra 411045
Inspector Name	Krushna & Mahesh
Inspection Date	27 September 2022
Property Type	Flat
Floors	11
Property Age	8 years

Section 1

1. Property Issue Summary

Significant Moisture Ingress and Dampness Across Multiple Areas

The property, Flat 202, UrbanRoof Sample Site, exhibits widespread moisture ingress and dampness, primarily affecting the lower sections of walls in various rooms and ceilings. Thermal analysis consistently detected cold spots indicative of moisture, corroborated by visual evidence of dampness, mold, and peeling paint. Key contributing factors include issues with bathroom waterproofing, plumbing, external wall integrity, and balcony leakage.

Key Findings

- Widespread dampness and mold growth observed at skirting levels and lower wall sections in Hall, Bedroom, Master Bedroom, and Kitchen.
- Thermal imaging confirms significant cold spots and moisture presence in affected wall areas, indicating active water ingress.
- Identified root causes include gaps in tile joints and plumbing issues in bathrooms of Flat No. 103 and Flat No. 203, as well as cracks in the external wall and internal balcony leakage.
- Seepage detected at the parking ceiling below Flat No. 103, linked to plumbing and tile joint issues in the Common Bathroom of Flat No. 103.
- Dampness on the Common Bathroom ceiling of Flat No. 103 is attributed to tile joint issues in Flat No. 203 bathrooms.

Section 2

2. Area-wise Observations

Hall

IMMEDIATE

Observation: Skirting level Dampness Thermal review also shows a large blue/cyan area at the bottom of the wall, indicating a significant temperature drop and moisture presence.

Probable Root Cause: Observed gaps between the tile joints of Common Bathroom of Flat No. 103: Dampness in Hall due to gaps in Common Bathroom tile joints.

Severity Assessment: Skirting level Dampness Thermal evidence shows significant moisture ingress or dampness at the base of the wall, likely due to rising damp or water penetration from the floor/ground level. the cold spot temperature is 23.4 °c, which is close to the reflected temperature (23 °c), but still significantly cooler than the hotspot. the visual image confirms visible dampness and mold. at bottom section of the wall. Related source-side evidence points to dampness in hall due to gaps in common bathroom tile joints.. The issue appears active and likely to worsen if it is delayed.

Recommended Actions

- Treat this area as urgent to prevent further spread of dampness and surface damage.
- Open failed tile joints, repair weak spots, and seal floor-wall junctions in the wet area.

Additional Notes

- Linked thermal evidence: RB02380X.JPG, RB02386X.JPG.
- Related source area: Observed gaps between the tile joints of Common Bathroom of Flat No. 103.

Missing Or Unclear Information

- Not Available

Conflicts

- No direct conflict found in the uploaded documents.

Supporting Images

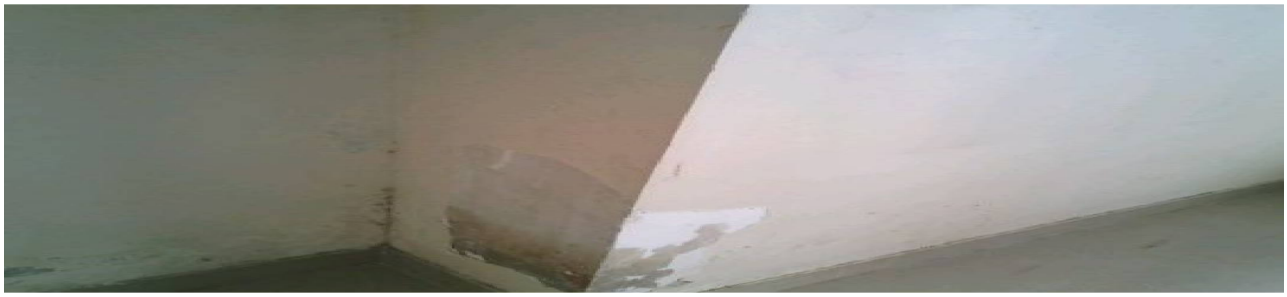

Thermal Report Extracted Image 1 (Page 1)

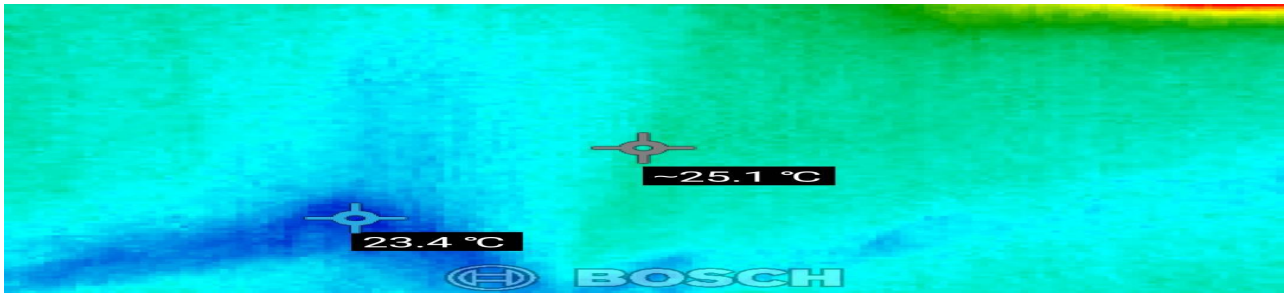

Thermal Report Extracted Image 2 (Page 1)

Thermal Report Extracted Image 1 (Page 2)

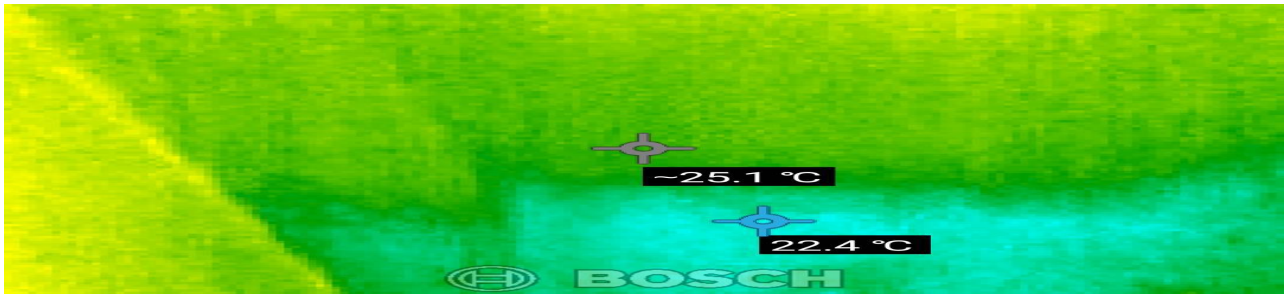

Thermal Report Extracted Image 2 (Page 2)

Bedroom

IMMEDIATE

Observation: Skirting level Dampness Thermal review also shows a large blue/cyan area at the bottom of the wall, indicating a significant temperature drop and moisture presence.

Probable Root Cause: Flat No. 203 Bathrooms (Common & Master Bedroom): Open tile joints and gaps between tile joints.

Severity Assessment: Skirting level Dampness Thermal evidence shows significant moisture ingress or dampness at the base of the wall, likely due to rising damp or water penetration from the floor/ground level. the cold spot temperature is 23.4 °c, which is close to the reflected temperature (23 °c), but still significantly cooler than the hotspot. the visual image confirms visible dampness and mold. at bottom section of the wall. Related source-side evidence points to open tile joints and gaps between tile joints.. The issue appears active and likely to worsen if it is delayed.

Recommended Actions

- Treat this area as urgent to prevent further spread of dampness and surface damage.
- Open failed tile joints, repair weak spots, and seal floor-wall junctions in the wet area.

Additional Notes

- Linked thermal evidence: RB02380X.JPG, RB02386X.JPG.
- Related source area: Flat No. 203 Bathrooms (Common & Master Bedroom), Master Bedroom Bathroom (Flat No. 103).

Missing Or Unclear Information

- Not Available

Conflicts

- Multiple possible source areas are mentioned: Observed gaps between the tile joints of Common Bathroom of Flat No. 103, Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103, Observed cracks on the External wall of building near Master Bedroom of Flat No. 103.

Supporting Images

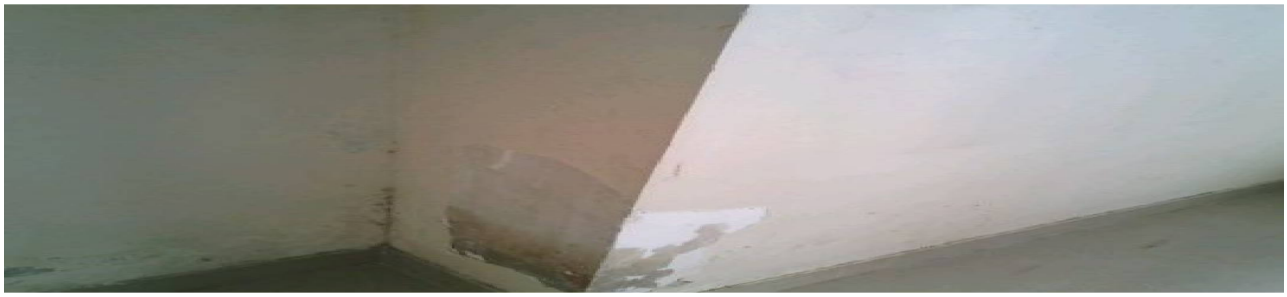

Thermal Report Extracted Image 1 (Page 1)

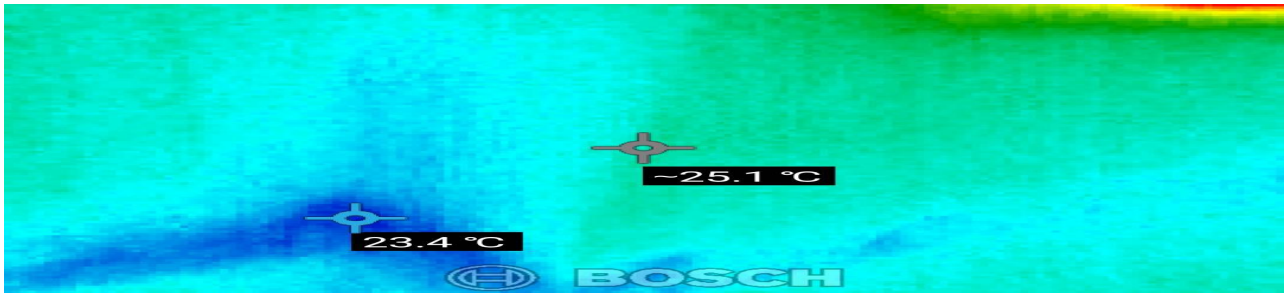

Thermal Report Extracted Image 2 (Page 1)

Thermal Report Extracted Image 1 (Page 2)

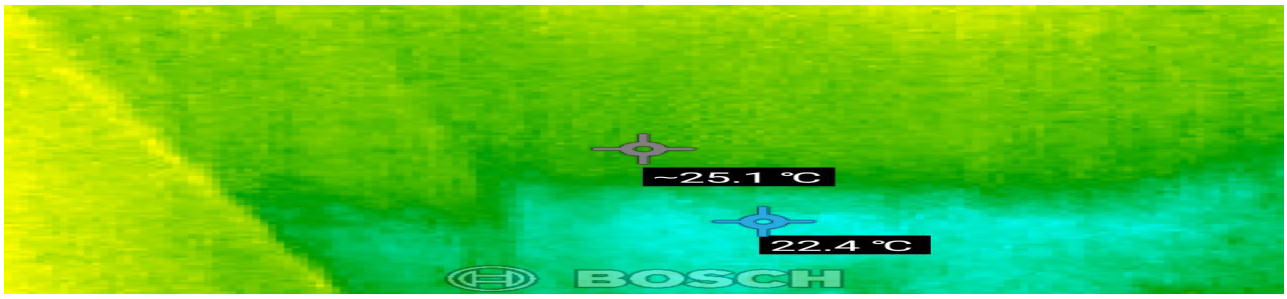

Thermal Report Extracted Image 2 (Page 2)

Master Bedroom

IMMEDIATE

Observation: Skirting level Dampness Thermal review also shows a large blue/cyan area at the bottom of the wall, indicating a significant temperature drop and moisture presence.

Probable Root Cause: Flat No. 203 Bathrooms (Common & Master Bedroom): Open tile joints and gaps between tile joints.

Severity Assessment: Skirting level Dampness Thermal evidence shows significant moisture ingress or dampness at the base of the wall, likely due to rising damp or water penetration from the floor/ground level. the cold spot temperature is 23.4 °c, which is close to the reflected temperature (23 °c), but still significantly cooler than the hotspot. the visual image confirms visible dampness and mold. at bottom section of the wall. Related source-side evidence points to open tile joints and gaps between tile joints.. The issue appears active and likely to worsen if it is delayed.

Recommended Actions

- Treat this area as urgent to prevent further spread of dampness and surface damage.
- Open failed tile joints, repair weak spots, and seal floor-wall junctions in the wet area.

Additional Notes

- Linked thermal evidence: RB02380X.JPG, RB02386X.JPG.
- Related source area: Flat No. 203 Bathrooms (Common & Master Bedroom), Master Bedroom Bathroom (Flat No. 103).

Missing Or Unclear Information

- Not Available

Conflicts

- Multiple possible source areas are mentioned: Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103, Observed cracks on the External wall of building near Master Bedroom of Flat No. 103.

Supporting Images

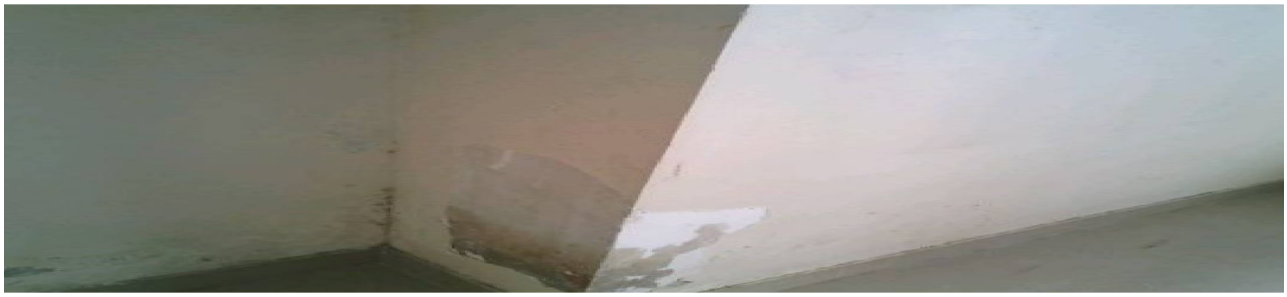

Thermal Report Extracted Image 1 (Page 1)

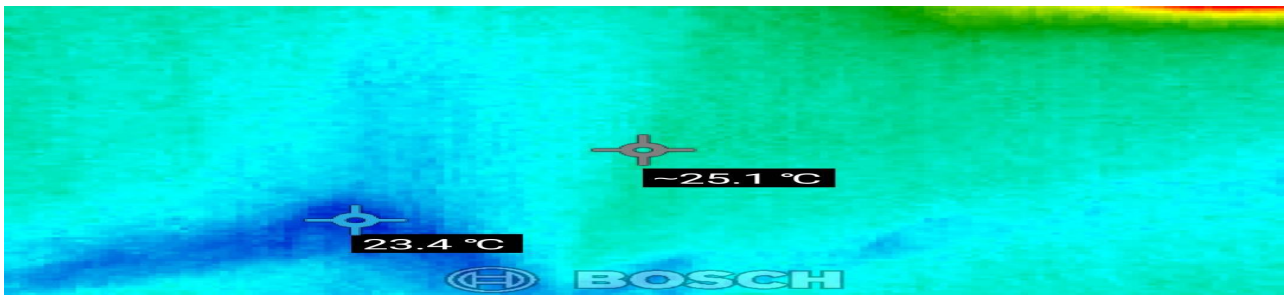

Thermal Report Extracted Image 2 (Page 1)

Thermal Report Extracted Image 1 (Page 2)

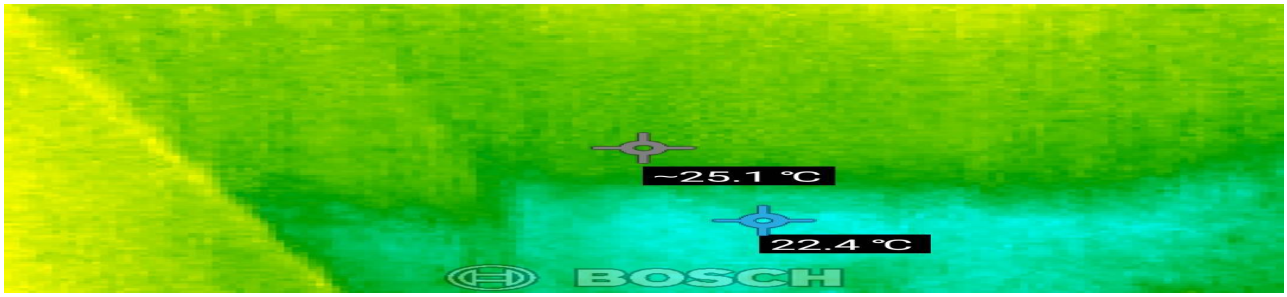

Thermal Report Extracted Image 2 (Page 2)

Kitchen

IMMEDIATE

Observation: Skirting level Dampness Thermal review also shows a large blue/cyan area at the bottom of the wall, indicating a significant temperature drop and moisture presence.

Probable Root Cause: Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103: Dampness in Kitchen due to gaps in Master Bedroom Bathroom tile joints.

Severity Assessment: Skirting level Dampness Thermal evidence shows significant moisture ingress or dampness at the base of the wall, likely due to rising damp or water penetration from the floor/ground level. the cold spot temperature is 23.4 °c, which is close to the reflected temperature (23 °c), but still significantly cooler than the hotspot. the visual image confirms visible dampness and mold. at bottom section of the wall. Related source-side evidence points to dampness in kitchen due to gaps in master bedroom bathroom tile joints.. The issue appears active and likely to worsen if it is delayed.

Recommended Actions
- Treat this area as urgent to prevent further spread of dampness and surface damage.
- Open failed tile joints, repair weak spots, and seal floor-wall junctions in the wet area.

Additional Notes
- Linked thermal evidence: RB02380X.JPG, RB02386X.JPG.
- Related source area: Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103.

Missing Or Unclear Information
- Not Available

Conflicts
- No direct conflict found in the uploaded documents.

Supporting Images

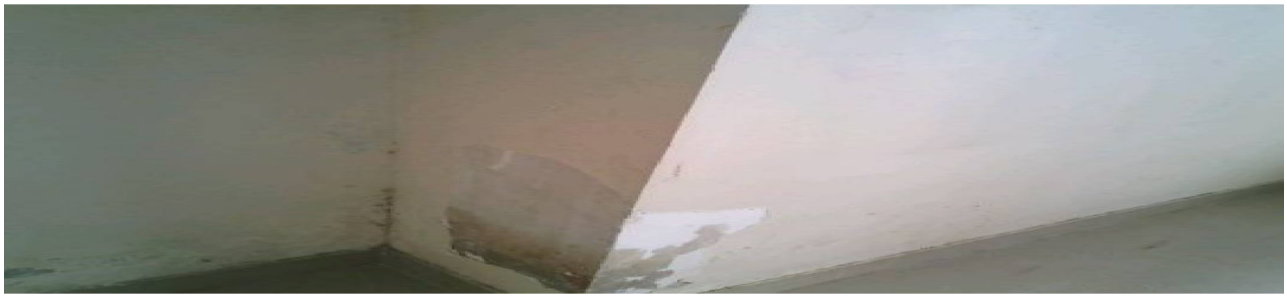

Thermal Report Extracted Image 1 (Page 1)

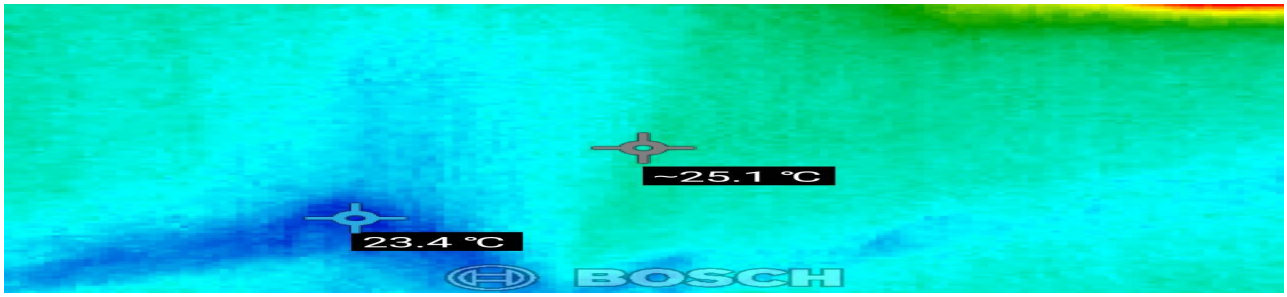

Thermal Report Extracted Image 2 (Page 1)

Thermal Report Extracted Image 1 (Page 2)

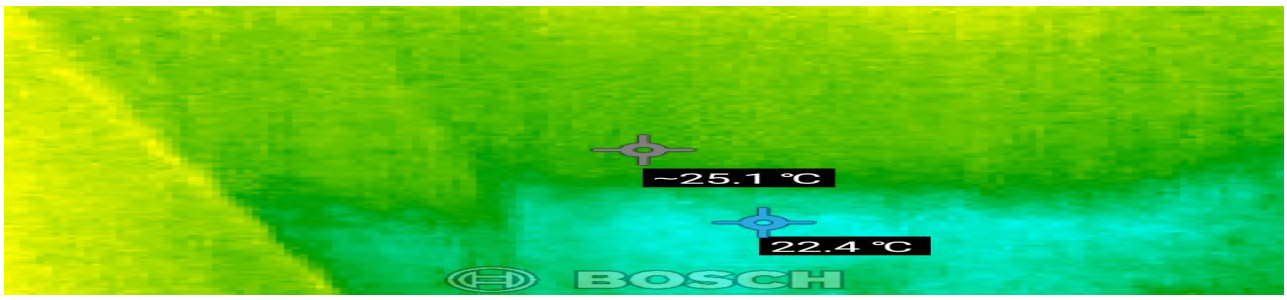

Thermal Report Extracted Image 2 (Page 2)

Master Bedroom Wall

IMMEDIATE

Observation: Wall dampness Thermal review also shows a large blue/cyan area at the bottom of the wall, indicating a significant temperature drop and moisture presence.

Probable Root Cause: External Wall: Cracks, duct issue, and external plumbing pipes cracked/leaked.

Severity Assessment: Wall dampness Thermal evidence shows significant moisture ingress or dampness at the base of the wall, likely due to rising damp or water penetration from the floor/ground level. the cold spot temperature is 23.4 °c, which is close to the reflected temperature (23 °c), but still significantly cooler than the hotspot. the visual image confirms visible dampness and mold. at bottom section of the wall. Related source-side evidence points to cracks, duct issue, and external plumbing pipes cracked/leaked.. The issue appears active and likely to worsen if it is delayed.

Recommended Actions

- Treat this area as urgent to prevent further spread of dampness and surface damage.
- Open failed tile joints, repair weak spots, and seal floor-wall junctions in the wet area.
- Repair wall cracks, stop external water entry, and apply suitable waterproof protection.
- Check nearby plumbing lines and service shafts for hidden leakage.

Additional Notes

- Linked thermal evidence: RB02380X.JPG, RB02386X.JPG, RB02395X.JPG.
- Related source area: External Wall, Flat No. 203 Bathrooms (Common & Master Bedroom).

Missing Or Unclear Information

- Not Available

Conflicts

- No direct conflict found in the uploaded documents.

Supporting Images

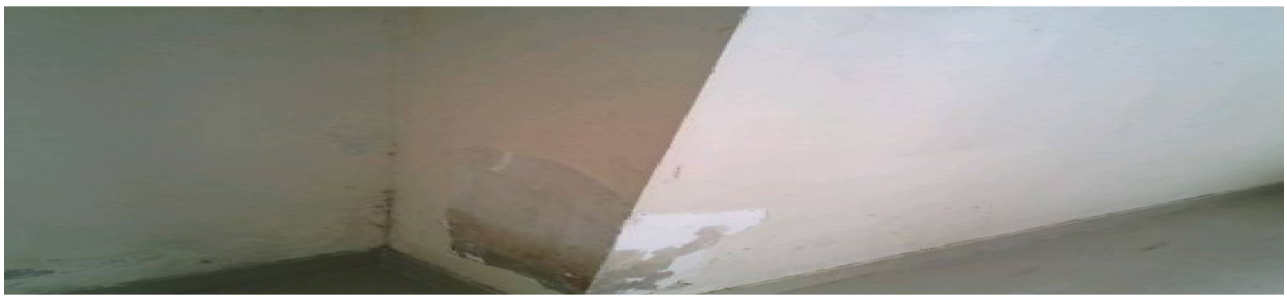

Thermal Report Extracted Image 1 (Page 1)

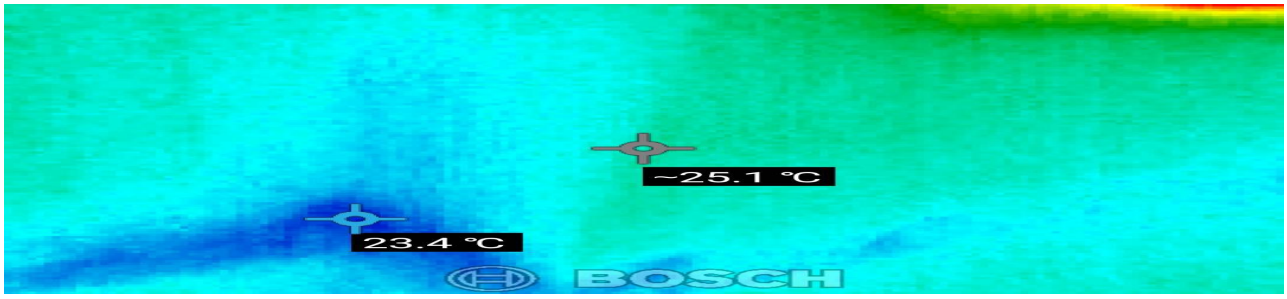

Thermal Report Extracted Image 2 (Page 1)

Thermal Report Extracted Image 1 (Page 2)

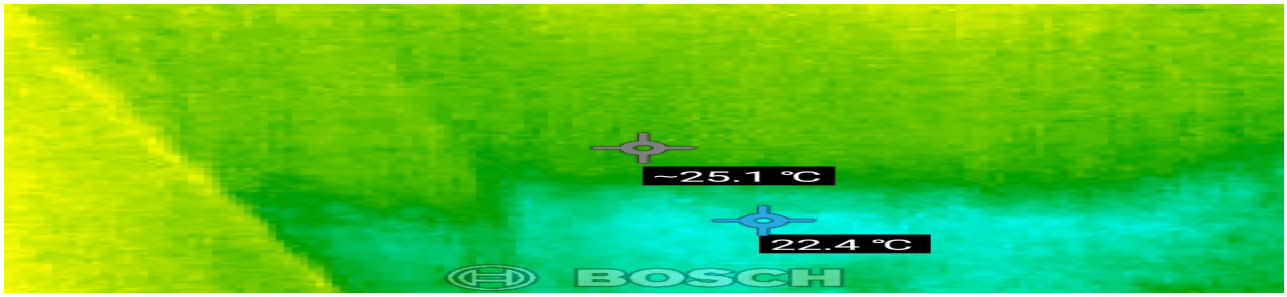

Thermal Report Extracted Image 2 (Page 2)

Parking Area

IMMEDIATE

Observation: Seepage is observed at the parking ceiling directly below Flat No. 103.

Probable Root Cause: This seepage is linked to plumbing issues and gaps between the tile joints in the Common Bathroom of Flat No. 103.

Severity Assessment: The inspection report indicates 'immediate' severity for seepage in the parking area, suggesting active water leakage that requires urgent attention to prevent structural damage and safety hazards.

Recommended Actions

- Immediately investigate and repair the plumbing issues in the Common Bathroom of Flat No. 103.
- Re-grout and seal all tile joints in the Common Bathroom of Flat No. 103.
- Repair the damaged parking ceiling after the source of leakage is resolved.

Additional Notes

- Linked thermal evidence: RB02386X.JPG, RB02402X.JPG, RB02403X.JPG.
- Related source area: Observed plumbing issue & gaps between the tile joints of Common Bathroom of Flat No. 103.

Missing Or Unclear Information

- Not Available

Conflicts

- No direct conflict found in the uploaded documents.

Supporting Images

Thermal Report Extracted Image 1 (Page 2)

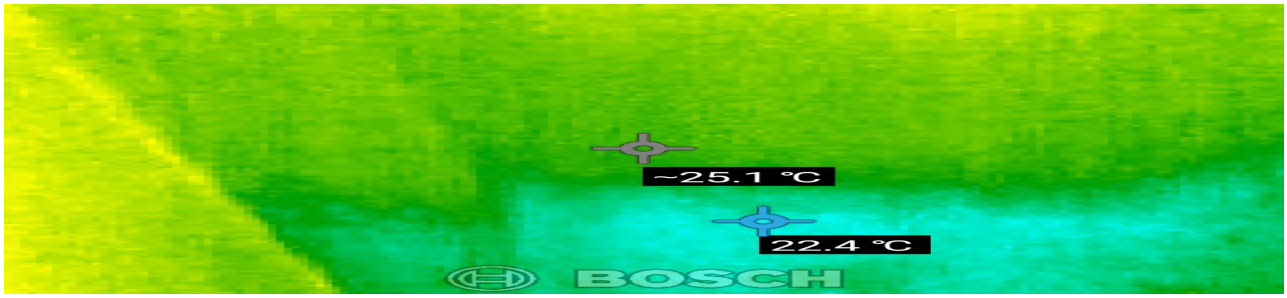

Thermal Report Extracted Image 2 (Page 2)

Thermal Report Extracted Image 1 (Page 4)

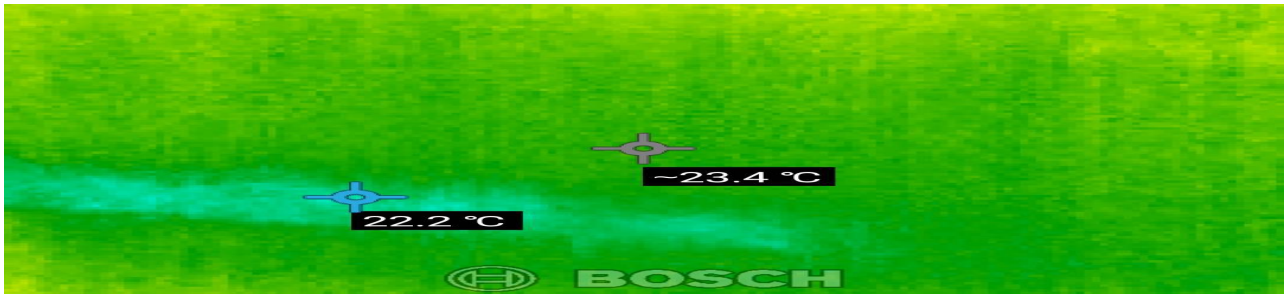

Thermal Report Extracted Image 2 (Page 4)

Common Bathroom Ceiling

IMMEDIATE

Observation: Dampness Thermal review also shows a large blue/cyan area at the bottom of the wall, indicating a significant temperature drop and moisture presence.

Probable Root Cause: Common Bathroom (Flat No. 103): Tile hollowness, gaps between tile joints, and plumbing issue.

Severity Assessment: Dampness Thermal evidence shows significant moisture ingress or dampness at the base of the wall, likely due to rising damp or water penetration from the floor/ground level. the cold spot temperature is 23.4 °c, which is close to the reflected temperature (23 °c), but still significantly cooler than the hotspot. the visual image confirms visible dampness and mold. at bottom section of the wall. Related source-side evidence points to tile hollowness, gaps between tile joints, and plumbing issue.. The issue appears active and likely to worsen if it is delayed.

Recommended Actions

- Treat this area as urgent to prevent further spread of dampness and surface damage.
- Open failed tile joints, repair weak spots, and seal floor-wall junctions in the wet area.
- Check nearby plumbing lines and service shafts for hidden leakage.

Additional Notes

- Linked thermal evidence: RB02380X.JPG, RB02386X.JPG.
- Related source area: Common Bathroom (Flat No. 103), Flat No. 203 Bathrooms (Common & Master Bedroom).

Missing Or Unclear Information

- Not Available

Conflicts
- No direct conflict found in the uploaded documents.

Supporting Images

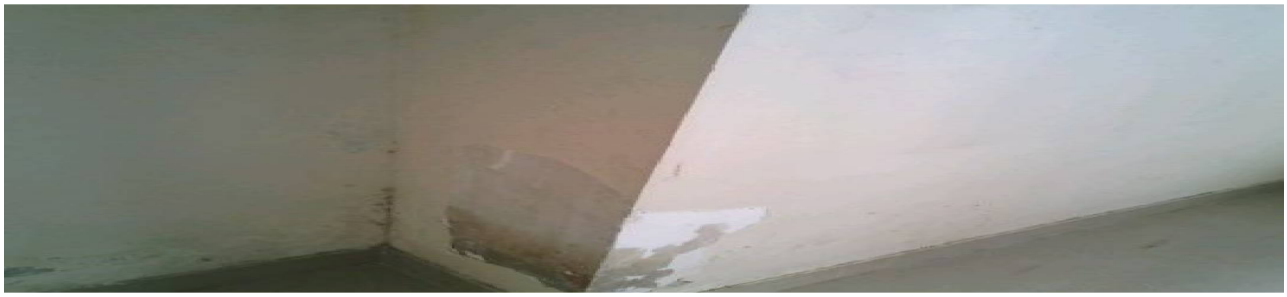

Thermal Report Extracted Image 1 (Page 1)

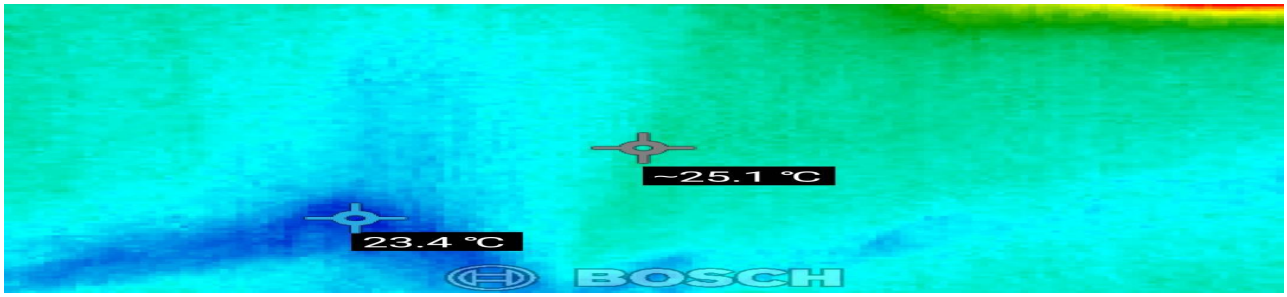

Thermal Report Extracted Image 2 (Page 1)

Thermal Report Extracted Image 1 (Page 2)

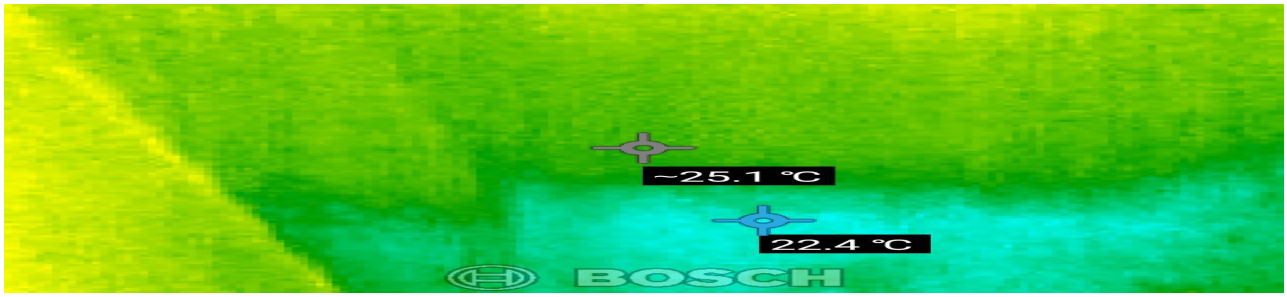

Thermal Report Extracted Image 2 (Page 2)

Section 3

3. Probable Root Cause

Area	Probable Root Cause	Supporting Evidence
Hall	Observed gaps between the tile joints of Common Bathroom of Flat No. 103: Dampness in Hall due to gaps in Common Bathroom tile joints.	Skirting level Dampness Thermal evidence shows significant moisture ingress or dampness at the base of the wall, likely due to rising damp or water penetration from the floor/ground level. the cold spot temperature is 23.4 °c, which is close to the reflected temperature (23 °c), but still significantly cooler than the hotspot. the visual image confirms visible dampness and mold. at bottom section of the wall. Related source-side evidence points to dampness in hall due to gaps in common bathroom tile joints.. The issue appears active and likely to worsen if it is delayed.
Bedroom	Flat No. 203 Bathrooms (Common & Master Bedroom): Open tile joints and gaps between tile joints.	Skirting level Dampness Thermal evidence shows significant moisture ingress or dampness at the base of the wall, likely due to rising damp or water penetration from the floor/ground level. the cold spot temperature is 23.4 °c, which is close to the reflected temperature (23 °c), but still significantly cooler than the hotspot. the visual image confirms visible dampness and mold. at bottom section of the wall. Related source-side evidence points to open tile joints and gaps between tile joints.. The issue appears active and likely to worsen if it is delayed.
Master Bedroom	Flat No. 203 Bathrooms (Common & Master Bedroom): Open tile joints and gaps between tile joints.	Skirting level Dampness Thermal evidence shows significant moisture ingress or dampness at the base of the wall, likely due to rising damp or water penetration from the floor/ground level. the cold spot temperature is 23.4 °c, which is close to the reflected temperature (23 °c), but still significantly cooler than the hotspot. the visual image confirms visible dampness and mold. at bottom section of the wall. Related source-side evidence points to open tile joints and gaps between tile joints.. The issue appears active and likely to worsen if it is delayed.
Kitchen	Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103: Dampness in Kitchen due to gaps in Master Bedroom Bathroom tile joints.	Skirting level Dampness Thermal evidence shows significant moisture ingress or dampness at the base of the wall, likely due to rising damp or water penetration from the floor/ground level. the cold spot temperature is 23.4 °c, which is close to the reflected temperature (23 °c), but still significantly cooler than the hotspot. the visual image confirms visible dampness and mold. at bottom section of the wall. Related source-side evidence points to dampness in kitchen due to gaps in master bedroom bathroom tile joints.. The issue appears active and likely to worsen if it is delayed.
Master Bedroom Wall	External Wall: Cracks, duct issue, and external plumbing pipes cracked/leaked.	Wall dampness Thermal evidence shows significant moisture ingress or dampness at the base of the wall, likely due to rising damp or water penetration from the floor/ground level. the cold spot temperature is 23.4 °c, which is close to the reflected temperature (23 °c), but still significantly cooler than the hotspot. the visual image confirms visible dampness and mold. at bottom section of the wall. Related source-side evidence points to cracks, duct issue, and external plumbing pipes cracked/leaked.. The issue appears active and likely to worsen if it is delayed.

Area	Probable Root Cause	Supporting Evidence
Parking Area	Plumbing issue & gaps between the tile joints of Common Bathroom of Flat No. 103.	Inspection finding of seepage and summary table link.
Common Bathroom Ceiling	Common Bathroom (Flat No. 103): Tile hollowness, gaps between tile joints, and plumbing issue.	Dampness Thermal evidence shows significant moisture ingress or dampness at the base of the wall, likely due to rising damp or water penetration from the floor/ground level. the cold spot temperature is 23.4 °c, which is close to the reflected temperature (23 °c), but still significantly cooler than the hotspot. the visual image confirms visible dampness and mold. at bottom section of the wall. Related source-side evidence points to tile hollowness, gaps between tile joints, and plumbing issue.. The issue appears active and likely to worsen if it is delayed.

Section 4

4. Severity Assessment

Area	Severity	Reasoning
Hall	immediate	Skirting level Dampness Thermal evidence shows significant moisture ingress or dampness at the base of the wall, likely due to rising damp or water penetration from the floor/ground level. the cold spot temperature is 23.4 °c, which is close to the reflected temperature (23 °c), but still significantly cooler than the hotspot. the visual image confirms visible dampness and mold. at bottom section of the wall. Related source-side evidence points to dampness in hall due to gaps in common bathroom tile joints.. The issue appears active and likely to worsen if it is delayed.
Bedroom	immediate	Skirting level Dampness Thermal evidence shows significant moisture ingress or dampness at the base of the wall, likely due to rising damp or water penetration from the floor/ground level. the cold spot temperature is 23.4 °c, which is close to the reflected temperature (23 °c), but still significantly cooler than the hotspot. the visual image confirms visible dampness and mold. at bottom section of the wall. Related source-side evidence points to open tile joints and gaps between tile joints.. The issue appears active and likely to worsen if it is delayed.
Master Bedroom	immediate	Skirting level Dampness Thermal evidence shows significant moisture ingress or dampness at the base of the wall, likely due to rising damp or water penetration from the floor/ground level. the cold spot temperature is 23.4 °c, which is close to the reflected temperature (23 °c), but still significantly cooler than the hotspot. the visual image confirms visible dampness and mold. at bottom section of the wall. Related source-side evidence points to open tile joints and gaps between tile joints.. The issue appears active and likely to worsen if it is delayed.
Kitchen	immediate	Skirting level Dampness Thermal evidence shows significant moisture ingress or dampness at the base of the wall, likely due to rising damp or water penetration from the floor/ground level. the cold spot temperature is 23.4 °c, which is close to the reflected temperature (23 °c), but still significantly cooler than the hotspot. the visual image confirms visible dampness and mold. at bottom section of the wall. Related source-side evidence points to dampness in kitchen due to gaps in master bedroom bathroom tile joints.. The issue appears active and likely to worsen if it is delayed.

Area	Severity	Reasoning
Master Bedroom Wall	immediate	Wall dampness Thermal evidence shows significant moisture ingress or dampness at the base of the wall, likely due to rising damp or water penetration from the floor/ground level. the cold spot temperature is 23.4 °c, which is close to the reflected temperature (23 °c), but still significantly cooler than the hotspot. the visual image confirms visible dampness and mold. at bottom section of the wall. Related source-side evidence points to cracks, duct issue, and external plumbing pipes cracked/leaked.. The issue appears active and likely to worsen if it is delayed.
Parking Area	immediate	The inspection report indicates 'immediate' severity for seepage in the parking area, suggesting active water leakage that requires urgent attention to prevent structural damage and safety hazards.
Common Bathroom Ceiling	immediate	Dampness Thermal evidence shows significant moisture ingress or dampness at the base of the wall, likely due to rising damp or water penetration from the floor/ground level. the cold spot temperature is 23.4 °c, which is close to the reflected temperature (23 °c), but still significantly cooler than the hotspot. the visual image confirms visible dampness and mold. at bottom section of the wall. Related source-side evidence points to tile hollowness, gaps between tile joints, and plumbing issue.. The issue appears active and likely to worsen if it is delayed.

Section 5

5. Recommended Actions

Area	Action	Priority	Reasoning
Walls (Lower Section / Skirting Level) in Hall, Bedroom, Master Bedroom, and Kitchen	Conduct a detailed investigation to pinpoint exact water entry points from bathrooms and external walls. Repair all identified plumbing issues and re-grout/seal tile joints in the Common Bathroom and Master Bedroom Bathroom of Flat No. 103. Address and repair cracks on the external wall, especially near the Master Bedroom. Implement appropriate damp-proofing measures for affected wall sections. Professionally remediate all mold growth and repair damaged paint/surfaces.	immediate	Addressing the source of moisture and remediating existing damage is critical to prevent further structural deterioration and health risks.
Parking Area	Immediately investigate and repair the plumbing issues in the Common Bathroom of Flat No. 103. Re-grout and seal all tile joints in the Common Bathroom of Flat No. 103. Repair the damaged parking ceiling after the source of leakage is resolved.	immediate	Active seepage requires urgent intervention to prevent structural damage and safety hazards.
Common Bathroom Ceiling (Flat No. 103)	Coordinate with Flat No. 203 to address and re-grout/seal all open and gapped tile joints in their Common and Master Bedroom Bathrooms. Repair the damp ceiling in Flat No. 103 after the source of leakage from Flat No. 203 is resolved.	moderate	Addressing the source of leakage from the upper floor is necessary to prevent recurrence and further damage.
Common Bathroom (Flat No. 103)	Undertake a comprehensive repair of the concealed plumbing system. Repair or replace the damaged Nahani trap/Brickbat coba. Re-grout and seal all tile joints thoroughly, addressing hollowness where necessary. Tighten or replace loose plumbing joints and address rust.	immediate	This area is a primary source of multiple severe issues, requiring immediate and comprehensive repair.
Master Bedroom Bathroom (Flat No. 103)	Re-grout and seal all tile joints, addressing tile hollowness as needed. Inspect concealed plumbing for any potential issues.	moderate	Addressing compromised waterproofing will prevent further dampness in adjacent areas.

Area	Action	Priority	Reasoning
External Wall	Repair all cracks on the external wall, including RCC Columns and Beams. Repair or replace cracked and leaking external plumbing pipes. Clean and treat external walls to remove algae, fungus, and moss. Consider applying a waterproof coating to the external wall.	immediate	External wall integrity is crucial for preventing widespread internal dampness, and current issues are linked to immediate severity internal problems.
Balcony	Investigate the source of internal balcony leakage thoroughly. Repair or re-waterproof the balcony as necessary.	moderate	Leakage, even if severity is not specified, should be addressed to prevent potential damage and discomfort.
Flat No. 203 Bathrooms (Common & Master Bedroom)	Re-grout and seal all open and gapped tile joints in both bathrooms of Flat No. 203.	moderate	This area is a source of dampness for the flat below and requires attention to prevent further water damage.

Section 6

6. Additional Notes

Additional Notes

- The presence of dampness near electrical outlets (thermal images RB02402X.JPG, RB02393X.JPG, RB02400X.JPG) poses a potential safety concern.

- The type of tile in the Common Bathroom (Flat No. 103) is noted as 'moderate'.

Section 7

7. Missing or Unclear Information

Missing Or Unclear Information

- Customer Name
- Mobile
- Email
- Address
- Positive side description for 'Flat no 203 tile joint open and' is incomplete.
- Specific severity level for internal balcony leakage.

Section 8

8. Conflicting Details

Conflicting Details

- Thermal analysis consistently indicates an 'immediate' severity for wall dampness, while the inspection report categorizes skirting level dampness in Hall, Bedroom, Master Bedroom, and Kitchen as 'moderate'.

- The inspection report identifies the external wall as a 'high risk' source, and links it to 'moderate' dampness in the Master Bedroom wall. However, thermal analysis of the Master Bedroom wall indicates 'immediate' severity dampness.

- Property Age is provided as '8' years in the property details but is listed as 'Missing Information' in the inspection data.

- No direct conflict found in the uploaded documents.

- Multiple possible source areas are mentioned: Observed gaps between the tile joints of Common Bathroom of Flat No. 103, Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103, Observed cracks on the External wall of building near Master Bedroom of Flat No. 103.

- Multiple possible source areas are mentioned: Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103, Observed cracks on the External wall of building near Master Bedroom of Flat No. 103.