Site Name : Dhandalpur

CONTENTS:

Section Title
1. GENERAL DETAILS OF WIND TURBINE
2. INSPECTION DETAILS OF WIND TURBINE
3. MAJOR COMPONENTS OF WIND TURBINE
4. INSPECTION CHECKLIST
5. WTG CRITICAL SENSOR INSPECTION CHECK
6. HIGH RISK ASSESSMENT TABLE
7. OBSERVATIONS & PHOTOGRAPHS
8. EARTH RESISTANCE MEASUREMENT
9. GENERATOR IR MEASUREMENT
10. BLADE INSPECTION

1.GENERAL DETAILS OF WIND TURBINE :

S.No	Details	Input	S.No	Details	Input
1	PROJECT	End of warranty inspection (Chotila)	2	WINDFARM	End of warranty inspection (Chotila)
3	LOCATION NO	JGBPL-01	4	VILLAGE	Adala /Dhandalpur
5	DIST	surendranagar	6	TALUKA	Chotila
7	STATE	Gujarat	8	COUNTRY	India
9	WINDFARM CAPACITY	-	10	TURBINE GPS COORDINATES	738749N, 2471993E (UTM)
11	TURBINE MANUFACTURER	Suzlon	12	WTG MODEL	S144
13	WTG SERIAL NO	JGBPL-01	14	WTG LOCATION NO	JGBPL-01
15	WTG SCADA NO	JGBPL-01	16	WTG CAPACITY	3.15 (MW)
17	ROTOR DIAMETER	144 (MTR)	18	HUB HEIGHT	140 (MTR)
19	LAST ACTIVITY	2026-03-20			

2.INSPECTION DETAILS :

S.No	Details	Input	S.No	Details	Input
1	DATE OF INSPECTION	20-03-2026	2	OPERATING HOURS	-
3	WTG STOP TIME	11:05	4	TOTAL PRODUCTION	-
5	WTG START TIME	19:02	6	TEMPERATURE	34 °C
7	WIND SPEED	4.2 (m/s)	8	INSPECTION TYPE	TURBINE

REPRESENTATIVES :

S.No	Customer Representative	Demo Representative	OEM / OM Representative
1	Mr. Lalatendu Sahoo	Mr. Mallik Srinivas Ganesh Chaudhari	Mr. Manish

3. DETAILS OF MAJOR COMPONENTS:

S.No	Component	Manufacturer	Serial No
1	Tower	Suzlon	140S144TPV0SE
2	Generator	Suzlon	MH5277A23012
3	Gearbox	ZF	EF0953A-001/CM0006
4	Rotor Blade - 1	Suzlon	147037
5	Rotor Blade - 2	Suzlon	147022
6	Rotor Blade - 3	Suzlon	147021
7	Nacelle	Suzlon	HL5D5N0009S144IL2
8	Hub	Suzlon	HL5D5H0009S144IL2

High Priority	Medium Priority	Low Priority

RISK CLASSIFICATION:

High – Immediate impact on generation or safety of asset/Human.

Medium – Impact on generation or life of asset in short period.

Low – Impact on generation or life of asset in long period.

4. COMPONENT INSPECTION CHECKLIST:

SR No	Description	Paint Damage	Physical Damage Dent Crack	Corrosion	Looseness	Leakage	Missing Or Not Available	Function Issue	Gap Or Not Sealed	Not Sufficient	Overview
FOUNDATION & TOWER (OUTSIDE)											
2.1	Foundation Surface	-	-	-	-	-	-	-	-	-	Found ok
2.2	Grouting	-	-	-	-	-	-	-	-	-	Found ok
2.3	Back Filling Area	-	-	-	-	-	-	-	-	-	Found ok
2.4	Anchor Bolts/Cap	-	-	-	-	-	-	-	-	-	Found ok
2.5	Stair Case Grouting	-	-	-	-	-	-	-	-	-	Found ok
2.6	Earthing Strips & Pit	-	-		-	-	-	-	-	-	Not ok
2.7	Tower Structure	-	-	-	-	-	-	-	-	-	Found ok
2.8	Stair Case Structure	-	-	-	-	-	-	-	-	-	Found ok
2.9	Main Door Earthing	-	-	-	-	-	-	-	-	-	Found ok
BASEMENT & BASE SEC.											
3.1	Tower Structure	-	-	-	-	-	-	-	-	-	Found ok
3.2	Tower Earthing	-	-	-	-	-	-	-	-	-	Found ok

SR No	Description	Paint Damage	Physical Damage Dent Crack	Corrosion	Looseness	Leakage	Missing Or Not Available	Function Issue	Gap Or Not Sealed	Not Sufficient	Overview
3.3	Foundation Inside Surface	-	-	-	-	-	-	-	-	-	Found ok
3.4	Grouting	-	-	-	-	-	-	-	-	-	Found ok
3.5	Anchor Bolt	-	-	-	-	-	-	-	-	-	Found ok
3.6	Earthing Bus Bar & Conn.	-	-	-	-	-	-	-	-	-	Found ok
3.7	Illumination Light	-	-	-	-	-	-	-	-	-	Found ok
3.8	Platform & Bolted Connections, Earthing	-	-	-	-	-	-	-	-	-	Found ok
3.9	Platform Door & Earthing	-	-	-	-	-	-	-	-	-	Found ok
3.10	Power Cables Arrangements & Connection	-	-	-	-	-	-	-	-	-	Found ok
3.11	Supply/Control Cables Arrangements & Connection	-	-	-	-	-	-	-	-	-	Found ok
3.12	Communication Cables Arrangements & Connection	-	-	-	-	-	-	-	-	-	Found ok
3.13	Switch Gear SF6	-	-	-	-	-	-	-	-	-	Found ok
3.14	Bottom Controller	-	-	-	-	-	-		-		Not ok
3.15	UPS	-	-	-	-	-	-	-	-	-	Found ok
3.16	Emergency Light Backup	-	-	-	-	-	-	-	-	-	Found ok
3.17	Smoke Detector & Other	-	-	-	-	-	-	-	-	-	Found ok
3.18	First Aid Box	-	-	-	-	-	-	-	-	-	Found ok
3.19	Fire Extinguisher	-	-	-	-	-	-	-	-		Not ok
3.20	Rubber Mat	-	-	-	-	-	-	-	-	-	Found ok
3.21	Safety Signs & Labels	-		-	-	-	-	-	-	-	Not ok
3.22	Ladder & Life Line	-	-	-	-	-	-	-	-	-	Found ok
3.23	Bottom lift control panel	-	-	-	-	-	-		-	-	Not ok

SR No	Description	Paint Damage	Physical Damage Dent Crack	Corrosion	Looseness	Leakage	Missing Or Not Available	Function Issue	Gap Or Not Sealed	Not Sufficient	Overview
3.24	Radiator	-	-	-	-	-	-	-	-		Not ok
ELEVATOR (LIFT)											
4.1	Display Leds	-	-	-	-	-	-	-	-	-	Found ok
4.2	Guardrails & Door Lock	-	-	-	-	-	-	-	-	-	Found ok
4.3	Limit Switches	-		-	-	-	-	-	-	-	Not ok
4.4	Emergency Light	-	-	-	-	-	-	-	-	-	Found ok
4.5	Guide Rope	-		-	-	-	-	-	-	-	Not ok
TOWER SECTION(T2-T5)											
5.1	Tower Structure	-	-	-	-	-	-	-	-	-	Found ok
5.2	Bolted Connection	-	-	-	-	-	-	-	-	-	Found ok
5.3	Platforms	-	-	-	-		-	-	-	-	Not ok
5.4	Ladder & Safety Rope	-	-	-	-	-	-	-	-	-	Found ok
5.5	Illumination Lamp	-	-	-	-	-	-	-	-	-	Found ok
5.6	Power Cables & Supporting Structure	-	-	-	-	-	-	-	-	-	Found ok
5.7	Communication Cables	-	-	-	-	-	-	-	-	-	Found ok
5.8	Control/Supply Cables	-	-	-	-	-	-	-	-	-	Found ok
5.9	Cable Supporting Tray (Comm. Control Cable)	-	-	-	-	-	-	-	-	-	Found ok
5.10	Tower Earthing	-	-	-	-	-	-	-	-	-	Found ok
NACELLE											
7.1	Yaw System	-	-	-	-	-	-	-	-	-	Found ok
7.1.1	Brake Disc	-	-	-	-	-	-	-	-	-	Found ok

SR No	Description	Paint Damage	Physical Damage Dent Crack	Corrosion	Looseness	Leakage	Missing Or Not Available	Function Issue	Gap Or Not Sealed	Not Sufficient	Overview
7.1.2	Yaw Gear Rim	-	-	-	-	-	-	-	-		Not ok
7.1.3	Brake Caliper & Pad	-	-	-	-	-	-	-	-	-	Found ok
7.1.4	Bolted Connection	-	-	-	-	-	-	-	-	-	Found ok
7.1.5	Yaw Drive And Oil Level	-	-	-	-	-	-	-	-	-	Found ok
7.1.6	Yaw Gear/Pinion	-	-	-	-	-	-	-	-	-	Found ok
7.1.7	IGBT Converter Section	-	-	-	-	-	-	-	-	-	Found ok
7.1.8	Yaw Motor & Brakes	-	-	-	-	-	-	-	-	-	Found ok
7.1.9	Cable Twist Limit Switch	-	-	-	-	-	-	-	-	-	Found ok
7.1.10	Power Cables Yaw Platform	-		-	-	-	-	-	-	-	Not ok
7.1.11	Wind Van & Anemometer System	-	-	-	-	-	-	-	-	-	Found ok
7.1.12	Aviation lights	-	-	-	-	-	-		-	-	Not ok
GEARBOX											
7.2.1	Gearbox Oil Level	-	-	-	-	-	-	-	-	-	Found ok
7.2.2	Cooling System	-	-	-	-	-	-	-	-	-	Found ok
7.2.3	Gear Box Oil Pump	-	-	-	-	-	-	-	-	-	Found ok
7.2.4	Offline & Online Filter	-	-	-	-	-	-	-	-	-	Found ok
7.2.5	Hose Pipes & Valves	-	-	-	-	-	-	-	-	-	Found ok
7.2.6	Bolted Connection	-	-	-	-	-	-	-	-	-	Found ok
7.2.7	Sensors	-	-	-	-	-	-	-	-	-	Found ok
7.2.8	Earthing System	-	-	-	-	-	-	-	-	-	Found ok
7.2.9	Breather	-	-	-	-	-	-	-	-		Not ok

SR No	Description	Paint Damage	Physical Damage Dent Crack	Corrosion	Looseness	Leakage	Missing Or Not Available	Function Issue	Gap Or Not Sealed	Not Sufficient	Overview
7.2.10	Slip Ring Unit	-	-	-	-	-	-	-	-	-	Found ok
SHAFT / DRIVETRAIN - DE & NDE											
7.3	Main Drive- De & Nde	-	-	-	-	-	-	-	-		Not ok
GENERATOR											
7.4.1	Stator Terminal Box	-	-	-	-	-	-	-	-	-	Found ok
7.4.2	Rotor Terminal Box	-	-	-	-	-	-	-	-	-	Found ok
7.4.3	Power Cables	-	-	-	-	-	-	-	-	-	Found ok
7.4.4	Slip Ring Unit	-	-	-	-	-	-	-	-	-	Found ok
7.4.5	Carbon Brush(Slip Ring)	-	-	-	-	-	-	-	-	-	Found ok
7.4.6	Cooling System	-	-	-	-	-	-	-	-	-	Found ok
7.4.7	Speed Encoder	-	-	-	-	-	-	-	-	-	Found ok
7.4.8	Auto Lubrication System(Cls)	-	-	-	-	-	-	-	-	-	Found ok
7.4.9	Bolted Connection	-	-	-		-	-	-	-	-	Not ok
7.4.10	Bearing	-	-	-	-	-	-	-	-	-	Found ok
CABINETS IN NACELLE											
7.8.1	Main Controller	-	-	-	-	-	-	-	-		Not ok
7.8.2	IGBT Converter Section	-	-	-	-	-	-	-	-	-	Found ok
7.8.3	Bus Bar Section	-	-	-	-	-	-	-	-	-	Found ok
7.8.4	Nacelle Controller Section - 2	-	-	-	-	-	-	-	-	-	Found ok
7.8.5	Control Panel Earthing	-	-	-	-	-	-	-	-	-	Found ok
NACELLE AREA											
7.9.1	FRP	-	-	-	-	-	-	-	-	-	Found ok

SR No	Description	Paint Damage	Physical Damage Dent Crack	Corrosion	Looseness	Leakage	Missing Or Not Available	Function Issue	Gap Or Not Sealed	Not Sufficient	Overview
7.9.2	Illumination	-	-	-	-	-	-	-	-	-	Found ok
7.9.3	House Keeping	-	-	-	-	-	-	-	-		Not ok
7.9.4	Fire Extinguisher & Rescue Kit	-	-	-	-	-	-	-	-		Not ok
7.9.5	First Aid Kit	-	-	-	-	-	-	-	-		Not ok
7.9.6	Cable Laying	-	-	-	-	-	-	-	-	-	Found ok
7.9.7	Earthing Connection	-	-	-	-	-	-	-	-	-	Found ok
7.9.8	Door/Window	-	-	-	-	-	-	-	-	-	Found ok
7.9.9	Radiator	-	-	-	-	-	-	-	-		Not ok
HUB AREA											
8.3.1	Nose Cone Frp	-	-	-	-	-	-	-	-	-	Found ok
8.3.2	Nose Cone Supporting Arm	-	-		-	-	-	-	-	-	Not ok
8.3.3	Housekeeping	-	-	-	-	-	-	-	-	-	Found ok
8.3.4	Tower Structure	-	-	-	-	-	-	-	-		Not ok
8.3.5	Blade Teeth		-	-	-	-	-	-	-	-	Not ok
TRANSFORMER											
8.4.1	Power Cable Connection	-	-	-	-	-	-	-	-	-	Found ok
8.4.2	Earthing & Neutral Cable Connection	-	-	-	-	-	-	-	-	-	Found ok
8.4.3	Jump Ring	-	-	-	-	-	-	-	-	-	Found ok
8.4.4	Surge Arrester Condition	-	-	-	-	-	-	-	-	-	Found ok
8.4.5	Flash Protection Application	-	-	-	-	-	-	-	-	-	Found ok
8.4.6	Mounting Of Transformer	-	-	-	-	-	-		-	-	Not ok

SR No	Description	Paint Damage	Physical Damage Dent Crack	Corrosion	Looseness	Leakage	Missing Or Not Available	Function Issue	Gap Or Not Sealed	Not Sufficient	Overview
8.4.7	Temperature Indicators (If Applicable)	-	-	-	-	-	-	-		-	Not ok
USS-DOOR LOCKING/SAFETY											
8.5.1	Illumination	-	-	-	-	-	-	-	-	-	Found ok
8.5.2	DP Structure And Add On Parts	-	-	-	-	-	-	-	-	-	Found ok
8.5.3	Cable Laying & Conduit Pipe	-	-	-	-	-	-	-	-	-	Found ok
8.5.4	Earth Pit/Chambers	-	-	-	-	-	-	-	-	-	Found ok
8.5.5	Isolator	-	-	-	-	-	-	-	-		Not ok

RISK STATISTICS :

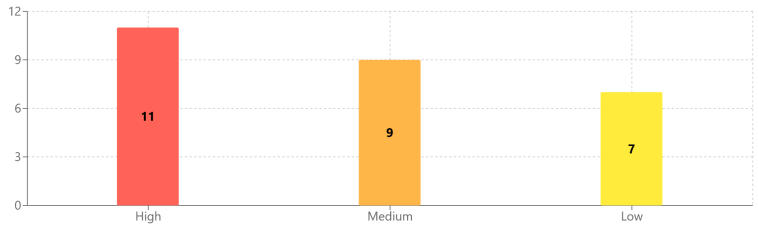

MEASUREMENT RISK DISTRIBUTION :

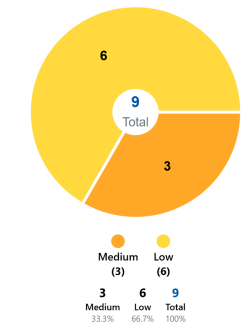

5. WTG CRITICAL SENSOR INSPECTION CHECK:

Sr. No	WTG Critical Check Points	Functional Check			SCADA Log Status			Sensor Feedback		
		Ok	Not Ok	Not Applicable	Ok	Not Ok	Not Applicable	Ok	Not Ok	Not Applicable
1	Protection Relay		X		Y				X	

6. HIGH RISK ASSESSMENT TABLE:

S. No.	Observation Areas	Risk Category	Mitigation	Target Date
1	Cotton waste material found on DP isolator pole.	High	Remove all cotton waste immediately, clean the area, and implement regular housekeeping checks to prevent recurrence.	-
2	Lift operating switch is damaged.	High	Replace or repair the lift operating switch immediately and conduct functional checks to ensure safe operation.	-
3	Aviation obstruction lights are not functioning.	High	Repair or replace the aviation lights immediately, check power supply and connections, and implement routine functional checks.	-
4	The main bearing shrink disc was observed in a corroded condition, and grease leakage was also noted from the main bearing NDE (Non-Drive End) side.	High	Clean the affected area, remove corrosion, reapply proper protection, inspect for damage, and rectify source of grease leakage.	-
5	Fire extinguisher refilling due date has expired.	High	Refill or replace the fire extinguisher immediately and implement a tracking system for timely servicing.	-
6	First aid kit materials are insufficient.	High	Replenish the first aid kit with required materials as per standard checklist and conduct periodic inspections.	-
7	The gearbox radiator was observed in a dusty condition.	High	Clean the radiator thoroughly, ensure proper airflow, and schedule regular cleaning and inspection.	-
8	In the power panel, the main ACB feedback cable was observed to be disconnected/outside from the terminal.	High	Reconnect the feedback cable properly to the designated terminal.	-
9	One (01) Surge Arrester was found in a defective condition in the control panel.	High	Replace the defective surge arrester with a new unit of the same rating and specification.	-
10	The nacelle area housekeeping was observed to be not properly maintained.	High	Remove dust, debris, and any loose items from the nacelle area	-
11	The transformer MOG (Magnetic Oil Level Gauge) is showing the oil level in full condition.	High	The transformer MOG (Magnetic Oil Level Gauge) is indicating full oil level however, it needs to be verified whether this is an actual oil level condition or a possible MOG malfunction.	-

7. Observation and Photographs with Risk Category

Ref. No.	Observation / Way Forward	Ref. Photos	Risk Category
2.6	Corrosion observed on earth cable hardware at tower foundation. **Way Forward:** Clean or replace corroded hardware, ensure proper tightening, and verify earthing resistance is within acceptable limits.		Low
3.14	In the power panel, the main ACB feedback cable was observed to be disconnected/outside from the terminal. **Way Forward:** Reconnect the feedback cable properly to the designated terminal.		High
3.14	One (01) Surge Arrester was found in a defective condition in the control panel. **Way Forward:** Replace the defective surge arrester with a new unit of the same rating and specification.	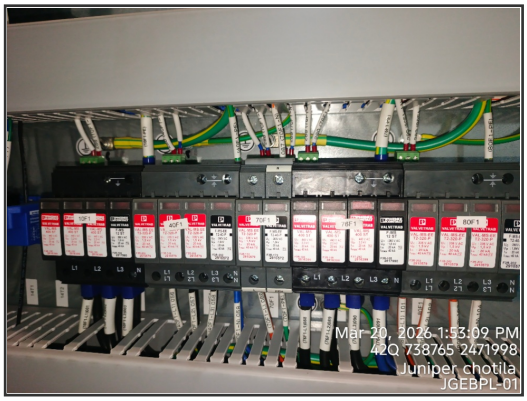	High

Ref. No.	Observation / Way Forward	Ref. Photos	Risk Category
3.19	Bottom platform fire extinguisher is overdue for servicing. **Way Forward:** Service or replace the fire extinguisher immediately and implement a schedule to track future maintenance dates.	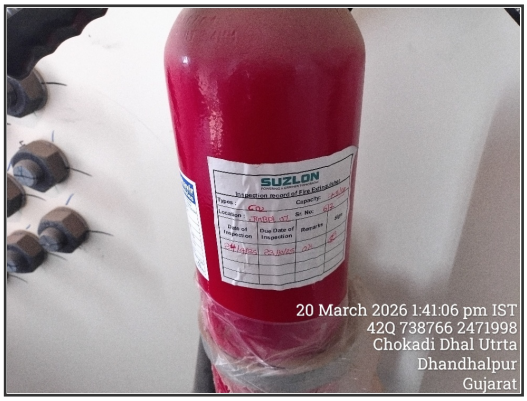 	Medium
3.21	Electric shock safety chart board is not properly fixed. **Way Forward:** Re-fix or secure the chart board in its designated position and include it in regular safety inspections.		Low

Ref. No.	Observation / Way Forward	Ref. Photos	Risk Category
3.23	Bottom lift control panel push button switches are open/exposed. **Way Forward:** Close or cover the push button switches immediately, inspect for any damage, and implement regular panel inspections.		Medium
3.24	In the middle section radiator, the coolant pressure was observed to be below 2 bar. **Way Forward:** After topping up and rectifying, monitor coolant pressure and system temperature during operation.	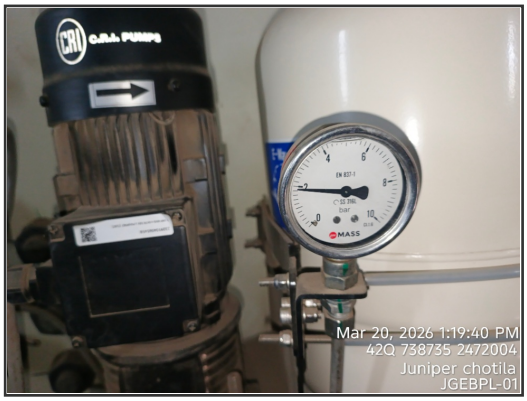	Medium
4.3	Lift operating switch is damaged. **Way Forward:** Replace or repair the lift operating switch immediately and conduct functional checks to ensure safe operation.		High

Ref. No.	Observation / Way Forward	Ref. Photos	Risk Category
4.5	Bird caging observed on lift guide rope. **Way Forward:** Inspect the lift guide rope for damage, replace if necessary, and implement measures to prevent bird nesting near the lift.	 	Medium
5.3	Oil spillage observed on yaw platform. **Way Forward:** Clean the oil spill immediately, identify and repair the source of leakage, and implement regular inspections and spill prevention measures.		Low

Ref. No.	Observation / Way Forward	Ref. Photos	Risk Category
7.1.2	Yaw gear teeth observed dry due to insufficient greasing. **Way Forward:** Apply appropriate grease immediately, inspect for wear or damage, and implement a regular lubrication schedule.	 	Medium
7.1.10	Power cables holding cable socks observed damaged condition. **Way Forward:** Replace damaged cable holding socks and inspect cables for any insulation damage or wear		Medium

Ref. No.	Observation / Way Forward	Ref. Photos	Risk Category
7.1.12	Aviation obstruction lights are not functioning. **Way Forward:** Repair or replace the aviation lights immediately, check power supply and connections, and implement routine functional checks.	 	High
7.2.9	Gearbox breather silica gel is saturated (color changed). **Way Forward:** Replace the silica gel immediately, inspect breather condition, and implement regular monitoring of silica gel status.		Medium

Ref. No.	Observation / Way Forward	Ref. Photos	Risk Category
7.3	The main bearing shrink disc was observed in a corroded condition, and grease leakage was also noted from the main bearing NDE (Non-Drive End) side. **Way Forward:** Clean the affected area, remove corrosion, reapply proper protection, inspect for damage, and rectify source of grease leakage.	 	High
7.4.9	The generator NDE (Non-Drive End) bearing cover hardware was observed in a loose condition. **Way Forward:** Tighten all loose bolts/nuts to the recommended torque as per OEM specifications.		Low

Ref. No.	Observation / Way Forward	Ref. Photos	Risk Category
7.8.1	The nacelle panel filter mat was observed in a dusty condition. **Way Forward:** Clean the filter mat using compressed air or wash (if reusable).		Medium
7.9.3	The nacelle area housekeeping was observed to be not properly maintained. **Way Forward:** Remove dust, debris, and any loose items from the nacelle area	 	High

Ref. No.	Observation / Way Forward	Ref. Photos	Risk Category
7.9.4	Fire extinguisher refilling due date has expired. **Way Forward:** Refill or replace the fire extinguisher immediately and implement a tracking system for timely servicing.	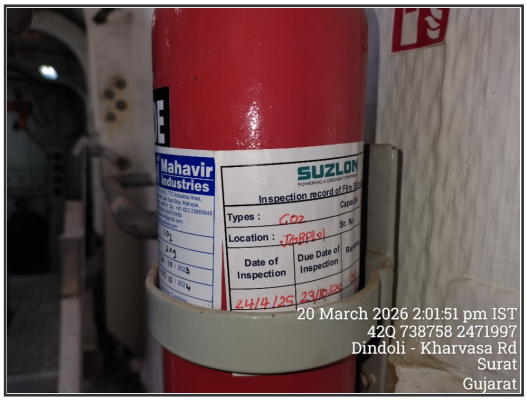	High
7.9.5	First aid kit materials are insufficient. **Way Forward:** Replenish the first aid kit with required materials as per standard checklist and conduct periodic inspections.		High
7.9.9	The gearbox radiator was observed in a dusty condition. **Way Forward:** Clean the radiator thoroughly, ensure proper airflow, and schedule regular cleaning and inspection.		High
8.3.2	Corrosion observed on NOC bracket supporting hardware. **Way Forward:** Remove corrosion, assess hardware condition, replace severely affected parts, and apply anti-corrosion treatment.		Low

Ref. No.	Observation / Way Forward	Ref. Photos	Risk Category
8.3.4	Hub light cable neutral conductor was found unclamped and in bypass condition. **Way Forward:** Properly secure the neutral cable in designated clamps, eliminate bypass condition, and verify connection integrity.	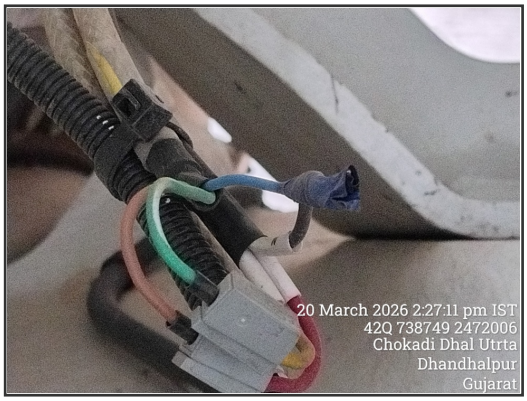 	Medium
8.3.5	Paint cracking observed on blade teeth cover supporting joint. **Way Forward:** Clean the affected area, assess for corrosion, and reapply protective coating/paint as required		Low

Ref. No.	Observation / Way Forward	Ref. Photos	Risk Category
8.4.6	The transformer MOG (Magnetic Oil Level Gauge) is showing the oil level in full condition. **Way Forward:** The transformer MOG (Magnetic Oil Level Gauge) is indicating full oil level however, it needs to be verified whether this is an actual oil level condition or a possible MOG malfunction.		High
8.4.7	The marshalling box cable gland was observed in a missing condition. **Way Forward:** Install suitable cable gland of correct size and specification.	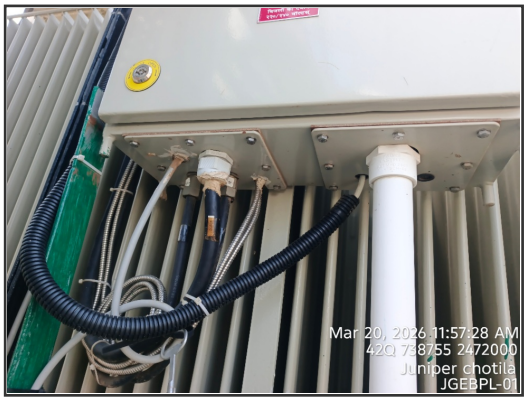	Low
8.5.5	Cotton waste material found on DP isolator pole. **Way Forward:** Remove all cotton waste immediately, clean the area, and implement regular housekeeping checks to prevent recurrence.		High

Note:
1. Risk assessment is based on the observation at time of the inspection.

8. EARTH RESISTANCE MEASUREMENT

Measurement Point / Method	Measurement Reading	Ref. Photos	Risk Category
1	E1- 1.30 Ohm **Way Forward:** Found ok		Acceptable
2	E2-0.70 Ohm **Way Forward:** Found ok		Acceptable
3	E3-0.69 Ohm **Way Forward:** Found ok		Acceptable

Note: Risk assessment is based on the readings at the time of the measurement as above.

9. GENERATOR INSULATION RESISTANCE

Measurement Point / Method	Measurement Reading	Ref. Photos	Risk Category
1. Phase to Earth (P–E)	U TO E - 10.5 G ohm **Way Forward:** Found ok		Acceptable
2. Phase to Earth (P–E)	V TO E - 12.4 G ohm **Way Forward:** Found ok		Acceptable
3. Phase to Earth (P–E)	W TO E - 15.3 G ohm **Way Forward:** Found ok		Acceptable

Measurement Point / Method	Measurement Reading	Ref. Photos	Risk Category
4. Phase to Phase (P–P)	U TO V -13.5 G ohm **Way Forward:** Found ok		Acceptable
5.. Phase to Phase (P–P)	V TO W - 11.1 G ohm **Way Forward:** Found ok		Acceptable
6.. Phase to Phase (P–P)	U TO W - 13.2 G ohm **Way Forward:** Found ok		Acceptable
1. Power Cable IR test- Phase To Earth	R1 TO E- 7.79 G ohm **Way Forward:** Found ok		Acceptable

Measurement Point / Method	Measurement Reading	Ref. Photos	Risk Category
2. Power Cable IR test- Phase To Earth	R2 TO E- 8.98 G ohm **Way Forward:** Found ok		Acceptable
3. Power Cable IR test- Phase To Earth	R3 TO E- 9.01 G ohm **Way Forward:** Found ok	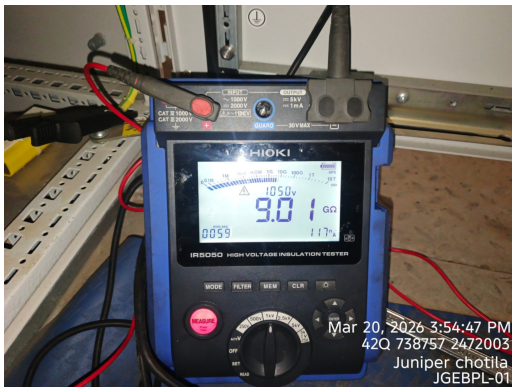	Acceptable
4. Power Cable IR test- Phase To Earth	R4 TO E- 9.59 G ohm **Way Forward:** Found ok		Acceptable
5. Power Cable IR test- Phase To Earth	R5 TO E- 10.1 G ohm **Way Forward:** Found ok		Acceptable

Measurement Point / Method	Measurement Reading	Ref. Photos	Risk Category
6. Power Cable IR test- Phase To Earth	R6 TO E- 8.77 G ohm **Way Forward:** Found ok		Acceptable
7. Power Cable IR test- Phase To Earth	Y1 TO E- 9.52 G ohm **Way Forward:** Found ok		Acceptable
8. Power Cable IR test- Phase To Earth	Y2 TO E- 8.94 G ohm **Way Forward:** Found ok		Acceptable
9. Power Cable IR test- Phase To Earth	Y3 TO E- 8.68 G ohm **Way Forward:** Found ok		Acceptable

Measurement Point / Method	Measurement Reading	Ref. Photos	Risk Category
10. Power Cable IR test- Phase To Earth	Y4 TO E- 9.7 G ohm **Way Forward:** Found ok		Acceptable
11. Power Cable IR test- Phase To Earth	Y5 TO E- 10.3 G ohm **Way Forward:** Found ok		Acceptable
12. Power Cable IR test- Phase To Earth	Y6 TO E- 8.66 G ohm **Way Forward:** Found ok		Acceptable
13. Power Cable IR test- Phase To Earth	B1 TO E- 9.39 G ohm **Way Forward:** Found ok		Acceptable

Measurement Point / Method	Measurement Reading	Ref. Photos	Risk Category
14. Power Cable IR test- Phase To Earth	B2 TO E- 9.66 G ohm **Way Forward:** Found ok		Acceptable
15. Power Cable IR test- Phase To Earth	B3 TO E- 9.07 G ohm **Way Forward:** Found ok		Acceptable
16. Power Cable IR test- Phase To Earth	B4 TO E- 9.10 G ohm **Way Forward:** Found ok		Acceptable
17. Power Cable IR test - Phase To Earth	B5 TO E- 9.24 G ohm **Way Forward:** Found ok	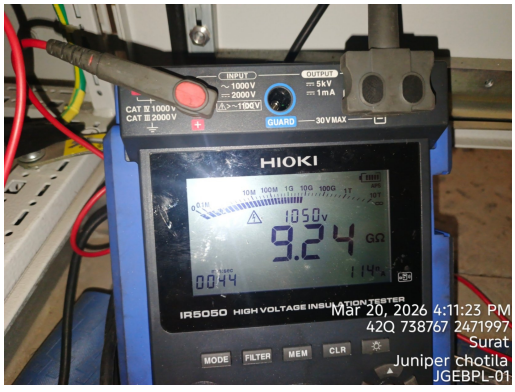	Acceptable

Measurement Point / Method	Measurement Reading	Ref. Photos	Risk Category
18. Power Cable IR test-Phase To Earth	B6 TO E- 7.92 G ohm **Way Forward:** Found ok		Acceptable
19. Power Cable IR test-Phase To Phase	R TO Y- 4.87 G ohm **Way Forward:** Found ok		Acceptable
20. Power Cable IR test-Phase To Phase	Y TO B- 6.46 G ohm **Way Forward:** Found ok		Acceptable
21. Power Cable IR test-Phase To Phase	R TO B- 4.62 G ohm **Way Forward:** Found ok		Acceptable

Note: Risk assessment is based on the IR readings recorded at the time of measurement.

16. BLADE INSPECTION

Measurement Point / Method	Measurement Reading	Ref. Photos	Risk Category
Blade 1(Root Section)	Blade surface observed to be covered with dust accumulation during visual inspection. **Way Forward:** Schedule blade cleaning activity to remove accumulated dust and contaminants, in order to restore optimal aerodynamic performance.		Low
Blade 1 (Middle Section)	Vortex generators (VGs) were observed in a partially removed/damaged condition. **Way Forward:** Inspect all vortex generators (VGs) for condition, alignment, and adhesion.\nRe-fix or replace missing/damaged VGs as per OEM specifications to maintain aerodynamic performance.		Medium
Blade 1 (Tip Section)	Blade surface observed to be covered with dust accumulation during visual inspection. **Way Forward:** Schedule blade cleaning activity to remove accumulated dust and contaminants, in order to restore optimal aerodynamic performance.		Low

Measurement Point / Method	Measurement Reading	Ref. Photos	Risk Category
Blade 2 (Root Section)	Blade surface observed to be covered with dust accumulation during visual inspection. **Way Forward:** Schedule blade cleaning activity to remove accumulated dust and contaminants, in order to restore optimal aerodynamic performance.		Low
Blade 2 (middle Section)	Vortex generators (VGs) were observed in a partially removed/damaged condition. **Way Forward:** Inspect all vortex generators (VGs) for condition, alignment, and adhesion.\nRe-fix or replace missing/damaged VGs as per OEM specifications to maintain aerodynamic performance.		Medium
Blade 2 (Tip Section)	Blade surface observed to be covered with dust accumulation during visual inspection. **Way Forward:** Schedule blade cleaning activity to remove accumulated dust and contaminants, in order to restore optimal aerodynamic performance.		Low
Blade 3 (Root Section)	Blade surface observed to be covered with dust accumulation during visual inspection. **Way Forward:** Schedule blade cleaning activity to remove accumulated dust and contaminants, in order to restore optimal aerodynamic performance.		Low

Measurement Point / Method	Measurement Reading	Ref. Photos	Risk Category
Blade 3 (Middle section)	vortex generators (VGs) were observed in a partially removed/damaged condition. **Way Forward:** Inspect all vortex generators (VGs) for condition, alignment, and adhesion.\nRe-fix or replace missing/damaged VGs as per OEM specifications to maintain aerodynamic performance.	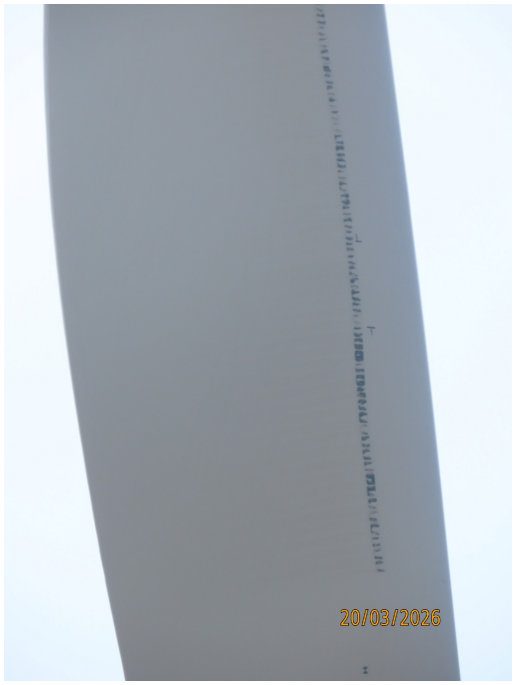	Medium
Blade 3 (Tip Section)	Blade surface observed to be covered with dust accumulation during visual inspection. **Way Forward:** Schedule blade cleaning activity to remove accumulated dust and contaminants, in order to restore optimal aerodynamic performance.		Low

Final Notes:

1. Risk assessment is based on the readings at time of the measurement as above.:
2. Above reading taken for generator IR at:**1000V DC**

Instrument Details:

SIGNATURES:

Demo Representative:	**OEM / OM Representative:**	**Customer Representative:**
Mr. Mallik Srinivas	Mr. Manish	Mr. Lalatendu Sahoo
Ganesh Chaudhari		