


DATA SERIES

Safety performance indicators – 2023 data – Fatal incident reports

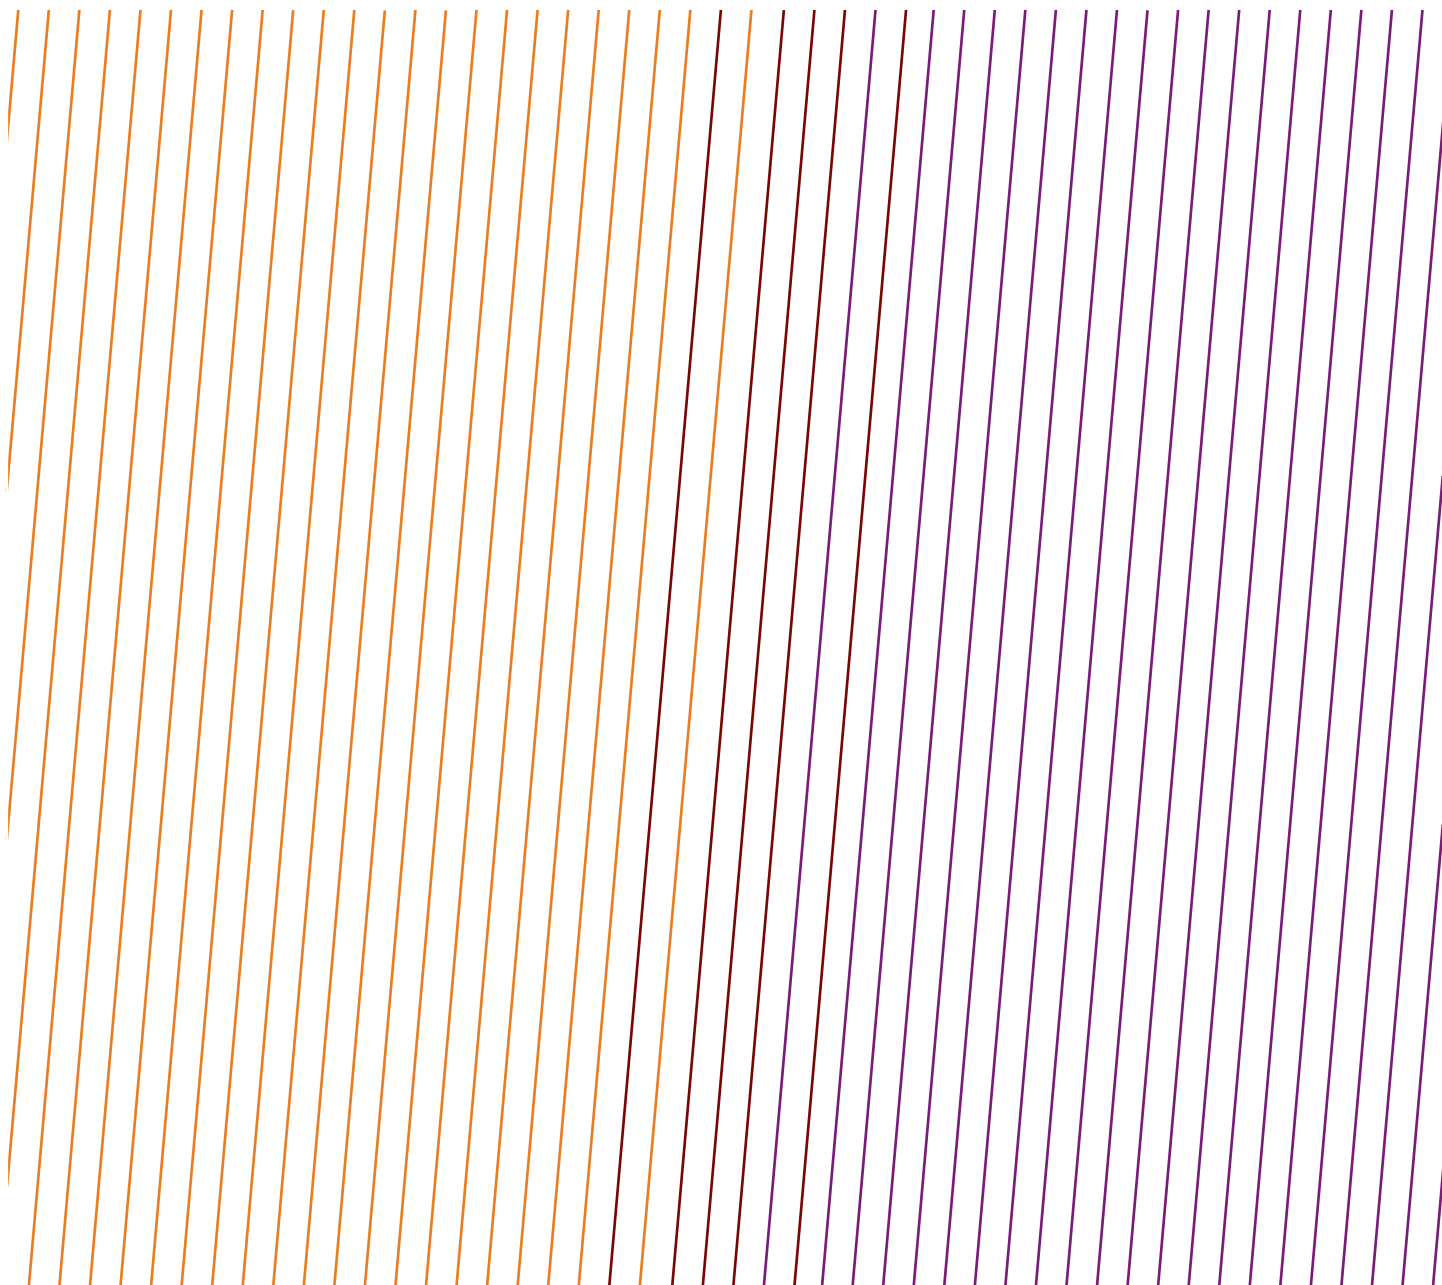

Acknowledgements

IOGP thanks those companies that have participated in the data collection programme.

This report was produced by the Safety Committee.

Feedback

IOGP welcomes feedback on our reports: publications@iogp.org

Disclaimer

Whilst every effort has been made to ensure the accuracy of the information contained in this publication, neither IOGP nor any of its Members past present or future warrants its accuracy or will, regardless of its or their negligence, assume liability for any foreseeable or unforeseeable use made thereof, which liability is hereby excluded. Consequently, such use is at the recipient's own risk on the basis that any use by the recipient constitutes agreement to the terms of this disclaimer. The recipient is obliged to inform any subsequent recipient of such terms.

Please note that this publication is provided for informational purposes and adoption of any of its recommendations is at the discretion of the user. Except as explicitly stated otherwise, this publication must not be considered as a substitute for government policies or decisions or reference to the relevant legislation relating to information contained in it.

Where the publication contains a statement that it is to be used as an industry standard, IOGP and its Members past, present, and future expressly disclaim all liability in respect of all claims, losses or damages arising from the use or application of the information contained in this publication in any industrial application.

Any reference to third party names is for appropriate acknowledgement of their ownership and does not constitute a sponsorship or endorsement.

Copyright notice

The contents of these pages are © International Association of Oil & Gas Producers. Permission is given to reproduce this report in whole or in part provided (i) that the copyright of IOGP and (ii) the sources are acknowledged. All other rights are reserved. Any other use requires the prior written permission of IOGP.

These Terms and Conditions shall be governed by and construed in accordance with the laws of England and Wales. Disputes arising here from shall be exclusively subject to the jurisdiction of the courts of England and Wales.

DATA SERIES

Safety performance indicators – 2023 data

– Fatal incident reports

Revision history		
VERSION	DATE	AMENDMENTS
1.0	June 2024	First release

Contents

AFRICA ONSHORE	5
AFRICA OFFSHORE	8
ASIA/AUSTRALASIA ONSHORE	9
ASIA/AUSTRALASIA OFFSHORE	11
EUROPE ONSHORE	12
EUROPE OFFSHORE	12
MIDDLE EAST ONSHORE	13
MIDDLE EAST OFFSHORE	15
NORTH AMERICA ONSHORE	16
NORTH AMERICA OFFSHORE	18
RUSSIA & CENTRAL ASIA ONSHORE	19
RUSSIA & CENTRAL ASIA OFFSHORE	20
SOUTH & CENTRAL AMERICA ONSHORE	21
SOUTH & CENTRAL AMERICA OFFSHORE	21

AFRICA ONSHORE

DATE: 26 Jun 2023

COUNTRY: Nigeria

NUMBER OF DEATHS: 1

FUNCTION; DRILLING

CAUSE: Struck by (not dropped object)

ACTIVITY: Drilling, workover, well operations

PRIMARY LIFE-SAVING RULE: Energy isolation

SECONDARY LIFE-SAVING RULE: Work authorization

FATALITY

Function: Drilling, **Employer:** Contractor, **Occupation:** Manual labourer, **Body part:** Neck/torso/spine,

Nature of injury: Organ function / loss or damage, **Time in service:** > 1 year < 5 years

NARRATIVE:

The activity on well 2 started on June 17th with the equipment mobilization in location. On June 18th the job officially commenced on site.

The Scope of Work was to carry out maintenance activities on Xmas Tree and ambient valve recalibration. Operation was performed with support of Slick Line service and downhole plug.

During the activity, the team observed the Slick Line and the upper sheave were not moving. In order to fix the issue, the Contractor Supervisor bled off the pressure in the hydraulic hose of the SL stuffing box through the dedicated hydraulic line, and proceeded to slack the cable at the bottom sheave to resume jar action. This brought to failure the pressure equalization across the downhole plug and consequently led to the ejection of the same inside the lubricator which parted and jumped on air. The lubricator ejection determined the Slick Line cable tension and strong knockback. Consequently, the lower sheave, connected to such cable, strongly impacted the IP's chest and chin. IP medical conditions immediately appeared critical. The event led also to a slight gas release.

WHAT WENT WRONG:

- Rigless Programme developed PtW, Risk Assessment, Method of Statement, Isolation Certificate, TBT forms: all available in location, improvement needs have been observed in the procedures coordination and implementation.
- Lack of supervision.
- In presence of an issue (blocked Slick Line sheave), Contractor Supervisor decided to bleed off pressure in the hydraulic hose of the Slick Line stuffing box by pushing the small ball in the check valve seat allowing the hydraulic oil to bleed. This brought to the failure of the pressure equalization and following lubricator's ejection. Operator did not stop the activity to re-assess the Risks.
- The Contractor's personnel competences were not previously assessed before starting the activity due to lack of Procedures. During the contractor's personnel interviews carried out in the Investigation process, competence's gaps appeared evident for some crew members.
- Lack of knowledge on First Aid Operations and Emergency Communications. Night MEDEVAC Operations to be improved.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

- While dealing with high pressure fluids, ensure proper barriers always in place.
- In case the assessed workflow (as per method of statement) changes, proper risk assessment must be done and mitigations identified. It must be treated as management of change.

AFRICA ONSHORE

- Whenever you are planning a job, always take into consideration the operational context and the process conditions.
- All operations (routine and critical ones) require competent person to be performed; their knowledge must be formally assessed prior to start any job.
- In all locations medevac drills must be performed and personnel to be adequately informed and trained about the existent procedures to be implemented.
- Proper communication devices in remote areas are fundamental to manage any emergency situation.
- Ensure safe rescue by medevac of the workers during day & night.
- Stop work authority to be always applied whenever required (anyone is entitled).

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Deviation intentional (by individual or group)

PEOPLE (ACTS): Use of Protective Methods: Personal Protective Equipment not used or used improperly

PEOPLE (ACTS): Inattention/Lack of Awareness: Improper decision making or lack of judgment

PROCESS (CONDITIONS): Work Place Hazards: Hazardous atmosphere (explosive/toxic/asphyxiant)

PROCESS (CONDITIONS): Organizational: Inadequate work standards/procedures

PROCESS (CONDITIONS): Organizational: Poor leadership/organizational culture

DATE: 13 Nov 2023

COUNTRY: Nigeria

NUMBER OF DEATHS: 1

FUNCTION; PRODUCTION

CAUSE: Caught in, under or between (excl. dropped objects)

ACTIVITY: Construction, commissioning, decommissioning

PRIMARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Production, **Employer:** Contractor, **Occupation:** Process/equipment operator,

Body part: Respiratory system, **Nature of injury:** Inhalation, poisoning, intoxication, asphyxiation, drowning,

Time in service: > 1 year < 5 years

NARRATIVE:

While a Business Partner A-frame/Floater handler was attempting to disconnect a pipe floater from an 8-inch pipeline to lower the pipe, his arm became trapped, and the weight of the pipeline and the orientation of the floater dragged him under the water.

WHAT WENT WRONG:

Inadequate hazard identification or risk assessment.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

None allocated.

AFRICA ONSHORE

DATE: 12 Dec 2023

COUNTRY: Nigeria

NUMBER OF DEATHS: 2

FUNCTION; CONSTRUCTION

CAUSE: Assault or violent act

ACTIVITY: Transport - Land

PRIMARY LIFE-SAVING RULE: Other issue – no applicable rule

FATALITY

Function: Construction, **Employer:** Contractor, **Occupation:** Transportation operator,

Body part: Head (incl. mouth, etc.), **Nature of injury:** Cut, Puncture, Scrape, **Time in service:** Unspecified

Function: Construction, **Employer:** Contractor, **Occupation:** Transportation operator,

Body part: Head (incl. mouth, etc.), **Nature of injury:** Cut, Puncture, Scrape, **Time in service:** Unspecified

NARRATIVE:

A contractor convoy was ambushed by unknown gunmen. Four government security personnel and two contractor drivers were fatally injured. Two contractor expats were kidnapped, but were released 17 days later.

WHAT WENT WRONG:

Ambushed by unknown gunmen.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Lack of security.

AFRICA OFFSHORE

DATE: 29 Dec 2023

COUNTRY: Nigeria

NUMBER OF DEATHS: 1

FUNCTION; PRODUCTION

CAUSE: Explosion, fire or burns

ACTIVITY: Transport - Water, incl. marine activity

PRIMARY LIFE-SAVING RULE: Other issue – no applicable rule

FATALITY

Function: Production, **Employer:** Contractor, **Occupation:** Unknown, **Body part:** Leg/knee/hip,

Nature of injury: Burn, **Time in service:** Unspecified

NARRATIVE:

A Pusher Tug with Environmental barge experienced an engine room fire. One of the crew sustained severe burns and was admitted to hospital for treatment and later passed away.

WHAT WENT WRONG:

Unspecified.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Unspecified.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Deviation unintentional (by individual or group)

PEOPLE (ACTS): Use of Protective Methods: Inadequate use of safety systems

PROCESS (CONDITIONS): Protective Systems: Inadequate/defective guards or protective barriers

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate design/specification/management of change

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate maintenance/inspection/testing

PROCESS (CONDITIONS): Work Place Hazards: Hazardous atmosphere (explosive/toxic/asphyxiant)

ASIA/AUSTRALASIA ONSHORE

DATE: 02 Jan 2023

COUNTRY: Malaysia

NUMBER OF DEATHS: 1

FUNCTION; PRODUCTION

CAUSE: Falls from height

ACTIVITY: Construction, commissioning, decommissioning

PRIMARY LIFE-SAVING RULE: Working at height

FATALITY

Function: Production, **Employer:** Contractor, **Occupation:** Other, **Body part:** Head (incl. mouth, etc.),

Nature of injury: Unspecified, **Time in service:** > 1 year < 5 years

NARRATIVE:

Fall from height during scaffolding dismantling at project fabrication site.

WHAT WENT WRONG:

During the incident, the scaffolder was dismantling the cantilever scaffold when the scaffold frame suddenly tilted after the he stepped onto the ledger box-tie member. This caused the scaffolder to lose his balance and fall onto the ground, together with the scaffolding structure. The scaffolder was observed hooking his full-body harness to the scaffold frame instead of the lifeline.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Lifeline to be properly designed and installed. Visually mark the lifeline for easy identification and enforce safety harness to be secured/hooked to the lifeline at all times while working at height.

DATE: 22 Jun 2023

COUNTRY: Pakistan

NUMBER OF DEATHS: 2

FUNCTION; PRODUCTION

CAUSE: Explosion, fire or burns

ACTIVITY: Transport - Land

PRIMARY LIFE-SAVING RULE: Driving

FATALITY

Function: Production, **Employer:** Contractor, **Occupation:** Transportation operator, **Body part:** Respiratory system,

Nature of injury: Burn, **Time in service:** Unspecified

Function: Production, **Employer:** Contractor, **Occupation:** Transportation operator, **Body part:** Respiratory system,

Nature of injury: Burn, **Time in service:** Unspecified

NARRATIVE:

Contractor bowser, filled with crude oil, left the plant around 3 pm. While commuting from the plant to a refinery, at 10.45 pm, the bowser rolled over and caught fire, resulting in the driver's death. The helper suffered a burn injury and was immediately transported to hospital but later also lost his life.

WHAT WENT WRONG:

System of supervision was ineffective.

ASIA/AUSTRALASIA ONSHORE

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Introduce the continuous speed check for HAZMAT transportation.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Deviation unintentional (by individual or group)

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate design/specification/management of change

PROCESS (CONDITIONS): Work Place Hazards: Hazardous atmosphere (explosive/toxic/asphyxiant)

PROCESS (CONDITIONS): Organizational: Inadequate work standards/procedures

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

PROCESS (CONDITIONS): Organizational: Inadequate communication

DATE: 22 May 2023

COUNTRY: Pakistan

NUMBER OF DEATHS: 6

FUNCTION; UNSPECIFIED

CAUSE: Assault or violent act

ACTIVITY: Production operations

PRIMARY LIFE-SAVING RULE: Other issue – no applicable rule

FATALITY

Function: Unspecified, **Employer:** Contractor, **Occupation:** Unknown, **Body part:** Internal organs,
Nature of injury: Unspecified, **Time in service:** Unspecified

Function: Unspecified, **Employer:** Contractor, **Occupation:** Unknown, **Body part:** Internal organs,
Nature of injury: Unspecified, **Time in service:** Unspecified

Function: Unspecified, **Employer:** Contractor, **Occupation:** Unknown, **Body part:** Internal organs,
Nature of injury: Unspecified, **Time in service:** Unspecified

Function: Unspecified, **Employer:** Contractor, **Occupation:** Unknown, **Body part:** Internal organs,
Nature of injury: Unspecified, **Time in service:** Unspecified

Function: Unspecified, **Employer:** Contractor, **Occupation:** Unknown, **Body part:** Internal organs,
Nature of injury: Unspecified, **Time in service:** Unspecified

Function: Unspecified, **Employer:** Contractor, **Occupation:** Unknown, **Body part:** Internal organs,
Nature of injury: Unspecified, **Time in service:** Unspecified

NARRATIVE:

Terror attack - no further information.

WHAT WENT WRONG:

Terror attack - no further information.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Terror attack - no further information.

ASIA/AUSTRALASIA OFFSHORE

DATE: 02 Jun 2023

COUNTRY: Australia

NUMBER OF DEATHS: 1

FUNCTION; PRODUCTION

CAUSE: Struck by (not dropped object)

ACTIVITY: Maintenance, inspection, testing

PRIMARY LIFE-SAVING RULE: Working at height

FATALITY

Function: Production, **Employer:** Contractor, **Occupation:** Maintenance, craftsman,

Body part: Head (incl. mouth, etc.), **Nature of injury:** Unspecified, **Time in service:** 10 + years

NARRATIVE:

Fatality of a rope access technician whilst performing inspection tasks.

WHAT WENT WRONG:

Pending formal investigation outcome.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Pending formal investigation outcome.

DATE: 07 Apr 2023

COUNTRY: Malaysia

NUMBER OF DEATHS: 1

FUNCTION; DRILLING

CAUSE: Caught in, under or between (excl. dropped objects)

ACTIVITY: Drilling, workover, well operations

PRIMARY LIFE-SAVING RULE: Safe mechanical lifting

SECONDARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Drilling, **Employer:** Contractor, **Occupation:** Drilling/well servicing operator, **Body part:** Neck/torso/spine,

Nature of injury: Crushing, **Time in service:** 10 + years

NARRATIVE:

While removing the Christmas tree using air tuggers, the securing bracket for the air tugger failed. This caused the air tugger winch to rotate and fatally crush the IP against a steel I-beam.

WHAT WENT WRONG:

Location of tugger controls required the floorman to stand between tugger and I-beam. Potential for tugger movement and line of fire hazard was not identified. Tugger swivel pedestal base was modified from the original design without documented engineering review or management of change. Previous tugger incidents involving swivel base malfunction and failure were undocumented and not shared.

ASIA/AUSTRALASIA OFFSHORE

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

- Install OEM-available remote operation capability for tuggers and establish criteria for remote operation to manage line of fire hazard. Implement physical walk through upon installation to identify and mitigate crush points.
- Ensure lifting equipment permanently installed on adjustable foundations is engineered, fabricated, and installed per approved design and modifications are in accordance with management of change processes (contractor).
- Prohibit work on critical equipment outside of the maintenance system.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Deviation unintentional (by individual or group)

EUROPE ONSHORE

No fatal incidents reported.

EUROPE OFFSHORE

No fatal incidents reported.

MIDDLE EAST ONSHORE

DATE: 12 Mar 2023

COUNTRY: Kuwait

NUMBER OF DEATHS: 2

FUNCTION; PRODUCTION

CAUSE: Explosion, fire or burns

ACTIVITY: Maintenance, inspection, testing

PRIMARY LIFE-SAVING RULE: Bypassing safety controls

SECONDARY LIFE-SAVING RULE: Energy isolation

FATALITY

Function: Production, **Employer:** Contractor, **Occupation:** Maintenance, craftsman, **Body part:** Unspecified,

Nature of injury: Burn, **Time in service:** Unspecified

Function: Production, **Employer:** Contractor, **Occupation:** Maintenance, craftsman, **Body part:** Unspecified,

Nature of injury: Burn, **Time in service:** Unspecified

NARRATIVE:

On the day of the incident the gathering center was under total shutdown. The job was to replace the corroded 42" tank vapour gas piping. The activity was performed by cold cutting by the contractor. While cold cutting, an explosion and fire occurred that resulted in two contractor fatalities, 12 lost work day cases, and 1 minor injury. Emergency responders attended. The fire was extinguished by fire crew. The employees were transferred to medical facilities by ambulance. The deceased person was taken by Forensic medical department.

WHAT WENT WRONG:

Workers in the line of fire.

Underestimated the associated hazard of work location and activity.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

- Ensure Method Statement for Critical Activities includes all potential hazards and precautions to eliminate/mitigate hazards and ensure compliance.
- Ensure close follow-up between all the maintenance and contractors during facility shutdown.

MIDDLE EAST ONSHORE

DATE: 28 Jun 2023

COUNTRY: Kuwait

NUMBER OF DEATHS: 1

FUNCTION; UNSPECIFIED

CAUSE: Pressure release

ACTIVITY: Production operations

PRIMARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Production, **Employer:** Contractor, **Occupation:** Process/equipment operator,

Body part: Neck/torso/spine, **Nature of injury:** Inhalation, poisoning, intoxication, asphyxiation, drowning,

Time in service: > 1 year < 5 years

NARRATIVE:

When a Production crew was conducting routine well monitoring and troubleshooting, they noticed a spill from a nearby pipeline. The crew approached the spill site to investigate. Upon arriving at the site, the crew saw the water disposal pipeline had failed, and a pinhole was sending high-pressure produced water into the desert sand, creating a five metre-wide and two metre-deep whirlpool. During this observation, one of the workers slipped into the newly formed whirlpool. Crew members made several attempts to rescue him and were finally able to retrieve him from the water. One of the rescuers went into the hole and had to be rescued without any further harm. Emergency Medical arrived on site to begin advanced life-saving techniques but were unsuccessful.

WHAT WENT WRONG:

Unaware of surroundings.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Not available.

PROCESS SAFETY FUNDAMENTAL:

We respect hazards

MIDDLE EAST ONSHORE

DATE: 2 May 2023

COUNTRY: Oman

NUMBER OF DEATHS: 1

FUNCTION; UNSPECIFIED

CAUSE: Exposure noise, chemical, biological, vibration, extreme temperature

ACTIVITY: Drilling, workover, well operations

PRIMARY LIFE-SAVING RULE: Other issue – no applicable rule

FATALITY

Function: Unspecified, **Employer:** Contractor, **Occupation:** Manual labourer, **Body part:** Respiratory system,

Nature of injury: Inhalation, poisoning, intoxication, asphyxiation, drowning, **Time in service:** 10 + years

NARRATIVE:

At approximately 2:55 am, a contractor was performing circulation prior to cement on well, when the wellhead started leaking fluid with hydrogen sulphide (H₂S) release. A total of 7 people were reported to be impacted (1 deceased, 4 transferred to hospital and stable, 2 examined at site clinic). The well was secured (BOP shut-in) and the location was evacuated.

WHAT WENT WRONG:

Death from H₂S exposure.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Unspecified.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Deviation intentional (by individual or group)

PEOPLE (ACTS): Use of Protective Methods: Equipment or materials not secured

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate/defective tools/equipment/materials/products

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

PROCESS (CONDITIONS): Organizational: Inadequate supervision

PROCESS (CONDITIONS): Organizational: Poor leadership/organizational culture

MIDDLE EAST OFFSHORE

No fatal incidents reported.

NORTH AMERICA ONSHORE

DATE: 16 May 2023

COUNTRY: USA

NUMBER OF DEATHS: 1

FUNCTION; PRODUCTION

CAUSE: Exposure electrical

ACTIVITY: Construction, commissioning, decommissioning

PRIMARY LIFE-SAVING RULE: Safe mechanical lifting

SECONDARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Construction, **Employer:** Contractor, **Occupation:** Heavy equipment operator, **Body part:** Internal organs, **Nature of injury:** Electric shock, **Time in service:** Unspecified

NARRATIVE:

A contractor was operating a forklift when the forklift contacted an energized overhead power line, causing the death of the contractor and equipment damage.

WHAT WENT WRONG:

Incident currently under investigation.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Incident currently under investigation.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Work or motion at improper speed

PEOPLE (ACTS): Use of Tools, Equipment, Materials and Products: Improper use/position of tools/equipment/materials/products

PEOPLE (ACTS): Inattention/Lack of Awareness: Improper decision making or lack of judgment

PROCESS (CONDITIONS): Work Place Hazards: Inadequate surfaces, floors, walkways or roads

PROCESS (CONDITIONS): Work Place Hazards: Storms or acts of nature

NORTH AMERICA ONSHORE

DATE: 24 Feb 2023

COUNTRY: USA

NUMBER OF DEATHS: 1

FUNCTION; PRODUCTION

CAUSE: Exposure noise, chemical, biological, vibration, extreme temperature

ACTIVITY: Maintenance, inspection, testing

PRIMARY LIFE-SAVING RULE: Bypassing safety controls

SECONDARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Production, **Employer:** Company, **Occupation:** Process/equipment operator, **Body part:** Respiratory,

Nature of injury: Inhalation, poisoning, intoxication, asphyxiation, drowning, **Time in service:** Unspecified

NARRATIVE:

Worker was managing high fluid levels in the low pressure knock out (LPKO) vessel while bringing wells online at the facility and was found unresponsive.

WHAT WENT WRONG:

Unexpected release.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Review small building design with focus on ventilation and alarms. Reinforce existing practice of not draining process fluids within enclosed spaces or near ignition sources. Reinforce use of personal multi-gas protection monitors to verify acceptable atmospheric conditions, especially prior to building/enclosure entry and during activities involving process fluids. Ensure lone worker policies and safety-critical tools are functioning as intended – including calibration and testing – and supervisors are accountable for monitoring use and adherence.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Work or motion at improper speed

PEOPLE (ACTS): Inattention/Lack of Awareness: Fatigue

PROCESS (CONDITIONS): Organizational: Inadequate communication

PROCESS (CONDITIONS): Organizational: Failure to report/learn from events

NORTH AMERICA ONSHORE

DATE: 25 Oct 2023

COUNTRY: USA

NUMBER OF DEATHS: 1

FUNCTION; PRODUCTION

CAUSE: Dropped objects

ACTIVITY: Transport - Land

PRIMARY LIFE-SAVING RULE: Driving

SECONDARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Production, **Employer:** Company, **Occupation:** Foreman, Supervisor, **Body part:** Neck/torso/spine, **Nature of injury:** Major/multiple system trauma, **Time in service:** 10 + years

NARRATIVE:

Company vehicle was traveling in their lane of traffic and was approaching another vehicle going in the opposite direction. The other vehicle was hauling a trailer that was loaded with a compressor. The loaded compressor became loose and fell into the path of the company vehicle. The IP was transported to hospital where they passed away from injuries sustained in the collision.

WHAT WENT WRONG:

Load shifted and fell off the trailer from a vehicle travelling in the opposite direction.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Currently under litigation hold.

CAUSAL FACTORS:

PEOPLE (ACTS): Inattention/Lack of Awareness: Improper decision making or lack of judgment

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate/defective tools/equipment/materials/products

NORTH AMERICA OFFSHORE

No fatal incidents reported.

RUSSIA & CENTRAL ASIA ONSHORE

DATE: 26 Jun 2023

COUNTRY: Azerbaijan

NUMBER OF DEATHS: 2

FUNCTION; PRODUCTION

CAUSE: Caught in, under or between (excl. dropped objects)

ACTIVITY: Transport - Land

PRIMARY LIFE-SAVING RULE: Driving

FATALITY

Function: Production, **Employer:** Company, **Occupation:** Heavy equipment operator,

Body part: Head (incl. mouth, etc.), **Nature of injury:** Crushing, **Time in service:** 10 + years

Function: Production, **Employer:** Company, **Occupation:** Heavy equipment operator,

Body part: Head (incl. mouth, etc.), **Nature of injury:** Crushing, **Time in service:** 10 + years

NARRATIVE:

The driver of a cementing plant truck, lost control and the truck rolled into a ravine.

An ambulance and rescue squad called to the scene reported that the driver died at the scene. The machinist passenger suffered a head injury and broken arm and was taken by ambulance to the hospital but died after three hours.

WHAT WENT WRONG:

The driver did not know the route well and could not determine the direction correctly because he was driving the road for the first time.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

- Effective control over the physical and psychological state of the driver and the serviceability of the vehicle before the trip.
- Improving the control system for safe vehicle operation (speed control, sudden braking/acceleration, etc.).
- Regularly involving drivers in “Safe Driving” courses.

RUSSIA & CENTRAL ASIA OFFSHORE

DATE: 24 Aug 2023

COUNTRY: Azerbaijan

NUMBER OF DEATHS: 2

FUNCTION; CONSTRUCTION

CAUSE: Water related, drowning

ACTIVITY: Lifting, crane, rigging, deck operations

PRIMARY LIFE-SAVING RULE: Work authorization

SECONDARY LIFE-SAVING RULE: Safe mechanical lifting

FATALITY

Function: Construction, **Employer:** Company, **Occupation:** Other, **Body part:** Respiratory system,

Nature of injury: Inhalation, poisoning, intoxication, asphyxiation, drowning, **Time in service:** 10 + years

Function: Construction, **Employer:** Company, **Occupation:** Maintenance, craftsman, **Body part:** Respiratory system,

Nature of injury: Inhalation, poisoning, intoxication, asphyxiation, drowning, **Time in service:** 10 + years

NARRATIVE:

While trying to start unloading new concrete slabs from the vessel and loading them onto the offshore platform, 2 employees of the oil and gas construction trust, a welder and a fitter, fell into the water because of failure of the old concrete slab of the platform. After search and rescue efforts, involving divers, bodies were found and taken out of the water.

WHAT WENT WRONG:

Failure of planning, lack of pre-task workplace inspection, overloading of load bearing structure. All jurisdictions require the use of a life jacket or PFD (personal floatation devices) when there is the risk of drowning but proper equipment was not used.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Before starting any loading, the work area is to be inspected, and load bearing capacity calculated. Permit to work should only be authorized and obtained after workplace inspection with proper identification of red zones. An approved life jacket should be used by all personnel while on offshore platform operation.

CAUSAL FACTORS:

PROCESS (CONDITIONS): Protective Systems: Inadequate/defective guards or protective barriers

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate maintenance/inspection/testing

PROCESS (CONDITIONS): Organizational: Inadequate work standards/procedures

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

PROCESS (CONDITIONS): Organizational: Inadequate supervision

SOUTH & CENTRAL AMERICA ONSHORE

No fatal incidents reported.

SOUTH & CENTRAL AMERICA OFFSHORE

No fatal incidents reported.

For the full analysis of 2023 results,
as well as all fatal incident reports
submitted to IOGP since 1991,
visit IOGP's data website at:
<https://data.iogp.org>

IOGP Headquarters

City Tower, 40 Basinghall Street, London EC2V 5DE, United Kingdom
T: +44 20 4570 6879
E: reception@iogp.org

www.iogp.org

IOGP Americas

T: +1 281 219 9908
E: reception-americas@iogp.org

IOGP Asia Pacific

T: +61 7 2139 9714
E: reception-asiapacific@iogp.org

IOGP Europe

T: +32 2 882 16 53
E: reception-europe@iogp.org

IOGP Middle East & Africa

T: +244 226 434 245
E: reception-mea@iogp.org