


DATA SERIES

Safety performance indicators – 2025 data – Fatal incident reports

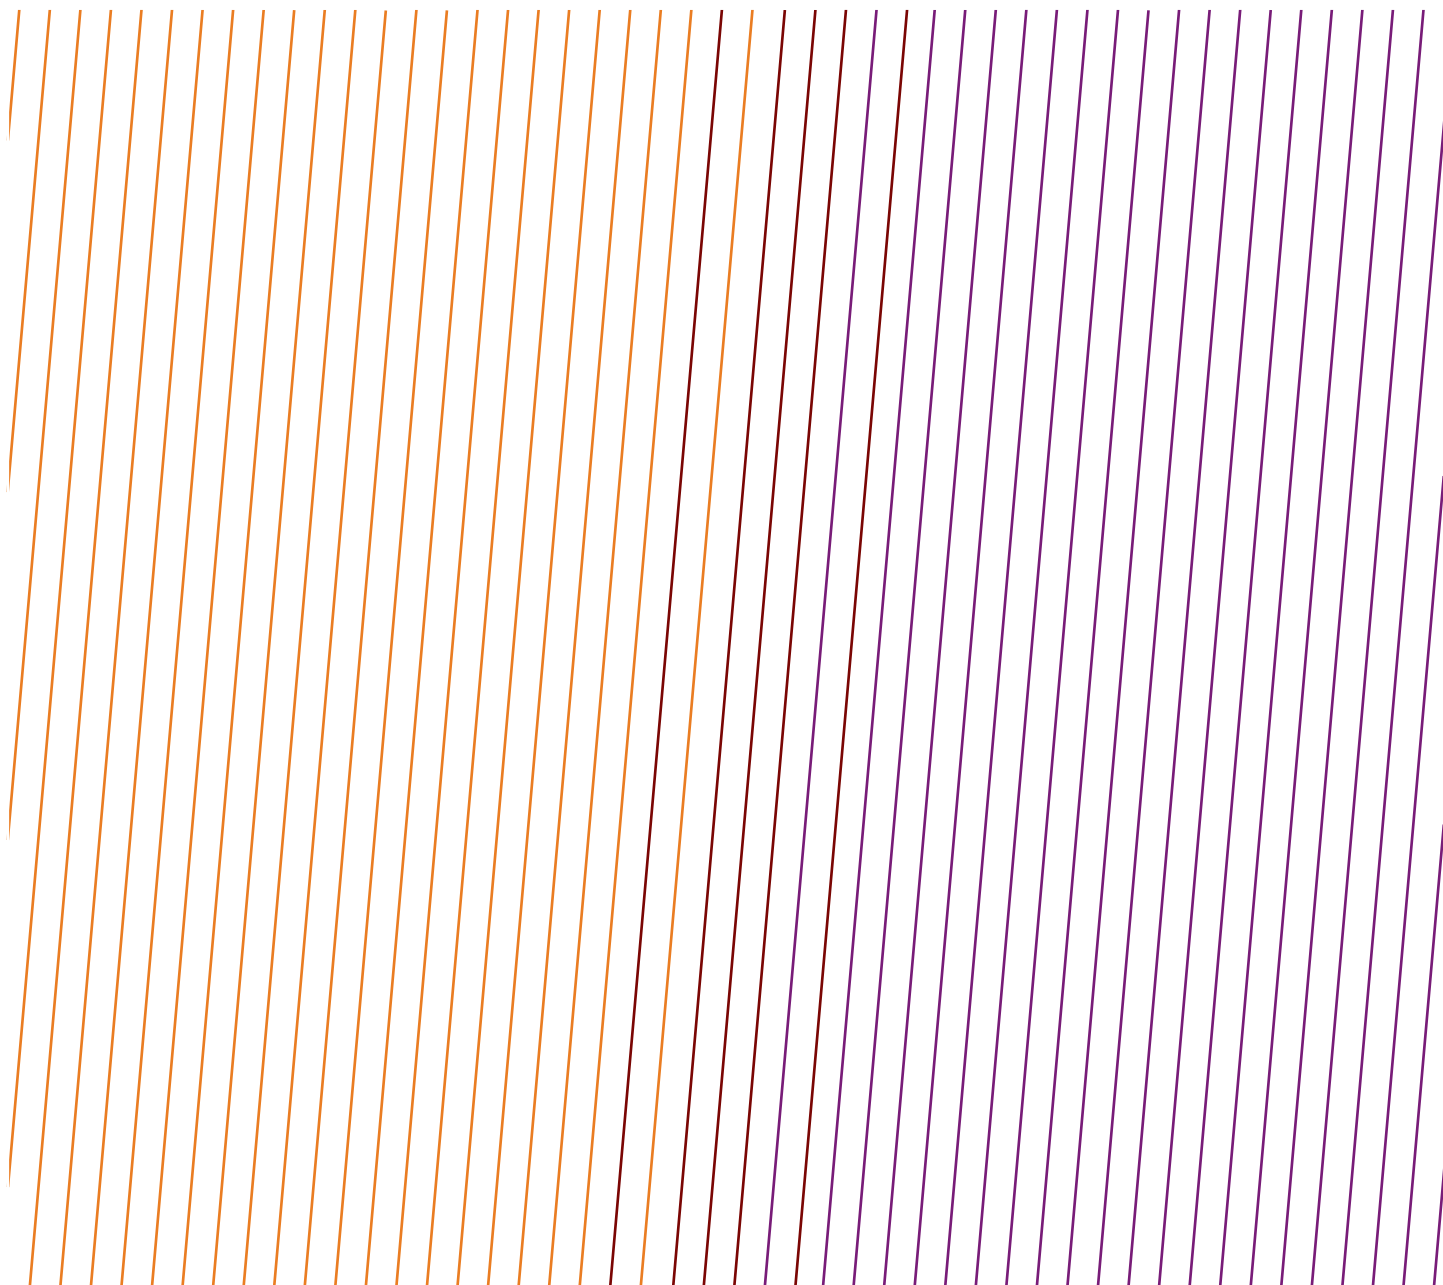

Acknowledgements

IOGP thanks those companies that have participated in the data collection programme.

This Report was produced by the Safety Committee.

Feedback

IOGP welcomes feedback on our reports: publications@iogp.org

Disclaimer

Whilst every effort has been made to ensure the accuracy of the information contained in this publication and any associated material, neither IOGP nor any of its Members past present or future warrants its accuracy or will, regardless of its or their negligence, assume liability for any foreseeable or unforeseeable use made thereof, which liability is hereby excluded. Consequently, such use is at the recipient's own risk on the basis that any use by the recipient constitutes agreement to the terms of this disclaimer. The recipient is obliged to inform any subsequent recipient of such terms.

Please note that this publication and any associated material is provided for informational purposes and adoption of any of its recommendations is at the discretion of the user. Except as explicitly stated otherwise, this publication must not be considered as a substitute for government policies or decisions or reference to the relevant legislation relating to information contained in it.

Where the publication contains a statement that it is to be used as an industry standard, IOGP and its Members past, present, and future expressly disclaim all liability in respect of all claims, losses or damages arising from the use or application of the information contained in this publication in any industrial application.

Any reference to third party names is for appropriate acknowledgement of their ownership and does not constitute a sponsorship or endorsement.

Copyright notice

This publication and the contents of these pages are © International Association of Oil & Gas Producers™ ("IOGP™"). Permission is given to reproduce, quote from, republish, redistribute, and recommunicate this publication in whole or in part for purposes without independent economic value and provided that (i) International Association of Oil & Gas Producers is always acknowledged as the source, together with the words "© International Association of Oil & Gas Producers™ ("IOGP™")", and (ii) any acknowledgments of other sources as may appear in this publication, in respect of such material, are included unaltered. All other rights are reserved.

These Terms and Conditions shall be governed by and construed in accordance with the laws of England and Wales. Disputes arising here from shall be exclusively subject to the jurisdiction of the courts of England and Wales.

DATA SERIES

Safety performance indicators – 2025 data

– Fatal incident reports

Revision history		
VERSION	DATE	AMENDMENTS
1.0	June 2026	First release

Contents

AFRICA ONSHORE	5
AFRICA OFFSHORE	7
ASIA/AUSTRALASIA ONSHORE	11
ASIA/AUSTRALASIA OFFSHORE	19
EUROPE ONSHORE	22
EUROPE OFFSHORE	23
MIDDLE EAST ONSHORE	24
MIDDLE EAST OFFSHORE	30
NORTH AMERICA ONSHORE	31
NORTH AMERICA OFFSHORE	34
RUSSIA & CENTRAL ASIA ONSHORE	35
RUSSIA & CENTRAL ASIA OFFSHORE	41
SOUTH & CENTRAL AMERICA ONSHORE	43
SOUTH & CENTRAL AMERICA OFFSHORE	45

AFRICA ONSHORE

DATE: 20 May 2025

COUNTRY: Nigeria

NUMBER OF DEATHS: 1

FUNCTION: Construction

CAUSE: Dropped objects

ACTIVITY: Construction, commissioning, decommissioning

PRIMARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Construction, Employer: Contractor, Occupation: Heavy equipment operator,

Body part: Head (incl. mouth, etc.), Nature of injury: Crushing, Time in service: > 6 months < 1 year

NARRATIVE:

At about 0840 hrs a rigger working on the site was impacted by a heavy-duty equipment (excavator), when a hydraulic pressure hose in the excavator failed, leading to a sudden release of its bucket and resulting in serious injury of the Injured Person (IP). The IP was medevaced to the contractor retainership hospital, from where he was referred to another hospital where he was confirmed dead at about 1112 hrs.

WHAT WENT WRONG:

1. Equipment failure
2. Inadequate preventive maintenance
3. Unsafe positioning of personnel
4. Inadequate risk assessment and planning
5. Insufficient communication and supervision

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

1. Post equipment checks at site is important to uncover latent issues.
2. Lack of intervention culture allows unsafe practices to persist.
3. Habituation to risky acts creates normalization.
4. Promote a learner mindset by clarifying reportability and feedback loops.
5. Supervisory lapses lead to unsafe work practices.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate/defective tools/equipment/materials/products

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate maintenance/inspection/testing

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

PROCESS (CONDITIONS): Organizational: Inadequate communication

PROCESS (CONDITIONS): Organizational: Inadequate supervision

AFRICA ONSHORE

DATE: 01 Jun 2025

COUNTRY: Nigeria

NUMBER OF DEATHS: 1

FUNCTION: Construction

CAUSE: Exposure noise, chemical, biological, vibration, extreme temperature

ACTIVITY: Maintenance, inspection, testing

PRIMARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Construction, Employer: Contractor, Occupation: Maintenance, craftsman, Body part: Head (incl. mouth, etc.), Nature of injury: Bite, sting, animal attack, allergic reaction, Time in service: > 1 year < 5 years

NARRATIVE:

At approximately 4.30 pm 1st June 2025, a contractor worker on a project was fatally injured when a swarm of bees attacked him and his work crew on the electrical transmission line Right of Way work site.

WHAT WENT WRONG:

1. Environmental hazard was not adequately identified.
2. Task Risk Assessment/Job Safety Analysis (TRA/JSA) did not sufficiently cover biological (reptiles, bees etc) hazards.
3. Inadequate controls for known/possible bee presence.
4. Medical readiness was not sufficient for anaphylaxis.
5. Supervision and stop-work triggers were not strong enough.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

1. Unplanned work introduces high risk and must be strictly controlled.
2. Environmental and biological hazards must be fully integrated into risk assessments.
3. Hazard controls must consider panic and human behaviour.
4. Terrain risk significantly impacts emergency outcomes.
5. Emergency preparedness must be task-specific and location-specific.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

PEOPLE (ACTS): Inattention/Lack of Awareness: Improper decision making or lack of judgment

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate design/specification/management of change

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

AFRICA OFFSHORE

DATE: 14 May 2025

COUNTRY: Angola

NUMBER OF DEATHS: 1

FUNCTION: Production

CAUSE: Caught in, under or between (excl. dropped objects)

ACTIVITY: Lifting, crane, rigging, deck operations

PRIMARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Production, Employer: Contractor, Occupation: Other, Body part: Leg/knee/hip,

Nature of injury: Fracture, Time in service: -

NARRATIVE:

During backloading operation from a Drilling RIG to Platform Supply Vessel (PSV), a bundle of five 10"3/4 inch casing joints stacked on the deck of the PSV rolled over 2 deck crew (slingers).

29 x tubulars were already loaded (3 bundles x 5, 4 bundles x 3 and 2 x singles tubulars). 20 seconds after the last lift, the IPs were in front of the bundles rearranging the slings (in line of fire). IP1 had 1 leg trapped under the knee, IP2 (FAT) had 2 legs trapped under the knee. The rescue attempts freed IP1 (LTI) but resulted in the rest of the bundle collapsing on IP2. A tourniquet was applied on both legs and Cardiopulmonary Resuscitation (CPR) was performed but was unsuccessful.

WHAT WENT WRONG:

1. Work preparation less than adequate: The risk analysis of the backloading operation did not identify the risk of tubular movement and personnel being crushed and therefore control measures were not implemented. There was also no lifting plan.
2. Equipment Guard/Tools not appropriate: No securing means have been used (wooden wedges, stanchions, ...) to mitigate the risk of tubular movement.
3. Supervision missing: There was no clear supervision of the loading operation. Nobody stopped the operation as it was being performed.
4. Rules not enforced: The recommendations for tubulars handling detailed in the Supply Vessel operation manual have not been implemented by the vessel technical operator.
5. Lack of regular visits/audits on safety aspects on PSV while in operation offshore.
6. No Training: No dedicated slinger/banksman training on PSV.
7. Rescue medical assistance: Lack of strong experience in emergency care on RIG.
- 8 Contractor selection - Absence of corrective action: No improvement plan developed after contract award of contractor with low HSE score.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

- Laydown areas to be taken into consideration in risk analysis and lifting plans.
- Clarify responsibilities for marine operations within the 500m zone around installations.
- Ensure supervision on vessels.
- Emergency scenarios including Medevac from vessels to be included and tested.

AFRICA OFFSHORE

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

PEOPLE (ACTS): Use of Protective Methods: Equipment or materials not secured

PROCESS (CONDITIONS): Protective Systems: Inadequate/defective guards or protective barriers

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate/defective tools/equipment/materials/products

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate maintenance/inspection/testing

PROCESS (CONDITIONS): Organizational: Inadequate training/competence

PROCESS (CONDITIONS): Organizational: Inadequate work standards/procedures

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

PROCESS (CONDITIONS): Organizational: Inadequate supervision

DATE: 20 May 2025

COUNTRY: Angola

NUMBER OF DEATHS: 4

NUMBER OF PERMANENT IMPAIRMENT INJURIES: 4

FUNCTION: Production

CAUSE: Explosion, fire or burns

ACTIVITY: Maintenance, inspection, testing

PRIMARY LIFE-SAVING RULE: Hot work

SECONARY LIFE-SAVING RULE: Energy isolation

FATALITY

Function: Construction, Employer: Contractor, Occupation: Unknown, Body part: Head (incl. mouth, etc.),
Nature of injury: Burn, Time in service: -

FATALITY

Function: Construction, Employer: Contractor, Occupation: Unknown, Body part: Internal organs,
Nature of injury: Burn, Time in service: -

FATALITY

Function: Construction, Employer: Contractor, Occupation: Unknown, Body part: Internal organs,
Nature of injury: Burn, Time in service: -

FATALITY

Function: Construction, Employer: Contractor, Occupation: Unknown, Body part: Internal organs,
Nature of injury: Burn, Time in service: -

PERMANENT IMPAIRMENT

PI Category: Unspecified, PI Subcategory: Unspecified, Body part: Head (incl. mouth, etc.), Nature of injury: Burn,
Time in service: -, Function: Construction, Employer: Contractor, Occupation: Unknown, Body part: Head (incl.
mouth, etc.), Nature of injury: Burn, Time in service: -

AFRICA OFFSHORE

PERMANENT IMPAIRMENT

PI Category: Unspecified, PI Subcategory: Unspecified, Body part: Head (incl. mouth, etc.), Nature of injury: Burn, Time in service: -, Function: Construction, Employer: Contractor, Occupation: Unknown, Body part: Head (incl. mouth, etc.), Nature of injury: Burn, Time in service: -

PERMANENT IMPAIRMENT

PI Category: Unspecified, PI Subcategory: Unspecified, Body part: Head (incl. mouth, etc.), Nature of injury: Burn, Time in service: -, Function: Construction, Employer: Contractor, Occupation: Unknown, Body part: Head (incl. mouth, etc.), Nature of injury: Burn, Time in service: -

PERMANENT IMPAIRMENT

PI Category: Unspecified, PI Subcategory: Unspecified, Body part: Head (incl. mouth, etc.), Nature of injury: Burn, Time in service: -, Function: Construction, Employer: Contractor, Occupation: Unknown, Body part: Head (incl. mouth, etc.), Nature of injury: Burn, Time in service: -

NARRATIVE:

Crews were performing flange management on the water 16" and 18' lines and installation of the blind flange on the 24' overboard line for hydrotest. During the process, crew encountered a clash with an abandoned open 18' line and started hot cutting the 18' line to make room to install a blind flange. Fire broke out at worksite, resulting in 17 people injured (including first aid cases) and 1 person missing.

WHAT WENT WRONG:

Fire or burn.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Pending Investigation.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Deviation unintentional (by individual or group)

PEOPLE (ACTS): Inattention/Lack of Awareness: Improper decision making or lack of judgment

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate design/specification/management of change

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

AFRICA OFFSHORE

DATE: 23 Aug 2025
COUNTRY: Cameroon
NUMBER OF DEATHS: 1
FUNCTION: Unspecified
CAUSE: Unspecified - Other
ACTIVITY: Unspecified - other
PRIMARY LIFE-SAVING RULE: Confined space
SECONARY LIFE-SAVING RULE: Work authorization

FATALITY

Function: Unspecified, Employer: Company, Occupation: Unknown, Body part: Unspecified,
Nature of injury: Unspecified, Time in service: -

NARRATIVE:

Fatal Accident in cargo Tank.

WHAT WENT WRONG:

No details provided.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

No details provided.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Deviation intentional (by individual or group)
PEOPLE (ACTS): Use of Protective Methods: Personal Protective Equipment not used or used improperly

ASIA/AUSTRALASIA ONSHORE

DATE: 28 Mar 2025

COUNTRY: India

NUMBER OF DEATHS: 1

FUNCTION: Unspecified

CAUSE: Falls from height

ACTIVITY: Drilling, workover, well operations

PRIMARY LIFE-SAVING RULE: Working at height

SECONDARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Drilling, Employer: Contractor, Occupation: Drilling/well servicing operator, Body part: Head (incl. mouth, etc.), Nature of injury: Unspecified, Time in service: -

NARRATIVE:

The derrickman fell from approximately 20 m while accessing the monkey board during tubing and sucker-rod retrieval operations, resulting in a fatality.

WHAT WENT WRONG:

Work-at-height controls did not prevent a fall during ladder access to the monkey board - FPD/harness was not effectively secured, access was obstructed, and climbing surfaces were contaminated - resulting in an uncontrolled fall from height.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Effective fall protection, unobstructed ladder access, and clean, non-slip climbing surfaces are essential to prevent falls from height. Proper verification of FPD use and engineered protections like ladder cages are critical controls.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

PEOPLE (ACTS): Use of Protective Methods: Inadequate use of safety systems

DATE: 10 Sep 2025

COUNTRY: India

NUMBER OF DEATHS: 1

FUNCTION: Unspecified

CAUSE: Dropped objects

ACTIVITY: Lifting, crane, rigging, deck operations

PRIMARY LIFE-SAVING RULE: Safe mechanical lifting

SECONDARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Drilling, Employer: Contractor, Occupation: Drilling/well servicing operator, Body part: Head (incl. mouth, etc.), Nature of injury: Unspecified, Time in service: -

NARRATIVE:

Fatality caused by falling drill pipe after sling dislodged during crane stacking.

ASIA/AUSTRALASIA ONSHORE

WHAT WENT WRONG:

Improper rigging, deviation from the approved lifting method without MOC, and the slinger standing in the line of fire allowed the sling to dislodge from the crane hook, causing the drill pipe to fall and strike him.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Strict adherence to approved lifting methods, and maintaining exclusion from the line of fire are essential to prevent dropped-object incidents.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

PEOPLE (ACTS): Following Procedures: Improper lifting or loading

PEOPLE (ACTS): Use of Protective Methods: Equipment or materials not secured

PROCESS (CONDITIONS): Protective Systems: Inadequate/defective guards or protective barriers

PROCESS (CONDITIONS): Protective Systems: Inadequate/defective warning systems/safety devices

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate design/specification/management of change

PROCESS (CONDITIONS): Organizational: Inadequate work standards/procedures

DATE: 07 Jan 2025

COUNTRY: India

NUMBER OF DEATHS: 1

FUNCTION: Unspecified

CAUSE: Explosion, fire or burns

ACTIVITY: Maintenance, inspection, testing

PRIMARY LIFE-SAVING RULE: Hot work

SECONDARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Production, Employer: Company, Occupation: Engineer, Scientist, Technician, Body part: Respiratory system, Nature of injury: Burn, Time in service: 10 + years

NARRATIVE:

Fatal fire following premature restart during PSV maintenance.

WHAT WENT WRONG:

A premature restart of the system without verifying reinstatement of the PSV resulted in uncontrolled hydrocarbon release, gas accumulation, ignition from a modified adjacent burner opening, and a fatal fire incident.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Critical safety devices must never be removed or bypassed without ensuring positive mechanical isolation, structured restart control, and thorough hazard assessment, particularly in hydrocarbon environments with adjacent operating units.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate design/specification/management of change

ASIA/AUSTRALASIA ONSHORE

PROCESS (CONDITIONS): Work Place Hazards: Hazardous atmosphere (explosive/toxic/asphyxiant)

PROCESS (CONDITIONS): Organizational: Inadequate work standards/procedures

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

DATE: 23 Dec 2025

COUNTRY: Indonesia

NUMBER OF DEATHS: 1

FUNCTION: Drilling

CAUSE: Dropped objects

ACTIVITY: Drilling, workover, well operations

PRIMARY LIFE-SAVING RULE: Line of fire

SECONARY LIFE-SAVING RULE: Safe mechanical lifting

FATALITY

Function: Drilling, Employer: Contractor, Occupation: Drilling/well servicing operator, Body part: Head (incl. mouth, etc.), Nature of injury: Organ function / loss or damage, Time in service: -

NARRATIVE:

Floorman was hit by a falling lubricator during a swab tool lay down activity. During removal of swap tool assembly, the lubricator and safety release tools were hit by the sinker bar, causing it to detach from the tubing swab and become stuck. When personnel positioned and tied the sinker bar to the tower pole, the stuck lubricator fell and slid, breaking the sand line and then hitting a floorman resulting in immediate fatality.

WHAT WENT WRONG:

- Lack of situational awareness.
- Inadequate experience.
- Inadequate standard.
- Inadequate work/process planning/programming.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

- Review and revise the N/D Swab Tools procedure by adding clear guidance on identifying abnormal conditions, including scenarios where the sinker bar comes out of the swab tubing.
- Conducting socialization and strengthening personnel understanding regarding line of fire hazards, including the obligation to stop work and verify equipment and environmental conditions if abnormal conditions occur.
- Developing a program to enhance SWA (Stop Work Authority) implementation, such as:
 1. Issuing a directive from top management to emphasize the implementation and authorization of SWA for all personnel.
 2. Conducting massive SWA campaigns through all available media channels.
 3. Providing recognition/awards from top management to personnel who exercise SWA against unsafe acts or unsafe conditions.
- Developing or completing the Work Plan of Action (PoA) and HIRADC for a contracting company to comprehensively accommodate the activity stages of N/D Swab Tools.

ASIA/AUSTRALASIA ONSHORE

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper lifting or loading

PEOPLE (ACTS): Use of Protective Methods: Failure to warn of hazard

PEOPLE (ACTS): Inattention/Lack of Awareness: Improper decision making or lack of judgment

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate maintenance/inspection/testing

PROCESS (CONDITIONS): Organizational: Inadequate training/competence

PROCESS (CONDITIONS): Organizational: Inadequate work standards/procedures

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

DATE: 31 Aug 2025

COUNTRY: Indonesia

NUMBER OF DEATHS: 1

FUNCTION: Drilling

CAUSE: Struck by (not dropped object)

ACTIVITY: Drilling, workover, well operations

PRIMARY LIFE-SAVING RULE: Energy isolation

SECONDARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Drilling, Employer: Contractor, Occupation: Drilling/well servicing operator, Body part: Head (incl. mouth, etc.), Nature of injury: Organ function / loss or damage, Time in service: > 5 years < 10 years

NARRATIVE:

Worker died due to (allegedly) being hit by a surface test line while carrying out well surveillance work.

WHAT WENT WRONG:

Safety restraint/whip check in substandard conditions.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Ensure pressure test complies with procedures.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

PEOPLE (ACTS): Use of Tools, Equipment, Materials and Products: Servicing of energized equipment/inadequate energy isolation

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate/defective tools/equipment/materials/products

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate maintenance/inspection/testing

ASIA/AUSTRALASIA ONSHORE

DATE: 24 Nov 2025

COUNTRY: Indonesia

NUMBER OF DEATHS: 1

FUNCTION: Drilling

CAUSE: Caught in, under or between (excl. dropped objects)

ACTIVITY: Drilling, workover, well operations

PRIMARY LIFE-SAVING RULE: Safe mechanical lifting

FATALITY

Function: Drilling, Employer: Contractor, Occupation: Drilling/well servicing operator, Body part: Internal organs, Nature of injury: Organ function / loss or damage, Time in service: > 5 years < 10 years

NARRATIVE:

Drill string running out of hole (ROOH) work for 4-1/8 inch rock bits. Drill string ROOH was performed when the annular BOP was closed, causing an overload on the rig tower (mast), causing the tower to bend and collapse leading to a derrickman being caught in between the rig mast and the structure, resulting in fatality.

WHAT WENT WRONG:

- Inadequate strategy and planning (Leadership).
- Lack of competence – Inadequate Experience / Inadequate Initial Training / Coaching.
- Inadequate supervision – Lack of Supervision / Inadequate performance measurement and evaluation.
- Inadequate risk management – Identification of hazard.
- Unclear organizational structure – Unclear responsibility.
- Inadequate tool – Inadequate assessment of risk / consideration of human factors.
- Inadequate work standard – Inadequate standard / procedure from contractor.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Ensure adequate business/operation strategies and plans are required to meet increasing operational needs. Evaluate the performance of well intervention and work over supervisors on contractor work at each stage of the project and ensure the availability of supervisory resources covering all contractor work areas. Reviewing inspection and/or assurance system on pre-drilling activities covering critical aspects of rig preparation and operation, including; level rig loading location, slope and soil bearing capacity according to manufacturer's provisions, and checked and approved by competent personnel.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper lifting or loading

PEOPLE (ACTS): Use of Protective Methods: Failure to warn of hazard

PEOPLE (ACTS): Use of Protective Methods: Equipment or materials not secured

PEOPLE (ACTS): Inattention/Lack of Awareness: Improper decision making or lack of judgment

PROCESS (CONDITIONS): Work Place Hazards: Inadequate surfaces, floors, walkways or roads

PROCESS (CONDITIONS): Organizational: Inadequate training/competence

PROCESS (CONDITIONS): Organizational: Inadequate work standards/procedures

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

ASIA/AUSTRALASIA ONSHORE

DATE: 16 Dec 2025

COUNTRY: Indonesia

NUMBER OF DEATHS: 1

FUNCTION: Production

CAUSE: Falls from height

ACTIVITY: Maintenance, inspection, testing

PRIMARY LIFE-SAVING RULE: Working at height

FATALITY

Function: Production, Employer: Contractor, Occupation: Maintenance, craftsman, Body part: Internal organs,
Nature of injury: Organ function / loss or damage, Time in service: > 1 year < 5 years

NARRATIVE:

Worker fell from height while repairing ceiling.

WHAT WENT WRONG:

Working at height without proper PPE.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Ensure proper fall protection system in place.

CAUSAL FACTORS:

PEOPLE (ACTS): Use of Protective Methods: Failure to warn of hazard

PEOPLE (ACTS): Use of Protective Methods: Personal Protective Equipment not used or used improperly

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

DATE: 27 Mar 2025

COUNTRY: Indonesia

NUMBER OF DEATHS: 1

FUNCTION: Production

CAUSE: Exposure electrical

ACTIVITY: Maintenance, inspection, testing

PRIMARY LIFE-SAVING RULE: Energy isolation

SECONDARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Production, Employer: Contractor, Occupation: Maintenance, craftsman, Body part: Internal organs,
Nature of injury: Electric shock, Time in service: > 1 year < 5 years

NARRATIVE:

A contractor died from electrocution while replacing damaged insulator pins on a 13.8 kV power distribution network.

WHAT WENT WRONG:

Improper isolation of energy.

ASIA/AUSTRALASIA ONSHORE

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Implement voltage detection using reliable methods and tools before installing personal grounding.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

PEOPLE (ACTS): Use of Tools, Equipment, Materials and Products: Servicing of energized equipment/inadequate energy isolation

PROCESS (CONDITIONS): Organizational: Inadequate work standards/procedures

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

DATE: 13 Apr 2025

COUNTRY: Indonesia

NUMBER OF DEATHS: 1

FUNCTION: Production

CAUSE: Falls from height

ACTIVITY: Maintenance, inspection, testing

PRIMARY LIFE-SAVING RULE: Working at height

SECONDARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Production, Employer: Contractor, Occupation: Maintenance, craftsman, Body part: Internal organs, Nature of injury: Organ function / loss or damage, Time in service: > 5 years < 10 years

NARRATIVE:

A worker fell from the top of the Gas Engine Enclosure to the maindeck floor.

WHAT WENT WRONG:

Working at height without proper PPE.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Ensure proper fall protection system in place.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

PEOPLE (ACTS): Use of Protective Methods: Failure to warn of hazard

PEOPLE (ACTS): Use of Protective Methods: Personal Protective Equipment not used or used improperly

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate design/specification/management of change

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

ASIA/AUSTRALASIA ONSHORE

DATE: 06 Aug 2025
COUNTRY: Pakistan
NUMBER OF DEATHS: 4
FUNCTION: Production
CAUSE: Assault or violent act
ACTIVITY: Transport - Land
PRIMARY LIFE-SAVING RULE: Other issue – no applicable rule

FATALITY

Function: Unspecified, Employer: Contractor, Occupation: Other, Body part: Neck/torso/spine, Nature of injury: Shot, Time in service: -

FATALITY

Function: Unspecified, Employer: Contractor, Occupation: Other, Body part: Neck/torso/spine, Nature of injury: Shot, Time in service: -

FATALITY

Function: Unspecified, Employer: Contractor, Occupation: Other, Body part: Neck/torso/spine, Nature of injury: Shot, Time in service: -

FATALITY

Function: Unspecified, Employer: Contractor, Occupation: Other, Body part: Neck/torso/spine, Nature of injury: Shot, Time in service: -

NARRATIVE:

An escort vehicle transporting personnel between operational sites was ambushed by armed attackers during transit. The attack resulted in the fatalities of four contractor personnel.

WHAT WENT WRONG:

The vehicle was ambushed by armed third parties during routine personnel transportation. The incident was the result of an external intentional act outside the direct control of the company or contractor.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Review and reinforcement of journey management and security protocols for personnel transportation. Continuous coordination with local authorities and reassessment of route risk levels. Strengthening of security awareness and emergency response preparedness.

CAUSAL FACTORS:

PEOPLE [ACTS]: Inattention/Lack of Awareness: Acts of violence

ASIA/AUSTRALASIA OFFSHORE

DATE: 10 Mar 2025

COUNTRY: India

NUMBER OF DEATHS: 1

FUNCTION: Unspecified

CAUSE: Dropped objects

ACTIVITY: Lifting, crane, rigging, deck operations

PRIMARY LIFE-SAVING RULE: Line of fire

SECONARY LIFE-SAVING RULE: Safe mechanical lifting

FATALITY

Function: Drilling, Employer: Contractor, Occupation: Drilling/well servicing operator,
Body part: Head (incl. mouth, etc.), Nature of injury: Unspecified, Time in service: -

NARRATIVE:

Fatal head injury from dropped drill pipe during mouse-hole to catwalk transfer.

WHAT WENT WRONG:

The equipment used for handling the pipe did not fully meet the operational requirements, and its condition did not ensure reliable performance. When the pipe made contact with the V-door, the elevator released unexpectedly, causing the pipe to descend and resulting in a fatal injury. Several procedural and equipment-related gaps contributed to the event.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Correct selection, maintenance, and pre-use verification of lifting equipment are essential, along with strict adherence to safe-work procedures to prevent dropped-object incidents.

CAUSAL FACTORS:

No Causal Factors Allocated

DATE: 05 Aug 2025

COUNTRY: Indonesia

NUMBER OF DEATHS: 1

FUNCTION: Production

CAUSE: Water related, drowning

ACTIVITY: Production operations

PRIMARY LIFE-SAVING RULE: Other issue – no applicable rule

FATALITY

Function: Production, Employer: Company, Occupation: Process/equipment operator, Body part: Internal organs,
Nature of injury: Organ function / loss or damage, Time in service: > 6 months < 1 year

NARRATIVE:

Man over board from cellar deck offshore platform.

WHAT WENT WRONG:

Structure integrity issues of grating.

ASIA/AUSTRALASIA OFFSHORE

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Ensure adequate asset integrity program (Inspection, Maintenance and Repair).

CAUSAL FACTORS:

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate maintenance/inspection/testing

PROCESS (CONDITIONS): Work Place Hazards: Inadequate surfaces, floors, walkways or roads

PROCESS (CONDITIONS): Organizational: Inadequate communication

DATE: 02 Apr 2025

COUNTRY: Malaysia

NUMBER OF DEATHS: 1

FUNCTION: Drilling

CAUSE: Caught in, under or between (excl. dropped objects)

ACTIVITY: Maintenance, inspection, testing

PRIMARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Drilling, Employer: Contractor, Occupation: Other, Body part: Internal organs, Nature of injury: Crushing, Time in service: > 5 years < 10 years

NARRATIVE:

On 2nd April 2025, an individual was found in between the sliding hydraulic watertight door (WTD) and the door frame. The individual was found unconscious and not breathing. The individual was brought to sick bay. The Incident Management Team was activated. Medics attended to the individual and assessed with no signs of life.

WHAT WENT WRONG:

The watertight door had been set to "Door Closed" mode, which activates an automatic closing mechanism after 10 seconds when the lever is released. The door movement closing time is no less than 20 seconds.

The individual was in "Line of Fire" while passed through the WTD as it was automatically closing. Due to the significant force exerted by the watertight door, this resulted in the individual being trapped between the door and the frame.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

1. The watertight door control mode was set to 'automatic close' based on site specific operating guidelines. The automatic watertight doors provide a Major Accident Event barrier for compartment flooding, but potentially pose a risk to personnel.
2. Familiarity with a known hazard, like a slow-moving watertight door, may create a false sense of safety and reduce perceived risk. Continuous reinforcement of hazard awareness is essential.
3. Encouraging teams to regularly discuss "what could go wrong", including unlikely or weak signals, helps maintain a sharp awareness of risks. By promoting curiosity, psychological safety, and learning from everyday work, organizations can strengthen their ability to guide safe behaviours and support effective human performance.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

ASIA/AUSTRALASIA OFFSHORE

DATE: 22 Oct 2025

COUNTRY: Malaysia

NUMBER OF DEATHS: 1

FUNCTION: Production

CAUSE: Struck by (not dropped object)

ACTIVITY: Production operations

PRIMARY LIFE-SAVING RULE: Bypassing safety controls

SECONDARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Production, Employer: Contractor, Occupation: Maintenance, craftsman, Body part: Head (incl. mouth, etc.), Nature of injury: Concussion, Time in service: > 1 year < 5 years

NARRATIVE:

On 22 October 2025 at approximately 1615 hours, smoke alarm detectors were triggered in the engine room. Personnel on Board (POB) mustering and engine room reported one missing person. Emergency Response Team (ERT) deployed to the location and found one engine room operator unconscious, adjacent to steam plant. Additionally, there was sign of steam release found at site. Despite prompt medical attention by the onboard medical team, the individual was subsequently pronounced deceased. The affected equipment and piping were isolated.

WHAT WENT WRONG:

This incident was due to the following factors:

- a. Condensation-induced water hammer
- b. The failure of the end plate weldment
- c. The end plate was ejected and hit the DP on the right side of his head

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Gaps in system operation, monitoring, and competency management. This serves as an important reminder of the need for strong technical control and workforce awareness when operating steam systems.

This incident highlights the importance of ensuring all crew, especially new and existing personnel, are properly trained and aware of steam system risks such as steam hammering, and are competent in following approved operating procedures. Critical equipment including control valves, steam traps, and piping must be maintained in proper working condition and operated in automatic mode where required to prevent condensate build-up and system damage. Adequate temperature and pressure monitoring must be in place and closely observed so that early intervention can be taken during abnormal conditions. Operating procedures must be regularly reviewed and updated to include steam hammering mitigation measures, and the Management of Change (MoC) process must be strengthened to ensure that any system modifications are properly assessed, documented, and reflected in as-built drawings.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Deviation unintentional (by individual or group)

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

PEOPLE (ACTS): Use of Protective Methods: Inadequate use of safety systems

PEOPLE (ACTS): Use of Protective Methods: Equipment or materials not secured

PEOPLE (ACTS): Use of Protective Methods: Disabled or removed guards, warning systems or safety devices

ASIA/AUSTRALASIA OFFSHORE

DATE: 03 Sep 2025
COUNTRY: South Korea
NUMBER OF DEATHS: 1
FUNCTION: Construction
CAUSE: Water related, drowning
ACTIVITY: Construction, commissioning, decommissioning
PRIMARY LIFE-SAVING RULE: Line of fire
SECONARY LIFE-SAVING RULE: Working at height

FATALITY

Function: Construction, Employer: Company, Occupation: Engineer, Scientist, Technician, Body part: Internal organs, Nature of injury: Inhalation, poisoning, intoxication, asphyxiation, drowning, Time in service: 10 + years

NARRATIVE:

A Company vessel supervisor was overseeing the load test of the stern offloading system’s hawser winch when the cantilevered structure supporting the system (offloading balcony/platform) partially collapsed, causing the worker to fall overboard.

WHAT WENT WRONG:

Project failure.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Maintain the documentation workflow to ensure that project documents are reviewed by the classifier before full release by the Company and, specifically, in cases where there are supporting structures, that an additional review of the calculations is carried out by the Company.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)
PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate design/specification/management of change
PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate maintenance/inspection/testing
PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

EUROPE ONSHORE

No fatal incidents reported.

EUROPE OFFSHORE

DATE: 14 Nov 2025

COUNTRY: UK

NUMBER OF DEATHS: 1

FUNCTION: Drilling

CAUSE: Falls from height

ACTIVITY: Drilling, workover, well operations

PRIMARY LIFE-SAVING RULE: Bypassing safety controls

FATALITY

Function: Drilling, Employer: Contractor, Occupation: Other, Body part: Head (incl. mouth, etc.), Nature of injury: Loss of cognitive function / brain injury (e.g. resulting in seizures/epilepsy), Time in service: -

NARRATIVE:

Change the incident description to: On 14th Nov 2025 at 2:30am, a person who was working inside a crane cabin, fell through an opening inside the cabin and landed on the lower ground. The person sustained fatal injuries.

WHAT WENT WRONG:

During housekeeping activities, a floor grating panel was removed inside a crane cab, exposing a glass panel beneath the floor. The glass panel gave way under the weight of a person, resulting the person fell through the opening.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

1. Owners or operators of cranes with similar configurations should verify - or take steps to ensure - that grating or barriers over or covering non-load-bearing windows or glass are present and secured in place.
2. Such grating or barriers should not be removed without a necessary risk assessment and control of work process.

CAUSAL FACTORS:

PEOPLE (ACTS): Use of Protective Methods: Disabled or removed guards, warning systems or safety devices

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

MIDDLE EAST ONSHORE

DATE: 07 Jun 2025

COUNTRY: Kuwait

NUMBER OF DEATHS: 1

FUNCTION: Drilling

CAUSE: Struck by (not dropped object)

ACTIVITY: Drilling, workover, well operations

PRIMARY LIFE-SAVING RULE: Line of fire

SECONARY LIFE-SAVING RULE: Bypassing safety controls

FATALITY

Function: Drilling, Employer: Contractor, Occupation: Manual labourer, Body part: Head (incl. mouth, etc.),
Nature of injury: Loss of cognitive function / brain injury (e.g. resulting in seizures/epilepsy), Time in service: -

NARRATIVE:

Rig Manager relieved Driller for breakfast and engaged controls to continue operations. At this time, the Derrickman (IP) started inspecting the folded stabbing board standing on the mast beam adjacent to the stabbing board. Rig Manger was lowering the Top Drive System (TDS) to connect to the next stand to POOH, the IP was struck on the head by the lower section of the TDS, and his final position was on a beam between TDS and stabbing board. The IP was brought down and evacuated to company clinic using the rig ambulance. IP was declared deceased by company clinic.

WHAT WENT WRONG:

1. Failure to Identify Line of fire hazards. The IP was standing on the mast beam adjacent to the stabbing board during TDS movement.
2. Carrying out multiple activities at the same time. Rig Manager was lowering the TDS at the same time the IP was conducting an Inspection.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

1. Line of Fire hazards to be avoided by drilling crew.
2. Establish clear communication by drilling crew.
3. Tasks shall not overlap with in critical operations.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

PROCESS (CONDITIONS): Organizational: Inadequate communication

MIDDLE EAST ONSHORE

DATE: 12 Nov 2025

COUNTRY: Kuwait

NUMBER OF DEATHS: 2

FUNCTION: Drilling

CAUSE: Struck by (not dropped object)

ACTIVITY: Drilling, workover, well operations

PRIMARY LIFE-SAVING RULE: Line of fire

SECONARY LIFE-SAVING RULE: Bypassing safety controls

FATALITY

Function: Drilling, Employer: Contractor, Occupation: Manual labourer, Body part: Head (incl. mouth, etc.),
Nature of injury: Loss of cognitive function / brain injury (e.g. resulting in seizures/epilepsy), Time in service: -

FATALITY

Function: Drilling, Employer: Contractor, Occupation: Manual labourer, Body part: Head (incl. mouth, etc.),
Nature of injury: Loss of cognitive function / brain injury (e.g. resulting in seizures/epilepsy), Time in service: -

NARRATIVE:

Contractor employees, while working on the rig floor at the mentioned location, they were struck by a chiksan line. As a result, one contractor employee sustained a head injury and another contractor employee sustained a chest injury. Later declared that the 2 contractor employees deceased and a third employee who sustained a right shoulder injury was transferred to hospital for further necessary treatment.

WHAT WENT WRONG:

Upon releasing the Hammer Union, the restraint on the system was removed, causing a sudden backspin of the Drill String and associated connections, which struck the contractor workers positioned within the line of fire.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

1. Early warning signs for presence of potential energy must be recognized and acted upon including any unexpected reverse rotation, resistance during rig-down activities, or prolonged difficulty in breaking surface connections. These indicators must trigger immediate hazard reassessment, work stoppage, and verification of string torque status before continuing operations.
2. Communication, role clarity, and well-defined responsibilities between contractors and company must be strengthened. All parties must clearly understand who is authorized to perform each task, especially during high-risk activities such as acid. Job, rig-down and workflows must be governed by formal procedures rather than informal practices.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

PEOPLE (ACTS): Use of Protective Methods: Equipment or materials not secured

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

MIDDLE EAST ONSHORE

DATE: 22 Oct 2025

COUNTRY: Kuwait

NUMBER OF DEATHS: 1

FUNCTION: Production

CAUSE: Exposure electrical

ACTIVITY: Construction, commissioning, decommissioning

PRIMARY LIFE-SAVING RULE: Energy isolation

SECONDARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Production, Employer: Contractor, Occupation: Unknown, Body part: Leg/knee/hip,

Nature of injury: Electric shock, Time in service: -

NARRATIVE:

A contract employee working at heights in a bucket on recommissioning an underground powerline from an overhead powerline. The worker came into contact with the live electrical line and lost consciousness. The bucket was lowered by another worker, and the emergency dispatcher was contacted; an ambulance was then sent to the site. The contract employee was transferred to a local hospital, where he was declared deceased.

WHAT WENT WRONG:

Contact with a live electric line.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Requirement 5 of the Electrical Safe Work technical standard requiring people performing electrical work to have PPE in accordance with ASTM/ANSI, IEC was not being followed.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

PEOPLE (ACTS): Use of Tools, Equipment, Materials and Products: Servicing of energized equipment/inadequate energy isolation

PEOPLE (ACTS): Use of Protective Methods: Inadequate use of safety systems

PROCESS (CONDITIONS): Organizational: Inadequate work standards/procedures

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

MIDDLE EAST ONSHORE

DATE: 25 May 2025

COUNTRY: Kuwait

NUMBER OF DEATHS: 1

FUNCTION: Production

CAUSE: Dropped objects

ACTIVITY: Maintenance, inspection, testing

PRIMARY LIFE-SAVING RULE: Line of fire

SECONDARY LIFE-SAVING RULE: Bypassing safety controls

FATALITY

Function: Production, Employer: Contractor, Occupation: Process/equipment operator, Body part: Internal organs, Nature of injury: Loss of consciousness, Time in service: -

NARRATIVE:

One contractor employee was engaged in cleaning a 42-inch diameter collector header (1.8 metres in length), which was temporarily rested on two steel pipe supports at a height of approximately 0.6 metre. The activity was taking place outside of a yard. During the task, the employee suddenly became unconscious and collapsed onto the pipe. As a result of the impact, the header slipped from its supports and fell onto his lower body. The site supervisor promptly initiated emergency response measures and arranged for the immediate transfer of the employee to the company clinic for urgent medical evaluation. The attending doctor later declared the employee deceased.

WHAT WENT WRONG:

1. Storage setup was inadequate to maintain proper positioning and support, which contributed to the Instability of the header during laydown.
2. Workplace layout limited safe access, exposing workers to hazards due to Insufficient consideration of ergonomic factors in the setup.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

1. Workplace shall be designed in ergonomically safe manner considering human factors and minimizing the line of fire near heavy loads.
2. Suitable temporary pipe supports shall be used considering the centre body of mass to secure loads. The supports shall be equipped with stoppers suitable for all sizes.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

PEOPLE (ACTS): Use of Protective Methods: Equipment or materials not secured

PROCESS (CONDITIONS): Work Place Hazards: Congestion, clutter or restricted motion

PROCESS (CONDITIONS): Organizational: Inadequate supervision

MIDDLE EAST ONSHORE

DATE: 08 Jan 2025

COUNTRY: Kuwait

NUMBER OF DEATHS: 1

FUNCTION: Production

CAUSE: Falls from height

ACTIVITY: Production operations

PRIMARY LIFE-SAVING RULE: Other issue – no applicable rule

FATALITY

Function: Production, Employer: Contractor, Occupation: Manual labourer, Body part: Head (incl. mouth, etc.),
Nature of injury: Cut, Puncture, Scrape, Time in service: -

NARRATIVE:

A contractor employee (helper) was assisting two contractor mechanical fitters on a platform 4.5 meters high from the ground level. The hook of one of the grill plates of the platform broke, which caused the grill plate to dislodge. As a result, the contractor employee (helper) fell to the ground who was standing on the grill plate. The injured employee was transferred to hospital by company ambulance. IP passed away while he was under treatment in hospital.

WHAT WENT WRONG:

1. Platform gratings hooks were loose, causing it to unhook and fall beneath with the worker.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

1. The Importance of inspecting permanent platforms in any case to identify and mitigate potential hazards.
2. Spreading awareness across all worksite and operational personnel regarding the permanent platform design standards and explain the importance of the placed clamps or any other fastening devices on the grating panels.

CAUSAL FACTORS:

PROCESS (CONDITIONS): Work Place Hazards: Inadequate surfaces, floors, walkways or roads

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

DATE: 08 Apr 2025

COUNTRY: Kuwait

NUMBER OF DEATHS: 1

FUNCTION: Production

CAUSE: Explosion, fire or burns

ACTIVITY: Production operations

PRIMARY LIFE-SAVING RULE: Other issue – no applicable rule

FATALITY

Function: Production, Employer: Contractor, Occupation: Foreman, Supervisor, Body part: Internal organs,
Nature of injury: Organ function / loss or damage, Time in service: -

MIDDLE EAST ONSHORE

NARRATIVE:

For the fuel gas pipeline was under preparation for cleaning pigging activity, contractor employees went to the location for cleaning pigging activity. During the process, an explosion (without fire) occurred, sand and carbon were scattered in the area. This led to the collapse of the valve pit along with its structure, resulting in one contractor employee fatality, one contractor employee injury (left leg ankle fracture) and damage to the property. The injured employees were shifted to company clinic and then to hospital. One contractor employee was declared dead by the hospital and another contractor employee was injured.

WHAT WENT WRONG:

1. An explosion of an underground pipeline section because of loss of containment.
2. The loss of containment resulted in gas accumulation at congested and confined underground section of the pipeline next to the concrete pit that was ignited by an exothermic reaction between pyrophoric black powder and air.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

1. Upgrade old manifolds pigging facilities to ensure safety while carrying out pigging operations.
2. Ensure Safe Deferral process is implemented for the deferment of pipeline inspections.
3. Track Inspection & Corrosion recommendations and prioritized based on risk.
4. Ban the use of Generic Job Safety Analysis and consider it as a violation.
5. The use of e-Work Permit System shall be enforced at all times, unless authorized by HSE Team.

CAUSAL FACTORS:

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate maintenance/inspection/testing

PROCESS (CONDITIONS): Work Place Hazards: Hazardous atmosphere (explosive/toxic/asphyxiant)

DATE: 23 Jan 2025

COUNTRY: UAE

NUMBER OF DEATHS: 1

FUNCTION: Drilling

CAUSE: Water related, drowning

ACTIVITY: Maintenance, inspection, testing

PRIMARY LIFE-SAVING RULE: Work authorization

SECONARY LIFE-SAVING RULE: Working at height

FATALITY

Function: Drilling, Employer: Contractor, Occupation: Manual labourer, Body part: Unspecified, Nature of injury: Inhalation, poisoning, intoxication, asphyxiation, drowning, Time in service: > 3 months < 6 months

NARRATIVE:

After replacing the submersible pump of the water pit, it was reported that there was no water flow. The Labour Foreman (LFM) and one Roustabout (deceased) went to check the pump. The Roustabout fell in the pit. The LFM called the rig manager for support through walkie talkie. Rig team recovered the Roustabout from the water pit by man basket. First aid and CPR were administered but the IP was later declared dead.

MIDDLE EAST ONSHORE

WHAT WENT WRONG:

There were no specifications nor guidance for water pit construction and operations. This includes pump maintenance and accessibility requirements with the associated risk of working near water. Moreover, the construction of the water pit was not included in the location preparation contract.

- No warning signs/barriers provided to prevent entry to water pit and buddy system was not followed in absence of Labour Foreman.
- The Permit to Work raised was under General Lifting Permit and did not cover the water pump replacement.

Hence, the risk associated with the pump replacement and the controls are not established.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

- Always intervene/stop any unsafe actions and report any unsafe observations promptly for timely corrective actions.
- Always conduct activities under valid PTW and ensure necessary precautionary measures are effectively implemented including clear communication of the job steps.
- Always verify the water pit as part of rig acceptance to ensure that all the safety requirements are provided by the Location Preparation Team including proper design of the Pit.
- Conduct regular emergency readiness exercises to deal with any emergency scenario in the water pit area including rescue from the water.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

PEOPLE (ACTS): Use of Protective Methods: Failure to warn of hazard

PROCESS (CONDITIONS): Protective Systems: Inadequate/defective guards or protective barriers

PROCESS (CONDITIONS): Organizational: Inadequate work standards/procedures

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

MIDDLE EAST OFFSHORE

No fatal incidents reported.

NORTH AMERICA ONSHORE

DATE: 11 Nov 2025

COUNTRY: Mexico

NUMBER OF DEATHS: 1

FUNCTION: Unspecified

CAUSE: Unspecified - Other

ACTIVITY: Maintenance, inspection, testing

PRIMARY LIFE-SAVING RULE: Unspecified

FATALITY

Function: Unspecified, Employer: Company, Occupation: Other, Body part: Internal organs,
Nature of injury: Chemical or physical irritation or exposure, Time in service: -

NARRATIVE:

The worker, while supporting the operator in connecting the unit to the firefighters' supply line to pump water to attend the fire at substation #7, located south of the Firefighting Station, began to feel unwell. Firefighting personnel transported him to the clinic, and he was later taken by emergency ambulance to hospital, where his death was reported. The incident resulted in a heart attack, which was triggered by the inhalation of toxic substances during an emergency response.

WHAT WENT WRONG:

- End of the transformer's service life.
- Lack of maintenance and inspection of the transformer.
- Non-compliance with Electrical Installations 'Use', Article 250.190.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

- Implement furan analysis in the CT for all oil-filled transformers to increase reliability in terms of their service life.
- Increase the frequency of predictive maintenance inspections.
- Perform daily predictive maintenance inspections on transformer and to develop a preventive maintenance and electrical testing program for the transformer (due to the scope of the fire).

CAUSAL FACTORS:

PROCESS (CONDITIONS): Protective Systems: Inadequate/defective Personal Protective Equipment

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate maintenance/inspection/testing

PROCESS (CONDITIONS): Work Place Hazards: Hazardous atmosphere (explosive/toxic/asphyxiant)

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

NORTH AMERICA ONSHORE

DATE: 10 Dec 2025

COUNTRY: Mexico

NUMBER OF DEATHS: 1

FUNCTION: Unspecified

CAUSE: Struck by (not dropped object)

ACTIVITY: Production operations

PRIMARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Unspecified, Employer: Contractor, Occupation: Maintenance, craftsman, Body part: Leg/knee/hip, Nature of injury: Cut, Puncture, Scrape, Time in service: -

NARRATIVE:

The contractor worker, 50 years old, while performing activities on an 18" floating gate valve located at the inlet line to separator at the Gas Transportation Processing Centre, was struck by a metal element in the right front hip. He was transported to the clinic located outside the facility, where the on-duty physician declared him deceased at 10:30 h.

WHAT WENT WRONG:

The incident was originated from the failure of an O-ring. This failure caused the violent ejection of the worm screw, resulting in a fatal injury to a worker. This finding highlights a systemic deficiency in the certification and quality processes for replacement components used in Floating Gate Valves (FGVs).

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Contractors must provide evidence of maintenance, inspection, testing, and certification for all machinery and equipment they will use, ensuring that tests comply with applicable regulations. Through a temporary management of change process, it must be confirmed that contractor equipment does not introduce additional risks. The valve design must comply with API-6D, and material certifications must meet NACE MR-0175 requirements for sour service. The procedure must also be updated to include the correct personnel positioning during valve opening and the actions to take in case of abnormal conditions.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate design/specification/management of change

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate/defective tools/equipment/materials/products

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate maintenance/inspection/testing

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

NORTH AMERICA ONSHORE

DATE: 12 Aug 2025

COUNTRY: USA

NUMBER OF DEATHS: 1

FUNCTION: Production

CAUSE: Struck by (not dropped object)

ACTIVITY: Transport - Land

PRIMARY LIFE-SAVING RULE: Driving

FATALITY

Function: Production, Employer: Company, Occupation: Foreman, Supervisor, Body part: Internal organs, Nature of injury: Unspecified, Time in service: -

NARRATIVE:

While driving a company vehicle in between work sites, employee (IP) vehicle was struck by an oncoming non-affiliated vehicle which crossed into employee's lane. As a result of the impact, the employee sustained fatal injuries.

WHAT WENT WRONG:

While driving a company vehicle in between work sites, employee (IP) vehicle was struck by an oncoming non-affiliated vehicle which crossed into employee's lane. As a result of the impact, the employee sustained fatal injuries.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Incident was associated actions of third party.

CAUSAL FACTORS:

No Causal Factors Allocated

DATE: 18 Sep 2025

COUNTRY: USA

NUMBER OF DEATHS: 1

FUNCTION: Construction

CAUSE: Struck by (not dropped object)

ACTIVITY: Construction, commissioning, decommissioning

PRIMARY LIFE-SAVING RULE: Energy isolation

SECONARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Construction, Employer: Contractor, Occupation: Unknown, Body part: Head (incl. mouth, etc.), Nature of injury: Concussion, Time in service: -

NARRATIVE:

Around 10 minutes into clearing/removal activities a high energy release occurred ejecting the contents of the piping assembly including the pig, fatally striking a contract worker in the head.

WHAT WENT WRONG:

High energy release.

NORTH AMERICA ONSHORE

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Pending Investigation.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

DATE: 19 May 2025

COUNTRY: USA

NUMBER OF DEATHS: 1

FUNCTION: Unspecified

CAUSE: Dropped objects

ACTIVITY: Lifting, crane, rigging, deck operations

PRIMARY LIFE-SAVING RULE: Safe mechanical lifting

SECONDARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Unspecified, Employer: Contractor, Occupation: Heavy equipment operator, Body part: Neck/torso/spine, Nature of injury: Crushing, Time in service: > 1 year < 5 years

NARRATIVE:

On May 19, 2025, at approximately 07:50 AM, the contractor was getting ready to move mud tank 1. The crane was positioned next to the mud tank. A contract rigger and contract floor hand went to the top of the tank to prepare the roof top to get it lowered with the crane. The rigger got a step ladder and positioned it at the edge of the roof top to be able to climb up to connect the crane slings to the pad eyes on the rooftop. As IP began to climb up onto the rooftop, the rooftop came towards IP, knocking IP off the ladder and onto the skid with the rooftop landing on top of IP.

WHAT WENT WRONG:

Line of fire, load not secured.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Failure to follow procedure.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

PEOPLE (ACTS): Following Procedures: Improper lifting or loading

PEOPLE (ACTS): Use of Protective Methods: Equipment or materials not secured

NORTH AMERICA OFFSHORE

No fatal incidents reported.

RUSSIA & CENTRAL ASIA ONSHORE

DATE: 11 Jun 2025

COUNTRY: Kazakhstan

NUMBER OF DEATHS: 1

FUNCTION: Production

CAUSE: Dropped objects

ACTIVITY: Drilling, workover, well operations

PRIMARY LIFE-SAVING RULE: Safe mechanical lifting

SECONARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Production, Employer: Contractor, Occupation: Heavy equipment operator, Body part: Neck/torso/spine, Nature of injury: Crushing, Time in service: 10 + years

NARRATIVE:

During the night shift, a 3rd drilling crew was conducting casing operations (running Ø114.3 mm x 7.4 mm OTTM "E" filter pipes) at a depth of 750 meters using a drilling rig. At approximately 02:50 AM, the crew was handling the 18th filter pipe. After the assistant drillers positioned the pipe into the elevator (Model KM 114-140) and closed the locking handle, the driller began hoisting the block. During the ascent, the elevator's locking handle unexpectedly opened. The pipe was released and fell rapidly onto the rotor area. The falling pipe struck the Machinist, who was positioned on the lower receiving bridge/platform. The victim sustained multiple severe internal and external injuries. Despite immediate emergency calls, the victim passed away while in transit to the medical facility on the highway.

WHAT WENT WRONG:

During the night shift, while hoisting the 18th filter pipe (Ø114.3 mm) to the rig floor, the elevator's locking handle unexpectedly opened. The pipe was released and fell rapidly through the rotor area. The Machinist was standing on the receiving platform below and was struck by the falling pipe.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Strict adherence to Red Zones: Personnel must strictly remain at their designated control posts during hoisting and tripping operations. Any unauthorized movement within the drilling rig area during active operations is strictly prohibited.

Exclusion Zone Enforcement: High-risk areas where loads are being moved must be physically barricaded and marked with visible warning signs. Fencing materials must meet safety standards to prevent non-essential personnel from entering the "Line of Fire".

Pre-Operation Equipment Verification: Before starting casing or liner running, supervisors and drillers must conduct a thorough inspection of the hoisting equipment, including elevators, to ensure all locking mechanisms are fully functional.

Effective Internal Oversight: Formal safety briefings (Toolbox Talks) are insufficient if not supported by active field supervision. Employers must strengthen internal controls to ensure workers follow safety instructions in real-time.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

PEOPLE (ACTS): Use of Protective Methods: Equipment or materials not secured

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate/defective tools/equipment/materials/products

RUSSIA & CENTRAL ASIA ONSHORE

PROCESS (CONDITIONS): Tools, Equipment, Materials and Products: Inadequate maintenance/inspection/testing

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

PROCESS (CONDITIONS): Organizational: Inadequate communication

PROCESS (CONDITIONS): Organizational: Inadequate supervision

DATE: 29 May 2025

COUNTRY: Kazakhstan

NUMBER OF DEATHS: 1

FUNCTION: Production

CAUSE: Dropped objects

ACTIVITY: Lifting, crane, rigging, deck operations

PRIMARY LIFE-SAVING RULE: Safe mechanical lifting

SECONDARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Production, Employer: Company, Occupation: Maintenance, craftsman, Body part: Neck/torso/spine, Nature of injury: Crushing, Time in service: > 6 months < 1 year

NARRATIVE:

During repair works on the Oil-Water Emulsion Heater at a Group Station, a fragment of a concrete block fell on a maintenance mechanic. The worker sustained severe physical injuries and passed away in the ambulance during transit to the hospital.

WHAT WENT WRONG:

1. Unsafe Acts and Human Factors: Personnel applied an unauthorized "choke hitch" slinging method after the burner became stuck during the initial lifting attempt. The injured worker violated safety protocols by pulling himself up on the burner itself to secure the sling, using the equipment as a physical support. When technical difficulties arose (equipment jamming), the crew failed to stop work for a reassessment of risks, leading to the burner falling along with the worker.
2. Failures in Operational Control: The responsible line supervisor was absent from the high-risk work site, having left for another facility to perform a different task. Oversight regarding the adherence to safety requirements by responsible persons and the employer was deemed insufficient. Despite the existence of a permit-to-work, no actual risk assessment (dynamic risk assessment) was conducted directly at the work site prior to the task.
3. Organizational and Systemic Deficiencies: The technological regulations lacked step-by-step instructions for the dismantling and installation of the burner, leading to dangerous improvisation on-site. Insufficient training and qualification of workers for this specific type of hazardous work were identified. The internal control system failed to provide adequate supervision during the planning and resource allocation stages.
4. Technical Consequences: As a result of falling from height along with the burner, the worker sustained severe injuries. The worker passed away in the ambulance enroute to the hospital.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

1. Operational Oversight and Supervision: High-risk activities must never be conducted without the continuous presence and active supervision of a designated line supervisor. Supervisors must prioritize safety oversight over secondary tasks; leaving a high-risk site unattended creates a critical vulnerability.

RUSSIA & CENTRAL ASIA ONSHORE

2. Risk Assessment and "Stop Work Authority": A formal risk assessment must be documented and registered before starting any maintenance or dismantling work. Personnel must be empowered and trained to exercise "Stop Work Authority" the moment a task deviates from the plan (e.g., equipment jamming) to perform a dynamic risk reassessment. No work should commence or continue if safety measures are not fully organized or if the situation changes unexpectedly.

3. Technical Documentation and Procedures: Technological regulations must include detailed, step-by-step instructions for specific hazardous tasks, such as burner dismantling, including approved slinging points and methods. All technical procedures should be reviewed to ensure they cover the full lifecycle of the task: setup, execution, and emergency contingencies

4. Competence and Training: Training programs must go beyond general safety and focus on specific, high-risk operational tasks to ensure workers are fully prepared for the technical challenges they may face. Regular safety briefings should reinforce the dangers of using equipment (like burners or piping) as physical supports or climbing aids.

5. Permit-to-Work (PTW) System: The PTW system must be strictly enforced and potentially digitized to ensure all safety barriers are verified and documented by responsible parties before work begins.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

PEOPLE (ACTS): Following Procedures: Improper lifting or loading

PEOPLE (ACTS): Use of Tools, Equipment, Materials and Products: Improper use/position of tools/equipment/materials/products

PEOPLE (ACTS): Inattention/Lack of Awareness: Improper decision making or lack of judgment

PROCESS (CONDITIONS): Organizational: Inadequate training/competence

PROCESS (CONDITIONS): Organizational: Inadequate work standards/procedures

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

PROCESS (CONDITIONS): Organizational: Inadequate supervision

DATE: 30 Jun 2025

COUNTRY: Kazakhstan

NUMBER OF DEATHS: 1

FUNCTION: Production

CAUSE: Caught in, under or between (excl. dropped objects)

ACTIVITY: Maintenance, inspection, testing

PRIMARY LIFE-SAVING RULE: Line of fire

SECONDARY LIFE-SAVING RULE: Bypassing safety controls

FATALITY

Function: Production, Employer: Contractor, Occupation: Heavy equipment operator, Body part: Internal organs, Nature of injury: Major/multiple system trauma, Time in service: 10 + years

NARRATIVE:

Crew No. 1 arrived at the well to begin rig-up operations. While the crew was unloading equipment from a semi-trailer, the Hoist Operator (IP) identified a mechanical issue with the mobile hoist unit.

RUSSIA & CENTRAL ASIA ONSHORE

The IP crawled underneath the chassis of the hoist to perform an inspection/repair. While positioned under the vehicle, he requested a Driller (who was not part of the mechanical maintenance team) to start the engine. When the Driller turned the ignition key, the hoist unexpectedly moved in reverse. The front axle wheel of the unit passed over the IP. Emergency services were summoned immediately; however, the victim succumbed to his injuries while in transit to the Hospital.

WHAT WENT WRONG:

A breakdown in basic safety discipline and mechanical safety protocols occurred. A worker positioned himself underneath a heavy mobile hoist unit to perform an inspection/repair and instructed a colleague (who was not the designated operator) to start the engine. Because the vehicle was likely in gear or moved upon ignition, the worker was crushed.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Maintenance Boundaries: Field personnel (drillers) should not perform mechanical repairs or troubleshooting on heavy machinery unless specifically trained and authorized.

Communication Protocol: Clear "Start-up" protocols must be established; an engine should never be started while personnel are in the "Line of Fire" or under the chassis.

LOTO (Lockout/Tagout): Any work performed under a vehicle requires the engine to be off, keys removed, and wheels chocked.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

PEOPLE (ACTS): Use of Tools, Equipment, Materials and Products: Servicing of energized equipment/inadequate energy isolation

PEOPLE (ACTS): Use of Protective Methods: Equipment or materials not secured

PEOPLE (ACTS): Inattention/Lack of Awareness: Improper decision making or lack of judgment

PROCESS (CONDITIONS): Organizational: Inadequate training/competence

PROCESS (CONDITIONS): Organizational: Inadequate supervision

PROCESS (CONDITIONS): Organizational: Poor leadership/organizational culture

RUSSIA & CENTRAL ASIA ONSHORE

DATE: 16 Jul 2025
COUNTRY: Kazakhstan
NUMBER OF DEATHS: 4
FUNCTION: Production
CAUSE: Caught in, under or between (excl. dropped objects)
ACTIVITY: Transport - Land
PRIMARY LIFE-SAVING RULE: Driving
SECONARY LIFE-SAVING RULE: Bypassing safety controls

FATALITY

Function: Production, Employer: Contractor, Occupation: Manual labourer, Body part: Internal organs, Nature of injury: Major/multiple system trauma, Time in service: 0 months < 3 months

FATALITY

Function: Production, Employer: Contractor, Occupation: Manual labourer, Body part: Internal organs, Nature of injury: Major/multiple system trauma, Time in service: 0 months < 3 months

FATALITY

Function: Production, Employer: Contractor, Occupation: Admin, Management, Support Staff, Body part: Internal organs, Nature of injury: Major/multiple system trauma, Time in service: > 1 year < 5 years

FATALITY

Function: Production, Employer: Contractor, Occupation: Other, Body part: Internal organs, Nature of injury: Major/multiple system trauma, Time in service: > 1 year < 5 years

NARRATIVE:

On July 16, 2025, a group accident occurred involving subcontractor personnel, the Camp Commandant was performing inspections at the field. Although a company-authorized vehicle (Toyota Hilux) was scheduled for the IP's return to the base at 15:00, the IP remained on-site to complete tasks. Later, without notifying the management, the IP boarded a private Lexus GX 460 belonging to the subcontractor, which was at the field for plumbing/maintenance work.

The vehicle was carrying five occupants. While traveling on a gravel road, the driver lost control. The vehicle veered off the road and rolled over multiple times. Two passengers died instantly; two others, including the driver, died later due to severe injuries.

WHAT WENT WRONG:

Unauthorized transportation: The Camp Commandant and a plumber boarded a private vehicle belonging to an individual entrepreneur (IE) without informing management or following the official journey management plan.

Speeding on gravel: The vehicle was traveling at 93.4 km/h on a dry gravel road, which significantly exceeded safe limits for the terrain.

Lack of oversight: The driver (hired by the IE) was operating the vehicle without a valid driver's license.

Failure of Contractor Management: A private vehicle (Lexus GX 460) was allowed into the field territory and used for personnel transport without a permit, GPS/IVMS monitoring, or technical inspection.

RUSSIA & CENTRAL ASIA ONSHORE

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Journey management is mandatory: No personnel movement between sites should occur without a documented journey management plan and a company-authorized vehicle.

Zero tolerance for private vehicles: Using private or subcontractor-owned "personal" vehicles for work-related transit must be strictly prohibited and monitored at security checkpoints.

Verification of subcontractors: Business units must verify that IEs and small subcontractors comply with HSE standards, including driver licensing and vehicle safety, before they are granted site access.

Communication protocols: Employees must be re-educated on the "Stop Work Authority" and the requirement to wait for official transport rather than taking unauthorized rides.

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Work or motion at improper speed

PEOPLE (ACTS): Use of Protective Methods: Inadequate use of safety systems

PEOPLE (ACTS): Inattention/Lack of Awareness: Improper decision making or lack of judgment

PROCESS (CONDITIONS): Organizational: Inadequate training/competence

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

PROCESS (CONDITIONS): Organizational: Inadequate supervision

RUSSIA & CENTRAL ASIA OFFSHORE

DATE: 18 Mar 2025

COUNTRY: Azerbaijan

NUMBER OF DEATHS: 1

FUNCTION: Production

CAUSE: Water related, drowning

ACTIVITY: Lifting, crane, rigging, deck operations

PRIMARY LIFE-SAVING RULE: Safe mechanical lifting

SECONDARY LIFE-SAVING RULE: Line of fire

FATALITY

Function: Production, Employer: Company, Occupation: Heavy equipment operator, Body part: Unspecified, Nature of injury: Inhalation, poisoning, intoxication, asphyxiation, drowning, Time in service: 10 + years

NARRATIVE:

While repair activities were being carried out on an offshore trestle bridge, a 50-ton Liebherr crawler crane lost stability and toppled into the sea. The crane operator was fatally drowned as a result of the incident.

WHAT WENT WRONG:

- Inadequate risk assessment and lack of lifting plan;
- Lack of adequate supervision of the lifting operation by the site supervisor;
- Failure to appoint a competent signaller to control crane operations;
- Poor risk awareness among the workforce and failure to communicate hazards and risks prior to commencing work.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

- All lifting operations must be supported by a documented risk assessment and an approved lifting plan prior to commencement of work.
- Workers involved in lifting activities shall be briefed on the Safe Lifting Operations Procedure, with training provided and competency verified.
- Effective supervision must be ensured by designated responsible persons to confirm compliance with occupational health and safety requirements.
- Only competent and authorized signallers shall be assigned to control and manage crane and lifting operations.
- Hazards and risks associated with lifting activities must be clearly identified, communicated, and mitigated before work begins.
- Personnel assigned to lifting operations must possess the appropriate competence and authorization for their respective roles.
- A responsible person shall be formally appointed for each lifting operation, with roles and responsibilities clearly defined and communicated.
- A supervision and monitoring system shall be implemented and maintained to ensure lifting activities are carried out in accordance with approved procedures and plans.

RUSSIA & CENTRAL ASIA OFFSHORE

CAUSAL FACTORS:

PEOPLE (ACTS): Following Procedures: Deviation unintentional (by individual or group)

PEOPLE (ACTS): Following Procedures: Improper position (in the line of fire)

PEOPLE (ACTS): Following Procedures: Improper lifting or loading

PEOPLE (ACTS): Use of Tools, Equipment, Materials and Products: Improper use/position of tools/equipment/materials/products

PEOPLE (ACTS): Use of Protective Methods: Failure to warn of hazard

PEOPLE (ACTS): Inattention/Lack of Awareness: Improper decision making or lack of judgment

PROCESS (CONDITIONS): Organizational: Inadequate training/competence

PROCESS (CONDITIONS): Organizational: Inadequate work standards/procedures

PROCESS (CONDITIONS): Organizational: Inadequate hazard identification or risk assessment

PROCESS (CONDITIONS): Organizational: Inadequate supervision

SOUTH & CENTRAL AMERICA ONSHORE

DATE: 10 Jul 2025
COUNTRY: Argentina
NUMBER OF DEATHS: 1
NUMBER OF PERMANENT IMPAIRMENT INJURIES: 2
FUNCTION: Production
CAUSE: Caught in, under or between (excl. dropped objects)
ACTIVITY: Transport - Land
PRIMARY LIFE-SAVING RULE: Driving

FATALITY

Function: Production, Employer: Contractor, Occupation: Process/equipment operator, Body part: Head (incl. mouth, etc.), Nature of injury: Crushing, Time in service: > 1 year < 5 years

PERMANENT IMPAIRMENT

PI Category: Permanent reduction in psychological, social or cognitive function, PI Subcategory: Post injury psychiatric disorders including Post Traumatic Stress Disorder (PTSD) with inability to return to previous work role and/or schedule, Body part: Leg/knee/hip, Nature of injury: Fracture, Time in service: > 5 years < 10 years, Function: Production, Employer: Contractor, Occupation: Transportation operator, Body part: Leg/knee/hip, Nature of injury: Fracture, Time in service: > 5 years < 10 years

PERMANENT IMPAIRMENT

PI Category: Permanent reduction in psychological, social or cognitive function, PI Subcategory: Post injury psychiatric disorders including Post Traumatic Stress Disorder (PTSD) with inability to return to previous work role and/or schedule, Body part: Neck/torso/spine, Nature of injury: Fracture, Time in service: > 5 years < 10 years, Function: Production, Employer: Contractor, Occupation: Process/equipment operator, Body part: Neck/torso/spine, Nature of injury: Fracture, Time in service: > 5 years < 10 years

NARRATIVE:

On July 10, 2025, at approximately 7:40 AM, while traveling along public road, a contractor minibus carrying four passengers and a driver was involved in a frontal collision with a third-party truck, which had a single occupant. A third vehicle, a car carrying three passengers, was also involved in the incident. As a result of the collision, one passenger from the minibus and the driver of the truck tragically lost their lives. The remaining minibus occupants sustained injuries of varying severity and were transported to hospital for treatment. The three passengers from the car were medically evaluated and later discharged. Emergency services and another contractor vehicle arrived within minutes, and emergency calls were made.

WHAT WENT WRONG:

Preliminary indications suggest the car, traveling ahead of the minibus, may have crossed lanes and interacted with the truck, triggering a chain reaction that caused the truck to veer into the minibus’s path. The crash occurred rapidly, leaving little time for evasive action.

Two passengers who were not wearing seatbelts were ejected from the minibus upon impact. One passenger sustained fatal injuries, while the other was severely injured.

SOUTH & CENTRAL AMERICA ONSHORE

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

1. While Contractor HSSE Management processes are in place and HSSE risks are generally identified as high, inconsistent specification, documentation, and assurance of transport and driver safety requirements - particularly for personnel transportation - can lead to gaps in effective risk mitigation. Clear, consistent contract requirements, robust contractor and subcontractor transport safety capability assessments, aligned HSSE Plans, and disciplined assurance with tracked actions to closure are essential to ensure driver safety risks are adequately managed throughout the contract lifecycle.
2. Transport and driver safety risks were inconsistently identified, embedded, or assured within contractor scopes - particularly in multi-mode contracts - leading to gaps in critical controls such as seatbelt use, fatigue management, and safety technology deployment. Clear scope ownership and active contract holder engagement, as seen in road-transport-focused contracts, are essential to ensure consistent enforcement of legal requirements, driver readiness, and effective use of technology-enabled controls across all transport activities.
3. Emergency response arrangements were not sufficiently adapted for road transport and commuting scenarios, with plans, training, and exercises primarily focused on site-based emergencies. The absence of joint planning with contractors, limited consideration of regional infrastructure and communication constraints, unclear offsite roles and responsibilities, and poorly defined notification and activation protocols reduced preparedness and effectiveness for offsite incidents. Emergency response planning must explicitly address offsite transport risks and be jointly assured with contractors to ensure timely, coordinated, and effective response.

CAUSAL FACTORS:

- PEOPLE (ACTS):** Following Procedures: Deviation unintentional (by individual or group)
- PEOPLE (ACTS):** Following Procedures: Work or motion at improper speed
- PEOPLE (ACTS):** Use of Protective Methods: Inadequate use of safety systems
- PEOPLE (ACTS):** Inattention/Lack of Awareness: Fatigue
- PROCESS (CONDITIONS):** Organizational: Inadequate work standards/procedures

DATE: 29 Oct 2025

COUNTRY: Peru

NUMBER OF DEATHS: 3

FUNCTION: Production

CAUSE: Aviation accident

ACTIVITY: Transport - Air

PRIMARY LIFE-SAVING RULE: Other issue – no applicable rule

FATALITY

Function: Production, Employer: Contractor, Occupation: Other, Body part: Neck/torso/spine, Nature of injury: Unspecified, Time in service: -

FATALITY

Function: Production, Employer: Contractor, Occupation: Other, Body part: Neck/torso/spine, Nature of injury: Unspecified, Time in service: -

FATALITY

Function: Production, Employer: Contractor, Occupation: Other, Body part: Neck/torso/spine, Nature of injury: Unspecified, Time in service: -

SOUTH & CENTRAL AMERICA ONSHORE

NARRATIVE:

During the execution of external load hooking operations in the aerial operations, a helicopter crashed to the ground, resulting in three fatalities, total loss of the aircraft, and a small-scale fuel spill with limited environmental impact.

WHAT WENT WRONG:

Incident currently under investigation.

CORRECTIVE ACTIONS AND RECOMMENDATIONS:

Incident currently under investigation.

CAUSAL FACTORS:

No Causal Factors Allocated

SOUTH & CENTRAL AMERICA OFFSHORE

No fatal incidents reported.

For the full analysis of 2025 results,
as well as all fatal incident reports
submitted to IOGP since 1991,
visit IOGP's data website at:
<https://data.iogp.org>

IOGP Headquarters

3 Moorgate Place, London, EC2R 6EA, United Kingdom
T: +44 20 4570 6879
E: reception@iogp.org

IOGP Europe

T: +32 2 882 16 53
E: reception-europe@iogp.org

www.iogp.org