Vijeo Citect v7.40

Release Notes for Service Pack 1

The Vijeo Citect v7.40 Service Pack 1 includes several product updates and enhancements, providing improvements in stability, performance and functionality.

Important:

As per recommended practice, all projects should be backed up prior to commencing the Service Pack installation.

Important:

Upgrade and recompile all projects after installing this Service Pack. If not performed, a 'conflicting database size' message will occur.

By default, the Project Editor will prompt to perform the upgrade after the configuration tools are launched. However, if you cancel the upgrade, you can select another upgrade to occur at startup by editing the Citect.ini file, setting [CTEDIT] Upgrade=1, and restarting the Project Explorer.

In some instances a full compile may be required after an upgrade. If using Incremental Compile (which is the default) re-run a compile, and select to continue when prompted to perform a full compile.

For projects using Library_Equipment templates, please run **Update Pages** (in Graphics Builder→Tools→Update Pages).

Hot Fixes

Customers who have hot fixes installed should check the release notes to ensure the applicable fix is included in this Service Pack - please contact SCADA & MES Global Support if in any doubt.

SCADA & MES Global Support recommends V7.40 users apply the Service Pack as soon as practically possible.

Note For general information about service packs, see Knowledge Base article Q2181.

This service pack applies to two of the components shipped with Vijeo Citect version 7.40:

a) Vijeo Citect

b) Vijeo Citect Web Server

Separate service pack installers have been created for these components, allowing you to choose which components to upgrade to Service Pack 1.

Table of Contents

Release Notes for Service Pack 1 1
Table of Contents 2
What's New in Vijeo Citect v7.40 SP1 3
Service Pack Installation 5
Service Pack Uninstall 9
Files changed in this Service Pack 12
Known Issues 22
Issues resolved in this Service Pack 23

What's New in Vijeo Citect v7.40 SP1

Vijeo Citect v7.40 SP1 incorporates the following new or modified features.

- **Alarm performance improvement**

  In v7.40, some users have observed slower display of alarms after the login of a new user or start of the client. This delay has been reduced in v7.40 SP1.

  As part of the improvement process, there has been a change in the default value of the [Alarm]DefaultSOETimeRange parameter from 7 days to 1 day which affects the number of records returned when no time-range filter has been specified.

  Additional improvement to the performance of the SOE alarm pages may be achieved by adjusting the configuration parameter [Alarm] SoeRowLimit. This parameter determines the maximum amount of records per cluster that are displayed on the SOE Page. For example, reducing the value (from the default of 200k) to 1000 would allow approximately 40 pages of alarms to be returned. If you have a historian server connected to the system, then you should consider the amount of history needed; it is recommend using the default value with a historian database.

- **Enhancements to the Equipment Editor**

  A number of significant enhancements have been made to the equipment editor which include:

  1. An equipment can now be created using dot notation to build the hierarchy when creating an instance. For example, an equipment name can be specified as AA.BB.CC to create the instance (CC) at the specified position.
  2. Accumulator items can now be added to an equipment type.
  3. Equipment with no set equipment type can be created to make it easier for users to create their equipment tree.
  4. Equipment States and Custom Parameters appear in tabs next to the equipment items tab making it easier for users to configure equipment types.
  5. The duplication / moving of an equipment node will now also duplicate / move the child equipment nodes.
  6. The read only equipment types in the system include projects can now be copied to user projects for further customization.

- **EcoStruxure Web Services Client**

  The EcoStruxure Web Services Client enables Vijeo Citect to communicate with an EcoStruxure Web Services Server.

- **New Cicode Function**

  A new Cicode function has been introduced.

  GetLanguage - Gets the language currently used on the display client.

- **Schneider Electric PAC Diagnostic Equipment Objects**
  The Library_Equipment include project now features a series of new genies and popup page templates providing Integrated diagnostics and status information popup pages for Schneider Electric's M580, M340, Premium and Quantum Programmable Automation Controller PAC range.
  These include:
  1. Diagnostic and status information popup pages for Schneider Electric M580, M340, Premium and Quantum PAC range.
  2. Web links to FactoryCast Module to display PAC statistics and summary pages for M580, M340, Premium and Quantum PAC range.

  The starter projects have been updated to include the new genies and popup pages for the PAC Diagnostic Equipment Objects.
  To use these in an existing project:
  1. Create a new project from the SxW_Style starter project
  2. Copy the popup pages to your project (pages beginning with '!SEPACStatus')
  3. Add 'Library_Equipment' include project reference to your project
  4. Use the new Genies from the 'Equip_SE_PAC' library on you pages in yourproject

  New Pop up page templates include:
  1. Equip_Control - pre-defined for equipment control
  2. Equip_Alarm - pre-defined for alarm display
  3. Equip_PA - pre-defined for process analyst (trends)
  4. Equip_Tagl - pre-defined for variable tags
  5. Equip_Normal - generic pop-up
  6. Equip_Extended - generic pop-up of extended size

- **Quick Start Tutorial**
  A Quick Start tutorial has been added to the PC and Web based help, and is also available as two pdf documents. Split into two parts, the first part outlines basic configuration and the second part advanced configuration concepts which combined gives users a comprehensive introduction to Vijeo Citect.

- **Running as a Windows Service**
  The following White paper details the steps required to run Vijeo Citect as a Windows Service.
  http://www.citect-kb.schneider-electric.com/ScadaKB/KnowledgebaseArticle6599.aspx

Service Pack Installation

Select the relevant install procedure below:

Existing Vijeo Citect v7.40 Users

1. Run patch file "Vijeo Citect 7.40 SP1.exe" to extract installation package.

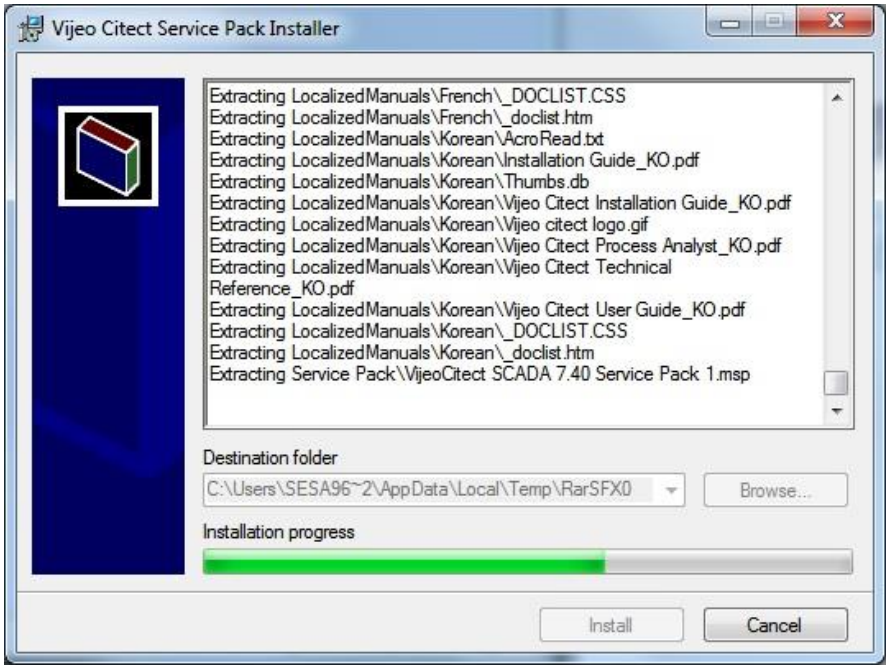


Figure 1: Installation Package Extraction

2. Click 'Next' and follow on-screen instructions to install "Vijeo Citect 7.40 Service Pack 1".



Figure 2: Service Pack Installer

3. In step shown in Figure 3, make sure that Vijeo Citect 7.40 Service Pack 1 Checkbox is ticked. Please note web server upgrade will be explained later in this section.

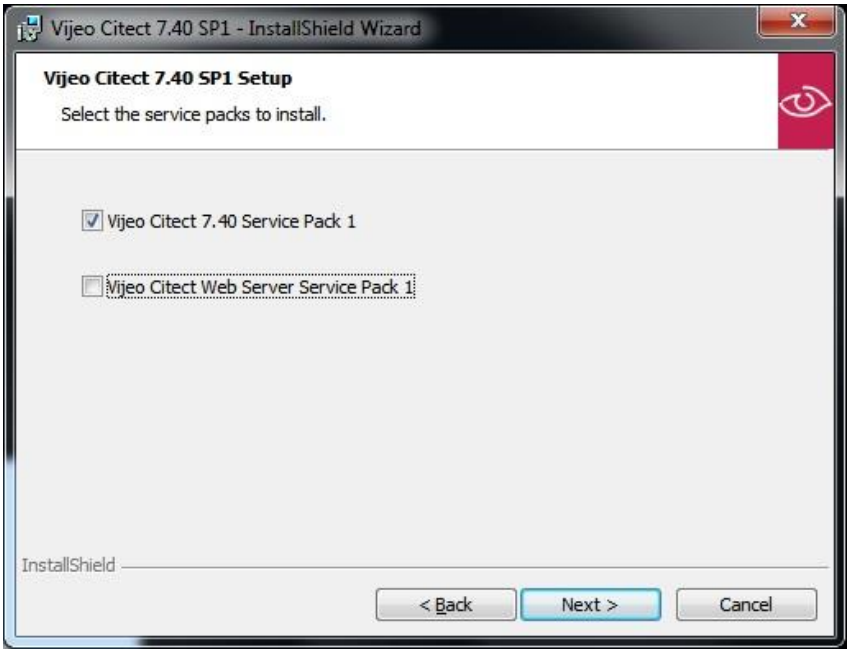


Figure 3: Vijeo Citect 7.40 Service Pack 1 Installation

4. Click 'Finish' button to exit the installer.



Figure 4: Installation Complete

5. Open Citect Explorer, wait until upgrade has completed.
6. For any project using Library_Equipment templates:
    a. Select the project in Citect Explorer.
    b. In Citect Graphics Builder, select Tools→Update Pages, then click Yes to continue.

7. Perform a full compile - when using Incremental Compile (which is the default) re-run the compile and select to continue when prompted.
8. For any webclient project whose graphics pages were updated in step 5, redeploy:
    a. Run Citect Explorer→Tools→Web Deployment Preparation.
    b. Follow the steps below for "Upgrading Vijeo Citect 7.40 Web Server to Service Pack 1" and re-save the project deployment.

New Vijeo Citect v7.40 Users

1. Install Vijeo Citect v7.40.
2. Open Citect Explorer for the first time and then close.
3. Run patch file "VijeoCitect SCADA 7.40 Service Pack 1.exe".
4. Open Citect Explorer, wait until the upgrade has completed.
5. For any project using Library_Equipment templates:
    a. Select the project in Citect Explorer.
    b. In Citect Graphics Builder, select Tools→Update Pages, then click Yes to continue.
6. Ensure the Incremental Compile menu option (in Project Editor→Tools→Options) is turned OFF before recompiling each project.

Upgrading Vijeo Citect 7.40 Web Server to Service Pack 1

To upgrade Vijeo Citect 7.40 Web Server:

1. On your web server(s) (machines running IIS), run patch file "Vijeo Citect 7.40 SP1.exe". When dialog in Figure 4 is prompted, make sure that Vijeo Citect Web Server Service Pack 1 checkbox is ticked. This will install an updated CAB file: "CitectSCADAWebClient_7_40_1_239.cab" which will become available to all your web clients.

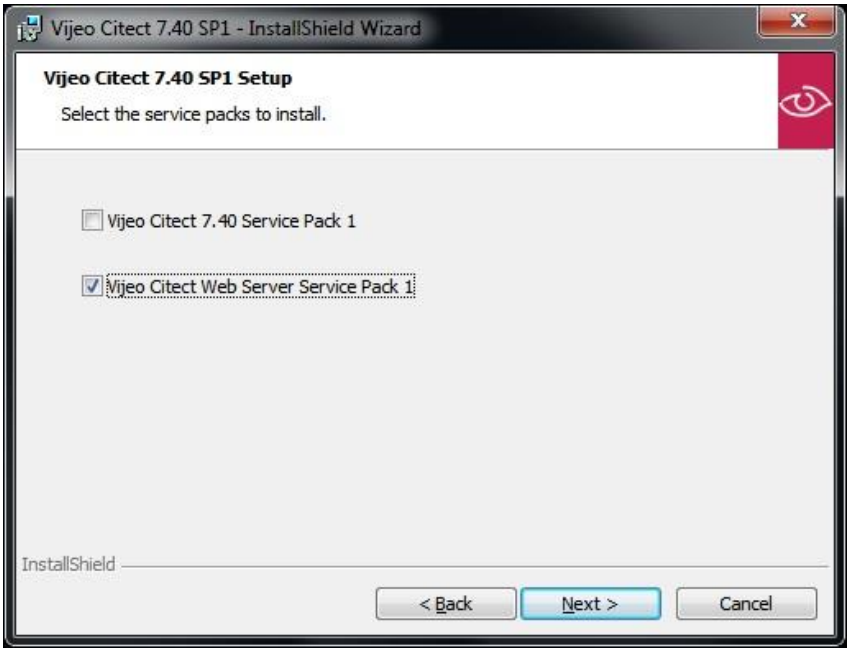


Figure 5: Vijeo Citect Web Server Service Pack 1 Installation

2. On all your web client machines, take the following actions:
    a. Open Programs and Features by choosing Start→Settings→Control Panel→Programs→Programs and Features.
    b. Locate the entry 'Citect Web Client 7.40' and click 'Remove'. If this item is not listed in Programs and Features, you should delete the *%windir%\system32\citect\webclient\740* directory. (*NB: %windir% indicates the default windows installation directory.)*
    c. In the Vijeo Citect Web Deployment Configuration (in Internet Explorer):
        i. Select "CitectSCADAWebClient_7_40_1_239.cab" from the *Client Control* drop down menu.
        ii. Save the deployment by selecting the action to save deployment.

Service Pack Uninstall

The procedure for removing (rolling back) Service Pack 1 varies according to the Operating System you are running.

Supported Windows Versions

Before following one of the procedures below, backup your citect.ini file to a temporary location. Use the Computer Setup Editor (via Tools menu) to determine the location of this file. This step is required as the uninstall procedure may revert some settings back to their default. Additionally, unless you are restoring your projects to the backups made prior to Service Pack upgrade, you will also need to backup the citect.frm file from the Bin directory. Restore the citect.ini file (and possibly citect.frm) to their original location upon completion of the uninstall procedure.

During the uninstallation process the user will be prompted to specify the Vijeo Citect 7.40 installer location if it is no longer accessible. The following message is shown if Vijeo Citect 7.40 has been installed from a DVD:

"The feature you are trying to use is on a CD-ROM or other removable disk that is not available".

Hence when uninstalling SCADA service pack 1 the user will have to specify the Vijeo Citect 7.40 installer location. Locate the MSI installer for the Vijeo Citect 7.40 product via the Browse button and then click OK. The SCADA installer is located in the "Citect" folder under the main installation directory (e.g. your DVD drive).

To uninstall products other than the Web Server:

1. Open “Programs and Features” from the Control Panel :

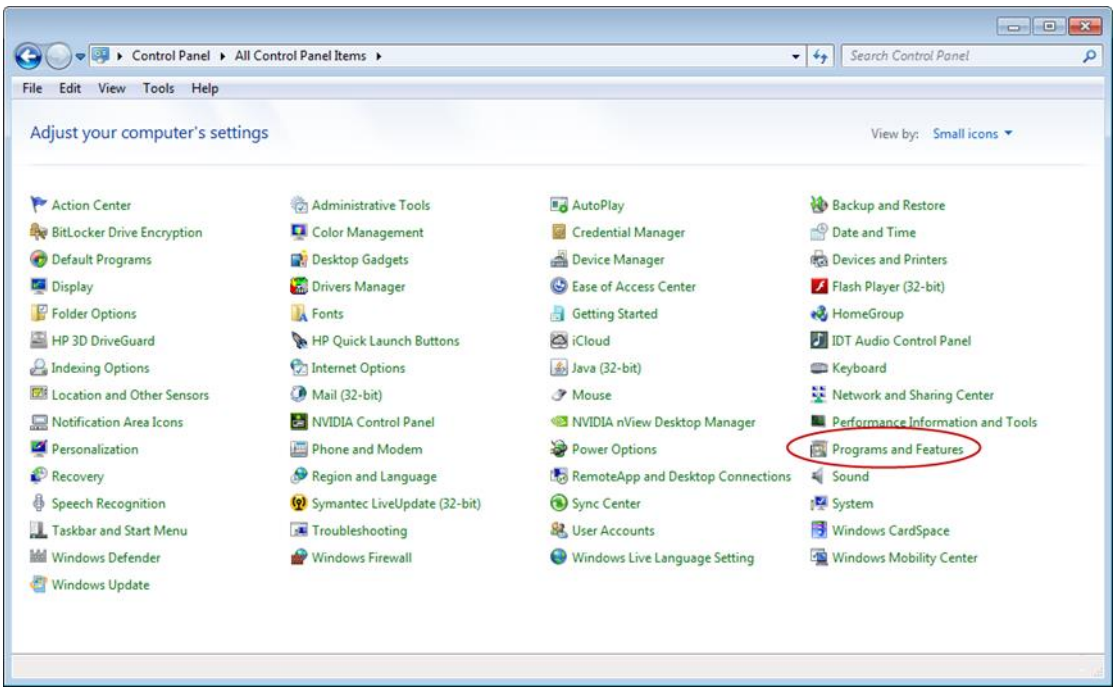


Figure 6: Programs and Features

2. Select “View installed updates” from the side panel that is presented:

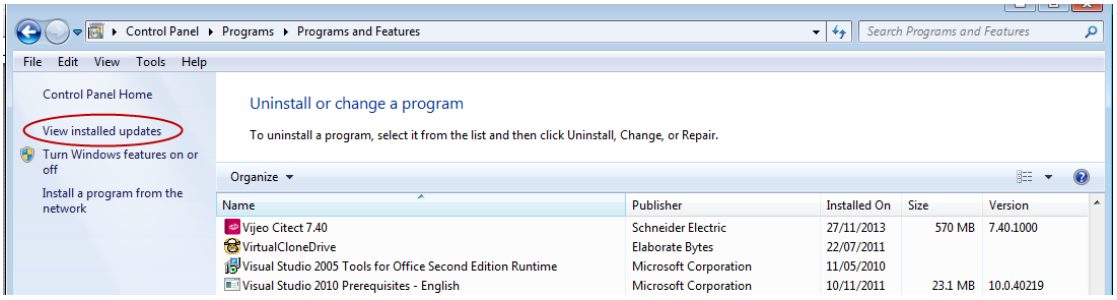


Figure 7: View installed updates

3. Select “Service Pack 1” for the appropriate product then click Uninstall:

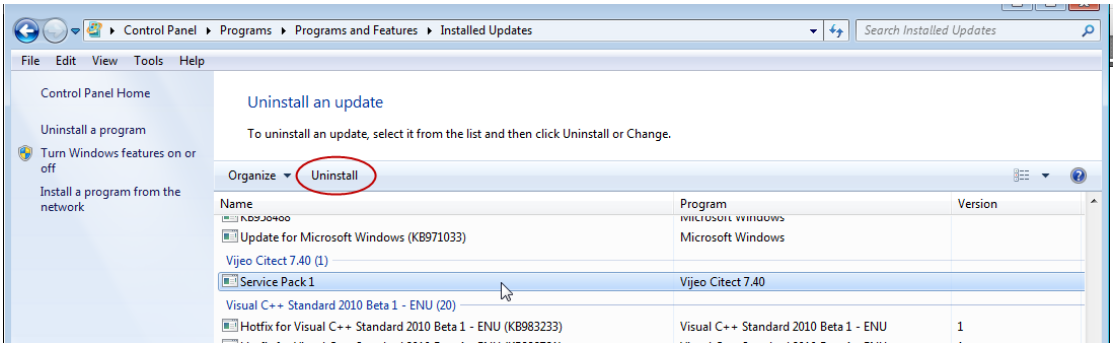


Figure 8: Uninstall an update

Note If you have User Access Control switched on, the UAC dialog will be displayed before the uninstaller is launched. Select allow and proceed with the uninstallation. This is a limitation imposed by the User Access Control and cannot be avoided.

4. Open Citect Explorer, wait until upgrade has completed.
5. For any project using Library_Equipment templates:
    a. Select the project in Citect Explorer.
    b. In Citect Graphics Builder, select Tools→Update Pages, then click Yes to continue.
6. The Incremental Compile menu option (in Project Editor→Tools→Options) should be turned OFF before recompiling each project.

Note The EcoStruxure Web Services (EWS) client is installed in the Vijeo Citect 7.40 Service Pack 1. The EWS client is not activated until it is configured in the project. It will not be uninstalled by the service pack uninstaller.

Uninstalling WebServer and WebClient(s)

The Vijeo Citect servers and web client(s) must be running the same service pack. This means that to uninstall Vijeo Citect 7.40 Service Pack 1, it is also necessary to modify the deployments on the web server, and uninstall any web clients that connect to the downgraded servers. This will allow the web server to install the correct web client version when next used.

Note	Vijeo Citect 7.40 Service Pack 1 web client cabinet (CitectSCADAWebClient_7_40_1_239.cab) will update the Microsoft Rich Text control (RichTx32.ocx) on your web client machines. As per Microsoft best practices, this control will not be downgraded to the original version after uninstalling the web client.

Files changed in this Service Pack

Listed below are the files updated or added to the Vijeo Citect product after installing 7.40 Service Pack 1.

Added Files – Vijeo Citect

Add Install Path and File - Vijeo Citect
Common\Citect\Scheduler 7.40\SE.TimeSchedulerControls.resources.de.dll
Common\Citect\Scheduler 7.40\SE.TimeSchedulerControls.resources.es.dll
Common\Citect\Scheduler 7.40\SE.TimeSchedulerControls.resources.fr.dll
Common\Citect\Scheduler 7.40\SE.TimeSchedulerControls.resources.it.dll
Common\Citect\Scheduler 7.40\SE.TimeSchedulerControls.resources.ja.dll
Common\Citect\Scheduler 7.40\SE.TimeSchedulerControls.resources.ko.dll
Common\Citect\Scheduler 7.40\SE.TimeSchedulerControls.resources.no.dll
Common\Citect\Scheduler 7.40\SE.TimeSchedulerControls.resources.pt.dll
Common\Citect\Scheduler 7.40\SE.TimeSchedulerControls.resources.ru.dll
Common\Citect\Scheduler 7.40\SE.TimeSchedulerControls.resources.sv.dll
Common\Citect\Scheduler 7.40\SE.TimeSchedulerControls.resources.zh-CHS.dll
Common\Schneider Electric Shared\Schneider Electric Software Update\Config\IuSettingsCitectEWSCLIENTDriver.xml
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Include\portuguese.NDX
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Include\portuguese.dbf
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Controls\portuguese.NDX
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Controls\portuguese.dbf
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Equipment\French.NDX
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Equipment\French.dbf
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Equipment\SE_M340_OFS.xml
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Equipment\SE_M580_OFS.xml
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Equipment\SE_PAC.ci
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Equipment\SE_Premium_OFS.xml
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Equipment\SE_Quantum_OFS.xml
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Equipment\equip_se_pac.ctm
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\SxW_Style_Include\portuguese.NDX
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\SxW_Style_Include\portuguese.dbf
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Tab_Style_Include\portuguese.NDX
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Tab_Style_Include\portuguese.dbf
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\DriverBackup\EWSCLIENT\EXPRBRD.DBF
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\DriverBackup\EWSCLIENT\EXPRWIZ.DBF
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\DriverBackup\EWSCLIENT\HELP.DBF
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\DriverBackup\EWSCLIENT\PROTDIR.DBF
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect

7.40\Bin\DriverBackup\EWSCLIENT\PROTERR.DBF
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\DriverDebugWrapper.dll
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\DriverReadMe\readme_EWSCLIENT.html
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\EWSCLIENT.DBF
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\EWSCLIENT.dll
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\EWSClientWrapper.dll
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SE.SCADA.CommonFunctions.dll
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SE.SCADA.CommonTypes.dll
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SE.SCADA.EWSClientProxy.dll
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SE.SCADA.zlibwapi.dll
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect\Documentation\Vijeo Citect Quick Start Guide Part 1.pdf
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect\Documentation\Vijeo Citect Quick Start Guide Part 2.pdf

Updated Files – Vijeo Citect

Update Install Path and File - Vijeo Citect	Notes
Common\Citect\Scheduler 7.40\CiDebugHelp.dll	
Common\Citect\Scheduler 7.40\CtApi.dll	
Common\Citect\Scheduler 7.40\CtEng32.dll	
Common\Citect\Scheduler 7.40\CtRes32.DLL	
Common\Citect\Scheduler 7.40\CtUtil32.dll	
Common\Citect\Scheduler 7.40\Ct_ipc.dll	
Common\Citect\Scheduler 7.40\SE.CTAPIWrapper.dll	
Common\Citect\Scheduler 7.40\SE.TimeSchedulerControls.dll	
Common\Citect\Scheduler 7.40\TimeSchedulerActiveXContainer.dll	
Common\Citect\Scheduler 7.40\Win32Ctrl.dll	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\Config\CitectMetadata.xml	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\Data\Example.ctz	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\Starter\SxW_Style_1_HD1080_titlebar.ctz	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\Starter\SxW_Style_1_HD768_titlebar.ctz	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\Starter\Tab_Style_1_HD1080_titlebar.ctz	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\Starter\Tab_Style_1_SXGA_titlebar.ctz	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\Starter\Tab_Style_1_WUXGA_titlebar.ctz	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\Starter\Tab_Style_1_XGA_titlebar.ctz	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\CSV_Include\CSV_Alarms.ci	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\CSV_Include\CSV_Database.ci	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\CSV_Include\accums.DBF	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\CSV_Include\activex.zip	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect	

7.40\User\CSV_Include\trend.DBF	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Include\ACCUMS.DBF	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Include\LANG.DBF	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Include\PROJECT.CIT	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Include\TREND.DBF	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Include\chinese.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Include\citect.ci	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Include\french.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Include\german.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Include\hebrew.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Include\italian.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Include\japanese.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Include\korean.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Include\russian.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Include\spanish.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Include\tagDebugForm.ci	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Controls\Lib_Controls.frm	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Controls\PROJECT.CIT	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Controls\Tabs.ci	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Controls_Internal_Calendar.ci	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Controls_Internal_Library.ci	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Controls_Internal_PageTabs.ci	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Controls_Internal_Table.ci	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Controls_Internal_Tree.ci	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Controls\accums.DBF	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Controls\chinese.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Controls\french.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Controls\german.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Controls\hebrew.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Controls\italian.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Controls\japanese.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Controls\korean.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Controls\lang.DBF	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Controls\russian.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect	

7.40\User\Library_Controls\spanish.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Controls\trend.DBF	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Equipment\English.DBF	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Equipment\English.NDX	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Equipment\Equip.ci	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Equipment_Internal_Equip.ci	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Equipment\eqtype.DBF	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Equipment\equipment.ctt	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Equipment\lang.DBF	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Equipment\lang.SQX	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Library_Equipment\pagemenu.DBF	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\SxW_Style_Include\PROJECT.CIT	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\SxW_Style_Include\SxwRightPanel.ci	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\SxW_Style_Include\accums.DBF	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\SxW_Style_Include\chinese.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\SxW_Style_Include\french.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\SxW_Style_Include\german.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\SxW_Style_Include\hebrew.DBF	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\SxW_Style_Include\italian.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\SxW_Style_Include\japanese.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\SxW_Style_Include\korean.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\SxW_Style_Include\lang.DBF	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\SxW_Style_Include\russian.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\SxW_Style_Include\spanish.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\SxW_Style_Include\trend.DBF	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\System\ACCUMS.DBF	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\System\HARDALM.DBF	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\System\TREND.DBF	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Tab_Style_Include\DisplayFile.ci	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Tab_Style_Include\PROJECT.CIT	

_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Tab_Style_Include\TabAlarm_Utility.ci	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Tab_Style_Include\accums.DBF	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Tab_Style_Include\activex.zip	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Tab_Style_Include\chinese.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Tab_Style_Include\french.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Tab_Style_Include\german.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Tab_Style_Include\hebrew.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Tab_Style_Include\italian.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Tab_Style_Include\japanese.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Tab_Style_Include\korean.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Tab_Style_Include\lang.DBF	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Tab_Style_Include\russian.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Tab_Style_Include\spanish.dbf	
_CommonAppDataFolder_\Schneider Electric\Vijeo Citect 7.40\User\Tab_Style_Include\trend.DBF	
_CommonFilesFolder_\Citect\Alarm\DBClient.dll	
_CommonFilesFolder_\Citect\Alarm\DBKernel.dll	
_CommonFilesFolder_\Citect\Alarm\DBQP.dll	
_CommonFilesFolder_\Citect\Alarm\Lib.dll	
_CommonFilesFolder_\Citect\Analyst.dll	
_CommonFilesFolder_\Citect\CiASCDrv.dll	
_CommonFilesFolder_\Citect\CiDBFDrv.dll	
_CommonFilesFolder_\Citect\CiDebugHelp.dll	
_CommonFilesFolder_\Citect\CiMitsubishiTagBrowse.dll	
_CommonFilesFolder_\Citect\CiOPCDrv.dll	Chinese
_CommonFilesFolder_\Citect\CiOPCDrv.dll	English
_CommonFilesFolder_\Citect\CiOPCDrv.dll	French
_CommonFilesFolder_\Citect\CiOPCDrv.dll	German
_CommonFilesFolder_\Citect\CiOPCDrv.dll	Italian
_CommonFilesFolder_\Citect\CiOPCDrv.dll	Japanese
_CommonFilesFolder_\Citect\CiOPCDrv.dll	Korean
_CommonFilesFolder_\Citect\CiOPCDrv.dll	Russian
_CommonFilesFolder_\Citect\CiOPCDrv.dll	Spanish
_CommonFilesFolder_\Citect\CiOPCTagBrowse.dll	Chinese
_CommonFilesFolder_\Citect\CiOPCTagBrowse.dll	English
_CommonFilesFolder_\Citect\CiOPCTagBrowse.dll	French
_CommonFilesFolder_\Citect\CiOPCTagBrowse.dll	German
_CommonFilesFolder_\Citect\CiOPCTagBrowse.dll	Italian
_CommonFilesFolder_\Citect\CiOPCTagBrowse.dll	Japanese
_CommonFilesFolder_\Citect\CiOPCTagBrowse.dll	Korean
_CommonFilesFolder_\Citect\CiOPCTagBrowse.dll	Russian

_CommonFilesFolder_\Citect\CiOPCTagBrowse.dll	Spanish
_CommonFilesFolder_\Citect\CiSchneiderDrv.dll	Chinese
_CommonFilesFolder_\Citect\CiSchneiderDrv.dll	English
_CommonFilesFolder_\Citect\CiSchneiderDrv.dll	French
_CommonFilesFolder_\Citect\CiSchneiderDrv.dll	German
_CommonFilesFolder_\Citect\CiSchneiderDrv.dll	Italian
_CommonFilesFolder_\Citect\CiSchneiderDrv.dll	Japanese
_CommonFilesFolder_\Citect\CiSchneiderDrv.dll	Korean
_CommonFilesFolder_\Citect\CiSchneiderDrv.dll	Russian
_CommonFilesFolder_\Citect\CiSchneiderDrv.dll	Spanish
_CommonFilesFolder_\Citect\CiSchneiderTagBrowse.dll	Chinese
_CommonFilesFolder_\Citect\CiSchneiderTagBrowse.dll	English
_CommonFilesFolder_\Citect\CiSchneiderTagBrowse.dll	French
_CommonFilesFolder_\Citect\CiSchneiderTagBrowse.dll	German
_CommonFilesFolder_\Citect\CiSchneiderTagBrowse.dll	Italian
_CommonFilesFolder_\Citect\CiSchneiderTagBrowse.dll	Japanese
_CommonFilesFolder_\Citect\CiSchneiderTagBrowse.dll	Korean
_CommonFilesFolder_\Citect\CiSchneiderTagBrowse.dll	Russian
_CommonFilesFolder_\Citect\CiSchneiderTagBrowse.dll	Spanish
_CommonFilesFolder_\Citect\CiTagBrowse.dll	
_CommonFilesFolder_\Citect\CiTrans.dll	
_CommonFilesFolder_\Citect\CiTrendArchiveFileOffset.dll	
_CommonFilesFolder_\Citect\CiTrendArchiveFileOffset8Byte.dll	
_CommonFilesFolder_\Citect\CiTrendArchiveInterpolator.dll	
_CommonFilesFolder_\Citect\CiTrendManager.dll	
_CommonFilesFolder_\Citect\Cimitsubishidrv.dll	
_CommonFilesFolder_\Citect\CtApi.dll	
_CommonFilesFolder_\Citect\CtEng32.dll	
_CommonFilesFolder_\Citect\CtKC.dll	
_CommonFilesFolder_\Citect\CtRes32.DLL	English
_CommonFilesFolder_\Citect\CtRes32.dll	Chinese
_CommonFilesFolder_\Citect\CtRes32.dll	French
_CommonFilesFolder_\Citect\CtRes32.dll	German
_CommonFilesFolder_\Citect\CtRes32.dll	Italian
_CommonFilesFolder_\Citect\CtRes32.dll	Japanese
_CommonFilesFolder_\Citect\CtRes32.dll	Korean
_CommonFilesFolder_\Citect\CtRes32.dll	Russian
_CommonFilesFolder_\Citect\CtRes32.dll	Spanish
_CommonFilesFolder_\Citect\CtUtil32.dll	
_CommonFilesFolder_\Citect\Ct_ipc.dll	
_CommonFilesFolder_\Citect\ProcessAnalyst.chm	
_CommonFilesFolder_\Citect\Resources.dll	Chinese
_CommonFilesFolder_\Citect\Resources.dll	English
_CommonFilesFolder_\Citect\Resources.dll	French
_CommonFilesFolder_\Citect\Resources.dll	German
_CommonFilesFolder_\Citect\Resources.dll	Italian
_CommonFilesFolder_\Citect\Resources.dll	Japanese
_CommonFilesFolder_\Citect\Resources.dll	Korean
_CommonFilesFolder_\Citect\Resources.dll	Russian
_CommonFilesFolder_\Citect\Resources.dll	Spanish

_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\AlarmServer.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CSAPSI.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CSEHelp.chm	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CTTAGDB.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CiDebugHelp.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CiExceptionMailer.dll	Chinese
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CiExceptionMailer.dll	English
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CiExceptionMailer.dll	French
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CiExceptionMailer.dll	German
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CiExceptionMailer.dll	Italian
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CiExceptionMailer.dll	Japanese
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CiExceptionMailer.dll	Korean
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CiExceptionMailer.dll	Russian
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CiExceptionMailer.dll	Spanish
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CiUSAFE.exe	Chinese
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CiUSAFE.exe	English
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CiUSAFE.exe	French
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CiUSAFE.exe	German
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CiUSAFE.exe	Italian
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CiUSAFE.exe	Japanese
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CiUSAFE.exe	Korean
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CiUSAFE.exe	Russian
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CiUSAFE.exe	Spanish
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CicodeReference.chm	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Citect.CitectSCADA.DSServers.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Citect.CitectSCADA.Kernel.KernelTaskQueue.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Citect.CitectSCADA.Migration.exe	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Citect.CitectSCADA.RuntimeConfiguration.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Citect.CitectSCADA.TagGen.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Citect.Platform.Data.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Citect.Platform.PSI.Client.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Citect.Platform.PSI.Interfaces.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Citect.Platform.PSI.Server.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Citect.Platform.Scheduling.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Citect.Platform.Tasks.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Citect.Platform.Transport.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Citect.Platform.logging.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Citect32.exe	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CitectSCADA.chm	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\ClearScada.Client.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\ClearScada.Core.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Client.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\ComputerSetupEditor.exe	

_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtApi.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtApi.lib	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtBack32.exe	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtCicode.exe	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtCmp32.exe	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtDraw32.exe	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtEdit32.exe	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtEng32.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtExplor.exe	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtIndex.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtKC.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtMenu32.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtProj.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtRegion.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtRender.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtRes32.DLL	English
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtRes32.dll	Chinese
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtRes32.dll	French
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtRes32.dll	German
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtRes32.dll	Italian
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtRes32.dll	Japanese
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtRes32.dll	Korean
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtRes32.dll	Russian
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtRes32.dll	Spanish
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtSetup.exe	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtUtil32.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtVersion.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\CtVersion.xml	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Ct_ipc.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Ctcomdlg.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Ctg32.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\DB3UTILS.DLL	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\DBClient.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\DBFAccess.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\DBKernel.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\DBQP.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\DBServerCore.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\DRVUTILS.DLL	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Diskdrv.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Dlg32.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\DriverConfigInfo.DLL	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\DriverDebug.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\DriverRuntimeInterface.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\ERRSTR.DBF	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\ERRSTR.NDX	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\EXPRWIZ.DBF	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\ExprWiz.exe	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\FUNC0.DBF	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\HELP.DBF	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\HELP.NDX	

_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\IoServer.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\LMBrickProvider.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Lib.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\ManagedDep.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\ManagedUtil.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\PLUSADOCon.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\PROTERR.DBF	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\ParameterLUT.xml	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Parameters.chm	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\PlatformHost.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\PolledDataSource.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\ProcessAnalyst.chm	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\ReIndex.exe	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\ReportServer.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Rscite32.exe	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\RuntimeConfiguration.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\RuntimeConfigurationDatabaseAccess.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\RuntimeManager.chm	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\RuntimeManager.exe	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SACCUMS.DBF	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SCADAHELP.NDX	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SCADAHELP.dbf	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SE.Alarm.Client.Adaptor.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SE.Alarm.Client.Connection.Manager.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SE.Alarm.Client.Model.Interfaces.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SE.Alarm.Client.Model.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SE.CTAPIWrapper.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SE.SCADA.Alarm.LegacyUtility.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SE.SCADA.EWS.ServiceHost.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SE.SCADA.EWS.ServiceLibrary.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SE.SCADA.OPC.DaServer.Host.exe	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SE.SCADA.OPC.DaServer.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SE.SCADA.UACWorks.exe	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SE.Scada.EquipmentEditor.Model.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SE.Scada.EquipmentEditor.SE.Theme.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SE.Scada.EquipmentEditor.exe	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SSPC.DBF	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\STREND.DBF	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SchedOp.chm	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\SchneiderIdentity.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Techdo32.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\TimeSyncConfig.exe	

_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\Tools32.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\TrendServer.dll	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\citect.frm	Chinese
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\citect.frm	English
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\citect.frm	French
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\citect.frm	German
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\citect.frm	Italian
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\citect.frm	Japanese
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\citect.frm	Korean
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\citect.frm	Russian
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\citect.frm	Spanish
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\ctdraw32.tlb	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect 7.40\Bin\splash.bmp	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect\Documentation\CitectSCADA Cicode Reference.pdf	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect\Documentation\CitectSCADA Installation Guide.pdf	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect\Documentation\CitectSCADA Process Analyst.pdf	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect\Documentation\CitectSCADA Technical Reference.pdf	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect\Documentation\CitectSCADA User Guide.pdf	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect\Documentation\CitectVBA Reference Guide.pdf	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect\Documentation\PELCO Camera Integration Guide.pdf	
_ProgramFilesFolder_\Schneider Electric\Vijeo Citect\Documentation_doclist.htm	

Added Files – Vijeo Citect WebServer

Listed below are the files added to the **Vijeo Citect** *WebServer* product after installing 7.40 Service Pack 1.

Add Install Path and File - Vijeo Citect WebServer
Citect\client\740\CitectSCADAWebClient_7_40_1_239.cab

Updated Files – Vijeo Citect WebServer

Listed below are the files updated in the **Vijeo Citect** *WebServer* product after installing 7.40 Service Pack 1.

Update Install Path and File - Vijeo Citect WebServer
Citect\cgi-bin\server.js
Citect\help\Creating_a_new_deployment.html
Citect\help\images\Vijeocitectlogo.gif

Known Issues

This Service Pack also contains the known issues described below.

61206 - **The 'Prompt on tag not exist' option in the Citect Project Editor is not working.**

The 'Prompt on tag not exist' has always been an option in the Citect Project Editor (menu tools -> options). It appears not to be working when set.

Issues resolved in this Service Pack

This Service Pack resolves the issues described below. If you have any hotfixes installed on your current version, please check if they are included in this service pack. If the hotfix is not included in the list below, or you have any concerns regarding the issues covered, please contact Support *before* installing this Service Pack.

Bug Fixes

ADO

60475 - **CSV_DB_Execute function can cause duplicate entries in the database.**

CSV_DB_Execute function uses PlusADOCon.dll and database queries can be executed twice (re-query) in certain situations. This issue has been rectified for queries that do not result in a return data set. CSV_DB_Execute has an additional parameter.

60508 - **CSV_DB_Execute() returns only 49 characters if a string field is longer than 49 chars.**

The legacy ADO library had a limitation of 50 bytes on a field and now it's extended to 255 characters for string fields.

Alarms

59410 - **[AddressForwarding] parameter for new alarm database port 5482**

In 7.30, the alarm database port was introduced; however there was no way to forward the port for the client connecting behind a firewall-router. To cater for this scenario, a new INI parameter under section [AlarmForwarding] has been introduced.
[AddressForwarding]
<Cluster>.<Alarm Server Name>_AlarmDBPort = <ip address>:<port>

The new parameter uses the same syntax as other server redirection, but only the <port> will actually be used, as the database communication always use the same ip address as that of the alarm server.

59456 - **Reread user rdb when alarm server changes state from standby to active**

When alarm server changes state from standby to active, the citect user table is reread to add new users and remove deleted users.

59496 - **Alarm client fails silently when OPC AE ports are firewalled**

OPC AE opens up a port for an alarm server to connect to. However, if the ports are fire-walled the user has no indication that alarms will not be updated. Now if the alarm server does not connect in 30 seconds the client breaks the outgoing database connection as well and puts up a hardware alarm indicating database connection failure.

59646 - **New INI Parameters Allowing Users to Control Snapshot and DB Logging on Alarm Server**

Following INI parameters allowing users to control Snapshot and DB logging on Alarm Server have been introduced: [Debug]DBLogFileBase - The folder that will contain the log files and the filename prefix for the files. [Debug]DBLogMaxSize - The largest possible size in kilobyte for a database log file. Default Value is 2048. [Debug]DBLogOldFiles - The maximum number of database log files. Default Value is 1. [Debug]SnapshotFileBase - The folder that will contain the snapshot log files and the filename prefix for the files. [Debug]SnapshotMaxSize - The largest possible size in kilobyte for a snapshot log file. Default Value is 2048. [Debug]SnapshotOldFiles - The maximum number of snapshot log files. Default Value is 1.

60448 - **Display client unable to retrieve the entire list of RecID from the Alarm Server**

Neither [Alarm]QueryRowLimit = 500 or [Alarm]SOERowLimit = 500 should limit the number of active alarms being displayed

60460 - **Alarm server stalls at 'Initialize Functions' step when starting up**

When starting up, alarm servers with more than 1000 alarms would experience an unnecessary delay at the 'Initialize Functions' step (as reported in Runtime Manager). Depending on the number of alarms, this delay may last for several minutes. This issue has now been fixed.

60485 - **Improved diagnostic information when FmtOpen/FmtClose are not used properly.**

User can get detailed diagnostic information from log and Hardware alarm page will be responsive when all formats are exhaust due to misuse of FmtOpen/FmtClose.

60500 - **ServerIsOnline() cicode function unable to return the correct status for the Standby Alarm server**

When doing RPC calls (e.g. ServerIsOnline) in start up cicode running on the server there was a 'race condition' where the wrong session type was opened if the tran connection had not been setup by the time the RPC call was executed which led to RPC calls being forwarded by the alarm server to itself until the unending loop was detected and a CT_ERROR_SOFTWARE (0x0100) was reported. When startup cicode on a server runs and makes RPC calls, do not create the session until the tran connection is properly established. Startup cicode on servers should be delayed until the server is fully functional. Added logging like this, "OpenSession() id=con:1000.<ClusterName>.<ServerName>, servParam.IsLocalService() AND servParam.GetTranHandle() == BAD_HANDLE", to indicate that attempts to make RPC calls before the server has completed startup.

60664 - **@ syntax for localisation causes incorrect information to be logged in device**

@ syntax for localisation causes incorrect information to be logged in device, this issue has been fixed.

60884 - **Delay in displaying Active Alarm page after login new user when redundant Alarm server is disconnected**

When only one server from primary-redundant pair is available the system will display counters and alarms after establishing a connection with that server without waiting for the second server.

60991 - **Hardware alarm "Database not connected" is incorrectly raised when user logs in**

Hardware alarm "Database not connected" is incorrectly raised whenever a user logs in. This problem is now fixed. The hardware alarm is only raised when the client genuinely has trouble connecting to the alarm database server.

61071 - **Display Client is slow to display alarms for the first time following the login of a new user or after restarting the client process**

The display client was slow to display alarms for the first time after the login of a new user or after restarting the client. The time taken to obtain alarms has been reduced in v7.40SP1.

61078 - **DBClient logging is now working in Citect 7.40SP1**

A change in the ClearSCADA DBclient.dll and the Citect alarm client has re-enabled ClearSCADA client logging.

61136 - **Citect Display Client Cannot display alarm data from a fast cluster until data is obtained from a slow cluster.**

On multiple clusters system the alarm data will not be displayed until the data have been obtained from all clusters. In 7.40 service pack 1 this has been changed such that the users can specify the time-out period using citect ini parameter [Alarm]AlarmListRequestTimeout to control the length of waiting for the data to come from all clusters.

61340 - **Calling AlarmBrowseOpen immediately after Login(bSync = 1) results in error**

Calling AlarmBrowseOpen immediately after Login(bSync = 1) results in error code 541 being returned. This problem is now fixed.

61365 - **Allow a custom path to be set for SOEArchive function**

Allow a custom path to be set for SOEArchive function
Cicode:
Existing: SOEArchive();
New: SOEArchive("C:\temp\SOEArchive");

61366 - **AlarmActive(2) does not return -1 if no unacknowledged alarm category**

AlarmActive(2) does not return -1 if no unacknowledged alarm category. This issue has now been resolved.

61368 - **AlarmAck(2,x) not fired from Categories ON/OFF action fields unless TaskNew is used**

AlarmAck did not block cicode in previous versions and should not block cicode in v7.30+

61374 - **Advanced Alarms are not re-evaluated if the value change was made when the Alarm Server was offline.**

Advanced alarm states were being re-evaluated during runtime only and could not handle tags' value changes made while the alarm server was offline, resulting in alarms remaining active where they had transitioned to off. With this fix, the Alarm Server can evaluate Advanced Alarms on startup so that the offline value changes aren't ignored.

61506 - **7.40 Alarm server hangs on startup when trying to synchronize with 7.30 SP1**

Synchronization between alarm servers of different versions was not supported between v7.30 and v7.20 or earlier. Support for this functionality was reintroduced between v7.40 and v7.30 only, however an issue was found where a v7.40 Alarm server hangs on startup when trying to synchronize an alarm server of v7.30 SP1. The issue has been fixed. However it is not recommended to run alarm servers of different versions for extended periods of time. Additionally in such a case, if the v7.30 SP1 alarm server is restarted in such a mixed mode case it will not be able to synchronize with the v7.40 alarm server. Additionally in such a case, if the v7.30 SP1 alarm server is restarted in such a mixed mode case it will not be able to synchronize with the v7.40 alarm server.

61577 - **The Alarm Count calculation may fail to return a value on a highly active system after a period of time**

An issue was identified where the Alarm Count calculation would not return a value on the system. This occurred after a long period of time and was caused by an internal data type mismatch. Examples of the activity that could accelerate the occurrence of this issue are: using the new Struxureware alarm templates with a large number of logins, after a large number of page changes, or extensively calling the alarm count function directly via cicode. The Struxureware alarm templates make use of these alarm count calls, and so other templates that do not make use of the alarm count are not affected. This issue has now been resolved.

61616 - **Local Windows user cannot see alarms after a server restart.**

On a standalone machine, when the Alarm server was restarted a client with a local Windows user logged in could no longer see alarms. This is now fixed.

Authentication / Security

58261 - **User login name does not support dot character**

When configuring user accounts in CitectSCADA project or login, a user to runtime, CitectSCADA will not allow the user login name to contain a dot character. This has been changed in 7.40 SP1 such that the CitectSCADA runtime will allow windows users to have a name with dot(s) to login to the runtime.

60660 - **Domain user unable to see alarms if domain controller is offline**

Domain user unable to see alarms if domain controller is offline. This issue has been fixed.

Backup/Restore

60895 - **"Include Project Warning" message has been mistakenly suppressed**

Project Backup / Restore utility is designed to display a warning if the backed up project has include projects to recommend users to back up include projects as well but this message had been mistakenly suppressed. It now displays a warning message to indicate this situation correctly unless there is no include project at all or set [Backup]IncludedDBOn=0.

61099 - **"Configuration Files" checkbox doesn't work on project restore**

"Configuration Files" checkbox on Project Restore was not active. This option is now active so that the configuration files (*.INI) and time synchronisation XML (TimeSyncConfig.XML) will not be restored to the target project location if the checkbox is unticked.

61132 - **Overwrite option ('-o') doesn't work for project backup**

Command line option '-o' did not work with Project Backup so that the option was silently ignored. This option is now activated and works with Project Backup to overwrite the target CTZ without user prompt, which is useful for automation of project backup.

Cicode

60338 - **ProductInfo(0) does not work on web client**

Some product information is in BIN\CtVersion.xml but this file hasn't been available on web clients. This file is now deployed via web deployment and saved locally with project files. Brand information is available on web clients as well.

60471 - **WinNewAt() Window Resize Inconsistencies - Mode 8 (no user resize)**

It was possible to resize a window with mode 8 set (no user resize) using a double click on the title bar when the cicode resize only changed the width or height. This has been fixed.

60480 - **GetEnv() Cicode function causes heap corruption**

When GetEnv() is used to retrieve a long environment variable like "PATH", the runtime might have crashed. Now, the value is truncated correctly as per the Cicode string limits which resolves this issue.

60482 - **Existing "Kernel" command could not recognize server name as input**

Existing "Kernel" command could not recognize server name as input. This issue has been fixed.

60491 - **LogoutIdle when used as Startup Code does not log user out**

LogoutIdle when used as Startup Code does not log user out. This issue has been fixed.

60492 - **Some Cicode functions with string parameters can corrupt global/module string variables by overrun**

Due to the mismatch of sizes between module/global string variables and local string variables, some of string functions like FormSecurePassword() can corrupt module/global string variables. This issue is resolved and all Cicode string variables can hold up to 255 characters. Please note that all existing projects must be fully recompiled after installing this fix, to avoid mismatch on Runtime and project database.

60497 - **PageInfo(11) does not work correctly**

PageInfo(11) does not work correctly. This issue has now been addressed.

60499 - **Some blocking Cicode functions don't handle "Foreground Cicode cannot block" error properly if called from foreground**

Following Cicode functions now return "Foreground Cicode cannot block" error code (282) or raise the relevant hardware alarm, if called from foreground. Input(), FormOpenFile(), FormSaveAsFile(), FormSelectPrinter(), MsgRPC()*, FileExist(), Login()* *: Blocking mode only

60501 - **Cicode File functions do not work for strings containing 255 characters**

Cicode File functions do not work for strings containing 255 characters. This issue has been fixed.

60507 - **Version(3) Cicode function returns a redundant string of "UNKNOWN", if a hotfix is installed**

On most hot-fixed SCADA products, Version(3) Cicode function returns a build label followed by a redundant string of "Unknown". This part is now truncated and the function shows a correct build label with no redundant string.

60649 - **AlmTags Functions may hang if interrupted**

AlmTagsOpen, AlmTagsNext and AlmTagsPre set of cicode are blocking functions, if the communication between client and server process(es) are lost, the cicode thread is may be left hanging.

60650 - **CSV_Alarms_GetGroupFilter doesnt work with iChars=-1 and 64**

CSV_Alarms_GetGroupFilter now works as expected with any value for iCha,s; including -1 and 64

60653 - **Loss of precision in arithmetic operations on scaled integer tags**

Loss of precision in arithmetic operations on scaled integer tags has been rectified by their data type being set to Double if the Scaling or Offset is different than unity. This conversion is applied on the Server side.

60655 - **ErrCom() returning 257 (Value is out of range) with ScaleCheck OFF.**

CiCode function ErrCom() is returning error 257 (Value is out of range), even with ini [CODE] ScaleCheck = OFF. This issue has been fixed.

60658 - **SOEEventAdd only works when user has full privileges**

Citect users(defined in the project) can successfully call Cicode SOEEventAdd().

60661 - **AlarmSetInfo couldn't set category greater than 255**

Now AlarmSetInfo can handle alarm category from 0 to 16375.

61354 - **TagInfoEx() is being passed a NULL pointer for sName parameter leading to a Access Violation error reading location 0x00000000**

TagInfoEx() requires a valid (non-empty) Tag name. TagInfoEx() now returns an Invalid argument error (274) if sName is empty. TagInfoEx() will also log SYSLOG.DAT if a NULL pointer is passed. This should never happen and is a critical error if it occurs, requiring further investigation. The new SYSLOG entry looks like: <DATETIME> <TZ> UsrTagInfoEx: Invalid pointer detected. sName=0x00000000. sCluster=0x093D5E5C.

61367 - **AlarmFirstCatRec returns -1 when called via alarm category ON action**

The Alarm Category cicode actions were being executed before the alarm database had been updated. The Alarm Category cicode actions are now executed after the alarm database has been updated.

Compiler

60502 - **The compiler can raise 'Address on bad boundary' correctly instead of 'UNKNOWN ERROR 1'**

Compiler correctly gives 'Address on bad boundary' error instead of 'UNKNOWN ERROR 1'. Compile the project with '[General]CheckAddressBoundary = 1' on Citect.ini, and when compiler detects a variable address bad boundary problem, this error is raised.

60646 - **Compilation of Variable Remapping is failing with Raw type mismatch error**

Compilation of Variable Remapping is failing with Raw type mismatch error. This issue has been fixed.

61361 - **Compiler warnings 'The specified language is not supported' & "Not a valid language" for Swedish / Norwegian (Bokmal)**

Compiler warnings 'The specified language is not supported' & "Not a valid language" for Swedish / Norwegian (Bokmal), this issue has been fixed.

61362 - **Spaces in 'Network Addresses' field in configuration form Editor->Servers->'Alarm Servers' may cause an access violation in the compiler**

Spaces in 'Network Addresses' field in configuration form Editor->Servers->'Alarm Servers' may cause an access violation in the compiler. This issue has now been addressed.

61376 - **Compiler hangs when 'Warn about unused tags during full compile' option is ticked from Tools->Options**

When there was an unused tag the 'next' part of the loop kept finding the first symbol instead of the next symbol.

CTAPI

60696 - **Read the [CTAPI]EventLogging parameter in 'Remote' (or 'Socket') mode**

The [CTAPI]EventLogging parameter was being overwritten or reset by the [IPC]EventLogging parameter.

Diagnostics

60474 - **Verbose authentication logging flooding the syslog.dat by default**

If too much unnecessary authentication logging floods the syslog.dat file, actual problems can be missed. The default for [Security]AuthenticationLogging was 2 = LOG_ALL
The default for [Security]AuthenticationLogging is now 1 = LOG_FAILED - log only failed authentication (logon) attempts

60659 - **"Poll" field removed from the CSAtoPSI.Subs kernel Table.**

"Poll" field removed from the CSAtoPSI.Subs kernel Table. This issue has been fixed.

60663 - **Improved Shutdown logging**

This logging is enabled when the citect.ini parameter is set:
[Debug]LogShutDown=1
New logging example:
2013-09-06 14:18:40.673 +10:00 SysExit[104]: SendStoppingMessageToRuntimeManager (0xf2d39a0) Previously the function name was not shown.
In addition to the new logging, at the start of the shutdown, the time (in ms) of when the exit function was pushed on to the exit function list at startup is shown.

Example:
2013-09-06 14:18:40.668 +10:00 SysAtExit[001], Called@ 0ms: unloadServers (0xf2d3160) [Client.cpp,line=336] 2013-09-06 14:18:40.668 +10:00 SysAtExit[002], Called@ 93ms: ctExceptionExit (0xf479fc0) [..\..\common\WIN_ERR.C,line=1342] The ctExceptionExit function was added 93ms after the unloadServers function was added. This will help analyze any startup delay problems.

60665 - **Cicode stats to indicate which cicode tasks are causing high CPU**

New kernel cicode statistics
----------Table CiCode
Handle 34 Length 128 Offset 0. 0
Name HND ... Slice Use% Duty%
PageFG 0 ... 59997 0.0 100.0
_TagSimulateTask 1 ... 151 0.0 0.0
_TagSimulateTask 2 ... 150 0.0 0.0
<BlockTest1> 3 ... 87 0.0 100.0
_TagSimulateTask 4 ... 149 0.0 0.0
_TagSimulateTask 5 ... 149 0.0 0.0
_TagSimulateTask 6 ... 149 0.0 0.0
_TagSimulateTask 7 ... 149 0.0 0.0
_TagSimulateTask 8 ... 149 0.0 0.0
_TagSimulateTask 9 ... 149 0.0 0.0
_TagSimulateTask 10 ... 149 0.0 0.0
_TagSimulateTask 11 ... 149 0.0 0.0
TranslateReportTask 12 ... 7 0.0 0.0
BlockTestTask2 13 ... 587 95.0 100.0

BlockTestTask2 is using 95% (Use%) of the citect component's processing time.
BlockTestTask2 is running without sleeping (Duty% = 100%)

Use% = (Time spent executing cicode task / Elapsed time) * 100
= If the SCADA system spent 10% of it's time executing a particular cicode task, the cicode task's Use% would be 10%
Duty% = (Time spent executing cicode task / ((Time spent executing cicode task + Time spent sleeping)) * 100
= If the cicode task spent 5% of it's time sleeping, the cicode task's Duty% would be 95%

Also add warnings if a cicode task or cicode function blocks for more than 1 second.
e.g.
ExecExpr: Cicode Task Blocked for more than 1 sec: Name=<DspCursor_MouseDown>, Time=20708ms
FuncCall: Cicode function ran for more than 1 sec: Function=TaskNew, time=11811ms
ExecExpr: Cicode Task Blocked for more than 1 sec: Name=_PageDefDisplay, Time=10759ms

Display System

60469 - **Halted foreground codes leak "Code.String" queue**

There was possibility to leak internal string queue if a foreground Cicode block is halted, regardless of the way of being halted. The memory leak caused by this issue is now fixed.

60504 - **Parameter '[Animator]ToolTipFont' does not work correctly**

Parameter '[Animator]ToolTipFont' did not work because Citect Runtime never reads this parameter even though a customer sets it. This has been resolved. Now, Citect Runtime reads this parameter and displays tooltip font as a setting value.

61275 - **Title on popup dialogues for 2 byte languages are not displayed correctly**

On the web client and display client, popup dialogues such as the login form would display an incorrect caption for some languages. This has been fixed.

61372 - **Process Analyst Load, Save and Print popups are being displayed in incorrect monitor**

Process Analyst Load, Save and Print popups can be displayed in incorrect monitor in a multi-monitor setup. This issue has been rectified.

Equipment Editor

61533 - **The additional duplicated tag is generated after the Update Equipment due to the TAGGENLINK number is different on the same tag**

When a new item is given a taggenlink id, it is also added to the model of the editor, so that it won't be re-assigned again.

Example Project

59320 - **Text on the Factory page in Example project overflows when they are translated**

In the Factory page of Example project, text that has been translated does not keep within the boundary of the text box and overlaps into other areas causing parts of the page to be unreadable. This problem is now fixed by showing the affected text in a Web Browser control.

60413 - **In Example project, symbol °C is displayed as different words at runtime when switched to Asian languages**

On the LoopPage of Example project, the symbol (°C) is displayed as different words at runtime when switched to Asian languages. This happens because the byte codes of phrase °C is intrepreted as another word in languages using multibyte character sets. This problem is now fixed in the Example project via language localization.

60416 - **Some texts in the Factory page of Example project are not translated**

In the Factory page of Example porject, some texts are not translated. This problem is now fixed.

EWS Server

61302 - **EWS Server may crash after running for a long time**

EWS server may crash if it has frequent CTAPI connection failures to the display client. Under such situation, the thread count on EWS server will keep increasing over time, and consume more CTAPI licenses on the client process. This may eventually lead to crash. This problem is now fixed.

General

60487 - **The page names are not well aligned in the "Contents of Pages" pane of the Citect Explorer when pages name exceed 18 characters**

By reapplying the list style after the list was populated, the page names are aligned properly.

IO System

60494 - **Show bad tag quality when a unit is disabled**

When a device is disabled using CiCode function IODeviceControl, the tag quality of that unit will be set to bad.

60511 - **No synchronization when Primary IOServer is shutting down**

No synchronization when Primary IOServer is shutting down, this issue has been fixed.

60669 - **DISKDRV driver now stamped for windows 8 and Server 2012**

DISKDRV driver was not stamped for windows 8 and Server 2012 Operating Systems. This has now been fixed.

Kernel

60488 - **Kernel window moves up/left every time you restart the Runtime**

If the Windows task bar is placed at the top(or left) of the screen and the Kernel is set to automatically load on start of Runtime by using [debug]kernel=1 in the Setup Editor, then the Kernel window moves up (or left) by the size of the task bar every time the Runtime is relaunched. This has been fixed.

Licensing

60281 - **Vijeo Citect and CitectSCADA can now accept valid Citect Facilities dongle license(s).**

Vijeo Citect and CitectSCADA can now accept valid CitectFacilities dongle licenses).

60320 - **Soft Key license could not be detected for a period after rebooting the computer**

There was an issue with Soft Key Licenses which occurred for a period of 5 minutes after doing a computer reboot. A Software Protection Error was reported for this period. After 5 minutes the license could be detected. This issue has been fixed and the license should now be detected after a reboot in a timely manner.

60673 - **Flexera Administration screen shows only Vijeo Historian or CitectHistorian soft key license information**

SCADA and Historian products will now each obtain their own version of the FLEXERA licensing feature.

60681 - **PSDirect driver does not support Flexera Soft Key Licenses, runs in demo mode**

PSDirect was working correctly. License checking in the licence manager was looking for an incorrect name. This has been corrected.

61355 - **Runtime fails immediately with "Software Protection Failure"**

Client Runtime would stop immediately with "Software Protection Failure" if a local cryptography container was corrupted.Runtime now recovers the container if needed rather than just stopping so that the issue no longer occurs.

61359 - **Software Protection Failure OPC DA Server when using floating license**

In Bug 59019, the OPCDA server was changed to consume a CTAPI license instead of a full license. However this change missed an important scenario where the required license is remote to the OPCDA server - a floating license. This has now been fixed.

61360 - **Cancelling demo mode shows a misleading error of "Unknown license run mode (0x0000)"**

Cancelling demo mode caused a misleading error of "Software Protection Failure, Unknown license run mode (0x0000)" on Runtime Manager, which is fixed now fixed to display "Software Protection Failure" like SCADA 7.20.

61377 - **OPCDA Server was using a full license when running on a client only machine**

If the OPCDA server was run on a SCADA machine which was only running the client, it attempted to take a full license. The OPCDA server will now be allowed to start if the machine has been set up as a Control or View only client and the computer setup wizard is allowed to set up a machine in this configuration.

OPC Connector

60481 - **Tags shown in the OPC client browse list do not include the cluster name**

OPC Clients cannot resolve tags from citect opc server when citect is run as a multi cluster project When using an OPC client the listed tags do not contain clusters. When an item is then added the items cannot be resolved. Adding the items with the cluster name manually does work. Adding a cluster name as the access path does not seem to work.
Example:
Browsing for items gives
dig1
dig2

The correct browse list should give
c.dig1
c1.dig2

60657 - **OPC DA Server crashes when adding a non-existent tag in the OPC client**

Crash when adding a non-existent tag.
Program was not checking for a 'null' pointer as a result of adding an non-existent item.

61369 - **OPC Server returns error 0x80070057 when using Hierarchy mode + Softing OPC Client**

Adding a non-existent tag should work (the quality should be bad)
Softing OPC Client, or any client, should be able to specify items as <clustername>.<tagname> in Hierarchy mode and the program was only expecting <tagname> in Hierarchy mode

61378 - **OPC Client cannot read/write to individual elements of an array**

The new OPC DA Server did not initially support read/write to individual elements of an array

Process Analyst

60513 - **Help window showing on incorrect monitor in multi-monitor setup**

Help window was showing on incorrect monitor in multi-monitor setup. This issue has been rectified.

60672 - **Process Analyst can display the error message, 'The value is out of range.'.**

When the trend value is out of range, Process analyst displays unknown error. Process Analyst can now display the correct error message, 'The value is out of range.'.

Project Development Utilities

60408 - **Some icons are missing on Citect Explorer with 8-bit colour modes**

Some icons are missing on Citect Explorer due to legacy graphics themes which have now been removed.

60422 - **Scheduler help menu entry does nothing on Citect Explorer and Project Editor**

Contents of the scheduler help is available in the main help file so the menu entries in the Citect Explorer and Project Editor were removed for are no longer necessary.

60423 - **Script error when using Computer Setup Editor 'Search Parameter Reference**

The help script was updated.

60470 - **GraphicsBuilder Automation functions don't support strings variables for Area and Privilege**

GraphicsBuilder Automation functions don't support strings variables for Area and Privilege. The following functions have been added or amended to support strings variables for Area and Privilege: PageArea, PropertiesInputKeyboardPutEx(), PropertiesInputKeyboardGetEx(), PropertiesAccessGeneralPutEx(), PropertiesAccessGeneralGetEx().

60477 - **PropertiesCicodeObjectGet function truncates cicode command that is longer than 32 characters**

The graphical automation interface method, PropertiesCicodeObjectGet, only returned the first 31 characters of an object's cicode expression text. The PropertiesCicodeObjectGet was changed to return all 253 characters of an object's cicode expression text.

60486 - **Graphics Builder throws C++ runtime library error when trying to find a page for which object links are missing in that page**

When reading a found page that contains missing object links, the system should not crash

60493 - **Graphics Builder crashes when editing a polygon**

Example:
Draw a polygon with several points, select and drag one node, and while dragging press ctrl+Z (Undo) => Crash (trying to drag an object's node after removing the object) The fix prevents keyboard actions from being executed when an object or an object node is being dragged

60495 - **Project Editor does not open forms correctly when located on a secondary monitor**

Project Editor forms opened incorrectly when located on a secondary monitor that is on the left or top of its primary monitor. This restriction has been removed.

60651 - **PageSelect.. And PageTemplateSelect.. Object fns not able to find an included templates AN when template ANs not at start**

A couple of new Graphics Builder Automation APIs: PageAllGetFirstAN and PageAllGetNextAN are introduced to traverse through all objects(including template and non-template objects) in the open page.

60654 - **Show Database error message box when Database format error found**

Database error message box will be shown by default if something is incorrect in the database format. Graphics Builder Automation users needs to disable the dialog by setting INI parameter [CtDraw.RSC]ShowDbfErrorMessages to 0.

60722 - **Multiprocess mode is not selected by default in 7.40**

Multiprocess mode is now selected by default in 7.40SP1.

Runtime Issues

60496 - **Improve [Ctedit]Copy functionality to ensure Client does not freeze when network path becomes unavailable**

Improved [Ctedit]Copy functionality has been implemented to ensure Client does not freeze when network path becomes unavailable.

60498 - **The same default, min and max value of [CtEdit]DbFiles were inconsistent**

Citect Compiler, Project Editor and Runtime used to have different default min and max values for [CtEdit]DbFiles. They are all referring to the same set of values (min=50, default=100, max=510) in following this fix.

60503 - **SCADA crashes when shut down with NetBios kernel windows open**

If the NetBios window is opened from the kernel console and the application is shut down without closing the Kernel console the SCADA crashes. This has been fixed.

60510 - **Tag values do not update on start up unless Sleep is used at beginning of the start up cicode function (standby running)**

Previously, all tags were replicated every replication period regardless of if they had changed nor not, thus hiding the startup issue. When the startup cicode is run during primary IO server startup, the cicode is attached to the standby IO server. There was a small window where cicode tag updates made during the primary IO server startup and replication could be made only on the standby IO server and not be replicated to the primary IO server.

60512 - **Assigning a non-numeric value to a local numeric tag triggers "General software error" on CSAPSI**

Assigning a non-numeric value such as "", "Not a number" or "123ABC" to a local numeric tag causes a misleading hardware alarm of "General Software Error". Now this situation is handled properly and generates "Invalid data conversion" hardware alarm.

61255 - **Runtime Manager log files don't display PID**

PID is added into Runtime Manager log files.

61375 - **CtCicode.exe CPU usage goes to 100% if Cicode debugger is turned on while a page based on Alarm_Equip template is open during runtime**

The cicode start and stop task messages are now sent if CodeTrace(*, 16) is enabled for the specified cicode task.

Time Scheduler

60662 - **Scheduler's Calendar shows incorrect number of days after Daylight savings has ended.**

When the local machine is in a daylight savings time affected region and time zone region ranging from UTC-12 to UTC+1, Scheduler's Calendar shows incorrect number of days in a month in the immediately month after Day light savings has ended.

61131 - **TimeScheduler on Web Client displays English strings only**

TimeScheduler on Web Client was deployed via ActiveX.zip which didn't have language files. To resolve this issue, Web Client cabinet installs TimeScheduler now, rather than using ActiveX.zip.

Time Synch Service

60779 - **TimeSynch Service terminating with unhandled InvalidFormat exception.**

TimeSynch Service terminating with unhandled InvalidFormat exception. This issue has been fixed.

Trends

60489 - **Trends are not displayed when trending a sum and/or subtraction of scaled tags**

New Trend range fields were added. When the trend range fields are configured, they will over-ride the range obtained from the tag(s) in the Trend Expression field.

60490 - **Trend synchronisation progress shown properly on multi-cluster system**

When trends are configured on more than one cluster on multi-cluster system, trend synchronisation progress won't reach 100% when the sync is complete. It will now show 100% when sync is complete.

60506 - **Process Analyst and TrnBrowse support 8 characters for the 'Engineering Units' field of the Trend Tags**

Process Analyst can display 8 characters on the 'Engineering Units' field. Also, TrnBrowse functions can return 8 characters from the 'Eng_Units' field.

Web Client

59804 - **[AddressForwarding] parameter for new alarm database port 5482**

In 7.30, the alarm database port was introduced; however there was no way to forward the port for a client connecting behind a firewall-router. To cater for this scenario, a new INI parameter under section [AlarmForwarding] has been introduced.
[AddressForwarding]
<Cluster>.<Alarm Server Name>_AlarmDBPort = <ip address>:<port>

The new parameter uses the same syntax as other server redirection, but only the <port> will actually be used, as the database communication always use the same ip address as that of the alarm server.

60652 - **Web client v7.40 does not work side by side with previous versions of the web client**

The version 7.40 of web client, when installed side by side with previous versions of the web client, functions correctly. However, earlier versions of the web client failed to initialize on startup. This issue has been fixed.

60843 - **Alarm Server IP address in System.(Client).xml is set incorrectly if using Alarm port forwarding in Web Client**

If port forwarding is specified for alarm server on a web deployment, the settings, saved in System.(Client).xml after downloaded on client machine, are not honoured. As a result, the web client will not be able to see alarms. This problem is now fixed.

61257 - **Web Deployment removal / modification on Web UI fails due to permission denied error if some project files are read-only**

If any of the deployed files were read-only, Web Deployment configuration on Web UI would fail due to permission denied error. This issue is now resolved by ignoring read-only attributes during internal deployment procedures.

SxW Style Include

61586 - **Tree control on the SxW style template does not hide menu items when their "Hidden When" condition is true**

The tree control on the SxW style template does not hide menu items when their "Hidden When" condition is true at the time of page entry. In addition, if a menu item's "Disabled When" condition is true, clicking on that item on the tree control will still execute its configured command. This problem is now fixed.

Enhancements

Alarms

60889 - **[Alarm]WebClientUpdatePollPeriod and [Alarm]ClientUpdatePollPeriod**

In v7.40 SP1 two Alarm parameters '[Alarm]WebClientUpdatePollPeriod' and '[Alarm]ClientUpdatePollPeriod' are introduced in Citect.ini file, so a Web Client can be configured to get Alarm Update via polling rather than subscription, especially in the case that Alarm Server is running behind a firewall-router.

61245 - **Add new type to AlarmInfo() to indicate whether alarm display has data from all clusters**

In 7.40 service pack 1, the option to display alarms on the alarm display without waiting for data from all clusters is re-introduced. In order for the user to distinguish whether data is complete, a new mode, 13, is added to AlarmGetInfo(). The new mode returns whether no / some / all data is readily displayed on the screen at the time.

61429 - **Add new case 14 to AlarmGetInfo to be able to check if the cluster has data ready and some refactoring**

AlarmGetInfo(26,14,"c2") returns 1 or 0 depending on whether the data is available (some clusters could be on high latency networks).

61672 - **The [Alarm]DefaultSOETimeRange parameter default value has changed from 7 days to 1 day**

In order to prevent SOE queries from negatively impacting alarm server performance, all SOE queries should include a time-range filter. This parameter specifies the default time range, in days, for SOE views that have no other time-based filter. This default can be overridden by specifying any other time filter. Its default value has been changed from 7 days to 1 day to improve performance where no time-range filter has been specified.

General

60478 - **Adjusting Column widths of DatabaseExchange control Programmatically**

The DatabaseExchange control displays a grid whose column widths can be adjusted. This information was lost if the user navigates away from the page. Now we have added two methods (DXGetColumnWidth and DXSetColumnWidth) to DatabaseExchange control so that the column widths can be saved or restored on page unload or on page shown respectively.

IO System

61370 - **Large array and string array support for memory devices**

Large arrays and string arrays for memory devices are now supported

Time Scheduler

61392 - **Norwegian language support on TimeScheduler**

Time Scheduler control now has Norwegian translations.

61483 - **Swedish support on TimeScheduler**

Time Scheduler control now has Swedish translations.