

# MEGN 300

# Instrumentation & Automation

## Master Reference Document

Measurement Theory, Signal Processing, & Control Systems

Colorado School of Mines  
Department of Mechanical Engineering

**Adam Duran**  
Assistant Teaching Professor  
PE · PMP

Publication Date: March 2026

---

A comprehensive reference covering measurement fundamentals, error analysis, signal processing, analog and digital systems, filter design, amplifiers, power electronics, and PID control.



# Contents

---

|                                                                |          |
|----------------------------------------------------------------|----------|
| How to Use This Document                                       | xix      |
| What Should I Be Reading Right Now?                            | xxi      |
| First Week Survival Guide                                      | xxii     |
| Modern Tools and AI Use Policy                                 | xxiii    |
| Laboratory Safety and Equipment Care                           | 1        |
| <br>                                                           |          |
| <b>I Measurement Fundamentals</b>                              | <b>5</b> |
| <b>1 Fundamentals of Measurement Theory</b>                    | <b>6</b> |
| 1.1 What Is a Measurement? . . . . .                           | 6        |
| 1.2 The Generalized Measurement System . . . . .               | 6        |
| 1.3 Sensor Classification . . . . .                            | 8        |
| 1.3.1 By Energy Source . . . . .                               | 8        |
| 1.3.2 By Output Signal . . . . .                               | 8        |
| 1.3.3 By Measurand Type . . . . .                              | 8        |
| 1.4 Sensor Terminology . . . . .                               | 8        |
| 1.5 Transducer Operating Principles . . . . .                  | 9        |
| 1.5.1 Resistive . . . . .                                      | 9        |
| 1.5.2 Thermoelectric . . . . .                                 | 9        |
| 1.5.3 Piezoelectric . . . . .                                  | 9        |
| 1.5.4 Capacitive . . . . .                                     | 9        |
| 1.5.5 Inductive and Electromagnetic . . . . .                  | 9        |
| 1.6 Loading Effects . . . . .                                  | 10       |
| 1.7 Sensor Selection Methodology . . . . .                     | 10       |
| 1.7.1 Step 1: Define the Measurand and Environment . . . . .   | 10       |
| 1.7.2 Step 2: Accuracy and Resolution Requirements . . . . .   | 10       |
| 1.7.3 Step 3: Dynamic Response Requirements . . . . .          | 10       |
| 1.7.4 Step 4: Interface Compatibility . . . . .                | 11       |
| 1.7.5 Step 5: Cost, Availability, and Reliability . . . . .    | 11       |
| 1.8 Measurement System Design Process . . . . .                | 11       |
| 1.9 Units, Standards, and Traceability . . . . .               | 12       |
| 1.10 Signal Types and Their Characteristics . . . . .          | 12       |
| 1.11 Sensor Specifications: What the Numbers Mean . . . . .    | 13       |
| 1.12 Sensor Failure Modes . . . . .                            | 13       |
| 1.13 Measurement in the Engineering Design Process . . . . .   | 14       |
| 1.14 Common Measurement Mistakes in Student Projects . . . . . | 14       |
| 1.15 Practice Questions . . . . .                              | 14       |
| 1.15.1 Answers . . . . .                                       | 15       |

|          |                                                          |           |
|----------|----------------------------------------------------------|-----------|
| <b>2</b> | <b>Static Measurements</b>                               | <b>16</b> |
| 2.1      | Static Calibration . . . . .                             | 16        |
| 2.1.1    | The Calibration Process . . . . .                        | 16        |
| 2.1.2    | Linear Calibration . . . . .                             | 17        |
| 2.1.3    | Nonlinear Calibration . . . . .                          | 17        |
| 2.2      | Static Characteristics . . . . .                         | 17        |
| 2.2.1    | Sensitivity . . . . .                                    | 17        |
| 2.2.2    | Linearity . . . . .                                      | 18        |
| 2.2.3    | Hysteresis . . . . .                                     | 18        |
| 2.2.4    | Resolution and Threshold . . . . .                       | 18        |
| 2.2.5    | Drift . . . . .                                          | 18        |
| 2.3      | Bridge Circuits . . . . .                                | 18        |
| 2.3.1    | The Wheatstone Bridge . . . . .                          | 19        |
| 2.3.2    | Bridge Configurations . . . . .                          | 19        |
| 2.4      | Calibration Standards and Traceability . . . . .         | 20        |
| 2.5      | Fundamentals of Calibration . . . . .                    | 20        |
| 2.5.1    | Calibration Standards and Traceability . . . . .         | 20        |
| 2.5.2    | Static Calibration Procedure . . . . .                   | 20        |
| 2.5.3    | Linear vs. Polynomial Calibration . . . . .              | 20        |
| 2.6      | The Wheatstone Bridge in Detail . . . . .                | 21        |
| 2.6.1    | Bridge Theory . . . . .                                  | 21        |
| 2.6.2    | Bridge Nonlinearity . . . . .                            | 21        |
| 2.6.3    | Lead Wire Compensation . . . . .                         | 21        |
| 2.7      | Signal Conditioning for Static Measurements . . . . .    | 21        |
| 2.8      | Traceability and Measurement Audit Trail . . . . .       | 22        |
| 2.9      | Advanced Calibration Techniques . . . . .                | 22        |
| 2.9.1    | Multi-Point Calibration with Uncertainty Bands . . . . . | 22        |
| 2.9.2    | In-Situ Calibration . . . . .                            | 22        |
| 2.9.3    | Two-Point vs. Multi-Point Calibration . . . . .          | 22        |
| 2.10     | Resistance Measurement Techniques . . . . .              | 22        |
| 2.10.1   | Two-Wire Measurement . . . . .                           | 22        |
| 2.10.2   | Three-Wire Measurement . . . . .                         | 22        |
| 2.10.3   | Four-Wire (Kelvin) Measurement . . . . .                 | 23        |
| 2.11     | Signal Conditioning Chain Design . . . . .               | 23        |
| 2.12     | Strain Measurement in Detail . . . . .                   | 23        |
| 2.12.1   | Gauge Installation . . . . .                             | 24        |
| 2.12.2   | Temperature Compensation . . . . .                       | 24        |
| 2.13     | Sensor Fusion and Redundancy . . . . .                   | 24        |
| 2.14     | Environmental Effects on Static Measurements . . . . .   | 24        |
| 2.15     | Data Logging Best Practices . . . . .                    | 25        |
| 2.16     | Advanced Bridge Techniques . . . . .                     | 25        |
| 2.16.1   | AC Bridge Excitation . . . . .                           | 25        |
| 2.16.2   | Auto-Balancing Bridge . . . . .                          | 25        |
| 2.17     | Sensor Selection: Decision Matrix . . . . .              | 25        |
| 2.18     | Calibration Transfer Standards . . . . .                 | 26        |
| 2.19     | Practice Questions . . . . .                             | 26        |
| 2.19.1   | Answers . . . . .                                        | 26        |

|          |                                                                |           |
|----------|----------------------------------------------------------------|-----------|
| <b>3</b> | <b>Dynamic Measurements</b>                                    | <b>28</b> |
| 3.1      | Why Dynamic Response Matters . . . . .                         | 28        |
| 3.2      | System Order and Models . . . . .                              | 28        |
| 3.2.1    | Zero-Order Systems . . . . .                                   | 29        |
| 3.2.2    | First-Order Systems . . . . .                                  | 29        |
| 3.2.3    | Second-Order Systems . . . . .                                 | 30        |
| 3.3      | Measuring Dynamic Characteristics . . . . .                    | 30        |
| 3.3.1    | Step Test . . . . .                                            | 30        |
| 3.3.2    | Frequency Response Test . . . . .                              | 31        |
| 3.4      | Bandwidth and Rise Time . . . . .                              | 31        |
| 3.5      | Selecting a Sensor for Dynamic Measurements . . . . .          | 31        |
| 3.6      | Why Dynamic Response Matters . . . . .                         | 31        |
| 3.7      | Zero-Order Systems . . . . .                                   | 32        |
| 3.8      | First-Order Step Response in Depth . . . . .                   | 32        |
| 3.8.1    | Frequency Response . . . . .                                   | 32        |
| 3.8.2    | Measuring the Time Constant . . . . .                          | 32        |
| 3.9      | Second-Order Systems in Depth . . . . .                        | 32        |
| 3.9.1    | Frequency Response . . . . .                                   | 32        |
| 3.9.2    | The Bandwidth–Rise Time Tradeoff . . . . .                     | 32        |
| 3.10     | Practical Implications . . . . .                               | 33        |
| 3.11     | Time Domain vs. Frequency Domain Characterization . . . . .    | 33        |
| 3.12     | Experimental Frequency Response Measurement . . . . .          | 33        |
| 3.13     | Transfer Functions . . . . .                                   | 33        |
| 3.14     | Cascaded System Response . . . . .                             | 34        |
| 3.15     | Sensor Dynamic Compensation . . . . .                          | 34        |
| 3.16     | Aliasing from Sensor Dynamics . . . . .                        | 34        |
| 3.17     | Measuring Sensor Time Constants: Advanced Methods . . . . .    | 34        |
| 3.17.1   | Plunge Test Details . . . . .                                  | 34        |
| 3.17.2   | Sinusoidal Testing . . . . .                                   | 35        |
| 3.18     | Higher-Order System Dynamics . . . . .                         | 35        |
| 3.19     | Sensor Bandwidth and Control System Interaction . . . . .      | 35        |
| 3.20     | Amplitude Ratio and Phase Measurement . . . . .                | 35        |
| 3.21     | Practical Impact of Sensor Dynamics: Worked Examples . . . . . | 36        |
| 3.22     | White Noise Testing for System Identification . . . . .        | 36        |
| 3.23     | System Identification from Experimental Data . . . . .         | 36        |
| 3.23.1   | Step Response Method . . . . .                                 | 36        |
| 3.23.2   | Frequency Response Method . . . . .                            | 37        |
| 3.24     | Dynamic Range of Sensor Systems . . . . .                      | 37        |
| 3.25     | Anti-Resonance and Its Effects . . . . .                       | 37        |
| 3.26     | Practice Questions . . . . .                                   | 37        |
| 3.26.1   | Answers . . . . .                                              | 38        |
| <b>4</b> | <b>Error Analysis and Uncertainty</b>                          | <b>39</b> |
| 4.1      | Types of Error . . . . .                                       | 39        |
| 4.1.1    | Systematic Error (Bias) . . . . .                              | 39        |
| 4.1.2    | Random Error (Precision Error) . . . . .                       | 39        |
| 4.1.3    | Gross Errors (Blunders) . . . . .                              | 40        |
| 4.2      | Statistical Foundations . . . . .                              | 40        |

|          |                                                                |           |
|----------|----------------------------------------------------------------|-----------|
| 4.2.1    | Mean, Standard Deviation, and Standard Error . . . . .         | 40        |
| 4.2.2    | Confidence Intervals . . . . .                                 | 40        |
| 4.3      | Uncertainty Propagation . . . . .                              | 40        |
| 4.3.1    | Special Cases . . . . .                                        | 41        |
| 4.4      | Design-Stage Uncertainty Estimation . . . . .                  | 41        |
| 4.5      | The Philosophy of Uncertainty . . . . .                        | 42        |
| 4.6      | Type A and Type B Evaluation . . . . .                         | 42        |
| 4.7      | Combined Standard Uncertainty (RSS) . . . . .                  | 42        |
| 4.8      | Expanded Uncertainty and Confidence Intervals . . . . .        | 43        |
| 4.9      | Systematic Error Sources and Corrections . . . . .             | 43        |
| 4.10     | Designing the Error Budget . . . . .                           | 43        |
| 4.11     | Reporting Measurements . . . . .                               | 43        |
| 4.12     | Monte Carlo Uncertainty Analysis . . . . .                     | 44        |
| 4.13     | Correlation Between Inputs . . . . .                           | 44        |
| 4.14     | Degrees of Freedom and Student's t-Distribution . . . . .      | 44        |
| 4.15     | Systematic Error Discovery . . . . .                           | 45        |
| 4.16     | Uncertainty in Derived Quantities . . . . .                    | 45        |
| 4.17     | Uncertainty in Curve-Fit Calibrations . . . . .                | 45        |
| 4.18     | Measurement Uncertainty in Standards and Regulations . . . . . | 46        |
| 4.19     | Common Uncertainty Analysis Mistakes . . . . .                 | 46        |
| 4.20     | Propagation Through Common Engineering Functions . . . . .     | 46        |
| 4.20.1   | Trigonometric Functions . . . . .                              | 46        |
| 4.20.2   | Logarithmic Functions . . . . .                                | 46        |
| 4.20.3   | Exponential Functions . . . . .                                | 46        |
| 4.21     | Gauge Repeatability and Reproducibility (Gauge R&R) . . . . .  | 47        |
| 4.22     | Bayesian Uncertainty (Conceptual) . . . . .                    | 47        |
| 4.23     | Variance, Covariance, and Correlation . . . . .                | 47        |
| 4.23.1   | Variance . . . . .                                             | 47        |
| 4.23.2   | Variance of Functions . . . . .                                | 48        |
| 4.23.3   | Covariance . . . . .                                           | 48        |
| 4.23.4   | Correlation Coefficient . . . . .                              | 48        |
| 4.23.5   | Practical Impact of Correlation on Uncertainty . . . . .       | 48        |
| 4.23.6   | Covariance Matrix . . . . .                                    | 49        |
| 4.24     | Reporting Uncertainty: International Standards . . . . .       | 49        |
| 4.25     | Practice Questions . . . . .                                   | 50        |
| 4.25.1   | Answers . . . . .                                              | 50        |
| <b>5</b> | <b>Statistics and Experimental Data Analysis</b>               | <b>52</b> |
| 5.1      | Why Statistics Matters for Engineers . . . . .                 | 52        |
| 5.2      | Descriptive Statistics . . . . .                               | 52        |
| 5.2.1    | Measures of Central Tendency . . . . .                         | 52        |
| 5.2.2    | Measures of Spread . . . . .                                   | 53        |
| 5.2.3    | Standard Error of the Mean . . . . .                           | 53        |
| 5.3      | Probability Distributions in Instrumentation . . . . .         | 53        |
| 5.3.1    | Normal (Gaussian) Distribution . . . . .                       | 53        |
| 5.3.2    | Uniform (Rectangular) Distribution . . . . .                   | 53        |
| 5.3.3    | Student's t-Distribution . . . . .                             | 53        |
| 5.3.4    | Chi-Squared Distribution . . . . .                             | 54        |

|          |                                                             |           |
|----------|-------------------------------------------------------------|-----------|
| 5.4      | Confidence Intervals . . . . .                              | 54        |
| 5.5      | Hypothesis Testing . . . . .                                | 54        |
| 5.5.1    | The t-Test . . . . .                                        | 54        |
| 5.5.2    | p-Values . . . . .                                          | 54        |
| 5.6      | Regression Analysis . . . . .                               | 55        |
| 5.6.1    | Linear Regression . . . . .                                 | 55        |
| 5.6.2    | Residual Analysis . . . . .                                 | 55        |
| 5.6.3    | Polynomial Regression . . . . .                             | 55        |
| 5.7      | Outlier Detection and Treatment . . . . .                   | 55        |
| 5.8      | Design of Experiments (DOE) Fundamentals . . . . .          | 56        |
| 5.8.1    | One-Factor-at-a-Time (OFAT) . . . . .                       | 56        |
| 5.8.2    | Factorial Design . . . . .                                  | 56        |
| 5.8.3    | Replication and Randomization . . . . .                     | 56        |
| 5.9      | Graphical Data Presentation . . . . .                       | 56        |
| 5.10     | The Central Limit Theorem . . . . .                         | 57        |
| 5.10.1   | CLT in Averaging . . . . .                                  | 57        |
| 5.11     | Analysis of Variance (ANOVA) . . . . .                      | 57        |
| 5.12     | Propagation of Distributions (Monte Carlo Method) . . . . . | 58        |
| 5.13     | Goodness-of-Fit Testing . . . . .                           | 58        |
| 5.14     | Time Series Analysis Basics . . . . .                       | 58        |
| 5.15     | Nonparametric Methods . . . . .                             | 59        |
| 5.16     | Multiple Testing Correction . . . . .                       | 59        |
| 5.17     | Effect Size and Practical Significance . . . . .            | 59        |
| 5.18     | Practice Questions . . . . .                                | 60        |
| 5.18.1   | Answers . . . . .                                           | 60        |
| <b>6</b> | <b>Principles of Sensors and Actuators</b>                  | <b>62</b> |
| 6.1      | Transduction: Converting Between Physical Domains . . . . . | 63        |
| 6.2      | Sensor Classification . . . . .                             | 63        |
| 6.2.1    | By Transduction Mechanism . . . . .                         | 63        |
| 6.2.2    | By Output Type . . . . .                                    | 64        |
| 6.3      | Key Sensor Specifications . . . . .                         | 64        |
| 6.4      | Common Sensor Types for MEGN 300 . . . . .                  | 65        |
| 6.4.1    | Temperature Sensors . . . . .                               | 65        |
| 6.4.2    | Strain and Force Sensors . . . . .                          | 65        |
| 6.4.3    | Pressure Sensors . . . . .                                  | 65        |
| 6.4.4    | Motion and Position Sensors . . . . .                       | 66        |
| 6.4.5    | Flow Sensors . . . . .                                      | 66        |
| 6.5      | Actuator Principles . . . . .                               | 66        |
| 6.5.1    | Electromagnetic Actuators . . . . .                         | 66        |
| 6.5.2    | Thermal Actuators . . . . .                                 | 67        |
| 6.5.3    | Fluid Actuators . . . . .                                   | 67        |
| 6.5.4    | Actuator Selection Framework . . . . .                      | 67        |
| 6.6      | Practice Questions . . . . .                                | 67        |
| 6.6.1    | Answers . . . . .                                           | 68        |

|           |                                                               |           |
|-----------|---------------------------------------------------------------|-----------|
| <b>II</b> | <b>Signals and Signal Processing</b>                          | <b>69</b> |
| <b>7</b>  | <b>Analog vs. Digital Systems</b>                             | <b>70</b> |
| 7.1       | Continuous and Discrete Signals . . . . .                     | 70        |
| 7.2       | Analog-to-Digital Conversion (ADC) . . . . .                  | 70        |
| 7.2.1     | Quantization Error . . . . .                                  | 70        |
| 7.3       | Digital-to-Analog Conversion (DAC) . . . . .                  | 70        |
| 7.4       | Advantages and Trade-offs . . . . .                           | 71        |
| 7.5       | Sample-and-Hold (S/H) . . . . .                               | 71        |
| 7.6       | Multiplexing . . . . .                                        | 72        |
| 7.7       | Common NI DAQ Devices for MEGN 300 . . . . .                  | 72        |
| 7.8       | The Analog World and Its Limitations . . . . .                | 72        |
| 7.9       | Sampling Theory . . . . .                                     | 72        |
| 7.10      | Quantization in Depth . . . . .                               | 73        |
| 7.11      | Sample-and-Hold and Aperture Effects . . . . .                | 73        |
| 7.12      | Multiplexing and Channel Skew . . . . .                       | 73        |
| 7.13      | Input Configuration . . . . .                                 | 73        |
| 7.14      | Digital-to-Analog Conversion . . . . .                        | 74        |
| 7.15      | Understanding ADC Architectures . . . . .                     | 74        |
| 7.16      | Practical DAQ Considerations . . . . .                        | 74        |
| 7.17      | ADC Architecture Comparison . . . . .                         | 74        |
| 7.18      | Practical DAQ Configuration Details . . . . .                 | 75        |
| 7.18.1    | Trigger Configuration . . . . .                               | 75        |
| 7.18.2    | Buffer Management and Data Throughput . . . . .               | 75        |
| 7.18.3    | Clock Sources . . . . .                                       | 75        |
| 7.19      | Grounding and Wiring Best Practices for DAQ . . . . .         | 75        |
| 7.20      | Data Conversion Pipeline . . . . .                            | 76        |
| 7.21      | Common ADC Errors . . . . .                                   | 76        |
| 7.22      | Oversampling for Improved Resolution . . . . .                | 76        |
| 7.23      | Signal Conditioning Integration with DAQ . . . . .            | 77        |
| 7.24      | Multi-Channel Acquisition Strategies . . . . .                | 77        |
| 7.25      | Timing Verification . . . . .                                 | 77        |
| 7.26      | Real-World DAQ System Examples . . . . .                      | 77        |
| 7.26.1    | NI USB-6001 (MEGN 300 Standard) . . . . .                     | 78        |
| 7.26.2    | NI USB-9234 (Vibration/Acoustics) . . . . .                   | 78        |
| 7.26.3    | Arduino/ESP32 (Embedded/Low-Cost) . . . . .                   | 78        |
| 7.27      | Practical Input Range Optimization . . . . .                  | 78        |
| 7.28      | Timing Accuracy and Jitter . . . . .                          | 78        |
| 7.29      | Practice Questions . . . . .                                  | 79        |
| 7.29.1    | Answers . . . . .                                             | 79        |
| <b>8</b>  | <b>Signal-to-Noise Ratio</b>                                  | <b>80</b> |
| 8.1       | Defining SNR . . . . .                                        | 80        |
| 8.2       | Noise Sources in Instrumentation . . . . .                    | 80        |
| 8.3       | Improving SNR . . . . .                                       | 82        |
| 8.4       | Dynamic Range . . . . .                                       | 82        |
| 8.5       | Grounding Best Practices for Low-Noise Measurements . . . . . | 82        |
| 8.6       | Defining Signal and Noise . . . . .                           | 83        |



|          |                                                                |           |
|----------|----------------------------------------------------------------|-----------|
| 8.7      | The Decibel Scale . . . . .                                    | 83        |
| 8.8      | Noise Classification . . . . .                                 | 83        |
| 8.9      | Grounding Best Practices . . . . .                             | 83        |
| 8.10     | Noise in the Signal Chain . . . . .                            | 84        |
| 8.11     | SNR Improvement Techniques . . . . .                           | 84        |
| 8.12     | Noise Spectral Density . . . . .                               | 84        |
| 8.13     | Dynamic Range . . . . .                                        | 84        |
| 8.14     | Ground Loops: Diagnosis and Cure . . . . .                     | 84        |
| 8.15     | EMI Shielding Effectiveness . . . . .                          | 85        |
| 8.16     | Noise Budget Analysis . . . . .                                | 85        |
| 8.16.1   | Worked Example . . . . .                                       | 85        |
| 8.17     | Common-Mode Rejection in Practice . . . . .                    | 85        |
| 8.18     | Noise Figure . . . . .                                         | 86        |
| 8.19     | Noise Measurement Techniques . . . . .                         | 86        |
| 8.20     | Signal Recovery from Noise . . . . .                           | 86        |
| 8.21     | Noise Measurement Procedure for MEGN 300 Labs . . . . .        | 87        |
| 8.22     | SNR Requirements for Different Measurement Types . . . . .     | 87        |
| 8.23     | Quantifying EMI: Conducted vs. Radiated . . . . .              | 87        |
| 8.24     | Power Supply Noise . . . . .                                   | 88        |
| 8.25     | SNR Improvement: A Quantitative Case Study . . . . .           | 88        |
| 8.26     | Dynamic Range and Effective Bits . . . . .                     | 88        |
| 8.27     | Noise Floor and Minimum Detectable Signal . . . . .            | 89        |
| 8.28     | Noise in Data Acquisition Systems . . . . .                    | 89        |
| 8.29     | Lock-In Amplification: Extracting Signals from Noise . . . . . | 89        |
| 8.30     | Practice Questions . . . . .                                   | 89        |
| 8.30.1   | Answers . . . . .                                              | 90        |
| <b>9</b> | <b>Fourier Series and Complex Signal Construction</b>          | <b>91</b> |
| 9.1      | The Fourier Principle . . . . .                                | 91        |
| 9.2      | Common Waveform Decompositions . . . . .                       | 92        |
| 9.3      | Why Frequency Matters in Instrumentation . . . . .             | 92        |
| 9.4      | Mathematical Foundation . . . . .                              | 92        |
| 9.5      | Common Waveforms . . . . .                                     | 93        |
| 9.6      | Physical Interpretation . . . . .                              | 93        |
| 9.7      | The Gibbs Phenomenon . . . . .                                 | 93        |
| 9.8      | From Series to Transform . . . . .                             | 93        |
| 9.9      | Complex Exponential Representation . . . . .                   | 93        |
| 9.10     | Convergence and the Dirichlet Conditions . . . . .             | 94        |
| 9.11     | Practical Implications for Bandwidth Requirements . . . . .    | 94        |
| 9.12     | Spectral Analysis of Real Signals . . . . .                    | 94        |
| 9.13     | Why Engineers Must Think in Frequency . . . . .                | 94        |
| 9.14     | Even and Odd Function Decomposition . . . . .                  | 94        |
| 9.15     | Power and Energy in the Frequency Domain . . . . .             | 95        |
| 9.16     | Total Harmonic Distortion (THD) . . . . .                      | 95        |
| 9.17     | Modulation and Demodulation . . . . .                          | 95        |
| 9.18     | Discrete Fourier Series and the Transition to DFT . . . . .    | 95        |
| 9.19     | Windowing Preview . . . . .                                    | 96        |
| 9.20     | Fourier Transform of Common Signals . . . . .                  | 96        |

|           |                                                                    |            |
|-----------|--------------------------------------------------------------------|------------|
| 9.21      | The Short-Time Fourier Transform (STFT) and Spectrograms . . . . . | 96         |
| 9.22      | Bandwidth and Harmonic Content: A Design Tool . . . . .            | 96         |
| 9.23      | Fourier Series in Sensor Design . . . . .                          | 97         |
| 9.24      | Spectral Analysis in Troubleshooting . . . . .                     | 97         |
| 9.25      | Fourier Series Symmetry Properties . . . . .                       | 97         |
| 9.26      | Convergence Rate and Bandwidth Implications . . . . .              | 98         |
| 9.27      | Fourier Analysis of Real Sensor Signals . . . . .                  | 98         |
| 9.27.1    | Vibration Signature Analysis . . . . .                             | 98         |
| 9.27.2    | Electrical Power Quality . . . . .                                 | 98         |
| 9.28      | Window Functions: Mathematical Basis . . . . .                     | 98         |
| 9.29      | Practical Frequency Analysis Workflow . . . . .                    | 99         |
| 9.30      | The Uncertainty Principle for Signals . . . . .                    | 99         |
| 9.31      | Hilbert Transform and Envelope Analysis . . . . .                  | 100        |
| 9.32      | Practice Questions . . . . .                                       | 100        |
| 9.32.1    | Answers . . . . .                                                  | 100        |
| <b>10</b> | <b>FFT and Complex Signal Decomposition</b>                        | <b>101</b> |
| 10.1      | From Fourier Series to Fourier Transform . . . . .                 | 101        |
| 10.2      | The Discrete Fourier Transform (DFT) and FFT . . . . .             | 102        |
| 10.2.1    | Interpreting the FFT Output . . . . .                              | 102        |
| 10.2.2    | Windowing . . . . .                                                | 102        |
| 10.3      | Practical FFT in LabVIEW . . . . .                                 | 102        |
| 10.4      | Power Spectral Density (PSD) . . . . .                             | 102        |
| 10.5      | Averaging for Spectral Estimates . . . . .                         | 103        |
| 10.6      | Practical FFT Analysis Workflow . . . . .                          | 103        |
| 10.7      | From DFT to FFT . . . . .                                          | 104        |
| 10.8      | FFT Output Interpretation . . . . .                                | 104        |
| 10.8.1    | Frequency Resolution . . . . .                                     | 104        |
| 10.8.2    | Frequency Range . . . . .                                          | 104        |
| 10.9      | Power Spectral Density (PSD) . . . . .                             | 104        |
| 10.10     | Windowing: Theory and Practice . . . . .                           | 105        |
| 10.10.1   | The Root Cause . . . . .                                           | 105        |
| 10.10.2   | Window Functions . . . . .                                         | 105        |
| 10.11     | Spectral Averaging . . . . .                                       | 105        |
| 10.11.1   | Overlap Processing . . . . .                                       | 106        |
| 10.12     | Common FFT Pitfalls . . . . .                                      | 106        |
| 10.13     | From DFT to FFT . . . . .                                          | 106        |
| 10.14     | FFT Output Interpretation . . . . .                                | 106        |
| 10.15     | Power Spectral Density . . . . .                                   | 106        |
| 10.16     | Windowing . . . . .                                                | 106        |
| 10.17     | Spectral Averaging and Overlap . . . . .                           | 107        |
| 10.18     | Common FFT Pitfalls . . . . .                                      | 107        |
| 10.19     | Choosing FFT Parameters for MEGN 300 Labs . . . . .                | 107        |
| 10.19.1   | Acquisition Time Tradeoff . . . . .                                | 107        |
| 10.20     | Interpreting FFT Results . . . . .                                 | 107        |
| 10.20.1   | Identifying Signal Components . . . . .                            | 107        |
| 10.20.2   | Frequency Identification Guide . . . . .                           | 108        |
| 10.21     | Cross-Spectral Analysis . . . . .                                  | 108        |

|           |                                                                 |            |
|-----------|-----------------------------------------------------------------|------------|
| 10.22     | Practical LabVIEW FFT Implementation . . . . .                  | 108        |
| 10.23     | FFT Resolution Enhancement Techniques . . . . .                 | 108        |
| 10.23.1   | Zero-Padding . . . . .                                          | 109        |
| 10.23.2   | Zoom FFT . . . . .                                              | 109        |
| 10.24     | Order Analysis for Rotating Machinery . . . . .                 | 109        |
| 10.25     | Cepstral Analysis (Overview) . . . . .                          | 109        |
| 10.26     | Waterfall and Spectrogram Displays . . . . .                    | 110        |
| 10.27     | Practice Questions . . . . .                                    | 110        |
| 10.27.1   | Answers . . . . .                                               | 110        |
| <b>11</b> | <b>Fundamentals of Digital Signal Processing</b>                | <b>112</b> |
| 11.1      | Sampling Theorem (Nyquist-Shannon) . . . . .                    | 112        |
| 11.1.1    | Alias Frequency Calculation . . . . .                           | 113        |
| 11.2      | Practical Sampling Rate Selection . . . . .                     | 113        |
| 11.3      | Quantization and Effective Number of Bits (ENOB) . . . . .      | 113        |
| 11.4      | Oversampling and Decimation . . . . .                           | 113        |
| 11.5      | Dithering . . . . .                                             | 114        |
| 11.6      | The Sampling Process in Detail . . . . .                        | 114        |
| 11.6.1    | Alias Frequency Formula . . . . .                               | 114        |
| 11.7      | Anti-Aliasing Strategy . . . . .                                | 114        |
| 11.8      | Oversampling Benefits . . . . .                                 | 114        |
| 11.9      | Dithering . . . . .                                             | 114        |
| 11.10     | Reconstruction . . . . .                                        | 115        |
| 11.11     | Digital Resampling . . . . .                                    | 115        |
| 11.12     | Practical Oversampling Design . . . . .                         | 115        |
| 11.13     | Sample Rate for Control Systems . . . . .                       | 115        |
| 11.14     | Data File Management . . . . .                                  | 115        |
| 11.15     | The Z-Transform and Digital System Analysis . . . . .           | 116        |
| 11.16     | Quantization Effects in Digital Systems . . . . .               | 116        |
| 11.17     | Practical Anti-Aliasing: A Complete Design Example . . . . .    | 116        |
| 11.18     | Multirate Signal Processing . . . . .                           | 117        |
| 11.19     | Sigma-Delta Conversion in Detail . . . . .                      | 117        |
| 11.20     | Complete Anti-Aliasing Design: A Worked Example . . . . .       | 117        |
| 11.21     | Choosing the Right Sample Rate: A Decision Framework . . . . .  | 118        |
| 11.22     | Data Volume and Storage Calculations . . . . .                  | 118        |
| 11.23     | Discrete Convolution . . . . .                                  | 118        |
| 11.24     | The Sampling Theorem: Proof by Intuition . . . . .              | 119        |
| 11.25     | Practical Aliasing Scenarios in MEGN 300 . . . . .              | 119        |
| 11.26     | Digital Filtering in LabVIEW: Implementation Patterns . . . . . | 119        |
| 11.27     | Resampling: Practical Considerations . . . . .                  | 120        |
| 11.28     | Spectral Analysis of Noise . . . . .                            | 120        |
| 11.29     | The Z-Transform: Bridge from Continuous to Digital . . . . .    | 120        |
| 11.29.1   | Definition . . . . .                                            | 121        |
| 11.29.2   | Key Mapping: Poles and Stability . . . . .                      | 121        |
| 11.29.3   | Bilinear Transform . . . . .                                    | 121        |
| 11.29.4   | Why This Matters for Control . . . . .                          | 121        |
| 11.30     | Practice Questions . . . . .                                    | 121        |
| 11.30.1   | Answers . . . . .                                               | 122        |

|                                                                 |            |
|-----------------------------------------------------------------|------------|
| <b>12 Analog Filter Design</b>                                  | <b>123</b> |
| 12.1 What Filters Do . . . . .                                  | 123        |
| 12.2 Passive RC Filters . . . . .                               | 123        |
| 12.2.1 First-Order Low-Pass . . . . .                           | 124        |
| 12.2.2 First-Order High-Pass . . . . .                          | 124        |
| 12.3 Active Filters . . . . .                                   | 124        |
| 12.3.1 Filter Response Types . . . . .                          | 124        |
| 12.4 Designing Active Filters with Op-Amps . . . . .            | 125        |
| 12.4.1 Sallen-Key Low-Pass (Second-Order) . . . . .             | 125        |
| 12.4.2 Higher-Order Filters . . . . .                           | 125        |
| 12.5 Why Analog Filters Are Essential . . . . .                 | 126        |
| 12.6 First-Order RC Low-Pass Filter . . . . .                   | 126        |
| 12.7 Sallen-Key Active Filters . . . . .                        | 126        |
| 12.8 Filter Types . . . . .                                     | 126        |
| 12.9 Notch Filters . . . . .                                    | 126        |
| 12.10 Design Workflow . . . . .                                 | 127        |
| 12.11 Component Selection for Filters . . . . .                 | 127        |
| 12.12 Active Filter Power Supply Considerations . . . . .       | 127        |
| 12.13 Measuring Filter Response . . . . .                       | 127        |
| 12.14 Switched-Capacitor Filters . . . . .                      | 127        |
| 12.15 Active Filter Component Sensitivity . . . . .             | 127        |
| 12.16 Multiple Feedback (MFB) Topology . . . . .                | 128        |
| 12.17 State Variable Filter . . . . .                           | 128        |
| 12.18 Switched-Capacitor Filters . . . . .                      | 128        |
| 12.19 Filter Design Software Tools . . . . .                    | 129        |
| 12.20 Practical Troubleshooting . . . . .                       | 129        |
| 12.21 Practical Active Filter Construction Tips . . . . .       | 129        |
| 12.22 Complete Anti-Alias Filter Design: Step by Step . . . . . | 129        |
| 12.23 Higher-Order Filter Design Tables . . . . .               | 130        |
| 12.24 All-Pass Filters for Phase Correction . . . . .           | 131        |
| 12.25 Anti-Alias Filter Implementation Options . . . . .        | 131        |
| 12.26 Passive vs. Active Filters: When to Use Each . . . . .    | 131        |
| 12.27 Elliptic (Cauer) Filters . . . . .                        | 131        |
| 12.28 Group Delay and Its Measurement . . . . .                 | 132        |
| 12.29 Practice Questions . . . . .                              | 132        |
| 12.29.1 Answers . . . . .                                       | 132        |
| <b>13 Digital Filter Design</b>                                 | <b>133</b> |
| 13.1 Why Digital Filters? . . . . .                             | 133        |
| 13.2 FIR Filters (Finite Impulse Response) . . . . .            | 133        |
| 13.3 IIR Filters (Infinite Impulse Response) . . . . .          | 134        |
| 13.4 Practical Digital Filtering in LabVIEW . . . . .           | 134        |
| 13.5 Advantages of Digital Filters . . . . .                    | 134        |
| 13.6 Moving Average Filter . . . . .                            | 134        |
| 13.7 FIR Filter Design . . . . .                                | 135        |
| 13.8 IIR Filter Design . . . . .                                | 135        |
| 13.9 Selection Guide . . . . .                                  | 135        |
| 13.10 Implementation in LabVIEW . . . . .                       | 135        |

|                                                           |     |
|-----------------------------------------------------------|-----|
| 13.10.1 Filter Testing Methodology . . . . .              | 135 |
| 13.11 Decimation and Interpolation Filters . . . . .      | 135 |
| 13.12 Adaptive Filters (Overview) . . . . .               | 136 |
| 13.13 Detailed FIR Design Example . . . . .               | 136 |
| 13.14 IIR Biquad Implementation . . . . .                 | 136 |
| 13.14.1 Direct Form II Transposed . . . . .               | 137 |
| 13.15 Real-Time Filtering in Control Loops . . . . .      | 137 |
| 13.16 Notch Filter Design . . . . .                       | 137 |
| 13.17 Comb Filters . . . . .                              | 137 |
| 13.18 Comparison: LabVIEW Filter VIs . . . . .            | 138 |
| 13.19 Filter Transient Behavior . . . . .                 | 138 |
| 13.20 Zero-Phase Filtering . . . . .                      | 138 |
| 13.21 Implementing Filters on Microcontrollers . . . . .  | 138 |
| 13.22 Practical Filter Selection Flowchart . . . . .      | 139 |
| 13.23 Windowed FIR Design: Detailed Procedure . . . . .   | 139 |
| 13.23.1 Window Function Selection . . . . .               | 139 |
| 13.24 Equiripple (Parks-McClellan) FIR Design . . . . .   | 140 |
| 13.25 Multirate Filter Structures . . . . .               | 140 |
| 13.25.1 Polyphase Decomposition . . . . .                 | 140 |
| 13.25.2 Cascaded Integrator-Comb (CIC) Filter . . . . .   | 140 |
| 13.26 Adaptive Filtering: The LMS Algorithm . . . . .     | 141 |
| 13.27 Real-Time Filter Implementation Checklist . . . . . | 141 |
| 13.28 Filter Banks . . . . .                              | 141 |
| 13.29 Hilbert Transform Filter . . . . .                  | 142 |
| 13.30 Practice Questions . . . . .                        | 142 |
| 13.30.1 Answers . . . . .                                 | 142 |

### III Electronics for Instrumentation 143

#### 14 Circuit Fundamentals 144

|                                                        |     |
|--------------------------------------------------------|-----|
| 14.1 Voltage, Current, Resistance, and Power . . . . . | 145 |
| 14.2 Kirchhoff's Laws . . . . .                        | 145 |
| 14.2.1 Kirchhoff's Current Law (KCL) . . . . .         | 145 |
| 14.2.2 Kirchhoff's Voltage Law (KVL) . . . . .         | 145 |
| 14.3 Series and Parallel Circuits . . . . .            | 146 |
| 14.3.1 Series Combination . . . . .                    | 146 |
| 14.3.2 Parallel Combination . . . . .                  | 146 |
| 14.4 Voltage Dividers . . . . .                        | 146 |
| 14.5 Thevenin and Norton Equivalent Circuits . . . . . | 147 |
| 14.6 Capacitors and Inductors . . . . .                | 147 |
| 14.6.1 Capacitors . . . . .                            | 147 |
| 14.6.2 Inductors . . . . .                             | 148 |
| 14.7 RC and RL Time Constants . . . . .                | 148 |
| 14.7.1 RC Circuit . . . . .                            | 148 |
| 14.7.2 RL Circuit . . . . .                            | 148 |
| 14.8 AC Circuit Fundamentals . . . . .                 | 149 |
| 14.8.1 Impedance . . . . .                             | 149 |

|           |                                                        |            |
|-----------|--------------------------------------------------------|------------|
| 14.8.2    | RMS Values . . . . .                                   | 149        |
| 14.8.3    | Decibels . . . . .                                     | 149        |
| 14.9      | Grounding and Ground Loops . . . . .                   | 149        |
| 14.10     | Practical Component Selection . . . . .                | 150        |
| 14.10.1   | Resistor Color Code . . . . .                          | 150        |
| 14.10.2   | Resistor Tolerance and Standard Values . . . . .       | 151        |
| 14.10.3   | Power Rating . . . . .                                 | 151        |
| 14.10.4   | Capacitor Voltage Rating . . . . .                     | 151        |
| 14.10.5   | Wire Gauge Reference (AWG) . . . . .                   | 151        |
| 14.10.6   | SI Prefixes and Unit Conversions . . . . .             | 152        |
| 14.10.7   | Common Schematic Symbols . . . . .                     | 152        |
| 14.10.8   | Multimeter Usage Quick Reference . . . . .             | 153        |
| 14.10.9   | Breadboard Layout and Conventions . . . . .            | 153        |
| 14.11     | Practice Questions . . . . .                           | 154        |
| 14.11.1   | Answers . . . . .                                      | 154        |
| <b>15</b> | <b>Amplifiers</b>                                      | <b>155</b> |
| 15.1      | Why Amplification? . . . . .                           | 155        |
| 15.2      | Operational Amplifier (Op-Amp) Fundamentals . . . . .  | 155        |
| 15.2.1    | Inverting Amplifier . . . . .                          | 155        |
| 15.2.2    | Non-Inverting Amplifier . . . . .                      | 156        |
| 15.2.3    | Voltage Follower (Buffer) . . . . .                    | 156        |
| 15.2.4    | Differential Amplifier . . . . .                       | 156        |
| 15.3      | Instrumentation Amplifiers . . . . .                   | 156        |
| 15.4      | Amplifier Noise . . . . .                              | 157        |
| 15.5      | Signal Conditioning Chains . . . . .                   | 157        |
| 15.6      | Why Amplification Is Necessary . . . . .               | 158        |
| 15.7      | Op-Amp Fundamentals . . . . .                          | 158        |
| 15.8      | Amplifier Configurations . . . . .                     | 158        |
| 15.9      | Instrumentation Amplifier (INA) . . . . .              | 158        |
| 15.10     | Common Mistakes . . . . .                              | 159        |
| 15.11     | Reading Op-Amp Datasheets . . . . .                    | 159        |
| 15.12     | PCB Layout for Low-Noise Amplifiers . . . . .          | 159        |
| 15.13     | Signal Conditioning Chain Design Example . . . . .     | 159        |
| 15.14     | Op-Amp Selection Guide . . . . .                       | 159        |
| 15.15     | INA Design Details . . . . .                           | 160        |
| 15.15.1   | Gain Resistor Selection . . . . .                      | 160        |
| 15.15.2   | Input Bias Current Path . . . . .                      | 160        |
| 15.15.3   | Reference Pin . . . . .                                | 160        |
| 15.16     | Signal Chain Design Methodology . . . . .              | 160        |
| 15.17     | Differential vs. Single-Ended Signal Routing . . . . . | 161        |
| 15.18     | Practical Amplifier Troubleshooting . . . . .          | 161        |
| 15.19     | Precision Measurement Techniques . . . . .             | 161        |
| 15.20     | INA Applications Beyond Temperature . . . . .          | 162        |
| 15.21     | Noise Analysis for Amplifier Circuits . . . . .        | 162        |
| 15.21.1   | Op-Amp Noise Model . . . . .                           | 162        |
| 15.21.2   | Noise Gain . . . . .                                   | 162        |
| 15.21.3   | Noise Bandwidth . . . . .                              | 163        |

|           |                                                          |            |
|-----------|----------------------------------------------------------|------------|
| 15.22     | Practical Circuit Construction . . . . .                 | 163        |
| 15.22.1   | Breadboard vs. Protoboard vs. PCB . . . . .              | 163        |
| 15.22.2   | Decoupling Best Practices . . . . .                      | 163        |
| 15.23     | Signal Chain Verification Checklist . . . . .            | 163        |
| 15.24     | Op-Amp Non-Idealities: The Brutal Realities . . . . .    | 164        |
| 15.24.1   | Gain-Bandwidth Product (GBW) . . . . .                   | 164        |
| 15.24.2   | Input Offset Voltage ( $V_{os}$ ) . . . . .              | 164        |
| 15.24.3   | Input Offset Voltage Drift ( $dV_{os}/dT$ ) . . . . .    | 165        |
| 15.24.4   | Slew Rate . . . . .                                      | 165        |
| 15.24.5   | Op-Amp Selection Decision Tree . . . . .                 | 165        |
| 15.25     | Practice Questions . . . . .                             | 166        |
| 15.25.1   | Answers . . . . .                                        | 166        |
| <b>16</b> | <b>High-Power Devices and Switches</b>                   | <b>167</b> |
| 16.1      | The Problem: MCU Outputs Cannot Drive Loads . . . . .    | 167        |
| 16.2      | Transistors as Switches . . . . .                        | 167        |
| 16.2.1    | BJT (Bipolar Junction Transistor) . . . . .              | 167        |
| 16.2.2    | MOSFET . . . . .                                         | 167        |
| 16.3      | Relays . . . . .                                         | 168        |
| 16.3.1    | Solid-State Relays (SSR) . . . . .                       | 168        |
| 16.4      | H-Bridge for Motor Direction Control . . . . .           | 169        |
| 16.5      | Pulse Width Modulation (PWM) for Power Control . . . . . | 169        |
| 16.6      | Optocouplers and Galvanic Isolation . . . . .            | 169        |
| 16.7      | Why High-Power Switching Matters . . . . .               | 169        |
| 16.8      | MOSFET as a Switch . . . . .                             | 170        |
| 16.8.1    | Gate Drive Circuit . . . . .                             | 170        |
| 16.9      | BJT as a Switch . . . . .                                | 170        |
| 16.10     | Inductive Load Protection . . . . .                      | 170        |
| 16.11     | Relay and SSR Switching . . . . .                        | 170        |
| 16.12     | PWM for Proportional Control . . . . .                   | 171        |
| 16.13     | H-Bridge for Bidirectional Motor Control . . . . .       | 171        |
| 16.14     | Optocoupler Isolation . . . . .                          | 171        |
| 16.15     | Relay Selection Guide . . . . .                          | 171        |
| 16.16     | Level Shifting . . . . .                                 | 172        |
| 16.17     | Current Sensing . . . . .                                | 172        |
| 16.18     | Thermal Management . . . . .                             | 172        |
| 16.19     | Power Budget and Wire Sizing . . . . .                   | 172        |
| 16.20     | Solid-State Relay (SSR) Detailed Design . . . . .        | 172        |
| 16.21     | Motor Control Fundamentals . . . . .                     | 173        |
| 16.22     | Protection Circuits . . . . .                            | 173        |
| 16.23     | EMI from Power Switching . . . . .                       | 173        |
| 16.24     | Inrush Current Management . . . . .                      | 174        |
| 16.25     | Safety Considerations for High-Power Circuits . . . . .  | 174        |
| 16.26     | Motor Selection for MEGN 300 Projects . . . . .          | 174        |
| 16.27     | Power Electronics Thermal Design . . . . .               | 175        |
| 16.28     | DC-DC Converters: Buck and Boost Regulators . . . . .    | 175        |
| 16.28.1   | Buck Converter (Step-Down) . . . . .                     | 175        |
| 16.28.2   | Boost Converter (Step-Up) . . . . .                      | 176        |

|                                                                     |            |
|---------------------------------------------------------------------|------------|
| 16.28.3 Buck-Boost Converter . . . . .                              | 176        |
| 16.28.4 Switching Regulator Noise . . . . .                         | 177        |
| 16.29 Functional Safety: Fail-Safes and Emergency Stops . . . . .   | 177        |
| 16.29.1 What Happens When the Controller Fails? . . . . .           | 177        |
| 16.29.2 Fail-Safe Design Patterns . . . . .                         | 177        |
| 16.29.3 Safety Integrity Levels (Conceptual) . . . . .              | 178        |
| 16.29.4 Practical Implementation for GreenShield Projects . . . . . | 178        |
| 16.30 Practice Questions . . . . .                                  | 179        |
| 16.30.1 Answers . . . . .                                           | 179        |
| <b>17 Systematic Debugging and Troubleshooting</b>                  | <b>180</b> |
| 17.1 Why Bottom-Up Debugging Matters . . . . .                      | 181        |
| 17.2 Debugging Hardware . . . . .                                   | 181        |
| 17.2.1 Visual Inspection . . . . .                                  | 181        |
| 17.2.2 Continuity and Short-Circuit Check . . . . .                 | 182        |
| 17.2.3 Power-Up Sequence . . . . .                                  | 182        |
| 17.2.4 Signal Tracing . . . . .                                     | 182        |
| 17.2.5 Common Hardware Faults and Their Signatures . . . . .        | 182        |
| 17.3 Debugging Software and Firmware . . . . .                      | 183        |
| 17.3.1 Incremental Development . . . . .                            | 183        |
| 17.3.2 Common Firmware Bugs . . . . .                               | 183        |
| 17.3.3 Using the LabVIEW Debugging Tools . . . . .                  | 184        |
| 17.4 Debugging Integrated Systems . . . . .                         | 184        |
| 17.4.1 The Integration Test Sequence . . . . .                      | 184        |
| 17.4.2 Common Integration Failures . . . . .                        | 185        |
| 17.4.3 The Five-Step Debugging Protocol . . . . .                   | 185        |
| 17.5 Debugging Tools and Their Proper Use . . . . .                 | 186        |
| 17.5.1 Multimeter . . . . .                                         | 186        |
| 17.5.2 Oscilloscope . . . . .                                       | 186        |
| 17.5.3 Logic Analyzer . . . . .                                     | 186        |
| 17.5.4 Bench Power Supply . . . . .                                 | 186        |
| 17.5.5 Serial Terminal / Data Logger . . . . .                      | 187        |
| 17.6 Building a Debugging Mindset . . . . .                         | 187        |
| 17.7 Practice Questions . . . . .                                   | 187        |
| 17.7.1 Answers . . . . .                                            | 188        |
| <b>Why Instrumentation Projects Fail</b>                            | <b>189</b> |
| <b>IV Control Systems</b>                                           | <b>191</b> |
| <b>18 Open-Loop Control</b>                                         | <b>192</b> |
| 18.1 Definition . . . . .                                           | 192        |
| 18.2 Characteristics . . . . .                                      | 192        |
| 18.3 Feedforward Control . . . . .                                  | 193        |
| 18.4 Understanding Open-Loop Control . . . . .                      | 193        |
| 18.5 Feedforward Control . . . . .                                  | 193        |
| 18.6 Limitations of Open-Loop . . . . .                             | 193        |



|                                                                             |            |
|-----------------------------------------------------------------------------|------------|
| 18.7 When Open-Loop Is Appropriate . . . . .                                | 194        |
| 18.8 Feedforward Control . . . . .                                          | 194        |
| 18.9 Calibration Tables as Open-Loop Control . . . . .                      | 194        |
| 18.10 State Machines as Open-Loop Controllers . . . . .                     | 194        |
| 18.11 When Open-Loop Fails . . . . .                                        | 194        |
| 18.12 Mathematical Model of Open-Loop Systems . . . . .                     | 194        |
| 18.13 Examples of Open-Loop Systems in Engineering . . . . .                | 195        |
| 18.14 Quantifying Open-Loop Performance . . . . .                           | 195        |
| 18.15 Feedforward Design Procedure . . . . .                                | 195        |
| 18.16 Open-Loop Stability . . . . .                                         | 196        |
| 18.17 Lookup Tables and Interpolation in Open-Loop Control . . . . .        | 196        |
| 18.18 State Machine Controllers . . . . .                                   | 196        |
| 18.19 Combining Open-Loop and Closed-Loop . . . . .                         | 196        |
| 18.20 Characterizing Plant Dynamics in Open Loop . . . . .                  | 197        |
| 18.21 Sensitivity Analysis . . . . .                                        | 197        |
| 18.22 Hybrid Architectures in Industrial Practice . . . . .                 | 197        |
| 18.23 Open-Loop Control in Embedded Systems . . . . .                       | 198        |
| 18.24 Feedforward Control: Design and Implementation . . . . .              | 198        |
| 18.25 Model-Based Open-Loop: Inverse Dynamics . . . . .                     | 198        |
| 18.26 Gain Scheduling: Quasi-Open-Loop . . . . .                            | 199        |
| 18.27 Lookup Table Implementation . . . . .                                 | 199        |
| 18.27.1 Linear Interpolation . . . . .                                      | 199        |
| 18.27.2 Table Resolution . . . . .                                          | 199        |
| 18.28 Practical Comparison: Open-Loop vs. Closed-Loop Performance . . . . . | 199        |
| 18.29 Practice Questions . . . . .                                          | 200        |
| 18.29.1 Answers . . . . .                                                   | 200        |
| <b>19 Closed-Loop Control</b>                                               | <b>201</b> |
| 19.1 Feedback Control . . . . .                                             | 201        |
| 19.2 Block Diagram . . . . .                                                | 201        |
| 19.3 Advantages Over Open-Loop . . . . .                                    | 202        |
| 19.4 Stability . . . . .                                                    | 202        |
| 19.5 Transfer Functions . . . . .                                           | 202        |
| 19.6 Steady-State Error . . . . .                                           | 203        |
| 19.7 The Feedback Principle . . . . .                                       | 203        |
| 19.8 Closed-Loop Block Diagram Components . . . . .                         | 203        |
| 19.9 Transfer Functions and System Type . . . . .                           | 203        |
| 19.10 Stability . . . . .                                                   | 204        |
| 19.11 Closed-Loop Advantages . . . . .                                      | 204        |
| 19.12 Sensitivity and Complementary Sensitivity . . . . .                   | 204        |
| 19.13 Stability Margins in Detail . . . . .                                 | 204        |
| 19.14 The Effect of Sensor Dynamics . . . . .                               | 205        |
| 19.15 Disturbance Rejection Quantified . . . . .                            | 205        |
| 19.16 The Feedback Equation . . . . .                                       | 205        |
| 19.17 Steady-State Error Analysis . . . . .                                 | 205        |
| 19.18 Stability Analysis Methods . . . . .                                  | 206        |
| 19.18.1 Bode Plot Method . . . . .                                          | 206        |
| 19.18.2 Root Locus (Conceptual) . . . . .                                   | 206        |

|           |                                                              |            |
|-----------|--------------------------------------------------------------|------------|
| 19.19     | Performance Specifications . . . . .                         | 206        |
| 19.20     | Practical Closed-Loop Design Steps . . . . .                 | 206        |
| 19.21     | Closed-Loop Bandwidth and Speed of Response . . . . .        | 207        |
| 19.22     | The Sensitivity Tradeoff . . . . .                           | 207        |
| 19.23     | Effect of Time Delay (Dead Time) . . . . .                   | 207        |
| 19.24     | Integral Action and Reset Windup . . . . .                   | 208        |
| 19.25     | Root Locus: Physical Interpretation . . . . .                | 208        |
| 19.26     | Frequency-Domain Design: Lead and Lag Compensation . . . . . | 208        |
| 19.27     | Closed-Loop Response to Ramp Inputs . . . . .                | 209        |
| 19.28     | Implementation Considerations . . . . .                      | 209        |
| 19.29     | Practice Questions . . . . .                                 | 209        |
| 19.29.1   | Answers . . . . .                                            | 209        |
| <b>20</b> | <b>PID Control</b>                                           | <b>211</b> |
| 20.1      | The PID Controller . . . . .                                 | 211        |
| 20.2      | The Three Terms . . . . .                                    | 211        |
| 20.2.1    | Proportional (P) . . . . .                                   | 211        |
| 20.2.2    | Integral (I) . . . . .                                       | 212        |
| 20.2.3    | Derivative (D) . . . . .                                     | 212        |
| 20.3      | From PID Output to Physical Actuator . . . . .               | 213        |
| 20.4      | Tuning Methods . . . . .                                     | 213        |
| 20.4.1    | Ziegler-Nichols (Closed-Loop) . . . . .                      | 213        |
| 20.4.2    | Manual Tuning . . . . .                                      | 214        |
| 20.5      | Integral Windup . . . . .                                    | 214        |
| 20.6      | Digital PID Implementation . . . . .                         | 214        |
| 20.7      | Practical PID Considerations . . . . .                       | 215        |
| 20.7.1    | Derivative Filter . . . . .                                  | 215        |
| 20.7.2    | Setpoint Weighting . . . . .                                 | 215        |
| 20.7.3    | Bumpless Transfer . . . . .                                  | 215        |
| 20.7.4    | Cascade Control . . . . .                                    | 215        |
| 20.8      | PID Controller Theory . . . . .                              | 216        |
| 20.8.1    | Proportional (P) Term . . . . .                              | 216        |
| 20.8.2    | Integral (I) Term . . . . .                                  | 216        |
| 20.8.3    | Derivative (D) Term . . . . .                                | 216        |
| 20.9      | Tuning Methods . . . . .                                     | 216        |
| 20.9.1    | Ziegler-Nichols Closed-Loop Method . . . . .                 | 216        |
| 20.9.2    | Manual Tuning . . . . .                                      | 217        |
| 20.10     | Anti-Windup . . . . .                                        | 217        |
| 20.11     | Discrete PID Implementation . . . . .                        | 217        |
| 20.12     | Practical PID Tips . . . . .                                 | 217        |
| 20.13     | PID Gain Units and Conversion . . . . .                      | 218        |
| 20.14     | Cascade Control . . . . .                                    | 218        |
| 20.15     | Feed-Forward Combined with PID . . . . .                     | 218        |
| 20.16     | PID Autotuning . . . . .                                     | 218        |
| 20.17     | Control Latency and Its Effect on Stability . . . . .        | 219        |
| 20.17.1   | What Is Control Latency? . . . . .                           | 219        |
| 20.17.2   | Phase Lag from Latency . . . . .                             | 219        |
| 20.17.3   | Worked Example: ThermoRig . . . . .                          | 219        |

|                                                              |                |
|--------------------------------------------------------------|----------------|
| 20.17.4 Reducing Latency . . . . .                           | 220            |
| 20.18 Practice Questions . . . . .                           | 220            |
| 20.18.1 Answers . . . . .                                    | 220            |
| <b>Appendix: LabVIEW Quick Reference for MEGN 300</b>        | <b>223</b>     |
| <br><b>V Engineering Science Reference</b>                   | <br><b>227</b> |
| <b>Fundamentals of Heat Transfer</b>                         | <b>228</b>     |
| 20.19 Why Heat Transfer Matters in Instrumentation . . . . . | 228            |
| 20.20 Modes of Heat Transfer . . . . .                       | 228            |
| 20.21 Conduction . . . . .                                   | 229            |
| 20.21.1 Thermal Conductivity . . . . .                       | 229            |
| 20.21.2 Thermal Resistance . . . . .                         | 229            |
| 20.21.3 Composite Walls . . . . .                            | 229            |
| 20.22 Convection . . . . .                                   | 230            |
| 20.22.1 Natural (Free) Convection . . . . .                  | 230            |
| 20.22.2 Forced Convection . . . . .                          | 230            |
| 20.22.3 Convective Thermal Resistance . . . . .              | 230            |
| 20.23 Radiation . . . . .                                    | 231            |
| 20.23.1 When Radiation Matters . . . . .                     | 231            |
| 20.24 Energy Balance . . . . .                               | 231            |
| 20.24.1 Steady-State Energy Balance . . . . .                | 231            |
| 20.24.2 Transient Energy Balance . . . . .                   | 231            |
| 20.24.3 The Lumped Capacitance Model . . . . .               | 232            |
| 20.25 Heat Transfer and Sensor Placement . . . . .           | 232            |
| 20.26 Thermal Design for Control Systems . . . . .           | 232            |
| 20.27 Extended Surfaces: Fins . . . . .                      | 233            |
| 20.28 Thermal Time Constants and Sensor Response . . . . .   | 233            |
| 20.29 Thermal Interface Materials . . . . .                  | 234            |
| 20.30 Radiation Shields and View Factors . . . . .           | 234            |
| 20.31 Dimensional Analysis and Nusselt Number . . . . .      | 234            |
| 20.32 Heat Transfer Coefficient Estimation . . . . .         | 235            |
| 20.33 Transient Heating and Cooling Curves . . . . .         | 235            |
| 20.34 Multi-Node Thermal Models . . . . .                    | 235            |
| 20.35 Practice Questions . . . . .                           | 236            |
| 20.35.1 Answers . . . . .                                    | 236            |
| <br><b>Fundamentals of Fluid Power</b>                       | <br><b>237</b> |
| 20.36 Fluid Properties and Fundamentals . . . . .            | 237            |
| 20.37 Hydrostatics: Pressure in Stationary Fluids . . . . .  | 238            |
| 20.38 Fluid Dynamics: Flow in Pipes and Channels . . . . .   | 238            |
| 20.38.1 Reynolds Number and Flow Regime . . . . .            | 238            |
| 20.38.2 Bernoulli's Equation . . . . .                       | 238            |
| 20.38.3 Continuity Equation . . . . .                        | 238            |
| 20.38.4 Pressure Drop in Pipes . . . . .                     | 239            |
| 20.39 Flow Measurement . . . . .                             | 239            |

|                                                    |            |
|----------------------------------------------------|------------|
| 20.39.1 Differential Pressure Methods . . . . .    | 239        |
| 20.39.2 Positive Displacement Flowmeters . . . . . | 239        |
| 20.39.3 Turbine Flowmeters . . . . .               | 239        |
| 20.39.4 Ultrasonic Flowmeters . . . . .            | 240        |
| 20.39.5 Electromagnetic Flowmeters . . . . .       | 240        |
| 20.40 Hydraulic Systems . . . . .                  | 240        |
| 20.41 Pneumatic Systems . . . . .                  | 241        |
| 20.42 Control Valves for Process Control . . . . . | 241        |
| 20.43 Practice Questions . . . . .                 | 241        |
| 20.43.1 Answers . . . . .                          | 242        |
| <b>Glossary of Key Terms and Acronyms</b>          | <b>243</b> |
| <b>Quick Reference Tables</b>                      | <b>247</b> |
| <b>ABET Student Outcome Mapping</b>                | <b>249</b> |
| <b>References and Further Resources</b>            | <b>251</b> |
| <b>Index</b>                                       | <b>253</b> |

# How to Use This Document

---

This reference document accompanies the MEGN 300 lecture modules and lab exercises. It is organized in four parts that follow the logical progression of instrumentation and control:

**Part I: Measurement Fundamentals** covers the physics and mathematics of measurement. These six chapters establish the vocabulary and analytical tools you need before touching any hardware: what measurements are, how sensors behave statically and dynamically, how to quantify uncertainty with variance and covariance analysis, how to apply statistical methods to experimental data, and the physical principles of sensors and actuators.

**Part II: Signals and Signal Processing** covers how measured signals are represented, converted between analog and digital domains, decomposed into frequency components, and cleaned up with filters. These chapters bridge measurement theory and practical data acquisition.

**Part III: Electronics for Instrumentation** covers the electronic building blocks that condition, amplify, and switch signals in real measurement and control systems. It begins with circuit fundamentals (Ohm's Law, Kirchhoff's Laws, voltage dividers, RC/RL transients, and grounding) before moving to amplifiers, power electronics, DC-DC converters, and a systematic debugging methodology that teaches you to verify hardware, firmware, and integrated systems from the bottom up.

**Part IV: Control Systems** covers the fundamentals of open-loop and closed-loop control, culminating in the PID controller that is the workhorse of industrial automation.

## Generative AI Policy

This document includes a “Modern Tools and AI Use Policy” (page xxiii) with a Green/Yellow/Red traffic-light framework governing the use of ChatGPT, Copilot, and other generative AI tools in MEGN 300. Read it before your first assignment.

## About the Requirements Mapping Boxes

Throughout this document, blue-bordered **Requirements Mapping** boxes show how theoretical concepts translate directly into testable “shall” statements in a System Design Requirements Document (SDRD). This is the language of professional engineering: every measurement specification, filter design, and control performance target should trace to a formal requirement that can be verified by test, analysis, inspection, or demonstration. When you encounter a Requirements Mapping box, it is showing you how to write the engineering specification for the concept just discussed.

**Part V: Engineering Science Reference** provides the heat transfer fundamentals (conduction, convection, radiation, and energy balances) that underpin the ThermoRig worked example and any thermal measurement or control system, plus fluid power fundamentals (hydraulics, pneumatics, flow measurement, and control valves) for students whose projects involve fluid systems.

Every chapter includes worked examples, practice questions with solutions, and Requirements Mapping boxes that connect theory to testable engineering specifications.

### The Running Worked Example: ThermoRig

Throughout this document, teal-bordered **WE** boxes follow a single instrumentation design, the **ThermoRig** temperature measurement and control system: a thermocouple-based sensor, signal conditioning chain, NI DAQ data acquisition, and PID-controlled heater. Watch for these boxes to see how each concept applies to a real measurement system.

### ThermoRig Worked Example Roadmap

The ThermoRig boxes are not random examples; they form a cumulative narrative of a complete measurement and control system:

- **Chapter 2** (Static Measurements): We calibrate the Type K thermocouple at known temperature points.
- **Chapter 3** (Dynamic Measurements): We measure the thermocouple's time constant and evaluate its bandwidth.
- **Chapter 4** (Error Analysis): We propagate uncertainty through the heat flux calculation.
- **Chapter 8** (Signal-to-Noise Ratio): We diagnose 60 Hz noise from the heater cable and fix it.
- **Chapter 11** (Digital Signal Processing): We discover aliasing from the 500 kHz switching regulator.
- **Chapter 15** (Amplifiers): We design the complete signal conditioning chain (bridge, INA, filter, ADC).
- **Chapter 16** (High-Power Devices): We drive the heater through an SSR with time-proportional PWM.
- **Chapter 20** (PID Control): We tune the PID controller using Ziegler-Nichols and manual refinement.

Read the boxes in sequence for a complete case study of instrumentation system design.

### Week-to-Chapter Mapping

| Week  | Topic Area                   | Primary Activities                                      | Chapters  |
|-------|------------------------------|---------------------------------------------------------|-----------|
| 1–2   | Measurement Fundamentals     | Sensor terminology, static characteristics, calibration | Ch. 1–2   |
| 3–4   | Dynamic Measurements & Error | Time constants, frequency response, uncertainty         | Ch. 3–4   |
| 5–6   | Signals & Digitization       | Analog vs. digital, sampling, aliasing, SNR             | Ch. 5–6   |
| 7–8   | Frequency Analysis           | Fourier series, FFT, spectral analysis                  | Ch. 7–8   |
| 9–10  | Filtering                    | DSP basics, analog and digital filter design            | Ch. 9–11  |
| 11–12 | Signal Conditioning          | Amplifiers, instrumentation amps, high-power switches   | Ch. 12–13 |
| 13–14 | Control Systems              | Open-loop, closed-loop, PID fundamentals                | Ch. 14–16 |
| 15–16 | Integration & Exams          | Complete system integration, lab practicals             | All       |

# What Should I Be Reading Right Now?

---

| If you are...                     | Your problem                  | Go to                        |
|-----------------------------------|-------------------------------|------------------------------|
| Just starting the course          | Need the big picture          | Ch. 1, p. 6                  |
| Calibrating a sensor              | Need procedure and equations  | Ch. 2, p. 16                 |
| Sensor too slow for your signal   | Dynamic response limiting you | Ch. 3, p. 28                 |
| Reporting a measurement           | Need uncertainty and CI       | Ch. 4, p. 39                 |
| Selecting a sensor or actuator    | Need transduction principles  | Ch. 6, p. 62                 |
| Choosing ADC settings             | Bits, sample rate, range      | Ch. 7 (Analog vs. Digital)   |
| Seeing noisy data                 | Need to improve SNR           | Ch. 8, p. 80                 |
| Running an FFT in LabVIEW         | Need parameters and windows   | Ch. 10, p. 101               |
| Getting aliased data              | False frequencies appearing   | Ch. 11, p. 112               |
| Designing an anti-alias filter    | Need cutoff and order         | Ch. 12, p. 123               |
| Need circuit fundamentals         | Ohm's Law, KVL/KCL, dividers  | Ch. 14, p. 144               |
| Signal too small for the ADC      | Need amplification            | Ch. 15, p. 155               |
| Driving a motor or heater         | Need switching circuits       | Ch. 16, p. 167               |
| System not working after assembly | Need debugging methodology    | Ch. 17, p. 180               |
| Control loop oscillating          | PID gain too high             | Ch. 20, p. 211               |
| PID has steady-state offset       | Missing integral action       | Ch. 20, p. 211               |
| PID overshoots massively          | Integral windup               | Ch. 20, p. 211               |
| Working with fluid systems        | Flow, pressure, hydraulics    | Ch. 20.35.1, p. 237          |
| LabVIEW VI broken                 | DAQ or code error             | Appendix (LabVIEW Reference) |
| Preparing for lab practical       | Need formula summary          | Quick Ref tables             |

## Essential Formulas Quick Reference

**Filters:**  $f_c = 1/(2\pi RC)$

**ADC Resolution:**  $\text{LSB} = V_{\text{range}}/2^n$

**SNR:**  $20 \log_{10}(V_s/V_n)$  dB

**Max ADC SNR:**  $6.02n + 1.76$  dB

**Nyquist:**  $f_s > 2f_{\text{max}}$  (practical:  $\geq 10\times$ )

**FFT Resolution:**  $\Delta f = f_s/N$

**Alias:**  $f_{\text{alias}} = |f - n \cdot f_s|$

**Non-inv. amp:**  $G = 1 + R_f/R_g$

**INA gain:**  $G = 1 + 2R/R_G$

**Bridge (quarter):**  $\Delta V = V_{ex} \cdot (\Delta R/R)/4$

**First-order:**  $f_{-3\text{dB}} = 1/(2\pi\tau)$

**Bandwidth  $\times$  rise time:**  $\approx 0.35$

**Uncertainty (RSS):**  $u_R = \sqrt{\sum (\partial f / \partial x_i)^2 u_i^2}$

**Std. error:**  $s_{\bar{x}} = s/\sqrt{n}$

**PID:**  $u = K_p e + K_i \int e dt + K_d de/dt$

# First Week Survival Guide

---

If this is your first day in MEGN 300, start here:

1. **Read Chapter 1** (Fundamentals of Measurement Theory). Focus on the five-block system and sensor terminology.
2. **Read Chapter 17** (Systematic Debugging). Read it *before* you build your first circuit, not after it fails.
3. **Read the LabVIEW appendix**. Familiarize yourself with DAQmx, essential VIs, and the “Common Mistakes” checklist.
4. **Review the Laboratory Safety chapter** (page 1). You cannot enter the lab without understanding electrical safety.
5. **Practice**: open LabVIEW, drop a DAQmx Read VI, wire it to a Waveform Chart in a While Loop with a 100 ms Wait, and run it with the NI USB-6001. If you can read one voltage channel, you are ready for Lab 1.

## Do Not Read This Document Cover to Cover

This is a 200+ page reference. Use the “What Should I Be Reading Right Now?” triage guide to find exactly the section you need for each module.

## Also Read Before Your First Lab

The “Why Instrumentation Projects Fail” chapter (page 189) consolidates the ten most common failure modes from six years of MEGN 300 projects. Ten minutes of reading it now saves hours of debugging later.



# Modern Tools and AI Use Policy

---

Generative AI tools (ChatGPT, GitHub Copilot, Claude, Gemini) are part of the modern engineering toolkit. MEGN 300 uses a tiered policy distinguishing AI as a learning accelerator from AI as an integrity violation.

## The Traffic Light Framework

### GREEN — Always permitted:

Asking AI to explain a concept. Asking for help interpreting an error message. Using AI to review your writing for grammar after you have written it. Asking AI to explain a datasheet parameter. Using AI-generated study questions to test your own knowledge.

### YELLOW — Permitted with disclosure:

Using AI to generate a code skeleton that you then modify, understand, and can explain line by line. Asking AI for a starting approach to a design problem. Using AI to debug code you wrote, provided you understand the fix. Note “AI-assisted” on any deliverable where AI contributed substantive content.

### RED — Never permitted (academic integrity violation):

Submitting AI-generated code, analysis, or writing as your own. Having AI write your lab report, uncertainty analysis, or design justification. Copying AI-generated LabVIEW block diagrams without understanding them. Using AI to generate data or plots you did not collect. Using AI during exams or practicals unless explicitly authorized.

Figure 1: AI usage policy: green (always permitted), yellow (permitted with disclosure), red (never permitted).

## The Mastery Test

The boundary between Green/Yellow and Red: **Can you do it without the AI?** If AI helped you write a PID controller, you should be able to rebuild it from a blank VI, explaining every wire. If you cannot, the AI did the learning, not you. The lab practical exams test exactly this.

### AI-Generated Code Is Not Verified Code

AI tools produce plausible code that may contain subtle errors: wrong DAQmx configurations, incorrect filter coefficients, PID gain signs causing positive feedback, or timing assumptions mismatched to your hardware. **Never trust AI-generated code without testing against known inputs.** Treat AI output like a colleague’s suggestion: verify independently before using it in a system controlling real hardware.

### Why This Policy Exists

In professional practice, you will use AI tools. But you will be the engineer of record who signs the drawing and certifies the test result. If you cannot verify what the AI produced, you cannot take responsibility for it. MEGN 300 builds the foundational skills that let you use AI as a *force multiplier* rather than a *crutch*. The difference matters when the system you designed controls a 400 V battery thermal management system and a faulty sensor reading could trigger a thermal runaway event.

# Laboratory Safety and Equipment Care

---

## Your Safety Is Non-Negotiable

The MEGN 300 laboratory contains electrical equipment capable of causing injury, fire, and equipment damage. Every student must understand and follow the safety practices in this chapter before working with any equipment. No measurement, no deadline, and no grade justifies taking a safety shortcut.

## Electrical Safety Fundamentals

### Voltage and Current Hazards

The human body has a resistance of approximately  $1\text{ k}\Omega$ – $100\text{ k}\Omega$  depending on skin moisture and contact pressure. At these resistances:

**Below 30 V DC / 25 V AC:** generally considered safe for dry skin contact. Most MEGN 300 circuits operate in this range. However, wet hands or broken skin can reduce body resistance to  $\sim 500\text{ }\Omega$ , making even low voltages dangerous.

**30–48 V DC:** can produce a painful shock and involuntary muscle contraction. Muscle contraction can prevent you from releasing the conductor (“let-go threshold” is approximately 10–20 mA depending on the individual).

**Above 48 V DC / 30 V AC:** potentially lethal. Cardiac fibrillation can occur at currents as low as 75 mA through the heart. AC is more dangerous than DC at equivalent voltages because it causes sustained muscle contraction and interferes with the heart’s electrical rhythm.

**Above 240 V:** arc flash hazard. An electrical arc can form across air gaps, producing temperatures exceeding  $10,000\text{ }^{\circ}\text{C}$  and intense UV radiation. Arc flash causes severe burns and blindness.

#### The One-Hand Rule

When working on energized circuits above 30 V, keep one hand in your pocket or behind your back. If you touch a live conductor with one hand while the other hand (or any other part of your body) is grounded, current flows through your chest and across your heart. If only one hand contacts the conductor, current flows through that hand only, which is painful but far less likely to be fatal.

### Working with Benchtop Power Supplies

The benchtop DC power supply is the most commonly used piece of equipment in the lab. It provides adjustable voltage (0–30 V typical) and current-limited output. Safe practices:

**Before connecting:** set the voltage to zero and the current limit to the minimum. Turn the output OFF. Connect your circuit. Verify the connections visually (polarity, no shorts). Only then turn the output ON and slowly increase the voltage to the desired level while monitoring the current.

**Current limiting:** always set the current limit before applying voltage. The current limit protects both your circuit and the power supply. For initial testing of a new circuit: set the current

limit to 50% of the expected operating current. If the supply immediately hits the current limit, something is wrong (short circuit, reversed polarity, component failure). Turn off, investigate, and fix before increasing the limit.

**Never exceed rated voltage:** each component in your circuit has a maximum voltage rating. A 16 V electrolytic capacitor exposed to 20 V will bulge, leak, and potentially explode. Know the voltage ratings of every component and set the supply accordingly.

**Capacitor discharge:** when you turn off the power supply, capacitors in your circuit retain charge. A 1000  $\mu\text{F}$  capacitor charged to 12 V stores  $E = \frac{1}{2}CV^2 = 0.072 \text{ J}$ , sufficient to produce a painful spark and damage sensitive components. After power-off, verify that the supply voltage reads zero before touching the circuit. For high-capacitance circuits: add a discharge resistor or use a shorting wire (with appropriate current-limiting resistor) to safely discharge.

**Multiple supplies:** when using two supplies to create a bipolar supply (+15 V and -15 V), connect the negative terminal of the positive supply to the positive terminal of the negative supply at a single point (the system ground). Never connect the outputs in parallel unless the supplies are specifically designed for parallel operation; imbalanced outputs will fight each other, potentially damaging both.

## Working with Digital Multimeters (DMMs)

The DMM is the most fundamental measurement tool. Safe and accurate use requires:

**Select the correct function:** voltage (V), current (A), or resistance ( $\Omega$ ). Measuring current in voltage mode (probes in the voltage jacks but the selector on current) is harmless. Measuring voltage in current mode (probes in the current jacks while measuring voltage) creates a dead short through the DMM's low-impedance current shunt, blowing the internal fuse and potentially damaging the circuit. **Always verify the probe jacks match the selected function before connecting.**

**Current measurement:** current is measured in series (the DMM must be in the current path). To measure current: turn off the circuit, break the circuit at the point of interest, insert the DMM in series, turn on the circuit. Never connect the DMM's current jacks across a voltage source; this creates a short circuit through the DMM's  $<1 \Omega$  current shunt. The fuse may blow (best case) or the DMM may be damaged (worst case).

**Resistance measurement:** measure resistance only on de-energized circuits. Resistance measurement injects a small current from the DMM's battery; if the circuit is powered, the external voltage overwhelms the DMM's measurement signal and produces meaningless readings (or damages the DMM).

**Probe safety:** inspect probe insulation before each use. Cracked or worn insulation can expose the conductor, creating a shock hazard. Replace damaged probes immediately. When measuring high voltages ( $>30 \text{ V}$ ): hold the probes by their insulated handles, not near the tips.

**Auto-range vs. manual range:** auto-ranging is convenient but slow (the DMM cycles through ranges to find the right one). For steady-state measurements: auto-range is fine. For observing rapidly changing values: select the range manually to avoid the display flickering between ranges.

## Working with Oscilloscopes

The oscilloscope's ground clip is connected directly to earth ground through the power cord. This creates a safety hazard when measuring circuits that are not ground-referenced:

**The ground clip IS ground:** never connect the oscilloscope's ground clip to anything other than the circuit's ground. Connecting it to a non-ground point creates a short circuit from that

point to earth ground through the oscilloscope's ground wire. This can damage the circuit, the oscilloscope, or both, and can create a shock hazard.

**Differential measurement:** to measure the voltage between two non-ground points, use the oscilloscope's math function (Ch1 – Ch2) with each channel referenced to ground. Alternatively, use a differential probe.

**Probe compensation:** oscilloscope probes have a compensation adjustment (a small trimmer capacitor). Before making critical measurements, connect the probe to the oscilloscope's calibration output (1 kHz square wave) and adjust the trimmer until the square wave has flat tops and sharp corners (no overshoot, no rounding). An uncompensated probe can introduce 5–20% amplitude error and distort the waveform shape.

## Working with NI DAQ Equipment

**Input voltage limits:** the NI USB-6001 analog inputs are rated for  $\pm 10$  V with respect to the AI ground. Exceeding this range (applying 15 V to an AI pin) can damage the ADC permanently. Before connecting any signal, measure it with a DMM and verify it is within the DAQ's input range.

**Output current limits:** the digital outputs can provide approximately 3–5 mA per pin. Do not drive LEDs, relays, or motors directly from the digital outputs; use a transistor or MOSFET driver (Chapter 13).

**USB ground:** the DAQ's ground is connected to the computer's USB ground, which is connected to earth ground through the computer's power supply. Be aware of this ground path when connecting to external circuits, especially those with their own ground reference.

**Software crashes during acquisition:** if LabVIEW crashes or the VI is stopped abruptly during a continuous acquisition, the DAQ may retain its last output state (digital outputs stay high, analog outputs stay at last voltage). Include a “cleanup” routine that sets all outputs to safe states when the VI stops (use the “Error” wire to trigger cleanup even on abnormal termination).

**ESD protection:** the DAQ's analog inputs are sensitive to electrostatic discharge (ESD). Before handling the DAQ or connecting wires: touch a grounded metal surface to discharge static. In dry winter conditions (Colorado humidity < 20%), ESD voltages can exceed 10 kV, easily damaging semiconductor inputs.

## Fire Safety

**Lithium battery fires:** LiPo batteries can enter thermal runaway (self-sustaining exothermic reaction) if overcharged, short-circuited, or physically damaged. The resulting fire produces toxic fluorine gas and cannot be extinguished with water. Containment: a LiPo fire bag or a metal container with sand. Prevention: never charge unattended, always use a BMS, inspect for swelling before each use, and never puncture or crush.

**Soldering iron safety:** the soldering iron tip reaches 350–400 °C. It can ignite paper, plastic, and clothing on contact. Always return the iron to its holder when not in use. Never leave a powered iron unattended. Keep the work area clear of flammable materials. The fumes from rosin flux are an irritant; use a fume extractor or work in a ventilated area.

**Overheated components:** a component dissipating more power than it can shed (wrong resistor value, short circuit, insufficient heatsinking) becomes a burn hazard. If a component is too hot to touch (> 60 °C), turn off the circuit and investigate. A burning smell indicates a component is being destroyed; turn off immediately.

## Personal Protective Equipment (PPE)

**Safety glasses:** required whenever soldering, cutting, drilling, or working with pressurized fluids. Flying solder, metal chips, and fluid spray can cause permanent eye damage.

**ESD wrist strap:** required when handling bare PCBs, ICs, and the DAQ. Connect the strap to a grounded point. This maintains your body at ground potential, preventing ESD damage to components.

**Closed-toe shoes:** required in the lab at all times. Dropped tools, hot solder, and sharp components can injure exposed feet.

## Equipment Care and Lab Etiquette

**Power down before leaving:** turn off all power supplies, soldering irons, and instruments when you leave the lab. Verify that no equipment is left energized.

**Clean your workspace:** return all tools, probes, and cables to their designated locations. Dispose of wire clippings, solder debris, and failed components in the appropriate bins (electronics waste, not regular trash).

**Report damage immediately:** if you damage equipment (blown fuse, broken probe, cracked display), report it to the TA or instructor immediately. Do not hide the damage or leave it for the next group to discover.

**Respect shared equipment:** do not modify shared instruments (change probe tips, alter settings). If you need a specific configuration, set it for your session and restore the default before leaving.

**No food or drink at the lab bench:** liquids can short-circuit exposed electronics, and crumbs attract pests. Keep food and drink at the designated area away from equipment.

# Part I

## Measurement Fundamentals

# Chapter 1

## Fundamentals of Measurement Theory

---

### When to Read This Chapter

**Module 1 (Weeks 1–2):** Read the full chapter. This is the vocabulary foundation for the entire course. Sections on accuracy vs. precision, systematic vs. random error, and the measurement system model are referenced in every subsequent module. **Related:** Static calibration in Chapter 2 (p. 16); error propagation in Chapter 4 (p. 39).

### 1.1 What Is a Measurement?

A measurement is the process of assigning a numerical value to a physical quantity by comparing it to a standard. Every measurement has three components: (1) a **measurand** (the physical quantity being measured; e.g., temperature, pressure, strain), (2) a **sensor** (the device that converts the measurand into a signal; e.g., thermocouple, strain gauge, LVDT), and (3) a **measurement system** (the complete chain from sensor through signal conditioning, data acquisition, and display or storage).

No measurement is perfect. Every measured value contains the true value plus error:

$$x_{\text{measured}} = x_{\text{true}} + \epsilon_{\text{systematic}} + \epsilon_{\text{random}} \quad (1.1)$$

The goal of instrumentation engineering is to minimize both error components through careful sensor selection, system design, calibration, and signal processing.

### 1.2 The Generalized Measurement System

Every measurement system, from a mercury thermometer to a satellite telemetry chain, follows the same functional architecture:

1. **Sensing Element:** converts the measurand into an intermediate signal (often electrical). Examples: thermocouple (temperature  $\rightarrow$  voltage), strain gauge (strain  $\rightarrow$  resistance change), photodiode (light intensity  $\rightarrow$  current).
2. **Signal Conditioning:** modifies the sensor output for compatibility with the data acquisition system. Operations include amplification, filtering, linearization, bridge excitation, and impedance matching.
3. **Data Acquisition (DAQ):** converts the conditioned analog signal into a digital representation. Key parameters: sampling rate, resolution (bits), input range, and number of channels.
4. **Data Processing:** applies mathematical operations to the digital data: calibration equations, unit conversion, filtering, averaging, FFT, and statistical analysis.



5. **Data Presentation:** displays results to the user (screen, chart, indicator) or stores them (file, database) or transmits them (network, telemetry).

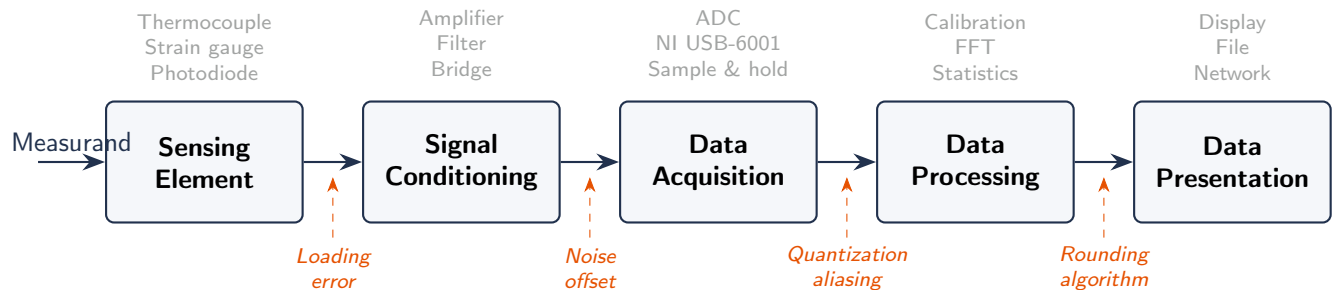


Figure 1.1: The five-block generalized measurement system with error sources (orange, dashed) entering at each interface. The total system uncertainty is the RSS combination of all contributions.

#### Requirements Mapping: Measurement System to Shall-Statements

Each block in the measurement chain generates testable requirements:

- “Measure temperature to  $\pm 0.5^\circ\text{C}$ ”  $\rightarrow$  SENS-REQ: Sensor accuracy  $\leq \pm 0.3^\circ\text{C}$ ; COND-REQ: Signal conditioning error  $\leq \pm 0.1^\circ\text{C}$ ; DAQ-REQ: ADC resolution contributes  $\leq \pm 0.1^\circ\text{C}$ .
- Error budgets must be allocated across the chain so that the RSS (root-sum-square) total meets the system requirement.

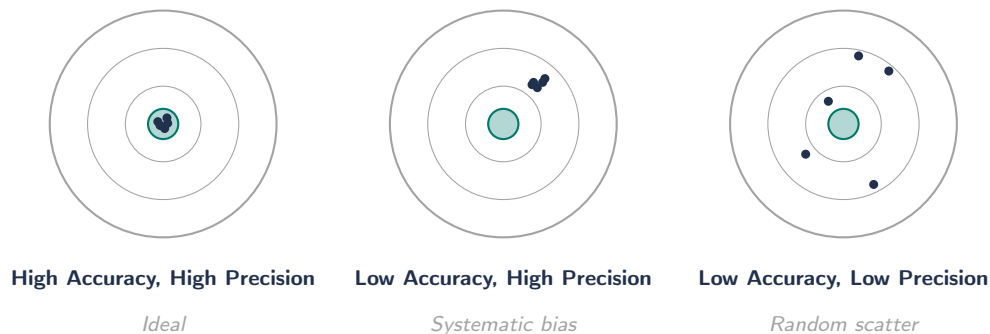


Figure 1.2: Accuracy vs. precision: the dartboard analogy. High precision with low accuracy (center) indicates systematic bias correctable by calibration. Low precision (right) requires averaging or a better sensor.

#### Industry Insight:

From Lab Bench to Electric Vehicle Test Cell The five-block measurement architecture is not an academic abstraction. In DOE vehicle energy analysis programs and NREL fleet testing, engineers instrument vehicles with hundreds of channels following exactly this architecture: CAN bus sensors feeding signal conditioning boards, high-speed DAQ systems, real-time processing pipelines, and terabyte-scale storage. The measurement system design principles you learn in MEGN 300 scale directly from the lab bench to a 400 V EV powertrain test cell or a grid-scale battery energy storage system. The error budgets, grounding practices, and signal

conditioning chains are identical in concept; only the voltage levels, channel counts, and safety requirements change.

## 1.3 Sensor Classification

### 1.3.1 By Energy Source

**Active sensors** (self-generating) produce an electrical output from the measurand's energy without external excitation. Examples: thermocouples (Seebeck effect), piezoelectric sensors (mechanical stress  $\rightarrow$  charge), photovoltaic cells.

**Passive sensors** require external excitation (voltage or current) and change an electrical property (resistance, capacitance, inductance) in response to the measurand. Examples: RTDs, strain gauges, thermistors, capacitive pressure sensors.

### 1.3.2 By Output Signal

**Analog:** output is a continuous voltage or current proportional to the measurand. Requires ADC for digital processing.

**Digital:** output is a discrete digital word (e.g., I2C, SPI, frequency output). Eliminates the ADC step but shifts the conversion inside the sensor.

### 1.3.3 By Measurand Type

Temperature (thermocouples, RTDs, thermistors, IR), pressure (diaphragm, piezoelectric, capacitive), force/torque (strain gauge, load cell), displacement (LVDT, potentiometer, encoder, laser), flow (turbine, orifice, ultrasonic, Coriolis), acceleration (MEMS, piezoelectric).

## 1.4 Sensor Terminology

| Term          | Definition                                                                                        |
|---------------|---------------------------------------------------------------------------------------------------|
| Range         | Span of measurand values the sensor can measure (e.g., 0–100 °C)                                  |
| Span          | Algebraic difference between upper and lower range limits                                         |
| Sensitivity   | Output change per unit input change ( $S = \Delta y / \Delta x$ ); slope of the calibration curve |
| Resolution    | Smallest detectable change in the measurand                                                       |
| Accuracy      | Closeness of measured value to true value (includes systematic + random)                          |
| Precision     | Closeness of repeated measurements to each other (random error only)                              |
| Linearity     | Maximum deviation from a best-fit straight line, expressed as % of full scale                     |
| Hysteresis    | Difference in output for the same input depending on approach direction                           |
| Repeatability | Variation among successive measurements under identical conditions                                |
| Drift         | Change in output over time with constant input (zero drift and sensitivity drift)                 |
| Response time | Time to reach a specified percentage (63.2% or 95%) of final value after step input               |

Table 1.1: Essential sensor terminology.

**Accuracy vs. Precision**

A sensor can be precise but inaccurate (consistent readings that are all wrong by the same amount, i.e., a systematic bias). Calibration corrects accuracy. Averaging improves precision. You need both.

## 1.5 Transducer Operating Principles

Every sensor exploits a physical phenomenon to convert the measurand into a signal. The most important principles in mechanical engineering instrumentation:

### 1.5.1 Resistive

A change in the measurand produces a change in electrical resistance. Examples: strain gauges (resistance changes with deformation; gauge factor  $GF = (\Delta R/R)/\epsilon \approx 2$  for metal foil), RTDs (resistance increases linearly with temperature;  $R(T) = R_0[1 + \alpha(T - T_0)]$  where  $\alpha \approx 0.00385^\circ\text{C}^{-1}$  for Pt100), thermistors (resistance changes exponentially with temperature; NTC type: resistance decreases as temperature increases), and potentiometers (resistance proportional to wiper position).

### 1.5.2 Thermoelectric

A temperature difference between two junctions of dissimilar metals generates a voltage (Seebeck effect). Type K (chromel-alumel):  $41\ \mu\text{V}/^\circ\text{C}$ , range  $-200$  to  $+1260^\circ\text{C}$ . Type T (copper-constantan):  $43\ \mu\text{V}/^\circ\text{C}$ , range  $-200$  to  $+350^\circ\text{C}$ . Requires a **reference junction** at a known temperature (ice point or electronic cold-junction compensation).

### 1.5.3 Piezoelectric

Mechanical stress on certain crystals (quartz, PZT ceramics) generates an electric charge proportional to the applied force. Used in accelerometers, pressure sensors, and force sensors. The charge decays over time, so piezoelectric sensors cannot measure static quantities; they are inherently AC-coupled (dynamic measurements only).

### 1.5.4 Capacitive

A change in plate spacing, overlap area, or dielectric constant changes the capacitance:  $C = \epsilon A/d$ . Used in MEMS pressure sensors (diaphragm deflection changes  $d$ ), proximity sensors, humidity sensors (dielectric changes with moisture), and MEMS accelerometers.

### 1.5.5 Inductive and Electromagnetic

LVDTs (Linear Variable Differential Transformers) measure displacement by changing the coupling between a primary and two secondary coils. Excellent linearity, infinite resolution (analog output), and robust construction. Tachometers generate a voltage proportional to rotational speed via electromagnetic induction.

## 1.6 Loading Effects

Connecting a sensor to a circuit can change the quantity being measured. The sensor draws energy from the measurand, potentially altering it.

**Electrical loading:** a voltmeter with input impedance  $Z_m$  measuring a source with output impedance  $Z_s$  reads:

$$V_{\text{measured}} = V_{\text{true}} \times \frac{Z_m}{Z_m + Z_s} \quad (1.2)$$

To keep the loading error below 1%, require  $Z_m > 100 \times Z_s$ . This is why buffer amplifiers (Chapter 12) are essential for high-impedance sensors.

**Thermal loading:** inserting a temperature probe into a small fluid volume changes the fluid temperature. The probe absorbs or releases heat until it equilibrates. In small samples, this thermal mass effect can be significant.

### The 100:1 Impedance Rule

For voltage measurements, the measuring instrument's input impedance should be at least 100 times the source impedance. For current measurements, the instrument's impedance should be less than 1/100 of the circuit impedance. Violating this rule introduces loading errors that corrupt your data.

## 1.7 Sensor Selection Methodology

Choosing the right sensor is the single most consequential decision in instrumentation system design. A poor choice propagates through the entire signal chain and cannot be corrected downstream. The selection process follows a systematic hierarchy of constraints.

### 1.7.1 Step 1: Define the Measurand and Environment

Before evaluating any sensor, define exactly what physical quantity you need to measure and the conditions under which the measurement will occur. Key questions include: what is the expected range of the measurand (minimum to maximum value with margin)? What is the required measurement bandwidth (how fast does the quantity change)? What is the operating environment (temperature extremes, humidity, vibration, chemical exposure, electromagnetic interference)? What mounting constraints exist (size, weight, access)?

### 1.7.2 Step 2: Accuracy and Resolution Requirements

The system-level accuracy requirement (e.g., “measure temperature to  $\pm 1.0^\circ\text{C}$ ”) must be decomposed into an error budget allocated across the measurement chain. The sensor typically receives the largest allocation (50–70% of the total variance budget) because it is the first element and its errors are amplified by subsequent stages. Resolution must be at least 5–10 $\times$  finer than the required accuracy to avoid quantization-dominated measurements.

### 1.7.3 Step 3: Dynamic Response Requirements

If the measurand changes rapidly, the sensor's bandwidth must exceed the signal bandwidth. For first-order sensors, the  $-3\text{ dB}$  frequency must be at least  $5\times$  the highest signal frequency to keep amplitude error below 1%. For second-order sensors (accelerometers, pressure transducers), the flat

response band extends to approximately  $0.2 \times \omega_n$  for a damping ratio of  $\zeta = 0.65$ . Beyond this frequency, the sensor's output amplitude becomes unreliable.

#### 1.7.4 Step 4: Interface Compatibility

The sensor's output must be compatible with the signal conditioning and DAQ hardware. Key considerations include output type (voltage, current, resistance, frequency, digital bus), output level (millivolts for thermocouples vs. volts for integrated sensors), output impedance (high impedance sources require buffer amplifiers), power supply requirements (excitation voltage and current), and wiring configuration (2-wire, 3-wire, or 4-wire for resistance sensors).

#### 1.7.5 Step 5: Cost, Availability, and Reliability

In production systems, sensor cost, lead time, second-source availability, and mean time between failures (MTBF) are critical. In MEGN 300 projects, cost and availability from common distributors (Digi-Key, Mouser, SparkFun, Adafruit) dominate. Always verify that the sensor has a clear, complete datasheet before committing to a design.

##### WE ThermoRig: Sensor Selection Rationale

For the ThermoRig temperature measurement system, we select a Type K thermocouple based on the following analysis: the temperature range (ambient to  $200^\circ\text{C}$ ) falls within Type K's range ( $-200$  to  $+1260^\circ\text{C}$ ). The required accuracy ( $\pm 2.2^\circ\text{C}$  or  $\pm 0.75\%$ , whichever is greater per ASTM E230 Standard tolerance) is adequate for our  $\pm 1.0^\circ\text{C}$  system requirement after calibration reduces the error to  $\pm 0.3^\circ\text{C}$ . The thermocouple is self-generating (no excitation needed), has a fast response time when using exposed-junction construction ( $\tau < 0.5\text{ s}$  in moving air), is extremely rugged, and costs less than \$5. The tradeoff: the output is tiny (approximately  $41\ \mu\text{V}/^\circ\text{C}$ ), requiring high-gain amplification with excellent common-mode rejection, which we address in Chapter 12.

## 1.8 Measurement System Design Process

The complete design process for an instrumentation system proceeds through six phases:

**Phase 1: Requirements Definition.** Write formal “shall” statements specifying range, accuracy, resolution, bandwidth, sample rate, output format, environmental limits, and interface requirements. These flow from the system-level measurement objectives.

**Phase 2: Sensor Selection and Error Budgeting.** Select the sensor technology, allocate the accuracy budget across chain elements, and verify by RSS analysis that the total system uncertainty meets the requirement.

**Phase 3: Signal Conditioning Design.** Design the amplification, filtering, bridge excitation, and any linearization required to present the sensor signal in the DAQ's input range (typically  $0$ – $5\text{ V}$  or  $\pm 10\text{ V}$ ). Choose component values to minimize noise while maintaining the required bandwidth.

**Phase 4: DAQ Configuration.** Select the sampling rate (at least  $10\times$  the signal bandwidth), bit resolution (sufficient that quantization noise is below the sensor noise floor), input mode (differential for millivolt signals, single-ended for volt-level signals), and input range (smallest range that encompasses the conditioned signal to maximize effective resolution).

**Phase 5: Software Implementation.** Implement the data acquisition loop, real-time calibration equations, digital filtering, display, logging, and any control algorithms in LabVIEW. Verify

timing (loop rate, buffer management) and data integrity.

**Phase 6: Calibration and Validation.** Calibrate the complete system against known standards. Compare measured values to reference instruments across the full operating range. Calculate the actual measurement uncertainty and verify it meets the requirements.

### The Five Questions Every Engineer Asks

Before designing any measurement system, answer these five questions: (1) What am I measuring? (2) How accurately? (3) How fast is it changing? (4) What environment will it operate in? (5) What do I do with the data? The answers to these five questions determine every subsequent design decision.

## 1.9 Units, Standards, and Traceability

All measurements must be traceable to national or international standards. In the United States, the National Institute of Standards and Technology (NIST) maintains primary measurement standards. Traceability means an unbroken chain of calibrations connecting your measurement to the national standard, with documented uncertainties at each step.

The International System of Units (SI) defines seven base units: meter (length), kilogram (mass), second (time), ampere (electric current), kelvin (temperature), mole (amount of substance), and candela (luminous intensity). All other units are derived from these seven. In instrumentation, the most commonly encountered derived units include pascal (pressure,  $\text{Pa} = \text{N}/\text{m}^2$ ), hertz (frequency,  $\text{Hz} = 1/\text{s}$ ), volt ( $\text{V} = \text{W}/\text{A}$ ), and ohm ( $\Omega = \text{V}/\text{A}$ ).

Calibration certificates from accredited laboratories (ISO/IEC 17025) provide the legal basis for measurement traceability. In industrial metrology, calibration intervals are set based on historical drift data, criticality of the measurement, and regulatory requirements. A common starting interval is 12 months, adjusted based on observed stability.

### Significant Figures and Reporting

Never report a measurement with more significant figures than the uncertainty justifies. If your system uncertainty is  $\pm 0.5^\circ\text{C}$ , reporting “ $23.472^\circ\text{C}$ ” is misleading; correct reporting is “ $23.5 \pm 0.5^\circ\text{C}$ ” or equivalently “ $23.5(5)^\circ\text{C}$ .” The number of decimal places in the reported value should match the number of decimal places in the uncertainty.

## 1.10 Signal Types and Their Characteristics

Understanding the nature of the signal produced by a sensor is essential for designing the rest of the measurement chain.

**DC signals** are constant or very slowly varying (temperature from an RTD, pressure from a strain gauge bridge). They require high-accuracy, low-noise amplification and are susceptible to  $1/f$  noise and drift. Typical signal conditioning: instrumentation amplifier with low offset voltage, followed by a low-pass filter with cutoff at 1–10 Hz.

**AC signals** vary periodically or quasi-periodically (vibration, acoustic pressure, alternating current). The frequency content carries the information. Signal conditioning emphasizes bandwidth, phase linearity, and noise rejection in the signal band. AC-coupled amplifiers (with a high-pass input filter) reject DC offset and low-frequency drift.

**Transient signals** are short-duration events (impact force, shock wave, spark discharge). They contain energy spread across a wide frequency band. The measurement system must have sufficient bandwidth to capture the fastest features and sufficient dynamic range to capture both the peak and the fine structure. Triggering (starting the acquisition at the moment of the event) is critical.

**Pulse signals** are digital or quasi-digital (encoder outputs, frequency-output sensors, PWM signals). They carry information in timing (period, duty cycle, edge count) rather than amplitude. Signal conditioning focuses on edge detection, debouncing, and accurate timing measurement.

## 1.11 Sensor Specifications: What the Numbers Mean

Datasheet specifications often confuse students because they use different reference conditions, definitions, and statistical bases. Key clarifications:

**Full Scale Output (FSO)** is the algebraic difference between the output at maximum and minimum measurand values. Many error specifications are expressed as a percentage of FSO. A sensor with 0.1% FSO accuracy on a 0–1000 psi range has  $\pm 1$  psi error at every point in the range, whether measuring 10 psi or 990 psi. This means the relative error at low readings is very large (10% at 10 psi).

**Best Fit Straight Line (BFSL) linearity** expresses nonlinearity as the maximum deviation from a least-squares line through the calibration data. This is the most common specification and the most optimistic. **End-point linearity** uses the line connecting the zero and full-scale points, which is more conservative and more representative of actual use.

**Temperature coefficient** specifies how much a parameter (offset, gain, accuracy) changes per degree of temperature change, typically in ppm/°C or %/°C. A 50 ppm/°C gain drift on a 200 °C temperature excursion produces a  $50 \times 200 \times 10^{-6} = 1\%$  gain error. This can dominate the error budget in environments with large temperature swings.

**Long-term stability (drift)** describes how much the output changes over months or years with constant input. Precision sensors specify drift rates of 0.01–0.1%/year. For field instruments recalibrated annually, long-term drift contributes to the total uncertainty.

## 1.12 Sensor Failure Modes

Understanding how sensors fail helps you design robust systems:

**Open circuit:** the sensor connection breaks (wire fatigue, corrosion, connector failure). The measurement reads full-scale or rail voltage. Detection: check for readings at the ADC limit.

**Short circuit:** two conductors contact (insulation failure, moisture, conductive contamination). The measurement reads zero or a fixed offset. Detection: check for stuck-at-zero readings.

**Drift:** gradual change in sensitivity or offset due to aging, contamination, or mechanical creep. The measurement appears valid but is increasingly wrong. Detection: periodic recalibration against a reference standard.

**Saturation:** the measurand exceeds the sensor's range. The output clips at the maximum value, losing the true peak information. Detection: check for readings at or near the full-scale output.

**Intermittent:** loose connections or cracked solder joints cause sporadic noise spikes or dropouts. Often vibration-dependent. Detection: monitor for statistical outliers in the data stream.



**Design for Diagnosability**

Include self-diagnostic features in your measurement system: range checking (flag readings at ADC limits), rate-of-change checking (flag physically impossible jumps), and periodic reference checks (measure a known voltage to verify the signal chain is functioning). These cost nothing to implement in software and can save hours of debugging.

## 1.13 Measurement in the Engineering Design Process

Measurements serve different purposes at different project phases, and understanding this shapes how you design your measurement system:

**Concept phase:** measurements are exploratory. You need rough data to understand the design space and make go/no-go decisions. Accuracy requirements are loose ( $\pm 10\%$ ); speed and convenience matter more. Use handheld instruments, default DAQ settings, and minimal signal conditioning.

**Detailed design phase:** measurements validate models and characterize components. Accuracy tightens ( $\pm 1\text{--}5\%$ ). Calibration becomes important. Use dedicated signal conditioning, proper anti-alias filtering, and documented calibration procedures.

**Verification and validation phase:** measurements prove the system meets its requirements. Accuracy is dictated by the requirement specifications. Full calibration, documented uncertainty analysis, and traceable reference standards are mandatory. The measurement uncertainty must be less than  $1/4$  of the specification tolerance (4:1 TAR).

**Production and field phase:** measurements monitor ongoing performance and detect degradation. Emphasis shifts to reliability, automated data collection, and statistical process control. Measurement systems must be robust to operator variation (Gauge R&R).

## 1.14 Common Measurement Mistakes in Student Projects

Based on a decade of MEGN 300 lab experience, the most frequent measurement mistakes are:

- (1) **No anti-alias filter:** aliased noise corrupts the data, producing unexplained frequency components. Fix: always include an analog LP filter before the ADC.
- (2) **Wrong input mode:** using RSE (single-ended) for millivolt signals, allowing ground offsets and 60 Hz to corrupt the measurement. Fix: use Differential for all signals  $< 100\text{ mV}$ .
- (3) **Wasting ADC range:** measuring a  $0\text{--}2\text{ V}$  signal on a  $\pm 10\text{ V}$  range, losing 3+ bits of effective resolution. Fix: match the signal conditioning gain to use 80–90% of the ADC range.
- (4) **No calibration:** reporting raw sensor output as the measurement, without calibrating against a reference standard. Fix: always calibrate and apply the calibration equation.
- (5) **No uncertainty analysis:** reporting “ $T = 23.47^\circ\text{C}$ ” without stating the uncertainty. Fix: every measurement must include an uncertainty statement.
- (6) **Ignoring sensor dynamics:** measuring a fast-changing quantity with a slow sensor and reporting the attenuated value as correct. Fix: verify that the sensor bandwidth exceeds the signal bandwidth by  $5\times$ .

## 1.15 Practice Questions

1. Draw the five-block generalized measurement system for measuring the vibration of a rotating shaft. Identify a specific sensor, signal conditioning operation, DAQ device, processing step,



and output format for each block.

2. A pressure sensor has a range of 0–500 psi, an output of 0–5 V, and a stated accuracy of  $\pm 0.25\%$  FS. What is the sensitivity? What is the maximum error in psi?
3. Explain the difference between accuracy and precision using a dartboard analogy. A sensor has high precision but low accuracy. What type of error dominates, and how do you fix it?
4. A thermocouple (active sensor) and an RTD (passive sensor) both measure temperature. Explain the fundamental difference in how they produce their output signals. Which requires external excitation and why?
5. Your measurement system must measure temperature to  $\pm 1.0^\circ\text{C}$ . Allocate an error budget across the sensor, signal conditioning, and DAQ stages such that the RSS total meets the requirement.

### 1.15.1 Answers

1. Sensor: accelerometer (e.g., ADXL345 MEMS). Signal conditioning: charge amplifier + low-pass filter at 1 kHz. DAQ: NI USB-6001 at 10 kS/s, 14-bit. Processing: FFT to identify dominant vibration frequencies. Output: frequency spectrum plot in LabVIEW with peak frequency and amplitude annotations.
2. Sensitivity  $S = 5\text{ V}/500\text{ psi} = 0.01\text{ V/psi} = 10\text{ mV/psi}$ . Accuracy  $= \pm 0.25\% \times 500 = \pm 1.25\text{ psi}$  (or equivalently  $\pm 12.5\text{ mV}$ ).
3. Precise but inaccurate = all darts clustered together but off-center. Systematic error dominates. Fix: calibrate against a known standard and apply a correction offset (or curve).
4. A thermocouple generates a voltage from the Seebeck effect at the junction of two dissimilar metals; no external power is needed. An RTD changes resistance with temperature but produces no voltage on its own; it requires an excitation current (typically 1 mA) passed through the element, and the voltage drop is measured to calculate resistance, then converted to temperature.
5. Example allocation: Sensor:  $\pm 0.6^\circ\text{C}$ , Signal conditioning:  $\pm 0.5^\circ\text{C}$ , DAQ (quantization + noise):  $\pm 0.5^\circ\text{C}$ .  $\text{RSS} = \sqrt{0.6^2 + 0.5^2 + 0.5^2} = \sqrt{0.86} = 0.93^\circ\text{C} < 1.0^\circ\text{C}$ . Meets requirement.

## Chapter 2

# Static Measurements

### When to Read This Chapter

**Module 1 (Weeks 1–2):** Read alongside the calibration lab. Focus on the calibration procedure, least-squares regression, and the sensor comparison table. Return to the Wheatstone bridge section when you encounter strain gauges in Module 7. **Related:** Measurement fundamentals in Chapter 1 (p. 6); dynamic response in Chapter 3 (p. 28).

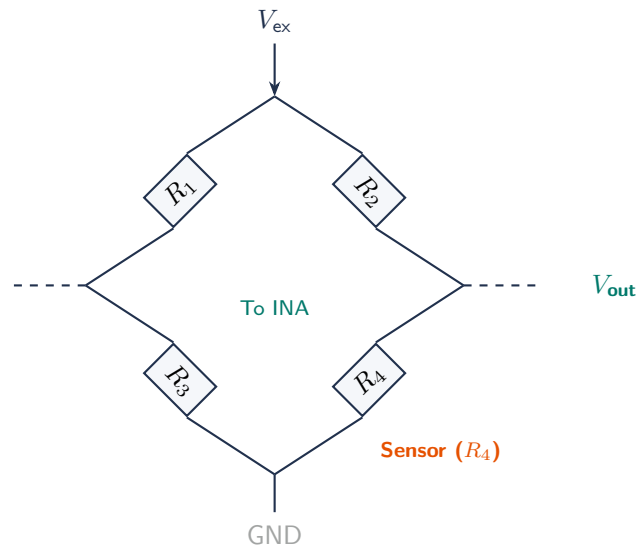


Figure 2.1: Wheatstone bridge circuit.  $R_4$  is the sensor element (e.g., RTD or strain gauge). When balanced ( $R_1 R_4 = R_2 R_3$ ),  $V_{out} = 0$ . A change in sensor resistance produces a differential output proportional to  $\Delta R/R$ , measured by an instrumentation amplifier.

## 2.1 Static Calibration

Static calibration determines the relationship between the sensor input (measurand) and output (signal) under steady-state conditions, where the measurand is not changing with time. The calibration process produces a **calibration curve**: a plot or equation mapping input to output.

### 2.1.1 The Calibration Process

1. Apply a series of known, stable input values spanning the sensor's range, using a **calibration standard** with accuracy  $\geq 4\times$  better than the sensor under test (4:1 Test Accuracy Ratio, per

ANSI/NCSL Z540.3).

2. Record the sensor output at each input value. Allow sufficient settling time at each point.
3. Apply inputs in both increasing and decreasing order to detect hysteresis.
4. Repeat the entire sequence at least 3 times to assess repeatability.
5. Fit a calibration equation (linear, polynomial, or piecewise) to the data.
6. Calculate residuals (measured – predicted) and report maximum error.

### 2.1.2 Linear Calibration

Most sensors are designed to be approximately linear over their operating range:

$$y = mx + b \quad (2.1)$$

where  $y$  = sensor output,  $x$  = measurand,  $m$  = sensitivity (slope), and  $b$  = zero offset (intercept). The sensitivity  $m$  and offset  $b$  are determined by least-squares regression on the calibration data.

### 2.1.3 Nonlinear Calibration

Some sensors are inherently nonlinear (e.g., thermistors:  $R = R_0 e^{\beta(1/T - 1/T_0)}$ ). For these, use a polynomial fit ( $y = a_0 + a_1x + a_2x^2 + \dots$ ) or a lookup table with interpolation. The Steinhart-Hart equation provides a three-coefficient model for thermistors that is accurate to  $\pm 0.01^\circ\text{C}$  over wide ranges.

#### WE ThermoRig: Static Calibration of a Type K Thermocouple

Calibration standard: NIST-traceable ice point ( $0.0^\circ\text{C}$ ) and boiling point ( $100.0^\circ\text{C}$  at local altitude, corrected for barometric pressure in Golden, CO:  $\approx 95.0^\circ\text{C}$  at 5,675 ft elevation). Additional points at  $25^\circ\text{C}$  and  $50^\circ\text{C}$  using a calibrated water bath.

Calibration equation (linear fit):  $T = 24.98 \times V_{mV} + 0.15^\circ\text{C}$ . Residuals: max  $\pm 0.8^\circ\text{C}$  over  $0$ – $95^\circ\text{C}$  range. With a second-order polynomial: max residual drops to  $\pm 0.3^\circ\text{C}$ .

## 2.2 Static Characteristics

### 2.2.1 Sensitivity

Sensitivity  $S$  is the slope of the calibration curve:

$$S = \frac{\partial y}{\partial x} \approx \frac{\Delta y}{\Delta x} \quad (2.2)$$

Units: output units per input unit (e.g.,  $\text{mV}/^\circ\text{C}$ ,  $\Omega/\text{kPa}$ ). A higher sensitivity produces a larger output change for a given input change, improving resolution and signal-to-noise ratio. For a linear sensor, sensitivity is constant. For a nonlinear sensor, sensitivity varies with the operating point.

### 2.2.2 Linearity

Linearity error is the maximum deviation of the calibration curve from a reference straight line, expressed as a percentage of full-scale output (FSO):

$$\text{Linearity} = \frac{\max |y_{\text{actual}} - y_{\text{line}}|}{\text{FSO}} \times 100\% \quad (2.3)$$

Three definitions of the reference line exist: **end-point** (connects the zero and full-scale points), **best-fit** (least-squares line through all data), and **independent** (best-fit line not constrained to pass through zero). The independent best-fit method gives the smallest linearity error and is most common in datasheets.

### 2.2.3 Hysteresis

Hysteresis is the difference in output between the up-sweep (increasing input) and the down-sweep (decreasing input) at the same input value. Causes include mechanical friction, magnetic remanence, and thermal lag. Expressed as % FSO:

$$\text{Hysteresis} = \frac{\max |y_{\text{up}} - y_{\text{down}}|}{\text{FSO}} \times 100\% \quad (2.4)$$

### 2.2.4 Resolution and Threshold

**Resolution** is the smallest input change that produces a detectable output change. For analog sensors, resolution is limited by noise. For digital sensors, resolution is set by the least significant bit (LSB). **Threshold** is the minimum input required to produce any output at all (relevant for sensors with a dead zone near zero).

### 2.2.5 Drift

**Zero drift** (offset drift) is a change in the output at zero input over time or with temperature changes. **Sensitivity drift** (span drift) is a change in the slope of the calibration curve. Temperature is the most common cause of both. Drift is specified in units per °C or units per year.

#### Recalibrate Regularly

Drift means your calibration degrades over time. Establish a recalibration interval based on the manufacturer's stability specification and the accuracy requirements of your application. For student lab instruments, recalibrate at the start of each semester. For critical measurements, recalibrate before every test series.

## 2.3 Bridge Circuits

The Wheatstone bridge is the most important circuit in resistive sensor instrumentation. It converts small resistance changes into measurable voltage changes with excellent sensitivity and inherent temperature compensation.

### 2.3.1 The Wheatstone Bridge

Four resistors arranged in a diamond pattern with excitation voltage  $V_{ex}$  applied across one diagonal and the output voltage  $V_o$  measured across the other:

$$V_o = V_{ex} \left( \frac{R_1}{R_1 + R_2} - \frac{R_3}{R_3 + R_4} \right) \quad (2.5)$$

When the bridge is balanced ( $R_1/R_2 = R_3/R_4$ ),  $V_o = 0$ . A small change  $\Delta R$  in one arm produces:

$$\Delta V_o \approx \frac{V_{ex}}{4} \cdot \frac{\Delta R}{R} \quad (\text{quarter-bridge})^1 \quad (2.6)$$

### 2.3.2 Bridge Configurations

**Quarter-bridge:** one active gauge, three fixed resistors. Simplest; output proportional to strain. Sensitive to temperature unless a dummy gauge is used in an adjacent arm.

**Half-bridge:** two active gauges in adjacent arms. Doubles sensitivity and provides automatic temperature compensation if both gauges experience the same temperature.

**Full-bridge:** four active gauges. Quadruples sensitivity, provides full temperature compensation, and rejects bending strains (if configured for axial measurement). Used in commercial load cells.

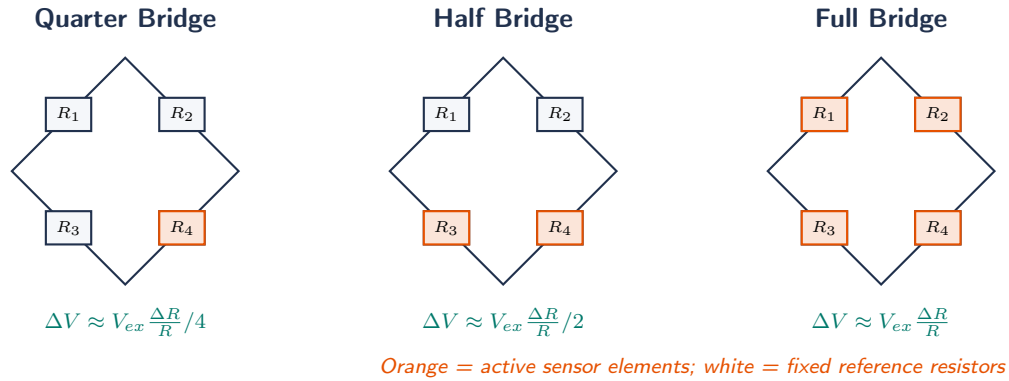


Figure 2.2: Wheatstone bridge configurations. Sensitivity doubles with each step: quarter-bridge (1 active element), half-bridge (2), full-bridge (4). Full bridge also provides complete temperature compensation.

#### WE ThermoRig: RTD in a Wheatstone Bridge

A Pt100 RTD ( $R_0 = 100.0 \Omega$  at  $0^\circ\text{C}$ ,  $\alpha = 0.00385^\circ\text{C}^{-1}$ ) is placed in a quarter-bridge with  $V_{ex} = 5.0 \text{ V}$  and three  $100.0 \Omega$  precision resistors. At  $25^\circ\text{C}$ :  $R_{RTD} = 100(1 + 0.00385 \times 25) = 109.6 \Omega$ . Bridge output:

$$V_o = 5.0 \times (109.6/(109.6 + 100) - 100/(100 + 100)) = 5.0 \times (0.5229 - 0.5000) = 114.5$$

mV. Sensitivity:  $114.5 \text{ mV} / 25^\circ\text{C} = 4.58 \text{ mV}/^\circ\text{C}$ .

Self-heating check: bridge current through RTD  $= V_{ex}/(2R) \approx 25 \text{ mA}$ . Power dissipated in RTD  $= I^2 R = 0.025^2 \times 110 = 0.069 \text{ W}$ . Self-heating coefficient for a Pt100 in still air  $\approx 0.5^\circ\text{C}/\text{mW}$

<sup>1</sup>This is the linearized approximation, valid for  $\Delta R/R \ll 1$  (i.e., strains below  $\sim 5000 \mu\epsilon$ ). The exact expression is  $\Delta V_o = V_{ex} \cdot (\Delta R/R)/(4 + 2\Delta R/R)$ , which matters for large strains or for high-accuracy absolute strain measurement.

→ self-heating error =  $0.069 \times 0.5 = 0.035^\circ\text{C}$ . Acceptable for  $\pm 0.5^\circ\text{C}$  accuracy, but reduce  $V_{ex}$  to 1 V for higher precision.

## 2.4 Calibration Standards and Traceability

A calibration is only as good as the reference standard. **Traceability** means the calibration chain can be traced back to a national or international standard through an unbroken series of comparisons, each with documented uncertainty.

- **Primary standards:** defined by fundamental physics (triple point of water =  $273.16\text{ K}$  exactly; NIST maintains primary standards for all SI units).
- **Secondary/transfer standards:** calibrated against primary standards. Used by calibration laboratories.
- **Working standards:** calibrated against secondary standards. Used in the lab to calibrate sensors.
- **Test Accuracy Ratio (TAR):** the standard should be  $\geq 4\times$  more accurate than the device under test (4:1 TAR per ANSI/NCSL Z540.3).

## 2.5 Fundamentals of Calibration

Calibration establishes the relationship between sensor output and true measurand value by applying known reference stimuli. Without calibration, a sensor's output is a raw electrical signal with no physical meaning.

### 2.5.1 Calibration Standards and Traceability

The reference standard must be at least  $4\times$  more accurate than the sensor under calibration (4:1 test accuracy ratio). Common standards: ice-point baths ( $0.000^\circ\text{C} \pm 0.002^\circ\text{C}$ ), dead-weight testers (pressure), precision decade resistors, certified mass sets. All standards must be traceable to NIST through an unbroken chain of documented calibrations.

### 2.5.2 Static Calibration Procedure

(1) Thermal equilibrium (15+ minutes after power-on). (2) Apply 5–7 known inputs spanning the full range. (3) Record sensor output at each. (4) Repeat sweep in reverse (detect hysteresis). (5) Repeat 3–5 times (quantify repeatability). (6) Fit calibration curve. (7) Calculate residuals and report uncertainty.

### 2.5.3 Linear vs. Polynomial Calibration

For linear sensors (RTDs, LVDTs):  $y = mx + b$  via least-squares regression. Sensitivity  $m$  and offset  $b$ . For nonlinear sensors (thermistors, wide-range thermocouples): polynomial  $y = a_0 + a_1x + a_2x^2 + \dots + a_nx^n$  using LabVIEW's General Polynomial Fit VI. Report the goodness-of-fit  $R^2$ .

**Do Not Extrapolate Beyond Calibration Range**

A calibration curve is valid only within the range of inputs used to generate it. Beyond this range, the sensor may saturate, exhibit unexpected nonlinearity, or produce physically meaningless outputs. Always recalibrate over a wider range if measurements approach the boundaries.

**WE ThermoRig: Type K Thermocouple Calibration**

Five calibration points: ice bath (0 °C), room temperature (23 °C from NIST-traceable reference), warm water at 50 °C, 75 °C, and boiling water (100 °C adjusted for altitude:  $T_{bp} = 100 - 0.037(760 - P_{mmHg})$ ). At each point, 100 samples (10 s at 10 S/s), mean computed. Linear fit:  $T = 24.12 \times V_{mV} + 0.31$ ,  $R^2 = 0.9998$ , max residual 0.28 °C. Calibration uncertainty:  $\pm 0.3$  °C (95% confidence).

## 2.6 The Wheatstone Bridge in Detail

### 2.6.1 Bridge Theory

Four resistors in a diamond, excitation voltage  $V_{ex}$  across one diagonal, output  $V_o$  across the other. For balanced bridge (all  $R$  equal):  $V_o = 0$ . With one arm changed by  $\Delta R$  (quarter bridge):

$$V_o \approx \frac{V_{ex}}{4} \cdot \frac{\Delta R}{R} \quad (\Delta R \ll R) \quad (2.7)$$

### 2.6.2 Bridge Nonlinearity

The exact output:  $V_o = (V_{ex}/4) \cdot (\Delta R/R)/(1 + \Delta R/(2R))$ . For  $\Delta R/R = 1\%$ : 0.5% nonlinearity. For 10%: 5%. Half and full bridges cancel this.

### 2.6.3 Lead Wire Compensation

Remote sensors add series lead resistance that offsets and desensitizes the bridge. Three-wire connection: adds equal lead resistance to adjacent arm, canceling the effect. Four-wire (Kelvin): eliminates lead resistance entirely using separate current and voltage pairs.

## 2.7 Signal Conditioning for Static Measurements

**Amplification:** INA maps bridge output ( $\pm 10$  mV typical) to DAQ range. For  $\pm 10$  mV to  $\pm 5$  V:  $G = 500$ .

**Anti-alias filtering:** LP filter at 10–100 Hz for static measurements removes wideband noise.

**Excitation regulation:** bridge sensitivity is proportional to  $V_{ex}$ . Use precision voltage reference (e.g., REF5050 for 5.000 V  $\pm 0.05\%$ ), not a bench supply.

**Self-Heating in Resistance Sensors**

Excitation current through RTDs/thermistors generates Joule heating ( $P = I^2 R$ ) raising sensor temperature above the measurand. For Pt100 at 1 mA: 0.1–1 °C self-heating depending on thermal coupling. Use the minimum excitation current that produces a measurable voltage.

## 2.8 Traceability and Measurement Audit Trail

Every calibration must be documented: date/time, reference standard (certificate number, expiration), environmental conditions (ambient T, humidity), raw data, calibration equation with coefficients, residuals and uncertainty, operator name. Include calibration records in your engineering logbook and reference them in reports.

## 2.9 Advanced Calibration Techniques

### 2.9.1 Multi-Point Calibration with Uncertainty Bands

For high-accuracy applications, calibrate at 10–20 points across the range. At each point, acquire enough samples ( $N \geq 30$ ) to compute the mean and standard deviation. Plot the calibration curve with  $\pm 2\sigma$  uncertainty bands. Any point where the measurement falls outside the band indicates a problem (sensor nonlinearity, environmental interference, or reference standard error).

### 2.9.2 In-Situ Calibration

When possible, calibrate the sensor in its actual operating environment (mounted in the test fixture, wired to the DAQ, with the same cable lengths and routing). This captures installation effects (strain from mounting, thermal coupling, EMI environment) that a bench calibration misses. For the ThermoRig, this means calibrating the thermocouple while it is installed in the thermal specimen holder, not on the bench.

### 2.9.3 Two-Point vs. Multi-Point Calibration

A two-point calibration (zero and span) assumes the sensor is linear and only corrects for offset and gain errors. This is adequate for sensors with specified linearity better than the required accuracy. For sensors with significant nonlinearity (thermistors, some pressure sensors), multi-point calibration with polynomial fitting is necessary. The polynomial order should be the minimum that reduces residuals below the target accuracy; overfitting (too high an order) creates oscillations between calibration points.

## 2.10 Resistance Measurement Techniques

Many sensors are resistive (strain gauges, RTDs, thermistors, potentiometers). Measuring resistance accurately requires careful technique.

### 2.10.1 Two-Wire Measurement

The simplest method: pass a known current through the sensor and measure the voltage across it. Problem: the voltage includes the drop across the lead wires ( $V = I(R_{\text{sensor}} + 2R_{\text{lead}})$ ). For a Pt100 RTD ( $R = 100\ \Omega$ ) with 10 m of 24 AWG copper wire ( $R_{\text{lead}} = 0.85\ \Omega$  per wire), the lead resistance is  $1.7\ \Omega$ , a 1.7% error that changes with temperature (copper has  $\alpha = 0.00393/^{\circ}\text{C}$ ).

### 2.10.2 Three-Wire Measurement

Adds a third wire to sense the voltage at the far end of one lead. The bridge circuit uses the third wire to compensate for lead resistance in one arm. This cancels the lead resistance to first order



(assumes both leads have equal resistance). Accuracy improves from 1.7% to approximately 0.05% (limited by lead resistance mismatch).

### 2.10.3 Four-Wire (Kelvin) Measurement

The gold standard: separate pairs of wires carry the excitation current and sense the voltage. The voltage sense wires carry negligible current, so their resistance does not affect the measurement. The measured voltage is exactly  $V = I \times R_{\text{sensor}}$ , independent of lead resistance. Required for precision RTD measurements (<0.01% accuracy) and any sensor more than a few meters from the DAQ.

## 2.11 Signal Conditioning Chain Design

The complete signal conditioning chain from sensor to ADC must be designed as an integrated system. Key design decisions and their interactions:

**Gain allocation:** if total gain of 1000 is needed, splitting it as  $100 \times 10$  (first stage  $\times$  second stage) is better than  $1000 \times 1$  because: (1) the first stage amplifies the signal above the noise floor of the second stage, (2) each stage operates at lower gain, reducing the impact of gain error and bandwidth limitations, and (3) the anti-alias filter can be placed between stages at an intermediate voltage level.

**Filter placement:** the anti-alias filter should be placed after the last amplification stage and immediately before the ADC. This ensures the filter operates on a signal with good SNR (already amplified) and that no noise is added after filtering.

**Power supply sequencing:** if the signal conditioning circuit is powered from the same supply as the actuators (heaters, motors), power supply transients from actuator switching can inject noise into the signal chain. Use separate, filtered power supplies for analog and digital/power circuits.

### WE ThermoRig: Complete Measurement Uncertainty Budget

The final ThermoRig measurement system, after calibration, has the following uncertainty contributors at the 80 °C operating point:

Thermocouple calibration residual:  $\pm 0.28$  °C (from 5-point linear fit).

Cold junction compensation:  $\pm 0.10$  °C (from the AD595 CJC IC accuracy).

INA128 gain error:  $\pm 0.05\% \times 80$  °C =  $\pm 0.04$  °C.

INA128 offset:  $50 \mu\text{V} \times 611$  gain = 30.5 mV, equivalent to  $\pm 0.01$  °C after calibration.

ADC quantization:  $\pm 0.5$  LSB =  $\pm 0.15$  mV  $\rightarrow$   $\pm 0.004$  °C (negligible).

Total (RSS):  $\sqrt{0.28^2 + 0.10^2 + 0.04^2 + 0.01^2 + 0.004^2} = 0.30$  °C.

This meets the  $\pm 0.5$  °C system requirement with 40% margin. The thermocouple calibration dominates the budget; improving the ADC would have no measurable effect.

## 2.12 Strain Measurement in Detail

Strain gauges are the most common resistive sensor in mechanical engineering. A metal foil gauge bonded to a structure changes resistance proportionally to strain:

$$\frac{\Delta R}{R} = GF \times \epsilon \quad (2.8)$$

where  $GF$  (gauge factor) is approximately 2.0 for metal foil gauges and  $\epsilon$  is the mechanical strain (dimensionless, typically expressed in microstrain,  $\mu\epsilon = 10^{-6}$ ).

For a typical strain of  $1000 \mu\epsilon$  ( $= 0.1\%$ ):  $\Delta R/R = 2.0 \times 0.001 = 0.2\%$ . For a  $120 \Omega$  gauge:  $\Delta R = 0.24 \Omega$ . In a quarter-bridge with  $10 \text{ V}$  excitation:  $\Delta V = 10 \times 0.002/4 = 5 \text{ mV}$ . This tiny signal requires careful amplification and noise rejection.

### 2.12.1 Gauge Installation

The quality of the gauge bond determines measurement accuracy. Clean the surface with solvent (acetone, then isopropanol). Abrade lightly with 320-grit sandpaper. Apply a thin, uniform layer of cyanoacrylate (strain gauge cement). Position the gauge and clamp for 60 seconds. Verify electrical continuity ( $R = 120 \pm 0.5 \Omega$  for a  $120 \Omega$  gauge). Any air bubble, misalignment, or excess adhesive degrades the measurement.

### 2.12.2 Temperature Compensation

Thermal expansion of the structure and the gauge causes apparent strain that is not due to mechanical loading. A quarter-bridge on a steel beam sees approximately  $23 \mu\epsilon/^\circ\text{C}$  from thermal effects alone. The half-bridge compensates: mount two gauges on the same material; one active (in the strain field), one passive (nearby but unstrained). Temperature affects both equally, canceling in the bridge output. Note that compensation is effective only if both gauges are at the same temperature; a temperature gradient across the structure (e.g., near a heat source) will produce a differential thermal signal that the bridge cannot distinguish from mechanical strain.

## 2.13 Sensor Fusion and Redundancy

When a single sensor cannot meet the accuracy or reliability requirement, combining multiple sensors improves performance. **Homogeneous redundancy**: multiple identical sensors measuring the same quantity, with outputs averaged to reduce random noise by  $\sqrt{N}$ . Also provides fault detection: if one sensor deviates significantly from the others, it is likely faulty. **Heterogeneous fusion**: combining different sensor types (e.g., thermocouple for fast response + RTD for accuracy). A Kalman filter or complementary filter can combine them optimally, using each sensor's strengths.

In MEGN 300 projects, the simplest form of sensor fusion is comparing your primary measurement to an independent check instrument (reference thermometer, multimeter, calibrated pressure gauge). This does not improve your primary measurement but validates it.

## 2.14 Environmental Effects on Static Measurements

Temperature affects virtually every component in the measurement chain. Strain gauge resistance changes with temperature (apparent thermal strain). Op-amp offset voltage drifts (typically  $1\text{--}10 \mu\text{V}/^\circ\text{C}$ ). Resistor values drift ( $25\text{--}100 \text{ ppm}/^\circ\text{C}$  for metal film). ADC reference voltage drifts ( $1\text{--}50 \text{ ppm}/^\circ\text{C}$ ).

For outdoor or industrial measurements, design for the full expected temperature range. Compute the worst-case drift for each component and include it in the error budget. For laboratory measurements, controlling the ambient temperature to  $\pm 2^\circ\text{C}$  (typical HVAC) usually keeps thermal effects negligible.

Humidity affects: capacitive sensors directly; high-impedance circuits (leakage currents across PCB surfaces); and hygroscopic materials (some strain gauge adhesives absorb moisture, causing drift). Conformal coating protects PCBs in humid environments.

## 2.15 Data Logging Best Practices

Static measurements often run for hours, days, or weeks. Data integrity requires: (1) timestamp every sample with a real-time clock (not just sample count), (2) log raw data (before calibration equations) so you can recalibrate offline, (3) flush data to disk periodically (every 1–10 s) to prevent data loss on power failure, (4) include metadata in the file header (sensor type, calibration date, DAQ settings, operator name), (5) use binary file formats (TDMS, HDF5) for large datasets rather than CSV (which is 3–10× larger).

## 2.16 Advanced Bridge Techniques

### 2.16.1 AC Bridge Excitation

For high-impedance sensors (semiconductor strain gauges, capacitive sensors), AC excitation offers advantages over DC: (1) eliminates thermoelectric offset voltages (thermocouples at connections produce DC errors that are rejected by AC demodulation), (2) enables capacitive and inductive measurements (which require AC), and (3) allows the use of transformer coupling for galvanic isolation.

The bridge is excited with a sine wave (typically 1–10 kHz), and the output is demodulated (multiplied by the excitation waveform and low-pass filtered) to extract the DC component proportional to the measurand. This is essentially lock-in detection applied to the bridge, providing excellent noise rejection.

### 2.16.2 Auto-Balancing Bridge

In a conventional bridge, the output voltage is proportional to  $\Delta R/R$ , but also depends on the excitation voltage  $V_{ex}$ . An **auto-balancing** (or servo-balanced) bridge uses a feedback loop to drive the bridge output to zero by adjusting a reference element. The value of the reference element at balance equals the unknown sensor resistance. This technique eliminates the nonlinearity of the unbalanced bridge and removes sensitivity to excitation voltage variations. Commercial LCR meters and precision resistance bridges use this technique.

## 2.17 Sensor Selection: Decision Matrix

For temperature measurement, the choice among thermocouple, RTD, thermistor, and IC sensor involves multiple tradeoffs:

The selection depends on the application priority: if you need to measure above 300 °C, only thermocouples and RTDs are options. If you need 0.01 °C resolution, the thermistor's 4%/°C sensitivity is best. If you need simple, no-conditioning interface: the IC sensor outputs mV directly, readable by any ADC.

| Property          | Thermocouple                    | RTD (Pt100)                   | Thermistor       | IC (LM35)          |
|-------------------|---------------------------------|-------------------------------|------------------|--------------------|
| Range             | −200 to +1260 °C                | −200 to +850                  | −40 to +300      | −55 to +150        |
| Accuracy (uncal.) | ±2.2 °C                         | ±0.3 °C                       | ±0.2 °C          | ±0.5 °C            |
| Sensitivity       | 41 $\mu\text{V}/^\circ\text{C}$ | 0.385 $\Omega/^\circ\text{C}$ | −4%/°C           | 10 mV/°C           |
| Linearity         | Fair                            | Excellent                     | Poor             | Excellent          |
| Response time     | 0.1–10 s                        | 1–50 s                        | 0.1–10 s         | 1–5 s              |
| Self-heating      | None                            | Yes (excitation)              | Yes (excitation) | Yes (bias current) |
| Cost              | \$1–\$10                        | \$10–\$50                     | \$1–\$5          | \$1–\$3            |

Table 2.1: Temperature sensor comparison. Thermocouples excel in range and speed; RTDs in accuracy; thermistors in sensitivity; IC sensors in ease of use.

## 2.18 Calibration Transfer Standards

When your reference standard cannot be brought to the measurement location (e.g., an ice-point bath cannot be used in a vibration test cell), a **transfer standard** bridges the gap. The transfer standard is calibrated against the primary reference in the lab, then transported to the field and used to calibrate the working sensor.

The transfer standard must be more stable than accurate: it does not need to hold an exact value, but the value must not change between calibration and use. For temperature: a precision platinum RTD in a protective housing, calibrated to  $\pm 0.05^\circ\text{C}$ , stable to  $\pm 0.01^\circ\text{C}/\text{year}$ . For voltage: a precision voltage reference (Fluke 732A), stable to  $\pm 1 \text{ ppm}/\text{year}$ .

## 2.19 Practice Questions

1. A pressure sensor is calibrated with the following data: (0 psi, 0.02 V), (100 psi, 1.01 V), (200 psi, 2.03 V), (300 psi, 2.98 V), (400 psi, 4.02 V), (500 psi, 4.99 V). Calculate the sensitivity and linearity error (% FSO) using the end-point line.
2. A thermistor has the Steinhart-Hart coefficients  $A = 1.125 \times 10^{-3}$ ,  $B = 2.347 \times 10^{-4}$ ,  $C = 0.856 \times 10^{-7}$  (all in  $\text{K}^{-1}$ ). The measured resistance is 10.0 k $\Omega$ . Calculate the temperature in  $^\circ\text{C}$ .
3. During calibration of a load cell, the readings during the up-sweep and down-sweep at 250 N are 2.48 mV/V and 2.53 mV/V respectively. Full-scale output is 3.00 mV/V. Calculate the hysteresis as % FSO.
4. Your measurement system has a 12-bit ADC with a  $\pm 5 \text{ V}$  input range. What is the voltage resolution (LSB)? If the sensor sensitivity is 10 mV/°C, what is the temperature resolution?

### 2.19.1 Answers

1. End-point line: slope =  $(4.99 - 0.02)/(500 - 0) = 9.94 \text{ mV}/\text{psi}$ , intercept = 0.02 V. Predicted at each point: 0.02, 1.014, 2.008, 3.002, 3.996, 4.99. Residuals: 0, −0.004, 0.022, −0.022, 0.024, 0. Max |residual| = 0.024 V. FSO = 4.97 V. Linearity =  $0.024/4.97 \times 100 = 0.48\%$  FSO. Sensitivity = 9.94 mV/psi.

2.

$$1/T = A + B \ln R + C(\ln R)^3 = 1.125 \times 10^{-3} + 2.347 \times 10^{-4} \times \ln(10000) + 0.856 \times 10^{-7} \times (\ln 10000)^3$$

$$\ln(10000) = 9.2103.$$

$$1/T = 1.125 \times 10^{-3} + 2.161 \times 10^{-3} + 6.69 \times 10^{-5} = 3.353 \times 10^{-3}$$

$$T = 298.2 \text{ K} = 25.1^\circ\text{C}.$$

$$3. \text{ Hysteresis} = |2.53 - 2.48|/3.00 \times 100 = 1.67\% \text{ FSO}.$$

$$4. \text{ LSB} = 10 \text{ V}/2^{12} = 10/4096 = 2.44 \text{ mV}. \text{ Temperature resolution} = 2.44 \text{ mV}/10 \text{ mV}/^\circ\text{C} = 0.244^\circ\text{C}.$$

#### ✓ Mastery Diagnostic:

Static Measurements To demonstrate mastery of this module, you must be able to:

1. Perform a multi-point static calibration: collect  $\geq 5$  points, fit a curve, compute maximum residual.
2. Calculate sensitivity ( $S = \partial y / \partial x$ ) from calibration data.
3. Configure and balance a Wheatstone bridge for a quarter-bridge RTD measurement.
4. Report a calibrated measurement with uncertainty, reference traceability, and valid range.
5. Identify systematic errors in a calibration procedure and explain mitigation.

# Chapter 3

## Dynamic Measurements

### When to Read This Chapter

**Module 2 (Weeks 3–4):** Read the full chapter. The first-order time constant and frequency response sections are critical for the dynamic response lab. The second-order system section is reference material for the control systems module later. **Related:** Static characteristics in Chapter 2 (p. 16); filter design in Chapter 12 (p. 123).

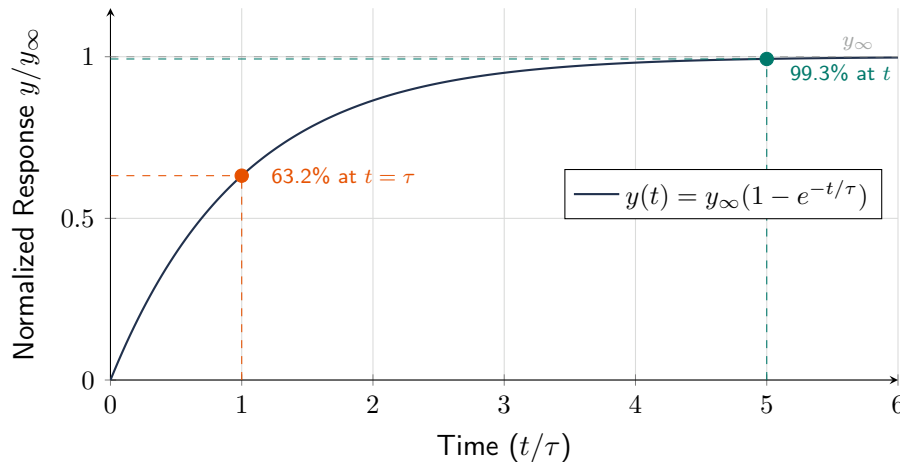


Figure 3.1: First-order step response showing the time constant ( $\tau$ ) at 63.2% and the Rule of Five ( $5\tau$ ) settling criterion at 99.3%. Wait at least  $5\tau$  before recording a steady-state measurement.

### 3.1 Why Dynamic Response Matters

Static calibration tells you the sensor's input-output relationship when the measurand is constant. But in real systems, measurands change with time: a pressure pulse, a temperature transient, a vibrating structure. A sensor's **dynamic response** determines how faithfully it tracks a time-varying input. A sensor that responds too slowly will attenuate rapid changes and introduce phase delay.

### 3.2 System Order and Models

### 3.2.1 Zero-Order Systems

Output is directly proportional to input at all times:  $y(t) = K \cdot x(t)$ . The output tracks the input instantaneously with no delay or distortion. Pure zero-order sensors are idealizations, but a wire-wound potentiometer measuring slow displacement is approximately zero-order.

### 3.2.2 First-Order Systems

Described by:

$$\tau \frac{dy}{dt} + y = K \cdot x(t) \quad (3.1)$$

where  $\tau$  is the **time constant** and  $K$  is the static sensitivity. First-order systems are characterized by a single energy storage element (e.g., thermal mass of a temperature probe).

**Step response:**  $y(t) = K \cdot x_0(1 - e^{-t/\tau})$ . After one time constant ( $t = \tau$ ), the output reaches 63.2% of its final value. After  $5\tau$ , the output is within 0.7% of final (effectively settled).

**Frequency response:** the magnitude ratio and phase are:

$$M(\omega) = \frac{K}{\sqrt{1 + (\omega\tau)^2}} \quad (3.2)$$

$$\phi(\omega) = -\arctan(\omega\tau) \quad (3.3)$$

The  $-3$  dB bandwidth (where  $M$  drops to  $K/\sqrt{2}$ ) occurs at  $\omega = 1/\tau$ , or  $f_{-3\text{dB}} = 1/(2\pi\tau)$ .

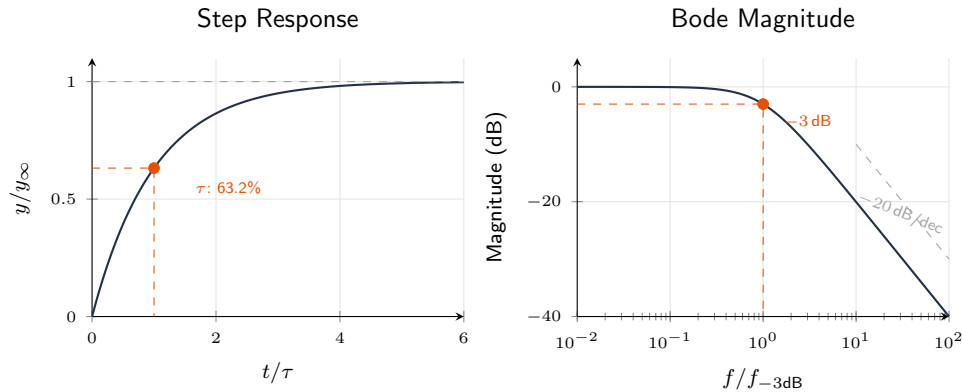


Figure 3.2: First-order system: step response (left) and Bode magnitude (right). The time constant  $\tau$  determines both settling time ( $5\tau$  to 99%) and bandwidth ( $f_{-3\text{dB}} = 1/(2\pi\tau)$ ).

#### WE ThermoRig: Time Constant of a Thermocouple

A Type K thermocouple (0.5 mm bead) plunged into boiling water responds with  $\tau \approx 0.2$  s. This means it reaches 63.2% of the temperature change in 0.2 s and settles to within 1% in  $5\tau = 1.0$  s.

For measuring a temperature that oscillates at 1 Hz:  $\omega = 2\pi$ ,  $\omega\tau = 1.26$ ,  $M = K/\sqrt{1 + 1.59} = 0.62K$ . The sensor attenuates the oscillation to 62% of its true amplitude and introduces a  $-51.6^\circ$  phase lag. The measurement significantly underreports the true oscillation.

**Lesson:** to faithfully measure a 1 Hz temperature oscillation, you need  $\tau \ll 1/(2\pi \times 1) = 0.16$  s. A finer thermocouple (0.1 mm bead,  $\tau \approx 0.01$  s) would be adequate.

### 3.2.3 Second-Order Systems

Described by:

$$\frac{1}{\omega_n^2} \frac{d^2 y}{dt^2} + \frac{2\zeta}{\omega_n} \frac{dy}{dt} + y = K \cdot x(t) \quad (3.4)$$

where  $\omega_n$  is the **undamped natural frequency** and  $\zeta$  is the **damping ratio**. Typical second-order sensors: accelerometers, pressure transducers with diaphragms, and force sensors with spring elements.

Three damping regimes: **underdamped** ( $\zeta < 1$ ): oscillatory response with overshoot; **critically damped** ( $\zeta = 1$ ): fastest non-oscillatory response; **overdamped** ( $\zeta > 1$ ): slow, no oscillation. Most practical sensors target  $\zeta \approx 0.6\text{--}0.7$  for fast response with minimal overshoot ( $< 5\%$ ).

**Frequency response** magnitude:

$$M(\omega) = \frac{K}{\sqrt{[1 - (\omega/\omega_n)^2]^2 + [2\zeta\omega/\omega_n]^2}} \quad (3.5)$$

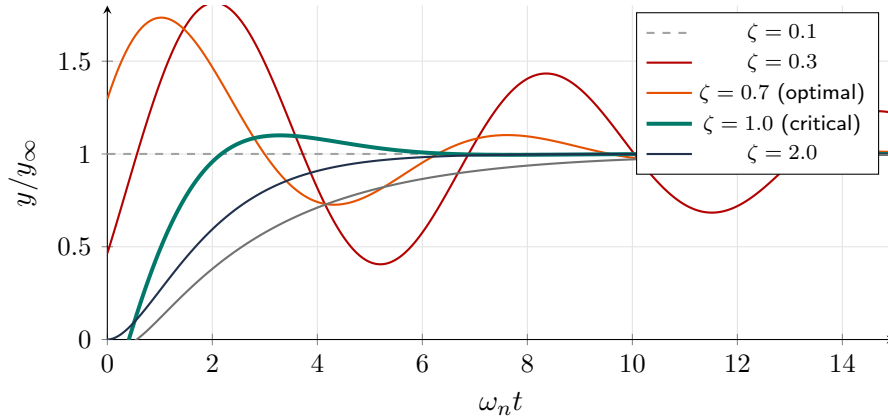


Figure 3.3: Second-order system step response for different damping ratios. The optimal range for most sensors is  $\zeta = 0.6\text{--}0.7$  (thick teal), giving fast response with minimal overshoot ( $\sim 5\%$ ).

The sensor faithfully measures frequencies up to about  $0.2\omega_n$  (flat within  $\pm 5\%$  for  $\zeta = 0.65$ ). Above  $\omega_n$ , the output rolls off at  $-40\text{ dB/decade}$ .

#### The Rule of Five

For a first-order sensor, allow  $5\tau$  settling time for each measurement point. For a second-order sensor, use the signal frequency to less than  $\omega_n/5$  to stay in the flat region. Both rules give  $< 1\%$  amplitude error.

## 3.3 Measuring Dynamic Characteristics

### 3.3.1 Step Test

Apply a sudden step change in the measurand and record the sensor output vs. time. For a first-order sensor, plot  $\ln(1 - y/y_\infty)$  vs.  $t$ ; the slope is  $-1/\tau$ . For a second-order sensor, measure



the overshoot percentage ( $M_p$ ) and peak time ( $t_p$ ) to extract  $\zeta$  and  $\omega_n$ :

$$\zeta = \frac{-\ln(M_p/100)}{\sqrt{\pi^2 + [\ln(M_p/100)]^2}}, \quad \omega_n = \frac{\pi}{t_p \sqrt{1 - \zeta^2}} \quad (3.6)$$

### 3.3.2 Frequency Response Test

Apply sinusoidal inputs at increasing frequencies and measure the output amplitude ratio and phase shift at each frequency. Plot the Bode diagram (magnitude in dB and phase in degrees vs. log frequency). This method is more thorough but requires a signal generator capable of producing sinusoidal variations in the measurand.

## 3.4 Bandwidth and Rise Time

Two related metrics describe how fast a sensor can respond:

**Bandwidth** ( $f_{-3\text{dB}}$ ): the frequency at which the amplitude response drops to  $-3\text{ dB}$  (70.7% of the DC sensitivity). For a first-order system:  $f_{-3\text{dB}} = 1/(2\pi\tau)$ . For a second-order system:  $f_{-3\text{dB}} \approx \omega_n/(2\pi)$  (exact value depends on  $\zeta$ ).

**Rise time** ( $t_r$ ): the time for the step response to go from 10% to 90% of the final value. For a first-order system:  $t_r = 2.2\tau$ . The approximate relationship between bandwidth and rise time:

$$f_{-3\text{dB}} \times t_r \approx 0.35 \quad (3.7)$$

This is a useful design rule: if you need to resolve events with a 1 ms rise time, your sensor bandwidth must be  $\geq 350\text{ Hz}$ .

## 3.5 Selecting a Sensor for Dynamic Measurements

1. Identify the highest frequency of interest in the measurand ( $f_{\text{max}}$ ).
2. Select a sensor with  $f_{-3\text{dB}} \geq 5f_{\text{max}}$  (to stay in the flat amplitude region with  $<1\%$  error).
3. Set the sampling rate  $f_s \geq 10f_{\text{max}}$  (per Chapter 9) to capture the waveform shape.
4. Place an anti-aliasing filter at  $f_c = 0.4f_s$  before the ADC.

### Requirements Mapping: Dynamic Response to Shall-Statements

- “Measure vibration up to 500 Hz”  $\rightarrow$  SENS-REQ: Sensor bandwidth  $\geq 2500\text{ Hz}$  ( $5\times$ ). DAQ-REQ: Sampling rate  $\geq 5000\text{ S/s}$  ( $10\times$ ).
- “Resolve pressure transients with 0.5 ms rise time”  $\rightarrow$  SENS-REQ: Sensor bandwidth  $\geq 700\text{ Hz}$  ( $0.35/0.0005$ ). SENS-REQ: Sensor natural frequency  $\geq 3500\text{ Hz}$  ( $5\times$  bandwidth).

## 3.6 Why Dynamic Response Matters

In static measurements, we wait for settling. In dynamic measurements, the measurand changes continuously and the sensor must track those changes. If the sensor cannot keep up, it attenuates and phase-shifts the signal, producing incorrect results.

### 3.7 Zero-Order Systems

Output instantaneously proportional to input:  $y(t) = K \cdot x(t)$ . A potentiometric sensor approximates this at low frequencies. No real sensor is truly zero-order; parasitic effects always introduce dynamics.

### 3.8 First-Order Step Response in Depth

For step input of magnitude  $A$  at  $t = 0$ :  $y(t) = KA(1 - e^{-t/\tau})$ . At  $\tau$ : 63.2%. At  $2\tau$ : 86.5%. At  $3\tau$ : 95.0%. At  $5\tau$ : 99.3% (“settled”). If  $\tau = 0.5$  s, settling takes 2.5 s.

#### 3.8.1 Frequency Response

Magnitude:  $|H| = 1/\sqrt{1 + (\omega\tau)^2}$ . Phase:  $\phi = -\arctan(\omega\tau)$ . At  $f_{-3dB} = 1/(2\pi\tau)$ : amplitude is 70.7% (29% error), phase is  $-45^\circ$ . For  $<5\%$  amplitude error: stay below  $f_{-3dB}/3$ . For  $<1\%$ : below  $f_{-3dB}/7$ .

#### 3.8.2 Measuring the Time Constant

Apply step input (plunge thermocouple into hot water). Record output vs. time. Find time at 63.2% of step change. That time is  $\tau$ . Alternatively: plot  $\ln(1 - y/y_\infty)$  vs.  $t$ ; slope is  $-1/\tau$ .

#### WE ThermoRig: Measuring Thermocouple Time Constant

Plunge Type K TC from  $23^\circ\text{C}$  air into  $80^\circ\text{C}$  stirred water bath. At 100 S/s, output reaches 63.2% of  $57^\circ\text{C}$  step (i.e.,  $59.0^\circ\text{C}$ ) at  $t = 0.42$  s. Therefore  $\tau = 0.42$  s,  $f_{-3dB} = 0.38$  Hz. For signals up to 0.05 Hz (convective heat transfer): amplitude error  $<1\%$ . For rapid thermal transients: too slow.

### 3.9 Second-Order Systems in Depth

Governing equation:  $(1/\omega_n^2)\ddot{y} + (2\zeta/\omega_n)\dot{y} + y = Kx(t)$ .

**Underdamped** ( $\zeta < 1$ ): oscillates with decaying amplitude. Damped frequency  $\omega_d = \omega_n\sqrt{1 - \zeta^2}$ . Overshoot:  $\%OS = 100 \cdot e^{-\pi\zeta/\sqrt{1-\zeta^2}}$ .

**Critically damped** ( $\zeta = 1$ ): fastest non-oscillatory approach.

**Overdamped** ( $\zeta > 1$ ): no oscillation but slower than critical.

#### 3.9.1 Frequency Response

$|H| = 1/\sqrt{[1 - (f/f_n)^2]^2 + [2\zeta(f/f_n)]^2}$ . Usable flat band:  $\sim 0.2f_n$  for  $\zeta = 0.65$ ,  $\sim 0.4f_n$  for  $\zeta = 0.7$ . This is why accelerometer datasheets specify a “useful range” that is a fraction of resonant frequency.

#### 3.9.2 The Bandwidth–Rise Time Tradeoff

$B \times t_r \approx 0.35$  where  $B$  is bandwidth (Hz) and  $t_r$  is 10–90% rise time (s). Faster sensor = wider bandwidth = more noise captured. Cannot independently improve both.

**First vs. Second-Order Model Selection**

Smooth exponential step response with no overshoot → first-order. Overshoot and ringing → second-order. Thermal sensors are typically first-order. Mechanical sensors (accelerometers, pressure transducers) are second-order.

### 3.10 Practical Implications

Rule 1: sensor bandwidth must exceed signal bandwidth by  $5\times$  minimum ( $10\times$  preferred). Rule 2: for transients, sensor rise time must be much shorter than event duration. Rule 3: in control systems, sensor phase lag directly affects stability margins.

### 3.11 Time Domain vs. Frequency Domain Characterization

Sensor dynamic behavior can be characterized in either domain. The step response (time domain) is intuitive: apply a sudden change and observe how the sensor responds. The frequency response (frequency domain) is more powerful for system design: it directly shows which frequencies the sensor can measure and which it attenuates.

The two representations are mathematically equivalent (connected by the Laplace transform), but each reveals different insights. Use the step response to evaluate settling time, overshoot, and rise time. Use the frequency response to evaluate bandwidth, resonance, and phase shift.

### 3.12 Experimental Frequency Response Measurement

To measure a sensor's frequency response experimentally: (1) Apply a sinusoidal input at frequency  $f$ . (2) Measure the input amplitude  $A_{\text{in}}$  and output amplitude  $A_{\text{out}}$ . (3) Compute the gain:  $|H(f)| = A_{\text{out}}/A_{\text{in}}$ . (4) Measure the time delay  $\Delta t$  between input and output peaks. (5) Compute the phase:  $\phi = -360 \times f \times \Delta t$  degrees. (6) Repeat at 10–20 frequencies from  $0.1f_{-3\text{dB}}$  to  $10f_{-3\text{dB}}$ , logarithmically spaced. (7) Plot the Bode diagram (gain in dB vs. log frequency; phase in degrees vs. log frequency).

For temperature sensors, generating a sinusoidal temperature input is difficult. Instead, use the step response method and extract the time constant. For mechanical sensors (accelerometers, pressure transducers), a shaker table provides calibrated sinusoidal acceleration at precise frequencies.

### 3.13 Transfer Functions

A transfer function  $G(s) = Y(s)/X(s)$  describes the input-output relationship in the Laplace domain ( $s = j\omega$ ).

First-order:  $G(s) = K/(1 + \tau s)$ . One pole at  $s = -1/\tau$ .

Second-order:  $G(s) = K\omega_n^2/(s^2 + 2\zeta\omega_n s + \omega_n^2)$ . Two poles at  $s = -\zeta\omega_n \pm \omega_n\sqrt{\zeta^2 - 1}$ .

The pole locations determine the dynamic behavior completely. Poles on the negative real axis produce exponential decay (first-order, overdamped). Complex conjugate poles produce oscillatory decay (underdamped). Poles on the imaginary axis produce sustained oscillation (critically stable). Poles on the positive real axis produce unstable (growing) response.

### 3.14 Cascaded System Response

When multiple dynamic elements are in series (sensor → amplifier → filter), the overall transfer function is the product of individual transfer functions:  $G_{\text{total}}(s) = G_1(s) \cdot G_2(s) \cdot G_3(s)$ . In the frequency domain, magnitudes multiply (or add in dB) and phases add.

Example: a thermocouple ( $\tau = 0.5$  s,  $f_{-3\text{dB}} = 0.32$  Hz) followed by a 2nd-order Butterworth filter at 10 Hz. At 0.1 Hz: thermocouple gain is  $-0.4$  dB, filter gain is  $-0.0$  dB; total is  $-0.4$  dB (acceptable). At 1 Hz: thermocouple is  $-10$  dB (the sensor, not the filter, limits performance). The system bandwidth is determined by the slowest element.

#### WE ThermoRig: Cascaded Dynamic Response

The ThermoRig signal chain dynamic response: thermocouple ( $\tau = 0.42$  s,  $f_{-3\text{dB}} = 0.38$  Hz) → INA128 ( $f_{-3\text{dB}} \approx 1.6$  kHz at  $G = 611$ , negligible lag at signal frequencies) → Sallen-Key LP ( $f_c = 40$  Hz, 2nd order, negligible lag below 4 Hz). The overall system bandwidth is limited entirely by the thermocouple at 0.38 Hz. The amplifier and filter contribute less than 0.01 dB of attenuation and less than  $0.1^\circ$  of phase shift at frequencies below 1 Hz. This is typical: in thermal measurement systems, the sensor dynamics dominate.

### 3.15 Sensor Dynamic Compensation

If the sensor's dynamic response is too slow for the measurement, mathematical compensation can partially recover the attenuated high-frequency content. For a first-order sensor with known  $\tau$ :

$$x_{\text{true}}(t) \approx y(t) + \tau \frac{dy}{dt} \quad (3.8)$$

where  $y(t)$  is the measured output and  $x_{\text{true}}(t)$  is the estimated true input. In the frequency domain, this is an inverse filter: multiply the measured spectrum by  $1 + j\omega\tau$  (the inverse of the sensor's transfer function).

Caution: dynamic compensation amplifies high-frequency noise (the derivative term). It is only practical when the sensor's bandwidth is within a factor of 2–5 of the signal bandwidth, and when the SNR at high frequencies is adequate. Beyond this, the noise amplification overwhelms the recovered signal.

### 3.16 Aliasing from Sensor Dynamics

A sensor acts as a low-pass filter. If the sensor bandwidth is less than  $f_s/2$ , it provides inherent anti-alias filtering. However, this is not deliberate and should not be relied upon. The sensor's rolloff may not be steep enough (first-order: only  $-20$  dB/decade), and the exact bandwidth may vary with operating conditions (temperature, mounting). Always include a dedicated anti-alias filter in the signal chain.

## 3.17 Measuring Sensor Time Constants: Advanced Methods

### 3.17.1 Plunge Test Details

For thermal sensors, the plunge test is the gold standard. Critical details: (1) the fluid must be well-stirred to eliminate thermal boundary layers (use a magnetic stirrer or continuous manual

agitation), (2) the fluid temperature must be uniform and known (use a calibrated reference thermometer), (3) the initial sensor temperature must be stable (allow 5 minutes of equilibration before plunging), (4) the data acquisition rate must be fast enough to capture the transient ( $f_s \geq 10/\tau$ ; for  $\tau = 0.5$  s:  $f_s \geq 20$  S/s), (5) compute  $\tau$  using the 63.2% method *and* the log-linear fit method, and compare. If they agree within 5%, the first-order model is valid.

### 3.17.2 Sinusoidal Testing

For sensors where a sinusoidal input is practical (vibration shakers for accelerometers, modulated light sources for photodetectors), sweep the input frequency from  $0.1f_{-3\text{dB}}$  to  $10f_{-3\text{dB}}$  in 20+ steps. At each frequency, measure the gain  $|H| = A_{\text{out}}/A_{\text{in}}$  and the phase lag. The Bode plot provides the complete dynamic characterization, including the order of the system and any resonance behavior.

## 3.18 Higher-Order System Dynamics

Some sensors exhibit dynamics that are neither purely first-order nor second-order. A thermocouple welded to a heavy metal block may show a fast initial response (the junction itself,  $\tau_1 \approx 0.1$  s) followed by a slow drift to final value (the block equilibrating,  $\tau_2 \approx 30$  s). This is a two-time-constant system:

$$G(s) = \frac{K}{(1 + \tau_1 s)(1 + \tau_2 s)} \quad (3.9)$$

The step response shows a fast initial rise followed by a slow creep. The dominant (larger) time constant determines the settling time; the faster time constant determines the initial response rate. In the frequency domain, there are two breakpoints on the Bode plot.

## 3.19 Sensor Bandwidth and Control System Interaction

In a feedback control system, the sensor is part of the loop. Its dynamic response affects stability. A sensor with time constant  $\tau_s$  introduces phase lag  $\phi = -\arctan(\omega\tau_s)$  at the crossover frequency. If this lag reduces the total phase margin below  $45^\circ$ , the system becomes oscillatory or unstable.

Rule of thumb: the sensor bandwidth must be at least  $5\times$  the closed-loop bandwidth. For a control system with 0.1 Hz bandwidth (10 s settling time): sensor  $f_{-3\text{dB}} \geq 0.5$  Hz ( $\tau \leq 0.32$  s). The ThermoRig thermocouple ( $\tau = 0.42$  s,  $f_{-3\text{dB}} = 0.38$  Hz) is marginally adequate; a faster thermocouple or an exposed-junction design would provide more stability margin.

## 3.20 Amplitude Ratio and Phase Measurement

When characterizing sensor dynamics experimentally, two quantities must be measured at each test frequency: the amplitude ratio  $M(\omega) = |Y|/(K|X|)$  and the phase angle  $\phi(\omega)$ .

For amplitude ratio: apply a sinusoidal input of known amplitude  $A_{\text{in}}$  at frequency  $f$ . Measure the output amplitude  $A_{\text{out}}$  after the transient has decayed (wait at least  $5\tau$  or 10 cycles, whichever is longer). The amplitude ratio is  $M = A_{\text{out}}/(K \cdot A_{\text{in}})$  where  $K$  is the static sensitivity.

For phase angle: measure the time delay  $\Delta t$  between the input and output waveforms (zero-crossing to zero-crossing, or peak to peak). The phase angle in degrees is  $\phi = -360 \cdot f \cdot \Delta t$ . For a first-order system,  $\phi$  is always negative (output lags input) and ranges from  $0^\circ$  at DC to  $-90^\circ$  at infinite frequency. For a second-order system,  $\phi$  ranges from  $0^\circ$  to  $-180^\circ$ , passing through  $-90^\circ$  at the natural frequency.

### 3.21 Practical Impact of Sensor Dynamics: Worked Examples

**Example 1: Temperature measurement during soldering.** A solder joint reaches peak temperature in approximately 2 s. A thermocouple with  $\tau = 0.5$  s reads only 86% of the peak temperature at  $t = 2$  s (missing  $\sim 40^\circ\text{C}$  if the peak is  $280^\circ\text{C}$ ). A thermocouple with  $\tau = 0.05$  s (exposed junction, 0.25 mm wire) reads 99.95% of the peak. For process control where the peak temperature must not exceed  $290^\circ\text{C}$ , the slow thermocouple could allow a  $40^\circ\text{C}$  overshoot without detection.

**Example 2: Pressure measurement in a hydraulic actuator.** The pressure oscillates at 50 Hz due to pump ripple. A pressure transducer with  $f_n = 500$  Hz ( $\zeta = 0.7$ ) has an amplitude ratio of  $M = 1/\sqrt{(1 - 0.01)^2 + (0.14)^2} = 1.005$  at 50 Hz, practically perfect. A cheaper transducer with  $f_n = 100$  Hz ( $\zeta = 0.4$ ) has  $M = 1/\sqrt{(1 - 0.25)^2 + (0.4)^2} = 1.21$  at 50 Hz, overstating the pressure by 21%. At 80 Hz, the resonance amplification makes the reading meaningless.

**Example 3: Vibration measurement on a rotating shaft.** An accelerometer with  $f_n = 25$  kHz ( $\zeta = 0.7$ ) has a flat response ( $\pm 5\%$ ) up to approximately  $0.2 \times 25000 = 5000$  Hz. If the shaft rotates at 3600 RPM (60 Hz), harmonics up to the 80th (4800 Hz) are measured accurately. A cheaper accelerometer with  $f_n = 5$  kHz is flat only to 1000 Hz, measuring only the first 16 harmonics.

### 3.22 White Noise Testing for System Identification

Instead of sweeping individual frequencies, apply broadband white noise as the input and compute the frequency response function using cross-spectral analysis (Chapter 8). This characterizes the entire frequency response in a single measurement. The coherence function  $\gamma^2(f)$  at each frequency indicates the quality of the measurement:  $\gamma^2 > 0.95$  means the estimate is reliable;  $\gamma^2 < 0.5$  means the SNR at that frequency is too low.

For thermal systems where white noise temperature input is impractical, use a Pseudo-Random Binary Sequence (PRBS): a square wave that switches between two temperatures at random intervals. The PRBS has a flat spectrum up to a frequency determined by the minimum switching interval, effectively exciting all frequencies simultaneously.

### 3.23 System Identification from Experimental Data

Determining the dynamic model (transfer function) of a sensor or plant from measured data is called **system identification**. For MEGN 300 applications, two simple methods suffice:

#### 3.23.1 Step Response Method

Apply a step input and record the output. For a first-order system: (1) measure the final steady-state value  $y_{ss}$ , (2) measure the time to reach  $0.632y_{ss}$  to get  $\tau$ , (3) the transfer function is  $G(s) = y_{ss}/(1 + \tau s)$ . For a second-order system: (1) measure the peak overshoot  $\%OS$  to determine  $\zeta$ :  $\zeta = -\ln(\%OS/100)/\sqrt{\pi^2 + \ln^2(\%OS/100)}$ , (2) measure the peak time  $t_p$  to determine  $\omega_d$ :  $\omega_d = \pi/t_p$ , (3) compute  $\omega_n = \omega_d/\sqrt{1 - \zeta^2}$ , (4) the transfer function is  $G(s) = K\omega_n^2/(s^2 + 2\zeta\omega_n s + \omega_n^2)$ .

### 3.23.2 Frequency Response Method

Sweep a sinusoidal input across a range of frequencies. At each frequency, measure the gain  $|H| = A_{\text{out}}/A_{\text{in}}$  and the phase  $\phi$ . Plot the Bode diagram. For a first-order system: the  $-3\text{ dB}$  frequency gives  $\tau = 1/(2\pi f_{-3\text{dB}})$ . For a second-order system: the resonant peak frequency and height give  $\omega_n$  and  $\zeta$ .

The frequency response method is more accurate than the step response method for second-order systems because it provides data at many frequencies, allowing curve fitting to reduce the effect of noise. However, it requires a sinusoidal input source, which is easy for electrical and mechanical systems but difficult for thermal systems.

## 3.24 Dynamic Range of Sensor Systems

The dynamic range of a sensor is the ratio between its maximum measurable input and its minimum resolvable input, both determined by dynamic characteristics:

**Upper limit:** determined by the sensor's linear range. Beyond this, the output saturates or becomes nonlinear. For an accelerometer with  $\pm 50\text{ g}$  range: the maximum input is  $50\text{ g}$ .

**Lower limit:** determined by the noise floor. For the same accelerometer with a noise floor of  $100\text{ }\mu\text{g}/\sqrt{\text{Hz}}$  and a  $1\text{ kHz}$  bandwidth: the minimum resolvable acceleration is  $100 \times \sqrt{1000} = 3.16\text{ mg} \approx 3\text{ mg}$ .

**Dynamic range:**  $20 \log_{10}(50/0.003) = 84\text{ dB}$  ( $\sim 14$  bits equivalent). The DAQ must have at least this dynamic range to utilize the sensor's full capability. A 12-bit ADC ( $72\text{ dB}$ ) would limit the usable range; a 16-bit ADC ( $96\text{ dB}$ ) provides headroom.

## 3.25 Anti-Resonance and Its Effects

Some measurement systems exhibit **anti-resonance**: a frequency at which the sensor output drops to near zero, even though the input is non-zero. Anti-resonance occurs when two parallel signal paths with different phase produce destructive interference. In vibration measurement, a mounting structure with internal resonances can create anti-resonances in the accelerometer's frequency response, producing "blind spots" where vibration at specific frequencies is invisible. The cure: verify the complete frequency response of the installed sensor (not just the sensor alone) and avoid measurements at anti-resonance frequencies.

## 3.26 Practice Questions

1. A temperature sensor has  $\tau = 3.0\text{ s}$ . How long must you wait after a step change for the reading to be within 1% of the true value?
2. A first-order pressure sensor ( $\tau = 0.5\text{ ms}$ ) measures a pressure signal oscillating at  $500\text{ Hz}$ . Calculate the amplitude attenuation (as a percentage of true amplitude) and the phase lag in degrees.
3. An accelerometer step response shows 15% overshoot and a peak time of  $2.0\text{ ms}$ . Calculate  $\zeta$  and  $\omega_n$ .
4. Your system must measure a vibration signal containing frequencies up to  $200\text{ Hz}$  with less than 5% amplitude error. What minimum natural frequency must your accelerometer have if  $\zeta = 0.65$ ?



5. Explain why wrapping a thermocouple in thermal paste improves its dynamic response when measuring surface temperature, even though the paste itself has low thermal conductivity.

### 3.26.1 Answers

1. Within 1% means  $e^{-t/\tau} < 0.01$ , so  $t > -\tau \ln(0.01) = 3.0 \times 4.605 = 13.8 \text{ s}$  (i.e.,  $4.6\tau$ ; often rounded to  $5\tau = 15 \text{ s}$ ).
2.  $\omega = 2\pi \times 500 = 3142 \text{ rad/s}$ .  $\omega\tau = 3142 \times 0.0005 = 1.571$ .  $M = 1/\sqrt{1 + 1.571^2} = 1/\sqrt{3.468} = 0.537$ . Amplitude = 53.7% of true (attenuated by 46.3%). Phase =  $-\arctan(1.571) = -57.5^\circ$ .

3.

$$\zeta = -\ln(0.15)/\sqrt{\pi^2 + [\ln(0.15)]^2} = 1.897/\sqrt{9.870 + 3.599} = 1.897/3.669 = 0.517$$

.

$$\omega_n = \pi/(0.002 \times \sqrt{1 - 0.267}) = \pi/(0.002 \times 0.856) = 1835$$

rad/s = 292 Hz.

4. For  $\zeta = 0.65$ , the flat region extends to  $\approx 0.2\omega_n$  for  $<5\%$  error. So  $0.2\omega_n \geq 2\pi \times 200$ , giving  $\omega_n \geq 6283 \text{ rad/s} = 1000 \text{ Hz}$ . The accelerometer's natural frequency must be at least 1000 Hz.
5. Thermal paste fills the microscopic air gaps between the thermocouple bead and the surface. Air has very low thermal conductivity ( $\sim 0.025 \text{ W/m}\cdot\text{K}$ ), so air gaps create a large thermal resistance that increases the effective time constant. The paste ( $\sim 1\text{--}5 \text{ W/m}\cdot\text{K}$ ) dramatically reduces this contact resistance, lowering  $\tau$  and improving dynamic response, even though the paste itself is not a great conductor compared to metal.

#### ✓ Mastery Diagnostic:

Dynamic Measurements To demonstrate mastery of this module, you must be able to:

1. Measure  $\tau$  from step response data using both the 63.2% method and log-linear regression.
2. Calculate the  $-3 \text{ dB}$  bandwidth from  $\tau$  and apply the bandwidth-rise time product ( $f_{-3\text{dB}} \times t_r \approx 0.35$ ).
3. Determine amplitude attenuation and phase lag of a first-order sensor at a given signal frequency.
4. Evaluate whether a sensor's dynamic response is adequate (the  $5\times$  rule:  $f_{\text{sensor}} \geq 5f_{\text{signal}}$ ).
5. Explain the difference between overdamped, critically damped, and underdamped second-order responses.



## Chapter 4

# Error Analysis and Uncertainty

### When to Read This Chapter

**Module 3 (Weeks 3–4):** Read before the uncertainty analysis assignment. Focus on propagation of uncertainty (RSS method) and confidence intervals. The Monte Carlo section is enrichment for advanced projects. **Related:** Statistics in Chapter 5 (p.52); measurement fundamentals in Chapter 1 (p.6).

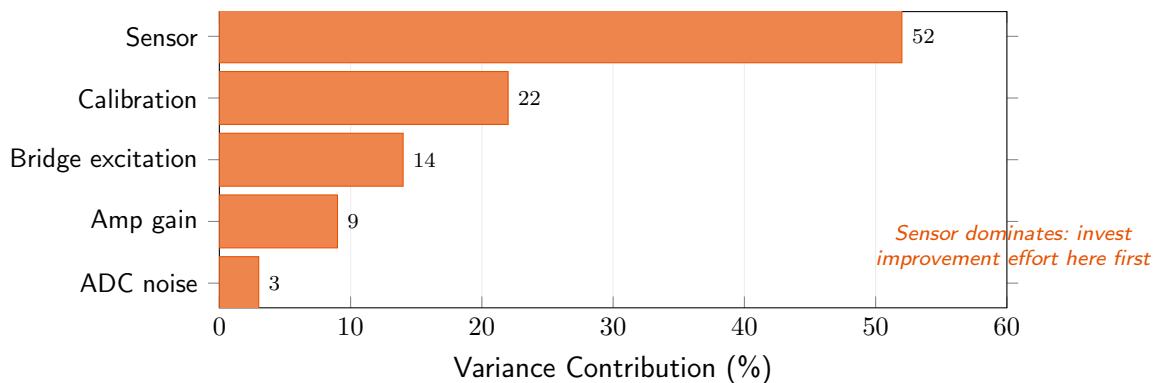


Figure 4.1: Variance contribution breakdown for the ThermoRig temperature measurement. Each bar shows the fraction of total variance  $u_c^2$  attributable to each source. The sensor contributes 52% of the total variance; improving the ADC (3%) has negligible effect. Always identify and improve the dominant contributor.

## 4.1 Types of Error

### 4.1.1 Systematic Error (Bias)

Systematic errors shift all measurements in one direction by a consistent amount. They arise from calibration errors, environmental effects (temperature, humidity), sensor nonlinearity, loading effects, and installation errors. Systematic errors are **correctable** through calibration, environmental compensation, and improved technique. They do **not** decrease with repeated measurements.

### 4.1.2 Random Error (Precision Error)

Random errors cause scatter around the mean value due to inherent variability in the measurement process (electronic noise, vibration, turbulence, human reading variation). Random errors follow a statistical distribution (usually Gaussian) and **decrease with averaging**: the standard error of the mean =  $\sigma/\sqrt{n}$ .

### 4.1.3 Gross Errors (Blunders)

Mistakes: wrong wiring, reading the wrong scale, recording errors, equipment malfunction. Detected and eliminated by inspection, redundancy, and outlier analysis (Chauvenet's criterion or Grubbs' test).

#### You Cannot Average Away Systematic Error

If your thermometer reads 2 °C high due to a calibration offset, taking 1000 measurements and averaging them will give you a very precise number that is still 2 °C wrong. Calibrate first, then average.

## 4.2 Statistical Foundations

### 4.2.1 Mean, Standard Deviation, and Standard Error

For  $n$  measurements  $\{x_1, x_2, \dots, x_n\}$ :

$$\bar{x} = \frac{1}{n} \sum_{i=1}^n x_i \quad (\text{sample mean}) \quad (4.1)$$

$$s = \sqrt{\frac{1}{n-1} \sum_{i=1}^n (x_i - \bar{x})^2} \quad (\text{sample standard deviation}) \quad (4.2)$$

$$s_{\bar{x}} = \frac{s}{\sqrt{n}} \quad (\text{standard error of the mean}) \quad (4.3)$$

Use  $n - 1$  (Bessel's correction) in the denominator for sample standard deviation. The standard error quantifies the uncertainty of the mean itself; the standard deviation quantifies the spread of individual measurements.

### 4.2.2 Confidence Intervals

The true value lies within  $\bar{x} \pm t_{\nu,P} \cdot s_{\bar{x}}$  with probability  $P$ , where  $t_{\nu,P}$  is the Student's  $t$ -value for  $\nu = n - 1$  degrees of freedom at confidence level  $P$ .

Common values: for 95% confidence and large  $n$ :  $t \approx 2.0$ . For  $n = 5$ :  $t_{4,95\%} = 2.776$ . For  $n = 10$ :  $t_{9,95\%} = 2.262$ .

#### Report Uncertainty Correctly

Always report measurements as:  $\bar{x} \pm U$  (95% confidence,  $n = [\text{sample size}]$ ). For example: " $T = 25.3 \pm 0.4$  °C (95% CI,  $n = 10$ )." This gives the reader everything needed to evaluate the quality of your measurement.

## 4.3 Uncertainty Propagation

When a result  $R$  is calculated from measured quantities  $x_1, x_2, \dots, x_n$ :

$$R = f(x_1, x_2, \dots, x_n) \quad (4.4)$$

the uncertainty in  $R$  propagates from the uncertainties in each  $x_i$ :

$$u_R = \sqrt{\sum_{i=1}^n \left( \frac{\partial f}{\partial x_i} \right)^2 u_{x_i}^2} \quad (4.5)$$

This is the **RSS (root-sum-square)** method, valid when the  $x_i$  errors are independent and random.

#### 4.3.1 Special Cases

**Addition/Subtraction:**  $R = x_1 \pm x_2 \Rightarrow u_R = \sqrt{u_{x_1}^2 + u_{x_2}^2}$ .

**Multiplication/Division:**

$$R = x_1 \cdot x_2 / x_3 \Rightarrow u_R / R = \sqrt{(u_{x_1} / x_1)^2 + (u_{x_2} / x_2)^2 + (u_{x_3} / x_3)^2}$$

**Power:**  $R = x^n \Rightarrow u_R / R = |n| \cdot u_x / x$ .

#### WE ThermoRig: Uncertainty Propagation for Heat Flux

Heat flux through a wall:  $q = k \cdot \Delta T / L$ , where  $k = 0.50 \pm 0.02 \text{ W/(m}\cdot\text{K)}$ ,  $\Delta T = 20.0 \pm 0.8 \text{ }^\circ\text{C}$ ,  $L = 0.010 \pm 0.0005 \text{ m}$ .

$$\frac{u_q}{q} = \sqrt{\left( \frac{0.02}{0.50} \right)^2 + \left( \frac{0.8}{20.0} \right)^2 + \left( \frac{0.0005}{0.010} \right)^2} = \sqrt{0.0016 + 0.0016 + 0.0025} = 0.0755 = 7.55\%$$

$q = 0.50 \times 20.0 / 0.010 = 1000 \text{ W/m}^2$ .  $u_q = 75.5 \text{ W/m}^2$ . Report:  $q = 1000 \pm 76 \text{ W/m}^2$ .

The thickness measurement ( $L$ ) dominates the uncertainty. To improve the result, improve the length measurement first.

## 4.4 Design-Stage Uncertainty Estimation

Before building a measurement system, estimate the total uncertainty from manufacturer specifications:

1. List all error sources in the measurement chain (sensor accuracy, signal conditioning gain error, ADC quantization, noise).
2. Convert each to the same units (typically the measurand's engineering units).
3. Classify each as systematic (bias) or random.
4. RSS the random components. Add the worst-case systematic components algebraically.
5. Compare to the measurement requirement. If the total exceeds the requirement, identify the dominant contributor and improve it.

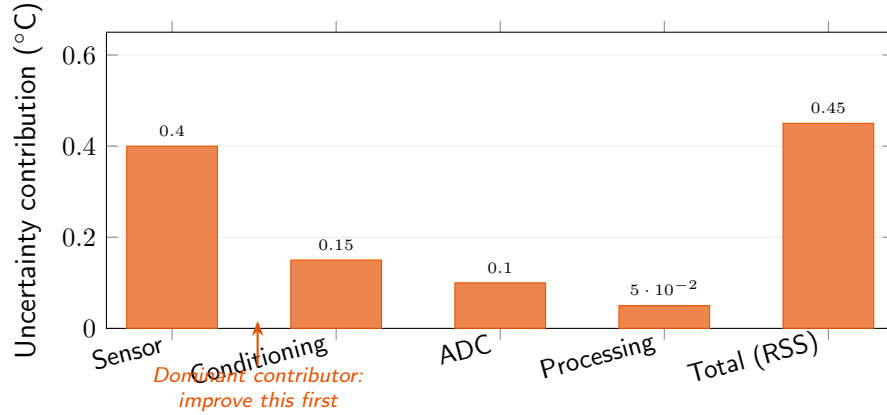


Figure 4.2: RSS error budget for a temperature measurement system. The sensor dominates; improving the ADC has diminishing returns. Always improve the dominant contributor first.

#### Requirements Mapping: Uncertainty to Shall-Statements

- “Measure temperature to  $\pm 1.0^\circ\text{C}$  at 95% confidence” → MEAS-REQ: Total expanded uncertainty  $U_{95} \leq 1.0^\circ\text{C}$ , verified by calibration against a NIST-traceable standard.
- The error budget allocates this across the sensor, conditioning, and DAQ stages. Each stage becomes a subsystem requirement.

## 4.5 The Philosophy of Uncertainty

Every measured value is an estimate accompanied by a range within which the true value is believed to lie. A reading of “ $23.5^\circ\text{C}$ ” is meaningless without knowing whether the uncertainty is  $\pm 0.1^\circ\text{C}$  or  $\pm 5^\circ\text{C}$ .

## 4.6 Type A and Type B Evaluation

**Type A (statistical):** from repeated measurements. Standard uncertainty of the mean:  $u_A = s/\sqrt{N}$ . As  $N$  increases,  $u_A$  decreases (but doubling  $N$  only reduces by  $\sqrt{2}$ ).

**Type B (non-statistical):** from datasheets, calibration certificates, engineering judgment. For  $\pm a$  specification with rectangular distribution:  $u_B = a/\sqrt{3}$ . Normal distribution (95%):  $u_B = a/2$ .

## 4.7 Combined Standard Uncertainty (RSS)

For  $R = f(x_1, x_2, \dots)$ :

$$u_c(R) = \sqrt{\sum_i \left( \frac{\partial f}{\partial x_i} \right)^2 u^2(x_i)} \quad (4.6)$$

Each  $(\partial f / \partial x_i)^2 u^2(x_i)$  is a variance contribution. The partial derivative is the sensitivity coefficient.

**Sums/differences:**  $u_c = \sqrt{u_1^2 + u_2^2}$ . **Products/quotients:** relative uncertainties add in quadrature. **Powers**  $R = x^n$ :  $u_c/R = |n| \cdot u_x/x$ . Velocity uncertainty of 5% means kinetic energy uncertainty of 10%.

**WE ThermoRig: Uncertainty in Heat Flux**

$q = k\Delta T/L$ . Given:  $k = 1.05 \pm 0.03 \text{ W/mK}$ ,  $T_1 = 80.2 \pm 0.4^\circ\text{C}$ ,  $T_2 = 23.1 \pm 0.4^\circ\text{C}$ ,  $L = 0.0100 \pm 0.0002 \text{ m}$ .

$\Delta T = 57.1^\circ\text{C}$ ,  $u_{\Delta T} = \sqrt{0.4^2 + 0.4^2} = 0.566^\circ\text{C}$ .  $q = 5995.5 \text{ W/m}^2$ .

Relative:  $u_k/k = 2.86\%$ ,  $u_{\Delta T}/\Delta T = 0.99\%$ ,  $u_L/L = 2.00\%$ .

$u_q/q = \sqrt{2.86^2 + 0.99^2 + 2.00^2}\% = 3.63\%$ .  $u_q = 218 \text{ W/m}^2$ .

Result:  $q = 6000 \pm 220 \text{ W/m}^2$ . Thermal conductivity dominates (62% of variance).

## 4.8 Expanded Uncertainty and Confidence Intervals

$U = k \cdot u_c$ . Coverage factor  $k = 2$  for 95% confidence (standard in engineering),  $k = 3$  for 99.7%. Always report: “ $T = 23.5 \pm 0.8^\circ\text{C}$  ( $k = 2$ ).” For small samples ( $N < 30$ ), use Student’s  $t$ -distribution with Welch-Satterthwaite effective degrees of freedom.

## 4.9 Systematic Error Sources and Corrections

**Sensor bias:** calibrate and apply correction. **Environmental effects:** characterize sensitivity coefficients. **Loading effects:** use higher-impedance instruments (Ch. 1). **Operator bias:** use digital readout. **Algorithmic bias:** use double-precision throughout.

**Accuracy vs. Precision**

Accuracy = total uncertainty (systematic + random). Precision = repeatability (random only). Precision is always better than accuracy. After calibration, accuracy improves toward precision but never exceeds it. Datasheet “accuracy:  $\pm 1\%$ ”  $\neq$  “repeatability:  $\pm 0.1\%$ .”

## 4.10 Designing the Error Budget

- (1) Start with system requirement. (2) Identify all sources. (3) Estimate each from datasheets/calibration.
- (4) Compute RSS total. (5) Verify meets requirement. (6) If not, improve the dominant contributor.

The dominant contributor determines the total. A 10% improvement in the largest source has more impact than 50% improvement in all minor sources combined.

**The 80/20 Rule**

In most systems, 80% of total uncertainty comes from one or two sources. Find them first. Display the error budget as a pie chart of variance contributions; the largest slice is where you invest effort.

## 4.11 Reporting Measurements

Never report more significant figures than the uncertainty justifies. If uncertainty is  $\pm 0.5^\circ\text{C}$ , report “ $23.5 \pm 0.5^\circ\text{C}$ ,” not “ $23.472^\circ\text{C}$ .” Match decimal places in value and uncertainty.

## 4.12 Monte Carlo Uncertainty Analysis

When the measurement equation is complex (nonlinear, conditional, or involves lookup tables), the analytical RSS formula becomes difficult or impossible to apply. Monte Carlo simulation provides a general alternative:

(1) Assign a probability distribution to each input variable (normal, rectangular, triangular, etc.) based on the available uncertainty information. (2) Generate  $N$  random samples of each input ( $N \geq 10,000$ ). (3) For each set of input samples, compute the output using the measurement equation. (4) Analyze the distribution of the  $N$  output values: mean, standard deviation, percentiles.

The 2.5th and 97.5th percentiles of the output distribution provide the 95% coverage interval directly, without assuming a normal distribution. This is especially valuable when the output distribution is asymmetric (which can occur with nonlinear measurement equations).

### WE ThermoRig: Monte Carlo vs. RSS for Heat Flux

For the heat flux calculation  $q = k\Delta T/L$ , we compare analytical RSS and Monte Carlo results. RSS (from the earlier example):  $q = 6000 \pm 218 \text{ W/m}^2$  (3.6%). Monte Carlo ( $N = 100,000$ , all inputs normal): mean =  $5998 \text{ W/m}^2$ , std =  $215 \text{ W/m}^2$ , 95% interval =  $[5577, 6428] \text{ W/m}^2$ . The agreement is excellent because the measurement equation is approximately linear over the uncertainty ranges. For this problem, the simpler RSS method is adequate. Monte Carlo becomes essential for equations involving powers, exponentials, or conditional logic.

## 4.13 Correlation Between Inputs

The RSS formula assumes all input uncertainties are independent (uncorrelated). If two inputs are correlated (e.g., two temperatures measured by the same type of sensor, which share the same calibration bias), the combined uncertainty must include cross-terms:

$$u_c^2 = \sum_i c_i^2 u_i^2 + 2 \sum_{i < j} c_i c_j u_i u_j r_{ij} \quad (4.7)$$

where  $r_{ij}$  is the correlation coefficient ( $-1 \leq r_{ij} \leq 1$ ). Positive correlation ( $r > 0$ ) increases the combined uncertainty; negative correlation ( $r < 0$ ) decreases it. In the ThermoRig,  $T_1$  and  $T_2$  are measured by different thermocouples, so they are independent ( $r = 0$ ). If they shared one thermocouple (e.g., measuring the same point at different times), they would be correlated.

## 4.14 Degrees of Freedom and Student's t-Distribution

When the number of measurements is small ( $N < 30$ ), the normal distribution underestimates the uncertainty. The Student's  $t$ -distribution, which has heavier tails, provides more conservative (and more accurate) coverage intervals.

For  $N$  measurements, the degrees of freedom  $\nu = N - 1$ . The coverage factor for 95% confidence:  $k = t_{0.975, \nu}$ . For  $N = 5$ :  $k = 2.78$  (vs. 2.00 for normal). For  $N = 10$ :  $k = 2.26$ . For  $N = 30$ :  $k = 2.04$  (approaching the normal value). This is why small sample sizes produce wider confidence intervals: there is less statistical evidence for the true mean and standard deviation.

## 4.15 Systematic Error Discovery

Systematic errors are insidious because they affect every measurement consistently but invisibly. Techniques for discovering them:

**Comparison with independent methods:** measure the same quantity with two fundamentally different sensors (e.g., thermocouple and RTD, or optical and contact displacement). If the results disagree beyond the combined uncertainty, at least one has a systematic error.

**Swap test:** interchange two sensors (swap channel connections). If the discrepancy follows the sensor, it is a sensor bias. If it follows the channel, it is a DAQ or wiring error.

**Substitution test:** replace the sensor with a known reference signal (precision voltage source). Compare the DAQ reading to the known value. Any difference is a systematic error in the signal conditioning or DAQ chain.

**Reversal test:** for sensors with a directional property (strain gauges, force sensors), reverse the direction of the measurand. The average of forward and reverse readings cancels hysteresis and reveals the true zero.

## 4.16 Uncertainty in Derived Quantities

Many engineering measurements compute a derived quantity from multiple measured inputs. Examples:

**Flow rate** from differential pressure:  $Q = C_d A \sqrt{2\Delta P/\rho}$ . The square root means that  $u_Q/Q = 0.5 \times u_{\Delta P}/\Delta P$ . Flow measurement uncertainty is half the pressure measurement uncertainty (a favorable leverage).

**Power** from voltage and current:  $P = VI$ . Relative uncertainty:  $u_P/P = \sqrt{(u_V/V)^2 + (u_I/I)^2}$ .

**Efficiency:**  $\eta = P_{\text{out}}/P_{\text{in}}$ . Since this is a ratio, relative uncertainties add in quadrature. A system with 3% uncertainty in both input and output power has  $\sqrt{3^2 + 3^2} = 4.2\%$  uncertainty in efficiency.

**Strain from bridge voltage:**  $\epsilon = (4V_o)/(V_{ex} \cdot GF)$ . Three uncertainty sources multiply: excitation voltage, gauge factor, and output voltage. A 0.1% excitation uncertainty, 1% gauge factor uncertainty, and 0.5% voltage measurement uncertainty give  $\sqrt{0.1^2 + 1.0^2 + 0.5^2} = 1.1\%$  strain uncertainty. The gauge factor dominates.

## 4.17 Uncertainty in Curve-Fit Calibrations

When a calibration curve is fitted to data points, the calibration uncertainty includes: (1) the uncertainty of each reference point (from the reference standard), (2) the scatter of repeated measurements at each point (Type A), (3) the fit residuals (difference between data and fitted curve), and (4) the interpolation uncertainty (between calibration points).

For a linear fit  $y = mx + b$  to  $N$  calibration points: the uncertainty of a predicted value  $\hat{y}$  at input  $x_0$  is:

$$u(\hat{y}) = s_{\text{resid}} \sqrt{\frac{1}{N} + \frac{(x_0 - \bar{x})^2}{\sum (x_i - \bar{x})^2}} \quad (4.8)$$

where  $s_{\text{resid}} = \sqrt{\sum (y_i - \hat{y}_i)^2 / (N - 2)}$  is the residual standard error. The uncertainty is smallest at the center of the calibration range ( $x_0 = \bar{x}$ ) and grows toward the edges. This is another reason not to extrapolate beyond the calibration range.

## 4.18 Measurement Uncertainty in Standards and Regulations

ISO 17025 (laboratory accreditation) requires that calibration certificates report expanded uncertainty with coverage factor  $k$ . ISO 9001 (quality management) requires that all measurement equipment used in production be calibrated with documented traceability. IATF 16949 (automotive) requires Measurement System Analysis (MSA) using Gauge R&R studies to quantify measurement variation.

In MEGN 300 projects, applying these standards is excellent preparation for industry. At minimum: (1) report all measurements with uncertainty, (2) document the calibration procedure and reference standards, (3) compute the error budget and identify the dominant contributor.

## 4.19 Common Uncertainty Analysis Mistakes

(1) **Adding uncertainties linearly:**  $u_{\text{total}} = u_1 + u_2 + u_3$  is overly conservative. Use RSS:  $u_{\text{total}} = \sqrt{u_1^2 + u_2^2 + u_3^2}$ , which assumes independence.

(2) **Confusing resolution with uncertainty:** a digital display showing  $0.01^\circ\text{C}$  resolution does not mean the measurement is accurate to  $0.01^\circ\text{C}$ . The uncertainty includes sensor accuracy, calibration error, noise, and drift, which are typically  $10\text{--}100\times$  larger than the display resolution.

(3) **Forgetting correlated sources:** if two inputs share the same calibration bias (e.g., two thermocouples from the same batch), their errors are correlated and do not cancel in RSS. They must be treated as systematic.

(4) **Reporting excessive significant figures:** “ $T = 23.4721 \pm 0.5^\circ\text{C}$ ” is wrong. Correct: “ $T = 23.5 \pm 0.5^\circ\text{C}$ .”

## 4.20 Propagation Through Common Engineering Functions

### 4.20.1 Trigonometric Functions

For  $y = \sin(x)$ :  $u_y = |\cos(x)| \cdot u_x$ . Near  $x = 0$  or  $\pi$ :  $|\cos(x)| \approx 1$ , so  $u_y \approx u_x$ . Near  $x = \pi/2$ :  $|\cos(x)| \approx 0$ , so  $u_y \ll u_x$  (favorable). This is why inclinometers are most accurate near horizontal (where  $\sin(\theta) \approx \theta$ ) and least accurate near vertical.

### 4.20.2 Logarithmic Functions

For  $y = \ln(x)$ :  $u_y = u_x/x$ . The absolute uncertainty decreases as  $x$  increases, but the relative uncertainty  $u_y$  in the log domain equals the relative uncertainty  $u_x/x$  of the input. This is why decibel measurements (which use logarithms) have constant relative accuracy regardless of signal level.

### 4.20.3 Exponential Functions

For  $y = e^x$ :  $u_y = e^x \cdot u_x = y \cdot u_x$ . The absolute uncertainty grows exponentially with  $x$ . This is why Arrhenius-type calculations (reaction rates, diffusion coefficients) where  $k = Ae^{-E_a/RT}$  are extremely sensitive to temperature uncertainty: a  $1^\circ\text{C}$  uncertainty at 300 K produces approximately 3–5% uncertainty in  $k$  for typical activation energies.



## 4.21 Gauge Repeatability and Reproducibility (Gauge R&R)

In manufacturing and quality control, the uncertainty of the measurement system itself is quantified using a Gauge R&R study. **Repeatability** is the variation when the same operator measures the same part multiple times with the same instrument. **Reproducibility** is the variation when different operators measure the same part.

The total measurement system variation

$$\sigma_{\text{MS}} = \sqrt{\sigma_{\text{repeat}}^2 + \sigma_{\text{repro}}^2}$$

. For the measurement system to be “acceptable,”  $\sigma_{\text{MS}}$  should be less than 10% of the total part-to-part variation (or less than 10% of the specification tolerance). If  $\sigma_{\text{MS}} > 30\%$  of the tolerance, the measurement system is incapable and must be improved before it can be used for quality decisions.

While a full Gauge R&R study is beyond MEGN 300 scope, understanding the concept prepares you for industry practice. In your projects, you can demonstrate the principle by having two team members independently measure the same quantity and comparing results.

## 4.22 Bayesian Uncertainty (Conceptual)

The GUM framework treats uncertainty as a property of the measurement procedure. An alternative approach, gaining traction in metrology, is **Bayesian uncertainty**: uncertainty represents the degree of belief about the true value given the data and prior knowledge. The posterior distribution  $p(\mu|\text{data})$  combines the likelihood (from the measurements) with the prior (from previous knowledge, datasheets, physics).

Bayesian methods are particularly powerful when: (1) you have informative prior knowledge (e.g., the temperature cannot be negative), (2) the data is limited (small  $N$ ), or (3) the measurement equation is highly nonlinear. While MEGN 300 uses the classical GUM approach, awareness of Bayesian methods is valuable for advanced metrological work.

## 4.23 Variance, Covariance, and Correlation

### 4.23.1 Variance

The variance of a set of  $N$  measurements  $\{x_1, x_2, \dots, x_N\}$  with mean  $\bar{x}$  is:

$$s^2 = \frac{1}{N-1} \sum_{i=1}^N (x_i - \bar{x})^2 \quad (4.9)$$

The factor  $N-1$  (Bessel’s correction) accounts for the fact that the sample mean  $\bar{x}$  is estimated from the data, consuming one degree of freedom. The standard deviation  $s = \sqrt{s^2}$  has the same units as the original measurements and represents the typical scatter of individual measurements around the mean.

For a measurement system, variance has a direct physical interpretation: it quantifies the random noise power. If you measure a constant temperature 100 times and get  $s = 0.3^\circ\text{C}$ , the variance  $s^2 = 0.09^\circ\text{C}^2$  represents the noise power in your measurement. Reducing the variance by a factor of 4 (halving  $s$ ) requires either a  $4\times$  better sensor, a  $4\times$  reduction in bandwidth, or averaging  $4\times$  as many samples.

### 4.23.2 Variance of Functions

When a derived quantity  $y = f(x_1, x_2, \dots, x_n)$  depends on several measured inputs, the variance of  $y$  is:

$$\text{Var}(y) = \sum_{i=1}^n \left( \frac{\partial f}{\partial x_i} \right)^2 \text{Var}(x_i) + 2 \sum_{i < j} \frac{\partial f}{\partial x_i} \frac{\partial f}{\partial x_j} \text{Cov}(x_i, x_j) \quad (4.10)$$

When all inputs are independent (uncorrelated), the covariance terms vanish and this reduces to the familiar RSS formula. When inputs are correlated, the covariance terms can either increase or decrease the total variance.

### 4.23.3 Covariance

The covariance between two variables  $x$  and  $y$  measured simultaneously:

$$\text{Cov}(x, y) = \frac{1}{N-1} \sum_{i=1}^N (x_i - \bar{x})(y_i - \bar{y}) \quad (4.11)$$

Positive covariance means  $x$  and  $y$  tend to increase together. Negative covariance means when  $x$  increases,  $y$  tends to decrease. Zero covariance means no linear relationship (but does not exclude nonlinear relationships).

In instrumentation, covariance arises when two measurements share a common error source. Two thermocouples from the same manufacturing batch share the same calibration bias: when one reads high, the other likely reads high too (positive covariance). Two strain gauges on opposite sides of a bending beam have opposite strain: when one increases, the other decreases (negative covariance, which the half-bridge exploits to double sensitivity).

### 4.23.4 Correlation Coefficient

The Pearson correlation coefficient normalizes covariance to the range  $[-1, +1]$ :

$$r_{xy} = \frac{\text{Cov}(x, y)}{s_x \cdot s_y} \quad (4.12)$$

$r = +1$ : perfect positive linear relationship.  $r = -1$ : perfect negative linear relationship.  $r = 0$ : no linear relationship. In practice,  $|r| > 0.8$  indicates strong correlation;  $|r| < 0.3$  indicates weak correlation.

### 4.23.5 Practical Impact of Correlation on Uncertainty

Consider measuring temperature difference  $\Delta T = T_1 - T_2$  where both sensors have uncertainty  $u = 0.5^\circ\text{C}$ . If uncorrelated ( $r = 0$ ):  $u_{\Delta T} = \sqrt{0.5^2 + 0.5^2} = 0.71^\circ\text{C}$ . If perfectly correlated ( $r = 1$ , same bias in both):  $u_{\Delta T} = \sqrt{0.5^2 + 0.5^2 - 2(0.5)(0.5)(1)} = 0^\circ\text{C}$ . The common bias cancels in the difference. This is why differential measurements are powerful: correlated errors cancel.

Conversely, if measuring the sum  $T_1 + T_2$  with  $r = 1$ :  $u_{\text{sum}} = \sqrt{0.5^2 + 0.5^2 + 2(0.5)(0.5)(1)} = 1.0^\circ\text{C}$ . Correlated errors add constructively in sums. The general formula:

$$u_{x \pm y}^2 = u_x^2 + u_y^2 \pm 2 r_{xy} u_x u_y \quad (4.13)$$

**When to Worry About Correlation**

In most MEGN 300 measurements, inputs are independent (different sensor types, different physical quantities) and correlation can be ignored. However, when two inputs share a common calibration source, a common environmental condition, or a common electronic circuit, correlation exists and must be included. The most common case: two sensors calibrated with the same reference standard share its calibration uncertainty as a correlated component.

**4.23.6 Covariance Matrix**

For a system with  $n$  correlated inputs, the uncertainties and correlations are compactly represented by the **covariance matrix**  $\mathbf{C}$ , an  $n \times n$  symmetric matrix where the diagonal elements are the variances  $\text{Var}(x_i)$  and the off-diagonal elements are the covariances  $\text{Cov}(x_i, x_j)$ :

$$\mathbf{C} = \begin{pmatrix} u_1^2 & r_{12}u_1u_2 & \cdots \\ r_{12}u_1u_2 & u_2^2 & \cdots \\ \vdots & \vdots & \ddots \end{pmatrix} \quad (4.14)$$

The combined uncertainty of a derived quantity  $y = f(x_1, \dots, x_n)$  is then:

$$u_y^2 = \mathbf{J} \mathbf{C} \mathbf{J}^T \quad (4.15)$$

where  $\mathbf{J} = [\partial f / \partial x_1, \dots, \partial f / \partial x_n]$  is the Jacobian (row vector of sensitivity coefficients). This matrix formulation is the foundation of the GUM framework and is implemented in commercial uncertainty analysis software.

**WE ThermoRig: Correlated Thermocouple Uncertainty**

Two Type K thermocouples from the same spool measure  $T_1$  and  $T_2$  across a thermal specimen. Both share the thermocouple wire's Seebeck coefficient uncertainty ( $\pm 0.4^\circ\text{C}$ , correlated,  $r = 1$ ). Each also has independent random noise ( $\pm 0.2^\circ\text{C}$ , uncorrelated). The heat flux  $q \propto (T_1 - T_2)$ . For the difference: the correlated component cancels ( $0.4^\circ\text{C} - 0.4^\circ\text{C} = 0$  for the shared bias), leaving only the uncorrelated noise:  $u_{\Delta T} = \sqrt{0.2^2 + 0.2^2} = 0.28^\circ\text{C}$ . Without recognizing the correlation, you would compute  $u_{\Delta T} = \sqrt{(0.4^2 + 0.2^2) + (0.4^2 + 0.2^2)} = 0.63^\circ\text{C}$ , overstating the uncertainty by 2.3 $\times$ . Correlation analysis matters.

**4.24 Reporting Uncertainty: International Standards**

The GUM-compliant uncertainty statement includes: (1) the measured value with appropriate significant figures, (2) the expanded uncertainty  $U$  with coverage factor  $k$  and confidence level, (3) a description of how the uncertainty was evaluated (Type A, Type B, or combined), and (4) the effective degrees of freedom if using the  $t$ -distribution.

**Correct format:** “The temperature was measured as  $T = 80.2 \pm 0.6^\circ\text{C}$  ( $k = 2$ , 95% confidence). The uncertainty was evaluated by combining Type A evaluation (10 repeated measurements,  $s = 0.18^\circ\text{C}$ ) with Type B evaluation of the calibration uncertainty ( $u_{\text{cal}} = 0.28^\circ\text{C}$ , normal distribution).”

**Incorrect format:** “ $T = 80.2347 \pm 0.6^\circ\text{C}$ ” (excessive significant figures). “ $T = 80.2^\circ\text{C}$ , accurate to  $\pm 1\%$ ” (ambiguous: 1% of what? no confidence level stated).

## 4.25 Practice Questions

1. Ten measurements of a voltage: 2.51, 2.48, 2.53, 2.49, 2.52, 2.50, 2.47, 2.54, 2.51, 2.50 V. Calculate the mean, sample standard deviation, standard error, and the 95% confidence interval.
2. You measure the density of a cylinder:  $\rho = 4m/(\pi d^2 L)$ . Measured values:  $m = 150.0 \pm 0.5$  g,  $d = 25.00 \pm 0.05$  mm,  $L = 100.0 \pm 0.1$  mm. Calculate  $\rho$  and its uncertainty.
3. A measurement system has three error sources: sensor bias  $\pm 0.5^\circ\text{C}$ , amplifier gain error  $\pm 0.2^\circ\text{C}$  (systematic), and noise  $\pm 0.3^\circ\text{C}$  (random,  $1\sigma$ ). What is the total uncertainty at 95% confidence?
4. You are designing a strain measurement system. The requirement is  $\pm 5 \mu\epsilon$  at 95% confidence. Your strain gauge has  $\pm 2 \mu\epsilon$  accuracy, your bridge amplifier has  $\pm 1.5 \mu\epsilon$  equivalent input noise, and your DAQ quantization contributes  $\pm 1 \mu\epsilon$ . Does the design meet the requirement?

### 4.25.1 Answers

1.  $\bar{x} = 2.505$  V.  $s = 0.0222$  V.  $s_{\bar{x}} = 0.0222/\sqrt{10} = 0.00702$  V.  $t_{9,95\%} = 2.262$ . CI =  $2.505 \pm 2.262 \times 0.00702 = 2.505 \pm 0.016$  V. Report:  $V = 2.505 \pm 0.016$  V (95% CI,  $n = 10$ ).

2.

$$\rho = 4 \times 150 / (\pi \times 25^2 \times 100) = 600 / (49087.4) = 0.03056$$

g/mm<sup>3</sup> = 30.56 kg/m<sup>3</sup>... wait, let me recalculate in consistent units.  $m = 0.1500$  kg,  $d = 0.02500$  m,  $L = 0.1000$  m.

$$V = \pi d^2 L / 4 = \pi \times 0.000625 \times 0.1 / 4 = 4.909 \times 10^{-5}$$

m<sup>3</sup>.  $\rho = 0.1500 / 4.909 \times 10^{-5} = 3056$  kg/m<sup>3</sup>. Fractional uncertainties:  $u_m/m = 0.5/150 = 0.00333$ ,  $u_d/d = 0.05/25 = 0.002$  (but  $d$  is squared: contribution =  $2 \times 0.002 = 0.004$ ),  $u_L/L = 0.1/100 = 0.001$ .

$$u_\rho/\rho = \sqrt{0.00333^2 + 0.004^2 + 0.001^2} = \sqrt{0.0000272} = 0.00522 = 0.52\%$$

.  $u_\rho = 15.9$  kg/m<sup>3</sup>. Report:  $\rho = 3056 \pm 16$  kg/m<sup>3</sup>.

3. Systematic:  $0.5 + 0.2 = 0.7^\circ\text{C}$  (worst-case addition for biases). Random at 95%:  $2 \times 0.3 = 0.6^\circ\text{C}$ . Total:  $\sqrt{0.7^2 + 0.6^2} = 0.92^\circ\text{C}$  if combining RSS, or  $0.7 + 0.6 = 1.3^\circ\text{C}$  worst-case. (Note: combining systematic and random is debated; the GUM method treats all as uncertainty components and RSS-combines them:

$$U_{95} = \sqrt{0.5^2 + 0.2^2 + (2 \times 0.3)^2} = \sqrt{0.25 + 0.04 + 0.36} = 0.81$$

$^\circ\text{C}$ .)

4. RSS

$$= \sqrt{2^2 + 1.5^2 + 1^2} = \sqrt{4 + 2.25 + 1} = \sqrt{7.25} = 2.69 \mu\epsilon$$

. At 95%:  $U_{95} \approx 2 \times 2.69 = 5.39 \mu\epsilon$ . This slightly exceeds the  $\pm 5 \mu\epsilon$  requirement. The design needs improvement; the strain gauge accuracy ( $\pm 2 \mu\epsilon$ ) is the dominant contributor. Options: use a higher-accuracy gauge, improve the bridge excitation stability, or relax the requirement.

**✓ Mastery Diagnostic:**

Error Analysis and Uncertainty To demonstrate mastery of this module, you must be able to:

1. Classify error sources as systematic or random, and explain appropriate mitigation.
2. Propagate uncertainty through a multi-variable equation using RSS, identifying sensitivity coefficients.
3. Identify the dominant uncertainty contributor and justify where to invest improvement effort.
4. Construct a complete uncertainty budget allocating error from sensor, conditioning, and DAQ.
5. Report results in GUM format:  $\bar{x} \pm U$  (95% CI,  $k = 2$ ,  $n = \dots$ ).

## Chapter 5

# Statistics and Experimental Data Analysis

---

### When to Read This Chapter

**Module 3 (Weeks 3–4):** Read alongside Chapter 4. Focus on  $t$ -tests, confidence intervals, and outlier detection (Chauvenet’s criterion). These are applied in every lab report for the rest of the semester. **Related:** Error analysis in Chapter 4 (p. 39).

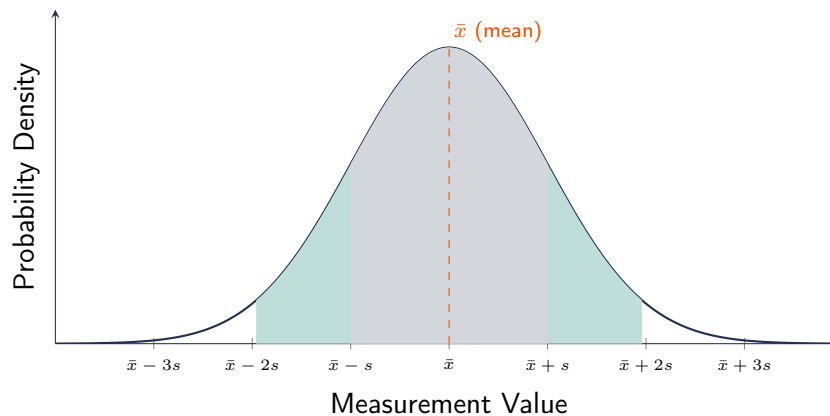


Figure 5.1: Normal (Gaussian) distribution showing the 68% ( $\pm 1s$ ) and 95% ( $\pm 1.96s$ ) confidence intervals. For MEGN 300 reporting, always use the 95% CI:  $\bar{x} \pm t_{0.025, \nu} \cdot s / \sqrt{n}$ .

## 5.1 Why Statistics Matters for Engineers

Every measurement contains noise. Every experiment has limited sample size. Every conclusion drawn from data carries a probability of being wrong. Statistics provides the mathematical framework for quantifying these realities, making honest claims about measurement quality, and designing experiments that efficiently answer engineering questions. This chapter covers the statistical tools most directly applicable to MEGN 300 laboratory work.

## 5.2 Descriptive Statistics

### 5.2.1 Measures of Central Tendency

The **arithmetic mean**  $\bar{x} = (1/N) \sum x_i$  is the best estimate of the true value when errors are symmetric and random. It minimizes the sum of squared deviations from the data.

The **median** is the middle value when data is sorted. It is robust to outliers: a single extreme measurement shifts the mean but barely affects the median. Use the median when you suspect outliers or when the data distribution is skewed.

The **mode** is the most frequently occurring value. It is primarily useful for categorical data or for identifying the peak of a multi-modal distribution (which may indicate two distinct populations in the data, such as measurements taken before and after a calibration shift).

### 5.2.2 Measures of Spread

The **sample standard deviation**  $s = \sqrt{(1/(N-1)) \sum (x_i - \bar{x})^2}$  quantifies the typical scatter of individual measurements. It has the same units as the data.

The **range** (max – min) is the simplest measure of spread but is sensitive to outliers and increases with sample size. It is useful for quick quality checks but should not be used for formal uncertainty analysis.

The **interquartile range (IQR)** =  $Q3 - Q1$  (75th percentile minus 25th percentile) is a robust measure of spread. Data points more than  $1.5 \times \text{IQR}$  beyond  $Q1$  or  $Q3$  are conventionally classified as outliers.

### 5.2.3 Standard Error of the Mean

The standard error  $SE = s/\sqrt{N}$  quantifies the uncertainty of the *mean*, not of individual measurements. While individual measurements scatter by  $\pm s$ , the mean is known to within  $\pm s/\sqrt{N}$ . This is why averaging improves measurement quality: 100 measurements reduce the uncertainty of the mean by  $\sqrt{100} = 10\times$  compared to a single measurement.

## 5.3 Probability Distributions in Instrumentation

### 5.3.1 Normal (Gaussian) Distribution

The most important distribution in measurement science. Random errors from many independent sources combine to produce a normal distribution (Central Limit Theorem). Properties: symmetric, bell-shaped, fully characterized by mean  $\mu$  and standard deviation  $\sigma$ . 68.3% of data falls within  $\pm 1\sigma$ , 95.4% within  $\pm 2\sigma$ , 99.7% within  $\pm 3\sigma$ .

In instrumentation, the normal distribution models: thermal noise voltages, repeated measurement scatter, calibration residuals, and manufacturing tolerances. When a datasheet specifies “accuracy:  $\pm 1\%$  ( $3\sigma$ ),” it means 99.7% of units meet the specification, but 0.3% may exceed it.

### 5.3.2 Uniform (Rectangular) Distribution

Equal probability across the range  $[a, b]$ . Mean =  $(a + b)/2$ . Standard deviation =  $(b - a)/\sqrt{12}$ . In instrumentation, the uniform distribution models: quantization error ( $\pm 0.5$  LSB), rounding error, and manufacturer specifications when no distribution information is given. Per GUM convention, when a datasheet says “ $\pm a$ ” with no further information, assume a rectangular distribution:  $u = a/\sqrt{3}$ .

### 5.3.3 Student’s t-Distribution

When estimating the mean from a small sample ( $N < 30$ ), the normal distribution underestimates the tails. The  $t$ -distribution, with  $\nu = N - 1$  degrees of freedom, provides wider confidence intervals

that account for the uncertainty in estimating  $\sigma$  from  $s$ . As  $N \rightarrow \infty$ ,  $t \rightarrow$  normal. For  $N = 5$ : the 95%  $t$ -factor is 2.78 (vs. 1.96 for normal). For  $N = 10$ : 2.26. For  $N = 30$ : 2.04.

### 5.3.4 Chi-Squared Distribution

The distribution of the sample variance  $s^2$  scaled by  $(N - 1)/\sigma^2$ . Used to construct confidence intervals for the variance itself and for goodness-of-fit testing. In MEGN 300, you encounter it when assessing whether the scatter in your calibration data is consistent with the claimed sensor accuracy.

## 5.4 Confidence Intervals

A confidence interval provides a range within which the true value is expected to lie with a specified probability. The 95% confidence interval for the mean:

$$\bar{x} \pm t_{0.975, N-1} \cdot \frac{s}{\sqrt{N}} \quad (5.1)$$

where  $t_{0.975, N-1}$  is the critical value from the  $t$ -distribution.

#### WE ThermoRig: Confidence Interval for Calibration

At the 50 °C calibration point, 10 measurements yield: mean = 50.12 °C,  $s = 0.18$  °C. The 95% CI:  $50.12 \pm 2.262 \times 0.18/\sqrt{10} = 50.12 \pm 0.13$  °C. We are 95% confident that the true mean reading at 50 °C is between 50.00 and 50.25 °C. The 0.12 °C offset from the true value (50.00 °C) is the systematic calibration residual.

## 5.5 Hypothesis Testing

### 5.5.1 The t-Test

The most common hypothesis test in engineering: is the mean of a dataset significantly different from a reference value (one-sample  $t$ -test), or are the means of two datasets significantly different from each other (two-sample  $t$ -test)?

**One-sample  $t$ -test:** test statistic  $t = (\bar{x} - \mu_0)/(s/\sqrt{N})$  where  $\mu_0$  is the hypothesized value. If  $|t| > t_{\text{critical}}$ , the difference is statistically significant (reject the null hypothesis that the mean equals  $\mu_0$ ).

**Two-sample  $t$ -test:** compares two independent groups. Test statistic:

$$t = \frac{\bar{x}_1 - \bar{x}_2}{\sqrt{s_1^2/N_1 + s_2^2/N_2}} \quad (5.2)$$

Use this to determine whether two measurement methods give significantly different results, whether a design change significantly affected performance, or whether two batches of sensors have different characteristics.

### 5.5.2 p-Values

The  $p$ -value is the probability of observing a test statistic at least as extreme as the one computed, assuming the null hypothesis is true. Convention:  $p < 0.05$  (5% significance level) is considered statistically significant.  $p < 0.01$  is highly significant.  $p > 0.1$  is not significant.



### Statistical Significance vs. Practical Significance

A statistically significant result is not necessarily practically important. With enough data ( $N = 10,000$ ), even a  $0.001^\circ\text{C}$  difference between two sensors is statistically significant ( $p < 0.05$ ). But if your accuracy requirement is  $\pm 1^\circ\text{C}$ , this difference is irrelevant. Always evaluate whether the observed effect size matters for your application, not just whether  $p < 0.05$ .

## 5.6 Regression Analysis

### 5.6.1 Linear Regression

Fitting a straight line  $y = mx + b$  to calibration data using least-squares minimization:

$$m = \frac{N \sum x_i y_i - \sum x_i \sum y_i}{N \sum x_i^2 - (\sum x_i)^2}, \quad b = \bar{y} - m\bar{x} \quad (5.3)$$

The **coefficient of determination**  $R^2$  measures the fraction of variance in  $y$  explained by the linear model.  $R^2 = 1$ : perfect fit.  $R^2 = 0$ : no linear relationship. For sensor calibrations,  $R^2 > 0.999$  is typical for linear sensors (RTDs, LVDTs).  $R^2 < 0.99$  suggests nonlinearity requiring a polynomial model.

### 5.6.2 Residual Analysis

After fitting, plot the residuals  $e_i = y_i - \hat{y}_i$  vs.  $x_i$ . If the model is correct, residuals should be randomly scattered around zero with no pattern. Systematic patterns indicate: curvature (need higher-order polynomial), heteroscedasticity (variance changes with  $x$ , requiring weighted regression), or outliers (bad data points requiring investigation).

### 5.6.3 Polynomial Regression

For nonlinear sensors (thermistors, thermocouples over wide ranges): fit  $y = a_0 + a_1x + a_2x^2 + \dots + a_nx^n$ . Choose the minimum order  $n$  that reduces residuals below the target accuracy. Overfitting (too many terms for the available data points) creates oscillations between data points and poor interpolation accuracy. A useful rule:  $n < N/3$  (at least 3 data points per coefficient).

## 5.7 Outlier Detection and Treatment

Outliers are data points that deviate significantly from the rest. They may indicate: genuine extreme values (valid but rare), measurement errors (sensor glitch, operator mistake, recording error), or equipment malfunction (intermittent connection, ADC overflow).

**Chauvenet's criterion:** reject a data point if the probability of observing a value that extreme (or more extreme) is less than  $1/(2N)$ . For  $N = 10$ : reject if the point is more than  $1.96\sigma$  from the mean. For  $N = 100$ : reject if more than  $2.81\sigma$ .

**Modified Thompson tau test:** a more rigorous statistical test for outlier rejection in small samples. Compares the deviation of the suspected outlier to a critical value that depends on  $N$  and the significance level.

**Rule:** never discard data without documenting the reason. "It looked wrong" is not acceptable. Valid reasons include: known equipment malfunction during that measurement, operator error recorded in the lab notebook, or failure of a formal statistical test.

## 5.8 Design of Experiments (DOE) Fundamentals

### 5.8.1 One-Factor-at-a-Time (OFAT)

The traditional approach: vary one factor while holding all others constant. Simple but inefficient: it requires many experiments to cover all combinations and cannot detect interactions between factors.

### 5.8.2 Factorial Design

Test all combinations of two or more factors at two or more levels. A  $2^k$  factorial tests  $k$  factors at 2 levels each. For  $k = 3$  factors (e.g., excitation voltage, sample rate, filter cutoff):  $2^3 = 8$  experiments. The factorial design reveals not only the main effect of each factor but also interactions (e.g., the effect of sample rate depends on the filter cutoff). This information is invisible in OFAT experiments.

### 5.8.3 Replication and Randomization

**Replication:** repeat each experimental condition multiple times to estimate the experimental error and enable statistical testing. Without replication, you cannot distinguish real effects from noise.

**Randomization:** run the experiments in random order to prevent systematic errors (drift, fatigue, environmental changes) from being confounded with the factors under study. If you test all “low” settings first and all “high” settings later, any time-dependent drift appears as a factor effect.

#### Sample Size Planning

Before running an experiment, estimate how many measurements you need to detect the effect you care about. The minimum sample size depends on: (1) the effect size you want to detect (smaller effects need more data), (2) the measurement noise ( $s$ ), (3) the desired confidence level (95% typical), and (4) the desired power (80% typical, meaning 80% probability of detecting a real effect). For a two-sample  $t$ -test:  $N \approx 2(z_{\alpha/2} + z_{\beta})^2 s^2 / \delta^2$  where  $\delta$  is the minimum detectable difference. Planning ahead prevents the frustration of collecting data that is insufficient to answer the question.

## 5.9 Graphical Data Presentation

**Scatter plots:** the default for showing the relationship between two continuous variables. Add error bars ( $\pm 1$  SE or  $\pm 1\sigma$ ) to every data point. Include the regression line and  $R^2$  value.

**Residual plots:** always plot residuals after a regression fit. Patterns in residuals reveal model inadequacy that  $R^2$  alone may not show.

**Histograms:** show the distribution of a dataset. Use 10–20 bins for  $N > 50$ . Overlay the theoretical distribution (normal curve) to assess normality.

**Box plots:** compact display of median, IQR, and outliers. Excellent for comparing multiple groups (e.g., measurements from different sensors or different operators).

**Time series plots:** for data collected over time, plot the raw values with a moving average overlay. Look for trends (drift), cycles (periodic errors), and step changes (calibration shifts).

**Error Bars Are Not Optional**

A data point without an error bar is a claim without evidence. Every plotted measurement should include error bars representing either the standard deviation (individual measurement scatter), the standard error (uncertainty of the mean), or the 95% confidence interval (most conservative). State which type of error bar you are using in the figure caption or legend.

## 5.10 The Central Limit Theorem

The Central Limit Theorem (CLT) is arguably the most important result in applied statistics. It states: regardless of the distribution of individual measurements, the distribution of the sample mean approaches a normal distribution as the sample size  $N$  increases. The approximation is excellent for  $N \geq 30$ , and surprisingly good for  $N \geq 10$  unless the underlying distribution is extremely skewed.

Practical consequence: even if individual sensor readings have a non-normal distribution (e.g., the rectangular distribution of quantization noise, or the skewed distribution of a saturating sensor), the mean of  $N$  readings is approximately normally distributed. This justifies using normal-distribution-based confidence intervals and hypothesis tests for averaged measurements.

### 5.10.1 CLT in Averaging

When you average  $N$  measurements: (1) the mean converges toward the true value (law of large numbers), (2) the distribution of the mean becomes normal (CLT), and (3) the standard deviation of the mean is  $s/\sqrt{N}$ . All three facts together justify the standard practice of “measure  $N$  times and report the mean with uncertainty  $\pm t \cdot s/\sqrt{N}$ .”

## 5.11 Analysis of Variance (ANOVA)

When comparing more than two groups (e.g., three calibration methods, four sensor brands, five operators), the two-sample  $t$ -test is insufficient (running multiple  $t$ -tests inflates the false-positive rate). ANOVA tests whether the means of  $k$  groups are all equal simultaneously.

The key insight: ANOVA partitions the total variance in the data into **between-group variance** (due to actual differences among the groups) and **within-group variance** (due to random measurement scatter). The  $F$ -statistic is the ratio:

$$F = \frac{\text{Between-group variance}}{\text{Within-group variance}} = \frac{MS_{\text{between}}}{MS_{\text{within}}} \quad (5.4)$$

If  $F$  exceeds the critical value from the  $F$ -distribution (at significance level  $\alpha = 0.05$  with  $k - 1$  and  $N - k$  degrees of freedom), at least one group mean is significantly different from the others. A post-hoc test (Tukey HSD) then identifies which specific pairs differ.

**WE ThermoRig: Comparing Three Thermocouple Batches**

Three batches of Type K thermocouples are tested at 80 °C. Batch A ( $N = 8$ ): mean = 80.12,  $s = 0.21$ . Batch B ( $N = 8$ ): mean = 79.85,  $s = 0.18$ . Batch C ( $N = 8$ ): mean = 80.05,  $s = 0.23$ . ANOVA:  $MS_{\text{between}} = 0.146$ ,  $MS_{\text{within}} = 0.043$ ,  $F = 3.40$ .  $F_{\text{crit}}(2, 21, 0.05) = 3.47$ . Since  $F < F_{\text{crit}}$ : fail to reject the null hypothesis. The three batches do not have significantly different mean readings. They are interchangeable for this application.

## 5.12 Propagation of Distributions (Monte Carlo Method)

When the measurement equation is nonlinear or complex, propagating uncertainties analytically (RSS formula) may give inaccurate results. The Monte Carlo approach simulates the measurement process numerically:

(1) Assign a probability distribution to each input variable based on calibration data or datasheet specifications. (2) Generate  $M$  random samples from each distribution ( $M \geq 10,000$ ). (3) Evaluate the measurement equation  $M$  times, once for each set of random inputs. (4) The resulting  $M$  output values form the output distribution. (5) Report the mean and the 2.5th and 97.5th percentiles as the 95% coverage interval.

Advantages over RSS: handles nonlinear equations correctly, provides the full output distribution shape (which may be asymmetric), and requires no partial derivatives. Disadvantage: requires a computer (but this is trivial in MATLAB, Python, or LabVIEW).

## 5.13 Goodness-of-Fit Testing

After fitting a model to calibration data, how do you know the model is adequate?

**$R^2$  (coefficient of determination):** fraction of variance explained by the model.  $R^2 > 0.999$  is typical for a good linear calibration. However,  $R^2$  alone can be misleading: a high  $R^2$  does not guarantee the model form is correct (a linear fit to clearly curved data can have  $R^2 > 0.99$  if the curvature is small).

**Residual analysis:** plot residuals ( $e_i = y_i - \hat{y}_i$ ) vs.  $x$ . Random scatter around zero: model is adequate. Systematic curvature: need a higher-order polynomial. Increasing spread: heteroscedasticity (need weighted regression or data transformation). Clusters of positive/negative residuals: model misspecification.

**Chi-squared test:**  $\chi^2 = \sum (e_i/u_i)^2$  where  $u_i$  is the uncertainty of each data point. If  $\chi^2/(N - p) \approx 1$  (where  $p$  is the number of fitted parameters): the model fits the data within the expected uncertainty.  $\chi^2/(N - p) \gg 1$ : the model does not fit (or the uncertainties are underestimated).  $\chi^2/(N - p) \ll 1$ : the model overfits (or the uncertainties are overestimated).

## 5.14 Time Series Analysis Basics

Laboratory data is often collected as a time series (sequential measurements over time). Beyond the standard statistics above, time series data has temporal structure:

**Trend:** a long-term drift in the mean (sensor aging, environmental change). Detected by: linear regression on the time series, or comparing means of the first and last thirds of the data.

**Periodicity:** oscillation at a specific frequency (60 Hz pickup, diurnal temperature cycle, periodic machine operation). Detected by: FFT of the time series.

**Autocorrelation:** dependence between successive samples. If sample  $n$  is above the mean, is sample  $n + 1$  also likely above the mean? The autocorrelation function  $R[\tau]$  quantifies this. High autocorrelation means successive samples are not independent, which violates the assumption underlying  $SE = s/\sqrt{N}$ . The effective number of independent samples is  $N_{\text{eff}} = N/(1 + 2 \sum_{k=1}^{\infty} R[k])$ , which can be much less than  $N$ . For heavily filtered or slowly sampled data:  $N_{\text{eff}}$  may be 10–100 $\times$  less than  $N$ , meaning the true uncertainty of the mean is much larger than  $s/\sqrt{N}$  suggests.

### The Autocorrelation Trap

If you sample a slow signal (temperature, pressure) at a high rate (1 kS/s) and average 1000 samples, you do **not** get  $\sqrt{1000} = 31.6\times$  noise reduction. The successive samples are highly correlated because the signal has not changed appreciably between samples. The effective improvement is determined by the number of independent measurements, which is approximately  $T_{\text{acquisition}}/\tau_{\text{signal}}$ . For a signal with  $\tau = 30$  s sampled for 1 s: you have  $N_{\text{eff}} \approx 1/30 \approx 0.03$  independent measurements, less than one. Averaging 1000 highly correlated samples gives almost no improvement. To improve the mean: acquire for longer ( $T \gg \tau$ ), not faster.

## 5.15 Nonparametric Methods

When the normality assumption does not hold (small samples from unknown distributions, heavily skewed data, ordinal data), nonparametric tests provide valid alternatives:

**Wilcoxon signed-rank test:** nonparametric replacement for the one-sample  $t$ -test. Ranks the absolute deviations from the hypothesized median and sums the ranks of positive and negative deviations separately. Does not assume normality.

**Mann-Whitney U test:** nonparametric replacement for the two-sample  $t$ -test. Compares the ranks of observations from two groups. Tests whether one group tends to have larger values than the other.

**Kruskal-Wallis test:** nonparametric replacement for one-way ANOVA. Compares ranks across three or more groups.

These tests have lower statistical power than their parametric counterparts (they need more data to detect the same effect), but they are valid regardless of the data distribution.

## 5.16 Multiple Testing Correction

When performing multiple hypothesis tests simultaneously (e.g., comparing 10 sensors pairwise: 45 comparisons), the probability of at least one false positive increases dramatically. With 45 tests at  $\alpha = 0.05$ : the probability of at least one false positive is  $1 - (1 - 0.05)^{45} = 90\%$ .

**Bonferroni correction:** divide the significance level by the number of tests. For 45 tests: use  $\alpha = 0.05/45 = 0.0011$  per test. Conservative but simple.

**Holm-Bonferroni:** a step-down procedure that is less conservative than Bonferroni. Sort the  $p$ -values from smallest to largest. Compare the smallest to  $\alpha/m$ , the second to  $\alpha/(m-1)$ , etc.

**False Discovery Rate (FDR):** controls the expected proportion of false positives among rejected hypotheses (rather than the probability of any false positive). The Benjamini-Hochberg procedure is the standard FDR method. It is more powerful than Bonferroni when many tests are performed.

## 5.17 Effect Size and Practical Significance

Statistical significance ( $p < 0.05$ ) answers: “Is the observed effect likely real (not due to chance)?” But it does not answer: “Is the effect large enough to matter?” Effect size measures answer the second question.

**Cohen’s  $d$ :** for comparing two means:  $d = (\bar{x}_1 - \bar{x}_2)/s_{\text{pooled}}$ .  $d = 0.2$ : small effect.  $d = 0.5$ : medium.  $d = 0.8$ : large. A  $p < 0.001$  result with  $d = 0.1$  means the difference is real but tiny; likely

not worth acting on.

$R^2$  (from regression): the fraction of variance explained by the model.  $R^2 = 0.01$  means the model explains 1% of the data variability; the effect is real but inconsequential.

In MEGN 300: always report both the  $p$ -value (statistical significance) and the effect size (practical significance). A measurement system improvement that is statistically significant but reduces uncertainty by only 0.01% is not worth the implementation cost.

## 5.18 Practice Questions

1. Twenty measurements of a resistor yield a mean of  $99.87\ \Omega$  and a standard deviation of  $0.15\ \Omega$ . Compute the 95% confidence interval for the true resistance. Is the resistor consistent with a nominal value of  $100\ \Omega$ ?
2. Two calibration methods are compared for a pressure sensor. Method A ( $N = 12$ ): mean residual =  $0.35\ \text{psi}$ ,  $s = 0.20\ \text{psi}$ . Method B ( $N = 15$ ): mean residual =  $0.22\ \text{psi}$ ,  $s = 0.18\ \text{psi}$ . Perform a two-sample  $t$ -test to determine whether the methods give significantly different mean residuals at the 5% level.
3. A strain gauge calibration produces the data points  $(0, 0.001)$ ,  $(500, 1.012)$ ,  $(1000, 2.005)$ ,  $(1500, 3.021)$ ,  $(2000, 4.008)$  in  $(\mu\epsilon, \text{mV})$ . Fit a linear model, compute  $R^2$ , and plot the residuals. Is a linear model adequate?
4. Explain the difference between correlation and causation using an instrumentation example. Two sensor readings are strongly correlated ( $r = 0.95$ ). Does this mean one is causing the other?
5. You are planning an experiment to determine whether a new filter design reduces measurement noise by at least 20%. Your current noise standard deviation is  $0.5\ \text{mV}$ . How many measurements of each filter do you need to detect a 20% reduction with 80% power at the 5% significance level?

### 5.18.1 Answers

1.  $\text{SE} = 0.15/\sqrt{20} = 0.0335\ \Omega$ .  $t_{0.975,19} = 2.093$ . CI:

$$99.87 \pm 2.093 \times 0.0335 = 99.87 \pm 0.07\ \Omega = [99.80, 99.94]\ \Omega$$

. Since  $100.0\ \Omega$  is outside the CI, the measured mean is statistically significantly different from  $100\ \Omega$  at the 95% level, suggesting a systematic offset of  $-0.13\ \Omega$  (0.13%).

2. Pooled  $\text{SE} = \sqrt{0.20^2/12 + 0.18^2/15} = \sqrt{0.00333 + 0.00216} = 0.0741\ \text{psi}$ .  $t = (0.35 - 0.22)/0.0741 = 1.75$ . Approximate  $\nu = 22$ .  $t_{\text{crit}} = 2.074$ . Since  $1.75 < 2.074$ : fail to reject the null hypothesis. The methods do not give significantly different results at the 5% level.
3. Linear fit:  $y = 0.002003x + 0.0018$ ,  $R^2 = 0.99998$ . Residuals:  $+0.001, +0.005, -0.003, +0.009, -0.010\ \text{mV}$ . Maximum residual is  $0.010\ \text{mV}$ . No systematic pattern. The linear model is excellent.
4. Two sensors measuring temperature in the same environment will be strongly correlated because they respond to the same physical temperature changes, not because one causes the other. A third variable (actual temperature) drives both. Correlation does not imply causation.

5. For two-sample  $t$ -test detecting  $\delta = 0.1$  mV ( $20\% \times 0.5$ ) from  $s = 0.5$  mV:

$$N \approx 2(1.96 + 0.84)^2 \times 0.5^2 / 0.1^2 = 2 \times 7.84 \times 2.5 = 392$$

per group. This is a large number because the effect (20%) is small relative to the noise. If the expected improvement were 50%,  $N$  drops to approximately 63 per group.

## Chapter 6

# Principles of Sensors and Actuators

### When to Read This Chapter

**Module 8B:** Read when selecting sensors and actuators for the design challenge. The transduction principles and selection decision tree help you match sensors to your measurement requirements. **Related:** Static calibration in Chapter 2 (p. 16); signal conditioning in Chapter 15 (p. 155).

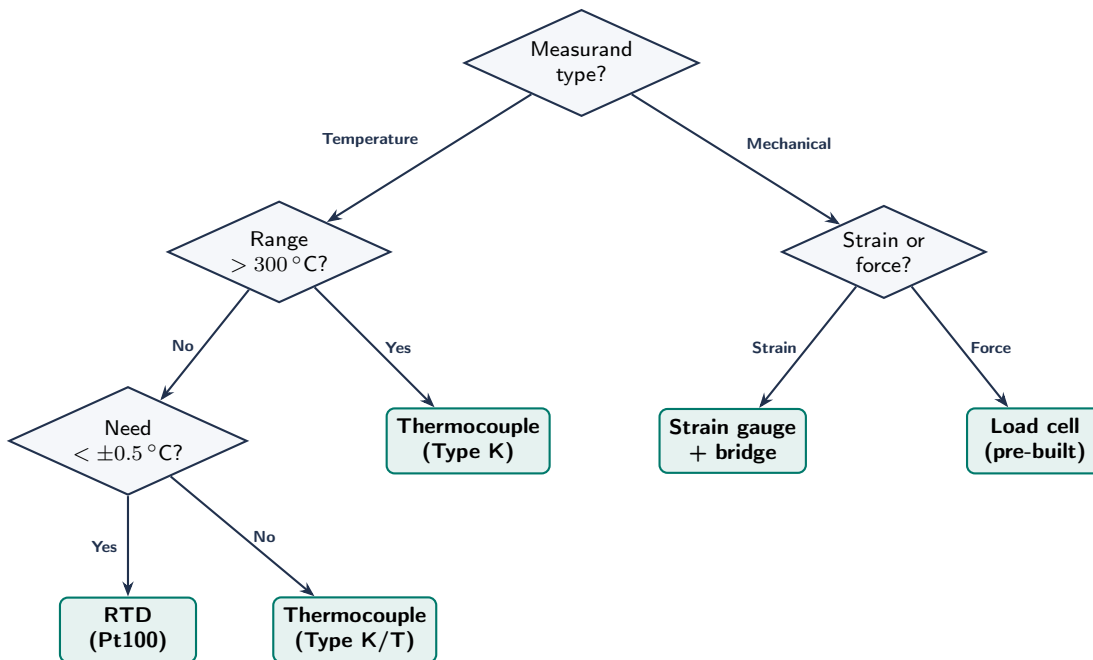


Figure 6.1: Simplified sensor selection decision tree for temperature and mechanical measurands. For pressure, flow, displacement, and other measurands, consult the full sensor selection tables later in this chapter.

The previous chapters established how to characterize, calibrate, and quantify uncertainty in measurements. This chapter steps back to the physical level: how do sensors convert physical quantities into electrical signals, and how do actuators convert electrical commands into physical action? Understanding transduction principles allows you to select the right sensor or actuator for a given application, predict its limitations, and design the signal conditioning that bridges it to your DAQ or controller.



## 6.1 Transduction: Converting Between Physical Domains

A **transducer** converts energy from one domain to another. A **sensor** (input transducer) converts a physical quantity (temperature, pressure, strain, displacement, flow, light, acceleration) into an electrical signal (voltage, current, resistance, capacitance, frequency). An **actuator** (output transducer) converts an electrical command into a physical action (force, torque, displacement, heat, light, flow).

The choice of transduction mechanism determines the sensor's sensitivity, range, linearity, bandwidth, and failure modes. There is no universal sensor; every mechanism involves tradeoffs.

### Industry Insight:

**From Lab Bench to Electric Vehicle Test Cell** The five-block measurement architecture is not an academic abstraction. In DOE vehicle energy analysis programs and NREL fleet testing, engineers instrument vehicles with hundreds of channels following exactly this architecture: CAN bus sensors feeding signal conditioning boards, high-speed DAQ systems, real-time processing pipelines, and terabyte-scale storage. The measurement system design principles you learn in MEGN 300 scale directly from the lab bench to a 400 V EV powertrain test cell or a grid-scale battery energy storage system. The error budgets, grounding practices, and signal conditioning chains are identical in concept; only the voltage levels, channel counts, and safety requirements change.

## 6.2 Sensor Classification

### 6.2.1 By Transduction Mechanism

**Resistive:** the measurand changes the resistance of a sensing element. Examples: strain gauges (piezoresistive effect in metal foil), RTDs (temperature coefficient of resistance in platinum wire), thermistors (large resistance change in semiconductor oxide), potentiometers (wiper position changes resistance). Output is a resistance change, typically measured with a Wheatstone bridge or voltage divider.

**Capacitive:** the measurand changes the capacitance of a parallel-plate or interdigitated structure by varying plate area, gap distance, or dielectric constant. Examples: MEMS accelerometers (proof mass displacement changes gap), humidity sensors (dielectric changes with moisture absorption), touchscreens (finger proximity changes fringe capacitance). Output is a capacitance change, measured with an oscillator circuit or capacitance-to-digital converter.

**Inductive/Electromagnetic:** the measurand changes inductance or generates a voltage via Faraday's law. Examples: LVDTs (Linear Variable Differential Transformer, displacement changes coupling between primary and secondary coils), tachometers (rotation generates AC voltage proportional to speed), eddy current sensors (proximity of a conductive target changes coil impedance). Output is an AC voltage or impedance change.

**Piezoelectric:** mechanical stress generates a charge (or conversely, applied voltage produces strain). Examples: dynamic force/pressure sensors (quartz or PZT crystals), accelerometers (mass on crystal produces charge proportional to acceleration), ultrasonic transducers (PZT element vibrates at ultrasonic frequencies). Piezoelectric sensors measure only dynamic (changing) quantities; they cannot measure static force because the charge leaks away.

**Thermoelectric:** a temperature difference at the junction of two dissimilar metals generates a voltage (Seebeck effect). The thermocouple is the primary example. Output is a small voltage

( $\sim 10\text{--}60\ \mu\text{V}/^\circ\text{C}$  depending on type) requiring amplification and cold-junction compensation.

**Optical/Photoelectric:** light intensity, wavelength, or interference pattern changes with the measurand. Examples: photodiodes and phototransistors (light to current), fiber-optic sensors (strain changes light transmission), pyrometers (infrared radiation from a surface indicates temperature without contact), encoders (light through a slotted disc produces digital pulses for position/speed).

### 6.2.2 By Output Type

**Analog output:** a continuous voltage or current proportional to the measurand. Requires an ADC for digital processing. Examples: thermocouples, strain gauges (with bridge), pressure transducers (4–20 mA loop).

**Digital output:** a digital word or pulse train directly readable by a microcontroller. Examples: encoders (pulse count), I2C/SPI digital temperature sensors (DS18B20, BME280), frequency-output sensors.

**Self-generating:** produces electrical energy from the measurand without external excitation. Examples: thermocouples, piezoelectric sensors, photovoltaic cells.

**Modulating:** requires external excitation (voltage, current, or light source) and the measurand modifies the excitation signal. Examples: strain gauges (need bridge excitation), RTDs (need current source), LVDTs (need AC excitation).

## 6.3 Key Sensor Specifications

When selecting a sensor for a project, evaluate these specifications against your measurement requirements:

**Range:** the minimum and maximum values the sensor can measure. Operating beyond the range produces saturated or damaged output.

**Sensitivity:** the ratio of output change to input change,  $S = \Delta V_{\text{out}}/\Delta x$ . Units depend on the sensor: mV/ $^\circ\text{C}$  for thermocouples, mV/V per microstrain for strain gauges, mV/kPa for pressure sensors. Higher sensitivity means larger output signal and better SNR.

**Resolution:** the smallest change in the measurand that produces a detectable change in output. Limited by noise, quantization, or mechanical friction.

**Accuracy:** closeness to the true value, expressed as  $\pm\%$  of full scale (FS) or  $\pm$  absolute units. Includes systematic errors correctable by calibration.

**Linearity:** deviation from a straight-line relationship between input and output, expressed as  $\pm\%$  FS. Nonlinear sensors (thermistors, some pressure sensors) require lookup tables or polynomial correction.

**Response time / Bandwidth:** how quickly the sensor tracks changes. Characterized by the time constant  $\tau$  (first-order) or natural frequency  $\omega_n$  (second-order). Must exceed  $5\times$  the highest signal frequency for  $<1\%$  dynamic error (Chapter 3).

**Repeatability:** closeness of successive measurements under identical conditions. A sensor with poor repeatability produces different readings each time, even if calibrated perfectly.

**Hysteresis:** difference in output for the same input depending on whether the input is increasing or decreasing. Common in mechanical sensors (springs, diaphragms) and magnetic sensors.

**Output impedance:** affects loading when connected to a measurement circuit (Chapter 13, Thevenin equivalent). High-impedance sensors require buffer amplifiers.

**Sensor Selection Decision Framework**

(1) What physical quantity are you measuring? (2) What range and accuracy does your requirement specify? (3) What is the fastest change you need to capture (bandwidth)? (4) What output type does your DAQ accept (analog voltage, digital, resistance)? (5) What is the operating environment (temperature, moisture, vibration, corrosive chemicals)? (6) What is the budget? Match these six criteria to the sensor specification table in the Quick Reference appendix. If multiple sensors qualify, prefer the one with the simplest signal conditioning path.

## 6.4 Common Sensor Types for MEGN 300

### 6.4.1 Temperature Sensors

**Thermocouples** (Type K, J, T): self-generating, wide range ( $-200$  to  $1250$  °C for Type K), fast response (small bead:  $\tau < 0.5$  s in water), rugged. Output is  $\mu$ V-level and requires amplification and cold-junction compensation. Best for: wide temperature ranges, fast measurements, harsh environments.

**RTDs** (Pt100, Pt1000): resistive, excellent accuracy ( $\pm 0.1$  °C with calibration), highly linear, stable over years. Slower response than thermocouples (wire-wound elements have higher thermal mass). Require bridge excitation with controlled current (self-heating error if current too high). Best for: precision measurements, stable long-term monitoring.

**Thermistors** (NTC): resistive, very high sensitivity ( $10\times$  thermocouples), small size. Highly nonlinear (require Steinhart-Hart equation or lookup table). Limited range ( $-40$  to  $125$  °C). Best for: high-resolution measurements over narrow ranges, fast response.

**Digital temperature ICs** (DS18B20, TMP36): integrated sensor with built-in ADC and digital output. Convenient (one-wire or analog voltage output, no bridge or amplifier needed). Limited accuracy ( $\pm 0.5$  °C typical) and range. Best for: simple projects where convenience outweighs precision.

### 6.4.2 Strain and Force Sensors

**Foil strain gauges**: resistive (gauge factor  $\sim 2$  for metal foil), bonded to the structure under test. Output is  $\sim 2$  mV/V at full scale, requiring a Wheatstone bridge and instrumentation amplifier. Resolution: sub-microstrain with proper amplification. Best for: structural analysis, load measurement via calibrated members.

**Load cells**: strain gauges bonded to a precision machined element (bending beam, S-type, or compression). Factory-calibrated with a known sensitivity (mV/V). Best for: direct force or weight measurement.

**Piezoelectric force sensors**: measure dynamic force only (charge leaks for static loads). Very high bandwidth ( $> 100$  kHz) and stiffness. Require charge amplifier. Best for: impact, vibration, and dynamic force measurement.

### 6.4.3 Pressure Sensors

**Piezoresistive**: strain gauges on a silicon diaphragm. Output is a bridge voltage proportional to pressure. Available in gauge, differential, and absolute configurations. Most common type for student projects.

**Capacitive:** diaphragm deflection changes capacitance. Higher accuracy and lower drift than piezoresistive. Used in precision applications (barometric pressure, altimeters).

#### 6.4.4 Motion and Position Sensors

**Potentiometers:** resistive position sensor. Simple, inexpensive, direct analog output. Mechanical wear limits lifetime. Best for: slow, limited-range position measurement.

**Encoders:** optical or magnetic disc produces digital pulses. Incremental encoders give relative motion (count pulses for position, measure pulse frequency for speed). Absolute encoders give absolute position (unique code at each angle). Best for: motor speed/position feedback.

**MEMS accelerometers** (ADXL345, MPU6050): capacitive sensing of proof-mass displacement. Digital output (I2C/SPI). Measure acceleration, tilt (via gravity vector), and vibration. Best for: motion sensing, vibration monitoring, tilt measurement.

**Ultrasonic range sensors** (HC-SR04): emit an ultrasonic pulse and measure the echo time. Range: 2 cm to 4 m with  $\pm 3$  mm accuracy. Best for: non-contact distance measurement.

#### 6.4.5 Flow Sensors

**Differential pressure:** an orifice plate, venturi tube, or Pitot tube creates a pressure drop proportional to  $v^2$ . Measure  $\Delta P$  with a differential pressure sensor. Requires knowledge of fluid density. Best for: pipe flow measurement in fixed installations.

**Turbine/paddle wheel:** rotating element spins proportionally to flow velocity. Pulse output. Best for: clean liquids, moderate flow rates.

**Ultrasonic transit-time:** measures the difference in ultrasonic pulse travel time with and against flow direction. Non-invasive (clamp-on). Best for: clean fluids where no pipe modification is allowed.

### 6.5 Actuator Principles

Actuators convert electrical energy into mechanical work. The choice of actuator depends on the required force/torque, speed, precision, and duty cycle.

#### 6.5.1 Electromagnetic Actuators

**DC motors** (brushed and brushless): convert electrical current into rotational torque via Lorentz force on current-carrying conductors in a magnetic field. Torque is proportional to current; speed is proportional to voltage (minus back-EMF). Controlled via PWM for speed and H-bridge for direction. Chapter 15 covers MOSFET switching and flyback protection.

**Stepper motors:** divide a full rotation into discrete steps (typically  $1.8^\circ/\text{step} = 200$  steps/revolution). Controlled by sequencing current through coil pairs. Open-loop position control (no encoder needed). Precise positioning but limited speed and torque at high speeds.

**Servo motors:** a DC or brushless motor with an integrated feedback sensor (encoder or potentiometer) and controller. Accept a position or velocity command and use internal closed-loop control to achieve it. Hobby servos accept a 1–2 ms PWM signal for angular position. Industrial servos use encoder feedback for high-precision motion.

**Solenoids:** a coil around a ferromagnetic plunger produces linear force when energized. Binary actuator (on/off), fast response ( $< 10$  ms). Used for valves, latches, and relays. Inductive load; requires flyback diode protection.

### 6.5.2 Thermal Actuators

**Resistive heaters:** convert electrical energy to heat via  $P = I^2R$ . Cartridge heaters, silicone pad heaters, and nichrome wire elements. Controlled via PWM through an SSR (AC loads) or MOSFET (DC loads). Chapter 15 covers the ThermoRig heater control example.

**Peltier devices** (thermoelectric coolers): semiconductor junctions that pump heat from one face to the other when current flows. Can heat or cool depending on current direction. Used for precise temperature control of small components (laser diodes, sample chambers). Efficiency is low; most electrical energy becomes waste heat.

### 6.5.3 Fluid Actuators

**Pumps:** convert rotational energy (from a motor) into fluid flow. Positive-displacement (gear, peristaltic, diaphragm) for precise metering; centrifugal for high-flow applications. Chapter 20 (Fluid Power) covers pump selection in detail.

**Valves:** control fluid flow by opening, closing, or partially obstructing a passage. Solenoid valves for on/off control; proportional valves for variable flow. Pneumatic and hydraulic cylinders convert pressurized fluid into linear force and motion.

### 6.5.4 Actuator Selection Framework

Match the actuator to the load requirements: (1) What type of motion? (rotary, linear, on/off). (2) What force/torque is needed? (3) What speed or stroke? (4) What precision? (5) What duty cycle? (continuous, intermittent). (6) What control interface? (PWM, analog voltage, digital command). The Master Reference Document's Quick Reference tables include motor and pump selection guides.

#### Actuators Need Drivers

No actuator connects directly to a microcontroller GPIO pin. Every motor needs a driver (H-bridge, ESC, stepper driver). Every solenoid needs a MOSFET with flyback diode. Every heater needs an SSR or MOSFET with current limiting. Chapter 15 (High-Power Devices) covers all driver circuits. Forgetting the driver circuit is the most common actuator integration mistake.

#### Requirements Mapping: Sensors and Actuators

“The temperature measurement system shall measure the range 0–200 °C with an accuracy of  $\pm 1.0$  °C and a response time less than 2.0 s (63.2% of step).” “The drive motor shall produce a continuous torque of at least 0.5 N·m at 500 RPM with speed regulation within  $\pm 5\%$  under varying load.” “The flow sensor shall measure 0–10 L/min with  $\pm 3\%$  FS accuracy and a 4–20 mA output compatible with the NI DAQ analog input.” Sensor and actuator specifications translate directly into testable system requirements.

## 6.6 Practice Questions

1. You need to measure temperature in a furnace (range: 200–800 °C) with  $\pm 2$  °C accuracy and a response time under 1 s. Which sensor type would you select and why? What signal conditioning would be needed?

2. Explain why a piezoelectric force sensor cannot measure the static weight of an object sitting on it, even though it can easily measure the dynamic impact when the object is dropped.
3. A stepper motor has 200 steps per revolution and is driven at 400 pulses per second. What is the shaft speed in RPM? If the motor stalls above 600 RPM, can this drive speed be achieved?

### 6.6.1 Answers

1. Type K thermocouple. Justification: range covers 200–800 °C (RTDs max out at ~850 °C but are more expensive; thermistors cannot reach 200 °C). Type K accuracy is  $\pm 2.2$  °C or  $\pm 0.75\%$  (whichever is larger), meeting the  $\pm 2$  °C requirement above ~290 °C. An exposed-junction bead thermocouple has  $\tau < 0.5$  s in moving gas, meeting the 1 s requirement. Signal conditioning: thermocouple amplifier with cold-junction compensation (e.g., AD8495 or MAX31855 digital), providing a voltage or digital output compatible with the DAQ.
2. Piezoelectric sensors generate charge in response to mechanical stress ( $Q = d \times F$  where  $d$  is the piezoelectric coefficient). For a static load, the charge is generated at the moment of application, but then leaks away through the finite insulation resistance of the crystal and the input impedance of the charge amplifier (time constant  $\tau = R_{\text{insulation}} \times C_{\text{crystal}}$ , typically seconds to minutes). After  $5\tau$ , the output decays to zero even though the force remains. Dynamic forces continuously generate new charge, maintaining the output signal.

3. Speed

$$= 400 \text{ pulses/s} \div 200 \text{ steps/rev} = 2 \text{ rev/s} = 120 \text{ RPM}$$

. Since 120 RPM < 600 RPM stall threshold, yes, this speed is achievable.

## Part II

### Signals and Signal Processing

# Chapter 7

## Analog vs. Digital Systems

---

### When to Read This Chapter

**Module 4 (Weeks 5–6):** Read the full chapter before the ADC/sampling lab. The sampling theorem, quantization error, and NI DAQ configuration sections are directly applied in that lab. **Related:** SNR in Chapter 8 (p. 80); DSP fundamentals in Chapter 11 (p. 112).

### 7.1 Continuous and Discrete Signals

An **analog signal** is continuous in both time and amplitude: it can take any value at any instant. A **digital signal** is discrete in both time (sampled at intervals) and amplitude (quantized to finite levels). The real world is analog; computers are digital. The boundary between them is the most critical interface in any measurement system.

### 7.2 Analog-to-Digital Conversion (ADC)

An ADC converts a continuous voltage into a binary number. Three key parameters:

**Resolution** ( $n$  bits): determines the number of discrete levels  $= 2^n$ . A 12-bit ADC divides the input range into 4096 levels. The **least significant bit** (LSB) voltage:

$$\text{LSB} = \frac{V_{\text{range}}}{2^n} \quad (7.1)$$

For a  $\pm 5$  V range (10 V span), 12-bit:  $\text{LSB} = 10/4096 = 2.44$  mV. Any voltage change smaller than 1 LSB is invisible to the ADC.

**Sampling rate** ( $f_s$ ): number of conversions per second. Must satisfy the Nyquist criterion (Chapter 9).

**Input range:** the voltage window the ADC can accept (e.g., 0–5 V,  $\pm 10$  V). Signals outside this range are clipped, losing information and potentially damaging the ADC.

#### 7.2.1 Quantization Error

Every ADC conversion introduces a rounding error of up to  $\pm \frac{1}{2}$  LSB. This error is inherent and cannot be eliminated; it can only be reduced by using a higher-resolution ADC. Quantization noise power is uniformly distributed; its RMS value is  $\text{LSB}/\sqrt{12}$ .

### 7.3 Digital-to-Analog Conversion (DAC)

A DAC converts a digital number back to an analog voltage. Used in control systems (Chapter 16) to drive actuators, in signal generators, and in audio output. Key parameters: resolution (bits), settling time, and output voltage range.



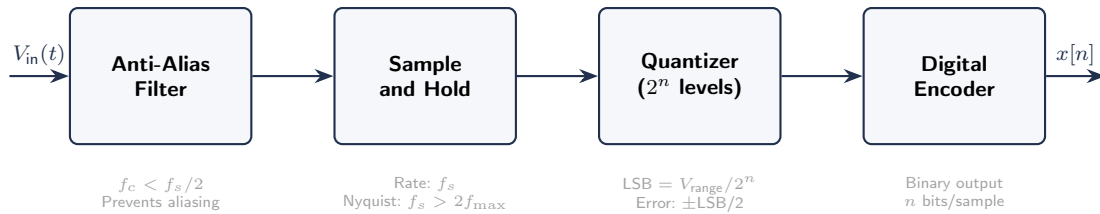


Figure 7.1: The analog-to-digital conversion pipeline. Each stage introduces specific errors: the anti-alias filter must prevent frequency folding, the sample-and-hold sets the temporal resolution, and the quantizer determines amplitude resolution.

## 7.4 Advantages and Trade-offs

| Property           | Analog                                   | Digital                               |
|--------------------|------------------------------------------|---------------------------------------|
| Noise immunity     | Low; noise accumulates through the chain | High; regenerated at each stage       |
| Precision          | Limited by component tolerances          | Limited by bit depth; easily >16 bits |
| Storage            | Degrades over time (tape, film)          | Perfect copies indefinitely           |
| Processing         | Real-time, continuous                    | Requires sampling; introduces latency |
| Flexibility        | Fixed function hardware                  | Software-reconfigurable               |
| Cost for precision | Expensive (matched components)           | Cheap (digital computation)           |

### Keep the Analog Path Clean, Do the Math Digitally

The best practice in modern instrumentation: use high-quality analog signal conditioning (amplification, anti-alias filtering) to bring the signal into the ADC's optimal input range, then do all processing (calibration, filtering, FFT, averaging) in software. This minimizes analog component count and maximizes flexibility.

## 7.5 Sample-and-Hold (S/H)

An ADC takes a finite time to complete a conversion (the **aperture time**). If the input voltage changes during conversion, the result is erroneous. A sample-and-hold circuit captures the analog voltage on a capacitor at the sampling instant and holds it constant while the ADC converts. Most modern ADCs include an internal S/H, but at high sampling rates or with fast-changing signals, the S/H settling time becomes a limitation.

**Aperture jitter:** random variation in the sampling instant. Creates timing uncertainty that converts to amplitude noise. For a sinusoidal signal of frequency  $f$  and amplitude  $V_p$ :

$$V_{\text{noise,jitter}} = 2\pi f \cdot V_p \cdot t_{\text{jitter}} \quad (7.2)$$

At high frequencies, jitter becomes the dominant noise source, limiting effective resolution. For the low-frequency measurements typical of the USB-6001 (<1 kHz), clock jitter is negligible compared to quantization noise and is not a practical concern.

## 7.6 Multiplexing

A DAQ system often uses a single ADC shared among multiple input channels via an **analog multiplexer** (MUX). The MUX switches channels sequentially, so the effective per-channel sampling rate is  $f_s/N_{\text{channels}}$ . This introduces a **channel-to-channel skew**: adjacent channels are sampled at slightly different times.

### Channel Skew in Multiplexed DAQs

If you need simultaneous sampling of multiple channels (e.g., correlating vibration and pressure), a multiplexed DAQ introduces timing errors. The NI USB-6001 (multiplexed) has channel skew; the NI USB-6356 (simultaneous sampling) does not. For timing-critical multi-channel measurements, use a simultaneous-sampling DAQ or synchronize channels with an external trigger.

## 7.7 Common NI DAQ Devices for MEGN 300

| Device   | AI Ch         | Resolution | Max Rate  | Range      | Notes                   |
|----------|---------------|------------|-----------|------------|-------------------------|
| USB-6001 | 8 diff / 4 SE | 14-bit     | 20 kS/s   | $\pm 10$ V | Basic; multiplexed      |
| USB-6002 | 8 diff / 4 SE | 16-bit     | 50 kS/s   | $\pm 10$ V | Higher resolution       |
| USB-6009 | 8 diff / 4 SE | 14-bit     | 48 kS/s   | $\pm 10$ V | Common in teaching labs |
| USB-6356 | 8 AI          | 16-bit     | 1.25 MS/s | $\pm 10$ V | Simultaneous sampling   |

Table 7.1: Common NI DAQ devices for MEGN 300 labs.

## 7.8 The Analog World and Its Limitations

The physical world is inherently analog: temperature, pressure, velocity, and strain are continuous quantities that vary smoothly in both time and amplitude. Analog signals are vulnerable to noise, drift, and degradation during transmission. Every amplifier adds noise, every cable picks up electromagnetic interference, and analog storage degrades with time. This is why modern instrumentation converts signals to digital form as early as possible.

## 7.9 Sampling Theory

Sampling converts a continuous-time signal into a discrete-time sequence. The Nyquist-Shannon sampling theorem states: a bandlimited signal with maximum frequency  $f_{\text{max}}$  can be perfectly reconstructed from its samples if  $f_s > 2f_{\text{max}}$ . The frequency  $f_s/2$  is the Nyquist frequency. Any content above it aliases into the baseband and cannot be removed digitally. The only defense is an analog anti-alias filter before the ADC.

In practice, use  $f_s \geq 10 \times f_{\text{max}}$  for general measurement,  $f_s \geq 20 \times f_{\text{bandwidth}}$  for control systems, and  $f_s = 2.56 \times f_{\text{max}}$  for vibration analysis (the factor 2.56 provides a  $\sim 28\%$  guard band above Nyquist for the anti-aliasing filter transition band, preventing aliased energy near  $f_{\text{max}}$  from corrupting the spectrum).

**Anti-Alias Filter Is Mandatory**

An analog low-pass filter must be present before the ADC in every properly designed system. It cannot be implemented in software because aliasing occurs at the moment of sampling. Set the cutoff at or below  $f_s/2$  with sufficient rolloff (4th order minimum) to attenuate out-of-band content by at least 60 dB.

## 7.10 Quantization in Depth

An  $n$ -bit ADC divides  $V_{\text{range}}$  into  $2^n$  levels. The LSB voltage is  $V_{\text{range}}/2^n$ . Quantization error is  $\pm 0.5$  LSB with RMS value  $\text{LSB}/\sqrt{12}$ . For  $\pm 10$  V range: 12-bit gives 4.88 mV LSB; 14-bit gives 1.22 mV; 16-bit gives 0.305 mV. Each additional bit halves the LSB.

The Effective Number of Bits (ENOB) quantifies actual resolution:  $\text{ENOB} = (\text{SINAD} - 1.76)/6.02$ . A 16-bit ADC may have ENOB of only 13–14 at full speed. Always check ENOB in the datasheet.

## 7.11 Sample-and-Hold and Aperture Effects

The ADC needs a stable input during conversion. A sample-and-hold (S/H) captures the signal at a precise instant. Without it, fast-changing signals cause aperture error:  $\epsilon = 2\pi f \cdot A \cdot t_a$  where  $t_a$  is the aperture time. For  $< 0.5$  LSB error:  $t_a < \text{LSB}/(2\pi f A)$ .

## 7.12 Multiplexing and Channel Skew

Most DAQ devices share one ADC among channels via a multiplexer, introducing interchannel delay. For slowly varying signals this is negligible. For fast signals or phase-sensitive measurements, channel skew distorts results. Solutions: reduce active channels, use simultaneous sample-and-hold, or correct mathematically.

## 7.13 Input Configuration

**Differential:** measures  $V_+ - V_-$ . Rejects common-mode voltages. Mandatory for millivolt signals (thermocouples, bridges). Uses two channels per measurement.

**RSE (Referenced Single-Ended):** measures voltage relative to DAQ ground. Suitable for volt-level grounded sources. Susceptible to ground loops.

**NRSE:** measures relative to a shared analog return. Useful for floating sources.

Always select the smallest input range that encompasses the signal. Using  $\pm 10$  V for a 0–2 V signal wastes 80% of dynamic range, losing 2.3 bits of effective resolution.

**WE ThermoRig: DAQ Configuration**

NI USB-6001: thermocouple signal (amplified to 0–4 V by INA) on AI0+/AI0– in Differential mode. Range: 0–5 V. Rate: 100 S/s ( $10\times$  the 10 Hz signal bandwidth). 14-bit resolution gives  $\text{LSB} = 0.305 \text{ mV} \approx 0.007^\circ\text{C}$  (well below sensor uncertainty). Anti-alias: 2nd-order Sallen-Key LP at 40 Hz before the DAQ.

## 7.14 Digital-to-Analog Conversion

DACs convert digital codes to analog voltages for control signals, excitation waveforms, and test stimuli. Key specs: resolution (bits), settling time, glitch energy, and monotonicity. A reconstruction low-pass filter smooths the DAC's staircase output.

## 7.15 Understanding ADC Architectures

Different applications require different ADC types. **Successive Approximation (SAR)**: the most common for data acquisition. Moderate speed (1 kS/s to 5 MS/s), moderate resolution (12–18 bits). One sample per conversion clock. Ideal for multiplexed multichannel systems.

**Sigma-Delta ( $\Sigma\Delta$ )**: extreme oversampling with noise shaping. Very high resolution (24 bits) at low to moderate bandwidth (10 S/s to 100 kS/s). Best for precision DC and low-frequency measurement (bridges, thermocouples). The NI USB-9219 uses sigma-delta.

**Flash**: fastest (100 MS/s to 1 GS/s) but lowest resolution (6–8 bits). Used in oscilloscopes and radar.

**Pipeline**: high speed with moderate resolution (10–14 bits at 10–200 MS/s). Used in communications and high-speed data acquisition.

## 7.16 Practical DAQ Considerations

**Trigger modes**: start acquisition on an external signal (rising edge, level), software command, or internal timer. Hardware triggering enables synchronized measurement with external events (impact, valve opening).

**Buffer management**: the DAQ fills a hardware buffer (typically 4096–65536 samples). If software does not read the buffer before it fills, samples are lost (buffer overflow). In LabVIEW, the DAQ Read VI must execute faster than the buffer fill rate.

**Timing modes**: finite acquisition (acquire exactly  $N$  samples, then stop) vs. continuous acquisition (run indefinitely, processing data in blocks). Continuous mode is standard for real-time monitoring and control.

**Synchronization**: when using multiple DAQ devices or combining analog and digital I/O, ensure all channels share a common clock and trigger to avoid timing skew.

## 7.17 ADC Architecture Comparison

Different applications demand different ADC types, and understanding the tradeoffs is essential for selecting the right DAQ hardware.

**Successive Approximation Register (SAR)**: uses a binary search algorithm, testing one bit per clock cycle.  $n$  bits require  $n$  clock cycles. Speed: 1 kS/s to 5 MS/s. Resolution: 12–18 bits. Low power. The most common architecture for general-purpose data acquisition. The NI USB-6001 uses a 14-bit SAR ADC.

**Sigma-Delta ( $\Sigma\Delta$ )**: oversamples at  $64\times$ – $256\times$  the output rate, shapes quantization noise to high frequencies, then decimation-filters to the output bandwidth. Very high resolution (24 bits) at low to moderate output rates (10–100 kS/s). Best for precision DC and low-frequency measurement. The NI USB-9219 uses 24-bit sigma-delta.

**Flash**: uses  $2^n - 1$  comparators operating simultaneously. Fastest (100 MS/s to multi-GS/s) but limited resolution (6–8 bits) and high power. Used in oscilloscopes.

**Pipeline:** cascades multiple low-resolution stages, each refining the previous stage's residual error. High speed (10–200 MS/s) with moderate resolution (10–14 bits). Used in communications and high-speed data acquisition.

## 7.18 Practical DAQ Configuration Details

### 7.18.1 Trigger Configuration

**Software trigger:** acquisition starts when the program calls the start function. Simple but introduces variable latency (milliseconds to tens of milliseconds) due to OS scheduling.

**Hardware trigger:** acquisition starts on an external electrical signal (rising/falling edge on a digital input, or analog level crossing). Precise timing ( $<1\ \mu\text{s}$  jitter). Essential for synchronizing acquisition with external events.

**Pre-trigger:** the DAQ continuously acquires data into a circular buffer and, upon trigger, saves the  $N$  most recent samples plus  $M$  post-trigger samples. This captures events that happen before the trigger point, which is essential for analyzing what caused the trigger event.

### 7.18.2 Buffer Management and Data Throughput

The DAQ writes samples to a hardware FIFO buffer. The software must read this buffer before it overflows. At 100 kS/s with a 4096-sample buffer: the buffer fills in 41 ms. The LabVIEW loop must execute a DAQ Read every 41 ms at minimum. In practice, read every 10 ms (1000 samples per read) to provide safety margin. If the loop is slower (due to disk I/O, display updates, or heavy computation), increase the buffer size or reduce the sample rate.

### 7.18.3 Clock Sources

The DAQ's internal clock provides adequate accuracy ( $\pm 50$  ppm typical, or  $\pm 5$  Hz at 100 kS/s) for most applications. For measurements requiring precise frequency accuracy (vibration analysis, phase measurement), use an external clock from a precision oscillator or GPS-disciplined source. For multi-device synchronization, route the master clock from one DAQ to the clock input of the others.

## 7.19 Grounding and Wiring Best Practices for DAQ

**Twisted pair:** twist the signal and return wires together (2–4 turns per inch). This cancels magnetically induced noise because each half-twist receives equal but opposite induced voltage. Use twisted pair for all analog signals longer than 30 cm.

**Shielded cable:** use shielded twisted pair for millivolt-level signals (thermocouples, bridges) or in high-EMI environments (near motors, power electronics). Connect the shield at the DAQ end only; leave it unconnected at the sensor end to avoid ground loops.

**Star grounding:** all analog grounds converge at a single point near the DAQ's analog ground terminal. Never daisy-chain grounds from one sensor to the next; the current from sensor 1 flowing through the shared ground wire creates a voltage drop that offsets sensor 2.

**Cable routing:** keep analog signal cables at least 30 cm from power cables, motor cables, and switching circuits. Cross at right angles when cables must intersect. Never bundle analog and power cables in the same conduit.

### The Most Expensive Mistake in Student Projects

Using a breadboard for signal conditioning circuits in a final project is the most common cause of mysterious noise, intermittent failures, and unreproducible results. Breadboard contacts have variable resistance (0.01–1  $\Omega$ ), parasitic capacitance (2–5 pF per row), and poor high-frequency behavior. For millivolt-level signals, solder all connections to a protoboard or use a custom PCB. Reserve the breadboard for initial prototyping only.

## 7.20 Data Conversion Pipeline

The complete data pipeline from analog sensor to engineering units involves multiple conversion stages, each with its own error contribution:

- (1) **Sensor:** physical quantity  $\rightarrow$  electrical signal. Uncertainty contributions: accuracy, linearity, hysteresis, repeatability.
- (2) **Signal conditioning:** raw electrical  $\rightarrow$  conditioned electrical (amplified, filtered). Error: gain error, offset, noise.
- (3) **ADC:** conditioned voltage  $\rightarrow$  digital code. Error: quantization ( $\pm 0.5$  LSB), DNL/INL, aperture jitter.
- (4) **Calibration equation:** digital code  $\rightarrow$  engineering units. Error: calibration residual, interpolation.
- (5) **Digital processing:** raw engineering units  $\rightarrow$  processed result (filtered, averaged, derived quantities). Error: rounding, truncation, filter transients.

Each stage's error can be analyzed independently and combined via RSS to produce the total system uncertainty.

## 7.21 Common ADC Errors

**Differential nonlinearity (DNL):** the deviation of any ADC step from the ideal 1 LSB width.  $\text{DNL} > +1$  LSB means a missing code (some digital values are never output). For the NI USB-6001:  $\text{DNL} < \pm 1$  LSB (no missing codes guaranteed).

**Integral nonlinearity (INL):** the maximum deviation of the ADC's transfer function from the ideal straight line. INL affects the overall measurement accuracy (not just the step-to-step accuracy). For the NI USB-6001:  $\text{INL} < \pm 4$  LSB at 14-bit.

**Aperture jitter:** variation in the exact sampling instant from sample to sample. For a sinusoidal signal at frequency  $f$ , aperture jitter  $\sigma_t$  produces noise:  $\text{SNR}_{\text{jitter}} = -20 \log_{10}(2\pi f \sigma_t)$  dB. At  $f = 10$  kHz and  $\sigma_t = 50$  ps:  $\text{SNR} = 90$  dB (adequate for 14-bit). At  $f = 1$  MHz:  $\text{SNR} = 50$  dB (limits effective resolution to  $\sim 8$  bits).

## 7.22 Oversampling for Improved Resolution

When oversampling by a factor  $K$  and then digitally low-pass filtering and decimating, the effective resolution improves by approximately  $\log_2(\sqrt{K})$  bits. To gain 1 bit of effective resolution: oversample by  $4\times$ . To gain 2 bits:  $16\times$ . To gain 4 bits (equivalent to upgrading from 12-bit to 16-bit):  $256\times$ .

Example: the NI USB-6001 (14-bit) sampling at 40 kS/s with a 100 Hz signal bandwidth provides  $K = 40000/(2 \times 100) = 200\times$  oversampling. Theoretical resolution improvement:  $\log_2(\sqrt{200}) = 3.8$  bits, giving effective 17.8-bit resolution. In practice, noise and INL limit the actual improvement to

approximately 2–3 bits (16–17 bit effective). Still, this is a significant improvement from a simple, inexpensive DAQ device.

## 7.23 Signal Conditioning Integration with DAQ

The signal conditioning stage must be designed as a unit with the DAQ, not independently. Key integration points:

**Voltage range matching:** the maximum output of the signal conditioning must equal the ADC's full-scale input. Wasting 50% of the input range (e.g., a 0–2.5 V signal on a 0–5 V range) costs one bit of effective resolution. Wasting 90% (0–0.5 V on 0–5 V) costs over 3 bits.

**Impedance matching:** the signal conditioning output impedance must be low enough to charge the ADC's input sampling capacitor within the acquisition time. For a SAR ADC acquiring at 100 kS/s with  $C_{\text{sample}} = 20 \text{ pF}$ : the source impedance should be  $< 1/(2\pi \times 100000 \times 20 \times 10^{-12}) \approx 80 \text{ k}\Omega$ . Most op-amp outputs have  $< 100 \Omega$  impedance, so this is rarely an issue unless you omit the output buffer.

**Common-mode voltage:** the ADC input has a limited common-mode range (typically  $-0.2 \text{ V}$  to  $V_{\text{supply}} + 0.2 \text{ V}$  for single-supply devices). If the signal conditioning output includes a common-mode voltage outside this range (e.g., a thermocouple referenced to earth ground while the DAQ is on USB ground), the ADC produces erroneous readings or damage. Use differential inputs or add a level-shifting circuit.

## 7.24 Multi-Channel Acquisition Strategies

**Sequential scanning:** the MUX connects each channel to the single ADC in turn. Channel rate  $= f_s/N_{\text{channels}}$ . For 8 channels at 100 kS/s total: each channel sampled at 12.5 kS/s. Interchannel delay  $= 1/100000 = 10 \mu\text{s}$ .

**Simultaneous sample-and-hold (SSH):** all channels have dedicated S/H circuits that capture simultaneously, then the single ADC converts each held value sequentially. No channel skew. Available on higher-end DAQ devices (NI USB-6356).

**Channel-to-channel crosstalk:** imperfect MUX isolation allows signal from one channel to leak into the next. Typical crosstalk:  $-80 \text{ dB}$ . For a 5 V signal on channel 0, the leakage onto channel 1 is  $5 \times 10^{-4} = 0.5 \text{ mV}$ . If channel 1 measures a millivolt-level signal, this crosstalk is significant. Solution: separate high-voltage and low-voltage channels, or insert ground channels between them.

## 7.25 Timing Verification

In real-time systems, verify that the LabVIEW loop executes within the required period. Add a “Tick Count” function at the start and end of the loop and compute the elapsed time. If the loop occasionally exceeds the period (a “timing violation”), samples may be lost or the control output may be delayed. Common causes: disk I/O (file write), display updates (front panel), and garbage collection. Solutions: move file writes to a separate parallel loop; reduce front panel update rate to 10 Hz; pre-allocate arrays.

## 7.26 Real-World DAQ System Examples



### 7.26.1 NI USB-6001 (MEGN 300 Standard)

14-bit SAR ADC, 8 AI channels (4 differential),  $\pm 10\text{ V}$  or  $\pm 1\text{ V}$  range, 20 kS/s aggregate (shared among active channels), 2 AO channels (12-bit), 13 DIO lines. USB-powered. Cost:  $\sim \$200$ . Adequate for temperature, strain, and low-frequency vibration measurements. Limited by: single ADC with multiplexer (channel skew), moderate resolution (14-bit), and USB latency ( $\sim 1\text{ ms}$ ).

### 7.26.2 NI USB-9234 (Vibration/Acoustics)

24-bit delta-sigma ADC, 4 AI channels with simultaneous sampling,  $\pm 5\text{ V}$  range, 51.2 kS/s per channel, built-in IEPE excitation for accelerometers, built-in anti-alias filters (software-configurable cutoff). Cost:  $\sim \$1,200$ . The standard for vibration analysis: high resolution, no channel skew, and integrated signal conditioning.

### 7.26.3 Arduino/ESP32 (Embedded/Low-Cost)

12-bit SAR ADC (10-bit on older Arduino), 0–3.3 V input range,  $\sim 1\text{--}100\text{ kS/s}$  depending on configuration. No built-in anti-alias filter, no differential input, moderate noise (2–5 LSB). Cost:  $\$5\text{--}\$15$ . Suitable for slow, non-critical measurements (ambient temperature monitoring, battery voltage). Inadequate for precision measurement without external signal conditioning.

## 7.27 Practical Input Range Optimization

The effective resolution of an ADC depends on how well you use its input range. Define the **range utilization ratio**  $U = V_{\text{signal, pk-pk}}/V_{\text{ADC, range}}$ .

If  $U = 1.0$  (signal fills the entire range): you use all  $n$  bits. If  $U = 0.5$  (signal uses half the range): you lose 1 bit (equivalent to  $n - 1$  bit ADC). If  $U = 0.1$  (signal uses 10%): you lose 3.3 bits.

**Design strategy:** set the signal conditioning gain so that the maximum expected signal (plus noise margin) reaches 80–90% of the ADC's full-scale input. Leave 10–20% headroom for unexpected peaks, noise spikes, and component tolerances. This maximizes the effective resolution while preventing clipping.

Example: thermocouple conditioned by INA128 with  $G = 611$ . Maximum TC output at  $200^\circ\text{C}$ :  $200 \times 0.041 = 8.2\text{ mV}$ . After amplification:  $8.2 \times 611 = 5.01\text{ V}$ . Using the 0–5 V DAQ range:  $U = 5.01/5.0 = 1.0$ . Excellent range utilization. But with the default  $\pm 10\text{ V}$  range:  $U = 5.01/20 = 0.25$ , losing 2 bits of effective resolution.

## 7.28 Timing Accuracy and Jitter

The accuracy of time-domain measurements (period, frequency, phase) depends on the sampling clock accuracy and jitter:

**Clock accuracy:** the NI USB-6001 internal clock has  $\pm 50\text{ ppm}$  accuracy. At 10 kS/s: the actual rate is  $10,000 \pm 0.5\text{ S/s}$ . Over a 10-second acquisition: the timing error accumulates to  $\pm 5\text{ }\mu\text{s}$ . This is negligible for most measurements but significant for precise frequency measurement (use an external crystal oscillator or GPS-disciplined clock for  $< 1\text{ ppm}$  accuracy).

**Clock jitter:** sample-to-sample variation in the sampling instant. Typical: 50–500 ps for a DAQ internal clock. Jitter produces noise proportional to signal frequency:  $\text{SNR}_{\text{jitter}} = -20 \log_{10}(2\pi f \sigma_j)$ . At  $f = 1\text{ kHz}$ ,  $\sigma_j = 200\text{ ps}$ :  $\text{SNR} = 118\text{ dB}$  (far below the ADC noise floor; negligible). At



$f = 10 \text{ MHz}$ ,  $\sigma_j = 200 \text{ ps}$ :  $\text{SNR} = 58 \text{ dB}$  (limits effective resolution to  $\sim 9$  bits). Jitter is only a concern for high-frequency signals.

## 7.29 Practice Questions

1. A 16-bit ADC has an input range of 0–10 V. Calculate the LSB voltage and the maximum quantization error in millivolts.
2. Your sensor outputs 0–50 mV for the full measurement range. Your ADC has a 0–5 V input range and 12-bit resolution. What amplifier gain do you need, and what is the resulting measurement resolution in terms of the sensor output?
3. Explain why a digital system has better noise immunity than an analog system for transmitting data over a long cable.

### 7.29.1 Answers

1.  $\text{LSB} = 10/2^{16} = 10/65536 = 0.153 \text{ mV}$ . Max quantization error  $= \pm 0.5 \times 0.153 = \pm 0.076 \text{ mV}$ .
2. Gain  $= 5 \text{ V}/0.050 \text{ V} = 100$ . Amplified LSB  $= 5/(4096) = 1.22 \text{ mV}$  at the ADC. Referred to the sensor input:  $1.22/100 = 0.0122 \text{ mV} = 12.2 \mu\text{V}$ . Sensor resolution  $= 12.2 \mu\text{V} / (50 \text{ mV}/\text{FS}) = 0.024\% \text{ FS}$ .
3. A digital signal has only two states (0 and 1). As long as noise does not push the signal past the decision threshold, the receiver reconstructs the original data perfectly. An analog signal carries information in continuous voltage levels; any noise added to the signal is indistinguishable from the signal itself and permanently corrupts the measurement.

#### ✓ Mastery Diagnostic:

Analog vs. Digital Systems To demonstrate mastery of this module, you must be able to:

1. Calculate ADC resolution (LSB) and determine whether it is sufficient for a given measurement.
2. Apply the Nyquist criterion and explain why practical sampling rates must exceed  $10 \times f_{\text{max}}$ .
3. Design an anti-alias filter with appropriate cutoff for a given sampling rate.
4. Select between RSE, differential, and NRSE input configurations.
5. Calculate quantization error and its contribution to total measurement uncertainty.

# Chapter 8

## Signal-to-Noise Ratio

### When to Read This Chapter

**Module 4 (Weeks 5–6):** Read alongside the ADC chapter. Focus on noise sources, SNR calculation in dB, and the grounding/shielding sections. These directly apply to debugging noisy signals in the lab. **Related:** ADC fundamentals in Chapter 7 (p. 70); filtering in Chapter 12 (p. 123).

### Industry Insight:

EMI Shielding in EV Test Cells In the Battery Workforce Challenge and EcoCAR Innovation Challenge, student teams instrument hybrid and electric vehicles with dozens of sensors operating alongside 400 V traction inverters switching at 10–20 kHz. The shielding, grounding, and filtering principles in this chapter are the difference between clean thermocouple data and a 60 Hz artifact that makes thermal management analysis useless. Every cable routing decision and filter cutoff traces directly to an EMI requirement in the vehicle integration specification.

## 8.1 Defining SNR

The signal-to-noise ratio quantifies how much useful signal exists relative to unwanted noise:

$$\text{SNR} = \frac{P_{\text{signal}}}{P_{\text{noise}}} = \left( \frac{V_{\text{signal,RMS}}}{V_{\text{noise,RMS}}} \right)^2 \quad (8.1)$$

In decibels:

$$\text{SNR}_{\text{dB}} = 10 \log_{10} \left( \frac{P_{\text{signal}}}{P_{\text{noise}}} \right) = 20 \log_{10} \left( \frac{V_{\text{signal,RMS}}}{V_{\text{noise,RMS}}} \right) \quad (8.2)$$

A 20 dB SNR means the signal is  $10\times$  the noise voltage. A 40 dB SNR means  $100\times$ . An ADC with  $n$  bits has a theoretical maximum SNR of  $6.02n + 1.76$  dB (e.g., 12-bit  $\rightarrow$  74 dB).

## 8.2 Noise Sources in Instrumentation

**Thermal noise** (Johnson-Nyquist):  $V_n = \sqrt{4k_B T R \Delta f}$ , present in every resistor. Reduced by cooling, lowering resistance, or narrowing bandwidth.

**Shot noise:** caused by discrete charge carriers crossing a junction. Proportional to  $\sqrt{I \cdot \Delta f}$ .

**Flicker noise** ( $1/f$  noise): dominant at low frequencies. Reduced by chopper-stabilized amplifiers or AC-coupling.

**Electromagnetic interference** (EMI): coupled from external sources (power lines at 60 Hz, switching regulators, motors). Reduced by shielding, twisted pairs, differential signaling, and filtering.

**Quantization noise:** inherent in ADCs (Chapter 5). Reduced by using higher resolution.

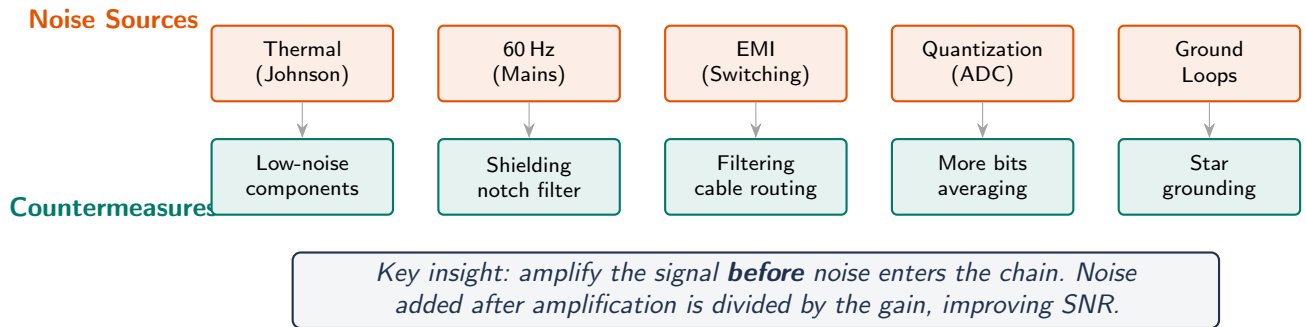


Figure 8.1: Five noise sources in the measurement chain and their countermeasures. Amplify early to maximize SNR.



Figure 8.2: Grounding topologies. Daisy-chain grounding (left) allows motor return current to flow through the sensor ground wire, creating noise. Star grounding (right) gives each device a dedicated return path to a single common point, eliminating ground-loop noise.

### 8.3 Improving SNR

1. **Amplify the signal before the noise is added.** Place the amplifier as close to the sensor as possible.
2. **Filter out-of-band noise.** If your signal is 0–100 Hz, a low-pass filter at 100 Hz removes all higher-frequency noise.
3. **Average repeated measurements.**  $n$  averages improve SNR by  $\sqrt{n}$  ( $10 \log_{10}(n)$  dB).
4. **Use shielded cables and differential signaling.** Rejects common-mode noise.
5. **Reduce bandwidth.** Noise power is proportional to bandwidth. Narrower measurement bandwidth = less noise.

#### 60 Hz Hum

The most common noise source in lab measurements is 60 Hz pickup from AC power lines. Symptoms: a clean-looking signal with a 60 Hz ripple superimposed. Fixes: use shielded cables, ground the shield at one end only, keep signal wires away from power cables, use differential inputs on the DAQ, and add a 60 Hz notch filter in software.

### 8.4 Dynamic Range

The **dynamic range** of a measurement system is the ratio of the largest measurable signal to the smallest detectable signal (noise floor):

$$\text{DR}_{\text{dB}} = 20 \log_{10} \left( \frac{V_{\text{max}}}{V_{\text{noise floor}}} \right) \quad (8.3)$$

For an ideal  $n$ -bit ADC:  $\text{DR} = 6.02n + 1.76$  dB. A 16-bit ADC has a theoretical dynamic range of 98 dB, meaning it can resolve signals spanning a 79,000:1 voltage ratio.

### 8.5 Grounding Best Practices for Low-Noise Measurements

1. **Single-point (star) ground:** all ground returns meet at one physical point near the power supply. Prevents ground loops.
2. **Differential inputs:** measure the voltage difference between two wires, rejecting common-mode noise (60 Hz hum, ground offsets). Always use differential mode on NI DAQs when measuring bridge circuits, thermocouples, or any sensor in a noisy environment.
3. **Shielded cables:** the shield connects to ground at *one end only* (typically the DAQ end). Grounding at both ends creates a ground loop that couples noise.
4. **Twisted pairs:** twisting the signal and return wires reduces magnetic pickup because induced voltages cancel in adjacent twists.
5. **Physical separation:** route signal cables at least 30 cm from power cables. Cross at right angles if they must cross.

**WE ThermoRig: Diagnosing 60 Hz Noise**

The ThermoRig thermocouple signal shows a clean 25 °C reading on the benchtop but develops  $\pm 0.3$  °C oscillation when the heater is powered on. FFT reveals a dominant 60 Hz peak. Root cause: the heater power cable runs parallel to the thermocouple extension wire for 50 cm. Fix: (1) reroute the thermocouple wire away from the heater cable, (2) switch the DAQ to differential input mode, (3) add a 50-point moving average in LabVIEW (effective cutoff well below 60 Hz given the slow thermal process). Result: noise drops to  $\pm 0.02$  °C.

## 8.6 Defining Signal and Noise

The signal carries information about the measurand; noise is everything else. Noise is present at every stage and can never be eliminated completely. The goal is to make the signal large relative to the noise.

## 8.7 The Decibel Scale

SNR in decibels:  $\text{SNR} = 20 \log_{10}(V_s/V_n)$  dB. Reference: 0 dB means signal equals noise. 20 dB means  $10\times$ . 40 dB means  $100\times$ . 60 dB means  $1000\times$ . Maximum theoretical ADC SNR:  $6.02n + 1.76$  dB. Doubling signal power adds 3 dB; doubling voltage adds 6 dB;  $10\times$  voltage adds 20 dB.

## 8.8 Noise Classification

**Thermal noise:**  $V_n = \sqrt{4k_B T R B}$ . At 300 K, a 10 k $\Omega$  resistor over 10 kHz:  $V_n = 1.28 \mu\text{V}$ . This is the fundamental noise floor.

**Shot noise:**  $I_n = \sqrt{2q I_{DC} B}$ . Appears in semiconductor junctions.

**Flicker (1/f) noise:** increases at low frequencies. Dominant below  $\sim 1$  kHz in semiconductors. Makes precision DC measurements harder than AC.

**EMI:** 60 Hz from power lines (capacitive and inductive coupling), switching supply harmonics (100 kHz–1 MHz), motor commutation, fluorescent lighting. EMI has specific frequencies visible as FFT spikes.

## 8.9 Grounding Best Practices

**Single-point (star) ground:** all grounds connect at one point. Prevents ground loops.

**Separate analog/digital grounds:** digital switching noise must not contaminate analog signal paths. Connect grounds only at the star point.

**Shield grounding:** connect cable shields at one end only (DAQ end). Both-end grounding creates a ground loop.

**Decoupling:** 100 nF ceramic at every IC power pin, 10  $\mu\text{F}$  electrolytic at each rail entry point.

**WE ThermoRig: Diagnosing 60 Hz Noise**

Initial testing showed  $\pm 2$  °C oscillation at 60 Hz (visible in FFT with harmonics at 120, 180, 240 Hz). Root cause: heater cable ran parallel to thermocouple cable, coupling 60 Hz capacitively. Fix: separated cables by 15 cm, used shielded TC wire (shield grounded at DAQ), switched to

Differential mode. Result: 60 Hz spike dropped from 2 °C to 0.01 °C. Cost: \$0 and 10 minutes.

## 8.10 Noise in the Signal Chain

Noise at the sensor end is amplified by the full system gain and dominates the output. Noise at the DAQ end is not amplified. **Golden rule:** amplify as early as possible, as close to the sensor as possible.

For a two-stage system with gains  $G_1$  and  $G_2$  and stage noise  $V_{n,1}$ ,  $V_{n,2}$ :

$$V_{n,\text{out}} = \sqrt{(G_1 G_2 V_{n,\text{src}})^2 + (G_2 V_{n,1})^2 + V_{n,2}^2}$$

. The first stage's noise is amplified by  $G_2$ ; the second stage's noise appears directly.

## 8.11 SNR Improvement Techniques

**Averaging:**  $N$  averages reduces random noise by  $\sqrt{N}$ , improving SNR by  $10 \log_{10}(N)$  dB. 100 averages = +20 dB. Does not help with systematic errors or correlated noise.

**Filtering:** noise power  $\propto$  bandwidth. Halving BW improves SNR by 3 dB. Use the narrowest BW consistent with the signal.

**Differential inputs:** rejects common-mode interference (60 Hz, ground offsets).

**Shielding:** Faraday cage around sensitive circuits blocks electric field coupling.

**Synchronous detection (lock-in):** modulate signal at known frequency, extract with narrow-band detection. Can measure signals 60 dB below the noise floor.

## 8.12 Noise Spectral Density

Noise is characterized by its power spectral density (PSD), measured in  $\text{V}^2/\text{Hz}$  (or equivalently  $\text{nV}/\sqrt{\text{Hz}}$  for voltage noise density). The total noise voltage in a measurement with bandwidth  $B$  is  $V_n = e_n \sqrt{B}$  where  $e_n$  is the noise density. This is why reducing measurement bandwidth directly reduces noise.

Op-amp noise density is specified on the datasheet as  $e_n$  (input-referred voltage noise) and  $i_n$  (input-referred current noise). For an op-amp with  $e_n = 10 \text{ nV}/\sqrt{\text{Hz}}$  and bandwidth  $B = 10 \text{ kHz}$ :  $V_n = 10 \times \sqrt{10000} = 1 \mu\text{V}$  RMS input-referred noise.

## 8.13 Dynamic Range

The dynamic range is the ratio between the largest and smallest signals the system can measure simultaneously:  $\text{DR} = 20 \log_{10}(V_{\text{max}}/V_{\text{min,detectable}})$  dB. For an ideal  $n$ -bit ADC,  $\text{DR} = 6.02n + 1.76$  dB. In practice, noise limits the minimum detectable signal, reducing the effective dynamic range.

## 8.14 Ground Loops: Diagnosis and Cure

A ground loop occurs when two or more ground connections create a closed current path. Current flowing through the finite impedance of the ground conductor creates a voltage drop that appears

as noise. Symptoms: large 60 Hz component in the FFT, noise that changes when you touch the cable, noise that depends on the position of nearby equipment.

Diagnosis: disconnect the sensor. If the noise disappears, the ground loop is between the sensor and DAQ. If it persists, the loop is internal to the DAQ/computer.

Cure: (1) use differential inputs (measures between two signal wires, ignoring ground). (2) Use a single-point ground topology. (3) Insert an isolation amplifier or optocoupler to break the galvanic path. (4) Use battery-powered (floating) sensor excitation.

## 8.15 EMI Shielding Effectiveness

Cable shielding is characterized by its transfer impedance  $Z_t$  (in  $\Omega/\text{m}$ ), which describes how much external interference voltage appears on the inner conductor per unit length. Lower is better. Single-braid shield:  $Z_t \approx 10 \text{ m}\Omega/\text{m}$  at low frequencies. Double-braid:  $\approx 1 \text{ m}\Omega/\text{m}$ . Foil shield: excellent at high frequencies but poor at low frequencies due to limited coverage. For best performance, use a foil + braid combination.

## 8.16 Noise Budget Analysis

Just as an error budget allocates measurement uncertainty across the signal chain, a **noise budget** allocates the noise contribution of each component. The total output-referred noise is:

$$V_{n,\text{total}} = \sqrt{(G_{\text{total}} \cdot e_{n,\text{sensor}})^2 + (G_2 G_3 \cdot e_{n,\text{amp1}})^2 + (G_3 \cdot e_{n,\text{amp2}})^2 + e_{n,\text{ADC}}^2} \quad (8.4)$$

where  $G_i$  are the gains of each stage and  $e_{n,i}$  are the input-referred noise voltages. The key insight: the first stage's noise is amplified by the full remaining gain, while later stages contribute progressively less.

### 8.16.1 Worked Example

Consider: sensor noise  $e_n = 2 \mu\text{V}/\sqrt{\text{Hz}}$ , first amplifier (INA128)  $e_n = 8 \text{ nV}/\sqrt{\text{Hz}}$  at gain  $G_1 = 100$ , second stage filter buffer  $e_n = 15 \text{ nV}/\sqrt{\text{Hz}}$  at gain  $G_2 = 1$ , ADC noise floor  $200 \mu\text{V}$  RMS. System bandwidth  $100 \text{ Hz}$ .

Sensor contribution at output:  $100 \times 1 \times 2 \mu\text{V} \times \sqrt{100} = 2,000 \mu\text{V}$ . INA128 contribution:  $1 \times 8 \text{ nV} \times \sqrt{100} = 0.08 \mu\text{V}$  (negligible). Buffer contribution:  $15 \text{ nV} \times \sqrt{100} = 0.15 \mu\text{V}$  (negligible). ADC:  $200 \mu\text{V}$  (fixed). Total:  $\sqrt{2000^2 + 0.08^2 + 0.15^2 + 200^2} = 2010 \mu\text{V}$ .

The sensor dominates completely (99.5% of noise power). A lower-noise amplifier would not improve the system. Reducing the sensor noise (e.g., by using a less noisy sensor type) or reducing the bandwidth (e.g., filtering at  $10 \text{ Hz}$  instead of  $100 \text{ Hz}$ , reducing sensor noise by  $\sqrt{10} = 3.16\times$ ) are the only effective strategies.

## 8.17 Common-Mode Rejection in Practice

Common-mode voltage ( $V_{CM}$ ) is the average voltage at the two differential inputs relative to ground. It represents ground offsets, 60 Hz pickup, and other interference that appears equally on both input wires. The differential amplifier (or INA) rejects this common-mode signal while amplifying the differential signal.

CMRR is typically specified at DC (e.g., 120 dB for INA128 at  $G = 100$ ) but degrades at higher frequencies. At 60 Hz, CMRR might be only 80–90 dB. This is still excellent: 80 dB CMRR means a 1 V common-mode voltage at 60 Hz produces only  $1 \text{ V}/10,000 = 100 \mu\text{V}$  of interference at the output. For a thermocouple producing 4 mV, this is a 2.5% error, which is significant. Higher CMRR or better shielding/grounding is needed.

## 8.18 Noise Figure

The noise figure ( $NF$ ) quantifies how much a component degrades the SNR:

$$NF = 10 \log_{10} \left( \frac{\text{SNR}_{\text{in}}}{\text{SNR}_{\text{out}}} \right) \text{ dB} \quad (8.5)$$

An ideal amplifier has  $NF = 0 \text{ dB}$  (adds no noise). Real amplifiers have  $NF = 1\text{--}10 \text{ dB}$ . The system noise figure is dominated by the first stage (Friis formula):

$$NF_{\text{total}} \approx NF_1 + \frac{NF_2 - 1}{G_1} + \frac{NF_3 - 1}{G_1 G_2} + \dots \quad (8.6)$$

With  $G_1 = 100$ : even if the second stage has  $NF_2 = 10 \text{ dB}$  ( $F_2 = 10$ ), its contribution is  $(10 - 1)/100 = 0.09$ , adding only 0.04 dB to the system noise figure. This mathematically confirms the golden rule: the first amplifier determines the system noise performance.

## 8.19 Noise Measurement Techniques

To characterize the noise of your measurement system: (1) Short the input (connect the two differential inputs together). (2) Acquire  $N \geq 10,000$  samples at the normal operating sample rate. (3) Compute the RMS of the acquired data: this is the total system noise floor. (4) Compute the FFT: peaks at specific frequencies indicate EMI (60 Hz, switching noise); a flat floor indicates thermal/shot noise.

Compare the measured noise to the theoretical prediction from the noise budget. If the measured noise significantly exceeds the prediction, look for: ground loops, EMI pickup, inadequate decoupling, or oscillating amplifiers.

## 8.20 Signal Recovery from Noise

**Coherent averaging (signal averaging):** for repetitive signals (triggered waveforms), average  $N$  acquisitions. Random noise cancels; the signal accumulates. SNR improves by  $\sqrt{N}$ . Used in oscilloscopes, vibration analyzers, and evoked-potential medical instruments.

**Correlation:** cross-correlate the measured signal with a reference waveform. The correlation peak indicates the presence and timing of the signal, even when buried in noise. This is the mathematical basis of lock-in amplification and GPS signal detection.

**Matched filtering:** design a filter whose impulse response matches the expected signal shape. The matched filter maximizes the SNR at the output for a known signal in white noise. Used in radar and communications.



## 8.21 Noise Measurement Procedure for MEGN 300 Labs

A systematic noise characterization should be performed as the first step in any lab:

(1) **Short-input test:** connect AI+ to AI– at the DAQ terminal block (zero signal). Acquire 10,000 samples at the operating sample rate. Compute the standard deviation: this is your system noise floor. Compare to the theoretical LSB noise:  $\text{LSB}/\sqrt{12}$ . If measured noise is  $> 3\times$  theoretical, there is excess noise from grounding, EMI, or power supply issues.

(2) **Resistor-terminated test:** connect a precision resistor across the differential inputs equal to the sensor's output impedance. This includes the thermal noise of the resistor. Compare to the short-input noise: the increase is the thermal noise contribution.

(3) **Sensor-connected test:** connect the actual sensor in the actual mounting configuration. Acquire with the same settings. This captures all real-world noise sources: sensor noise, cable pickup, ground loops, and environmental interference.

(4) **FFT analysis:** compute the FFT of the noise data. Identify discrete peaks (60 Hz, switching frequencies, resonances) vs. broadband floor. Address the discrete peaks first (grounding, shielding, filtering), then evaluate whether the broadband floor meets the SNR requirement.

## 8.22 SNR Requirements for Different Measurement Types

The following values are approximate guidelines that depend on the specific measurement goal. Detecting that a signal is present requires less SNR than accurately measuring its amplitude, which in turn requires less than resolving fine spectral features. **Temperature monitoring ( $\pm 1^\circ\text{C}$ ):** SNR  $> 40\text{ dB}$  is adequate. Easy to achieve with any modern DAQ.

**Strain measurement ( $\pm 10\ \mu\epsilon$ ):** requires SNR  $> 60\text{ dB}$ . Demands careful grounding, shielded cabling, and a low-noise INA.

**Vibration analysis (resolving 60 dB dynamic range):** requires SNR  $> 80\text{ dB}$ . Requires IEPE accelerometers with built-in signal conditioning, differential transmission, and proper anti-alias filtering.

**Audio-quality measurement:** SNR  $> 90\text{ dB}$ . Requires precision ADCs (24-bit sigma-delta), balanced signal paths, and low-noise power supplies.

## 8.23 Quantifying EMI: Conducted vs. Radiated

EMI enters the measurement circuit through two mechanisms:

**Conducted EMI:** noise current flowing on power supply lines, ground wires, or signal cables. The noise originates from switching power supplies, motor drives, or digital circuits, and propagates through shared conductors. Mitigation: ferrite beads on power lines, LC filters at power entry points, separate power supplies for analog and digital circuits.

**Radiated EMI:** electromagnetic fields from nearby sources (power lines, transformers, motors, RF transmitters, switching converters) couple into cables and circuits acting as antennas. Mitigation: shielding (Faraday cages, shielded cables), reducing cable loop area (twisted pair), increasing distance from the source (field strength decreases as  $1/r^2$  for near-field sources).

The distinction matters for diagnosis: if noise disappears when you disconnect the signal cable (leaving the DAQ connected to nothing), the noise is conducted on the cable. If noise persists with the cable disconnected, it is radiated into the DAQ directly (or conducted on the power supply).

## 8.24 Power Supply Noise

The DAQ and signal conditioning circuits require clean power. A switching regulator (buck/boost) produces ripple at the switching frequency (typically 100 kHz–2 MHz) and its harmonics. This ripple appears on the power rail as a 10–50 mV<sub>pk-pk</sub> sawtooth waveform that directly modulates the op-amp’s output through the Power Supply Rejection Ratio (PSRR).

For an op-amp with PSRR = 80 dB at 100 kHz, a 20 mV power supply ripple produces  $20 \times 10^{-4} = 0.002$  mV (2  $\mu$ V) at the output. At gain 1000, this becomes 2 mV, which may be significant for millivolt-level measurements. Solution: use a linear regulator after the switching regulator (the linear regulator’s PSRR further attenuates the switching noise by 40–60 dB), or power the analog circuits from a separate linear supply.

## 8.25 SNR Improvement: A Quantitative Case Study

ThermoRig initial setup: thermocouple ( $e_n = 2 \mu\text{V}/\sqrt{\text{Hz}}$ , measured at sensor), INA128 ( $G = 611$ ), no anti-alias filter, RSE input mode, DAQ at  $\pm 10$  V range, 1 kS/s.

**Initial SNR:** signal at  $80^\circ\text{C} = 3.3 \text{ mV} \times 611 = 2.0 \text{ V}$ . Noise at output: 120 mV RMS (dominated by 60 Hz at 80 mV and broadband above 100 Hz at 90 mV).  $\text{SNR} = 20 \log(2.0/0.12) = 24 \text{ dB}$ . Terrible.

**Fix 1:** switch to Differential mode. 60 Hz drops from 80 mV to 2 mV ( $\sim 30$  dB improvement in 60 Hz component).

**Fix 2:** add 2nd-order anti-alias LP at 40 Hz. Broadband noise above 40 Hz removed. Remaining noise: 8 mV RMS.

**Fix 3:** change input range from  $\pm 10$  V to 0–5 V ( $4\times$  better resolution). Quantization noise drops below 0.3 mV.

**Fix 4:** average 100 samples per reading (at 100 S/s: 1 s averaging time). Remaining random noise:  $8/\sqrt{100} = 0.8 \text{ mV}$ .

**Final SNR:**  $20 \log(2000/0.8) = 68 \text{ dB}$ . Improved from 24 dB to 68 dB, a 44 dB ( $160\times$ ) improvement, using only software and configuration changes (no hardware cost).

## 8.26 Dynamic Range and Effective Bits

The **dynamic range** of a measurement system is the ratio between the largest signal it can measure (without clipping) and the smallest signal it can detect (above the noise floor), expressed in dB:

$$\text{DR} = 20 \log_{10} \left( \frac{V_{\max}}{V_{\text{noise, RMS}}} \right) \text{ dB} \quad (8.7)$$

For an ideal  $n$ -bit ADC:  $\text{DR} = 6.02n + 1.76 \text{ dB}$ . For the NI USB-6001 (14-bit,  $\pm 10$  V range): ideal DR = 86 dB. In practice, noise from the signal conditioning chain reduces DR below the ideal. If the total system noise is 2 mV RMS on a  $\pm 10$  V range:  $\text{DR} = 20 \log_{10}(10/0.002) = 74 \text{ dB}$ , equivalent to  $\text{ENOB} = (74 - 1.76)/6.02 = 12.0$  effective bits. The signal conditioning has cost 2 bits of dynamic range.

This is why the noise budget matters: it directly determines how much of the ADC’s resolution is actually usable.

## 8.27 Noise Floor and Minimum Detectable Signal

The minimum detectable signal (MDS) is typically defined as the signal level equal to the RMS noise floor ( $\text{SNR} = 0 \text{ dB}$ ) or  $3\times$  the noise floor ( $\text{SNR} = 10 \text{ dB}$ , commonly used). Any signal below the MDS is buried in noise and cannot be reliably measured.

For the ThermoRig with  $0.8 \text{ mV}$  total output noise (after all improvements):  $\text{MDS} = 3 \times 0.8 = 2.4 \text{ mV}$ , corresponding to  $2.4/(611 \times 0.041) = 0.096^\circ\text{C}$  at the thermocouple. Any temperature change smaller than  $0.1^\circ\text{C}$  cannot be reliably detected. This is  $10\times$  better than the  $\pm 1^\circ\text{C}$  requirement, meaning the system has ample SNR margin.

## 8.28 Noise in Data Acquisition Systems

The total noise at the DAQ output includes contributions from multiple sources, combined by RSS:

**Sensor noise:** inherent to the sensor physics (thermal noise in resistive sensors, shot noise in photodiodes). Set by the sensor type and operating conditions.

**Signal conditioning noise:** op-amp voltage and current noise, resistor thermal noise in the gain and filter networks. Dominated by the first amplifier stage.

**EMI pickup:**  $60 \text{ Hz}$  and harmonics from power lines, switching frequencies from nearby electronics. Reducible by shielding, grounding, and differential inputs.

**DAQ noise:** quantization noise ( $\text{LSB}/\sqrt{12}$ ), ADC comparator noise, clock jitter. Fixed by the DAQ hardware; the only mitigation is choosing a better DAQ.

**Software noise:** rounding in calibration calculations, truncation in filter coefficients. Usually negligible with 64-bit double precision.

## 8.29 Lock-In Amplification: Extracting Signals from Noise

For the most demanding measurement applications (measuring signals  $60\text{--}120 \text{ dB}$  below the noise floor), **lock-in amplification** uses synchronous detection. The principle:

(1) Modulate the measurand at a known reference frequency  $f_{\text{ref}}$  (e.g., chop the light beam in an optical measurement). (2) Amplify the sensor signal, which now contains the desired signal at  $f_{\text{ref}}$  plus broadband noise. (3) Multiply the amplified signal by a reference sine wave at  $f_{\text{ref}}$  (the “demodulation” step). This shifts the signal to DC while spreading the noise across all frequencies. (4) Low-pass filter the result with a very narrow bandwidth ( $0.01\text{--}1 \text{ Hz}$ ). The filter passes only the DC component (the desired signal) and rejects all noise except in the narrow band around  $f_{\text{ref}}$ .

The effective noise bandwidth is the LP filter bandwidth, not the signal bandwidth. A lock-in with  $0.1 \text{ Hz}$  bandwidth on a system with  $10 \text{ kHz}$  signal bandwidth achieves  $10 \log_{10}(10000/0.1) = 50 \text{ dB}$  improvement in SNR. This is why lock-in amplifiers can detect nanovolt signals in millivolt noise.

While lock-in amplification is beyond the scope of MEGN 300 labs, understanding the principle illustrates the power of frequency-domain noise rejection and motivates the simpler techniques (averaging, filtering, differential inputs) used in your projects.

## 8.30 Practice Questions

1. A sensor produces  $100 \text{ mV}_{\text{RMS}}$  signal with  $2 \text{ mV}_{\text{RMS}}$  noise. Calculate the SNR in dB.
2. You average 64 measurements. By how many dB does the SNR improve?

3. A 14-bit ADC has a theoretical SNR of how many dB? If the noise floor is  $0.5 \text{ mV}_{\text{RMS}}$  and the input range is 0–5 V, is the system noise-limited or quantization-limited?

### 8.30.1 Answers

1.  $\text{SNR} = 20 \log_{10}(100/2) = 20 \log_{10}(50) = 34.0 \text{ dB}$ .
2.  $\text{Improvement} = 10 \log_{10}(64) = 18.1 \text{ dB}$ .
3. Theoretical:  $6.02 \times 14 + 1.76 = 86.0 \text{ dB}$ .  $\text{ADC LSB} = 5/2^{14} = 0.305 \text{ mV}$ . Quantization noise RMS  $= 0.305/\sqrt{12} = 0.088 \text{ mV}$ . System noise floor is  $0.5 \text{ mV} \gg 0.088 \text{ mV}$ ; the system is noise-limited, not quantization-limited. The extra ADC bits are wasted unless the noise is reduced.

## Chapter 9

# Fourier Series and Complex Signal Construction

### When to Read This Chapter

**Module 5 (Weeks 7–8):** Read before the Fourier/FFT lab. Focus on the Fourier series coefficients, the concept of frequency-domain representation, and the common spectra table.

**Related:** FFT implementation in Chapter 10 (p. 101); filter design in Chapter 12 (p. 123).

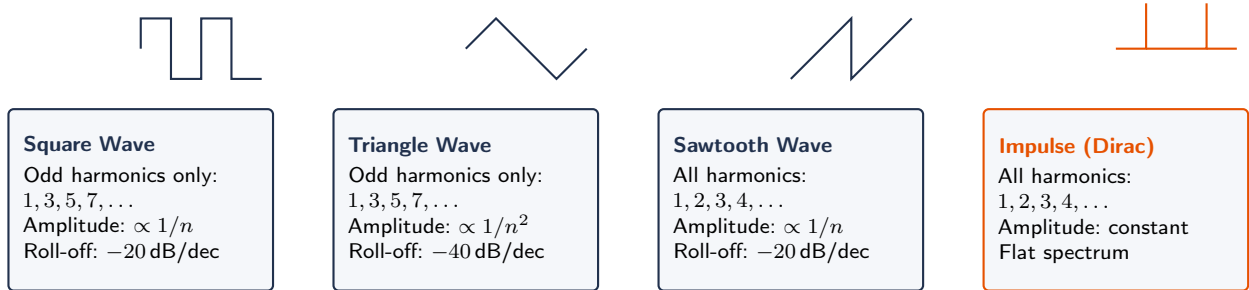


Figure 9.1: Fourier spectra of common periodic waveforms. Square and triangle waves contain only odd harmonics; sawtooth contains all harmonics. The roll-off rate determines how many harmonics carry significant energy, which in turn determines the bandwidth required to faithfully measure the signal.

### 9.1 The Fourier Principle

Any periodic signal  $x(t)$  with period  $T$  can be represented as a sum of sinusoids at the fundamental frequency  $f_0 = 1/T$  and its integer harmonics:

$$x(t) = \frac{a_0}{2} + \sum_{n=1}^{\infty} [a_n \cos(2\pi n f_0 t) + b_n \sin(2\pi n f_0 t)] \quad (9.1)$$

where the Fourier coefficients are:

$$a_n = \frac{2}{T} \int_0^T x(t) \cos(2\pi n f_0 t) dt \quad (9.2)$$

$$b_n = \frac{2}{T} \int_0^T x(t) \sin(2\pi n f_0 t) dt \quad (9.3)$$

$a_0/2$  is the DC offset (average value). Each  $(a_n, b_n)$  pair defines the amplitude and phase of the  $n$ -th harmonic.

## 9.2 Common Waveform Decompositions

**Square wave** (amplitude  $A$ , period  $T$ ):

$$x(t) = \frac{4A}{\pi} \sum_{n=1,3,5,\dots}^{\infty} \frac{1}{n} \sin(2\pi n f_0 t) \quad (9.4)$$

Contains only odd harmonics. The amplitude of each harmonic decreases as  $1/n$ .

**Triangle wave**: contains only odd harmonics, with amplitudes decreasing as  $1/n^2$ .

**Sawtooth wave**: contains all harmonics (odd and even), with amplitudes decreasing as  $1/n$ .

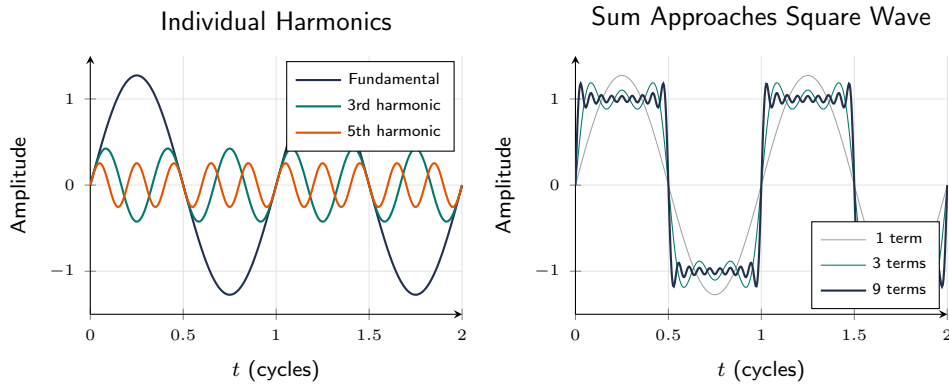


Figure 9.2: Fourier decomposition of a square wave. Left: individual odd harmonics. Right: as more terms are summed, the result approaches the square wave. Low-pass filtering removes high harmonics, rounding the edges.

### Why Fourier Series Matters for Instrumentation

Every real signal is a superposition of sinusoids. If your measurement system attenuates or phase-shifts any frequency component differently from others, the reconstructed signal is distorted. Understanding Fourier decomposition lets you predict how your sensor's frequency response (Chapter 3) and your filters (Chapters 10–11) will affect the measured signal.

## 9.3 Why Frequency Matters in Instrumentation

Every sensor, amplifier, filter, and ADC has a frequency-dependent response. To understand, predict, and design these behaviors, we need to describe signals in terms of frequency content. The Fourier series provides this: any periodic signal decomposes into sinusoids at harmonics of the fundamental frequency.

## 9.4 Mathematical Foundation

A periodic signal  $x(t)$  with period  $T$  and fundamental  $f_0 = 1/T$ :

$$x(t) = \frac{a_0}{2} + \sum_{n=1}^{\infty} [a_n \cos(2\pi n f_0 t) + b_n \sin(2\pi n f_0 t)] \quad (9.5)$$

where  $a_n = (2/T) \int_0^T x(t) \cos(2\pi n f_0 t) dt$  and  $b_n = (2/T) \int_0^T x(t) \sin(2\pi n f_0 t) dt$ . The amplitude of the  $n$ th harmonic is  $c_n = \sqrt{a_n^2 + b_n^2}$ .

## 9.5 Common Waveforms

**Square wave:**

$$x(t) = (4A/\pi)[\sin(\omega_0 t) + \sin(3\omega_0 t)/3 + \sin(5\omega_0 t)/5 + \dots]$$

. Only odd harmonics, amplitudes  $\propto 1/n$ . Sharp edges require many harmonics.

**Triangle wave:** odd harmonics, amplitudes  $\propto 1/n^2$ . Converges faster because transitions are smooth.

**Sawtooth:** all harmonics, amplitudes  $\propto 1/n$ .

## 9.6 Physical Interpretation

A measurement system must pass all significant harmonics. A sensor measuring a 100 Hz square wave must have bandwidth covering at least the 5th harmonic (500 Hz) to avoid severe distortion. For faithful edge reproduction, the 11th harmonic (1100 Hz) or higher is needed.

## 9.7 The Gibbs Phenomenon

Truncating the series near a discontinuity produces  $\sim 9\%$  overshoot that narrows but never disappears with more terms. In instrumentation, this manifests as “ringing” when a filter truncates harmonics.

## 9.8 From Series to Transform

The Fourier series applies to periodic signals. The Fourier transform generalizes to non-periodic signals (transients, events) by letting the period approach infinity. The discrete version (DFT/FFT) is the computational tool used in digital systems (Chapter 8).

### Parseval's Theorem

Total signal energy is the same in time and frequency domains:  $\sum |x[n]|^2 = (1/N) \sum |X[k]|^2$ . A filter removing frequency components removes their energy. If noise is concentrated in a narrow band (e.g., 60 Hz), a notch filter removes that energy without affecting the rest.

## 9.9 Complex Exponential Representation

Euler's formula  $e^{j\theta} = \cos \theta + j \sin \theta$  allows sine and cosine to be combined into a single complex exponential. The Fourier series in complex form:

$$x(t) = \sum_{n=-\infty}^{\infty} c_n e^{j2\pi n f_0 t} \quad (9.6)$$

where  $c_n = (1/T) \int_0^T x(t) e^{-j2\pi n f_0 t} dt$ . Negative frequencies are mathematical conveniences representing the complex conjugate of positive frequencies. For real signals,  $c_{-n} = c_n^*$ .

## 9.10 Convergence and the Dirichlet Conditions

The Fourier series converges for any signal satisfying the Dirichlet conditions: (1) finitely many discontinuities per period, (2) finitely many maxima and minima per period, (3) absolutely integrable over one period. All physical signals satisfy these conditions.

## 9.11 Practical Implications for Bandwidth Requirements

To pass a square wave through a measurement system with less than 10% distortion (measured by total harmonic distortion, THD), you must pass harmonics through the 7th ( $7f_0$ ). For less than 5%: through the 11th. For less than 1%: through the 25th or higher. This directly determines the sensor and filter bandwidth requirements.

A 100 Hz square wave with 5% THD limit requires system bandwidth  $\geq 1100$  Hz. If your anti-alias filter cuts off at 500 Hz, the 7th harmonic (700 Hz) and above are removed, distorting the signal.

## 9.12 Spectral Analysis of Real Signals

Real instrumentation signals are never pure sinusoids. A motor vibration signal typically contains: the fundamental rotation frequency, harmonics from gear tooth meshing, bearing defect frequencies, and broadband noise from turbulence. Fourier analysis separates these into distinct spectral lines, enabling diagnosis. A peak at  $f = N_{\text{teeth}} \times f_{\text{shaft}}$  identifies gear mesh; a peak at  $0.4 \times f_{\text{shaft}}$  identifies a ball-bearing outer race defect.

## 9.13 Why Engineers Must Think in Frequency

Consider a vibrating beam. In the time domain, you see a complex, seemingly random oscillation. In the frequency domain, you see three sharp peaks: the first, second, and third natural frequencies at 15, 94, and 263 Hz. Each peak corresponds to a mode shape. The frequency domain reveals the physics; the time domain obscures it.

This principle applies universally in instrumentation: noise has a spectrum (concentrated at 60 Hz and its harmonics), sensor bandwidth is defined in frequency, filter design is frequency-domain engineering, and control system stability is analyzed in frequency. Fourier analysis is the bridge between the physical time-domain world and the engineering frequency-domain tools.

## 9.14 Even and Odd Function Decomposition

Any signal can be decomposed into an even part  $x_e(t) = [x(t) + x(-t)]/2$  and an odd part  $x_o(t) = [x(t) - x(-t)]/2$ . The even part has only cosine terms in the Fourier series ( $b_n = 0$ ); the odd part has only sine terms ( $a_n = 0$ ). This simplifies computation: if you know a signal is symmetric about  $t = 0$  (even), you only need to compute cosine coefficients. If anti-symmetric (odd), only sine coefficients.



## 9.15 Power and Energy in the Frequency Domain

The average power of a periodic signal can be computed from its Fourier coefficients (Parseval's theorem):

$$P = \frac{a_0^2}{4} + \frac{1}{2} \sum_{n=1}^{\infty} (a_n^2 + b_n^2) = c_0^2 + \frac{1}{2} \sum_{n=1}^{\infty} c_n^2 \quad (9.7)$$

This means the total power is the sum of the power in each harmonic. A useful metric: the fraction of total power contained in the first  $N$  harmonics indicates how many harmonics are “significant.” For a square wave, 90% of the power is in the first 3 harmonics ( $f_0$ ,  $3f_0$ ,  $5f_0$ ). For a triangle wave, 98% is in the first 3. This quantifies the bandwidth needed to capture the signal.

## 9.16 Total Harmonic Distortion (THD)

THD quantifies how much a system distorts a pure sine wave:

$$\text{THD} = \frac{\sqrt{c_2^2 + c_3^2 + c_4^2 + \cdots}}{c_1} \times 100\% \quad (9.8)$$

where  $c_1$  is the fundamental amplitude and  $c_n$  are the harmonic amplitudes. A DAQ with 0.01% THD introduces negligible distortion. A sensor or amplifier with 1% THD generates significant harmonics that may be confused with real signal content. In vibration analysis, THD of the excitation source must be verified before using it for frequency response measurement.

## 9.17 Modulation and Demodulation

**Amplitude modulation (AM):** a low-frequency signal (e.g., strain gauge bridge output at 10 Hz) modulates the amplitude of a high-frequency carrier (e.g., 5 kHz excitation). The spectrum of the AM signal contains the carrier at 5 kHz and sidebands at 4990 Hz and 5010 Hz. Demodulation recovers the original 10 Hz signal. Advantage: the signal is shifted to a frequency range where 1/f noise and DC drift are negligible.

**Frequency modulation (FM):** the signal modulates the frequency of an oscillator. Used in voltage-to-frequency (VFC) converters for noise-immune data transmission over long cables. A 0–10 V signal modulates a 10–100 kHz oscillator. The receiver counts the frequency to recover the voltage.

## 9.18 Discrete Fourier Series and the Transition to DFT

When a computer processes sampled data, the continuous integrals of the Fourier series become discrete sums. For a periodic signal sampled at  $N$  equally spaced points:

$$c_k = \frac{1}{N} \sum_{n=0}^{N-1} x[n] e^{-j2\pi kn/N} \quad (9.9)$$

This is the Discrete Fourier Transform (DFT), covered in full in Chapter 8. The key insight:  $N$  samples produce  $N$  frequency coefficients, but only  $N/2$  are unique (the other half are complex conjugates). The frequency spacing is  $\Delta f = f_s/N$ , and the maximum frequency is  $f_s/2$ .

## 9.19 Windowing Preview

The DFT assumes the  $N$ -point data block is one period of a periodic signal. If the signal is not exactly periodic in  $N$  samples (which it almost never is in practice), the assumption is violated, and spectral leakage occurs. Chapter 8 discusses windowing functions that mitigate this problem. The Fourier series context here helps explain why: the discontinuity at the block boundary is a sharp transient, which the Fourier series represents as a superposition of many harmonics. The window eliminates the discontinuity.

## 9.20 Fourier Transform of Common Signals

While the Fourier series handles periodic signals, many instrumentation signals are non-periodic. The Fourier transform extends the analysis:

**Impulse (Dirac delta):**  $\mathcal{F}\{\delta(t)\} = 1$  (flat spectrum, all frequencies equally present). An ideal impulse contains infinite bandwidth, which is why impact testing excites all resonances simultaneously.

**Rectangular pulse:**  $\mathcal{F}\{\text{rect}(t/T)\} = T \cdot \text{sinc}(fT)$ . The spectrum is a sinc function with first null at  $f = 1/T$ . A narrower pulse has a wider spectrum (more bandwidth).

**Exponential decay:**  $\mathcal{F}\{e^{-t/\tau}u(t)\} = \tau/(1+j2\pi f\tau)$ . This is the impulse response of a first-order system, confirming that the frequency response is  $1/\sqrt{1+(\omega\tau)^2}$ .

**Gaussian pulse:**

$$\mathcal{F}\{e^{-t^2/(2\sigma^2)}\} = \sigma\sqrt{2\pi} \cdot e^{-2(\pi f\sigma)^2}$$

. A Gaussian in time has a Gaussian spectrum. The “uncertainty principle”: the product of the time-domain width and frequency-domain width is constant. Narrower in time = wider in frequency. This is a fundamental constraint on simultaneous time and frequency resolution.

## 9.21 The Short-Time Fourier Transform (STFT) and Spectrograms

The standard FFT computes the frequency content over the entire signal duration. For signals whose frequency content changes with time (motor speed ramp-up, earthquake, speech), the **Short-Time Fourier Transform** divides the signal into overlapping segments, computes the FFT of each, and displays the result as a time-frequency map called a **spectrogram** (or waterfall plot).

In LabVIEW, the “STFT Spectrogram” VI computes this. Parameters: segment length (determines frequency resolution), overlap (typically 75%), and window function (Hanning). The spectrogram is invaluable for analyzing run-up/coast-down vibration tests, transient thermal events, and any measurement where the frequency content evolves over time.

## 9.22 Bandwidth and Harmonic Content: A Design Tool

The Fourier series provides a quantitative tool for determining the bandwidth needed to faithfully reproduce a given waveform. The key metric: how many harmonics must be preserved to keep the waveform distortion below a specified threshold?

Define the harmonic energy fraction:  $E_N/E_{\text{total}} = \sum_{n=1}^N c_n^2 / \sum_{n=1}^{\infty} c_n^2$ .

For a square wave:  $E_1/E_{\text{total}} = 81\%$  (fundamental alone).  $E_3/E_{\text{total}} = 90\%$  (through 3rd harmonic).  $E_5/E_{\text{total}} = 93.4\%$ .  $E_{11}/E_{\text{total}} = 97\%$ . So passing harmonics through the 11th captures

97% of the energy. For a 100 Hz square wave: the measurement system needs bandwidth of at least  $11 \times 100 = 1100$  Hz.

For a triangle wave:  $E_1 = 97\%$ ,  $E_3 = 98.8\%$ . The triangle wave is nearly sinusoidal; bandwidth of  $3f_0$  captures 99% of the energy. This is why triangle waves pass through narrow-bandwidth systems with minimal distortion, while square waves are heavily distorted.

For a half-sine pulse (rectified sine): contains even harmonics.  $E_2/E_{\text{total}} = 95\%$ . Bandwidth of  $2f_0$  is nearly sufficient.

## 9.23 Fourier Series in Sensor Design

Sensor designers use Fourier analysis to specify bandwidth requirements. Example: a load cell measuring the force from a stamping press. The force waveform is approximately trapezoidal: a fast rise (impact), a flat peak (hold), and a fast fall (release). The trapezoidal waveform has harmonics decaying as  $1/(n^2)$  times a sinc envelope. The bandwidth needed depends on the rise time  $t_r$ :  $BW \geq 0.35/t_r$ . For  $t_r = 1$  ms:  $BW \geq 350$  Hz. For  $t_r = 0.1$  ms (high-speed press):  $BW \geq 3.5$  kHz.

## 9.24 Spectral Analysis in Troubleshooting

When a measurement produces unexpected results, computing the Fourier series (or FFT) of the output often reveals the cause:

**Symptom:** temperature reading fluctuates  $\pm 0.5^\circ\text{C}$  when the heater is off. **FFT:** sharp peak at 60 Hz. **Diagnosis:** mains coupling. **Fix:** shielding + differential input.

**Symptom:** strain gauge reading drifts slowly over 30 minutes. **FFT:**  $1/f$ -shaped spectrum (power increasing at low frequencies). **Diagnosis:** thermal drift in the bridge or amplifier. **Fix:** temperature-compensated half-bridge, or zero-drift amplifier.

**Symptom:** accelerometer output has a persistent component at exactly  $2 \times$  shaft speed. **FFT:** peak at  $2f_{\text{shaft}}$ . **Diagnosis:** misalignment (classic signature). **Fix:** realign the coupling.

**Symptom:** pressure sensor output has a “haystack” (broad hump) centered at 200 Hz. **FFT:** broad peak from 150–250 Hz. **Diagnosis:** turbulent flow noise. **Fix:** cannot eliminate (physical phenomenon); increase signal averaging to reduce its effect on mean pressure measurement.

## 9.25 Fourier Series Symmetry Properties

Understanding symmetry simplifies Fourier analysis and provides physical insight:

**Even functions** ( $x(t) = x(-t)$ , symmetric about  $t = 0$ ): contain only cosine terms ( $b_n = 0$ ). Examples: cosine waves, rectified sine waves, any waveform that is a mirror image about  $t = 0$ .

**Odd functions** ( $x(-t) = -x(t)$ , anti-symmetric): contain only sine terms ( $a_n = 0$ ,  $a_0 = 0$ ). Examples: sine waves, square waves centered at zero, sawtooth waves.

**Half-wave symmetry** ( $x(t + T/2) = -x(t)$ ): contains only odd harmonics ( $a_n = b_n = 0$  for even  $n$ ). The square wave, triangle wave, and any waveform where the second half-period is the negative of the first have this property.

These symmetry properties explain why the square wave contains only odd harmonics (it has half-wave symmetry), while the sawtooth contains all harmonics (it does not have half-wave symmetry).

## 9.26 Convergence Rate and Bandwidth Implications

The rate at which Fourier coefficients decrease with harmonic number  $n$  is directly related to the smoothness of the waveform:

**Discontinuous waveform** (square wave):  $c_n \propto 1/n$ . Coefficients decay slowly. Many harmonics needed for faithful reproduction. Bandwidth requirement:  $\sim 11f_0$  for 97% energy capture.

**Continuous but with discontinuous derivative** (triangle wave):  $c_n \propto 1/n^2$ . Faster decay. Bandwidth:  $\sim 3f_0$  for 99% energy.

**Smooth waveform with continuous first derivative**:  $c_n \propto 1/n^3$  or faster. Very few harmonics needed.

**Sinusoid**:  $c_1 = A/2$ , all other  $c_n = 0$ . Zero bandwidth beyond  $f_0$ .

The general rule: each additional order of continuity (smoothness) in the waveform adds a factor of  $1/n$  to the coefficient decay rate. This is why digital signals (sharp edges, discontinuities) require much wider bandwidth than analog signals (smooth, continuous).

## 9.27 Fourier Analysis of Real Sensor Signals

### 9.27.1 Vibration Signature Analysis

A rotating machine produces a vibration signal that is periodic at the rotation frequency  $f_r$  but not sinusoidal. The Fourier series reveals the harmonic structure:

$1 \times f_r$  (fundamental): unbalance. Amplitude indicates the severity of mass imbalance.

$2 \times f_r$ : misalignment (angular or parallel). Often the dominant component in poorly aligned machinery.

$3 \times f_r$ : looseness or rubbing. Indicates mechanical clearance problems.

$N_{\text{teeth}} \times f_r$ : gear mesh frequency. Sidebands spaced at  $f_r$  around the mesh peak indicate gear wear.

$N_{\text{blades}} \times f_r$ : blade pass frequency in fans, pumps, and turbines.

The Fourier series connects the physical defect to its spectral signature, enabling condition-based maintenance.

### 9.27.2 Electrical Power Quality

The AC mains voltage is nominally a 60 Hz (or 50 Hz) sinusoid. Nonlinear loads (computers, LED drivers, variable-frequency drives) draw current in pulses, distorting the voltage waveform. The Fourier series quantifies this distortion:

Total Harmonic Distortion:  $\text{THD} = \sqrt{c_2^2 + c_3^2 + \dots}/c_1$ . IEEE 519 limits THD to  $< 5\%$  at the point of common coupling. A THD of 10% indicates significant distortion that can cause overheating in transformers and interference in sensitive instrumentation.

The 3rd harmonic (180 Hz) is typically the largest for single-phase nonlinear loads. In three-phase systems, the 3rd harmonic currents from each phase add constructively in the neutral conductor, potentially overloading it. The 5th (300 Hz) and 7th (420 Hz) harmonics are dominant for three-phase variable-frequency drives.

## 9.28 Window Functions: Mathematical Basis

The DFT assumes periodicity: the  $N$ -point data block is treated as one period of an infinitely repeating signal. If the actual signal is not periodic within the window, the implicit discontinuity

at the block boundaries creates spectral leakage.

A window function  $w[n]$  tapers the data to zero at both ends, eliminating the discontinuity. The price: the main lobe of each spectral line widens (reducing frequency resolution). The tradeoff between main lobe width and sidelobe level is characterized by:

**Main lobe width** (in bins): determines the minimum separation between two frequencies that can be resolved. Rectangular: 2 bins. Hanning: 4 bins. Flat-top: 8 bins. Blackman-Harris: 8 bins.

**Highest sidelobe level:** determines the dynamic range (ability to detect a small signal near a large one). Rectangular:  $-13$  dB. Hanning:  $-31$  dB. Flat-top:  $-44$  dB. Blackman-Harris:  $-92$  dB.

**Amplitude accuracy:** the error in measuring the amplitude of a spectral line that falls between bins. Rectangular:  $-3.9$  dB worst case. Hanning:  $-1.4$  dB. Flat-top:  $-0.01$  dB.

## 9.29 Practical Frequency Analysis Workflow

A systematic approach to analyzing the frequency content of measured signals:

**Step 1: Inspect the time-domain waveform.** Look for periodicity, transients, trends, and obvious anomalies. Estimate the dominant frequency visually (count cycles per unit time). Check for clipping (flat-topped peaks indicating ADC saturation).

**Step 2: Remove the mean.** Subtract the DC component before computing the spectrum. A large DC component produces a tall spike at bin 0 that can mask nearby low-frequency content. In LabVIEW: subtract the mean of the array before wiring to the FFT function.

**Step 3: Apply a window.** Select based on the application: Hanning for general analysis, Flat-top for amplitude measurement, Blackman-Harris for detecting small signals near large ones.

**Step 4: Compute the FFT and display.** Plot the magnitude spectrum in dB (not linear):  $\text{dB} = 20 \log_{10}(|X[k]|)$ . The dB scale reveals both large and small components simultaneously. A linear scale shows only the dominant peaks.

**Step 5: Identify components.** Discrete peaks: identify the source (rotation speed, mains frequency, switching noise). Harmonics: verify they are integer multiples of a fundamental. Broadband noise: measure the PSD level in the flat regions.

**Step 6: Validate.** Change the acquisition parameters (different  $f_s$ , different  $N$ ) and verify that the identified components do not shift frequency (which would indicate aliasing). If a peak at 200 Hz moves to 300 Hz when you change  $f_s$ : it is an alias, not a real signal.

## 9.30 The Uncertainty Principle for Signals

The product of time resolution and frequency resolution has a fundamental lower bound:

$$\Delta t \cdot \Delta f \geq \frac{1}{4\pi} \approx 0.08 \quad (9.10)$$

In practice, the achievable product is  $\Delta t \cdot \Delta f \approx 1$  for most window functions. This means: to resolve 1 Hz frequency difference ( $\Delta f = 1$  Hz), you need at least 1 second of data ( $\Delta t \geq 1$  s). To resolve events lasting 1 ms ( $\Delta t = 0.001$  s), the best achievable frequency resolution is  $\Delta f \geq 1000$  Hz.

This tradeoff is not a limitation of the FFT algorithm; it is a fundamental property of signals. No analysis technique, no matter how sophisticated, can simultaneously achieve arbitrary time and frequency resolution.

## ★ Advanced Topic:

**Hilbert Transform and Envelope Analysis** The following section covers material beyond the core MEGN 300 curriculum. It is included for students whose projects require envelope or instantaneous frequency analysis. Skip this section on first reading.

## 9.31 Hilbert Transform and Envelope Analysis

The **Hilbert transform** produces the analytic signal  $z(t) = x(t) + j\hat{x}(t)$ , where  $\hat{x}(t)$  is the Hilbert transform of  $x(t)$ . The magnitude  $|z(t)|$  is the **envelope** (instantaneous amplitude) and  $\angle z(t)$  is the instantaneous phase. The time derivative of the instantaneous phase gives the instantaneous frequency.

In vibration analysis, envelope analysis detects amplitude-modulated signals produced by bearing defects. The bearing defect produces a periodic impulse train (at the defect frequency) that amplitude-modulates the bearing's natural frequency (typically 2–5 kHz). The envelope of the high-pass-filtered signal reveals the defect frequency, which is invisible in the raw spectrum (because it appears as sidebands, not a direct peak).

## 9.32 Practice Questions

1. A 100 Hz square wave passes through a first-order low-pass filter with a 500 Hz cutoff. What happens to the fundamental and the first four odd harmonics (100, 300, 500, 700, 900 Hz)? Describe the distortion qualitatively.
2. A signal has a fundamental at 50 Hz and significant harmonic content at 150 Hz and 250 Hz. What is the minimum sampling rate to capture all three components without aliasing?
3. Write the first three nonzero terms of the Fourier series for a triangle wave with amplitude 2 V and frequency 1 kHz.

### 9.32.1 Answers

1. At 100 Hz:  $M = 1/\sqrt{1 + (100/500)^2} = 0.981$  (nearly passed). At 300 Hz:  $M = 0.857$ . At 500 Hz:  $M = 0.707$  (−3 dB point). At 700 Hz:  $M = 0.581$ . At 900 Hz:  $M = 0.486$ . The higher harmonics that define the sharp edges of the square wave are progressively attenuated; the output will look like a rounded square wave with slower rise/fall times.
2. Nyquist:  $f_s > 2 \times f_{\max} = 2 \times 250 = 500$  Hz minimum. In practice, use  $f_s \geq 2.5 \times 250 = 625$  Hz or higher.
3. Triangle wave:

$$x(t) = \frac{8A}{\pi^2} \left[ \sin(2\pi f_0 t) - \frac{1}{9} \sin(6\pi f_0 t) + \frac{1}{25} \sin(10\pi f_0 t) - \dots \right]$$

. With  $A = 2$  V,  $f_0 = 1000$  Hz:

$$x(t) = \frac{16}{\pi^2} \left[ \sin(2000\pi t) - \frac{1}{9} \sin(6000\pi t) + \frac{1}{25} \sin(10000\pi t) \right] \approx 1.621 \sin(2000\pi t) - 0.180 \sin(6000\pi t) + 0.065 \sin(10000\pi t)$$

.

## Chapter 10

# FFT and Complex Signal Decomposition

---

### When to Read This Chapter

**Module 5 (Weeks 7–8):** Read alongside the FFT lab. Focus on windowing, spectral leakage, and the LabVIEW FFT configuration. The frequency resolution formula ( $\Delta f = f_s/N$ ) is used in every spectral analysis for the rest of the course. **Related:** Fourier theory in Chapter 9 (p. 91); DSP in Chapter 11 (p. 112).

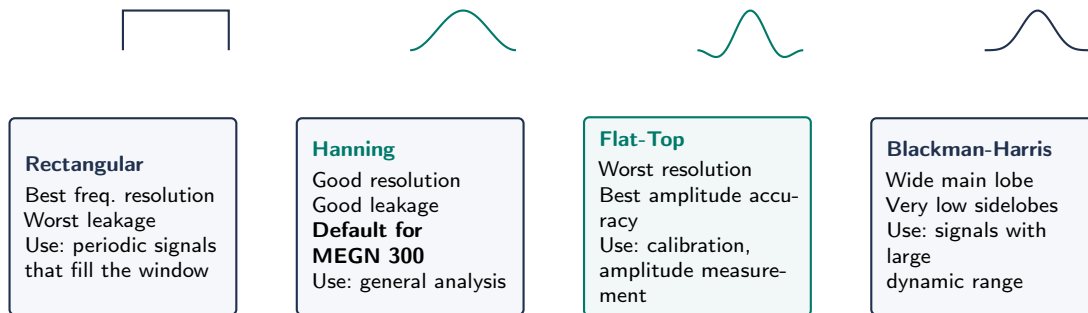


Figure 10.1: Common FFT window functions. Hanning is the default for MEGN 300 general analysis. Flat-top sacrifices frequency resolution for amplitude accuracy (use when measuring exact amplitudes). Rectangular is used only when the signal is exactly periodic within the window.

## 10.1 From Fourier Series to Fourier Transform

The Fourier series applies to periodic signals. For non-periodic or finite-duration signals, the **Fourier Transform** generalizes the concept to a continuous frequency spectrum:

$$X(f) = \int_{-\infty}^{\infty} x(t) e^{-j2\pi ft} dt \quad (10.1)$$

$X(f)$  is complex-valued: its magnitude  $|X(f)|$  gives the amplitude spectrum, and its angle  $\angle X(f)$  gives the phase spectrum.



## 10.2 The Discrete Fourier Transform (DFT) and FFT

For sampled data ( $N$  points, sampling rate  $f_s$ ), the DFT computes:

$$X[k] = \sum_{n=0}^{N-1} x[n] e^{-j2\pi kn/N}, \quad k = 0, 1, \dots, N-1 \quad (10.2)$$

The **Fast Fourier Transform (FFT)** is an algorithm that computes the DFT in  $O(N \log N)$  operations instead of  $O(N^2)$ . For  $N = 1024$ : DFT requires  $\sim 1$  million multiplications; FFT requires  $\sim 10,000$ . This is what makes real-time spectral analysis practical.

### 10.2.1 Interpreting the FFT Output

The FFT produces  $N$  complex numbers. The useful frequency range is 0 to  $f_s/2$  (first  $N/2 + 1$  bins). The frequency resolution (bin width) is:

$$\Delta f = \frac{f_s}{N} \quad (10.3)$$

To resolve two closely spaced frequencies, you need  $\Delta f$  smaller than their separation. Increasing  $N$  (longer acquisition time) improves frequency resolution.

### 10.2.2 Windowing

The FFT assumes the signal is periodic within the acquisition window. If the signal frequency does not exactly match an FFT bin, the result “leaks” energy into adjacent bins (**spectral leakage**). Windowing functions (Hanning, Hamming, Blackman, flat-top) taper the signal edges to reduce leakage at the cost of slightly reduced frequency resolution.

#### Which Window to Use

Hanning (Hann): best general-purpose choice; good frequency resolution with moderate leakage.  
Flat-top: best for accurate amplitude measurement of known tones. Rectangular (no window): best frequency resolution but worst leakage; use only when the signal is exactly periodic in the window.

## 10.3 Practical FFT in LabVIEW

In LabVIEW, use the **FFT Power Spectrum and PSD VI**. Set:  $N$  (power of 2 for efficiency), window type, and averaging mode. The output is a 1D array of power spectral density (PSD) values in  $V^2/\text{Hz}$  or amplitude spectrum in  $V_{\text{RMS}}$ .

## 10.4 Power Spectral Density (PSD)

The PSD describes how the signal’s power is distributed across frequencies, normalized by the frequency resolution:

$$\text{PSD}(f) = \frac{|X(f)|^2}{N \cdot f_s} \quad [V^2/\text{Hz}] \quad (10.4)$$



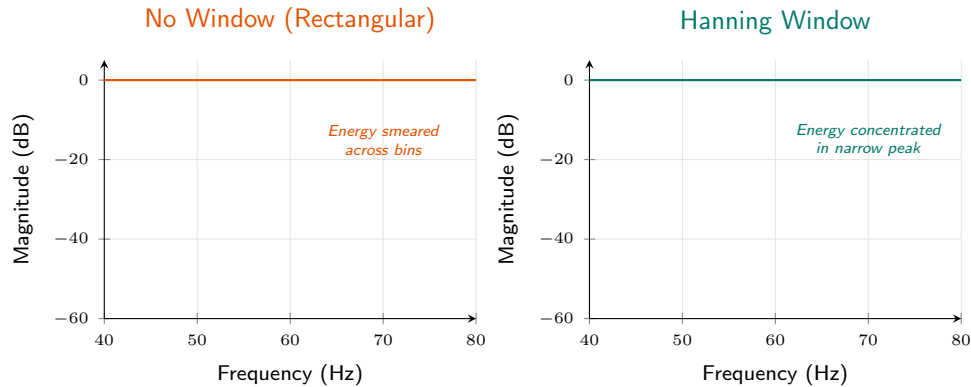


Figure 10.2: Spectral leakage: without windowing (left), a 60.5 Hz signal smears across many FFT bins. With a Hanning window (right), sidelobe energy is suppressed and the peak sharpens. Always window unless the signal is exactly periodic in the acquisition window.

PSD is independent of the FFT length  $N$  and sampling rate  $f_s$ , making it suitable for comparing measurements taken with different acquisition parameters. Use PSD for broadband (continuous) signals like vibration and noise. Use amplitude spectrum for discrete tones (known frequencies).

## 10.5 Averaging for Spectral Estimates

A single FFT of noisy data has high variance. Averaging reduces this variance:

**Linear averaging:** divide the signal into  $M$  overlapping segments, compute the FFT of each, and average the magnitude spectra. Reduces spectral variance by  $1/M$ . Use 50% overlap with Hanning window for optimal noise reduction with minimal data loss.

**Exponential averaging:** weights recent FFTs more heavily; tracks slowly changing spectra. Set the averaging constant based on how quickly the spectrum changes.

## 10.6 Practical FFT Analysis Workflow

1. Choose  $f_s \geq 2.56 \times f_{\max}$  (signal bandwidth + anti-alias margin).
2. Choose  $N$  based on required frequency resolution:  $N = f_s / \Delta f$ . Use a power of 2.
3. Apply a window function (Hanning for general use).
4. Compute the FFT; convert to single-sided amplitude or PSD.
5. Average multiple blocks (10–100 averages for noisy data).
6. Identify peaks; read frequency and amplitude. Compare to noise floor.

## 10.7 From DFT to FFT

The Discrete Fourier Transform (DFT) computes the frequency content of a sampled signal by decomposing it into  $N$  complex sinusoids:

$$X[k] = \sum_{n=0}^{N-1} x[n] e^{-j2\pi kn/N}, \quad k = 0, 1, \dots, N-1 \quad (10.5)$$

where  $x[n]$  is the  $n$ th time-domain sample and  $X[k]$  is the complex amplitude at frequency  $f_k = k \cdot f_s/N$ . Computing the DFT directly requires  $N^2$  complex multiplications. The **Fast Fourier Transform (FFT)** is an algorithm (Cooley-Tukey, 1965) that reduces this to  $N \log_2 N$  operations by exploiting symmetry and periodicity. For  $N = 1024$ , this is a  $100\times$  speedup; for  $N = 1,048,576$  (one million points), it is a  $50,000\times$  speedup.

## 10.8 FFT Output Interpretation

The FFT output  $X[k]$  is a complex number with magnitude and phase. The **magnitude spectrum**  $|X[k]|$  shows how much of each frequency is present. The **phase spectrum**  $\angle X[k]$  shows the phase angle of each frequency component. In LabVIEW, the “FFT” function returns both; the “Power Spectrum” function returns  $|X[k]|^2/N$  or its variants.

### 10.8.1 Frequency Resolution

The spacing between adjacent frequency bins is:

$$\Delta f = \frac{f_s}{N} \quad (10.6)$$

To resolve two closely spaced frequencies (e.g., 99 Hz and 101 Hz,  $\Delta f = 2$  Hz), you need  $N \geq f_s/\Delta f$ . At  $f_s = 1000$  S/s, this requires  $N \geq 500$  samples (0.5 s of data). Want 0.1 Hz resolution? You need  $N = 10,000$  samples (10 s of data at 1 kS/s). This is the fundamental tradeoff: **better frequency resolution requires longer acquisition time**.

### 10.8.2 Frequency Range

The FFT produces output from  $f = 0$  (DC) to  $f = f_s/2$  (Nyquist). Only the first  $N/2$  bins are unique; the second half is a mirror image (for real-valued input signals). In practice, you use bins  $k = 0$  to  $k = N/2$ .

## 10.9 Power Spectral Density (PSD)

For random or broadband signals, the magnitude spectrum depends on the FFT length  $N$  (longer records produce taller peaks because more energy is captured). The **Power Spectral Density (PSD)** normalizes by the frequency resolution:

$$\text{PSD}[k] = \frac{|X[k]|^2}{N \cdot \Delta f} \quad (\text{units: V}^2/\text{Hz}) \quad (10.7)$$

The PSD is independent of record length, making it the correct representation for comparing noise floors, characterizing random vibration, and specifying sensor noise performance.

## 10.10 Windowing: Theory and Practice

The FFT assumes the signal is exactly periodic within the acquisition window of  $N$  samples. If this assumption is violated (which it almost always is for real signals), the resulting discontinuity at the window boundaries produces **spectral leakage**: the energy of a single frequency smears across adjacent bins, reducing amplitude accuracy and frequency resolution.

### 10.10.1 The Root Cause

Consider acquiring 1000 samples of a 100.5 Hz sine wave at 1000 S/s. The FFT frequency bins are at 0, 1, 2, ..., 999 Hz (with 1 Hz spacing). The signal frequency (100.5 Hz) falls between bins 100 and 101. The FFT cannot represent 100.5 Hz exactly, so the energy “leaks” into neighboring bins, producing a smeared peak with sidelobes.

### 10.10.2 Window Functions

A window function  $w[n]$  is multiplied with the signal before the FFT:  $x_w[n] = x[n] \cdot w[n]$ . The window tapers the signal to zero at both ends, forcing it to appear periodic and reducing the discontinuity. Common windows and their tradeoffs:

**Rectangular (no window)**: highest frequency resolution (narrowest main lobe) but worst sidelobe rejection (−13 dB). Use only when the signal is exactly periodic in the window.

**Hanning**: moderate resolution, good sidelobe rejection (−31 dB). The default choice for general-purpose spectral analysis.

**Flat-top**: wide main lobe (poor frequency resolution) but extremely accurate amplitude measurement (<0.01 dB error). Use when you need to measure the exact amplitude of a known frequency (e.g., calibration).

**Blackman-Harris**: excellent sidelobe rejection (−92 dB) but widest main lobe. Use when small signals near large ones must be detected.

#### WE ThermoRig: Identifying Switching Noise with FFT

The ThermoRig thermocouple signal, sampled at 10 kS/s ( $N = 8192$  for FFT), reveals a sharp peak at 60 Hz (expected: mains coupling) and a broader peak near 500 kHz that has been aliased to 0.5 kHz. This aliased component comes from the switching regulator’s 500 kHz oscillator, which couples capacitively into the thermocouple wiring. The Hanning window produces clean, narrow peaks at both frequencies, confirming they are discrete tones rather than broadband noise. The solution: add a 100 Hz anti-alias filter before the ADC, eliminating the aliased component entirely.

## 10.11 Spectral Averaging

A single FFT of a random (noisy) signal produces a noisy spectrum. To obtain a smooth estimate of the PSD, compute multiple FFTs of successive blocks of data and average the magnitude spectra. With  $M$  averages, the variance of the PSD estimate decreases by a factor of  $M$ . Typical practice: 10–100 averages for laboratory measurements, 100–1000 for production testing.

### 10.11.1 Overlap Processing

To improve the effective averaging rate without acquiring more data, successive FFT blocks can overlap (typically 50–75%). With 50% overlap, a Hanning-windowed signal uses approximately 90% of the acquired data (vs. 50% without overlap). LabVIEW’s “Power Spectrum” function supports overlap processing natively.

## 10.12 Common FFT Pitfalls

1. **Forgetting the anti-alias filter:** aliased components appear real and cannot be distinguished from true signals in the FFT.
2. **Not windowing:** spectral leakage smears energy across bins, reducing dynamic range.
3. **Using too few points:** poor frequency resolution causes adjacent peaks to merge.
4. **Confusing linear and dB scales:** a peak at  $-40$  dB is not “almost zero”; it is 1% of full scale.
5. **Ignoring DC offset:** a large DC component (bin 0) can mask nearby low-frequency content. Remove the mean before computing the FFT.

## 10.13 From DFT to FFT

The DFT:  $X[k] = \sum_{n=0}^{N-1} x[n] e^{-j2\pi kn/N}$ ,  $k = 0, \dots, N-1$ . Direct computation:  $O(N^2)$ . The FFT (Cooley-Tukey, 1965) reduces this to  $O(N \log_2 N)$ . For  $N = 1024$ :  $100\times$  speedup. For  $N = 10^6$ :  $50,000\times$ .

## 10.14 FFT Output Interpretation

$X[k]$  is complex: magnitude  $|X[k]|$  gives amplitude at frequency  $f_k = k \cdot f_s/N$ ; phase  $\angle X[k]$  gives the phase angle. Only bins  $k = 0$  to  $N/2$  are unique for real input.

**Frequency resolution:**  $\Delta f = f_s/N$ . To resolve 99 Hz from 101 Hz ( $\Delta f = 2$  Hz) at 1 kS/s requires  $N \geq 500$  (0.5 s of data). Better resolution requires longer acquisition.

## 10.15 Power Spectral Density

For random signals, the magnitude spectrum depends on  $N$ . The PSD normalizes:  $\text{PSD}[k] = |X[k]|^2 / (N \cdot \Delta f)$  (units:  $\text{V}^2/\text{Hz}$ ). PSD is independent of record length, making it the correct representation for noise characterization.

## 10.16 Windowing

The FFT assumes the signal is periodic within the window. Non-periodic signals create discontinuities at the window edges, causing spectral leakage. A window function tapers the signal to zero at both ends.

**Rectangular:** best resolution, worst sidelobes ( $-13$  dB). Use only for exactly periodic signals.

**Hanning:** good general-purpose choice.  $-31$  dB sidelobes.

**Flat-top:** wide main lobe but  $<0.01$  dB amplitude error. Use for calibration.

**Blackman-Harris:**  $-92$  dB sidelobes. Use when small signals near large ones must be detected.

## 10.17 Spectral Averaging and Overlap

A single FFT of noisy data produces a noisy spectrum. Average  $M$  FFTs to reduce variance by  $M$ . With 50% overlap between successive blocks, approximately 90% of data is used. LabVIEW's Power Spectrum supports overlap processing natively.

### WE ThermoRig: Identifying Switching Noise

FFT of TC signal at 10 kS/s ( $N = 8192$ ) reveals: 60 Hz peak (mains coupling) and 500 Hz peak (aliased 500 kHz switching regulator). Hanning window confirms both are discrete tones. Fix: 100 Hz anti-alias filter eliminates the aliased component.

## 10.18 Common FFT Pitfalls

- (1) Forgetting anti-alias filter: aliases look real.
- (2) Not windowing: leakage smears peaks.
- (3) Too few points: poor resolution.
- (4) Confusing linear and dB scales:  $-40$  dB is 1%, not “almost zero.”
- (5) Large DC offset masks low-frequency content; remove mean before FFT.

## 10.19 Choosing FFT Parameters for MEGN 300 Labs

When setting up an FFT measurement in LabVIEW, four parameters must be chosen correctly:

**Sample rate  $f_s$ :** must be at least  $2.56\times$  the highest frequency of interest (standard vibration analysis convention). For a 1 kHz bandwidth measurement:  $f_s \geq 2560$  S/s. Round up to a convenient value (4096 S/s or 5000 S/s).

**Number of points  $N$ :** determines frequency resolution ( $\Delta f = f_s/N$ ). For 1 Hz resolution at 4096 S/s:  $N \geq 4096$ . For 0.1 Hz resolution:  $N \geq 40,960$ .  $N$  should be a power of 2 for maximum FFT algorithm efficiency (1024, 2048, 4096, 8192, etc.).

**Window function:** Hanning is the default for general use. Use Flat-top when amplitude accuracy is critical (calibration, amplitude comparison). Use Rectangular only when the signal is exactly periodic in the window (e.g., a frequency generator locked to the DAQ clock).

**Number of averages:** for random/noisy signals, average 10–100 spectra to reduce variance. For deterministic signals (sine waves, harmonics), a single FFT is sufficient.

### 10.19.1 Acquisition Time Tradeoff

The total acquisition time is  $T = N \times M / f_s$  where  $M$  is the number of averages. For  $f_s = 4096$  S/s,  $N = 4096$ ,  $M = 50$  averages with 50% overlap:  $T \approx 25.6$  s. Finer frequency resolution or more averaging requires longer acquisition. Plan accordingly for time-limited measurements.

## 10.20 Interpreting FFT Results

### 10.20.1 Identifying Signal Components

**Discrete tones:** sharp, narrow peaks at specific frequencies. Sources: rotating machinery (shaft speed and harmonics), electrical interference (60 Hz, switching frequencies), resonances (structural

natural frequencies). The peak height gives the amplitude; the peak frequency identifies the source.

**Broadband noise:** a raised floor across many or all frequencies. Sources: thermal noise, turbulent flow, friction. The PSD level ( $V^2/Hz$ ) characterizes the noise intensity.

**Sidebands:** peaks flanking a main peak, spaced equally on both sides. Sources: amplitude modulation (bearing defects modulating shaft rotation), frequency modulation (speed fluctuations). The sideband spacing identifies the modulation frequency.

### 10.20.2 Frequency Identification Guide

For a machine rotating at  $f_r$ : shaft imbalance appears at  $f_r$ . Misalignment at  $2f_r$ . Gear mesh at  $N_{\text{teeth}} \times f_r$ . Ball bearing outer race defect (BPFO) at  $\sim 0.4N_{\text{balls}} \times f_r$  (this is an approximation; exact defect frequencies for inner race (BPFI), outer race (BPFO), and rolling element (BSF) depend on bearing geometry and contact angle; consult the bearing manufacturer datasheet for precise values). Blade pass frequency at  $N_{\text{blades}} \times f_r$ . Electrical motor slip frequency at  $(f_{\text{line}} - N_p f_r)$  where  $N_p$  is the number of poles.

## 10.21 Cross-Spectral Analysis

When measuring two channels simultaneously (e.g., force input and acceleration output), the **cross-spectrum**  $G_{xy}(f) = X^*(f) \cdot Y(f)$  relates the two signals in the frequency domain. The **frequency response function** (transfer function magnitude) is:

$$|H(f)| = \frac{|G_{xy}(f)|}{G_{xx}(f)} \quad (10.8)$$

where  $G_{xx}$  is the auto-spectrum of the input. The **coherence function**  $\gamma^2(f) = |G_{xy}|^2 / (G_{xx}G_{yy})$  indicates how much of the output is linearly related to the input at each frequency.  $\gamma^2 = 1$ : output is completely explained by the input.  $\gamma^2 < 0.9$ : other sources (noise, nonlinearity, unmeasured inputs) contribute significantly.

## 10.22 Practical LabVIEW FFT Implementation

The recommended LabVIEW approach for FFT measurement:

(1) Use the “Spectral Measurements” Express VI for simple measurements (magnitude, phase, PSD). It handles windowing, averaging, and scaling automatically.

(2) For more control, use the “FFT” primitive: wire in the time-domain waveform, apply a window (“Scaled Time Domain Window” VI), compute the FFT, take the magnitude, and scale appropriately.

(3) For real-time display, place the FFT inside a While Loop with a “Waveform Chart” or “Intensity Graph” for waterfall (spectrogram) display. The spectrogram shows how the frequency content evolves over time, which is invaluable for diagnosing transient events and speed-varying machinery.

## 10.23 FFT Resolution Enhancement Techniques

### 10.23.1 Zero-Padding

Appending zeros to the time-domain data before computing the FFT increases the number of frequency bins without acquiring more data. Zero-padding does *not* improve the true frequency resolution (which is fixed at  $\Delta f = 1/T_{\text{acq}}$  where  $T_{\text{acq}}$  is the acquisition duration), but it interpolates between the existing bins, producing a smoother spectrum that makes it easier to identify peak frequencies.

For example: 1024 samples at 1 kS/s gives  $\Delta f = 1$  Hz with 512 frequency bins. Zero-padding to 4096 points gives the same  $\Delta f = 1$  Hz resolution but now with 2048 bins (interpolated), making peaks easier to locate visually.

### 10.23.2 Zoom FFT

To achieve very fine frequency resolution in a narrow band without acquiring an impractically long record: (1) frequency-shift the band of interest to baseband by multiplying the signal by  $e^{-j2\pi f_c t}$  where  $f_c$  is the center frequency, (2) low-pass filter and decimate to reduce the sample rate, (3) compute the FFT of the decimated data. The frequency resolution improves by the decimation factor. LabVIEW: use the “Zoom FFT” VI or implement manually with frequency shifting and decimation.

## 10.24 Order Analysis for Rotating Machinery

When a machine’s speed varies (run-up, coast-down, load changes), the vibration frequencies change proportionally. A standard FFT at fixed sample rate produces smeared peaks because the signal frequency sweeps across bins during the acquisition. **Order analysis** solves this by resampling the signal at constant angular increments (using a tachometer pulse as the sampling clock) rather than constant time increments. The resulting “order spectrum” shows vibration amplitude vs. multiples of shaft speed (orders), with sharp peaks regardless of speed variation.

In LabVIEW: the Sound and Vibration Toolkit includes order analysis VIs. Without the toolkit: use the tachometer signal to compute instantaneous speed, resample the vibration signal at constant angle increments using interpolation, then compute the FFT normally.

#### ★ Advanced Topic:

**Cepstral Analysis** Cepstral analysis is an advanced vibration diagnostics technique not covered in MEGN 300 exams. It is included for students whose projects involve rotating machinery fault detection.

## 10.25 Cepstral Analysis (Overview)

The **cepstrum** is the inverse FFT of the log magnitude spectrum:  $c[n] = \text{IFFT}(\log |X[k]|)$ . It separates multiplicative effects in the frequency domain (which become additive in the log domain) into individual components. The cepstrum is particularly useful for detecting periodic patterns in the spectrum, such as harmonics of a fundamental frequency or sidebands around a carrier. In vibration analysis, cepstral analysis detects bearing defects (which produce a family of harmonics and sidebands) more reliably than spectral analysis alone.

The “quefreny” axis of the cepstrum has units of time: a peak at quefreny  $\tau_q$  indicates a periodic pattern in the spectrum with spacing  $1/\tau_q$  Hz. For a bearing defect at frequency  $f_d$  with



harmonics at  $2f_d$ ,  $3f_d$ , etc.: the cepstrum shows a peak at  $\tau_q = 1/f_d$ .

## 10.26 Waterfall and Spectrogram Displays

For signals whose frequency content evolves over time, a single FFT captures only the average. Time-frequency displays show the evolution:

**Waterfall plot:** a 3D display with time on one axis, frequency on another, and amplitude on the third (or represented by color). Each “slice” is an FFT computed from a short segment of the data. Used in vibration analysis for run-up/coast-down tests.

**Spectrogram:** a 2D color map with time on the horizontal axis, frequency on the vertical axis, and amplitude represented by color intensity. More compact than a waterfall; the standard display for speech analysis, bioacoustics, and transient event analysis.

The time-frequency resolution tradeoff: shorter FFT segments give better time resolution but worse frequency resolution (and vice versa). The product of time resolution  $\Delta t$  and frequency resolution  $\Delta f$  is bounded:  $\Delta t \cdot \Delta f \geq 1$ . This is a fundamental physical constraint (the uncertainty principle for signals).

## 10.27 Practice Questions

1. You sample a signal at 10 kS/s for 0.1 s. How many FFT points do you have? What is the frequency resolution? What is the maximum frequency you can resolve?
2. A vibration signal contains components at 120 Hz, 240 Hz, and 360 Hz. You sample at 1 kS/s with  $N = 1024$  points. Can you resolve all three components? What is the frequency resolution?
3. Explain why you should use a Hanning window when analyzing a signal whose frequency is unknown, and why you should use a flat-top window when calibrating an accelerometer with a known reference frequency.

### 10.27.1 Answers

1.  $N = f_s \times T = 10000 \times 0.1 = 1000$  points.  $\Delta f = f_s/N = 10000/1000 = 10$  Hz. Max frequency  $= f_s/2 = 5000$  Hz.
2.  $\Delta f = 1000/1024 = 0.977$  Hz. The three components are separated by 120 Hz  $\gg \Delta f$ ; yes, all three are easily resolved. They appear at bins  $k = 120/0.977 \approx 123$ ,  $k \approx 246$ ,  $k \approx 369$ .
3. Hanning reduces spectral leakage when the signal frequency does not exactly align with an FFT bin (which is the common case for unknown signals). Flat-top preserves the true amplitude of a known tone (the flat passband of the window means the amplitude reading is accurate regardless of where the tone falls within a bin), which is critical for calibration where you need the exact voltage at a known frequency.

#### ✓ Mastery Diagnostic:

FFT and Frequency Analysis To demonstrate mastery of this module, you must be able to:

1. Select FFT parameters ( $f_s$ ,  $N$ , window type) and justify each choice.
2. Interpret an FFT magnitude spectrum: identify signal peaks, noise floor, harmonics, and aliases.



3. Explain spectral leakage and demonstrate how windowing mitigates it.
4. Calculate frequency resolution ( $\Delta f = f_s/N$ ) and evaluate sufficiency.
5. Use RMS averaging to reduce FFT variance and calculate expected noise floor improvement.

## Chapter 11

# Fundamentals of Digital Signal Processing

### When to Read This Chapter

**Module 6 (Weeks 9–10):** Read the aliasing and anti-aliasing sections before the filter design lab. The Nyquist theorem and its practical implications (always filter before sampling) are foundational. **Related:** ADC settings in Chapter 7 (p. 70); analog filter design in Chapter 12 (p. 123); digital filter design in Chapter 13 (p. 133).

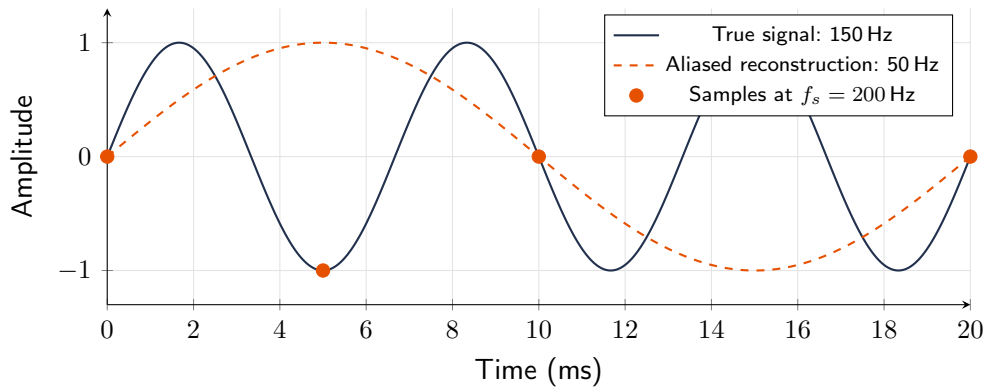


Figure 11.1: Aliasing demonstration. A 150 Hz signal (blue) sampled at  $f_s = 200$  Hz violates Nyquist ( $f_s < 2 \times 150$ ). The samples (orange dots) are consistent with a false 50 Hz signal (orange dashed). **An anti-alias filter before the ADC is the only prevention.**

### 11.1 Sampling Theorem (Nyquist-Shannon)

A continuous signal with maximum frequency  $f_{\max}$  can be perfectly reconstructed from discrete samples if the sampling rate satisfies:

$$f_s > 2f_{\max} \quad (11.1)$$

The frequency  $f_s/2$  is the **Nyquist frequency**. Any signal component above  $f_s/2$  will **alias**: it folds back into the baseband as a false lower-frequency component that is indistinguishable from real data.

**Aliasing Cannot Be Undone**

Once a signal is sampled, aliased components are permanently mixed into the data. No amount of digital post-processing can separate them. The only defense is an **anti-aliasing filter**: an analog low-pass filter placed before the ADC that attenuates all signal content above  $f_s/2$ . This filter is mandatory in every properly designed data acquisition system.

**11.1.1 Alias Frequency Calculation**

If a frequency  $f$  is sampled at  $f_s$  where  $f > f_s/2$ , the alias appears at:

$$f_{\text{alias}} = |f - n \cdot f_s| \quad \text{where } n \text{ is the nearest integer to } f/f_s \quad (11.2)$$

**WE ThermoRig: Aliasing from a Switching Regulator**

The ThermoRig uses a 500 kHz switching regulator that injects noise at 500 kHz onto the thermocouple signal. The DAQ samples at 1 kS/s ( $f_s/2 = 500$  Hz). Without an anti-alias filter, the 500 kHz noise aliases to  $|500000 - 500 \times 1000| = 0$  Hz; it appears as a DC offset. A 2nd-order anti-alias filter at 400 Hz attenuates 500 kHz by  $> 100$  dB, making the alias negligible.

**11.2 Practical Sampling Rate Selection**

- **Minimum:**  $f_s > 2f_{\text{max}}$  (Nyquist criterion).
- **Practical:**  $f_s \geq 5f_{\text{max}}$  to  $10f_{\text{max}}$  for good waveform reconstruction.
- **For FFT analysis:**  $f_s \geq 2.56f_{\text{max}}$  is common (the “2.56 rule” gives 25% guard band for anti-alias filter roll-off).

**11.3 Quantization and Effective Number of Bits (ENOB)**

Real ADCs have noise, nonlinearity, and other imperfections that reduce their effective resolution below the nominal bit count. The ENOB is:

$$\text{ENOB} = \frac{\text{SINAD}_{\text{dB}} - 1.76}{6.02} \quad (11.3)$$

where SINAD is the signal-to-noise-and-distortion ratio. A nominally 16-bit ADC might have ENOB of 14 bits in practice.

**11.4 Oversampling and Decimation**

Oversampling means sampling at a rate much higher than Nyquist ( $f_s \gg 2f_{\text{max}}$ ). Benefits:

- **Relaxes anti-alias filter requirements:** the transition band between the signal and the Nyquist frequency is wider, so a gentle analog filter suffices.
- **Improves effective resolution:** oversampling by a factor of  $4^k$  and digitally filtering/decimating adds  $k$  bits of effective resolution. Example: a 12-bit ADC oversampled  $64\times$  and decimated gains 3 effective bits (acts like a 15-bit ADC).

- **Spreads quantization noise:** the same noise power is distributed over a wider bandwidth; filtering removes the out-of-band portion.

Modern sigma-delta ( $\Sigma\Delta$ ) ADCs (used in precision instruments and audio) achieve 24-bit resolution by oversampling at  $256\times$  or more and using noise shaping to push quantization noise to high frequencies where it is filtered out.

## 11.5 Dithering

Adding a small amount of random noise (dither) to the ADC input, with amplitude  $\approx 0.5$ –1 LSB, actually *improves* the measurement by breaking up quantization artifacts. The dither noise averages out over multiple samples, but it linearizes the ADC response and allows sub-LSB signals to be recovered through averaging. This is counterintuitive but mathematically sound and widely used in precision measurement.

## 11.6 The Sampling Process in Detail

When sampled at  $f_s$ , the signal spectrum is replicated at multiples of  $f_s$ . If content exists above  $f_s/2$ , replicas overlap the baseband, creating aliases.

### 11.6.1 Alias Frequency Formula

$f_{\text{alias}} = |f_{\text{signal}} - n \cdot f_s|$  where  $n$  minimizes the result. Example: 900 Hz at 1 kS/s aliases to  $|900 - 1000| = 100$  Hz. Indistinguishable from a real 100 Hz signal.

## 11.7 Anti-Aliasing Strategy

Step 1: determine signal bandwidth  $f_{\text{max}}$ . Step 2: design analog LP filter with cutoff between  $f_{\text{max}}$  and  $f_s/2$ , sufficient rolloff to attenuate all content above  $f_s/2$  below ADC noise floor. Step 3: set  $f_s \geq 10 \times f_{\text{max}}$ .

## 11.8 Oversampling Benefits

Sampling much faster than Nyquist minimum: (1) relaxes anti-alias filter requirements; (2) spreads quantization noise over wider bandwidth, so digital filtering improves resolution ( $\sim 0.5$  bits per octave of oversampling); (3) improves time-domain resolution.

Sigma-delta ADCs exploit  $64$ – $256\times$  oversampling with noise shaping to achieve 24-bit resolution at modest bandwidth.

## 11.9 Dithering

Adding small random noise before quantization linearizes the process when signal amplitude is comparable to LSB. The dither noise is then reduced by averaging, revealing sub-LSB signals.

## 11.10 Reconstruction

Converting digital to analog requires a DAC followed by a reconstruction filter (LP filter smoothing the staircase output). The ideal filter is a sinc function (brick-wall at  $f_s/2$ ). In practice, smooth analog filters with zero-order hold compensation are used.

## 11.11 Digital Resampling

**Decimation:** reduce rate by factor  $M$  (keep every  $M$ th sample after digital LP filter at  $f_s/(2M)$ ).

**Interpolation:** increase rate by factor  $L$  (insert zeros, LP filter). Used for matching rates between instruments and reducing data size.

### Common Aliasing Mistake

Students set sampling rate based on signal frequency alone, forgetting about noise. If the signal is at 10 Hz but the sensor picks up 60 Hz and 500 kHz noise, both will alias unless filtered before the ADC. The anti-alias filter must remove everything above  $f_s/2$ , not just above  $f_{\max}$ .

## 11.12 Practical Oversampling Design

In many MEGN 300 labs, the DAQ is capable of much higher sample rates than needed. This excess capacity should be exploited. For a temperature signal with  $f_{\max} = 1$  Hz, instead of sampling at the minimum 10 S/s, sample at 1000 S/s. Then apply a digital low-pass filter at 5 Hz and decimate by 100 to produce clean 10 S/s data. Benefits: (1) the anti-alias filter only needs to attenuate at 500 Hz (very easy), (2) quantization noise spread over 1000 Hz band is reduced to the 5 Hz signal band (23 dB improvement,  $\approx 4$  extra bits of effective resolution), (3) the 60 Hz noise and its harmonics are captured and can be digitally notch-filtered.

## 11.13 Sample Rate for Control Systems

In feedback control (Part IV), the controller must update fast enough that the digital sampling delay does not significantly degrade stability. The rule of thumb:  $f_s \geq 20 \times f_{\text{crossover}}$  where  $f_{\text{crossover}}$  is the loop bandwidth. For the ThermoRig with 0.2 Hz bandwidth:  $f_s \geq 4$  Hz. We use 10 Hz ( $T_s = 100$  ms) for comfortable margin. For a motor speed controller with 100 Hz bandwidth:  $f_s \geq 2$  kHz.

## 11.14 Data File Management

Continuous acquisition at high sample rates generates large files. At 100 kS/s with 16-bit resolution (2 bytes per sample): 200 kB/s = 12 MB/min = 720 MB/hr. Plan storage accordingly. Use binary file formats (not text/CSV) for large datasets. LabVIEW's TDMS format provides efficient binary storage with metadata.

### ★ Advanced Topic:

**Z-Transform** The z-transform is the discrete-time counterpart of the Laplace transform. This section is included for reference; you do not need to design filters using the z-transform directly for MEGN 300.

## 11.15 The Z-Transform and Digital System Analysis

Just as the Laplace transform ( $s$ -domain) is the analysis tool for continuous systems, the **z-transform** is the tool for discrete (sampled) systems. A discrete-time signal  $x[n]$  has z-transform:

$$X(z) = \sum_{n=0}^{\infty} x[n] z^{-n} \quad (11.4)$$

A digital filter's transfer function  $H(z) = Y(z)/X(z)$  describes its frequency response when evaluated on the unit circle ( $z = e^{j\omega T_s}$ ). Poles inside the unit circle ( $|z| < 1$ ) produce stable, decaying responses; poles outside produce unstable, growing responses. This is the discrete-system equivalent of the left/right half-plane rule in the  $s$ -domain.

For MEGN 300, you do not need to design filters using the z-transform directly, but understanding that LabVIEW's digital filter VIs are implementing z-domain transfer functions helps you interpret their behavior and debug unexpected results.

## 11.16 Quantization Effects in Digital Systems

After sampling, the continuous-amplitude signal is quantized to  $2^n$  discrete levels. This introduces two distinct effects:

**Quantization noise:** the difference between the true sample value and the nearest quantization level. For a properly dithered signal, this behaves as additive white noise with RMS value  $\text{LSB}/\sqrt{12}$  and flat PSD up to  $f_s/2$ . The signal-to-quantization-noise ratio (SQNR) is  $6.02n + 1.76$  dB.

**Quantization distortion:** for small signals (amplitude comparable to a few LSBs), the quantization is no longer approximately linear. The “staircase” nature of the transfer function creates harmonic distortion. Dithering (adding noise of amplitude  $\sim 1$  LSB before quantization) linearizes the process at the cost of a slightly higher noise floor.

## 11.17 Practical Anti-Aliasing: A Complete Design Example

Design an anti-aliasing system for measuring vibration from 0 to 500 Hz:

**Step 1:** signal bandwidth  $f_{\max} = 500$  Hz. Choose  $f_s = 2560$  S/s (standard vibration analysis:  $2.56 \times f_{\max}$ , which gives 56% oversampling above Nyquist minimum).

**Step 2:** Nyquist frequency  $f_N = f_s/2 = 1280$  Hz. The anti-alias filter must attenuate all content above 1280 Hz below the ADC noise floor.

**Step 3:** for a 16-bit ADC (96 dB dynamic range), require  $\geq 96$  dB attenuation at  $f_N$ . A 4th-order Butterworth at  $f_c = 640$  Hz provides  $-80$  dB/decade rolloff. At  $f_N = 1280$  Hz ( $= 2 \times f_c$ ): attenuation  $= 4 \times 20 \log_{10}(1280/640) = 4 \times 6 = 24$  dB. Insufficient.

**Step 4:** increase to 8th-order (two cascaded 4th-order stages):  $-160$  dB/decade. At  $f_N$ :  $8 \times 6 = 48$  dB. Still insufficient for 16-bit, but adequate for 8-bit. For 16-bit, either increase the sample rate (more oversampling) or use a higher-order filter.

**Step 5:** alternatively, oversample at  $f_s = 10,240$  S/s ( $20 \times f_{\max}$ ). Now  $f_N = 5120$  Hz. A 4th-order Butterworth at  $f_c = 640$  Hz provides  $-80 \log_{10}(5120/640) = -80 \times 0.903 = 72$  dB at  $f_N$ . Combined with subsequent digital filtering and decimation: adequate for 14-bit.

This example illustrates the fundamental tradeoff: sharper anti-alias filters allow lower sample rates, while higher sample rates allow simpler anti-alias filters.

## ★ Advanced Topic:

Multirate Signal Processing The following section on decimation and interpolation is beyond the scope of most MEGN 300 projects. It is included for reference when interfacing sensors at different sample rates.

## 11.18 Multirate Signal Processing

Many practical systems use multirate processing: acquire at a high sample rate (to simplify anti-aliasing), then decimate digitally to the rate needed for analysis or control.

**Decimation by M:** (1) apply a digital LP filter with cutoff at  $f_s/(2M)$  to prevent aliasing; (2) discard  $M - 1$  out of every  $M$  samples. The output rate is  $f_s/M$ . Example: acquire at 10 kS/s, decimate by 10 to 1 kS/s. The digital anti-alias filter at 500 Hz can be very sharp (100th-order FIR) because computation is cheap.

**Multistage decimation:** for large decimation ratios, cascade multiple smaller stages. Decimating by 100 as  $10 \times 10$  requires fewer total filter taps than a single  $100\times$  decimation. Each stage's filter only needs to handle its own Nyquist constraint.

## 11.19 Sigma-Delta Conversion in Detail

The sigma-delta ADC deserves deeper treatment because it is the dominant technology for precision measurement.

The sigma-delta modulator oversamples the input at rate  $K \times f_s$  (where  $K = 64\text{--}256$  is the oversampling ratio and  $f_s$  is the output rate). A 1-bit quantizer in a feedback loop with an integrator “shapes” the quantization noise, pushing most of it to high frequencies. A subsequent digital decimation filter ( $\text{sinc}^3$  or  $\text{sinc}^4$ ) removes this high-frequency noise and reduces the data rate to  $f_s$ .

The result: from a simple 1-bit converter, you achieve 24-bit resolution in the output band. The tradeoff is latency: the decimation filter introduces a delay of several hundred output sample periods. For the ThermoRig at 10 S/s output rate: latency  $\approx 0.3\text{ s}$ . This is acceptable for temperature measurement but would be too slow for a fast control loop.

## 11.20 Complete Anti-Aliasing Design: A Worked Example

Design a measurement system for capturing vibration signatures of a small DC motor (0–1 kHz bandwidth) using an NI USB-6001 (14-bit, max 20 kS/s).

**Step 1: Sample rate.** For  $f_{\max} = 1\text{ kHz}$ :  $f_s = 2.56 \times 1000 = 2560\text{ S/s}$  minimum. Choose  $f_s = 5120\text{ S/s}$  (power of  $2 \times 10$ , convenient for FFT with  $N = 5120$ ). Nyquist:  $f_N = 2560\text{ Hz}$ .

**Step 2: Anti-alias filter.** Need  $\geq 6.02 \times 14 = 84\text{ dB}$  attenuation at  $f_N = 2560\text{ Hz}$ . Choose  $f_c = 1280\text{ Hz}$  (octave above  $f_{\max}$ ). Required order  $n$  for Butterworth:  $n \geq 84/(20 \log_{10}(2560/1280)) = 84/6.02 = 14$ . An 8th-order Butterworth (four cascaded Sallen-Key stages) provides  $8 \times 6 = 48\text{ dB}$  at  $f_N$ , insufficient.

**Step 3: Increase oversampling.** Instead, sample at  $f_s = 20,480\text{ S/s}$  ( $20 \times f_{\max}$ ). Now  $f_N = 10,240\text{ Hz}$ . A 4th-order Butterworth at  $f_c = 1280\text{ Hz}$  provides  $4 \times 20 \log_{10}(10240/1280) = 4 \times 18.1 = 72\text{ dB}$  at  $f_N$ . Marginally adequate for 14-bit. Add a 6th-order ( $3 \times$  Sallen-Key) for 108 dB: comfortable margin.

**Step 4: Digital decimation.** After acquisition at 20 kS/s, apply a digital LP at 1280 Hz (sharp FIR, 200 taps) and decimate by 4 to 5 kS/s output. This gives 1 Hz frequency resolution with  $N = 5000$  points.

This example illustrates the oversampling + digital decimation strategy that is standard in modern instrumentation: use a high sample rate to simplify the analog anti-alias filter, then do the sharp filtering digitally where precision is free.

## 11.21 Choosing the Right Sample Rate: A Decision Framework

The sample rate  $f_s$  is one of the most important design decisions in a measurement system. Too low: aliasing corrupts data. Too high: generates excessive data volume, increases computational load, and may exceed DAQ bandwidth when using many channels. The right choice depends on the application:

**DC and slowly varying measurements** (temperature, static pressure, weight):  $f_s = 10$ – $100$  S/s. The signal bandwidth is  $< 1$  Hz, so even  $10\times$  oversampling requires only 10 S/s. Higher rates are useful only for oversampling-based resolution enhancement.

**Low-frequency dynamic measurements** (building vibration, ocean waves, biological signals):  $f_s = 100$ – $1000$  S/s. Signal bandwidth up to 50 Hz.

**General vibration and acoustics:**  $f_s = 2,560$ – $51,200$  S/s. Signal bandwidth 100 Hz to 20 kHz. The standard vibration analysis rate is  $2.56 \times f_{\max}$  (providing adequate oversampling for Hanning-windowed FFT).

**High-speed transients** (impact, shock, ultrasonic):  $f_s = 100$  kS/s to 100 MS/s. Signal bandwidth 10 kHz to 50 MHz. Requires high-speed DAQ hardware (oscilloscopes or dedicated high-speed digitizers).

## 11.22 Data Volume and Storage Calculations

At  $f_s = 100$  kS/s with 16-bit resolution: data rate = 200 kB/s = 12 MB/min = 720 MB/hr. For a 24-hour monitoring session: 17.3 GB. For 8 channels simultaneously: 138 GB. Plan storage and file format accordingly:

**Binary formats** (TDMS, HDF5, raw binary): compact, fast to write, preserves full precision. TDMS (NI's Technical Data Management Streaming) is native to LabVIEW and includes metadata headers.

**Text formats** (CSV, tab-delimited): human-readable but  $3$ – $10\times$  larger than binary (each 16-bit sample uses 2 bytes in binary but 5–6 characters in text). Writing speed is also slower due to number-to-text conversion. Use for small datasets or interoperability with Excel.

**Compression:** lossless compression (ZIP, gzip) typically reduces measurement data by 30–50%. Lossy compression (reducing precision from 16-bit to 12-bit) saves 25% but discards information permanently.

## 11.23 Discrete Convolution

Convolution is the fundamental operation of digital filtering. The output of an FIR filter is the discrete convolution of the input signal  $x[n]$  with the filter's impulse response  $h[n]$ :

$$y[n] = \sum_{k=0}^{M-1} h[k] \cdot x[n-k] = (x * h)[n] \quad (11.5)$$



In the frequency domain, convolution becomes multiplication:  $Y(f) = X(f) \cdot H(f)$ . This duality is the foundation of all frequency-domain signal processing: multiplying the signal spectrum by the filter's frequency response is equivalent to convolving the signal with the filter's impulse response in the time domain.

LabVIEW implements convolution via the “Convolution” VI in the Signal Processing palette, or implicitly when you use any filter VI (which convolves the input with the filter coefficients).

## 11.24 The Sampling Theorem: Proof by Intuition

Why must  $f_s > 2f_{\max}$ ? Consider a sine wave at frequency  $f$ . To uniquely identify this sine wave, you need to determine three parameters: frequency, amplitude, and phase. Each parameter requires at least one constraint, and each sample provides one constraint. Therefore, you need at least two samples per cycle ( $f_s > 2f$ ) to determine a single sinusoid. With fewer than two samples per cycle, you cannot distinguish the sinusoid from a lower-frequency alias.

At exactly  $f_s = 2f$  (sampling at the Nyquist rate): the samples fall at the same phase of each cycle. If they fall at the zero crossings, the measured amplitude is zero regardless of the true amplitude. This is why the inequality is strict:  $f_s > 2f_{\max}$ , not  $f_s \geq 2f_{\max}$ .

## 11.25 Practical Aliasing Scenarios in MEGN 300

**Scenario 1: Switching noise.** A DC-DC converter on the power supply board operates at 500 kHz. The thermocouple wiring picks up 5 mV of this noise. Sampled at 1 kS/s: the 500 kHz noise aliases to  $|500,000 - 500 \times 1000| = 0$  Hz (DC), appearing as a constant offset. Worse: it aliases to DC *only when the switching frequency is an exact multiple of the sample rate*. If the switching frequency drifts slightly (to 500.1 kHz): the alias appears at 100 Hz, creating an unexplained oscillation in the data.

**Scenario 2: Motor commutation.** A brushed DC motor commutates at  $N_{\text{segments}} \times f_{\text{rotation}}$ . For a 3-segment commutator at 10,000 RPM:  $f_{\text{comm}} = 3 \times 166.7 = 500$  Hz. If the vibration sensor is sampled at 800 S/s: the 500 Hz vibration aliases to  $|500 - 800| = 300$  Hz, appearing as a false vibration that does not correspond to any physical phenomenon.

**Scenario 3: Fluorescent lighting.** Fluorescent lights flicker at twice the mains frequency (120 Hz in the US). A photodiode measuring ambient light sampled at 100 S/s: the 120 Hz flicker aliases to  $|120 - 100| = 20$  Hz, appearing as a slow oscillation in the light level.

In all three scenarios, the solution is the same: an analog anti-alias filter before the ADC, with cutoff below  $f_s/2$ .

## 11.26 Digital Filtering in LabVIEW: Implementation Patterns

Three common implementation patterns for digital filtering in LabVIEW real-time applications:

**Pattern 1: Block processing.** Acquire a block of  $N$  samples, apply the filter to the entire block, process the result. Simple but introduces latency of  $N/f_s$  seconds. Suitable for offline analysis and non-real-time monitoring.

**Pattern 2: Sample-by-sample with shift registers.** In a While Loop, read one sample per iteration. Use shift registers to store the filter state (past inputs and outputs). Apply the filter equation to produce one output sample. This provides minimum latency (one sample period) and is the pattern for real-time control loops. The shift register count equals the filter order.

**Pattern 3: Streaming with overlap.** Acquire blocks of  $N$  samples with overlap. Apply the filter to each block, then stitch the results using overlap-add or overlap-save. This is the most efficient for long FIR filters because it uses FFT-based convolution (which is  $O(N \log N)$  instead of  $O(NM)$  for direct convolution). LabVIEW’s “Convolution” VI uses this approach internally.

## 11.27 Resampling: Practical Considerations

When combining data from two sources sampled at different rates (e.g., a vibration signal at 10 kS/s and a tachometer at 1 kS/s), resampling aligns the time bases:

**Upsampling** (interpolation): insert zeros between samples, then low-pass filter to smooth. In LabVIEW: the “Resample Waveforms” VI. Quality depends on the interpolation filter; use cubic or sinc interpolation for measurement-quality results. Linear interpolation introduces high-frequency distortion.

**Downsampling** (decimation): low-pass filter to prevent aliasing, then discard samples. The anti-alias filter cutoff must be at the new Nyquist frequency ( $f_{s,\text{new}}/2$ ), not the original.

**Rational resampling:** for non-integer rate ratios (e.g., converting from 44.1 kS/s to 48 kS/s, ratio = 160/147): first upsample by 160, then downsample by 147 (or use a polyphase filter that combines both operations efficiently).

## 11.28 Spectral Analysis of Noise

The noise floor of a measurement system is best characterized by its Power Spectral Density (PSD). To measure the system PSD:

(1) Short the input (zero signal). (2) Acquire a long record ( $T \geq 10$  s for thermal noise characterization). (3) Compute the PSD using Welch’s method (averaged, overlapped FFTs). (4) Plot in units of  $\text{V}^2/\text{Hz}$  or  $\text{V}/\sqrt{\text{Hz}}$  vs. frequency.

The PSD reveals the noise character: **white noise** (flat PSD) indicates thermal noise or quantization noise dominating. **1/f noise** (PSD rising at low frequencies) indicates flicker noise in semiconductors. **Discrete peaks** indicate EMI at specific frequencies.

The total RMS noise in a measurement with bandwidth  $B$  is:

$$V_{n,\text{RMS}} = \sqrt{\int_0^B \text{PSD}(f) df} \quad (11.6)$$

For white noise with  $\text{PSD} = S_0$ :  $V_{n,\text{RMS}} = \sqrt{S_0 \cdot B}$ . Halving  $B$  reduces noise by  $\sqrt{2}$  (3 dB).

### ★ Advanced Topic:

**Z-Transform for Digital Control** This section connects the z-transform to digital PID implementation. It is advanced reference material not required for MEGN 300 exams.

## 11.29 The Z-Transform: Bridge from Continuous to Digital

The Laplace transform ( $s$ -domain) describes continuous-time systems. The **z-transform** is its discrete-time counterpart. Understanding the  $s$ -to- $z$  mapping is essential for analyzing digital control loops (Chapter 16) and digital filters (Chapter 12).

### 11.29.1 Definition

For a discrete-time signal  $x[n]$ :  $X(z) = \sum_{n=0}^{\infty} x[n]z^{-n}$ . The variable  $z = e^{sT_s}$  relates the  $z$ -domain to the  $s$ -domain, where  $T_s = 1/f_s$  is the sample period.

### 11.29.2 Key Mapping: Poles and Stability

In the  $s$ -domain, stability requires all poles in the left half-plane ( $\text{Re}(s) < 0$ ). The mapping  $z = e^{sT_s}$  transforms the left half-plane into the interior of the unit circle ( $|z| < 1$ ). Therefore, in the  $z$ -domain, stability requires all poles inside the unit circle.

The imaginary axis ( $\text{Re}(s) = 0$ ) maps to the unit circle ( $|z| = 1$ ). Frequencies map as:  $\omega = 0$  (DC) maps to  $z = 1$ . The Nyquist frequency  $\omega = \pi/T_s$  maps to  $z = -1$ . Frequencies between 0 and Nyquist trace the upper half of the unit circle.

### 11.29.3 Bilinear Transform

The most common method for converting an analog filter or controller design to digital form:  $s = \frac{2}{T_s} \frac{1-z^{-1}}{1+z^{-1}}$ . This maps the entire left half-plane to the interior of the unit circle (preserving stability) with a nonlinear frequency warping:  $\omega_{\text{digital}} = (2/T_s) \tan(\omega_{\text{analog}}T_s/2)$ . The warping is negligible for  $\omega_{\text{analog}} \ll \pi/T_s$  but becomes significant near Nyquist. Pre-warp the analog cutoff frequency before applying the bilinear transform to ensure the digital filter has the correct cutoff.

### 11.29.4 Why This Matters for Control

A PI controller designed in the  $s$ -domain as  $G_c(s) = K_p + K_i/s$  must be converted to the  $z$ -domain for digital implementation. The simplest method (backward Euler):  $1/s \rightarrow T_s/(1 - z^{-1})$ , giving  $G_c(z) = K_p + K_iT_s/(1 - z^{-1})$ . This is exactly the discrete PID summation used in Chapter 16. The bilinear transform gives a slightly different (and more accurate) discretization:  $1/s \rightarrow (T_s/2)(1 + z^{-1})/(1 - z^{-1})$ , called the Tustin method. For slow loops ( $f_s \gg 10 \times f_{\text{bandwidth}}$ ), the methods are equivalent. For fast loops ( $f_s < 20 \times f_{\text{bandwidth}}$ ), the Tustin method better preserves the analog design's stability margins.

#### When to Worry About the $s$ -to- $z$ Mapping

For MEGN 300 thermal control systems ( $f_{\text{bandwidth}} < 0.1 \text{ Hz}$ ,  $f_s \geq 10 \text{ Hz}$ ): the ratio  $f_s/f_{\text{bandwidth}} > 100$ . At this ratio, all discretization methods (Euler, Tustin, exact ZOH) give identical results. The  $s$ -to- $z$  mapping becomes important when this ratio drops below 20, which occurs in fast mechanical and electrical control systems but not in typical instrumentation lab projects.

## 11.30 Practice Questions

1. A 500 Hz signal is sampled at 800 S/s. What frequency appears in the digital data? Is this the true signal or an alias?
2. Design an anti-aliasing filter for a DAQ system sampling at 10 kS/s. The signal of interest spans 0–2 kHz. Specify the filter type, cutoff frequency, and minimum order if the filter must attenuate frequencies above 5 kHz by at least 40 dB.

3. A 12-bit ADC with a 10 V range has a measured SINAD of 68 dB. Calculate the ENOB. How many bits of resolution are “lost” to noise and distortion?

### 11.30.1 Answers

1.  $f_s/2 = 400$  Hz. Since  $500 > 400$ , it aliases.  $f_{\text{alias}} = |500 - 1 \times 800| = 300$  Hz. A false 300 Hz signal appears in the data; the true 500 Hz signal is lost.
2. Anti-alias cutoff: set at 4 kHz (to pass the 0–2 kHz signal band with margin and begin rolling off before Nyquist at 5 kHz). For 40 dB attenuation in the range 5–10 kHz: a 4th-order Butterworth (–80 dB/decade) provides 40 dB attenuation at 1.25 decades above cutoff... actually at 5 kHz ( $5/4 = 1.25 \times$  cutoff): attenuation =  $20 \times 4 \times \log_{10}(1.25) = 7.7$  dB (not enough). A better approach: set cutoff at 3 kHz. At 5 kHz:  $5/3 = 1.67 \times$ , 4th-order attenuation =  $80 \times \log_{10}(1.67) = 17.8$  dB (still not enough for –40 dB). Need higher order or lower cutoff. An 8th-order Butterworth at 3.5 kHz gives  $-160 \times \log_{10}(5/3.5) = -24.8$  dB at 5 kHz; still short. Practical solution: use a 4th-order Butterworth at 2.5 kHz, which gives  $-80 \times \log_{10}(5/2.5) = -24$  dB at 5 kHz. With oversampling (sample at 50 kS/s, digitally filter, then decimate to 10 kS/s), the analog filter requirements relax dramatically. This is the standard approach in modern DAQ systems.
3.  $\text{ENOB} = (68 - 1.76)/6.02 = 11.0$  bits. The ADC loses 1.0 bit of effective resolution to noise and distortion.

# Chapter 12

## Analog Filter Design

### When to Read This Chapter

**Module 6 (Weeks 9–10):** Read before the filter design lab. Focus on the Butterworth vs. Chebyshev comparison, the Sallen-Key topology, and the component calculation procedure. The Bode plot interpretation section is used repeatedly in the control systems module. **Related:** DSP fundamentals in Chapter 11 (p. 112); digital filters in Chapter 13 (p. 133).

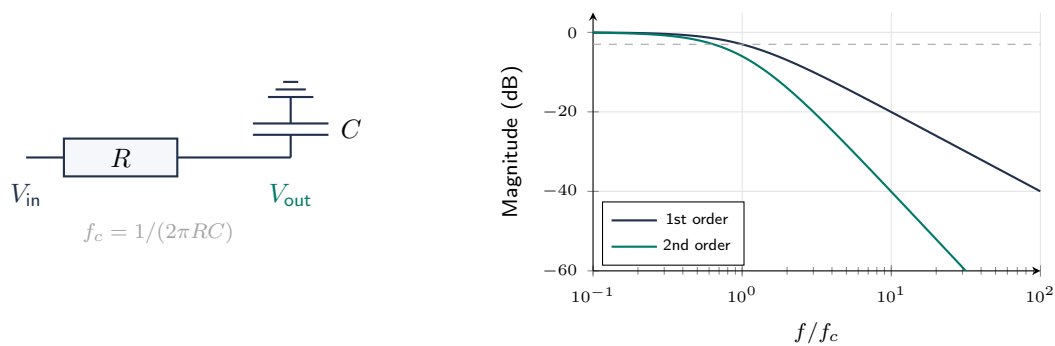


Figure 12.1: Left: first-order passive RC low-pass filter. Right: Bode magnitude response comparing 1st order ( $-20$  dB/dec) and 2nd order ( $-40$  dB/dec). A first-order filter is often insufficient for anti-aliasing.

### 12.1 What Filters Do

A filter selectively passes or rejects frequency components of a signal. Four basic types:

- **Low-pass:** passes frequencies below cutoff  $f_c$ ; attenuates above. The most common in instrumentation (anti-aliasing, noise reduction).
- **High-pass:** passes frequencies above  $f_c$ ; attenuates below. Removes DC offset and low-frequency drift.
- **Band-pass:** passes a band between  $f_L$  and  $f_H$ ; attenuates outside. Isolates a signal of interest.
- **Band-stop (notch):** rejects a narrow band around a center frequency. Removes a specific interference (e.g., 60 Hz hum).

### 12.2 Passive RC Filters

The simplest filter: one resistor and one capacitor.

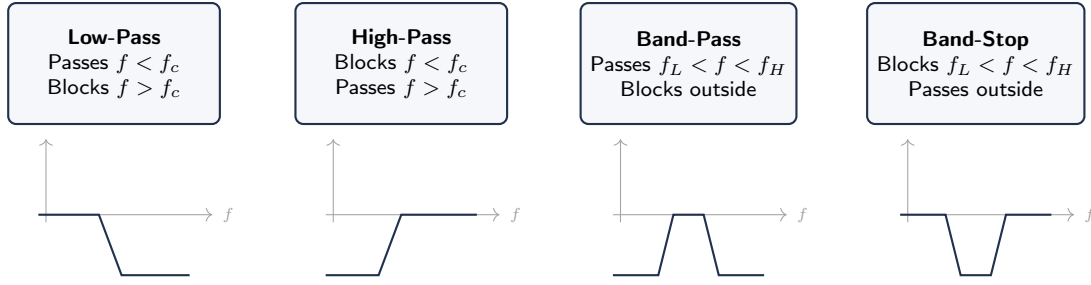


Figure 12.2: Four filter types with idealized magnitude response shapes. Low-pass is the most common in MEGN 300 (anti-aliasing, noise reduction). Band-stop (notch) is used to remove specific interference frequencies (e.g., 60 Hz mains hum).

### 12.2.1 First-Order Low-Pass

RC in series; output across the capacitor.

$$f_c = \frac{1}{2\pi RC}, \quad H(j\omega) = \frac{1}{1 + j\omega RC} \quad (12.1)$$

Magnitude rolls off at  $-20$  dB/decade above  $f_c$ . Phase shifts from  $0^\circ$  (DC) to  $-90^\circ$  (high frequency), passing through  $-45^\circ$  at  $f_c$ .

### 12.2.2 First-Order High-Pass

Same components; output across the resistor.

$$f_c = \frac{1}{2\pi RC}, \quad H(j\omega) = \frac{j\omega RC}{1 + j\omega RC} \quad (12.2)$$

Passes frequencies above  $f_c$ ;  $-20$  dB/decade roll-off below  $f_c$ .

## 12.3 Active Filters

Active filters use operational amplifiers to provide gain, buffering, and steeper roll-off without the signal attenuation inherent in passive filters. The Sallen-Key topology is the most common for second-order sections.

### 12.3.1 Filter Response Types

**Butterworth:** maximally flat magnitude in the passband. No ripple. The standard choice when flat amplitude response is more important than sharp cutoff. Roll-off:  $-20n$  dB/decade for  $n$ -th order.

**Chebyshev Type I:** steeper roll-off than Butterworth for the same order, but introduces ripple in the passband. Use when sharp cutoff is more important than flat passband.

**Bessel:** maximally flat group delay (linear phase). The best choice for time-domain measurements (pulse shapes, step responses) where phase distortion must be minimized.

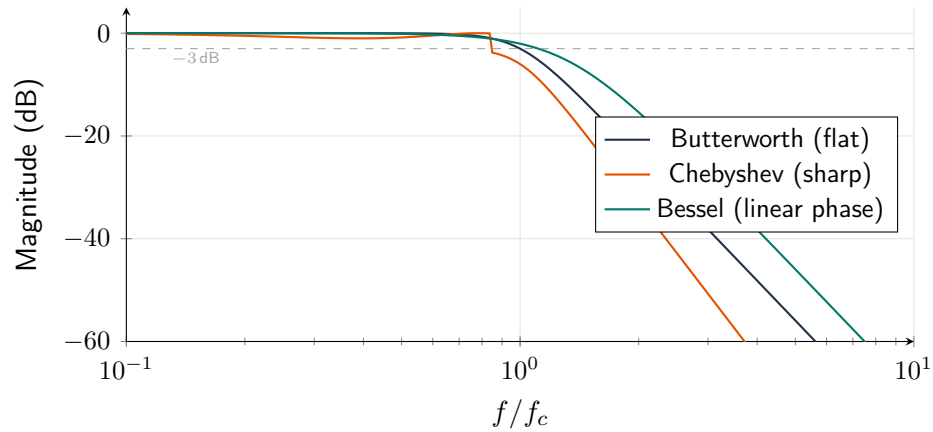


Figure 12.3: Bode magnitude comparison of 4th-order Butterworth, Chebyshev, and Bessel low-pass filters. Chebyshev has the steepest rolloff but passband ripple. Bessel has the gentlest rolloff but preserves pulse shape (linear phase). Butterworth is the default.

#### Choosing a Filter Type

For anti-aliasing: Butterworth (flat passband). For isolating a specific frequency: Chebyshev (sharp cutoff). For preserving pulse shape: Bessel (linear phase). When in doubt, use Butterworth.

## 12.4 Designing Active Filters with Op-Amps

### 12.4.1 Sallen-Key Low-Pass (Second-Order)

The Sallen-Key topology uses a single op-amp in a non-inverting configuration with positive feedback through capacitors. For a unity-gain second-order Butterworth low-pass:

$$f_c = \frac{1}{2\pi\sqrt{R_1 R_2 C_1 C_2}} \quad (12.3)$$

For Butterworth response (maximally flat), set  $C_2 = 2C_1$  and  $R_1 = R_2 = R$ :

$$f_c = \frac{1}{2\pi R\sqrt{2C_1^2}} = \frac{1}{2\pi RC_1\sqrt{2}} \quad (12.4)$$

**Design procedure** for a 2nd-order Butterworth LP at  $f_c$ :

1. Choose  $C_1$  (typically 1–100 nF for audio/instrumentation frequencies).
2. Set  $C_2 = 2C_1$ .
3. Calculate  $R = R_1 = R_2 = 1/(2\pi f_c C_1 \sqrt{2})$ .
4. Select the nearest standard resistor value.
5. Use a unity-gain stable op-amp (e.g., TL072, OPA2134, or MCP6002 for 3.3 V systems).

### 12.4.2 Higher-Order Filters

Higher-order filters are built by cascading second-order sections. A 4th-order Butterworth = two cascaded 2nd-order Sallen-Key stages, each with a specific  $Q$  value (1st stage:  $Q = 0.541$ ; 2nd

stage:  $Q = 1.307$ ). Filter design tables (or software like FilterPro, Analog Devices Filter Wizard) provide the component values for each stage.

#### Use Filter Design Software

Do not calculate high-order filter components by hand. Use Texas Instruments FilterPro, Analog Devices Filter Wizard, or the MathWorks Filter Designer. Input your requirements (type, order, cutoff, passband ripple) and the tool outputs a complete schematic with component values. Verify in SPICE simulation before building.

## 12.5 Why Analog Filters Are Essential

Digital filters (Chapter 11) operate on digitized signals only. Before the ADC, the only noise removal tool is an analog filter. The anti-alias filter (analog LP before ADC) is mandatory; without it, aliasing permanently corrupts digital data.

## 12.6 First-Order RC Low-Pass Filter

$f_c = 1/(2\pi RC)$ . At  $f_c$ :  $-3$  dB. Above:  $-20$  dB/decade. Rarely adequate for anti-aliasing; at  $10 \times f_c$ , only  $-20$  dB attenuation passes through. Choose  $R$  in  $1$ – $100$  k $\Omega$  range (balance current draw vs. thermal noise).

## 12.7 Sallen-Key Active Filters

Second-order ( $-40$  dB/decade) with one op-amp. Equal-component design ( $R_1 = R_2$ ,  $C_1 = C_2$ ):  $f_c = 1/(2\pi RC)$ . For Butterworth response ( $Q = 0.707$ ), set gain  $G = 1.586$ . Cascade two stages for 4th order ( $-80$  dB/decade).

## 12.8 Filter Types

**Butterworth:** maximally flat passband. No ripple. Default for general-purpose and anti-aliasing.  $|H(f)| = 1/\sqrt{1 + (f/f_c)^{2n}}$ .

**Chebyshev Type I:** steepest rolloff for given order. Accepts  $0.5$ – $3$  dB passband ripple. Use when maximum rejection of a nearby interferer is needed.

**Bessel:** most linear phase (constant group delay). Preserves pulse shape. Gentlest rolloff. Use for time-domain transient measurements.

#### Phase Delay and Control Stability

Higher-order filters introduce more phase lag. A 4th-order Butterworth at  $100$  Hz has  $\sim 180^\circ$  lag at cutoff. In control loops, this reduces phase margin and can cause instability. Limit filter order and set cutoff well above control bandwidth.

## 12.9 Notch Filters

A notch (band-reject) filter removes a specific frequency (e.g.,  $60$  Hz) while passing all others. Twin-T passive topology achieves  $-40$  to  $-60$  dB rejection. However, if interference has harmonics,



each needs its own notch. Fixing grounding and shielding is often a better solution.

## 12.10 Design Workflow

(1) Determine  $f_{\max}$  and  $f_s$ . (2) Set  $f_c$  between  $f_{\max}$  and  $f_s/2$  (common:  $f_c = f_s/4$ ). (3) Required stopband attenuation at  $f_s/2$ :  $\geq 6n$  dB for  $n$ -bit ADC. (4) Choose filter type. (5) Calculate order:  $n \geq \text{attenuation} / (20 \log_{10}(f_s/(2f_c)))$  for Butterworth. (6) Implement with cascaded Sallen-Key stages. (7) Measure actual response.

## 12.11 Component Selection for Filters

Real components have parasitic properties that affect filter performance. Resistors have parasitic inductance (wire-wound types: 1–10  $\mu\text{H}$ ) and capacitance (0.1–1 pF). Carbon film and thin-film resistors are preferred for filter applications. Capacitors have parasitic ESR (equivalent series resistance) and ESL (inductance). Ceramic (C0G/NP0) are best for filter applications: low ESR, low temperature coefficient, stable capacitance. Avoid Y5V and Z5U ceramics (capacitance varies 20–80% with temperature and voltage).

## 12.12 Active Filter Power Supply Considerations

The op-amp in a Sallen-Key filter needs headroom above and below the signal swing. For a 0–5 V signal, use  $\pm 12$  V or  $\pm 15$  V bipolar supply (or a single 12 V supply with mid-rail virtual ground). Single-supply op-amps (rail-to-rail input/output) can operate on 5 V, but the signal must be biased to mid-supply for maximum dynamic range.

## 12.13 Measuring Filter Response

After building a filter, verify its frequency response experimentally: (1) Apply a sine wave from a function generator. (2) Sweep the frequency from  $0.1f_c$  to  $10f_c$  in 10–20 steps. (3) At each frequency, measure the input and output amplitudes (RMS voltmeters or oscilloscope). (4) Compute the gain  $G = V_{\text{out}}/V_{\text{in}}$  and convert to dB. (5) Plot the Bode magnitude diagram and verify it matches the design. Deviations indicate component tolerances, parasitic effects, or wiring errors.

## 12.14 Switched-Capacitor Filters

An alternative to traditional RC active filters, switched-capacitor filters use a clock signal to simulate resistors with capacitor-switch networks. The “resistance” is  $R_{\text{eq}} = 1/(f_{\text{clk}}C)$ , so the cutoff frequency scales linearly with the clock frequency. This allows easy, precise frequency tuning by changing a single clock signal. Available as complete ICs (e.g., MAX291/MAX292 for 8th-order Butterworth). Ideal for applications needing multiple filter frequencies or temperature-insensitive cutoff.

## 12.15 Active Filter Component Sensitivity

Real components have tolerances (1% for standard resistors, 5–10% for ceramic capacitors). These tolerances shift the actual filter cutoff frequency and  $Q$  from the design values.

For a Sallen-Key filter with equal components ( $R, C$ ): the cutoff frequency  $f_c = 1/(2\pi RC)$  has a sensitivity of  $-1$  to both  $R$  and  $C$ : a 1% increase in  $R$  decreases  $f_c$  by 1%. With 1% resistors and 5% capacitors, the worst-case  $f_c$  deviation is approximately  $\pm 6\%$ . For anti-aliasing, this means designing with a safety margin: set  $f_c$  at 80% of the desired value to ensure the actual cutoff never exceeds the target.

For the  $Q$  factor, sensitivity depends on the topology. In the Sallen-Key,  $Q$  is sensitive to the gain-setting resistors. A 1% mismatch can shift  $Q$  by 5–10%, potentially causing peaking or reduced rolloff in a Butterworth design. Solution: use 0.1% resistors for the gain network, or use a topology less sensitive to  $Q$  (Multiple Feedback or State Variable).

## 12.16 Multiple Feedback (MFB) Topology

The MFB is an alternative to Sallen-Key that provides an inverting output and has lower sensitivity to component variations for high- $Q$  designs. The transfer function:

$$H(s) = \frac{-1/(R_1 R_3 C_1 C_2)}{s^2 + s(1/R_1 + 1/R_3)/(C_2) + 1/(R_2 R_3 C_1 C_2)} \quad (12.5)$$

The MFB is preferred when  $Q > 2$  because the Sallen-Key requires gain close to 3, which makes it sensitive to gain-resistor tolerance. The MFB achieves high  $Q$  without high gain, reducing sensitivity.

## 12.17 State Variable Filter

The state-variable (or biquad) topology uses two integrators and a summing amplifier to provide simultaneous low-pass, band-pass, and high-pass outputs from a single circuit. Advantages:  $f_c$  and  $Q$  can be adjusted independently (by changing different component values), and the circuit is less sensitive to component tolerances than Sallen-Key at high  $Q$ . Disadvantage: requires three op-amps per second-order section (vs. one for Sallen-Key).

The state variable is the topology of choice for tunable filters, notch filters (by summing the LP and HP outputs), and precision band-pass filters used in vibration analysis.

## 12.18 Switched-Capacitor Filters

Switched-capacitor (SC) filters simulate resistors using capacitors and electronic switches:  $R_{eq} = 1/(f_{clk} \cdot C)$ . By changing the clock frequency, the cutoff frequency changes proportionally. Available as complete ICs:

**MAX291/MAX292:** 8th-order Butterworth or Bessel LP. Clock-to-cutoff ratio of 100:1. For  $f_c = 1$  kHz: apply a 100 kHz clock. For  $f_c = 10$  Hz: apply a 1 kHz clock. No external components needed beyond a clock source and decoupling capacitors.

**LTC1068:** quad 2nd-order sections configurable as LP, HP, BP, or notch. For complex filter shapes.

SC filters are ideal for anti-aliasing in systems where the sample rate (and therefore the required  $f_c$ ) changes dynamically. They introduce clock feedthrough noise at  $f_{clk}$  and its harmonics, which must be removed by a simple RC post-filter.

## 12.19 Filter Design Software Tools

Analog Devices Filter Wizard (<https://tools.analog.com/en/filterwizard/>): enter the specifications (type, order, cutoff, passband ripple), and the tool generates a complete schematic with component values, including specific op-amp recommendations.

Texas Instruments FilterPro: similar capability with TI op-amp recommendations.

MATLAB `butter()`, `cheby1()`, `besself()`: compute the analog prototype coefficients. Use `[b,a] = butter(n, Wn, 's')` for  $n$ th-order Butterworth with cutoff  $W_n$  (rad/s).

In MEGN 300 labs, use the Analog Devices tool for hardware anti-alias filter design, and LabVIEW's Filter Express VI for digital filters.

## 12.20 Practical Troubleshooting

**Filter oscillates:** the op-amp is not stable at the required gain and phase margin. Check the op-amp's unity-gain stability specification. Use a compensation capacitor or select a different op-amp.

**Cutoff frequency is wrong:** measure the actual component values ( $R$  and  $C$ ) with a multimeter and LCR meter. Recalculate  $f_c$  with measured values. Ceramic capacitors (X7R, Y5V) lose significant capacitance at DC bias voltages and elevated temperatures.

**Passband gain is not flat:** the op-amp's open-loop gain is insufficient at the frequencies of interest. Check that the GBW product exceeds  $f_c \times G \times 10$  (a  $10\times$  margin above the minimum).

**Excessive noise:** check decoupling capacitors. Verify the power supply is clean. Use low-noise op-amps (OPA2277:  $e_n = 8 \text{ nV}/\sqrt{\text{Hz}}$  vs. LM741:  $e_n = 40 \text{ nV}/\sqrt{\text{Hz}}$ ).

## 12.21 Practical Active Filter Construction Tips

**Component matching:** for each Sallen-Key stage, the two resistors should be from the same batch (matched temperature coefficients), and the two capacitors should be measured and selected to be within 1% of each other. A 5% capacitor tolerance can shift  $f_c$  by 5% and  $Q$  by up to 15%.

**Op-amp selection for filters:** the op-amp's GBW must exceed  $f_c \times G \times 10$ . For a unity-gain Sallen-Key at  $f_c = 10 \text{ kHz}$ :  $\text{GBW} > 100 \text{ kHz}$  (any general-purpose op-amp). For a Sallen-Key at  $f_c = 100 \text{ kHz}$  with  $G = 2$ :  $\text{GBW} > 2 \text{ MHz}$  (use TL072 or better). Insufficient GBW causes premature rolloff and  $Q$  peaking.

**Capacitor types:** for filter circuits, use C0G/NP0 ceramic (stable with temperature and voltage, but limited to small values, typically  $< 10 \text{ nF}$ ), polypropylene film (stable, low loss, available to  $1 \mu\text{F}$ ), or polyester film (acceptable for non-critical applications). Avoid X7R and Y5V ceramics in the signal path (capacitance varies 20–80% with DC bias and temperature).

**PCB layout:** keep filter components physically close to the op-amp. Route the input trace away from the output trace to prevent capacitive coupling (which creates positive feedback and oscillation). Use a ground plane under the filter section to minimize stray impedance.

## 12.22 Complete Anti-Alias Filter Design: Step by Step

This section walks through a complete anti-alias filter design for a strain gauge measurement system, demonstrating every design decision.

**Requirements:** measure strain from 0 to 200 Hz with 14-bit accuracy. DAQ: NI USB-6001, max 20 kS/s.

**Step 1: Choose sample rate.** Signal bandwidth  $f_{\max} = 200$  Hz. Using the  $10\times$  rule:  $f_s = 2000$  S/s. Nyquist frequency  $f_N = 1000$  Hz.

**Step 2: Determine required stopband attenuation.** For a 14-bit ADC: dynamic range  $= 6.02 \times 14 + 1.76 = 86$  dB. The anti-alias filter must attenuate all content above  $f_N = 1000$  Hz by at least 86 dB to prevent aliased signals from exceeding the quantization noise floor.

**Step 3: Choose cutoff frequency and filter type.** Set  $f_c = 400$  Hz (double the signal bandwidth, providing a guard band for the filter's transition region). Choose Butterworth (maximally flat passband, default for anti-aliasing).

**Step 4: Calculate required order.** The Butterworth magnitude response at frequency  $f$ :  $|H(f)| = 1/\sqrt{1 + (f/f_c)^{2n}}$ . Attenuation at  $f_N = 1000$  Hz:  $A = 20n \log_{10}(1000/400) = 20n \times 0.398 = 7.96n$  dB. For 86 dB:  $n \geq 86/7.96 = 10.8$ . Use  $n = 12$  (6th-order  $\times 2$  for margin, implemented as six cascaded Sallen-Key stages).

**Step 5: Compute component values.** Each Sallen-Key stage has specific  $Q$  values determined by the Butterworth polynomial. For a 6th-order Butterworth, the three second-order section  $Q$  values are:  $Q_1 = 0.518$ ,  $Q_2 = 0.707$ ,  $Q_3 = 1.932$ . For each section with  $f_c = 400$  Hz: choose  $C = 10$  nF (convenient standard value). Then  $R = 1/(2\pi f_c C) = 1/(2\pi \times 400 \times 10^{-8}) = 39.8$  k $\Omega$ . Use 39.2 k $\Omega$  (nearest E96 value). The gain for each section:  $G = 3 - 1/Q$ . For  $Q_3 = 1.932$ :  $G = 2.482$ , so  $R_f/R_g = 1.482$ . Use  $R_f = 14.7$  k $\Omega$ ,  $R_g = 10.0$  k $\Omega$  (ratio = 1.47, close enough with 1% resistors).

**Step 6: Select op-amps.** Each section needs  $\text{GBW} > f_c \times G \times 10 = 400 \times 2.5 \times 10 = 10$  kHz (trivial). Use TL072 ( $\text{GBW} = 3$  MHz, dual package, 3 packages for 6 sections). For low noise: substitute OPA2277 in the first two sections (closest to the sensor).

**Step 7: Build, measure, verify.** After construction, sweep a sine wave from 10 Hz to 5 kHz and verify the frequency response matches the design within  $\pm 1$  dB in the passband and achieves  $> 80$  dB attenuation at 1 kHz.

## 12.23 Higher-Order Filter Design Tables

The following table gives the  $Q$  values for each second-order section of Butterworth filters up to 8th order:

| Order $n$ | Section $Q$ values                            |
|-----------|-----------------------------------------------|
| 2         | 0.707                                         |
| 3         | 1.000 (2nd-order section) + 1st-order section |
| 4         | 0.541, 1.307                                  |
| 6         | 0.518, 0.707, 1.932                           |
| 8         | 0.510, 0.601, 0.900, 2.563                    |

Table 12.1: Butterworth filter section  $Q$  values. Higher- $Q$  sections produce peaking near  $f_c$ ; place them last in the cascade to minimize noise amplification.

For Chebyshev Type I filters with 0.5 dB passband ripple, the section  $Q$  values are higher (e.g., 4th-order:  $Q_1 = 0.785$ ,  $Q_2 = 3.559$ ), which demands tighter resistor tolerances in the gain network. Bessel filter  $Q$  values are lower than Butterworth (e.g., 4th-order:  $Q_1 = 0.522$ ,  $Q_2 = 0.806$ ), making them easier to implement but with gentler rolloff.

## 12.24 All-Pass Filters for Phase Correction

An all-pass filter has flat magnitude response ( $|H(f)| = 1$  at all frequencies) but a frequency-dependent phase shift. It is used to correct the phase distortion introduced by other filter stages without affecting their magnitude response. In applications where both sharp cutoff (Chebyshev or Butterworth) and linear phase (for pulse preservation) are needed, cascade the LP filter with an all-pass equalizer designed to linearize the total phase response.

## 12.25 Anti-Alias Filter Implementation Options

Three practical approaches for MEGN 300 projects:

**Discrete components on protoboard:** most educational, teaches filter theory directly. Use for cutoff frequencies  $< 10$  kHz. Component count: 2 resistors + 2 capacitors + 1 op-amp per second-order section.

**Switched-capacitor IC** (MAX291/MAX292): no external components except clock source and bypass caps. 8th-order Butterworth or Bessel. Set cutoff by clock frequency ( $f_c = f_{\text{clk}}/100$ ). Ideal for variable-frequency applications. Clock feedthrough requires a simple RC post-filter.

**Integrated signal conditioning module:** many NI DAQ modules (e.g., NI 9234 for vibration) include built-in anti-alias filters, amplifiers, and IEPE sensor excitation. No external analog design needed, but less educational and more expensive.

## 12.26 Passive vs. Active Filters: When to Use Each

**Passive filters** (R, L, C only, no op-amp): cannot provide gain ( $|H| \leq 1$  at all frequencies). Advantages: no power supply needed, no noise from active components, can handle high voltages and currents directly. Use for: EMI filtering on power lines, RF filtering above 1 MHz (where op-amp bandwidth is insufficient), and output reconstruction filters after DACs.

**Active filters** (op-amp based): can provide gain, sharp rolloff with compact components, and buffered output. Advantages: high  $Q$  without inductors (inductors are large, lossy, and expensive at low frequencies), precise cutoff frequency with standard R and C values, cascadable without loading effects. Use for: anti-alias filtering, signal conditioning, and all audio/sub-audio frequency applications.

**The inductor problem:** a 1 kHz low-pass filter using passive LC components requires  $L \approx 100$  mH and  $C \approx 250$  nF. A 100 mH inductor is physically large ( $\sim 25$  mm diameter), has significant DC resistance ( $> 10 \Omega$ ), and couples magnetically with nearby circuits (EMI source). An equivalent Sallen-Key active filter uses two 10 k $\Omega$  resistors, two 15 nF capacitors, and one op-amp, all in a few square centimeters. Below 100 kHz, active filters are almost always preferred.

## 12.27 Elliptic (Cauer) Filters

The elliptic filter achieves the absolute steepest rolloff for a given order by allowing ripple in both the passband and the stopband. Where a 4th-order Butterworth provides  $-24$  dB/octave rolloff, a 4th-order elliptic can achieve the same stopband rejection with 2nd order (half the components).

The tradeoff: (1) passband ripple (typically 0.1–1 dB), (2) finite stopband rejection (the stopband attenuation is not monotonically increasing but has “notches” that return to the ripple level), and (3) nonlinear phase (worse than Chebyshev). Use elliptic filters only when the filter order must be minimized and both passband ripple and phase distortion are acceptable.

## 12.28 Group Delay and Its Measurement

The **group delay**  $\tau_g(f) = -d\phi/d\omega$  is the time delay experienced by the envelope of a narrow-band signal at frequency  $f$ . For a linear-phase filter (FIR with symmetric coefficients):  $\tau_g$  is constant at all frequencies, meaning all frequency components arrive at the output simultaneously, preserving the waveform shape. For a minimum-phase filter (Butterworth, Chebyshev):  $\tau_g$  increases near the cutoff frequency, meaning low frequencies arrive before high frequencies, distorting transient signals.

To measure group delay experimentally: apply a swept sine wave and measure the phase at each frequency. Compute  $\tau_g = -\Delta\phi/\Delta\omega$  from adjacent frequency points. In LabVIEW: the “Group Delay” VI in the Signal Processing palette computes this from the filter coefficients.

For the ThermoRig anti-alias filter (2nd-order Butterworth at 40 Hz): group delay at DC =  $1/(2\pi \times 40) = 4$  ms. At 30 Hz (near cutoff): group delay increases to approximately 8 ms. At 10 Hz (mid-band): approximately 4.5 ms. The 4 ms variation is negligible for the 0.1 Hz control bandwidth but would be significant for a vibration measurement system.

## 12.29 Practice Questions

1. Design a passive RC low-pass filter with  $f_c = 1$  kHz. Specify  $R$  and  $C$  values. What is the attenuation at 10 kHz?
2. Explain why a 4th-order Butterworth low-pass filter has a  $-80$  dB/decade roll-off, while a 1st-order filter has only  $-20$  dB/decade.
3. You need to remove 60 Hz interference from a 0–10 Hz signal. Design a filter strategy: what type(s) of filters do you use, and what are their specifications?

### 12.29.1 Answers

1.  $f_c = 1/(2\pi RC) = 1000$  Hz. Choose  $R = 1.59$  k $\Omega$ ,  $C = 100$  nF ( $f_c = 1/(2\pi \times 1590 \times 10^{-7}) = 1001$  Hz). At 10 kHz ( $10 \times f_c$ ): attenuation =  $-20 \log_{10}(\sqrt{1 + 10^2}) = -20$  dB.
2. Each first-order section contributes  $-20$  dB/decade of roll-off. A 4th-order filter cascades four first-order sections (or two second-order Sallen-Key stages), so the combined roll-off is  $4 \times (-20) = -80$  dB/decade.
3. Use a low-pass filter at  $f_c = 15$ –20 Hz (Butterworth, 2nd or 4th order) to pass the 0–10 Hz signal and attenuate 60 Hz. A 2nd-order Butterworth at 15 Hz gives  $-40 \log_{10}(60/15) = -24$  dB at 60 Hz. If more rejection is needed, cascade with a 60 Hz notch filter (twin-T or state-variable topology) for an additional 30–40 dB of rejection at exactly 60 Hz.

# Chapter 13

## Digital Filter Design

### When to Read This Chapter

**Module 6 (Weeks 9–10):** Read after the analog filter chapter. Focus on FIR vs. IIR tradeoffs, the window design method, and the LabVIEW filter implementation. The control-loop interaction section is important for Module 9. **Related:** Analog filters in Chapter 12 (p. 123); PID control in Chapter 20 (p. 211).

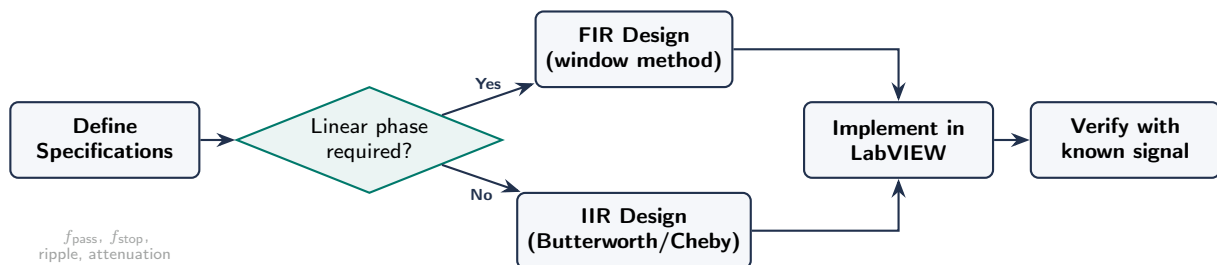


Figure 13.1: Digital filter design workflow. Start by specifying the passband, stopband, and required performance. Choose FIR if linear phase (pulse shape preservation) is needed; choose IIR if sharper cutoff with fewer coefficients is the priority. Always verify the implemented filter against a known signal before using it on measurement data.

### 13.1 Why Digital Filters?

Digital filters operate on sampled data in software or firmware. Advantages over analog: perfectly repeatable, easily modified by changing coefficients, no component drift, can implement filter shapes that are impractical in analog (e.g., linear phase, very high order).

### 13.2 FIR Filters (Finite Impulse Response)

A FIR filter computes the output as a weighted sum of the current and past  $M$  input samples:

$$y[n] = \sum_{k=0}^M b_k \cdot x[n - k] \quad (13.1)$$

**Moving average** is the simplest FIR filter: all  $b_k = 1/(M + 1)$ . It smooths noise but smears transients. A moving average of  $N$  points reduces random noise by  $\sqrt{N}$ .

FIR filters can be designed with **exactly linear phase** (symmetric coefficients), which preserves signal shape. They are always stable.



### 13.3 IIR Filters (Infinite Impulse Response)

An IIR filter uses feedback (past output values):

$$y[n] = \sum_{k=0}^M b_k \cdot x[n-k] - \sum_{k=1}^N a_k \cdot y[n-k] \quad (13.2)$$

IIR filters achieve sharper roll-off with fewer coefficients than FIR, but they have nonlinear phase and can be unstable if poorly designed. Digital implementations of Butterworth, Chebyshev, and Bessel filters are IIR.

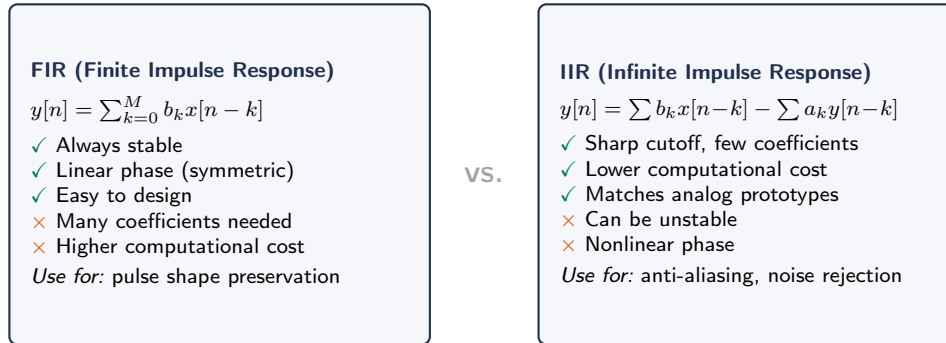


Figure 13.2: FIR vs. IIR digital filters. Choose FIR when signal shape must be preserved (linear phase). Choose IIR when sharp frequency selectivity is needed with low computational overhead.

#### FIR vs. IIR Decision

Use FIR when: linear phase is required (preserving pulse shape), stability is critical, or the filter order is manageable (<100 taps). Use IIR when: sharp cutoff is needed with minimal computation, phase distortion is acceptable, or you are implementing a digital equivalent of a known analog filter.

### 13.4 Practical Digital Filtering in LabVIEW

LabVIEW provides the **Filter Express VI** (interactive design) and the **IIR/FIR Filter Design** toolkit (programmatic). Specify: filter type (LP/HP/BP/BS), response (Butterworth/Chebyshev/Bessel), order, and cutoff frequency. The VI outputs filtered data; apply it to your DAQ signal chain.

### 13.5 Advantages of Digital Filters

Exact coefficients (no component tolerances), easy parameter changes in software, can implement impractical analog types (perfect linear phase, adaptive), no drift, can process stored data offline. Limitation: cannot undo aliasing.

### 13.6 Moving Average Filter

$y[n] = (1/M) \sum_{k=0}^{M-1} x[n-k]$ . FIR with all coefficients =  $1/M$ . Bandwidth  $\approx 0.44f_s/M$ . Nulls at  $f_s/M$  and multiples. Excellent for smoothing slowly varying signals. Poor frequency selectivity. In



LabVIEW: shift register + Mean function, or Filter Express VI with Smoothing.

## 13.7 FIR Filter Design

Design by windowing: specify ideal response, compute inverse DFT (sinc for LP), truncate to  $M$  points, multiply by window (Hamming, Blackman, Kaiser). Window choice determines transition width vs. stopband attenuation tradeoff.

Order  $M$  determines sharpness. Estimate:  $M \approx 3.3/(\Delta f/f_s)$  for Hamming window. Group delay:  $M/2$  samples. A symmetric FIR has exactly linear phase, preserving transient shapes.

## 13.8 IIR Filter Design

$y[n] = \sum b_k x[n - k] - \sum a_k y[n - k]$ . Feedback gives efficiency: a 4th-order Butterworth needs only 9 coefficients (vs. 100+ FIR taps). Design: analog prototype  $\rightarrow$  bilinear transform  $\rightarrow$  digital coefficients. Implement as cascaded biquad sections for numerical stability.

### Fixed-Point Stability

On MCUs without FPU, IIR coefficients quantized to 16-bit integers can cause instability for  $Q > 10$  or cutoff  $< f_s/100$ . Always simulate with actual precision before deploying.

## 13.9 Selection Guide

Smooth noisy DC data  $\rightarrow$  moving average. Sharp cutoff  $\rightarrow$  IIR Butterworth/Chebyshev. Preserve pulse shape  $\rightarrow$  FIR linear phase or IIR Bessel. Remove single frequency  $\rightarrow$  IIR notch. Adaptive  $\rightarrow$  FIR LMS (advanced).

## 13.10 Implementation in LabVIEW

LabVIEW provides several digital filter options. The **Filter Express VI** offers one-click configuration: select filter type (LP, HP, BP, BS), response (Butterworth, Chebyshev, Bessel, Elliptic), order, and cutoff frequency. It processes the entire waveform in one call.

For real-time filtering (one sample at a time in a control loop), use the **IIR Filter with Initialize** or implement the filter manually using shift registers. The manual approach provides explicit control over filter state initialization, anti-windup interaction, and coefficient precision.

### 13.10.1 Filter Testing Methodology

Test your digital filter with known inputs: (1) Apply a step function (constant array) to verify DC gain and settling behavior. (2) Apply a sine wave at the cutoff frequency to verify the  $-3$  dB attenuation. (3) Apply a sine wave at  $10\times$  cutoff to verify stopband rejection. (4) Apply white noise and verify the output spectrum shows the expected rolloff.

## 13.11 Decimation and Interpolation Filters

When reducing sample rate (decimation), a digital LP filter at the new Nyquist frequency must precede the sample-rate reduction to prevent aliasing. This “decimation filter” is typically imple-

mented as an FIR filter. For efficient multistage decimation (e.g., 100:1), cascade several smaller decimation stages (e.g., 10:1  $\rightarrow$  10:1), each with its own anti-alias filter. This requires fewer total filter taps than a single-stage approach.

## 13.12 Adaptive Filters (Overview)

Adaptive filters automatically adjust their coefficients to minimize an error signal. The Least Mean Squares (LMS) algorithm is the simplest:  $w[n+1] = w[n] + \mu \cdot e[n] \cdot x[n]$ , where  $\mu$  is the step size. Applications: noise cancellation (use a reference noise signal to adaptively subtract noise from the measurement), echo cancellation, and system identification. While beyond the scope of MEGN 300 labs, understanding that such filters exist prepares you for graduate-level signal processing.

## 13.13 Detailed FIR Design Example

Design a 50-tap FIR low-pass filter with cutoff at 100 Hz for data sampled at 1 kS/s.

**Step 1:** normalized cutoff  $f_c/f_N = 100/500 = 0.2$  (where  $f_N = f_s/2$ ).

**Step 2:** the ideal LP impulse response is a sinc function:  $h[n] = \sin(2\pi \times 0.2 \times (n - 25)) / (\pi(n - 25))$  for  $n = 0, \dots, 49$  (centered at  $n = 25$  for a 50-tap filter).

**Step 3:** apply a Hamming window:  $w[n] = 0.54 - 0.46 \cos(2\pi n/49)$ . The windowed coefficients are  $b[n] = h[n] \times w[n]$ .

**Step 4:** normalize so the DC gain is unity: divide all  $b[n]$  by their sum.

The resulting filter has a  $-3$  dB cutoff at approximately 100 Hz, transition bandwidth of  $\sim 40$  Hz (80–120 Hz), and stopband rejection of  $\sim -53$  dB (Hamming window property). The group delay is exactly 25 samples (2.5 ms at 1 kS/s).

In LabVIEW, this entire design is accomplished by the “FIR Windowed Coefficients” VI: specify the sampling rate, cutoff frequency, number of taps, and window type. The VI outputs the coefficient array, which you wire to the “FIR Filter” VI.

## 13.14 IIR Biquad Implementation

The biquad (second-order section) is the building block of IIR filter implementation:

$$H(z) = \frac{b_0 + b_1 z^{-1} + b_2 z^{-2}}{1 + a_1 z^{-1} + a_2 z^{-2}} \quad (13.3)$$

The difference equation:

$$y[n] = b_0 x[n] + b_1 x[n-1] + b_2 x[n-2] - a_1 y[n-1] - a_2 y[n-2] \quad (13.4)$$

Implementation in LabVIEW or C requires two memory locations (shift registers or variables) for past inputs ( $x[n-1]$ ,  $x[n-2]$ ) and two for past outputs ( $y[n-1]$ ,  $y[n-2]$ ). A 4th-order filter uses two cascaded biquads, each with its own set of 5 coefficients ( $b_0, b_1, b_2, a_1, a_2$ ). The biquad cascade is numerically more stable than a single high-order section because each biquad’s coefficients are close to 1.0, minimizing quantization sensitivity.

### 13.14.1 Direct Form II Transposed

For floating-point implementation, the Direct Form II Transposed structure provides the best numerical properties. Instead of separate input and output delay lines, it uses a single state vector:

$$\begin{aligned} y[n] &= b_0 x[n] + s_1 \\ s_1 &= b_1 x[n] - a_1 y[n] + s_2 \\ s_2 &= b_2 x[n] - a_2 y[n] \end{aligned}$$

This requires only two state variables per biquad section, minimizing memory and maximizing numerical precision.

## 13.15 Real-Time Filtering in Control Loops

When a digital filter is used inside a control loop (e.g., filtering the sensor signal before feeding it to the PID controller), the filter introduces delay that affects control stability.

**FIR delay:** an  $M$ -tap FIR introduces exactly  $M/2$  samples of group delay. For  $M = 50$  at 1 kS/s: 25 ms delay. At the controller's crossover frequency, this delay contributes phase lag:  $\phi = 360 \times f \times 0.025$  degrees. At  $f = 10$  Hz:  $\phi = 90^\circ$ , which is likely to destabilize the loop.

**IIR delay:** varies with frequency. A 2nd-order Butterworth at  $f_c = 100$  Hz introduces approximately 3 ms of group delay at 10 Hz (much less than the equivalent FIR). This is why IIR filters are preferred in control applications where phase delay matters.

**Design rule:** the filter's group delay at the controller's crossover frequency should contribute less than  $20^\circ$  of phase lag. For a 10 Hz crossover: max delay =  $20/(360 \times 10) = 5.6$  ms. A 2nd-order IIR at  $f_c = 50$  Hz easily meets this; a 50-tap FIR at 1 kS/s does not.

## 13.16 Notch Filter Design

A notch (band-reject) filter removes a single frequency. The second-order IIR notch:

$$H(z) = \frac{1 - 2 \cos(\omega_0 T_s) z^{-1} + z^{-2}}{1 - 2r \cos(\omega_0 T_s) z^{-1} + r^2 z^{-2}} \quad (13.5)$$

where  $\omega_0 = 2\pi f_{\text{notch}}$  and  $r$  controls the notch width (typical:  $r = 0.95$ – $0.99$ ; closer to 1 = narrower notch). For 60 Hz rejection at  $f_s = 1000$  S/s:  $\omega_0 T_s = 2\pi \times 60/1000 = 0.3770$  rad.

Cascading two notch filters (at 60 Hz and 120 Hz) removes the fundamental and first harmonic of mains interference. Three notches (60, 120, 180 Hz) handle most situations.

## 13.17 Comb Filters

A comb filter rejects a fundamental frequency and all its harmonics simultaneously:

$$H(z) = \frac{1 - z^{-D}}{1 - \alpha z^{-D}} \quad (13.6)$$

where  $D = f_s / f_{\text{fundamental}}$  (must be an integer) and  $\alpha$  controls the notch width. For rejecting 60 Hz and all harmonics at  $f_s = 600$  S/s:  $D = 10$ . The filter has nulls at 60, 120, 180,  $\dots$ , 300 Hz. This is more efficient than cascading individual notch filters. The tradeoff: it also removes any real signal content at these frequencies.

## 13.18 Comparison: LabVIEW Filter VIs

LabVIEW offers several filtering VIs, each suited to different applications:

**Filter Express VI:** one-click configuration (type, response, order, cutoff). Processes the entire waveform in one call. Best for: offline analysis of acquired data, quick prototyping.

**IIR Filter VI:** takes a waveform and returns a filtered waveform. Supports Butterworth, Chebyshev, Bessel, and Elliptic responses. Offers “reverse filtering” option that applies the filter forward and backward, canceling phase distortion (zero-phase filtering, only for offline data).

**FIR Windowed Filter VI:** generates and applies an FIR filter. Specify taps, cutoff, window type. Best for: linear-phase requirements, real-time filtering with known group delay.

**Median Filter VI:** replaces each sample with the median of the surrounding  $N$  samples. Excellent for removing spike noise (salt-and-pepper noise) while preserving edges. Not a frequency-domain filter; useful for preprocessing before FFT or control.

**Savitzky-Golay Filter:** fits a local polynomial to each data neighborhood. Smooths noise while preserving peak shapes and widths. Widely used in chromatography and spectroscopy. Available in LabVIEW’s Signal Processing palette.

## 13.19 Filter Transient Behavior

Every digital filter has a startup transient: the output is invalid for the first  $M$  samples (where  $M$  is the filter order for IIR or the number of taps for FIR). During this time, the filter’s internal state is filling with data. Discard (or ignore) the first  $M$  output samples. In a control loop, initialize the filter states with the first measured value (not zero) to minimize the startup transient.

For IIR filters, the transient decays exponentially with a time constant related to the pole locations. A narrow-band IIR filter (low cutoff relative to  $f_s$ , or high  $Q$ ) has a long transient that can persist for hundreds of samples. Plan your acquisition duration to include the transient plus the required steady-state data.

## 13.20 Zero-Phase Filtering

Conventional (causal) digital filters introduce phase distortion: different frequencies experience different delays. For time-domain analysis (peak detection, rise time measurement, waveform comparison), this phase distortion can be problematic. **Zero-phase filtering** eliminates phase distortion by applying the filter twice: once forward and once backward (time-reversed). The magnitude response is squared (doubled in dB), but the phase distortion cancels exactly.

In LabVIEW, enable “Reverse Filtering” in the IIR Filter VI options. In MATLAB: `filtfilt(b,a,x)`. Important: zero-phase filtering is only possible for offline data (you need the entire signal before filtering). It cannot be used in real-time control because the backward pass requires future samples.

## 13.21 Implementing Filters on Microcontrollers

For embedded systems (ESP32, Arduino, STM32) without floating-point units, digital filters must be implemented in fixed-point arithmetic. Key considerations:

**Coefficient quantization:** round filter coefficients to the available precision (typically 16 or 32 bits). Simulate the quantized filter and verify that the frequency response still meets specifications and that no instability occurs.

**Overflow protection:** intermediate calculations can exceed the word size. Use 32-bit accumulators for 16-bit data, or saturating arithmetic that clips at the maximum value instead of wrapping around.

**Execution time:** each filter tap requires one multiply-accumulate (MAC) operation. A 50-tap FIR at 10 kS/s requires 500,000 MACs/s. An ARM Cortex-M4 at 168 MHz executes  $\sim 168$  million MACs/s (with DSP instructions), leaving ample headroom. An 8-bit AVR at 16 MHz can manage  $\sim 4$  million MACs/s, limiting filter complexity.

**Circular buffer:** the shift register for past samples is efficiently implemented as a circular buffer (ring buffer): a fixed-size array with a pointer that wraps around, avoiding the need to physically shift data.

## 13.22 Practical Filter Selection Flowchart

- (1) Is the signal DC or slowly varying ( $f < 1$  Hz)?  $\rightarrow$  Moving average ( $M = 10\text{--}100$ ).
- (2) Do you need sharp frequency cutoff?  $\rightarrow$  IIR Butterworth (default) or Chebyshev (maximum sharpness).
- (3) Is pulse shape or rise time critical?  $\rightarrow$  FIR with linear phase.
- (4) Do you need to remove 60 Hz without affecting other frequencies?  $\rightarrow$  IIR notch at 60 Hz ( $r = 0.97$ ).
- (5) Do you need to remove 60 Hz and all harmonics?  $\rightarrow$  Comb filter ( $D = f_s/60$ ).
- (6) Is the noise source unknown or changing?  $\rightarrow$  Adaptive FIR (LMS) with a reference noise signal.
- (7) Is the filter inside a feedback control loop?  $\rightarrow$  Low-order IIR (2nd order max) to minimize phase lag.

## 13.23 Windowed FIR Design: Detailed Procedure

The windowed FIR design method is the most intuitive and widely used approach:

**Step 1: Specify the ideal frequency response.** For a low-pass filter with cutoff  $f_c$  (normalized to  $f_N = f_s/2$ ):  $H_d(f) = 1$  for  $|f| \leq f_c$ ,  $H_d(f) = 0$  for  $|f| > f_c$ .

**Step 2: Compute the ideal impulse response.** The inverse Fourier transform of the ideal rectangular frequency response is a sinc function:  $h_d[n] = \sin(2\pi f_c(n - M/2))/(\pi(n - M/2))$  for  $n = 0, 1, \dots, M$ , where  $M$  is the filter order (number of taps minus 1). At  $n = M/2$ :  $h_d[M/2] = 2f_c$  (by L'Hôpital's rule).

**Step 3: Apply the window.** Multiply the truncated impulse response by a window function:  $h[n] = h_d[n] \cdot w[n]$ . The window tapers the coefficients to zero at the ends, which suppresses the sidelobes in the frequency response (at the cost of widening the transition band).

**Step 4: Normalize.** Divide all coefficients by their sum to ensure unity DC gain:  $h_{\text{norm}}[n] = h[n] / \sum_k h[k]$ .

### 13.23.1 Window Function Selection

The Kaiser window is the most versatile: the parameter  $\beta$  adjusts the sidelobe-to-mainlobe tradeoff continuously. For a target stopband attenuation  $A_s$  (dB):  $\beta = 0.1102(A_s - 8.7)$  for  $A_s > 50$  dB. The required order:  $M = (A_s - 8)/(2.285 \times \Delta\omega)$  where  $\Delta\omega = 2\pi\Delta f/f_s$  is the normalized transition width.

| Window                 | Characteristics                       | Min. stopband (dB) | Trans. BW ( $\times f_s/M$ ) |
|------------------------|---------------------------------------|--------------------|------------------------------|
| Rectangular            | Narrowest main lobe, worst side-lobes | -21                | 0.9                          |
| Hamming                | Good all-around choice                | -53                | 3.3                          |
| Hanning                | Slightly wider, better sidelobes      | -44                | 3.1                          |
| Blackman               | Excellent sidelobes, wide transition  | -74                | 5.5                          |
| Kaiser ( $\beta = 8$ ) | Adjustable tradeoff via $\beta$       | -80                | 5.0                          |

Table 13.1: FIR window function comparison. Transition bandwidth determines the minimum filter order needed for a given sharpness.

## 13.24 Equiripple (Parks-McClellan) FIR Design

For demanding applications, the Parks-McClellan algorithm designs an FIR filter that minimizes the maximum error between the desired and actual frequency response (minimax criterion). This produces an equiripple response: the error oscillates with equal amplitude across both the passband and stopband.

Advantages over windowed design: for a given filter order, the equiripple design achieves either narrower transition band or greater stopband rejection. The improvement is significant for high-order filters ( $M > 50$ ).

In MATLAB: `b = firpm(M, [0 fp fs 1], [1 1 0 0])` where `fp` is the passband edge and `fs` is the stopband edge (both normalized to Nyquist). In LabVIEW: the “Equiripple FIR” VI in the Signal Processing palette.

### ★ Advanced Topic:

**Multirate Filter Structures and Adaptive Filtering** The following sections on multirate filters, adaptive LMS filtering, and Hilbert transform filters are advanced topics included for completeness. They are not required for MEGN 300 exams or lab reports.

## 13.25 Multirate Filter Structures

### 13.25.1 Polyphase Decomposition

For efficient decimation, the FIR filter can be decomposed into  $M$  polyphase subfilters, each operating at the lower output rate. This reduces computation by exactly  $M\times$  compared to filtering at the input rate and then discarding samples. The polyphase structure is the standard implementation in commercial DAQ systems and audio equipment.

### 13.25.2 Cascaded Integrator-Comb (CIC) Filter

A computationally efficient decimation filter that requires no multiplications (only additions and subtractions). The CIC consists of  $N$  integrator stages followed by  $N$  comb (differentiator) stages with a rate change between them. The frequency response has a  $\text{sinc}^N$  shape, providing good rejection of aliased components near multiples of the output rate. CIC filters are the first stage of decimation in sigma-delta ADCs, reducing the sample rate by factors of 32–256 before a more precise FIR filter handles the final shaping.

## 13.26 Adaptive Filtering: The LMS Algorithm

The Least Mean Squares (LMS) adaptive filter automatically adjusts its coefficients to minimize the error between its output and a desired signal. The update rule:

$$\mathbf{w}[n+1] = \mathbf{w}[n] + \mu \cdot e[n] \cdot \mathbf{x}[n] \quad (13.7)$$

where  $\mathbf{w}$  is the coefficient vector,  $\mu$  is the step size (learning rate),  $e[n] = d[n] - y[n]$  is the error, and  $\mathbf{x}$  is the input vector.

The most common application: **noise cancellation**. A reference microphone captures the ambient noise. The adaptive filter models the acoustic path from the noise source to the primary microphone. The filter's output is subtracted from the primary signal, canceling the noise while preserving the desired signal. This is the technology behind noise-canceling headphones.

In instrumentation, adaptive filtering can cancel vibration interference, remove 60 Hz hum using a reference from the power line, or compensate for time-varying sensor characteristics.

## 13.27 Real-Time Filter Implementation Checklist

Before deploying a digital filter in a control or monitoring system, verify:

(1) **Coefficient precision**: simulate the filter with the actual numerical precision of the target platform (32-bit float, 64-bit double, or 16-bit fixed). Compare the frequency response to the ideal design. If the response deviates: use biquad cascade (not direct form), increase precision, or redesign with less aggressive specifications.

(2) **Initialization**: set the filter state (shift register values) to the first sample value, not zero. Initializing to zero causes a startup transient as the filter “fills” with data. Initializing to the first sample assumes the signal was at this value for all past time, which produces a much smaller transient.

(3) **Overflow**: for fixed-point, verify that intermediate accumulator values do not exceed the word size. Use saturation arithmetic (clip at max/min) rather than wraparound arithmetic (which produces catastrophic sign flips).

(4) **Latency**: measure the actual output delay from input change to output response. For FIR: exactly  $M/2$  samples. For IIR: frequency-dependent (measure at the frequency of interest).

(5) **Computational load**: measure the execution time of the filter operation. Verify it completes within the sample period ( $T_s = 1/f_s$ ). If not: reduce the filter order, increase the sample period, or use a faster processor.

## 13.28 Filter Banks

A **filter bank** splits a signal into multiple frequency bands, each processed independently. The octave filter bank (used in acoustic measurement and vibration analysis) divides the spectrum into bands whose bandwidth is proportional to center frequency: 1 Hz band at 1 Hz, 10 Hz band at 10 Hz, 100 Hz band at 100 Hz, etc. This matches human perception (which is logarithmic in frequency) and the characteristics of many physical processes.

In MEGN 300, filter banks are encountered in the context of 1/3-octave analysis for noise measurement (ANSI S1.11) and vibration severity assessment (ISO 10816). LabVIEW's Sound and Vibration Toolkit includes octave analysis VIs.



## 13.29 Hilbert Transform Filter

A Hilbert transform filter produces a 90-degree phase shift at all frequencies, converting a cosine to a sine (and vice versa) without changing the amplitude. Combined with the original signal, it produces the **analytic signal**, whose magnitude is the instantaneous envelope and whose phase derivative is the instantaneous frequency.

FIR implementation: the ideal Hilbert transform impulse response is  $h[n] = 2 \sin^2(\pi n/2)/(\pi n)$  for  $n \neq 0$ ,  $h[0] = 0$ . Truncate and window (like any FIR design). Typical order: 31–63 taps.

Application in instrumentation: envelope detection for bearing fault diagnosis, demodulation of AM signals, and instantaneous frequency tracking for speed-varying machinery.

## 13.30 Practice Questions

1. Design a 10-point moving average filter for a signal sampled at 1 kS/s. What is the effective cutoff frequency? By how much does it reduce random noise?
2. Explain why a moving average filter is poor at removing a specific frequency (like 60 Hz) compared to a notch filter.
3. You need a digital low-pass filter with a cutoff of 100 Hz, linear phase, and a sampling rate of 10 kS/s. Would you choose FIR or IIR? Why?

### 13.30.1 Answers

1. A 10-point moving average has its first null at  $f_s/N = 1000/10 = 100$  Hz. The  $-3$  dB frequency is approximately  $0.443 \times f_s/N = 44.3$  Hz. Noise reduction:  $\sqrt{10} = 3.16 \times$  (10 dB).
2. A moving average has a  $\sin(x)/x$  frequency response with broad, shallow notches at multiples of  $f_s/N$ . Unless  $f_s/N$  happens to equal exactly 60 Hz, the 60 Hz component is only partially attenuated. A notch filter, by contrast, has a very narrow, deep rejection specifically at 60 Hz (and its harmonics if designed correctly).
3. FIR. The linear-phase requirement rules out IIR filters, which inherently have nonlinear phase. A FIR filter with symmetric coefficients provides exactly linear phase. At  $f_s = 10$  kS/s with  $f_c = 100$  Hz, the filter will need many taps (perhaps 200–500 for a sharp cutoff), but this is computationally feasible in LabVIEW on a modern PC.



## Part III

### Electronics for Instrumentation

# Chapter 14

## Circuit Fundamentals

### When to Read This Chapter

**Module 7 (Weeks 11–12):** Read before the signal conditioning lab. Sections on Ohm's Law, voltage dividers, Thevenin equivalents, and impedance are prerequisites for the amplifier chapter. The wire gauge and SI prefix tables are useful references all semester. **Related:** Amplifiers in Chapter 15 (p. 155); high-power switching in Chapter 16 (p. 167).

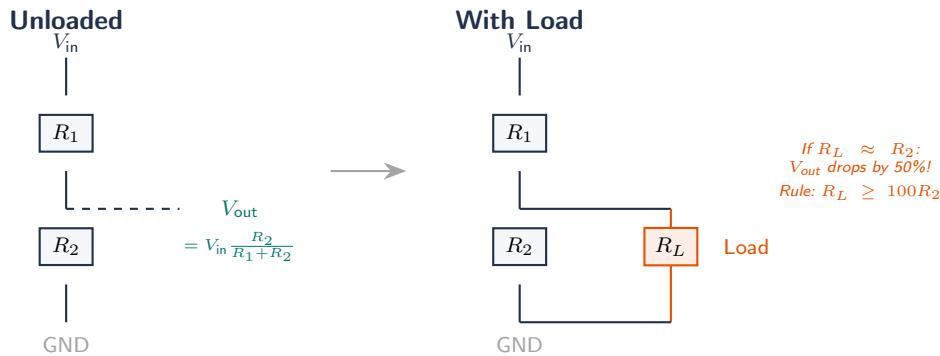


Figure 14.1: Voltage divider loading error. An unloaded divider (left) produces the expected  $V_{out}$ . Connecting a load  $R_L$  comparable to  $R_2$  (right) changes the output because  $R_2 \parallel R_L < R_2$ . The 100:1 impedance rule ensures loading error stays below 1%.

### Industry Insight:

**Breadboards Are for Prototyping, Not for Production** The single most expensive mistake in student instrumentation projects is building the final circuit on a solderless breadboard. Breadboards introduce parasitic capacitance (2–25 pF per row), intermittent contact resistance (up to 5  $\Omega$ ), and are mechanically unreliable under vibration. In DOE vehicle programs, teams that prototype on breadboards but deploy on soldered protoboards or custom PCBs consistently produce more reliable systems. When your circuit works on the breadboard, transfer it to a soldered board before the final demonstration.

This chapter reviews the core electrical concepts that underpin every topic in Parts III and IV. If you are comfortable with Ohm's Law, Kirchhoff's Laws, and basic RC/RL transients, this chapter serves as a concise reference. If these ideas are new or rusty, work through the examples before moving on to amplifiers and power electronics.

## 14.1 Voltage, Current, Resistance, and Power

**Voltage** ( $V$ , measured in volts) is the electrical potential difference between two points. It is the “pressure” that pushes charge through a circuit. **Current** ( $I$ , measured in amperes) is the rate of charge flow:  $I = dQ/dt$ . Conventional current flows from higher to lower potential (positive to negative); electron flow is opposite. **Resistance** ( $R$ , measured in ohms,  $\Omega$ ) quantifies how strongly a material opposes current flow. **Power** ( $P$ , measured in watts) is the rate of energy transfer:  $P = VI$ . In a resistor,  $P = I^2R = V^2/R$ .

### Ohm’s Law

The voltage across a resistor is proportional to the current through it:

$$V = IR \quad \Leftrightarrow \quad I = \frac{V}{R} \quad \Leftrightarrow \quad R = \frac{V}{I} \quad (14.1)$$

This is the single most-used equation in electronics. It applies to any purely resistive element: resistors, wire, heating elements, and the on-resistance of a MOSFET switch.

**Conductance** ( $G = 1/R$ , measured in siemens, S) is the reciprocal of resistance. It is convenient when combining parallel resistances:  $G_{\text{total}} = G_1 + G_2 + \dots$ .

**Energy** ( $E$ , measured in joules) is power integrated over time:  $E = P \cdot t$ . A 100 W heater running for 60 s dissipates  $100 \times 60 = 6000$  J. Battery capacity is often stated in watt-hours (Wh) or milliamp-hours (mAh): a 2000 mAh battery at 3.7 V stores  $2.0 \times 3.7 = 7.4$  Wh = 26,640 J.

## 14.2 Kirchhoff’s Laws

Gustav Kirchhoff formulated two conservation laws that, together with Ohm’s Law, allow you to solve any circuit.

### 14.2.1 Kirchhoff’s Current Law (KCL)

The algebraic sum of currents entering a node is zero:

$$\sum I_{\text{in}} = \sum I_{\text{out}} \quad (14.2)$$

Current is conserved. Whatever flows into a junction must flow out. If three wires meet at a node carrying 2 A, 3 A, and  $I_3$ , then  $I_3 = -(2 + 3) = -5$  A (5 A flowing out).

### 14.2.2 Kirchhoff’s Voltage Law (KVL)

The algebraic sum of voltages around any closed loop is zero:

$$\sum V_{\text{loop}} = 0 \quad (14.3)$$

Energy is conserved. The voltage rises (sources) must equal the voltage drops (resistors, loads) around any closed path.

**WE KVL Applied: Series Resistor Circuit**

A 12 V supply drives two series resistors:  $R_1 = 4\text{ k}\Omega$  and  $R_2 = 8\text{ k}\Omega$ . Apply KVL:  $V_s - V_{R1} - V_{R2} = 0$ . The current is  $I = V_s/(R_1 + R_2) = 12/12,000 = 1\text{ mA}$ . Then  $V_{R1} = 1\text{ mA} \times 4\text{ k}\Omega = 4\text{ V}$  and  $V_{R2} = 8\text{ V}$ . Check:  $12 - 4 - 8 = 0$ . KVL is satisfied.

## 14.3 Series and Parallel Circuits

### 14.3.1 Series Combination

Components in series carry the same current. Resistances add directly:

$$R_{\text{series}} = R_1 + R_2 + \cdots + R_n \quad (14.4)$$

The total resistance is always larger than any individual resistor. Voltage divides among the resistors in proportion to their resistance.

### 14.3.2 Parallel Combination

Components in parallel share the same voltage across their terminals. Conductances add (equivalently, reciprocals of resistance add):

$$\frac{1}{R_{\text{parallel}}} = \frac{1}{R_1} + \frac{1}{R_2} + \cdots + \frac{1}{R_n} \quad (14.5)$$

For two resistors:  $R_{\text{parallel}} = R_1 R_2 / (R_1 + R_2)$ . The total resistance is always less than the smallest individual resistor.

**Quick Parallel Calculation**

Two equal resistors in parallel give half the resistance:  $R_{\text{parallel}} = R/2$ . A  $10\text{ k}\Omega$  resistor in parallel with a  $1\text{ k}\Omega$  resistor gives  $10 \times 1 / (10 + 1) = 909\Omega$ , which is close to the smaller resistor alone. In parallel combinations, the smallest resistor dominates.

## 14.4 Voltage Dividers

The voltage divider is the most common subcircuit in instrumentation. Two series resistors connected across a source produce an output voltage at their junction:

$$V_{\text{out}} = V_{\text{in}} \cdot \frac{R_2}{R_1 + R_2} \quad (14.6)$$

**Applications in MEGN 300:** scaling a sensor output to match the ADC input range (0–3.3 V for the ESP32), creating a reference voltage, and biasing op-amp circuits.

**Loading a Voltage Divider**

A voltage divider only produces the calculated voltage if the load draws negligible current compared to the divider current. Rule of thumb: the load resistance should be at least  $10\times$  the divider output resistance ( $R_1 \parallel R_2$ ). If not, the load acts as a parallel resistor on  $R_2$  and pulls the output voltage down. Use a voltage follower (op-amp buffer) to isolate a high-impedance

divider from a low-impedance load.

#### WE ThermoRig: 12 V Sensor to 3.3 V ADC

A pressure sensor outputs 0–10 V. The ESP32 ADC accepts 0–3.3 V. Design:  $V_{\text{out}} = V_{\text{in}} \times R_2/(R_1 + R_2)$ . Target ratio:  $3.3/10 = 0.33$ . Choose  $R_1 = 20 \text{ k}\Omega$ ,  $R_2 = 10 \text{ k}\Omega$ : output =  $10 \times 10/30 = 3.33 \text{ V}$ . Divider current:  $10/30,000 = 0.33 \text{ mA}$  (low, does not load the sensor). Add a 100 nF capacitor across  $R_2$  to filter high-frequency noise.

## 14.5 Thevenin and Norton Equivalent Circuits

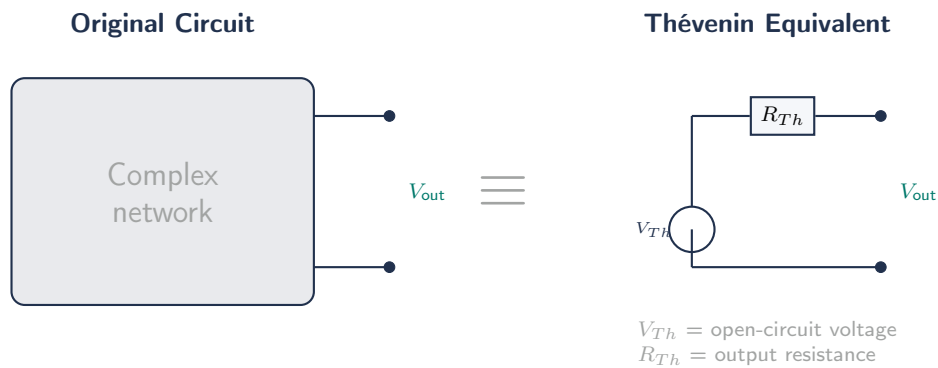


Figure 14.2: Thévenin equivalent: any linear circuit seen from two output terminals can be replaced by a single voltage source  $V_{Th}$  in series with a single resistance  $R_{Th}$ . This simplification is essential for analyzing loading effects when connecting a sensor circuit to an ADC or amplifier.

Any linear circuit, no matter how complex, can be reduced to a single voltage source in series with a single resistance (Thevenin) or a single current source in parallel with a single resistance (Norton).

**Thevenin equivalent:**  $V_{Th}$  = open-circuit voltage at the output terminals;  $R_{Th}$  = resistance seen from the output terminals with all independent sources set to zero (voltage sources shorted, current sources opened).

**Norton equivalent:**  $I_N = V_{Th}/R_{Th}$ ;  $R_N = R_{Th}$ .

**Why this matters for instrumentation:** every sensor has an output impedance ( $R_{Th}$ ). If you connect a low-impedance load (like a multimeter on the current range, or an ADC with a low input impedance), the output voltage drops from  $V_{Th}$  because of the voltage drop across  $R_{Th}$ . This is the root cause of loading errors in measurement systems.

## 14.6 Capacitors and Inductors

### 14.6.1 Capacitors

A capacitor stores energy in an electric field between two conductive plates separated by a dielectric:

$$Q = CV, \quad I = C \frac{dV}{dt}, \quad E = \frac{1}{2} CV^2 \quad (14.7)$$

Capacitance  $C$  is measured in farads (F). Practical values: pF (high-frequency coupling), nF (decoupling, filtering),  $\mu\text{F}$  (bulk energy storage, timing). A capacitor opposes changes in voltage; it passes AC and blocks DC. Impedance:  $Z_C = 1/(2\pi fC)$ , which decreases with frequency.

**Types used in MEGN 300:** ceramic (100 pF–10  $\mu\text{F}$ , low ESR, ideal for decoupling), electrolytic (1  $\mu\text{F}$ –10,000  $\mu\text{F}$ , polarized, bulk energy storage), and tantalum (0.1–100  $\mu\text{F}$ , low ESR, compact but voltage-sensitive).

### 14.6.2 Inductors

An inductor stores energy in a magnetic field generated by current flowing through a coil:

$$V = L \frac{dI}{dt}, \quad E = \frac{1}{2} LI^2 \quad (14.8)$$

Inductance  $L$  is measured in henrys (H). An inductor opposes changes in current; it passes DC and blocks AC. Impedance:  $Z_L = 2\pi fL$ , which increases with frequency. Motor windings, solenoid coils, and relay coils are all inductors. This is why they produce voltage spikes when switched (Chapter 14).

## 14.7 RC and RL Time Constants

### 14.7.1 RC Circuit

A resistor and capacitor in series produce an exponential charging or discharging response. The time constant is:

$$\tau = RC \quad (14.9)$$

After one time constant, the capacitor charges to 63.2% of the final value. After  $5\tau$ , it reaches 99.3% (practically complete). The step response is:

$$V_C(t) = V_{\text{final}} \left(1 - e^{-t/\tau}\right) \quad (\text{charging}), \quad V_C(t) = V_{\text{initial}} \cdot e^{-t/\tau} \quad (\text{discharging}) \quad (14.10)$$

**Applications:** low-pass filtering ( $R$  in series,  $C$  to ground; cutoff  $f_c = 1/(2\pi RC)$ ), debouncing a mechanical switch ( $\tau \approx 10$  ms), and ADC input filtering to reduce noise.

#### WE Anti-Alias Filter for DAQ

You need a low-pass filter with  $f_c = 1$  kHz to prevent aliasing before a 10 kS/s ADC. Choose  $C = 10$  nF. Then

$$R = 1/(2\pi f_c C) = 1/(2\pi \times 1000 \times 10 \times 10^{-9}) = 15.9 \text{ k}\Omega$$

. Use a standard 16 k $\Omega$  resistor ( $f_c = 995$  Hz, close enough). This is a single-pole,  $-20$  dB/decade rolloff. For steeper attenuation, use higher-order filters (Chapter 11).

### 14.7.2 RL Circuit

A resistor and inductor in series produce an analogous exponential response with time constant:

$$\tau = L/R \quad (14.11)$$

Current rises as  $I(t) = I_{\text{final}}(1 - e^{-t/\tau})$  when voltage is applied, and decays as  $I(t) = I_{\text{initial}} \cdot e^{-t/\tau}$  when the source is removed. RL time constants are critical for understanding relay pull-in time (the coil current must reach the hold-in threshold) and flyback voltage spikes (the energy stored as  $\frac{1}{2}LI^2$  must dissipate when the switch opens).

## 14.8 AC Circuit Fundamentals

### 14.8.1 Impedance

In AC circuits, resistance generalizes to impedance ( $Z$ ), which has both magnitude and phase. For a resistor:  $Z_R = R$  (purely real, voltage and current in phase). For a capacitor:  $Z_C = 1/(j\omega C)$  (current leads voltage by  $90^\circ$ ). For an inductor:  $Z_L = j\omega L$  (current lags voltage by  $90^\circ$ ). Impedances combine like resistances: in series they add, in parallel the reciprocals add. Ohm's Law applies using impedance:  $V = IZ$ .

### 14.8.2 RMS Values

Alternating signals are characterized by their root-mean-square (RMS) value, which represents the equivalent DC value that delivers the same average power to a resistive load:

$$V_{\text{RMS}} = \frac{V_{\text{peak}}}{\sqrt{2}} \approx 0.707 \cdot V_{\text{peak}} \quad (\text{sinusoidal signals only}) \quad (14.12)$$

US household power:  $V_{\text{peak}} = 170 \text{ V}$ ,  $V_{\text{RMS}} = 120 \text{ V}$ . Power calculations always use RMS:  $P = V_{\text{RMS}}^2/R = I_{\text{RMS}}^2 R$ .

### 14.8.3 Decibels

Signal magnitudes in instrumentation are often expressed in decibels (dB), a logarithmic ratio:

$$\text{Gain (dB)} = 20 \log_{10} \left( \frac{V_{\text{out}}}{V_{\text{in}}} \right) = 10 \log_{10} \left( \frac{P_{\text{out}}}{P_{\text{in}}} \right) \quad (14.13)$$

A gain of  $+6 \text{ dB} \approx$  doubling the voltage. A gain of  $-3 \text{ dB} \approx$  voltage reduced to 0.707 (half-power point, used to define filter cutoff frequencies). A gain of  $-20 \text{ dB} =$  voltage reduced by a factor of 10. Decibels are additive through a signal chain: a  $+20 \text{ dB}$  amplifier followed by a  $-6 \text{ dB}$  attenuator gives  $+14 \text{ dB}$  overall.

## 14.9 Grounding and Ground Loops

**Ground** is the reference node (0 V) against which all voltages are measured. In theory, ground is a single point at 0 V everywhere. In practice, ground conductors have nonzero resistance and carry return currents, creating small voltage differences between “ground” points in different parts of the circuit.

A **ground loop** occurs when two or more ground connections create a closed loop that can pick up magnetically induced currents (from nearby motors, transformers, or switching supplies), generating noise on the signal ground. Ground loops are one of the most common sources of measurement noise in instrumentation labs.

### Star Grounding

Connect all subsystem grounds to a single point (the star point) near the power supply, rather than daisy-chaining ground connections from one module to the next. Keep signal ground (sensors, ADC) and power ground (motors, relays) on separate conductors that meet only at the star point. This prevents motor return currents from flowing through the sensor ground path and corrupting measurements.

## 14.10 Practical Component Selection

### 14.10.1 Resistor Color Code

Through-hole resistors use colored bands to encode their value. The standard 4-band code works as follows: the first two bands are significant digits, the third band is the multiplier (number of zeros), and the fourth band indicates tolerance. Read the bands starting from the end closest to one lead (the tolerance band is usually spaced slightly farther from the others).

| Color  | Digit | Multiplier          | Tolerance    |
|--------|-------|---------------------|--------------|
| Black  | 0     | $\times 1$          | —            |
| Brown  | 1     | $\times 10$         | $\pm 1\%$    |
| Red    | 2     | $\times 100$        | $\pm 2\%$    |
| Orange | 3     | $\times 1,000$      | —            |
| Yellow | 4     | $\times 10,000$     | —            |
| Green  | 5     | $\times 100,000$    | $\pm 0.5\%$  |
| Blue   | 6     | $\times 1,000,000$  | $\pm 0.25\%$ |
| Violet | 7     | $\times 10,000,000$ | $\pm 0.1\%$  |
| Gray   | 8     | —                   | $\pm 0.05\%$ |
| White  | 9     | —                   | —            |
| Gold   | —     | $\times 0.1$        | $\pm 5\%$    |
| Silver | —     | $\times 0.01$       | $\pm 10\%$   |

**5-band resistors** (precision, 1% or better) use three significant digits, a multiplier, and a tolerance band. The reading process is the same: first three bands are digits, fourth is multiplier, fifth is tolerance.

### WE Reading Resistor Color Codes

**4-band:** Brown–Black–Orange–Gold =  $10 \times 1,000 = 10 \text{ k}\Omega$ ,  $\pm 5\%$ . The range is  $9.5 \text{ k}\Omega$  to  $10.5 \text{ k}\Omega$ .

**4-band:** Red–Violet–Red–Gold =  $27 \times 100 = 2.7 \text{ k}\Omega$ ,  $\pm 5\%$ .

**5-band:** Brown–Red–Black–Brown–Brown =  $120 \times 10 = 1.2 \text{ k}\Omega$ ,  $\pm 1\%$ .

**Common mnemonic** (digit order 0–9): “Better Be Right Or Your Great Big Venture Goes Wrong” (Black, Brown, Red, Orange, Yellow, Green, Blue, Violet, Gray, White).

### SMD Resistor Markings

Surface-mount resistors use a numeric code instead of color bands. The 3-digit code (e.g., “103”) uses the first two digits as significant figures and the third as the number of zeros:



$103 = 10 \times 10^3 = 10 \text{ k}\Omega$ . The 4-digit code (e.g., “4702”) uses three significant digits:  $4702 = 470 \times 10^2 = 47 \text{ k}\Omega$ . “R” indicates a decimal point: “4R7” =  $4.7 \Omega$ . Very small SMD packages (0402 and below) often have no marking at all; keep them in labeled bags or tape reels to avoid confusion.

### 14.10.2 Resistor Tolerance and Standard Values

Resistors come in standard value series (E12, E24, E96) spaced logarithmically. The E12 series (10% tolerance) has 12 values per decade: 10, 12, 15, 18, 22, 27, 33, 39, 47, 56, 68, 82. The E24 series (5%) has 24 values. E96 (1%) has 96 values. When designing a voltage divider or filter, choose the nearest standard value and verify the circuit still meets specifications at the tolerance extremes.

### 14.10.3 Power Rating

Every resistor has a maximum power dissipation. Standard through-hole resistors:  $1/4 \text{ W}$ . Verify:  $P = I^2 R$  or  $P = V^2/R$  at worst-case operating conditions. If the dissipation exceeds the rating, the resistor overheats, changes value, and eventually fails (sometimes by catching fire).

### 14.10.4 Capacitor Voltage Rating

Every capacitor has a maximum working voltage. Exceeding it causes dielectric breakdown (shorts, explosion for electrolytics). Rule of thumb: derate by 50% for reliability (use a 25 V cap on a 12 V rail). Electrolytic capacitors are polarized; reversing polarity causes catastrophic failure.

### 14.10.5 Wire Gauge Reference (AWG)

American Wire Gauge (AWG) is the standard for specifying wire size. Smaller AWG numbers indicate thicker wire with higher current capacity. The following table covers the gauges most commonly used in MEGN 300 projects:

| AWG | Diameter (mm) | Max Current (A) | Typical Use                       |
|-----|---------------|-----------------|-----------------------------------|
| 30  | 0.25          | 0.5             | Wire-wrap, fine signal wiring     |
| 28  | 0.32          | 0.8             | Ribbon cable, breadboard jumpers  |
| 26  | 0.40          | 1.3             | Ribbon cable, light signal wiring |
| 24  | 0.51          | 2.1             | Standard signal and sensor wiring |
| 22  | 0.64          | 3.0             | General purpose hookup wire       |
| 20  | 0.81          | 5.0             | Power wiring, LED strips          |
| 18  | 1.02          | 7.5             | Motor power, moderate loads       |
| 16  | 1.29          | 10              | High-current motor, battery leads |
| 14  | 1.63          | 15              | High-power supply, automotive     |
| 12  | 2.05          | 20              | Household branch circuits (US)    |

Current ratings above are approximate for chassis wiring in open air (single conductor,  $30^\circ\text{C}$  ambient). Bundled wires in conduit or cable should be derated by 20–40%. When in doubt, go one gauge thicker.

**Stranded vs. Solid Wire**

Use **stranded wire** for any connection that moves, flexes, or is subject to vibration (motor leads, connections to moving parts, cables between enclosures). Solid wire work-hardens and breaks after repeated flexing. Use **solid wire** only for permanent, stationary connections (breadboard jumpers, point-to-point wiring on perfboard). Never use solid wire for connections to motors, servos, or any moving mechanism.

**14.10.6 SI Prefixes and Unit Conversions**

Instrumentation spans many orders of magnitude. Memorize these prefixes:

| Prefix | Symbol | Factor     | Common Usage                                            |
|--------|--------|------------|---------------------------------------------------------|
| pico   | p      | $10^{-12}$ | Capacitance (pF), charge                                |
| nano   | n      | $10^{-9}$  | Capacitance (nF), time (ns)                             |
| micro  | $\mu$  | $10^{-6}$  | Voltage ( $\mu$ V), current ( $\mu$ A), time ( $\mu$ s) |
| milli  | m      | $10^{-3}$  | Voltage (mV), current (mA), time (ms)                   |
| —      | —      | $10^0$     | Base unit (V, A, $\Omega$ , s, Hz)                      |
| kilo   | k      | $10^3$     | Resistance ( $k\Omega$ ), frequency (kHz)               |
| mega   | M      | $10^6$     | Resistance ( $M\Omega$ ), frequency (MHz)               |
| giga   | G      | $10^9$     | Frequency (GHz)                                         |

**Case Sensitivity in Unit Prefixes**

Lowercase “m” means milli ( $10^{-3}$ ). Uppercase “M” means mega ( $10^6$ ). Confusing them changes a value by a factor of one billion. A 4.7 m $\Omega$  resistor (milliohm, a current-sense shunt) is very different from a 4.7 M $\Omega$  resistor (megaohm, a high-impedance input bias resistor). Similarly, “mA” is milliamps and “MA” is megaamps. Always double-check the case when reading datasheets and specifications.

**14.10.7 Common Schematic Symbols**

Knowing how to read a schematic is a prerequisite for building, debugging, and documenting any circuit. The following symbols appear throughout this course and in component datasheets:

**Passive components:** resistor (zigzag or rectangle), capacitor (two parallel lines; polarized electrolytic adds a curved line for the negative plate), inductor (series of loops or bumps), fuse (thin line with a break or “S” shape).

**Semiconductors:** diode (triangle pointing into a bar; current flows in the triangle direction, from anode to cathode), LED (diode with arrows representing emitted light), Zener diode (diode with bent bar ends), NPN BJT (arrow on emitter pointing away from base), PNP BJT (arrow on emitter pointing toward base), N-channel MOSFET (arrow on body diode pointing inward, gate on left side), P-channel MOSFET (arrow pointing outward).

**Sources and references:** DC voltage source (circle with +/–), AC voltage source (circle with sine wave), ground symbol (three horizontal lines of decreasing length, or a triangle pointing down), chassis ground (three diagonal lines).

**Active components:** op-amp (triangle with + and – inputs and one output), comparator (same symbol as op-amp but context indicates comparison function).

### 14.10.8 Multimeter Usage Quick Reference

The digital multimeter (DMM) is the most-used instrument in MEGN 300. Correct usage prevents both measurement errors and equipment damage.

**Voltage measurement** (DC or AC): set the dial to V; connect probes in parallel across the component or nodes of interest. The DMM presents very high input impedance ( $>1\text{ M}\Omega$ ) and draws negligible current.

**Current measurement**: set the dial to A or mA; move the red probe to the current jack (usually a separate terminal). Connect the meter in series: break the circuit and insert the meter into the break so all current flows through it. The DMM presents very low impedance ( $<1\text{ }\Omega$ ) when measuring current.

**Resistance measurement**: set the dial to  $\Omega$ . Disconnect the component from the circuit (de-energize first!). Connect probes across the component. The DMM sends a small known current through the component and measures the resulting voltage to compute resistance.

**Continuity**: set to the continuity/beep mode (diode symbol or speaker icon). Touch probes to two points. The meter beeps if resistance is below a threshold (typically  $<50\text{ }\Omega$ ), indicating an electrical connection.

#### The Current-Mode Dead-Short Trap

If you leave the multimeter in current mode (low impedance, probes in the current jacks) and connect it in parallel across a voltage source, the meter becomes a near-short-circuit. This blows the meter's internal fuse (best case) or damages the meter and the circuit (worst case). After every current measurement, move the red probe back to the voltage jack and switch the dial to voltage mode. This is the single most common multimeter damage mode in the MEGN 300 lab.

### 14.10.9 Breadboard Layout and Conventions

Breadboards are used for rapid prototyping before committing to a soldered or PCB design. Internal connections run as follows: the two long rails along the top and bottom edges are bus strips (typically used for power and ground, marked with red/blue or  $+/-$  lines). The central rows of five-hole groups are connected horizontally within each group but not across the center channel. The center channel separates the two halves and is sized to straddle a DIP IC package.

**Best practices**: run power (+) on the red rail and ground on the blue rail, both on the same side of the board for short return paths. Place ICs straddling the center channel. Use short, flat jumper wires (color-coded: red for power, black for ground, other colors for signals). Keep wires close to the board surface to reduce noise pickup and make the circuit readable. Label every IC and major node with a small sticky note.

**Limitations**: breadboard contact resistance is  $0.01\text{--}0.1\text{ }\Omega$  per connection (adds up over long signal paths), stray capacitance is  $2\text{--}5\text{ pF}$  between adjacent rows (limits high-frequency performance to  $<1\text{ MHz}$ ), and connections loosen over time (intermittent failures). Never deploy a breadboard as a final product.

#### Requirements Mapping: Circuit Parameters to Shall Statements

Circuit analysis directly generates testable requirements. “The input stage voltage divider shall scale the  $0\text{--}10\text{ V}$  sensor output to  $0\text{--}3.3\text{ V}$  with an accuracy of  $\pm 2\%$ .” “The signal ground and power ground shall connect at a single star point within  $50\text{ mm}$  of the main power entry

connector.” “All resistors in the signal conditioning path shall be 1% tolerance (E96 series) or better.” “Bulk decoupling capacitors shall have a voltage rating at least  $1.5\times$  the rail voltage.”

## 14.11 Practice Questions

1. A circuit has a 9 V battery driving three resistors:  $R_1 = 1\text{ k}\Omega$  in series with the parallel combination of  $R_2 = 2\text{ k}\Omega$  and  $R_3 = 3\text{ k}\Omega$ . Find the total current from the battery and the voltage across each resistor.
2. An RC low-pass filter uses  $R = 10\text{ k}\Omega$  and  $C = 100\text{ nF}$ . What is the  $-3\text{ dB}$  cutoff frequency? How long does the capacitor take to reach 99% of a step input?
3. A Thevenin analysis of a sensor circuit yields  $V_{Th} = 2.5\text{ V}$  and  $R_{Th} = 5\text{ k}\Omega$ . You connect it to an ADC with  $1\text{ M}\Omega$  input impedance. What voltage does the ADC actually read? What if the ADC input impedance were only  $10\text{ k}\Omega$ ?

### 14.11.1 Answers

1.  $R_{2\parallel 3} = (2 \times 3)/(2 + 3) = 1.2\text{ k}\Omega$ .  $R_{\text{total}} = 1.0 + 1.2 = 2.2\text{ k}\Omega$ .  $I = 9/2200 = 4.09\text{ mA}$ .  $V_{R1} = 4.09\text{ mA} \times 1\text{ k}\Omega = 4.09\text{ V}$ .  $V_{R2\parallel R3} = 4.09\text{ mA} \times 1.2\text{ k}\Omega = 4.91\text{ V}$ . Check:  $4.09 + 4.91 = 9.0\text{ V}$  (KVL satisfied).
2.
 
$$f_c = 1/(2\pi RC) = 1/(2\pi \times 10,000 \times 100 \times 10^{-9}) = 159$$
 Hz. For 99% of final value:  $5\tau = 5 \times RC = 5 \times 10,000 \times 100 \times 10^{-9} = 5\text{ ms}$ .
3. With  $1\text{ M}\Omega$  load:  $V_{\text{ADC}} = 2.5 \times 10^6/(5000 + 10^6) = 2.488\text{ V}$  (0.5% loading error, negligible).  
 With  $10\text{ k}\Omega$  load:  $V_{\text{ADC}} = 2.5 \times 10,000/(5000 + 10,000) = 1.667\text{ V}$  (33% loading error, severe).  
 This illustrates why ADC input impedance matters and why a buffer amplifier may be needed.

# Chapter 15

## Amplifiers

### When to Read This Chapter

**Module 7 (Weeks 11–12):** Read before the signal conditioning lab. Focus on the instrumentation amplifier (INA128) gain equation, the complete signal chain design, and CMRR. The ThermoRig worked example ties everything together. **Related:** Circuit fundamentals in Chapter 14 (p. 144); sensor selection in Chapter 6 (p. 62).

### Op-Amp Non-Idealities: Required Reading

Section 15.24 in this chapter (“The Brutal Realities”) is one of the most important in the entire document. Read it before designing any amplifier circuit.

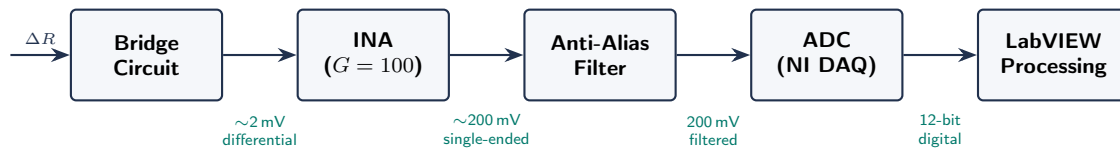


Figure 15.1: Complete signal conditioning chain for a bridge-based sensor. Verify signal levels at each stage using the Signal Walk debugging protocol (Chapter 17).

## 15.1 Why Amplification?

Many sensors produce millivolt or microvolt signals (thermocouples:  $\sim 40 \mu\text{V}/^\circ\text{C}$ ; strain gauges:  $\sim 2 \text{mV}/\text{V}$  at full scale). ADCs work best when the signal spans most of their input range. Amplification bridges this gap, improving resolution and SNR.

## 15.2 Operational Amplifier (Op-Amp) Fundamentals

An ideal op-amp has infinite gain, infinite input impedance, zero output impedance, and infinite bandwidth. Real op-amps approximate this well enough for most instrumentation.

### 15.2.1 Inverting Amplifier

$$V_{\text{out}} = -\frac{R_f}{R_{\text{in}}} V_{\text{in}}, \quad G = -\frac{R_f}{R_{\text{in}}} \quad (15.1)$$

The  $-$  sign means the output is inverted. Input impedance equals  $R_{\text{in}}$ ; this can load a high-impedance sensor.

### 15.2.2 Non-Inverting Amplifier

$$V_{\text{out}} = \left(1 + \frac{R_f}{R_g}\right) V_{\text{in}}, \quad G = 1 + \frac{R_f}{R_g} \quad (15.2)$$

No inversion. Very high input impedance (the op-amp's input impedance, typically  $>1 \text{ G}\Omega$ ). Preferred for sensor interfacing.

### 15.2.3 Voltage Follower (Buffer)

Non-inverting amplifier with  $G = 1$  ( $R_f = 0$ ,  $R_g = \infty$ ). Provides impedance transformation: high input impedance, low output impedance. Use between a high-impedance sensor and a low-impedance load (ADC input, cable driver).

### 15.2.4 Differential Amplifier

$$V_{\text{out}} = G(V_+ - V_-) \quad (15.3)$$

Amplifies the difference between two inputs while rejecting the common-mode voltage (noise, ground offsets). Critical for bridge circuits (strain gauges, RTDs) and any measurement in electrically noisy environments.

## 15.3 Instrumentation Amplifiers

A specialized differential amplifier with three op-amps that provides: very high input impedance on both inputs, precisely settable gain with a single resistor ( $R_G$ ), and very high Common-Mode Rejection Ratio (CMRR). The gain equation (for a standard 3-op-amp INA):

$$G = 1 + \frac{2R}{R_G} \quad (15.4)$$

Common ICs: INA128, AD620, INA333. CMRR typically  $>100 \text{ dB}$ .

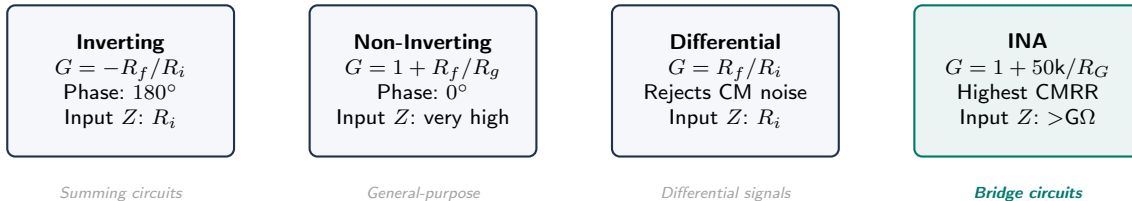


Figure 15.2: Four amplifier configurations for instrumentation. The instrumentation amplifier (INA, teal) is the gold standard for bridge-based sensor interfacing due to its balanced high-impedance inputs and superior CMRR.

#### Requirements Mapping: Amplifier to Shall-Statements

- “Measure strain gauge bridge output (0–10 mV) with a 0–5 V ADC” → AMP-REQ: Amplifier gain shall be  $500 \pm 0.1\%$ . Amplifier CMRR shall be  $\geq 100 \text{ dB}$  to reject 60 Hz common-mode noise.
- “Sensor output impedance is  $10 \text{ k}\Omega$ ” → AMP-REQ: Amplifier input impedance shall be  $\geq 100 \text{ M}\Omega$  (10,000:1 ratio to avoid loading error  $> 0.01\%$ ).

## 15.4 Amplifier Noise

Real amplifiers add noise to the signal. Two key specifications:

**Input-referred voltage noise** ( $e_n$ ): specified in  $\text{nV}/\sqrt{\text{Hz}}$ . Total noise voltage =  $e_n \times \sqrt{\text{bandwidth}}$ . For an INA128:  $e_n \approx 8 \text{ nV}/\sqrt{\text{Hz}}$ .

**Input-referred current noise** ( $i_n$ ): specified in  $\text{pA}/\sqrt{\text{Hz}}$ . Generates noise across the source impedance:  $V_n = i_n \times R_s$ . High source impedance (thermocouples, piezo sensors) makes current noise dominant.

**Total input-referred noise:**

$$V_{n,\text{total}} = \sqrt{e_n^2 + (i_n R_s)^2 + 4k_B T R_s} \times \sqrt{\text{BW}} \quad (15.5)$$

where the third term is thermal (Johnson) noise from the source resistance.

### Choosing an Amplifier for Low-Noise Applications

For low source impedance ( $<1 \text{ k}\Omega$ , e.g., strain gauge bridges): choose a low  $e_n$  amplifier (INA128, AD8221). For high source impedance ( $>100 \text{ k}\Omega$ , e.g., piezo sensors): choose a low  $i_n$  amplifier (INA116, OPA129; FET-input types). Always calculate total noise and compare to your signal level to verify adequate SNR.

### Mandate: Use Differential Mode for All Millivolt-Level Signals

When a sensor is physically separated from the DAQ (even by 1 meter of cable), the sensor's "ground" and the DAQ's "ground" are at different potentials. This ground offset (often 10–100 mV from building wiring) adds directly to your measurement. For a thermocouple producing 1 mV, a 50 mV ground offset is a  $50\times$  error. **Solution:** always configure the NI DAQ in Differential mode for millivolt-level signals (thermocouples, strain gauge bridges, low-output sensors). Differential mode measures the voltage *between* the two signal wires, rejecting the common-mode ground offset. In NI MAX, select "Differential" (not "RSE") when configuring analog input channels.

## 15.5 Signal Conditioning Chains

A complete signal conditioning chain for a resistive sensor:

1. **Bridge excitation:** precision voltage or current source drives the Wheatstone bridge.
2. **Instrumentation amplifier:** amplifies the differential bridge output (typically  $100\text{--}1000\times$ ) while rejecting common-mode voltage.
3. **Low-pass filter:** removes high-frequency noise and provides anti-aliasing. Cutoff frequency set to  $\leq 0.4f_s$ .
4. **Voltage offset/scaling:** shifts and scales the signal to match the ADC input range ( $0\text{--}5 \text{ V}$  or  $\pm 10 \text{ V}$ ).
5. **ADC:** digitizes the conditioned signal.

**WE ThermoRig: Complete Signal Chain for Strain Measurement**

A  $350\ \Omega$  strain gauge in a quarter-bridge (**ThermoRig Variant: Strain Measurement**; this example demonstrates the signal chain design process for a resistive sensor, complementing the thermocouple-based ThermoRig) with  $V_{ex} = 5\text{ V}$ . At  $1000\ \mu\epsilon$ :

$$\Delta V = V_{ex} \times GF \times \epsilon/4 = 5 \times 2.1 \times 0.001/4 = 2.625$$

mV. Signal chain: INA128 at  $G = 500$  ( $V_{out} = 1.31\text{ V}$ ), followed by a 2nd-order Butterworth LP at  $500\text{ Hz}$ , feeding a 16-bit ADC ( $\pm 5\text{ V}$  range). ADC resolution at sensor:  $10/(65536 \times 500) = 0.305\ \mu\text{V} = 0.116\ \mu\epsilon$ . Noise: INA128 noise ( $8\text{ nV}/\sqrt{\text{Hz}} \times \sqrt{500} = 179\text{ nV}$  input-referred)  $\rightarrow$  referred to strain:  $179\text{ nV}/(5 \times 2.1/4) = 0.068\ \mu\epsilon$ . Total: well within a  $\pm 5\ \mu\epsilon$  requirement.

## 15.6 Why Amplification Is Necessary

Sensor outputs are often too small for the ADC. A Type K thermocouple at  $100^\circ\text{C}$  produces only  $4.1\text{ mV}$ . An NI USB-6001 on  $\pm 10\text{ V}$  has  $1.22\text{ mV}$  LSB, meaning the TC signal spans only 3–4 bits. Amplification by  $500\text{--}1000\times$  utilizes the full 14-bit range.

## 15.7 Op-Amp Fundamentals

Key real-world limitations: **Input offset voltage** ( $V_{os}$ ):  $0.1\text{--}5\text{ mV}$ . At gain 1000, a  $1\text{ mV}$  offset becomes  $1\text{ V}$ . Use precision or auto-zero op-amps. **Input bias current** ( $I_b$ ):  $\text{nA}$  to  $\text{pA}$ . Creates voltage offsets across high-impedance sources. Match impedances or use FET-input. **GBW**: gain  $\times$  bandwidth is constant.  $1\text{ MHz}$  GBW gives  $1000\times$  gain only to  $1\text{ kHz}$ . **Slew rate**: max output change rate ( $\text{V}/\mu\text{s}$ ). For  $5\text{ V}$  at  $10\text{ kHz}$ : need  $\geq 0.31\text{ V}/\mu\text{s}$ .

## 15.8 Amplifier Configurations

**Non-inverting**:  $G = 1 + R_f/R_g$ . High input impedance. Default for sensors.

**Inverting**:  $G = -R_f/R_i$ . Input impedance =  $R_i$ . Use when inversion is acceptable.

**Buffer**:  $G = 1$ . Converts high-impedance source to low-impedance output.

**Differential**:  $V_o = (R_f/R_i)(V_2 - V_1)$ . CMRR limited by resistor matching ( $\sim 60\text{ dB}$  for  $0.1\%$  resistors).

## 15.9 Instrumentation Amplifier (INA)

Three-op-amp topology: two input buffers + difference amplifier.  $G = 1 + 2R/R_G$  (for the INA128 specifically:  $G = 1 + 49.4\text{ k}\Omega/R_G$ ). CMRR  $> 100\text{ dB}$ . Very high input impedance ( $> 10^{10}\ \Omega$ ). Gain set by single resistor. The gold standard for sensor interfacing.

**WE ThermoRig: Complete Signal Chain**

TC produces  $0\text{--}8.2\text{ mV}$  ( $0\text{--}200^\circ\text{C}$ ). DAQ accepts  $0\text{--}5\text{ V}$ . Required gain:  $G \approx 600$ . INA128 ( $R = 49.4\text{ k}\Omega$ ):  $R_G = 98.8\text{ k}/(600 - 1) = 165\ \Omega$ . Use  $162\ \Omega$  standard,  $G = 611$ . CMRR of  $120\text{ dB}$  rejects  $50\text{ mV}$  ground offset. Signal chain: TC  $\rightarrow$  INA128 ( $G = 611$ )  $\rightarrow$  Sallen-Key LP ( $40\text{ Hz}$ )  $\rightarrow$  NI USB-6001 (diff,  $0\text{--}5\text{ V}$ ,  $100\text{ S/s}$ ).



## 15.10 Common Mistakes

(1) No decoupling capacitors (100 nF at each power pin). (2) Input exceeds common-mode range. (3) Driving capacitive loads without series resistor (causes oscillation). (4) Gain maps signal beyond ADC range (clipping).

## 15.11 Reading Op-Amp Datasheets

The datasheet is the most important document for amplifier design. Key sections to examine:

**Absolute maximum ratings:** voltages and currents that must never be exceeded. Exceeding these destroys the device permanently. Always design with margin.

**Electrical characteristics table:** input offset voltage ( $V_{os}$ ), input bias current ( $I_b$ ), open-loop gain ( $A_{ol}$ ), CMRR, GBW product, slew rate. These are specified at particular conditions (supply voltage, temperature).

**Typical performance curves:** plots of key parameters vs. frequency, temperature, and supply voltage. The “Open-Loop Gain vs. Frequency” plot determines the usable gain-bandwidth. The “CMRR vs. Frequency” plot shows that CMRR degrades at high frequencies, which is critical for rejecting EMI.

**Application circuits:** the manufacturer’s recommended configurations, including component values and PCB layout tips.

## 15.12 PCB Layout for Low-Noise Amplifiers

Poor layout can undo careful circuit design. Key rules: (1) Keep traces short between sensor input and amplifier. (2) Route analog traces away from digital and power traces. (3) Use a continuous ground plane under the amplifier. (4) Place decoupling capacitors within 5 mm of power pins. (5) Use Kelvin connections for precision resistors (separate current and voltage traces). (6) Enclose the sensitive input area with a guard ring (a trace connected to the non-inverting input potential) to intercept leakage currents.

## 15.13 Signal Conditioning Chain Design Example

For a full Wheatstone bridge strain gauge system: (1) Bridge excitation: REF5050 (5.000 V precision reference). (2) First stage: INA128 with  $G = 100$  (maps  $\pm 20$  mV bridge output to  $\pm 2$  V). (3) Second stage: 4th-order Sallen-Key Butterworth LP at 100 Hz (anti-alias for 1 kS/s DAQ). (4) Buffer: unity-gain buffer (OPA2277) to drive the DAQ input. (5) DAQ: NI USB-6001, differential input,  $\pm 5$  V range, 1 kS/s. Total system noise: dominated by the INA128’s  $e_n = 8$  nV/ $\sqrt{\text{Hz}}$  over 100 Hz bandwidth:  $V_n = 8 \times \sqrt{100} = 80$  nV input-referred, or  $80 \times 100 = 8$   $\mu$ V at the ADC, well below the 1.22 mV LSB.

## 15.14 Op-Amp Selection Guide

With thousands of op-amps available, selection can be overwhelming. Use this decision tree for MEGN 300 applications:

**General purpose (non-critical):** TL072 (JFET input, low cost,  $\text{GBW} = 3\text{ MHz}$ ). Good for buffering, non-inverting amplification of volt-level signals, and filter stages where noise is not the limiting factor.

**Precision DC measurement:** OPA2277 ( $V_{os} = 10\text{ }\mu\text{V}$ , low drift, low noise). For strain gauge amplification, thermocouple signal conditioning, and any application where DC accuracy matters.

**Low noise:** OPA1612 ( $e_n = 1.1\text{ nV}/\sqrt{\text{Hz}}$ ). For hydrophone preamplifiers, high-impedance sensor buffering, and applications where the noise floor limits measurement resolution.

**High speed:** OPA657 ( $\text{GBW} = 1.6\text{ GHz}$ , slew rate  $= 700\text{ V}/\mu\text{s}$ ). For photodiode transimpedance amplifiers, high-frequency signal conditioning, and wideband measurements. Requires careful PCB layout.

**Rail-to-rail, single supply:** MCP6022 (operates on 2.5–5.5 V, rail-to-rail I/O). For battery-powered portable instruments and 3.3 V MCU-compatible signal conditioning.

## 15.15 INA Design Details

### 15.15.1 Gain Resistor Selection

The INA128's gain equation  $G = 1 + 49.4\text{ k}\Omega/R_G$  means that very high gains require very small  $R_G$ . At  $G = 1000$ :  $R_G = 49.4\text{ }\Omega$ . At this value, the resistor's lead resistance and contact resistance (especially on a breadboard) can contribute significant gain error. Solution: use a precision ( $\leq 0.1\%$ ), low-TCR metal film resistor soldered directly to the INA's  $R_G$  pins. Never use a potentiometer for  $R_G$  (the wiper resistance fluctuates).

### 15.15.2 Input Bias Current Path

The INA128's input bias current ( $\pm 2\text{ nA}$  typical) must have a DC return path to ground. If the sensor is AC-coupled (capacitor in series) or the source is floating (isolated thermocouple), the bias current has no path, and the output saturates to the rail. Solution: add high-value resistors (1–10 M $\Omega$ ) from each input to ground, providing the bias current path while maintaining high common-mode impedance.

### 15.15.3 Reference Pin

The INA128's output is referenced to the voltage on its REF pin (pin 5). For single-supply operation, connect REF to mid-supply (2.5 V from a precision reference) to center the output swing. For bipolar operation, connect REF to ground. If REF is driven by a noisy source, the noise appears directly at the output.

## 15.16 Signal Chain Design Methodology

A systematic approach to designing the complete signal conditioning chain:

**Step 1: Define the input and output.** Input: sensor output range (e.g.,  $-10$  to  $+40\text{ mV}$  for a thermocouple at  $0$ – $200^\circ\text{C}$ ). Output: ADC input range (e.g.,  $0$ – $5\text{ V}$ ).

**Step 2: Calculate required gain.**

$$G = V_{\text{ADC,range}}/V_{\text{sensor,range}} = 5000\text{ mV}/50\text{ mV} = 100$$

**Step 3: Add offset to shift the signal.** The sensor output includes negative values ( $-10\text{ mV}$  at  $0^\circ\text{C}$ ). After  $100\times$  gain:  $-1\text{ V}$  (cannot be measured by a  $0\text{--}5\text{ V}$  ADC). Add an offset of  $+1\text{ V}$  after amplification, or bias the INA's REF pin to  $+1\text{ V}$ .

**Step 4: Design the anti-alias filter.** For  $100\text{ S/s}$  sample rate and  $10\text{ Hz}$  signal bandwidth: 2nd-order Sallen-Key Butterworth at  $f_c = 40\text{ Hz}$ . This provides  $-24\text{ dB}$  attenuation at  $f_s/2 = 50\text{ Hz}$ , adequate for 14-bit.

**Step 5: Verify the noise budget.** Compute the total output noise and compare to the ADC's LSB. If the noise exceeds  $0.5\text{ LSB}$ , reduce the bandwidth, increase the gain (to use more of the ADC range), or select a lower-noise amplifier.

**Step 6: Simulate, build, test.** Use SPICE simulation (LTspice is free) to verify the design before building. After building, measure the actual gain, offset, frequency response, and noise, and compare to the design.

## 15.17 Differential vs. Single-Ended Signal Routing

**Single-ended:** one signal wire and a ground return. Simple but susceptible to ground noise. Use for volt-level signals from low-impedance sources over short distances ( $<30\text{ cm}$ ).

**Differential:** two signal wires (no ground reference). Rejects common-mode noise. Use for millivolt signals, long cable runs, and noisy environments. The INA at the receiving end converts differential to single-ended.

**Rule of thumb:** if the sensor output is less than  $100\text{ mV}$ , or the cable is longer than  $1\text{ m}$ , or the environment contains motors/power electronics, use differential signal routing with an INA.

## 15.18 Practical Amplifier Troubleshooting

**Output saturated at positive rail:** (1) check power supply connections (is  $V+$  actually connected?), (2) check for open feedback path ( $R_f$  disconnected = infinite gain = rail), (3) check input common-mode range (input voltage too high for the op-amp).

**Output saturated at negative rail:** (1) check that  $V-$  supply is connected, (2) check for reversed input polarity (signal on  $V-$  instead of  $V+$  for non-inverting), (3) check for DC offset amplified to the rail.

**Output oscillates at high frequency (MHz range):** (1) add decoupling capacitors ( $100\text{ nF}$  ceramic at power pins), (2) check for capacitive load on output (add  $100\ \Omega$  series resistor), (3) verify the op-amp is unity-gain stable (some high-speed op-amps require minimum gain for stability).

**Output has excessive noise:** (1) check grounding (star ground, no ground loops), (2) check power supply decoupling, (3) verify the input is properly terminated (floating inputs pick up noise), (4) check for resistor values too high ( $R > 100\text{ k}\Omega$  increases thermal noise).

**Gain is wrong:** (1) measure actual resistor values with a multimeter (tolerance effects), (2) check for loading at the output (the next stage drawing current through  $R_f$ ), (3) verify the op-amp has sufficient GBW for the gain and frequency.

## 15.19 Precision Measurement Techniques

**Chopper stabilization:** an auto-zero technique that periodically measures and corrects the offset voltage. The LTC2057 (chopper-stabilized) achieves  $V_{os} = 0.5\ \mu\text{V}$  and drift of  $0.015\ \mu\text{V}/^\circ\text{C}$ . For thermocouple measurement where the sensor output is  $41\ \mu\text{V}/^\circ\text{C}$ , a  $0.5\ \mu\text{V}$  offset corresponds to only  $0.012^\circ\text{C}$  of error, negligible.

**Guard rings:** for high-impedance circuits ( $R > 1\text{ G}\Omega$ ), PCB surface leakage can exceed the signal current. A guard ring (a PCB trace driven to the same potential as the high-impedance node, surrounding it on the PCB surface) intercepts leakage currents before they reach the sensitive input. Standard practice for pH meters, picoammeters, and charge amplifiers.

**Kelvin connections:** for precision resistance measurement, separate the current-carrying wires from the voltage-sensing wires. The current wires have IR drops across their resistance; the voltage-sensing wires carry no current (connected to high-impedance amplifier inputs) and therefore have no voltage error.

## 15.20 INA Applications Beyond Temperature

The instrumentation amplifier is used wherever a small differential signal must be extracted from a common-mode environment:

**Strain gauge bridges:** output is  $\sim 2\text{ mV/V}$  at full scale. INA gain of 200–1000 maps this to the ADC range.

**Current sensing** (high-side): a shunt resistor in the supply line produces a differential voltage proportional to current, riding on the full supply voltage as common-mode. The INA rejects the supply voltage and amplifies only the shunt voltage.

**Biomedical signals** (ECG, EMG): body-surface potentials are  $\sim 1\text{ mV}$  differential with  $\sim 1\text{ V}$  common-mode (from mains coupling to the body). INA with CMRR  $> 100\text{ dB}$  rejects the mains interference.

**Thermocouple cold junction compensation:** the reference junction voltage ( $\sim 1\text{ mV}$ ) must be measured differentially to reject the ground offset between the thermocouple and the compensation IC.

## 15.21 Noise Analysis for Amplifier Circuits

### 15.21.1 Op-Amp Noise Model

Every op-amp has two internal noise sources: a voltage noise source  $e_n$  (in series with the non-inverting input) and a current noise source  $i_n$  (flowing into each input). The total input-referred noise voltage depends on the source impedance  $R_s$ :

$$V_{n,\text{total}} = \sqrt{e_n^2 + (i_n R_s)^2 + 4k_B T R_s} \quad (15.6)$$

The three terms represent: amplifier voltage noise, amplifier current noise flowing through the source impedance, and the source's own thermal noise. For low source impedance ( $R_s < 1\text{ k}\Omega$ ):  $e_n$  dominates; choose a BJT-input op-amp (low  $e_n$ , e.g., OPA2277:  $8\text{ nV}/\sqrt{\text{Hz}}$ ). For high source impedance ( $R_s > 100\text{ k}\Omega$ ):  $i_n R_s$  dominates; choose a JFET-input op-amp (low  $i_n$ , e.g., OPA2132:  $4\text{ fA}/\sqrt{\text{Hz}}$ ).

### 15.21.2 Noise Gain

The noise gain of an amplifier circuit is the gain experienced by the input-referred noise sources, which is *not* always the same as the signal gain. For a non-inverting amplifier: noise gain =  $1 + R_f/R_g$  = signal gain. For an inverting amplifier: noise gain =  $1 + R_f/R_i$  but signal gain =  $-R_f/R_i$ . The noise gain is always  $\geq 1$  and determines the amplifier's bandwidth (GBW/noise gain) and output noise.

### 15.21.3 Noise Bandwidth

The noise bandwidth of a filter is the bandwidth of an ideal rectangular filter that would pass the same total noise power. For a single-pole (first-order) system with  $-3\text{ dB}$  frequency  $f_{-3\text{dB}}$ : noise bandwidth  $= (\pi/2)f_{-3\text{dB}} = 1.57f_{-3\text{dB}}$ . For a second-order Butterworth: noise bandwidth  $= 1.11f_{-3\text{dB}}$ . Use the noise bandwidth (not the  $-3\text{ dB}$  bandwidth) when computing total noise from noise spectral density.

## 15.22 Practical Circuit Construction

### 15.22.1 Breadboard vs. Protoboard vs. PCB

**Breadboard:** acceptable for initial testing of digital circuits and proof-of-concept. Unacceptable for final analog signal conditioning: contact resistance varies ( $0.01\text{--}1\ \Omega$ ), parasitic capacitance is high ( $\sim 2\text{ pF}$  between adjacent rows), and connections are unreliable under vibration. Maximum recommended use: circuits with signal levels  $> 100\text{ mV}$  and frequencies  $< 1\text{ kHz}$ .

**Protoboard** (solderable perfboard): adequate for most MEGN 300 final projects. Solder connections are permanent, low resistance ( $< 1\text{ m}\Omega$ ), and mechanically robust. Use point-to-point wiring with minimum wire length. Keep analog and digital sections physically separated with a ground plane (copper tape on the bottom side).

**Custom PCB:** best performance. Ground planes, controlled impedance traces, and optimized component placement minimize noise and parasitic effects. PCB fabrication services (JLCPCB, OSH Park) produce 2-layer boards for  $\$2\text{--}\$5$  with 5-day turnaround. For MEGN 301 projects requiring reliable, compact electronics: a custom PCB is strongly recommended.

### 15.22.2 Decoupling Best Practices

Every IC power pin needs a  $100\text{ nF}$  ceramic capacitor (C0G or X7R) placed within  $5\text{ mm}$  of the pin, connected to the nearest ground with the shortest possible trace. Additionally, place one  $10\ \mu\text{F}$  electrolytic capacitor at each power rail entry point to the board. For op-amps operating above  $1\text{ MHz}$ : add a  $1\text{ nF}$  capacitor in parallel with the  $100\text{ nF}$  for high-frequency decoupling.

The decoupling capacitor provides local charge storage so that fast current transients (from the op-amp switching its output stage) are supplied locally rather than propagating through long power traces (which act as antennas, radiating EMI and injecting noise into adjacent circuits).

## 15.23 Signal Chain Verification Checklist

Before connecting the signal conditioning to the DAQ, verify each stage independently:

1. Power supply: correct voltage, low noise ( $< 1\text{ mV}$  ripple on oscilloscope).
2. Zero input: short the amplifier input. Measure the output DC offset (should be  $< V_{os} \times G$ ).
3. Known DC input: apply a precision voltage (from a calibrated source or voltage divider) and verify the output matches the expected gain.
4. Frequency response: sweep a sine wave from  $0.1f_c$  to  $10f_c$  and verify the gain and phase match the design.

5. Noise floor: short the input, measure the output RMS noise. Compare to the calculated noise budget.
6. Full-scale output: apply the maximum expected input and verify the output does not clip (stays within the ADC's input range).
7. Common-mode rejection (for INA): apply the same voltage to both inputs. The output should remain near zero (within the specified CMRR).

## 15.24 Op-Amp Non-Idealities: The Brutal Realities

The preceding sections treat the op-amp as ideal (infinite gain, infinite bandwidth, zero offset). In practice, non-idealities are what destroy measurement accuracy. Understanding three key limitations prevents the most common student design failures.

### 15.24.1 Gain-Bandwidth Product (GBW)

An op-amp has finite open-loop gain that decreases with frequency at  $-20$  dB/decade above the dominant pole. The **Gain-Bandwidth Product** (GBW) is the frequency at which the open-loop gain equals 1 (0 dB). For a TL072:  $\text{GBW} = 3$  MHz. For an OPA2277:  $\text{GBW} = 1$  MHz.

The maximum usable closed-loop bandwidth at gain  $G$  is:

$$f_{\max} = \frac{\text{GBW}}{G} \quad (15.7)$$

For a non-inverting amplifier with  $G = 1000$  using a TL072 ( $\text{GBW} = 3$  MHz):  $f_{\max} = 3000$  Hz. Any signal above 3 kHz is *attenuated*, not amplified. A student expecting flat gain from DC to 10 kHz will measure a signal that rolls off above 3 kHz and be confused.

#### The Gain-Bandwidth Trap

If you need  $G = 1000$  with bandwidth to 10 kHz, you need  $\text{GBW} \geq 10,000 \times 1000 = 10$  MHz (with  $10\times$  margin:  $\geq 100$  MHz). Achieving this in a single stage is impractical: even if a high-GBW op-amp exists, the gain peaking, noise gain, and stability margins at  $G = 1000$  make single-stage design unreliable. The solution: split the gain into two stages ( $G_1 = 100$ ,  $G_2 = 10$ ). Each stage needs  $\text{GBW} \geq 100 \times 10000 = 1$  MHz and  $\text{GBW} \geq 10 \times 10000 = 100$  kHz respectively. Both are easily achievable with a TL072.

### 15.24.2 Input Offset Voltage ( $V_{os}$ )

The input offset voltage is a small DC voltage that appears between the inverting and non-inverting inputs due to manufacturing mismatches in the input transistor pair. It is amplified by the closed-loop gain just like a real signal:

$$V_{\text{output, offset}} = V_{os} \times G \quad (15.8)$$

For a TL072 ( $V_{os} = 3$  mV typical) at gain 611 (ThermoRig INA configuration):  $V_{\text{output, offset}} = 3 \times 10^{-3} \times 611 = 1.83$  V. The thermocouple signal at  $50^\circ\text{C}$  is  $50 \times 0.041 = 2.05$  mV, which amplified to  $2.05 \times 611 = 1.25$  V. The offset (1.83 V) is *larger than the signal* (1.25 V). The measurement is useless.

**Offset Voltage Kills Millivolt Measurements**

For thermocouple and strain gauge signal conditioning, the op-amp's  $V_{os}$  must be much smaller than the signal:  $V_{os} \ll V_{\text{signal}}$ . For a 2 mV thermocouple signal:  $V_{os} < 0.02 \text{ mV}$  ( $20 \mu\text{V}$ ). This requires a precision op-amp: OPA2277 ( $V_{os} = 10 \mu\text{V}$ ), AD8421 ( $V_{os} = 35 \mu\text{V}$ ), or a chopper-stabilized type like the LTC2057 ( $V_{os} = 0.5 \mu\text{V}$ ). General-purpose op-amps (TL072, LM741, LM358) are completely unsuitable for millivolt instrumentation due to their millivolt-level offsets.

The INA128 used in the ThermoRig has  $V_{os} = 50 \mu\text{V}$  maximum (referred to input), which produces only  $50 \times 10^{-6} \times 611 = 30.5 \text{ mV}$  at the output, small enough to be calibrated out. This is why INAs are specified for instrumentation: their offset, drift, and CMRR are optimized for the task.

**15.24.3 Input Offset Voltage Drift ( $dV_{os}/dT$ )**

The offset voltage changes with temperature. For a TL072:  $10 \mu\text{V}/^\circ\text{C}$  typical. Over a  $20^\circ\text{C}$  temperature excursion (lab temperature varying from 18 to  $38^\circ\text{C}$ ):  $\Delta V_{os} = 10 \times 20 = 200 \mu\text{V}$ . At gain 611:  $\Delta V_{\text{output}} = 122 \text{ mV}$ , equivalent to a  $5^\circ\text{C}$  measurement error that slowly wanders as the room temperature changes. This appears as a mysterious drift in the data that cannot be traced to the sensor.

For precision applications: use op-amps with  $dV_{os}/dT < 1 \mu\text{V}/^\circ\text{C}$  (OPA2277:  $0.1 \mu\text{V}/^\circ\text{C}$ ; LTC2057:  $0.015 \mu\text{V}/^\circ\text{C}$ ). Alternatively, calibrate frequently (every 30 minutes in a temperature-variable environment).

**15.24.4 Slew Rate**

The maximum rate at which the output voltage can change. For a TL072:  $13 \text{ V}/\mu\text{s}$ . For an LM741:  $0.5 \text{ V}/\mu\text{s}$ . If the signal demands a faster rate (e.g., a  $5 \text{ V}$  peak sine wave at  $100 \text{ kHz}$ : required slew rate  $= 2\pi \times 5 \times 100000 = 3.14 \text{ V}/\mu\text{s}$ ), the output cannot follow. The result: a sine wave with flattened peaks (slew-rate limiting), introducing harmonic distortion. Verify: required slew rate  $= 2\pi f A_{\text{peak}} < \text{op-amp slew rate}$ .

**15.24.5 Op-Amp Selection Decision Tree**

(1) Is the signal millivolt-level or below?  $\rightarrow$  Use a precision op-amp ( $V_{os} < 100 \mu\text{V}$ ) or an INA. Never use TL072 or LM741.

(2) Does the signal bandwidth exceed  $100 \text{ kHz}$ ?  $\rightarrow$  Select an op-amp with  $\text{GBW} \geq 10 \times G \times f_{\text{max}}$ . Consider splitting into multiple stages.

(3) Is the source impedance high ( $> 100 \text{ k}\Omega$ )?  $\rightarrow$  Use a JFET-input op-amp (TL072, OPA2132) for low input bias current.

(4) Is the circuit battery-powered or single-supply?  $\rightarrow$  Use a rail-to-rail op-amp (MCP6022, OPA2337) to maximize output swing.

(5) None of the above constraints are critical?  $\rightarrow$  TL072 (JFET, general purpose) or LM358 (BJT, single supply).



## 15.25 Practice Questions

1. Design a non-inverting amplifier with a gain of 50 using standard 1% resistor values. Specify  $R_f$  and  $R_g$ .
2. A strain gauge bridge produces 5 mV of signal with 2 V of common-mode voltage. Your ADC cannot tolerate more than 10 mV of common-mode breakthrough. What minimum CMRR does your amplifier need?
3. Why should you use an instrumentation amplifier (INA128) rather than a single op-amp differential amplifier for measuring a thermocouple signal? Give at least two reasons.

### 15.25.1 Answers

1.  $G = 1 + R_f/R_g = 50$ , so  $R_f/R_g = 49$ . Choose  $R_g = 1.00 \text{ k}\Omega$ ,  $R_f = 49.9 \text{ k}\Omega$  (both standard 1% values). Actual gain  $= 1 + 49.9/1.00 = 50.9$ . For tighter accuracy, use  $R_g = 2.00 \text{ k}\Omega$  and  $R_f = 97.6 \text{ k}\Omega$  ( $G = 49.8$ ), or use a precision resistor network.
2. Required CMRR

$$= 20 \log_{10}(V_{CM}/V_{\max \text{ breakthrough}}) = 20 \log_{10}(2/0.010) = 20 \log_{10}(200) = 46$$

dB minimum. In practice, use  $\geq 80$  dB to provide comfortable margin.

3. (1) An INA has very high and balanced input impedance on both inputs ( $>10 \text{ G}\Omega$ ), while a single-op-amp differential amplifier's input impedance depends on the resistor values and is often unequal. This matters for thermocouples, which are high-impedance sources sensitive to loading.  
(2) An INA's gain is set by a single resistor ( $R_G$ ), providing precise and easily adjustable gain, while a differential amplifier requires four matched resistors where any mismatch degrades CMRR.

#### ✓ Mastery Diagnostic:

Amplifiers and Signal Conditioning To demonstrate mastery of this module, you must be able to:

1. Design a non-inverting amplifier with specified gain ( $G = 1 + R_f/R_g$ ) and verify GBP sufficiency.
2. Select and configure an INA128 for a bridge circuit ( $G = 1 + 50 \text{ k}\Omega/R_G$ ).
3. Identify and mitigate op-amp non-idealities: offset, bias current, finite CMRR, slew rate.
4. Apply the 100:1 impedance rule and insert buffers where needed.
5. Design a complete signal conditioning chain from sensor to ADC.



## Chapter 16

# High-Power Devices and Switches

### When to Read This Chapter

**Module 8 (Weeks 11–12):** Read before the high-power switching lab. Focus on MOSFET gate drive, flyback diodes, PWM, and the relay vs. MOSFET vs. SSR comparison. The safety warnings in this chapter are critical. **Related:** Circuit fundamentals in Chapter 14 (p. 144); PID output stages in Chapter 20 (p. 211).

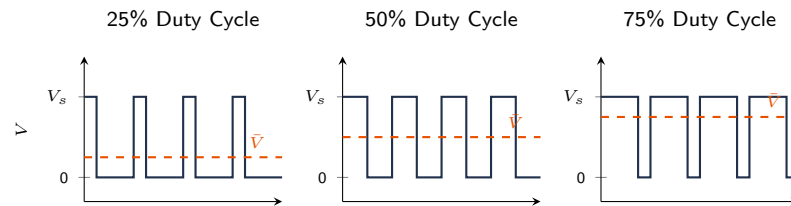


Figure 16.1: Pulse Width Modulation (PWM) at three duty cycles. The MOSFET switches rapidly between fully on ( $V_s$ ) and fully off (0 V). The average voltage  $\bar{V} = D \times V_s$  (orange dashed) is proportional to the duty cycle  $D$ . An inductive load (motor coil) smooths the pulsed current into a nearly DC value proportional to  $D$ . The ThermoRig heater uses time-proportional PWM through an SSR.

## 16.1 The Problem: MCU Outputs Cannot Drive Loads

A microcontroller GPIO pin typically sources 10–20 mA at 3.3 V. A heater, motor, solenoid, or lamp draws 100 mA to 30 A at 12–120 V. You need an electronic switch between the low-power control signal and the high-power load.

## 16.2 Transistors as Switches

### 16.2.1 BJT (Bipolar Junction Transistor)

A small base current ( $I_B$ ) controls a large collector current ( $I_C$ ). In switching mode: fully OFF (cutoff,  $I_C \approx 0$ ) or fully ON (saturation,  $V_{CE} \approx 0.2$ – $0.7$  V). The current gain  $\beta = I_C/I_B$  determines the base current needed:  $I_B = I_C/\beta$ . Add a base resistor to limit current from the MCU pin.

### 16.2.2 MOSFET

A voltage on the gate controls the drain current. In switching mode: fully OFF ( $V_{GS} < V_{th}$ , no current) or fully ON ( $V_{GS} \gg V_{th}$ , drain-source acts as a low resistance  $R_{DS(on)}$ ). Power dissipation

$$= I_D^2 \times R_{DS(on)}.$$

**N-channel** (most common): placed in the low side (between load and ground). Gate driven high to turn on. Logic-level gate MOSFETs (e.g., IRLZ44N,  $V_{th} < 2.5\text{ V}$ ) can be driven directly by a 3.3 V MCU.

**P-channel**: placed in the high side (between supply and load). Gate pulled low (relative to source) to turn on. Used for high-side switching and reverse-polarity protection.

### Inductive Load Protection

Motors, solenoids, and relays are inductive loads. When the switch opens, the inductor generates a voltage spike ( $V = L \cdot dI/dt$ ) that can reach hundreds of volts and destroy the switch. **Always add a flyback diode** (Schottky preferred) across the load: cathode to positive, anode to negative. This clamps the spike to one diode drop.

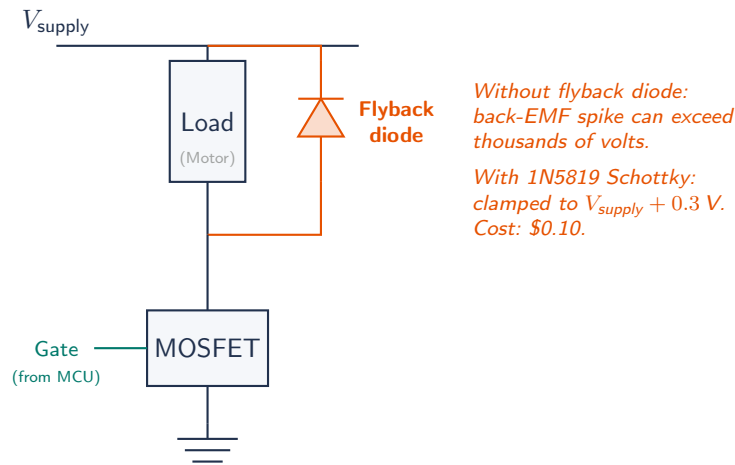


Figure 16.2: N-channel MOSFET low-side switching an inductive load with flyback diode (Schottky 1N5819) protection. The diode clamps the inductive voltage spike to  $V_{supply} + V_f$ , preventing MOSFET destruction.

## 16.3 Relays

An electromechanical switch operated by a coil. The coil is driven by a transistor or MOSFET; the contacts switch the load. **Advantages**: complete galvanic isolation between control and load, handles AC or DC, very low on-resistance. **Disadvantages**: slow (5–20 ms switching), mechanical wear (rated for  $10^5$ – $10^6$  cycles), audible click, generates EMI from contact arcing.

### 16.3.1 Solid-State Relays (SSR)

Use a semiconductor (MOSFET or TRIAC) instead of mechanical contacts. No moving parts, no arcing, no audible noise, faster switching ( $< 1\text{ ms}$ ), longer lifetime ( $> 10^8$  cycles). More expensive and have higher on-state voltage drop (generating more heat).

## 16.4 H-Bridge for Motor Direction Control

An H-bridge uses four switches (MOSFETs or BJTs) arranged so the motor can be driven in both directions. Two switches close at a time (diagonal pairs). PWM on one pair controls speed; switching pairs reverses direction. Common ICs: L298N, BTS7960, DRV8871. Always include flyback protection.

## 16.5 Pulse Width Modulation (PWM) for Power Control

PWM controls the average power delivered to a load by rapidly switching it on and off. The **duty cycle** ( $D$ ) determines the fraction of time the load is powered:

$$V_{\text{avg}} = D \times V_{\text{supply}}, \quad P_{\text{avg}} = D \times P_{\text{max}} \quad (16.1)$$

For a heater or lamp: average power is proportional to duty cycle. For a DC motor: average voltage (and thus speed) is proportional to duty cycle; the motor's mechanical inertia smooths the pulsed current into quasi-continuous rotation.

**PWM frequency selection:** high enough that the load integrates the pulses (no flicker in lamps, no audible buzz in motors). Typical: 1–25 kHz for motors, 100 Hz–1 kHz for heaters. Too high: increased switching losses in the MOSFET.

## 16.6 Optocouplers and Galvanic Isolation

An optocoupler transmits a signal across an electrical isolation barrier using light (LED → phototransistor inside a single package). Provides complete galvanic isolation (typically 3–5 kV) between the control circuit (MCU) and the power circuit (high-voltage load).

Use optocouplers when: (1) switching AC mains (120/240 VAC), (2) the power ground and signal ground must be kept separate for safety, or (3) ground loops between the controller and the load circuit must be eliminated.

### WE ThermoRig: Heater Control with SSR and PWM

The ThermoRig drives a 120 VAC, 500 W cartridge heater through a solid-state relay (SSR, Crydom D2425). The SSR's control input requires 3–32 VDC at 10 mA. The ESP32's 3.3 V GPIO drives the SSR directly (3.3 V is within the 3–32 V control range; current draw is 10 mA, within GPIO limits).

PWM at 1 Hz (slow PWM or “time-proportional control”): the PID controller outputs a duty cycle (0–100%). Each second, the heater is ON for  $D \times 1$  s and OFF for  $(1 - D) \times 1$  s. This slow switching extends SSR life and avoids EMI from fast switching of AC loads. The thermal mass of the metal block smooths the pulsed heating into a quasi-continuous temperature rise.

## 16.7 Why High-Power Switching Matters

Sensors and signal conditioning operate at milliamperes levels. Actuators (motors, heaters, solenoids, valves) require amperes. The MCU's GPIO pins cannot drive these loads directly; they provide at most 10–20 mA at 3.3 V. A power switching device acts as a gate between the low-power control signal and the high-power load, controlled by the MCU but powered by a separate supply.

## 16.8 MOSFET as a Switch

The N-channel enhancement MOSFET is the most common switching device in student projects. When gate voltage exceeds the threshold ( $V_{GS(th)}$ , typically 1–4 V), the MOSFET conducts between drain and source. When gate is low, it is an open circuit.

Key parameters:  $V_{GS(th)}$ : must be below the MCU's GPIO voltage. For 3.3 V MCUs, use logic-level MOSFETs ( $V_{GS(th)} < 2.5$  V; e.g., IRLZ44N, IRL540N). Standard MOSFETs ( $V_{GS(th)} \approx 4$  V) will not fully turn on.  $R_{DS(on)}$ : drain-source resistance when on. Lower is better; dissipates  $P = I^2 \times R_{DS(on)}$  as heat. The IRLZ44N has  $R_{DS(on)} = 0.022 \Omega$  at  $V_{GS} = 5$  V.  $V_{DS(max)}$ : maximum drain-source voltage when off. Must exceed supply voltage with margin.  $I_D(max)$ : maximum continuous drain current.

### 16.8.1 Gate Drive Circuit

The MCU GPIO connects to the MOSFET gate through a series resistor (100–330  $\Omega$ ) that limits gate charge current. A pull-down resistor (10 k $\Omega$ ) from gate to source ensures the MOSFET stays OFF during MCU reset or high-impedance states. For faster switching, a dedicated gate driver IC can be used.

## 16.9 BJT as a Switch

Bipolar Junction Transistors (NPN type: TIP120, 2N2222) are also used for switching. The base current controls the collector current:  $I_C = \beta \cdot I_B$  where  $\beta$  (current gain) is typically 50–200. For saturation (fully on), provide  $I_B \geq I_C/\beta_{min}$  with some margin. A base resistor limits current:  $R_B = (V_{GPIO} - V_{BE})/I_B$  where  $V_{BE} \approx 0.7$  V.

MOSFETs are generally preferred for student projects because they require no continuous base current (reducing MCU power) and have lower on-state losses. BJTs are useful for very low-cost applications and Darlington configurations (TIP120) that provide extremely high current gain ( $\beta > 1000$ ).

## 16.10 Inductive Load Protection

Motors, solenoids, and relays contain inductors. When current through an inductor is suddenly interrupted (MOSFET turns off), the inductor's stored energy ( $E = \frac{1}{2}LI^2$ ) generates a voltage spike:

$$V = L \frac{dI}{dt} \quad (16.2)$$

For a 50 mH coil carrying 0.5 A interrupted in 1  $\mu$ s:  $V = 0.05 \times 500,000 = 25,000$  V. This spike destroys the MOSFET, the MCU, and potentially the DAQ.

A **flyback diode** (Schottky type: 1N5819) placed across the inductive load (cathode to positive supply, anode to drain) clamps the spike to  $V_{supply} + V_{diode} \approx V_{supply} + 0.3$  V. This is safe. Every inductive load must have a flyback diode. No exceptions.

## 16.11 Relay and SSR Switching

**Electromechanical relays:** a coil creates a magnetic field that physically moves a switch contact. Advantages: complete galvanic isolation between control and load, can switch AC or DC, very high

off-resistance. Disadvantages: slow (5–20 ms), limited cycle life (100k–1M operations), generates EMI at contact bounce. The relay coil is itself an inductive load; drive it through a MOSFET or BJT with a flyback diode.

**Solid-State Relays (SSR):** semiconductor switches (triacs for AC, MOSFETs for DC) with optical isolation between control and load. Advantages: fast (microseconds), no contact bounce, unlimited cycle life, silent. Disadvantages: some leakage current when off, voltage drop when on (1–2 V for triacs), requires heat sinking at high currents.

## 16.12 PWM for Proportional Control

Pulse-Width Modulation (PWM) rapidly switches the load on and off at a fixed frequency, with the ratio of on-time to total period (the **duty cycle**) controlling the average power delivered. At 50% duty cycle, the load receives 50% of the maximum power.

PWM frequency selection: for DC motors, 1–25 kHz (above audible range to avoid whine). For heaters with SSRs, 0.5–2 Hz (slow PWM or time-proportional control, matched to the thermal time constant). For LEDs, >100 Hz (above flicker perception).

## 16.13 H-Bridge for Bidirectional Motor Control

A full H-bridge uses four switching devices (MOSFETs or integrated H-bridge ICs like L298N, DRV8871) arranged so that current can flow through the motor in either direction. By controlling which diagonal pair conducts, the motor spins forward or reverse. PWM on the enable input controls speed. Integrated H-bridge modules include flyback diodes, current sensing, and thermal protection.

### Shoot-Through Protection

In an H-bridge, if both the high-side and low-side switches in the same leg turn on simultaneously, a short circuit (“shoot-through”) occurs, drawing massive current and potentially destroying the switches. Integrated H-bridge ICs include dead-time protection; if building a discrete H-bridge, add hardware dead-time between complementary gate signals.

## 16.14 Optocoupler Isolation

When the control circuit (MCU, DAQ) must be electrically isolated from the power circuit (high voltage, noisy motors), an **optocoupler** provides the link. An LED on the control side illuminates a phototransistor on the power side, transferring the signal across a galvanic barrier. Typical isolation: 2.5–5 kV. This protects the MCU and DAQ from power-side faults, ground loops, and high-voltage transients.

## 16.15 Relay Selection Guide

When choosing between electromechanical relays and SSRs:

**Use electromechanical when:** switching AC mains (the relay’s galvanic isolation provides safety), switching infrequently (<1 time/second), cost is critical, or the contact resistance must be extremely low (<50 mΩ for power relays).

**Use SSR when:** fast switching is needed ( $>1$  Hz), the application requires millions of cycles (heating control, dimming), bounce-free switching is required (digital signal routing), or the system must be silent (laboratory, medical).

## 16.16 Level Shifting

When the MCU operates at 3.3 V but the MOSFET gate driver, relay coil, or SSR control requires 5 V or 12 V, a level shifter is needed. Simple solutions: (1) NPN transistor with pull-up to the higher voltage (inverts the logic). (2) Dedicated level-shifter IC (TXB0104 for bidirectional, SN74LVC1T45 for unidirectional). (3) Logic-level MOSFET (BSS138) used as a level translator.

## 16.17 Current Sensing

Measuring the current through a load enables overcurrent protection, power monitoring, and closed-loop current control. Methods: (1) Shunt resistor: insert a small precision resistor ( $0.01\text{--}1\ \Omega$ ) in series with the load. Measure the voltage drop:  $V = I \cdot R_{\text{shunt}}$ . Low-side placement (between load and ground) is simplest but shifts the ground reference. High-side placement (between supply and load) preserves the ground but requires a differential amplifier or dedicated high-side current sense IC (INA219, ACS712). (2) Hall-effect sensor: non-contact measurement. No insertion loss. Measures DC and AC. Lower accuracy than shunt but provides galvanic isolation.

## 16.18 Thermal Management

Power devices dissipate heat ( $P = I^2 R_{DS(on)}$  for MOSFETs,  $P = V_{CE(sat)} \times I_C$  for BJTs,  $P = I^2 R_{\text{contact}}$  for relays). If the junction temperature exceeds the maximum rating ( $T_{j,\text{max}}$ , typically  $150\text{--}175^\circ\text{C}$  for silicon), the device fails. The thermal path from junction to ambient has a thermal resistance  $R_{\theta,JA}$  ( $^\circ\text{C}/\text{W}$ ):  $T_j = T_{\text{ambient}} + P \times R_{\theta,JA}$ . If  $T_j$  exceeds limits, add a heatsink to reduce  $R_{\theta,JA}$ .

## 16.19 Power Budget and Wire Sizing

Before selecting any switching device, compute the power budget: total current, voltage, and power for each load. Size the wiring accordingly using the American Wire Gauge (AWG) table.

For DC loads:  $I = P/V$ . A 200 W heater at 12 V draws  $200/12 = 16.7$  A. At this current, use 12 AWG wire minimum (20 A rating), with appropriately rated connectors and fuses.

**Voltage drop in wiring:**  $V_{\text{drop}} = I \times R_{\text{wire}}$ . For 3 m of 14 AWG copper ( $R = 8.28\ \text{m}\Omega/\text{m}$ ):  $V_{\text{drop}} = 16.7 \times 2 \times 3 \times 0.00828 = 0.83$  V. This is 7% of the 12 V supply, significant enough to affect heater power. Use heavier wire or higher supply voltage.

**Fuse selection:** size the fuse at 125% of the normal operating current. For 16.7 A: use a 20 A slow-blow fuse. Slow-blow tolerates motor inrush current ( $5\text{--}10\times$  normal for the first 0.1–1 s); fast-blow fuses trip on inrush.

## 16.20 Solid-State Relay (SSR) Detailed Design

For AC loads (heaters, lamps, fans powered from mains): the SSR is the standard switching element. It uses a triac (bidirectional thyristor) that turns on when triggered and stays on until the AC

current crosses zero.

**Zero-cross SSR:** triggers only at the next AC zero crossing after the control input is asserted. This prevents inrush current spikes and EMI from mid-cycle switching. Standard for resistive loads (heaters, incandescent lamps).

**Random-fire SSR:** triggers immediately, regardless of the AC phase. Necessary for phase-angle control (dimming, speed control) but generates significant EMI. Requires an EMI filter.

**Snubber circuit:** an RC network ( $100\ \Omega + 0.1\ \mu\text{F}$ ) across the SSR output suppresses voltage transients from inductive loads and prevents false triggering from  $dV/dt$  across the triac.

**Heat sinking:** SSRs have 1–1.6 V forward drop. At 10 A:  $P = 16\ \text{W}$  dissipation. Without a heatsink, the SSR overheats and fails. Mount the SSR on an aluminum heatsink with thermal compound; size the heatsink for  $R_\theta < (T_{\text{max}} - T_{\text{ambient}})/P$ .

## 16.21 Motor Control Fundamentals

**DC motor speed control:** PWM duty cycle controls average voltage:  $V_{\text{avg}} = D \times V_{\text{supply}}$ . Speed is approximately proportional to voltage (for unloaded motors). Under load, speed drops due to armature resistance and back-EMF. Closed-loop speed control (tachometer feedback) compensates.

**Brushless DC (BLDC) motor control:** requires electronic commutation (switching the correct phase winding at the right time). Use a dedicated BLDC driver IC (e.g., DRV8313) or an ESC (Electronic Speed Controller) module. Not practical to implement from discrete components in MEGN 300.

**Stepper motor control:** moves in discrete angular steps ( $1.8^\circ\text{C}/\text{step}$  typical for a 200-step/revolution motor). Driven by a stepper driver IC (A4988, DRV8825) that converts step and direction signals into the correct coil energization sequence. Interface to MCU: one GPIO for step pulse, one for direction, one for enable.

## 16.22 Protection Circuits

**Overcurrent protection:** a fuse or resettable polyfuse in series with the load. For electronic protection: measure current through a shunt resistor and compare to a threshold; if exceeded, disable the MOSFET gate via a comparator circuit. Response time:  $<1\ \text{ms}$  for electronic, 10–100 ms for fuses.

**Overvoltage protection:** a TVS (Transient Voltage Suppressor) diode across the power bus clamps voltage spikes from inductive switching, ESD, or supply transients. Select a TVS with standoff voltage above the normal supply and clamping voltage below the maximum rating of the MOSFET and load.

**Reverse polarity protection:** a MOSFET in the ground return (body diode blocks reverse current) or a series Schottky diode (simple but has 0.3 V drop). The MOSFET method has negligible voltage drop and is preferred for high-current systems.

## 16.23 EMI from Power Switching

Every time a MOSFET or SSR switches, it generates electromagnetic interference. The fast voltage transitions ( $dV/dt = 100\text{--}1000\ \text{V}/\mu\text{s}$ ) and current transitions ( $dI/dt = 1\text{--}100\ \text{A}/\mu\text{s}$ ) create broadband noise that propagates through power wiring (conducted EMI) and radiates from current loops (radiated EMI). This noise can corrupt analog sensor measurements on the same board or through shared power supplies.



**Mitigation strategies:** (1) keep power switching traces physically separated from analog signal traces (at least 2 cm on a PCB, 10 cm on a protoboard), (2) use a ground plane that separates the power and analog ground return paths, (3) add snubber circuits (RC across the switch) to slow the transitions and reduce  $dV/dt$ , (4) use gate resistors on MOSFETs to limit  $dI/dt$  during turn-on, (5) decouple the analog power supply with LC filters to prevent conducted noise.

## 16.24 Inrush Current Management

Motors, incandescent lamps, and capacitive loads draw much higher current at turn-on than during steady-state operation:

**DC motors:** inrush current =  $V_{\text{supply}}/R_{\text{armature}}$ , typically 5–10× the running current. A motor that runs at 2 A may draw 15 A at startup. The MOSFET, wiring, and fuse must handle this inrush without tripping or failing.

**Incandescent lamps:** cold filament resistance is  $\sim 1/10$  of hot resistance. A 100 W lamp (0.83 A at 120 V running) draws  $\sim 8$  A at turn-on for the first 100 ms.

**Capacitive loads:** charging a capacitor bank produces a current spike  $I = V/R_{\text{wire}}$ , limited only by the wiring resistance. A 1000  $\mu\text{F}$  capacitor charged through 0.1  $\Omega$  of wiring from 12 V: peak current = 120 A for a few microseconds. This can weld relay contacts or blow fuses.

**Solutions:** soft-start circuits (ramp the PWM duty cycle from 0 to target over 0.5–2 s), NTC inrush limiters (thermistors that have high resistance when cold and low resistance when hot), pre-charge resistors (switched out after initial charging), and current-limiting gate drivers.

## 16.25 Safety Considerations for High-Power Circuits

**Stored energy:** capacitors store energy  $E = \frac{1}{2}CV^2$ . A 1000  $\mu\text{F}$  capacitor at 400 V stores 80 J, enough to cause serious injury. Capacitors in motor drives and power supplies retain lethal charge for minutes after power-off. Always verify discharge before touching.

**Arc flash:** at voltages above 48 V DC or 30 V AC, an arc can sustain across a small gap (broken wire, relay contact). Arc flash releases intense heat and UV radiation. Use appropriate PPE (safety glasses minimum) when working with circuits above these thresholds.

**Grounding and isolation:** all exposed metal enclosures must be grounded (connected to the safety ground conductor) to prevent electric shock if an internal fault energizes the enclosure. Use fuses or circuit breakers sized for the wiring, not just the load, to prevent fire from a short circuit.

**MEGN 300 safety rule:** circuits operating above 48 V DC or connected to AC mains must be reviewed by the instructor before energizing. All high-current circuits ( $> 5$  A) must include a fuse within 15 cm of the power source.

## 16.26 Motor Selection for MEGN 300 Projects

**DC brushed motors:** simple (two wires), speed proportional to voltage, reversible by polarity swap, easily controlled by PWM through a single MOSFET (one direction) or H-bridge (both directions). Drawback: brushes wear, generate EMI, and limit speed. Use for: pumps, fans, linear actuators, and simple drive systems.

**DC brushless (BLDC):** higher efficiency, longer life, less EMI. Require electronic commutation (ESC or motor driver IC). Cannot be driven by a simple MOSFET. Use for: high-performance drives, drones, precision positioning.



**Stepper motors:** precise angular positioning without feedback (open-loop). 200 steps/revolution (1.8°C/step) standard. Driven by dedicated stepper driver (A4988, DRV8825). Low cost, high torque at low speed, easy position control. Use for: 3D printers, CNC motion, laboratory positioning stages.

**Servo motors:** DC motor + encoder + PID controller in a closed-loop package. Precise position and speed control. Standard hobby servos accept a PWM signal (1–2 ms pulse width at 50 Hz). Industrial servos use CAN, EtherCAT, or analog  $\pm 10$  V command. Use for: robotic joints, valve actuators, camera gimbals.

**Selection criteria:** (1) required torque and speed (check the motor's torque-speed curve), (2) voltage and current (must match available power supply and switching devices), (3) size and weight, (4) control complexity (brushed DC is simplest; BLDC requires a driver), (5) lifetime requirement (brushed: 1000–5000 hours; brushless: 20,000+ hours).

## 16.27 Power Electronics Thermal Design

Every switching device dissipates power as heat. The thermal design must ensure the junction temperature stays below the maximum rating:

$$T_j = T_{\text{ambient}} + P_{\text{diss}} \times (R_{\theta,JC} + R_{\theta,CS} + R_{\theta,SA}) \quad (16.3)$$

where  $R_{\theta,JC}$  is junction-to-case (from datasheet),  $R_{\theta,CS}$  is case-to-sink (depends on thermal interface:  $\sim 0.5^\circ\text{C}/\text{W}$  with thermal paste,  $\sim 2^\circ\text{C}/\text{W}$  with bare contact), and  $R_{\theta,SA}$  is sink-to-ambient (from heatsink datasheet).

Example: IRLZ44N MOSFET ( $R_{\theta,JC} = 1.5^\circ\text{C}/\text{W}$ ), thermal paste ( $R_{\theta,CS} = 0.5$ ), switching 5 A with  $R_{DS(on)} = 0.022\ \Omega$ :  $P = 5^2 \times 0.022 = 0.55\ \text{W}$ . Without heatsink ( $R_{\theta,JA} = 62^\circ\text{C}/\text{W}$ ):  $T_j = 25 + 0.55 \times 62 = 59^\circ\text{C}$  (safe,  $< 175^\circ\text{C}$  limit). At 20 A:  $P = 8.8\ \text{W}$ ,  $T_j = 25 + 8.8 \times 62 = 571^\circ\text{C}$  (destroyed!). Need a heatsink:  $R_{\theta,SA} < (175 - 25)/8.8 - 2 = 15^\circ\text{C}/\text{W}$ .

## 16.28 DC-DC Converters: Buck and Boost Regulators

The switching transistors and PWM concepts covered earlier in this chapter have a direct application beyond motor control: DC-DC power conversion. Most instrumentation systems require multiple voltage rails (3.3 V for the MCU, 5 V for sensors, 12 V or 24 V for actuators) from a single source. Linear regulators (LDOs) can step voltage down, but they dissipate the voltage difference as heat: a 12 V to 3.3 V LDO wastes 72% of the input power. Switching regulators solve this by rapidly chopping the input voltage and using an inductor to transfer energy efficiently, achieving 85–95% efficiency.

### 16.28.1 Buck Converter (Step-Down)

A buck converter produces an output voltage lower than the input. The core circuit has four elements: a switching MOSFET, a diode (or synchronous MOSFET), an inductor, and an output capacitor. The MOSFET switches at 100 kHz–2 MHz with a duty cycle  $D$ . During the ON phase, current flows through the MOSFET and inductor to the load, storing energy in the inductor's magnetic field. During the OFF phase, the inductor's stored energy drives current through the diode to the load, maintaining continuous current flow.

The output voltage is controlled by the duty cycle:

$$V_{\text{out}} = D \times V_{\text{in}}, \quad D = \frac{V_{\text{out}}}{V_{\text{in}}} \quad (16.4)$$

For a 12 V to 3.3 V conversion:  $D = 3.3/12 = 0.275$  (27.5% duty cycle). The MOSFET is ON for 27.5% of each switching period and OFF for 72.5%. Efficiency is typically 85–95%, meaning only 5–15% of the input power is wasted as heat, compared to 72% for an LDO doing the same conversion.

**Common buck converter ICs for student projects:** LM2596 (3 A, adjustable, through-hole friendly), MP1584 (3 A, compact module), LM3671 (600 mA, ultra-compact for battery applications).

#### When to Use a Buck vs. an LDO

Use an LDO when: (1) the voltage drop is small ( $V_{\text{in}} - V_{\text{out}} < 2 \text{ V}$ ), (2) current is under 500 mA, (3) you need very low output noise (analog sensor circuits, precision ADCs), or (4) simplicity matters (an LDO needs only two capacitors). Use a buck converter when: (1) the voltage drop is large ( $> 2 \text{ V}$ ), (2) current exceeds 500 mA, (3) efficiency matters (battery-powered systems), or (4) the heat from an LDO would be problematic. Many systems use both: a buck to step 12 V down to 5 V efficiently, then an LDO to produce a clean 3.3 V from that 5 V rail.

### 16.28.2 Boost Converter (Step-Up)

A boost converter produces an output voltage higher than the input. The topology reverses the buck: the inductor is on the input side, the MOSFET shorts the inductor to ground during the ON phase (storing energy), and during the OFF phase the inductor's energy adds to the input voltage and charges the output capacitor through the diode.

$$V_{\text{out}} = \frac{V_{\text{in}}}{1 - D} \quad (16.5)$$

For a 3.7 V lithium cell boosted to 5 V:  $D = 1 - 3.7/5 = 0.26$  (26% duty cycle). As duty cycle approaches 1.0, the theoretical output approaches infinity, but practical limits (inductor saturation, diode losses, parasitic resistance) restrict useful boost ratios to about 4:1.

**Applications in MEGN 300:** powering a 5 V sensor system from a single 3.7 V lithium cell, generating a 12 V rail for relay coils from a 5 V USB supply, and driving LED strings that require higher voltage than the available supply.

### 16.28.3 Buck-Boost Converter

A buck-boost converter can produce an output voltage either higher or lower than the input. This is essential when the input varies across the output target: a lithium battery ranges from 4.2 V (fully charged) to 3.0 V (discharged). If the system needs 3.3 V, neither a pure buck nor a pure boost works across the full range. A buck-boost handles both conditions seamlessly.

The SEPIC (Single-Ended Primary-Inductor Converter) is a popular buck-boost topology that produces a non-inverted output with good regulation. Common ICs: TPS63000 series (Adjustable, 1.8–5.5 V output, 96% peak efficiency).

### 16.28.4 Switching Regulator Noise

The main disadvantage of all switching regulators is output ripple and electromagnetic interference (EMI). The rapid switching (100 kHz+) generates noise at the switching frequency and its harmonics. This noise can corrupt sensitive analog measurements.

Mitigation strategies: (1) add an LC output filter (extra inductor + capacitor) after the switching regulator, (2) use an LDO as a post-regulator to clean up the output for analog circuits, (3) keep switching regulator traces physically separated from analog signal traces on the PCB, and (4) use a continuous ground plane under the switching regulator with short, wide power traces. For further layout best practices, consult the grounding and EMI guidelines in Chapter 8 (p. 80).

#### WE ThermoRig: Multi-Rail Power Architecture

The ThermoRig uses a 12 V wall adapter as its primary source. A buck converter (LM2596 module) steps 12 V down to 5 V at up to 2 A for the sensor power rail (85% efficient, 0.3 W waste heat vs. 2.6 W for an LDO). An LDO (AMS1117-3.3) then produces 3.3 V from the 5 V rail for the ESP32 (66% efficient, but only 300 mA, so waste heat is 0.5 W, manageable). The 12 V rail directly powers the heater SSR control and the cooling fan. Total power architecture: three voltage rails from one input, with the high-current conversion handled by the switching regulator and the noise-sensitive MCU rail cleaned up by the LDO.

#### Requirements Mapping: Power Conversion

“The power supply system shall convert the 12 VDC input to a regulated  $5.0\text{ V} \pm 3\%$  rail at up to 2 A continuous.” “The 3.3 V MCU rail shall have output ripple less than 30 mV peak-to-peak measured at the ESP32 power pins.” “The power supply system shall achieve a minimum overall efficiency of 80% at full rated load.” “All switching regulator modules shall include input and output capacitors per the manufacturer’s reference design.”

## 16.29 Functional Safety: Fail-Safes and Emergency Stops

### 16.29.1 What Happens When the Controller Fails?

Every automation system must answer this question: if the microcontroller crashes, the software enters an infinite loop, the communication link drops, or the power supply glitches, what happens to the actuators?

If the heater stays ON at 100% power because the MCU froze: the system overheats, potentially causing fire, burns, or property damage. If the motor continues running because the stop command was never sent: the mechanism can drive into a hard stop, destroying gears, bending shafts, or ejecting workpieces.

**The fundamental principle:** the system must always transition to a safe state when control is lost. The safe state is application-specific: for a heater, safe means OFF. For a vehicle brake, safe means ENGAGED. For an emergency ventilation system, safe means ON. Define the safe state for every actuator in your system during the requirements phase.

### 16.29.2 Fail-Safe Design Patterns

**Normally-open (NO) relay/contactor:** the actuator is powered through a relay that is held closed by the controller’s “enable” signal. If the controller loses power or crashes, the relay opens

(spring-return), cutting power to the actuator. This is the Master Control Relay (MCR) pattern and is the standard for industrial safety circuits.

Implementation for MEGN 300: connect the heater or motor power through a relay. The relay coil is driven by a GPIO pin through a MOSFET. The firmware keeps the relay energized during normal operation. If the MCU resets, the GPIO defaults to LOW (output disabled), the MOSFET turns OFF, the relay opens, and the heater is de-energized. The system fails safe without any software action.

**Watchdog timer:** a hardware timer that must be periodically reset (“kicked”) by the firmware. If the firmware crashes or enters an infinite loop and stops kicking the watchdog, the timer expires and forces a system reset. The ESP32 has a built-in watchdog with configurable timeout (1–60 s). After reset, the firmware initializes all outputs to the safe state before resuming normal operation.

**Hardware E-Stop:** a physical emergency stop button (large, red, mushroom-head, per IEC 60947-5-5) that cuts power to all actuators independently of the controller. The E-Stop circuit is wired in series with the MCR and is always hardwired (never software-controlled). Pressing the E-Stop physically opens the relay, regardless of the controller state. The button latches in the pressed position; the operator must deliberately release it (twist to reset) before the system can restart.

#### Software Cannot Be the Last Line of Defense

A software-only safety system is not a safety system. Software crashes, firmware has bugs, and communication links drop. The E-Stop, the MCR, and the watchdog timer are hardware mechanisms that function independently of software. In professional automation (IEC 61508, ISO 13849), the safety function must be implemented in hardware that is separate from and independent of the control system. For MEGN 300 projects: at minimum, include a physical power switch (toggle or E-Stop button) that cuts actuator power independently of the MCU.

### 16.29.3 Safety Integrity Levels (Conceptual)

The international standard IEC 61508 defines Safety Integrity Levels (SIL 1–4) that quantify the required reliability of safety functions. SIL 1: probability of dangerous failure  $< 10^{-1}$  per demand ( $< 10\%$  chance of the safety function failing when needed). SIL 4:  $< 10^{-4}$  ( $< 0.01\%$ ). Higher SIL requires more rigorous design, redundancy, and testing.

MEGN 300 projects do not require formal SIL assessment, but understanding the concept demonstrates professional awareness. A single E-Stop relay with no redundancy is approximately SIL 1. Adding a second, independent relay (both must be energized for the actuator to operate) approaches SIL 2.

### 16.29.4 Practical Implementation for GreenShield Projects

Every MEGN 300 project with actuators (heaters, motors, pumps, solenoids) shall include:

- (1) A physical power disconnect (switch, button, or E-Stop) that cuts power to all actuators independently of the MCU.
- (2) A watchdog timer (ESP32 built-in) that resets the system if firmware hangs for more than 5 s.
- (3) Software current and temperature limits that de-energize actuators if readings exceed safe thresholds ( $> 150\%$  of normal operating values).
- (4) A “safe state” initialization routine that sets all outputs to OFF on startup, before any control logic executes.

## 16.30 Practice Questions

1. Your MCU (3.3 V GPIO, 10 mA max) must switch a 12 V, 2 A DC motor. Design the switching circuit using an N-channel MOSFET. Specify the MOSFET selection criteria and include flyback protection.
2. Explain why you cannot connect a 120 VAC heater directly to a MOSFET, and describe how you would control it instead.
3. A solenoid draws 500 mA at 24 V. The control MOSFET opens in  $1\text{ }\mu\text{s}$ . If the solenoid inductance is 50 mH, what voltage spike would occur without a flyback diode?

### 16.30.1 Answers

1. Select a logic-level N-channel MOSFET (e.g., IRLZ44N:  $V_{th} = 1.0\text{--}2.0\text{ V}$ ,  $R_{DS(on)} = 0.022\text{ }\Omega$  at  $V_{GS} = 4.5\text{ V}$ ,  $I_D = 47\text{ A}$ ). Connect: drain to motor negative, source to ground, gate to MCU GPIO through a  $100\text{ }\Omega$  resistor (limits gate charge current). Add a  $10\text{ k}\Omega$  pull-down from gate to source (ensures MOSFET stays off when MCU is in reset). Flyback diode: 1N5819 Schottky (40 V, 1 A) across motor terminals (cathode to +12 V, anode to drain). Power dissipation:  $2^2 \times 0.022 = 0.088\text{ W}$ ; no heatsink needed.
2. MOSFETs switch DC only (they conduct in one polarity). For 120 VAC, use: (a) an electromechanical relay with a MOSFET driving the coil, or (b) a solid-state relay (SSR) rated for the voltage and current. The SSR uses a TRIAC internally that handles AC polarity reversal. Ensure the SSR is rated for 120 VAC and the full heater current with derating.
3.  $V = L \times dI/dt = 0.050 \times (0.500/0.000001) = 25,000\text{ V}$ . This 25 kV theoretical spike (in practice clamped by parasitic capacitance and eventual breakdown) far exceeds any MOSFET's voltage rating. A flyback diode clamps it to approximately  $24 + 0.3 = 24.3\text{ V}$ .

## Chapter 17

# Systematic Debugging and Troubleshooting

### When to Read This Chapter

**Module 8D / Design Challenge:** Read before the integration phase of the design challenge. The debugging pyramid and signal walk protocol are your primary tools when things do not work. Return to this chapter any time a lab produces unexpected results. **Related:** Circuit fundamentals in Chapter 14 (p. 144); SNR and grounding in Chapter 8 (p. 80).

### Read This Chapter First

Read this chapter **before your first lab session**. The debugging methodology here will save you more time than any other single chapter in this document. Students who read this chapter first report spending 60–70% less time on integration problems.

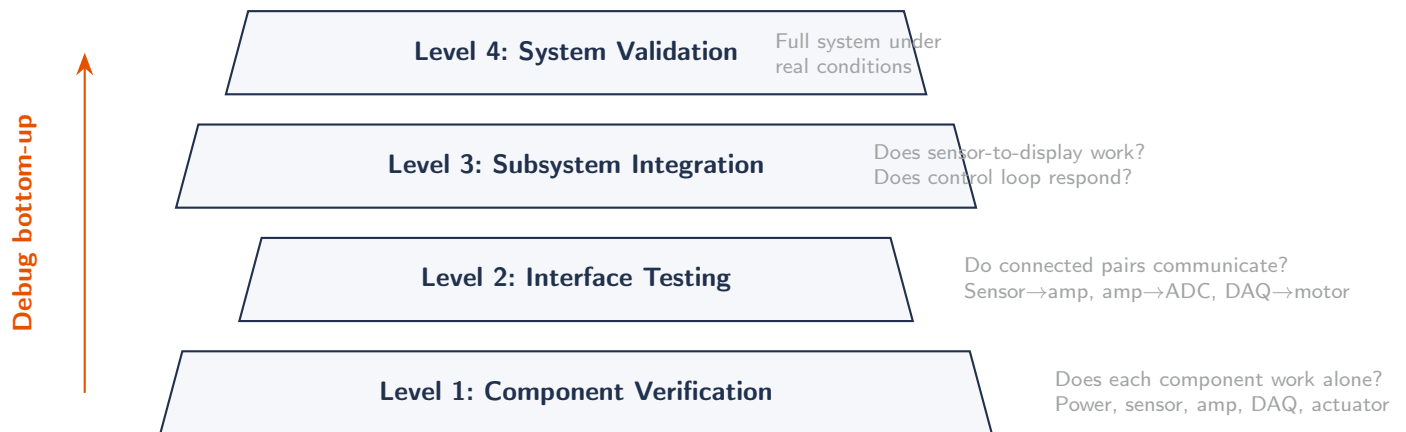


Figure 17.1: The debugging pyramid. Always start at Level 1 (component verification) and work upward. Skipping levels is the most common cause of wasted debugging time.

A working system is never assembled all at once. It is built in layers, verified at each layer, and only then combined into the full system. Debugging is not what you do when something goes wrong; it is the disciplined verification process you follow at every stage so that when something does go wrong, you can find it in minutes instead of hours. This chapter establishes the methodology: start at the lowest level, verify each component in isolation, then work upward through subsystems to the integrated system. Students who skip this process and assemble everything at once (“big-bang integration”) consistently spend 5–10× more time debugging than students who follow the bottom-up approach.

## 17.1 Why Bottom-Up Debugging Matters

Consider a system with five components: a sensor, an amplifier, an ADC, a microcontroller running firmware, and an actuator with its driver. If you wire everything together and power on, and the system does not work, the fault could be in any of the five components, any of the four interfaces between them, the power supply, the wiring, or the firmware. That is at least 15 possible failure locations. You have no way to isolate the problem without disconnecting things, which is exactly what you should have done from the start.

Bottom-up debugging reduces the search space at every step. If you verify the sensor alone and it works, the sensor is eliminated. If you verify the amplifier with a known input and it works, the amplifier is eliminated. By the time you connect the full chain, you have already verified every component and most interfaces. If the system fails at integration, the fault is almost certainly at the most recently added interface, not buried deep in a component you already tested.

### The Debugging Pyramid

**Level 1: Component verification.** Test each component in isolation with known inputs and expected outputs. Does the sensor produce the right voltage? Does the amplifier have the correct gain? Does the MOSFET switch? Does the firmware blink an LED?

**Level 2: Interface verification.** Connect two adjacent components and verify the signal crosses the boundary correctly. Does the amplifier correctly amplify the sensor output? Does the ADC read the correct voltage from the amplifier? Does the MCU command produce the expected driver output?

**Level 3: Subsystem verification.** Connect a functional chain (e.g., sensor → amplifier → ADC → MCU display) and verify end-to-end signal flow. Does the displayed value match the physical input?

**Level 4: System integration.** Connect all subsystems and verify the complete system. Does the controller read the sensor, compute the correct output, and drive the actuator to the desired setpoint?

Never advance to the next level with failures at the current level. Failures compound; a wiring error at Level 1 that is not caught becomes an inexplicable intermittent failure at Level 4 that takes hours to trace.

## 17.2 Debugging Hardware

Hardware debugging follows a systematic process. Resist the urge to start changing things randomly; that creates new problems faster than it solves old ones.

### 17.2.1 Visual Inspection

Before applying power, inspect the physical assembly. Check for: solder bridges (adjacent pads connected by a blob of solder, especially on fine-pitch ICs), cold joints (dull, grainy solder that did not flow properly), missing components, wrong component orientation (electrolytic capacitors, diodes, ICs), loose wires, and pinched or abraded insulation. A 10× magnifier or loupe is essential. Many hardware failures are visible before any electrical test.



### 17.2.2 Continuity and Short-Circuit Check

With power off, use the multimeter's continuity mode to verify: (1) power and ground are not shorted (beep between VCC and GND means a dead short that will destroy the supply or blow a fuse), (2) all ground connections are continuous (no open ground paths), and (3) signal connections reach their intended destinations (probe both ends of each wire or trace).

### 17.2.3 Power-Up Sequence

Apply power through a current-limited bench supply. Set the current limit to 50 mA initially. If the circuit draws more than expected, something is wrong; do not increase the limit until you find out why. Monitor the supply current as you increase the voltage to the operating level. A healthy circuit draws a predictable current; a fault draws either zero (open connection) or excessive current (short circuit). Measure every power rail voltage with a multimeter and compare to the expected values before connecting any ICs or modules.

### 17.2.4 Signal Tracing

Once power is verified, inject a known signal at the input and trace it through each stage of the signal chain with an oscilloscope or multimeter. At each node, compare the measured signal to the expected value (calculated from the circuit design). When the measured value deviates from the expected value, you have localized the fault to the stage between the last good node and the first bad node.

#### The Signal Walk

Start at the sensor (or a signal generator substituting for the sensor). Measure the output voltage. Move the probe one stage downstream: after the voltage divider, after the amplifier, at the ADC input pin. At each point, verify the signal is correct in amplitude, offset, and frequency content. When you find the first point where the signal is wrong, the fault is between that point and the previous (good) point. This narrows the search to one component or one interface.

### 17.2.5 Common Hardware Faults and Their Signatures

**Open connection** (broken wire, cracked solder joint, missing via): signal is present on the upstream side, absent or floating on the downstream side. The oscilloscope shows the downstream node either at ground (pulled down by a load) or floating with 60 Hz pickup.

**Short circuit** (solder bridge, pinched wire): two nodes that should be at different voltages are at the same voltage. The supply current is higher than expected. If VCC is shorted to GND, the current limit on the bench supply prevents damage (this is why current limiting is mandatory).

**Wrong component value** (wrong resistor, wrong capacitor): the circuit functions but with incorrect gain, incorrect cutoff frequency, or incorrect bias point. Compare measured values at each node to calculated values from the schematic.

**Component installed backwards** (electrolytic capacitor, diode, IC): behavior depends on the component. A reversed electrolytic may heat up, swell, or vent. A reversed diode conducts in the wrong direction (appears as a short in one direction). A reversed IC draws excessive current and may be destroyed. Always verify orientation before power-up.

**Dead IC** (ESD damage, overvoltage, overheating): outputs do not respond to inputs. Supply current may be abnormally high or low. Replace the IC with a known-good part to confirm.



**Change One Thing at a Time**

The cardinal rule of debugging: change only one variable between tests. If you swap a component AND change a wire AND modify the firmware simultaneously, and the system starts working, you do not know which change fixed it. Worse, one of the other changes may have introduced a new latent fault that will appear later. Make one change, test, record the result, then decide the next change.

## 17.3 Debugging Software and Firmware

Firmware bugs are at least as common as hardware bugs in MEGN 300 projects, and they interact with hardware in ways that create confusing symptoms. A timing bug in the ADC read routine can look like a noisy sensor. A missing pullup configuration can look like a dead I2C bus.

### 17.3.1 Incremental Development

Write and test firmware in small, testable increments. The sequence should mirror the hardware debugging pyramid:

**Step 1: Blink.** Verify the toolchain, upload process, and basic MCU function. If the LED blinks at the expected rate, the MCU is running, the clock is correct, and the upload path works.

**Step 2: Serial output.** Add serial print statements to confirm the firmware reaches each section of code. Print variable values, state machine transitions, and function entry/exit markers. This is the firmware equivalent of the oscilloscope probe.

**Step 3: Single peripheral.** Initialize and test one peripheral at a time. Read a single ADC channel and print the raw value. Toggle a single GPIO and verify with a multimeter. Send a single I2C command and verify the response. Do not initialize multiple peripherals until each one works individually.

**Step 4: Peripheral combinations.** Add peripherals one at a time to the working base. After each addition, verify that previously working peripherals still function correctly (regression testing).

**Step 5: Control logic.** Add the control algorithm (PID, state machine, decision logic) only after all I/O peripherals are verified. If the control loop misbehaves, you know the fault is in the algorithm, not in the I/O.

### 17.3.2 Common Firmware Bugs

**Wrong pin assignment:** GPIO number in code does not match the physical wiring. Symptoms: output has no effect, input reads constant value. Fix: print the pin number and verify against the wiring diagram.

**Missing initialization:** peripheral not configured before use. Symptoms: ADC reads zero or random values, I2C bus hangs, PWM output is static. Fix: verify every peripheral has its initialization call before the main loop.

**Blocking calls in the main loop:** using `delay()` stops all processing. Symptoms: system is unresponsive, sensor reads are stale, PID output updates are irregular. Fix: use `millis()`-based timing; check elapsed time each iteration and act only when the interval has passed.

**Integer overflow:** a 16-bit counter that wraps at 65,535, or an 8-bit variable that truncates values above 255. Symptoms: values jump unexpectedly, timing wraps, calculations produce wrong results. Fix: use appropriately sized data types (`uint32_t` for `millis`, `float` for analog values).

**Race conditions:** two interrupts or tasks accessing the same variable without synchronization. Symptoms: occasional corrupted readings, intermittent glitches. Fix: disable interrupts briefly while reading/writing shared variables, or use `volatile` qualifier and atomic operations.

**I2C bus hang:** a sensor that does not respond holds the SDA line low, preventing further communication. Symptoms: all I2C communication stops after a failed transaction. Fix: implement a bus recovery routine (toggle SCL 9 times to release SDA), and use timeouts on all I2C reads.

#### The Serial Monitor Is Your Oscilloscope for Code

Print everything during development: ADC raw values, computed engineering units, PID error and output, state machine transitions, loop execution time. When behavior is unexpected, the serial log tells you exactly which variable has the wrong value and when it went wrong. Remove or reduce print statements only after the system is fully verified (excessive printing slows the loop).

### 17.3.3 Using the LabVIEW Debugging Tools

LabVIEW provides built-in debugging tools that are more powerful than serial printing:

**Highlight Execution** (light bulb icon): animates dataflow on the block diagram, showing values moving along wires in real time. Useful for understanding execution order and spotting unexpected data paths. Warning: slows execution dramatically; do not use for timing-critical debugging.

**Probes:** right-click any wire and select “Probe” to watch its value update in real time without stopping execution. Place probes at the output of every major processing stage to monitor the signal chain live.

**Breakpoints:** pause execution at a specific node. Inspect all wire values at that moment. Step forward one node at a time to trace the exact point where values diverge from expectations.

**Error clusters:** the pink error wire that chains through DAQmx functions carries detailed error codes and descriptions. Always wire the error output to a “Simple Error Handler” outside the loop. If you leave error wires unwired, errors propagate silently and produce inexplicable behavior downstream.

## 17.4 Debugging Integrated Systems

Once individual hardware and software components are verified, integration debugging follows a structured protocol.

### 17.4.1 The Integration Test Sequence

1. **Power rail verification.** Before connecting any active components, verify all supply voltages under load. Connect a dummy load (a power resistor drawing the expected current) and measure each rail. Verify that the rails remain stable and within specification.
2. **Sensor-to-display path.** Connect only the sensor, its signal conditioning, and the ADC/MCU. Verify that a known physical input produces the correct displayed or logged value. This tests the entire measurement chain without any actuator complications.

3. **Command-to-actuator path.** Disconnect the sensor feedback. Send a fixed command (hard-coded PWM value, fixed relay state) and verify that the actuator responds correctly. This tests the output chain without feedback loop complications.
4. **Open-loop dry run.** Connect both paths but keep the controller in open-loop mode (manual setpoints). Vary the setpoint manually and observe both the actuator response and the sensor reading. Verify that the sensor correctly reflects the actuator's effect on the process.
5. **Closed-loop commissioning.** Enable the feedback controller (PID) with conservative gains ( $K_p$  at 25% of the expected value,  $K_i$  and  $K_d$  at zero). Gradually increase gains while monitoring stability. This is the final step, not the first.

### 17.4.2 Common Integration Failures

**Ground loops:** motor return current flows through the sensor ground path, injecting noise into the measurement. Symptom: sensor readings become noisy when the motor runs. Fix: star grounding (Chapter 14). Run separate ground conductors for sensor and motor circuits, joined at a single point near the power supply.

**Power supply sag (brown-out):** actuator inrush current (motor starting, relay pulling in) causes the supply voltage to dip momentarily, resetting the MCU. Symptom: MCU reboots when actuator activates. Fix: separate power rails for MCU and actuators, bulk capacitors ( $>470\ \mu\text{F}$ ) on the MCU rail, or a dedicated regulated supply for the MCU.

**EMI from switching:** PWM-driven motors and switching regulators generate high-frequency noise that couples into sensor signals through wiring or PCB traces. Symptom: sensor readings have high-frequency spikes synchronized with PWM switching. Fix: add snubber circuits on the motor, decouple the sensor supply, separate analog and digital wiring physically, use shielded cable for sensitive signals.

**Timing conflicts:** the firmware tries to read a sensor, update a display, and communicate over WiFi in the same loop iteration, and the total execution time exceeds the control loop period. Symptom: PID performance degrades, sensor readings are stale, communication drops. Fix: measure actual loop execution time (print `millis()` at start and end of each iteration); prioritize time-critical tasks (sensor read, PID compute, actuator write) and defer non-critical tasks (display update, data logging) to separate intervals.

**Feedback polarity error:** the sensor signal increases when the actuator output increases, creating positive feedback instead of negative feedback. Symptom: the system immediately saturates (output goes to maximum or minimum and stays there). Fix: verify that increasing the controller output drives the process variable toward the setpoint. If the sensor reads higher when the actuator output is higher, the controller must decrease output as the process variable increases (negative feedback). Swap the sign of  $K_p$  or invert the error calculation.

### 17.4.3 The Five-Step Debugging Protocol

When an integrated system fails, follow this protocol before making any changes:

**Step 1: Reproduce.** Make the failure happen reliably. Note the exact conditions: what inputs, what state, what sequence of events. A failure you cannot reproduce is a failure you cannot systematically fix.

**Step 2: Isolate.** Disconnect subsystems one at a time until the failure stops. The last subsystem disconnected (or its interface) is the prime suspect. Alternatively, substitute a known-good signal (signal generator for the sensor, fixed command for the controller) to bypass suspect components.

**Step 3: Measure.** Use the oscilloscope, multimeter, and serial monitor to measure actual signals at the suspected fault location. Compare measured values to the expected values from your design calculations. The discrepancy between measured and expected is the clue.

**Step 4: Hypothesize and test.** Form a specific hypothesis (“the amplifier gain is wrong because  $R_f$  is the wrong value”) and design a test that confirms or refutes it (“measure  $R_f$  with a multimeter”). Do not guess randomly; each test should eliminate at least one hypothesis.

**Step 5: Fix and regression test.** Implement the fix. Verify that the original failure is resolved. Then re-run all previously passing tests to confirm the fix did not break anything else. A fix that solves one problem and creates two new ones is not a fix.

#### Document Every Debug Session

Keep a debug log: date, symptom observed, tests performed, measurements taken, hypothesis, fix applied, and result. This log is invaluable when a similar failure appears later (“we saw this before; it was a ground loop, see entry from March 3”). It also demonstrates professional engineering practice in your final report.

## 17.5 Debugging Tools and Their Proper Use

### 17.5.1 Multimeter

The first instrument you reach for. Measures DC/AC voltage, current, resistance, and continuity. Use it for: power rail verification, static signal levels, resistance checks, and continuity. Limitation: cannot capture transient events or waveform shape.

### 17.5.2 Oscilloscope

Essential for: viewing signal waveforms, measuring timing relationships, capturing transient events (glitches, spikes, ringing), verifying PWM duty cycle and frequency, diagnosing communication protocols (SPI clock, I2C timing). Learn to set the trigger correctly; an untriggered oscilloscope display is useless noise. Use the “Single” trigger mode to capture one-time events (power-on transients, fault spikes).

### 17.5.3 Logic Analyzer

For digital communication debugging (SPI, I2C, UART). Captures multiple digital signals simultaneously and decodes protocol frames. Many affordable USB logic analyzers (<\$20) work with free software (PulseView/sigrok). Use when: I2C devices are not responding, SPI data is corrupted, UART baud rate mismatch is suspected.

### 17.5.4 Bench Power Supply

Use the current-limit feature as a diagnostic tool, not just a safety feature. A circuit that draws 50 mA normally but suddenly draws 500 mA has a fault. The current limit prevents damage while you investigate. Vary the supply voltage slowly and observe when the circuit starts and stops functioning; this reveals voltage margin issues.

### 17.5.5 Serial Terminal / Data Logger

For firmware debugging: capture timestamped variable values over extended periods to identify intermittent failures, drift, and timing anomalies. Use a serial terminal (PuTTY, screen, Arduino Serial Monitor) for real-time observation, and log to a file for post-analysis.

## 17.6 Building a Debugging Mindset

Effective debugging is a skill that improves with deliberate practice. Five principles distinguish expert debuggers from novices:

- 1. Expect problems.** No circuit works on the first try. No firmware is bug-free on the first compile. Plan for debugging time in your schedule. A project plan that allocates zero time for debugging will consume all available time for debugging.
- 2. Trust your measurements, not your assumptions.** “The sensor should output 2.5 V” is an assumption. “The multimeter reads 0.3 V at the sensor output” is a measurement. When assumptions and measurements disagree, the measurement wins. Every time.
- 3. Binary search.** When the signal chain has  $N$  stages, do not check them in sequence (worst case:  $N$  checks). Measure at the midpoint first. If the signal is correct there, the fault is downstream; if not, it is upstream. Recurse. This halves the search space with each measurement, finding the fault in  $\log_2(N)$  checks.
- 4. Rubber duck debugging.** Explain the problem aloud (to a teammate, a rubber duck, or an empty chair). Articulating the problem forces you to organize your understanding, and the act of explaining often reveals the assumption you have been making that is wrong.
- 5. Walk away.** If you have been debugging the same problem for more than 30 minutes without progress, take a 10-minute break. Fatigue causes fixation on a single hypothesis. A fresh perspective (yours after a break, or a teammate’s) often spots the obvious error that tunnel vision concealed.

#### Requirements Mapping: Debugging and Verification

“Each subsystem shall be individually verified with documented test results before integration into the next-higher assembly.” “The debug log shall record all faults encountered, diagnostic steps performed, root cause identified, and corrective actions taken during integration.” “The system integration sequence shall follow a bottom-up protocol with defined entry and exit criteria at each level.” “All power rails shall be verified under load before active components are connected.”

## 17.7 Practice Questions

1. You connect your complete system (sensor, amplifier, ADC, MCU, motor driver, motor) and the motor runs at full speed regardless of the sensor input. Describe the systematic debugging steps you would follow to isolate the fault, starting from the debugging pyramid.
2. Your thermocouple readings are accurate when the motor is off, but show  $\pm 5^\circ\text{C}$  noise when the motor is running. The noise appears as 25 kHz spikes on the oscilloscope. What is the likely root cause, and what are three mitigation strategies?
3. A teammate says “I changed the wiring and the firmware and replaced the op-amp, and now it works.” Why is this a problem, and what should they have done differently?

### 17.7.1 Answers

1. Start at Level 2 (interface verification). Disconnect the motor driver from the MCU. Measure the MCU's PWM output pin with an oscilloscope: is the duty cycle varying with sensor input? If yes, the fault is downstream (driver or motor). If the PWM output is stuck at 100%, the fault is upstream. Next, disconnect the sensor and substitute a known voltage from a bench supply: does the MCU PWM output change? If yes, the sensor path is the problem. If the PWM output is still stuck at 100% with a known input, the fault is in the firmware (likely the PID output is saturated, the PWM pin is misconfigured, or the control loop has positive feedback). Isolate by checking one variable at a time.
2. The 25 kHz frequency matches the PWM switching frequency of the motor driver. The motor's switching current is coupling into the thermocouple signal path, likely through a ground loop or shared ground conductor. Three mitigations: (1) Star grounding: run separate ground conductors for the thermocouple amplifier and the motor driver, joined at a single point near the supply. (2) Add a low-pass filter (RC,  $f_c \approx 100$  Hz) at the amplifier input to reject 25 kHz noise. (3) Use twisted-pair wire for the thermocouple leads and route them physically away from the motor power wiring.
3. They changed three variables simultaneously. The system works, but they do not know which change fixed the problem. Worse, one or two of the changes may have introduced latent faults that will appear later. The correct approach: revert all three changes, then apply them one at a time, testing after each. The first change that fixes the system is the actual solution. The other changes should be evaluated independently to confirm they do not introduce new problems.

# Why Instrumentation Projects Fail

---

The following failure patterns are drawn from over a decade of observing student projects in instrumentation, controls, and capstone design courses. They are listed in approximate order of frequency.

## 1. Aliasing from Insufficient Sampling or Missing Anti-Alias Filter

The most common technical failure. Students sample at a rate barely above the signal of interest, observe strange low-frequency artifacts in the data, and spend hours debugging the sensor when the problem is in the DAQ configuration. The fix is straightforward: sample at  $5\text{--}10\times$  the highest frequency of interest and place an analog low-pass filter before the ADC with  $f_c$  at or below  $f_s/2$ .

## 2. Ground Loops and Noise from Poor Wiring Practice

The second most common failure. Symptoms: noisy sensor readings that change when you touch the wires, 60 Hz interference patterns in FFT plots, readings that shift when a motor turns on. The root cause is almost always daisy-chained ground connections or signal and power wires running in parallel. Star grounding, twisted-pair signal wiring, and physical separation of power and signal conductors eliminate most noise problems without expensive shielding.

## 3. Sensor Selected Without Checking Output Compatibility

Students select a sensor from an online tutorial without verifying that the output voltage range matches the ADC input range, that the output impedance is compatible with the ADC input impedance, or that the sensor's response time is fast enough for the measurement. A 10 V sensor connected to a 3.3 V ADC saturates the reading and may damage the ADC. A high-impedance sensor connected to a low-impedance ADC input produces a severe loading error.

## 4. PID Tuned Without Understanding the Process

Students type Z-N tuning parameters into a PID block, observe overshoot or oscillation, and respond by randomly adjusting gains without a systematic approach. The Z-N method produces aggressive starting parameters that are intended to be refined. Begin with proportional-only control to understand the process response, then add integral action slowly to eliminate steady-state error, and add derivative only if the process dynamics require damping.

## 5. Uncertainty Analysis Omitted or Applied Incorrectly

Raw measurements reported without uncertainty bounds are scientifically meaningless, yet many students skip uncertainty analysis entirely or apply the formulas incorrectly (most commonly: adding uncertainties linearly instead of in quadrature, or confusing precision and accuracy). Every reported measurement should include an uncertainty estimate following the GUM framework.



## 6. Filter Design Based on Rules of Thumb Instead of Requirements

Students apply a “standard” 10 Hz low-pass filter to every signal without analyzing what frequencies are actually present, what the noise spectrum looks like, or what frequency content must be preserved. The result is either insufficient filtering (noise passes through) or excessive filtering (the signal of interest is attenuated or phase-shifted). Always start by examining the signal’s frequency content (FFT), then design the filter to preserve the signal band and reject the noise band.

## 7. Power Supply Inadequate for Actuator Loads

A bench supply or USB port that works fine with sensors alone browns out when a motor or heater activates, causing the MCU to reset. The fix: calculate total system current including actuator inrush, select a supply with 50% margin, and separate the actuator power rail from the sensor/MCU rail with independent regulation.

## 8. Documentation Insufficient for Reproduction

The system works on demo day, but the report lacks the wiring diagram, DAQ channel assignments, LabVIEW block diagram screenshots, calibration data, and sampling parameters needed for someone else to reproduce the results. If a competent peer cannot replicate your setup from your report alone, the documentation has failed.

## 9. Safety Ignored Until Something Breaks

No fuse on the power input, no flyback diode on the relay coil, no current limit on the bench supply. The first failure destroys a component (or several). Adding protection after a failure costs time and money that prevention would have avoided. Design the protection circuit first, then add the functional circuit inside the protected envelope.

## 10. Scope Creep and Feature Addition Without Requirements Traceability

Students add features (wireless data logging, color displays, additional sensors) that were not in the original requirements, consuming time that should have been spent on verification and documentation. Every addition should trace to a requirement; if there is no requirement, there should be no feature.



# Part IV

## Control Systems

# Chapter 18

## Open-Loop Control

### When to Read This Chapter

**Module 9:** Read this chapter first as an introduction to control systems. It establishes the vocabulary (plant, controller, setpoint, disturbance) and motivates why open-loop control alone is insufficient for most real systems. **Related:** Closed-loop fundamentals in Chapter 19 (p. 201); PID tuning in Chapter 20 (p. 211).

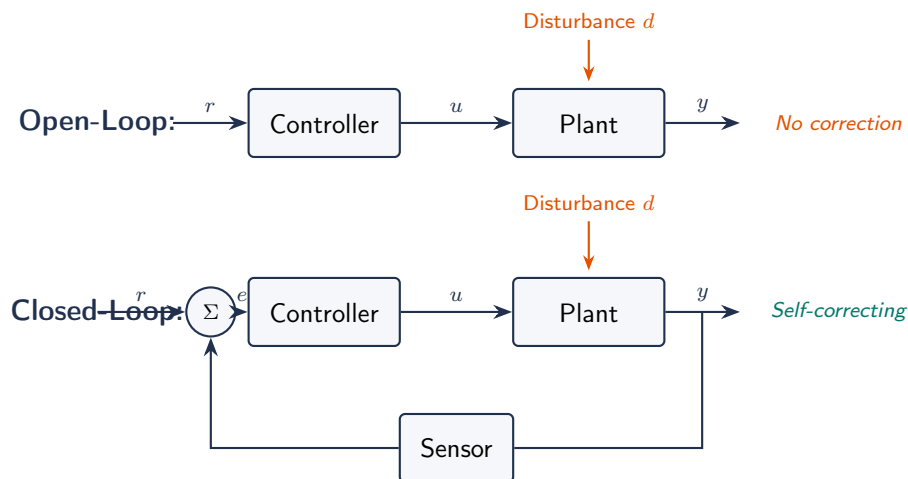


Figure 18.1: Open-loop vs. closed-loop control. In open-loop, disturbances cause uncorrected output errors. In closed-loop, the sensor feeds back the actual output, and the controller drives the error toward zero.

### 18.1 Definition

In open-loop control, the controller sends a command to the actuator without measuring the output. There is no feedback; the controller has no way to know if the desired outcome was achieved.

**Example:** a toaster. You set a timer (the command); the heating element runs for that duration regardless of how toasted the bread actually is. If the bread type, thickness, or initial temperature changes, the result changes, but the controller does not adapt.

### 18.2 Characteristics

- **Simple:** no sensor needed on the output; fewer components; lower cost.

- **Fast:** no processing delay from feedback.
- **No stability issues:** cannot oscillate (no feedback loop to create instability).
- **Cannot compensate for disturbances:** if the environment changes (load, temperature, friction), the output drifts from the desired value with no correction.
- **Accuracy depends on the model:** the controller must have a perfect model of the plant to achieve the desired output. Any model error becomes output error.

## 18.3 Feedforward Control

A refined form of open-loop control that measures the disturbance (not the output) and adjusts the command proactively. Example: measuring outdoor temperature and preemptively increasing heater power before the room cools down. Feedforward improves performance but still has no feedback on the actual output.

## 18.4 Understanding Open-Loop Control

In open-loop control, the controller sends a command to the actuator based on a model or schedule, with no measurement of the actual output. The system has no way to detect or correct errors. Examples: a toaster timer (runs for a fixed duration regardless of toast darkness), a washing machine cycle timer (runs predetermined durations for each phase), and a sprinkler timer (waters for a set time regardless of soil moisture).

Open-loop works when the relationship between input and output is well-characterized and disturbances are small or predictable. It is simple, cheap, and inherently stable (no feedback means no oscillation risk). However, it fails when disturbances are significant, when the plant model is inaccurate, or when precise output control is required.

## 18.5 Feedforward Control

Feedforward is an enhanced form of open-loop that measures the disturbance (not the output) and adjusts the control action proactively. Example: measuring outdoor temperature and adjusting the furnace output before the room temperature changes. Feedforward cannot correct for unmeasured disturbances or model errors, but it responds faster than feedback because it does not wait for the output to deviate.

In practice, feedforward is often combined with feedback: the feedforward handles the known, measurable disturbances (fast), while the feedback corrects for everything else (robust). This combined approach is standard in industrial process control.

## 18.6 Limitations of Open-Loop

**No disturbance rejection:** any unmodeled influence (load change, supply variation, environmental shift) directly affects the output with no correction.

**Sensitivity to model errors:** the accuracy of the output depends entirely on the accuracy of the model relating input to output. If the model is wrong, the output is wrong, and the system has no way to know.

**No steady-state accuracy guarantee:** drift, aging, and environmental changes cause the output to wander from the desired value over time.

## 18.7 When Open-Loop Is Appropriate

Despite its limitations, open-loop control is the right choice when: the cost of feedback sensors is prohibitive, the plant behavior is highly predictable and disturbances are negligible, the required accuracy is coarse (e.g., a traffic light timer), or when stability concerns make feedback dangerous (some chemical processes).

## 18.8 Feedforward Control

Feedforward measures the disturbance (not the output) and adjusts the control action proactively. Example: measuring outdoor temperature and adjusting furnace output before room temperature changes. Advantages: responds faster than feedback (does not wait for error). Limitations: cannot correct for unmeasured disturbances or model errors. In practice, feedforward is combined with feedback for optimal performance.

## 18.9 Calibration Tables as Open-Loop Control

A common form of open-loop control in instrumentation is the calibration table or lookup table. Rather than modeling the sensor's response analytically, the controller stores measured input-output pairs and interpolates between them. Example: a thermocouple's voltage-to-temperature relationship stored as a 100-entry table, with linear interpolation between entries. This is "open-loop" because it relies on the accuracy of the stored calibration data, with no feedback to verify the output.

## 18.10 State Machines as Open-Loop Controllers

Many laboratory instruments use state-machine controllers: a sequence of states (initialize, preheat, measure, cool down, report) with timed transitions. Each state commands specific actuator settings. The sequence runs to completion regardless of the process outcome. This is open-loop because the controller follows a predetermined script. Adding sensor checks that branch to error-handling states converts it to a hybrid open/closed-loop system.

## 18.11 When Open-Loop Fails

Example: you calibrate a heater to deliver 80 °C at 50% power. Initially, it works. Three months later, the ambient temperature drops from 22 °C to 10 °C, and the heater only reaches 68 °C. The open-loop controller has no way to detect or correct this. A closed-loop controller would measure the 68 °C output, compute a 12 °C error, and increase power automatically.

## 18.12 Mathematical Model of Open-Loop Systems

In open-loop control, the output  $Y(s) = G_p(s) \cdot G_a(s) \cdot U(s) + G_d(s) \cdot D(s)$  where  $G_p$  is the plant transfer function,  $G_a$  is the actuator,  $U$  is the command,  $G_d$  is the disturbance transfer function,

and  $D$  is the disturbance. The output depends on both the command and the disturbance, with no mechanism to separate or correct for the disturbance contribution.

For a linear system with known plant model:  $U = G_p^{-1} \cdot Y_{\text{desired}}$  (invert the plant model to compute the required command). This works perfectly if the model is exact and no disturbances exist. In practice, model uncertainty of  $\pm 10\%$  produces  $\pm 10\%$  output error, and disturbances add directly to the output.

## 18.13 Examples of Open-Loop Systems in Engineering

**CNC machine tool positioning:** the stepper motor receives a commanded number of steps, and the controller assumes the table moves exactly that distance. No position feedback (in basic systems). If the motor skips a step (due to excessive load or acceleration), the error accumulates permanently. High-end CNC machines add encoder feedback (closed-loop).

**Irrigation timer:** opens the water valve for a programmed duration. Does not measure soil moisture, rainfall, or evapotranspiration. Wastes water during rain and under-waters during heat waves. Smart irrigation systems add soil moisture sensors (closed-loop).

**Inkjet printer head positioning:** the carriage motor moves based on commanded pulses. Open-loop in the fast-scan direction (relying on motor accuracy). Closed-loop in the slow-scan direction (optical encoder on the paper feed roller).

**Drug delivery infusion pump:** delivers a programmed flow rate based on motor speed. Open-loop with respect to actual drug concentration in the patient's blood. Closed-loop drug delivery (measuring blood concentration and adjusting the rate) exists in research but is rare clinically due to sensor limitations.

## 18.14 Quantifying Open-Loop Performance

The performance of an open-loop system depends entirely on: (1) model accuracy: the relationship between command and output must be precisely characterized, (2) disturbance magnitude: smaller disturbances produce smaller output errors, (3) component repeatability: the actuator must produce the same output for the same command every time, (4) environmental stability: temperature, humidity, and other conditions must remain within the range over which the model is valid.

For the ThermoRig heater in open-loop mode: commanding 50% PWM duty cycle produces approximately  $65^\circ\text{C}$  at ambient  $22^\circ\text{C}$ . If the ambient temperature drops to  $15^\circ\text{C}$ , the steady-state temperature drops to approximately  $58^\circ\text{C}$  (a  $7^\circ\text{C}$  error). If the supply voltage drops from 12 V to 11 V (8% drop), the power drops by 16% (power  $\propto V^2$ ), and the temperature drops further. The open-loop system cannot detect or correct any of these deviations.

## 18.15 Feedforward Design Procedure

For measured disturbance  $d$  with known effect on the output: (1) measure  $d$  with a sensor. (2) Compute the required compensation:  $\Delta u = -G_d(s)/G_p(s) \cdot d$  (the feedforward transfer function). (3) Add  $\Delta u$  to the nominal command:  $u = u_{\text{nominal}} + \Delta u$ .

Example: the ThermoRig measures ambient temperature  $T_{\text{amb}}$  with a second thermocouple. The thermal model predicts that a  $1^\circ\text{C}$  drop in ambient requires 0.8% more heater power to maintain the setpoint. The feedforward controller adds  $0.8\% \times (T_{\text{amb,nominal}} - T_{\text{amb,measured}})$  to the duty cycle. This compensates for ambient temperature changes without waiting for the output temperature to deviate.

Combined feedforward + feedback: the feedforward handles the measured, predictable disturbance (ambient temperature) immediately, while the feedback (PID controller) corrects for unmeasured disturbances (supply voltage variation, heater degradation, model error). The result is faster disturbance rejection than feedback alone and more robust than feedforward alone.

## 18.16 Open-Loop Stability

Open-loop systems are always stable (in the BIBO sense) as long as the plant itself is stable. There is no feedback to create oscillation. This is a significant advantage in applications where stability is critical and the accuracy requirement is relaxed (e.g., a simple fan speed controller where  $\pm 10\%$  speed error is acceptable but oscillation would be unacceptable).

However, plants with integrators (e.g., liquid level in a tank with inflow but no outflow) are inherently unstable in open-loop: the level rises without bound unless the inflow is precisely balanced with the outflow. Such systems require closed-loop control.

## 18.17 Lookup Tables and Interpolation in Open-Loop Control

Many open-loop systems use precomputed lookup tables rather than mathematical models. For the ThermoRig in open-loop mode: measure the steady-state temperature at 10 duty cycle values (0%, 10%, 20%, ..., 100%) and store the results in a table. To achieve a desired temperature, look up the nearest duty cycle and interpolate linearly between table entries.

Limitations: (1) the table is valid only at the ambient temperature at which it was measured, (2) any change in heater resistance (aging), supply voltage, or thermal coupling invalidates the table, (3) the temperature can only be set to discrete values (the table resolution), (4) transient behavior is uncontrolled (the system takes whatever path it takes to reach the new steady state).

## 18.18 State Machine Controllers

Many laboratory instruments use state-machine (sequential) controllers. A typical sequence for the ThermoRig: INITIALIZE (set outputs to safe state) → PREHEAT (ramp heater to approximate temperature) → STABILIZE (wait 5 minutes for thermal equilibrium) → MEASURE (acquire 1000 samples) → COOL (turn off heater, wait) → REPORT (compute statistics, save file).

Each state has a fixed duration or a simple exit condition (e.g., “temperature within 5 °C of target”). The controller does not optimize performance within each state; it follows the script. This is robust and predictable but inflexible. If the preheat phase does not reach the target (due to a disturbance), the stabilize phase may not produce equilibrium, and the measurement phase produces incorrect data. A closed-loop controller would detect and correct this; the state machine does not.

## 18.19 Combining Open-Loop and Closed-Loop

Practical systems often combine both approaches. The state machine manages the high-level sequence (start, run, stop, error handling), while closed-loop controllers manage the low-level performance within each state. In the ThermoRig: the state machine sequences the test protocol, while a PID controller maintains the temperature within the STABILIZE and MEASURE states. This is the architecture used in most commercial test equipment.

## 18.20 Characterizing Plant Dynamics in Open Loop

Before designing a controller (open or closed-loop), you must know how the plant responds. The standard method: apply a step input and record the output.

For the ThermoRig in open-loop: set the heater to 50% duty cycle (step from 0%) and record the temperature vs. time. The response curve shows: (1) a transport delay  $L$  (dead time) before the temperature begins rising (heat propagating from the heater to the thermocouple), (2) an exponential-like rise toward the steady-state temperature, and (3) a final steady-state temperature  $T_{ss}$ .

From this step response, extract three parameters: the process gain  $K_p = (T_{ss} - T_{\text{ambient}})/(\text{duty cycle change})$ , the time constant  $\tau$  (time to reach 63.2% of  $T_{ss} - T_{\text{ambient}}$ ), and the dead time  $L$  (time from the step to the first observable temperature rise). For the ThermoRig:  $K_p \approx 1.1^\circ\text{C}/\%$ ,  $\tau \approx 30\text{ s}$ ,  $L \approx 3\text{ s}$ .

These three parameters ( $K_p$ ,  $\tau$ ,  $L$ ) define a First-Order Plus Dead Time (FOPDT) model:  $G(s) = K_p e^{-Ls}/(1 + \tau s)$ , which is the most common plant model used for PID tuning in process control.

## 18.21 Sensitivity Analysis

How much does the open-loop output change when a parameter varies?

**Supply voltage:** heater power  $P = V^2/R$ . A 10% voltage drop reduces power by 19% (because  $P \propto V^2$ ). For the ThermoRig:  $T_{ss}$  drops by approximately  $12^\circ\text{C}$  for a 10% voltage reduction. The open-loop controller does not detect this.

**Ambient temperature:** every  $1^\circ\text{C}$  change in ambient shifts the steady-state temperature by approximately  $0.9^\circ\text{C}$  (because the thermal resistance is nearly constant). A  $10^\circ\text{C}$  seasonal variation produces a  $9^\circ\text{C}$  output error.

**Heater aging:** over thousands of hours, the heater element resistance increases (wire oxidation), reducing power. A 5% resistance increase reduces power by 5% and  $T_{ss}$  by approximately  $3^\circ\text{C}$ .

These sensitivity calculations quantify why open-loop control is inadequate when precision matters. A closed-loop controller compensates for all of these disturbances automatically.

## 18.22 Hybrid Architectures in Industrial Practice

Most real industrial systems use a hierarchy of control:

**Level 1 (open-loop sequencing):** a PLC or state machine manages the process sequence (fill tank, heat, hold, cool, drain). This is deterministic and testable.

**Level 2 (closed-loop regulation):** PID controllers maintain temperature, pressure, flow, and level within each process step. These respond to disturbances in real time.

**Level 3 (supervisory optimization):** a higher-level controller (often model-predictive control, MPC) adjusts the setpoints of the Level 2 controllers to optimize the overall process (minimize energy, maximize throughput, meet quality targets).

Understanding open-loop control as one layer in this hierarchy, rather than as a standalone approach, provides the proper engineering perspective.

## 18.23 Open-Loop Control in Embedded Systems

Many microcontroller-based systems use open-loop control for non-critical functions while reserving closed-loop for critical ones:

**Stepper motor positioning:** the MCU commands a specific number of step pulses, and the motor is assumed to move one step per pulse. No position feedback. This works for light loads and moderate speeds but fails under high load (motor skips steps) or high acceleration (motor stalls). Adding an encoder closes the loop and enables step-loss detection and recovery.

**LED brightness control:** PWM duty cycle sets the average LED current. The brightness is assumed proportional to current (approximately true for most LEDs). No light sensor feedback. Adequate for indicator LEDs and displays; insufficient for precision photometric applications where LED aging, temperature, and manufacturing variation affect the current-to-luminance relationship.

**Timed dispensing:** a solenoid valve opens for a fixed duration to dispense a volume of liquid. The volume is assumed proportional to time (true if pressure and viscosity are constant). Variations in supply pressure, fluid temperature (viscosity changes), or valve wear produce volume errors. Closed-loop dispensing (measuring the actual volume or weight during dispensing) eliminates these errors.

## 18.24 Feedforward Control: Design and Implementation

Feedforward control measures a disturbance before it affects the output and applies a preemptive correction. It requires a model of how the disturbance affects the output.

**Design procedure:** (1) Identify the dominant measurable disturbance. (2) Model its effect on the output:  $\Delta y = G_d \cdot d$  where  $G_d$  is the disturbance transfer function. (3) Compute the required feedforward correction:  $\Delta u_{ff} = -(G_d/G_p) \cdot d$  where  $G_p$  is the plant transfer function. (4) Implement: measure  $d$  with a sensor, compute  $\Delta u_{ff}$ , and add it to the nominal control output.

**Example:** the ThermoRig operates at  $T_{sp} = 80^\circ\text{C}$ . The dominant disturbance is ambient temperature variation. Model: a  $1^\circ\text{C}$  drop in ambient requires approximately 0.8% additional heater duty cycle to compensate (determined by measuring the steady-state duty cycle at two ambient temperatures). Feedforward:  $\Delta u_{ff} = 0.8\% \times (T_{amb,ref} - T_{amb,measured})$ . Combined with PID feedback: the feedforward corrects 80% of the disturbance effect immediately (within one control loop period), while the PID corrects the remaining 20% (model error, unmeasured disturbances) over the next few time constants.

## 18.25 Model-Based Open-Loop: Inverse Dynamics

For systems where the plant dynamics are well-characterized, **inverse dynamics** computes the exact input needed to produce the desired output trajectory. If the plant transfer function is  $G_p(s)$ , the required input is  $U(s) = Y_{desired}(s)/G_p(s)$ .

For the ThermoRig: to ramp the temperature from  $25^\circ\text{C}$  to  $80^\circ\text{C}$  in exactly 60 s with a linear ramp: the desired trajectory is  $T(t) = 25 + 0.917t$  for  $0 \leq t \leq 60$  s. The required heater power includes both the steady-state loss compensation and the transient power to heat the thermal mass:

$$P(t) = hA(T(t) - T_{amb}) + mC_p \cdot dT/dt = hA(25 + 0.917t - 22) + 30.6 \times 0.917$$

. The second term is a constant 28 W needed to maintain the ramp rate. The first term increases linearly as the temperature rises.



This is open-loop because no temperature measurement is used during the ramp. If the model is perfect, the actual trajectory matches the desired trajectory exactly. In practice, model uncertainty produces a tracking error of 5–15%, which is why feedforward is almost always combined with feedback.

## 18.26 Gain Scheduling: Quasi-Open-Loop

Some systems have nonlinear or operating-point-dependent behavior. A fixed-gain controller cannot perform well across the entire operating range. **Gain scheduling** adjusts the controller gains based on a measured operating condition (not the controlled variable itself):

For the ThermoRig: the thermal dynamics change with temperature (convective  $h$  increases with  $\Delta T$ , radiation becomes significant above 100 °C). At  $T = 50$  °C:  $K_p = 10$  provides adequate performance. At  $T = 150$  °C: the plant gain has increased and  $K_p = 10$  causes oscillation;  $K_p = 5$  is needed. A gain schedule:  $K_p = 10 - 0.033(T - 50)$  for  $T \in [50, 200]$  °C adjusts the gain based on the measured temperature.

Gain scheduling is “quasi-open-loop” because the gain adjustment is based on the measured temperature (feedback), but the scheduling function itself is an open-loop model of how the plant dynamics change with operating point.

## 18.27 Lookup Table Implementation

### 18.27.1 Linear Interpolation

For a lookup table with  $N$  entries  $\{(x_i, y_i)\}_{i=1}^N$ , linear interpolation between adjacent entries:

$$y = y_i + \frac{y_{i+1} - y_i}{x_{i+1} - x_i}(x - x_i) \quad \text{for } x_i \leq x \leq x_{i+1} \quad (18.1)$$

In LabVIEW: the “Interpolate 1D” VI performs this automatically. On a microcontroller: implement with a binary search to find the bracketing entries ( $O(\log N)$ ) followed by the linear interpolation formula.

### 18.27.2 Table Resolution

The spacing between table entries determines the interpolation error. For a curve with maximum second derivative  $|y''|_{\max}$ , the maximum interpolation error with spacing  $\Delta x$  is:

$$\epsilon_{\max} = \frac{|y''|_{\max} \cdot \Delta x^2}{8} \quad (18.2)$$

For a thermocouple lookup table (nearly linear,  $|y''| \approx 0.001$  °C/mV<sup>2</sup>) with  $\Delta x = 0.5$  mV:  $\epsilon \approx 0.00003$  °C, negligible. For a thermistor ( $|y''|$  is large due to exponential nonlinearity): finer spacing is needed in the region of high curvature. Use non-uniform spacing: closely spaced entries where the curve bends sharply, widely spaced where it is nearly linear.

## 18.28 Practical Comparison: Open-Loop vs. Closed-Loop Performance

The ThermoRig provides an excellent test bed for comparing open and closed-loop control:

**Open-loop test:** calibrate the duty cycle vs. steady-state temperature at ambient = 22 °C. Command 50% duty cycle (calibrated to produce 80 °C). Record the temperature over 30 minutes while the HVAC cycles the ambient between 20 °C and 24 °C.

**Result:** the specimen temperature varies between 78 °C and 82 °C, tracking the ambient variation with no correction. When a student opens the lab door (creating a 2 m/s air draft), the temperature drops 5 °C and does not recover until the door closes.

**Closed-loop test** (PID at same setpoint): the temperature varies between 79.5 °C and 80.5 °C despite the same ambient variation. When the door opens, the temperature dips 1 °C and recovers within 20 s as the controller increases heater power.

The quantitative comparison: open-loop variation =  $\pm 2$  °C; closed-loop =  $\pm 0.5$  °C. A 4 $\times$  improvement in steady-state accuracy. The door disturbance: open-loop error = 5 °C sustained; closed-loop = 1 °C transient with 20 s recovery.

## 18.29 Practice Questions

1. Give three real-world examples of open-loop control systems. For each, identify the command, the actuator, and why feedback is not used.
2. Your team proposes an open-loop motor speed controller that sets PWM duty cycle based on a lookup table. Under what conditions will this work, and under what conditions will it fail?

### 18.29.1 Answers

1. (a) Clothes washer: timer sets cycle duration; motor runs for preset times; no sensor measures how clean the clothes are. (b) Sprinkler timer: runs for a set duration regardless of soil moisture. (c) Microwave oven: runs at set power for set time; does not measure food temperature. In all cases, feedback is omitted because the cost/complexity of a sensor exceeds the value of precision, and approximate control is acceptable.
2. Works when: the load is constant and predictable, the motor characteristics do not change with temperature, and the supply voltage is stable. Fails when: the load varies (e.g., a robot arm picks up different weights), the motor heats up (resistance changes, reducing speed at the same PWM), or the battery voltage drops during discharge.

# Chapter 19

## Closed-Loop Control

### When to Read This Chapter

**Module 9 (Weeks 13–14):** Read after the open-loop chapter. Focus on feedback block diagrams, stability concepts (gain/phase margin), and the step response characteristics (overshoot, settling time). **Related:** Open-loop in Chapter 18 (p. 192); PID tuning in Chapter 20 (p. 211).

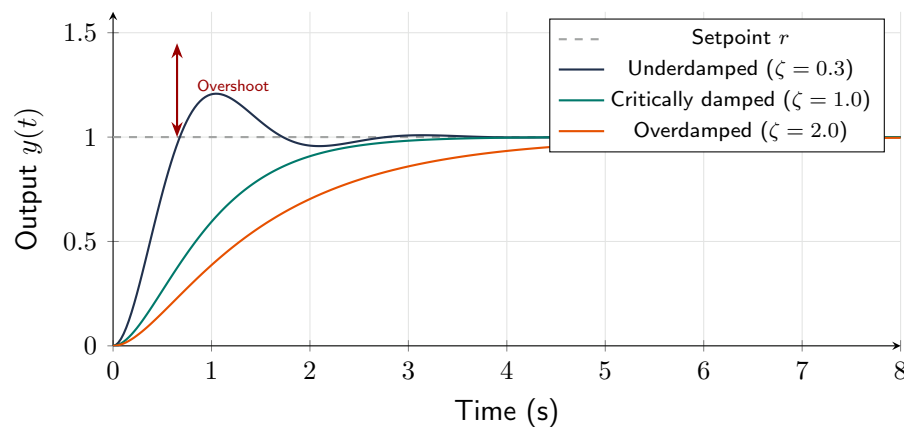


Figure 19.1: Closed-loop step response for different damping ratios. Underdamped ( $\zeta < 1$ ) responds quickly but overshoots; critically damped ( $\zeta = 1$ ) is the fastest without overshoot; overdamped ( $\zeta > 1$ ) is slow but conservative.

### 19.1 Feedback Control

Closed-loop control measures the output (the **process variable**, PV), compares it to the desired value (the **setpoint**, SP), and adjusts the actuator based on the **error** ( $e = \text{SP} - \text{PV}$ ). This feedback loop enables the system to self-correct.

### 19.2 Block Diagram

The summing junction computes  $e = \text{SP} - \text{PV}$ . The controller processes  $e$  and outputs a control signal  $u$ . The actuator converts  $u$  into physical action. The plant responds. The sensor measures the result and feeds it back.

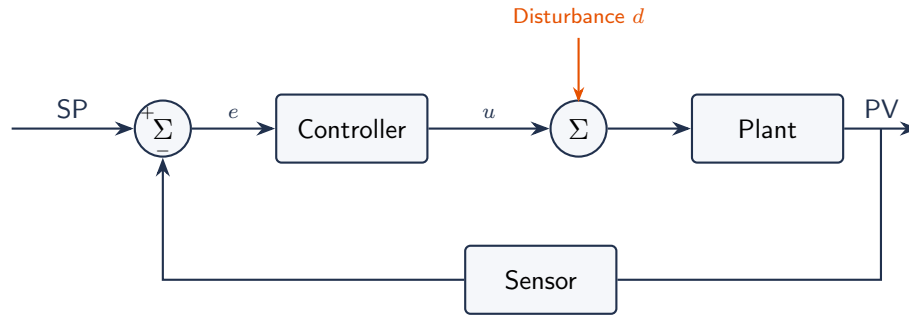


Figure 19.2: Standard feedback control loop. The summing junction computes error  $e = SP - PV$ . Disturbances enter at the plant but the feedback loop detects and corrects their effect.

### 19.3 Advantages Over Open-Loop

- **Disturbance rejection:** the controller compensates for unmeasured disturbances (load changes, supply voltage variations, environmental shifts).
- **Reduced sensitivity to plant uncertainty:** the system works even if the plant model is imperfect.
- **Improved accuracy:** steady-state error can be driven to zero (with integral action).

### 19.4 Stability

A feedback system can become **unstable** if the loop gain is too high or the phase shift around the loop reaches  $-180^\circ$  at a frequency where the gain is still  $>1$ . An unstable system oscillates with growing amplitude. Stability analysis tools: Bode plots (gain and phase margins), root locus, and Nyquist criterion. For MEGN 300, the key takeaway is: excessive controller gain causes instability (oscillation).

#### The Stability Rule of Thumb

If your controller output oscillates, the gain is too high. Reduce proportional gain first, then check if the oscillation stops. If the system responds sluggishly but does not oscillate, the gain may be too low.

### 19.5 Transfer Functions

The transfer function  $G(s)$  of a system relates its output to its input in the Laplace domain:

$$G(s) = \frac{Y(s)}{X(s)} \quad (19.1)$$

For the standard closed-loop with forward path  $G(s)$  and feedback sensor  $H(s)$ , the closed-loop transfer function is:

$$T(s) = \frac{G(s)}{1 + G(s)H(s)} \quad (19.2)$$

The denominator  $1 + G(s)H(s) = 0$  defines the **characteristic equation**; its roots determine stability. If any root has a positive real part, the system is unstable.

## 19.6 Steady-State Error

For a step input, the steady-state error depends on the **system type** (number of integrators in the open-loop transfer function):

- **Type 0** (no integrator, P-only): finite steady-state error  $e_{ss} = 1/(1 + K_p)$  where  $K_p$  is the DC loop gain.
- **Type 1** (one integrator, PI or I controller): zero steady-state error for step inputs. This is why integral action eliminates offset.
- **Type 2** (two integrators): zero steady-state error for step and ramp inputs.

### Requirements Mapping: Control Performance to Shall-Statements

- “Zero steady-state error” → CTRL-REQ: The controller shall include integral action (PI or PID). Verify: step test showing error converges to within  $\pm[\text{tolerance}]$  of setpoint.
- “Rise time  $<2$  s, overshoot  $<10\%$ ” → CTRL-REQ: Step response shall reach 90% of setpoint within 2 s with peak overshoot  $\leq 10\%$ . Verified by step test with data logging.
- “Gain margin  $\geq 6$  dB, phase margin  $\geq 45^\circ$ ” → CTRL-REQ: Verified by Bode plot analysis of the open-loop transfer function.

## 19.7 The Feedback Principle

Closed-loop control measures the actual output (process variable, PV) and compares it to the desired output (setpoint, SP). The difference is the error:  $e(t) = \text{SP} - \text{PV}$ . The controller uses this error to compute a control action  $u(t)$  that drives the error toward zero. This is the fundamental mechanism of all feedback control: measure, compare, correct.

## 19.8 Closed-Loop Block Diagram Components

**Setpoint (SP):** the desired output value, specified by the user or a higher-level controller.

**Summing junction:** computes  $e = \text{SP} - \text{PV}$ .

**Controller:** processes the error  $e$  to compute the control output  $u$ . May be as simple as a proportional gain or as sophisticated as a PID algorithm with anti-windup and derivative filtering.

**Actuator:** converts the control signal into physical action. Examples: heater (electrical power → heat), motor (electrical power → torque), valve (signal → flow rate).

**Plant:** the physical system being controlled (room temperature dynamics, motor speed dynamics, fluid level dynamics).

**Sensor:** measures the output of the plant and converts it to a signal for comparison with the setpoint. The sensor’s accuracy, bandwidth, and noise directly limit the achievable control performance.

**Disturbance:** any uncontrolled influence that affects the plant output (door opening, load change, supply voltage fluctuation). Feedback detects the effect of the disturbance on the output and corrects for it.

## 19.9 Transfer Functions and System Type

A transfer function  $G(s)$  describes the input-output relationship in the Laplace domain. The **open-loop transfer function**  $L(s) = G_c(s) \cdot G_p(s)$  (controller times plant) determines the closed-loop

behavior. The **system type** (number of pure integrators in  $L(s)$ ) determines the steady-state error for different input types:

**Type 0** (no integrators): finite steady-state error for step inputs.  $e_{ss} = 1/(1 + K_p)$  where  $K_p = \lim_{s \rightarrow 0} L(s)$  is the position error constant. P-only control of a first-order plant is Type 0.

**Type 1** (one integrator): zero steady-state error for step inputs, finite for ramp inputs. PI control adds the required integrator.

**Type 2** (two integrators): zero steady-state error for step and ramp inputs. Rarely needed in instrumentation.

## 19.10 Stability

A closed-loop system is stable if and only if all poles of the closed-loop transfer function have negative real parts (lie in the left half of the  $s$ -plane). In practice, stability is assessed using gain margin (how much the gain can increase before instability) and phase margin (how much additional phase lag can be tolerated). For robust performance, aim for gain margin  $> 6$  dB and phase margin  $> 45^\circ$ .

## 19.11 Closed-Loop Advantages

**Disturbance rejection:** feedback detects and corrects the effect of disturbances. A door opening in a heated room causes a temperature drop that the controller detects and compensates by increasing heater power.

**Reduced sensitivity:** the closed-loop gain  $T(s) = L(s)/(1 + L(s))$  is much less sensitive to plant parameter variations than the open-loop gain. If the plant gain doubles, the closed-loop gain changes by a much smaller fraction.

**Integral action eliminates offset:** adding an integrator in the controller (the “I” in PID) drives the steady-state error to zero for step inputs, regardless of the plant’s DC gain.

## 19.12 Sensitivity and Complementary Sensitivity

The closed-loop transfer function from setpoint to output is the **complementary sensitivity function**  $T(s) = L(s)/(1 + L(s))$  where  $L(s) = G_c(s)G_p(s)$  is the open-loop transfer function. The **sensitivity function**  $S(s) = 1/(1 + L(s))$  describes how disturbances affect the output. Note that  $S + T = 1$  (for the standard unity-feedback architecture with  $H(s) = 1$ ): you cannot simultaneously reduce sensitivity to disturbances at all frequencies. This is the fundamental limitation of feedback control.

At low frequencies where  $|L| \gg 1$ :  $T \approx 1$  (output tracks setpoint),  $S \approx 1/L \ll 1$  (disturbances are strongly rejected). At high frequencies where  $|L| \ll 1$ :  $T \approx L \ll 1$  (output does not track fast setpoint changes),  $S \approx 1$  (disturbances pass through unattenuated).

## 19.13 Stability Margins in Detail

**Gain margin:** the factor by which the loop gain can increase before the system becomes unstable. Measured at the frequency where the phase is  $-180^\circ$ . Minimum recommended: 6 dB (gain can double before instability).

**Phase margin:** the additional phase lag the system can tolerate before instability. Measured at the gain crossover frequency (where  $|L| = 1$ ). Minimum recommended:  $45^\circ$ . More phase margin gives less overshoot and more robust behavior.

In MEGN 300, you assess stability empirically: if the control loop oscillates, reduce  $K_p$ . If it oscillates with growing amplitude, you are at or beyond the stability boundary. Back off gain by at least 50%.

## 19.14 The Effect of Sensor Dynamics

The sensor is inside the feedback loop. Its dynamic response (bandwidth, time constant) directly affects stability. A slow sensor adds phase lag, reducing the phase margin. For stable control, the sensor bandwidth should be at least  $5\times$ – $10\times$  the closed-loop bandwidth. If the sensor is too slow, the maximum achievable control bandwidth is limited by the sensor, not the controller or actuator.

## 19.15 Disturbance Rejection Quantified

For a step disturbance  $d$  entering at the plant, the steady-state output deviation is:

$$\Delta y_{ss} = \frac{d}{1 + K_p K_{\text{plant}}} \quad (\text{P-only control}) \quad (19.3)$$

With integral action (PI or PID),  $\Delta y_{ss} = 0$  for step disturbances, because the integrator drives the error to zero regardless of the disturbance magnitude. This is the primary motivation for adding integral action.

## 19.16 The Feedback Equation

The closed-loop transfer function from setpoint  $R(s)$  to output  $Y(s)$ :

$$T(s) = \frac{G_c(s)G_p(s)}{1 + G_c(s)G_p(s)H(s)} \quad (19.4)$$

where  $G_c$  is the controller,  $G_p$  is the plant, and  $H$  is the sensor/feedback transfer function. For an ideal sensor ( $H = 1$ ):  $T(s) = L(s)/(1 + L(s))$  where  $L(s) = G_c G_p$  is the loop transfer function.

At frequencies where  $|L| \gg 1$  (low frequencies, typically):  $T \approx 1/H \approx 1$  (output tracks setpoint regardless of plant dynamics). At frequencies where  $|L| \ll 1$  (high frequencies):  $T \approx L$  (no tracking; the bandwidth limit). The **crossover frequency** (where  $|L| = 1$ ) defines the closed-loop bandwidth.

## 19.17 Steady-State Error Analysis

The steady-state error for a step input of magnitude  $R_0$ :

$$e_{ss} = \lim_{s \rightarrow 0} \frac{s \cdot R_0/s}{1 + L(s)} = \frac{R_0}{1 + K_p} \quad (19.5)$$

where  $K_p = \lim_{s \rightarrow 0} L(s)$  is the **position error constant**. For P-only control of a plant with DC gain  $K_{\text{plant}}$ :  $K_p = K_p^{\text{ctrl}} \times K_{\text{plant}}$ , and  $e_{ss} = R_0/(1 + K_p^{\text{ctrl}} K_{\text{plant}})$ .

Example: ThermoRig with  $K_p^{\text{ctrl}} = 10$  and  $K_{\text{plant}} = 1^\circ\text{C}/\% \text{ power}$ :  $K_p = 10$ ,  $e_{ss} = R_0/11 = 9.1\%$  of setpoint change. For a  $50^\circ\text{C}$  setpoint (from  $25^\circ\text{C}$  ambient):  $e_{ss} = 25/11 = 2.3^\circ\text{C}$ . The controller achieves  $47.7^\circ\text{C}$  instead of  $50^\circ\text{C}$ .

Adding integral action ( $K_i > 0$ ) makes the system Type 1:  $K_p \rightarrow \infty$ ,  $e_{ss} \rightarrow 0$ . This is the primary motivation for the “I” in PID.

## 19.18 Stability Analysis Methods

### 19.18.1 Bode Plot Method

Plot the magnitude and phase of  $L(j\omega)$  vs. frequency. The system is stable if the gain margin (gain below 0 dB at the  $-180^\circ$  phase frequency) and phase margin (phase above  $-180^\circ$  at the 0 dB gain frequency) are both positive.

For the ThermoRig PI controller:  $L(s) = (10 + 0.5/s) \times 1/(1 + 30s)$  ( $P = 10$ ,  $I = 0.5$ , plant time constant =  $30\text{ s}$ ). The Bode plot shows crossover at  $\sim 0.05\text{ Hz}$  with  $\sim 50^\circ$  phase margin. This is adequate ( $> 45^\circ$ ). Increasing  $K_p$  to 20 reduces the phase margin to  $\sim 30^\circ$ , making the response oscillatory.

### 19.18.2 Root Locus (Conceptual)

As the proportional gain  $K_p$  increases from 0 to infinity, the closed-loop poles trace paths in the complex plane. When poles cross the imaginary axis, the system becomes unstable. Root locus shows the gain at which instability occurs (the “ultimate gain”  $K_u$ ) and the frequency of oscillation ( $f_u$ ). This is the theoretical basis for the Ziegler-Nichols tuning method.

## 19.19 Performance Specifications

**Rise time** ( $t_r$ ): time for the output to go from 10% to 90% of the step change. Faster is better, but is limited by actuator power and stability.

**Overshoot** (%OS): peak value above the setpoint, as a percentage of the step change. Typical target:  $< 10\%$ . Zero overshoot requires overdamped response (slow settling).

**Settling time** ( $t_s$ ): time for the output to remain within a specified band (typically  $\pm 2\%$  or  $\pm 5\%$ ) of the final value. For a second-order system:  $t_s \approx 4/(\zeta\omega_n)$ .

**Steady-state error** ( $e_{ss}$ ): final deviation from setpoint. Zero with integral action for step inputs.

These four specifications are mutually constrained: reducing rise time increases overshoot (for a given plant and controller structure). Achieving zero steady-state error (integral action) increases overshoot and settling time. The controller gains represent a tradeoff among these competing objectives.

## 19.20 Practical Closed-Loop Design Steps

(1) Characterize the plant: apply a step input in open loop and measure the output response. Fit a first or second-order model. For the ThermoRig:  $G_p(s) \approx K/(1 + \tau s) = 1/(1 + 30s)$  (first-order with  $\tau = 30\text{ s}$ ).

(2) Choose a controller structure: P, PI, or PID. For systems requiring zero steady-state error: PI minimum. For systems with significant overshoot: add D.



(3) Tune the controller: Z-N method for initial gains, then manual refinement based on step response observation.

(4) Verify stability and performance: check phase margin ( $> 45^\circ$ ), overshoot ( $< 10\%$ ), settling time (within specification), and steady-state error (zero for step inputs with integral action).

(5) Test robustness: change the plant conditions (different ambient temperature, different load, different supply voltage) and verify the controller still performs acceptably.

## 19.21 Closed-Loop Bandwidth and Speed of Response

The closed-loop bandwidth  $f_{BW}$  determines how fast the system can track changing setpoints and reject disturbances. For a first-order closed-loop system:  $f_{BW} = f_{-3dB} = (1 + K_p K_{\text{plant}})/(2\pi\tau)$ , where  $\tau$  is the plant time constant. Higher gain  $K_p$  increases bandwidth (faster response), but also reduces stability margins.

For the ThermoRig with  $K_p = 10$ ,  $K_{\text{plant}} = 1$ ,  $\tau = 30$  s:  $f_{BW} = 11/(2\pi \times 30) = 0.058$  Hz, corresponding to a closed-loop time constant of  $30/11 = 2.7$  s (much faster than the open-loop 30 s). With  $K_p = 50$ :  $f_{BW} = 0.27$  Hz, closed-loop time constant = 0.59 s. But the phase margin at this gain may be insufficient.

## 19.22 The Sensitivity Tradeoff

The sensitivity function  $S(s) = 1/(1 + L(s))$  and the complementary sensitivity function  $T(s) = L(s)/(1 + L(s))$  satisfy  $S + T = 1$  at every frequency (assuming unity feedback,  $H(s) = 1$ , which is standard in most practical implementations). This means: at frequencies where the system tracks the setpoint well ( $|T| \approx 1$ ), it also rejects disturbances well ( $|S| \approx 0$ ). At frequencies where tracking is poor ( $|T| \approx 0$ ), disturbances pass through unattenuated ( $|S| \approx 1$ ).

The crossover frequency (where  $|L| = 1$ ) separates these two regimes. Below crossover: good tracking and disturbance rejection. Above crossover: no tracking, no disturbance rejection. This is why increasing bandwidth (moving the crossover to higher frequencies) improves performance, subject to the stability constraint.

## 19.23 Effect of Time Delay (Dead Time)

Dead time  $L$  in the plant ( $G_p(s) = Ke^{-Ls}/(1 + \tau s)$ ) introduces phase lag  $\phi = -\omega L$  radians at frequency  $\omega$ , without affecting magnitude. This phase lag directly reduces the phase margin:  $\Delta PM = -360 \times f_{BW} \times L$  degrees. For the ThermoRig with  $L = 3$  s and  $f_{BW} = 0.058$  Hz:  $\Delta PM = -360 \times 0.058 \times 3 = -63^\circ$ . This is very significant; the dead time alone uses most of the available phase budget.

Dead time is the enemy of feedback control. It limits the achievable bandwidth and the maximum usable gain. Systems with large  $L/\tau$  ratios (dead time comparable to the time constant) are inherently difficult to control. The Smith predictor is an advanced control technique that compensates for dead time by including a model of the plant (including its delay) inside the controller.

## 19.24 Integral Action and Reset Windup

When integral action is added ( $K_i > 0$ ), the steady-state error for step inputs becomes zero. However, integral action has two drawbacks:

(1) **Reduced stability:** the integrator adds  $-90^\circ$  of phase lag at all frequencies, reducing the phase margin. If the original P-only system had  $60^\circ$  phase margin, adding integral action might reduce it to  $30^\circ$  or less, producing oscillatory behavior. The solution: reduce  $K_i$  (longer integral time  $T_i$ ) to push the integral action to lower frequencies where its phase contribution at the crossover frequency is minimized.

(2) **Integral windup:** when the actuator saturates, the integral continues to accumulate, causing massive overshoot when the error changes sign. This is addressed in Chapter 16.

## 19.25 Root Locus: Physical Interpretation

The root locus is a graphical tool showing how the closed-loop pole locations change as the proportional gain  $K_p$  varies from 0 to infinity. Each pole traces a path (locus) in the complex plane. The pole locations determine the dynamic behavior:

**Real-axis poles:** produce exponential modes. A pole at  $s = -a$  produces a mode  $e^{-at}$  with time constant  $\tau = 1/a$ . More negative = faster decay.

**Complex conjugate poles:** produce oscillatory modes. Poles at  $s = -\sigma \pm j\omega_d$  produce  $e^{-\sigma t} \sin(\omega_d t + \phi)$ . The real part  $\sigma$  determines the decay rate; the imaginary part  $\omega_d$  determines the oscillation frequency.

**Imaginary axis poles:** produce sustained oscillation (marginally stable). This is the ultimate gain  $K_u$ : the gain at which poles reach the imaginary axis. Beyond this gain: poles enter the right half-plane and the system is unstable.

For the ThermoRig FOPDT model  $G_p(s) = 1.1e^{-3s}/(1 + 30s)$  with PI controller  $G_c(s) = K_p(1 + 1/(T_i s))$ : as  $K_p$  increases, the dominant poles move from the real axis (overdamped at low gain) toward the imaginary axis (oscillatory at high gain), crossing at  $K_u \approx 35$ . The Ziegler-Nichols tuning sets  $K_p = 0.45K_u = 15.75$ , which places the poles roughly halfway between the real axis and the imaginary axis, giving a damped oscillatory response with  $\sim 25\%$  overshoot.

## 19.26 Frequency-Domain Design: Lead and Lag Compensation

Beyond PID, classical control design uses **lead compensators** (to add phase and increase bandwidth) and **lag compensators** (to increase low-frequency gain for steady-state accuracy without affecting stability).

**Lead compensator:**  $G_{\text{lead}}(s) = K_c \cdot (s + z)/(s + p)$  where  $p > z$  (pole at higher frequency than zero). Adds positive phase near the geometric mean of  $z$  and  $p$ . Use when you need more phase margin at the crossover frequency.

**Lag compensator:**  $G_{\text{lag}}(s) = K_c \cdot (s + z)/(s + p)$  where  $z > p$  (zero at higher frequency than pole). Adds gain at low frequencies (improving steady-state accuracy) without significantly affecting the crossover frequency or phase margin.

In MEGN 300, the PI controller is a lag compensator (the integrator adds infinite gain at DC), and the PD controller is a lead compensator (the derivative adds phase at the crossover frequency). The PID combines both.

## 19.27 Closed-Loop Response to Ramp Inputs

Many control applications require tracking a ramping setpoint (heating at a constant rate, constant-speed motion). The steady-state tracking error for a ramp input  $r(t) = Rt$  depends on the system type:

Type 0 (P-only): ramp error grows without bound. P-only cannot track a ramp.

Type 1 (PI): finite ramp error  $e_{ss} = R/K_v$  where  $K_v = \lim_{s \rightarrow 0} sL(s)$  is the velocity error constant. Higher  $K_v$  (higher integral gain) reduces the ramp tracking error.

Type 2 (PID with double integrator): zero ramp error. However, double integrators are difficult to stabilize and are rarely needed in thermal or mechanical systems.

For the ThermoRig ramping at  $1^\circ\text{C/s}$  with PI control ( $K_v = K_p K_i K_{\text{plant}} = 10 \times 0.5 \times 1.1 = 5.5 \text{ s}^{-1}$ ):  $e_{ss} = 1.0/5.5 = 0.18^\circ\text{C}$ . The temperature always lags the ramp by  $0.18^\circ\text{C}$ . Increasing  $K_i$  reduces this lag but increases overshoot at the end of the ramp.

## 19.28 Implementation Considerations

**Sampling rate selection:** the control loop update rate should be  $\geq 10\times$  the closed-loop bandwidth. For the ThermoRig ( $f_{BW} \approx 0.05 \text{ Hz}$ ):  $f_s \geq 0.5 \text{ Hz}$  ( $T_s \leq 2 \text{ s}$ ). We use  $T_s = 100 \text{ ms}$  ( $f_s = 10 \text{ Hz}$ ) for margin. For motor speed control ( $f_{BW} = 100 \text{ Hz}$ ):  $f_s \geq 1 \text{ kHz}$ .

**Computational delay:** the time between reading the sensor and writing the actuator output. In LabVIEW on a desktop PC: 1–10 ms (adequate for thermal and slow mechanical systems). On a real-time controller (CompactRIO, myRIO):  $< 100 \mu\text{s}$ . On a microcontroller (ESP32):  $< 1 \text{ ms}$ . Computational delay adds to the dead time and reduces phase margin.

**Actuator saturation:** every actuator has limits (heater: 0–100%, motor:  $-V_{\text{max}}$  to  $+V_{\text{max}}$ ). The controller's output must be clamped to the actuator range. Saturation means the controller temporarily loses authority: it commands more than the actuator can deliver. During saturation, the feedback loop is effectively broken, and integral windup can occur (addressed in the PID chapter).

## 19.29 Practice Questions

1. Draw the block diagram for a closed-loop temperature control system. Label: setpoint, error, controller, heater (actuator), room (plant), and temperature sensor. Identify a specific disturbance and show where it enters the loop.
2. Explain why a thermostat (on/off controller) is a closed-loop system, and identify what limits its accuracy.
3. Your closed-loop motor speed controller oscillates at 5 Hz. What is the most likely cause, and what is the first adjustment you should make?

### 19.29.1 Answers

1. Block diagram: SP (desired temp)  $\rightarrow$  summing junction  $\rightarrow$  PID controller  $\rightarrow$  relay/SSR (actuator)  $\rightarrow$  room (plant)  $\rightarrow$  PV (room temperature)  $\rightarrow$  temperature sensor (e.g., thermistor)  $\rightarrow$  feedback to summing junction. Disturbance: someone opens a window (heat loss), which enters between the plant and the output.

2. A thermostat measures the room temperature (feedback), compares it to the setpoint, and switches the heater on or off. It is closed-loop because the output (temperature) is measured and used to determine the control action. Accuracy is limited by: (1) the dead band (hysteresis) between the on and off thresholds, (2) the sensor's accuracy and placement, and (3) the thermal lag between the heater and the sensor location.
3. The oscillation indicates the loop gain exceeds the stability margin at 5 Hz. First adjustment: reduce the proportional gain ( $K_p$ ) by 50% and observe if the oscillation amplitude decreases. If it stops, the gain was too high. If it persists, check for measurement delay (sensor lag, DAQ sampling latency) that adds phase shift to the loop.

# Chapter 20

## PID Control

### When to Read This Chapter

**Module 9 (Weeks 13–14):** Read before the PID tuning lab. Focus on P/I/D individual effects, Ziegler-Nichols tuning, and integral windup. The ThermoRig PID example is directly applicable to the lab. **Related:** Closed-loop fundamentals in Chapter 19 (p. 201); high-power output stages in Chapter 16 (p. 167).

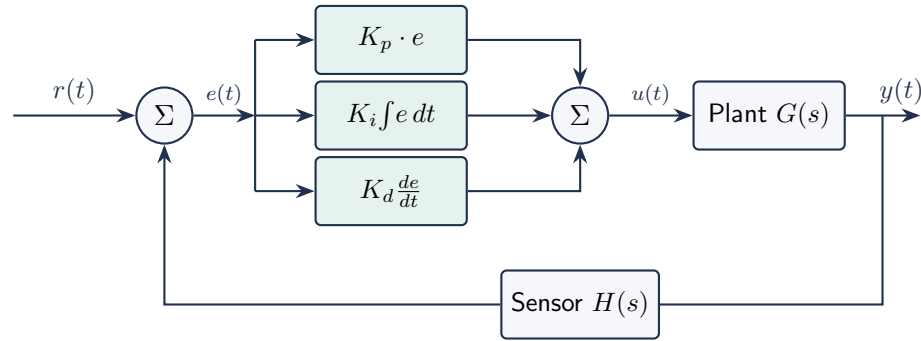


Figure 20.1: PID controller block diagram. The error  $e(t) = r(t) - y_{\text{measured}}(t)$  drives three parallel paths: proportional (speed), integral (accuracy), derivative (damping). The sensor feedback path introduces its own dynamics and noise.

### 20.1 The PID Controller

The Proportional-Integral-Derivative controller is the most widely used feedback controller in industry. The control output is:

$$u(t) = K_p e(t) + K_i \int_0^t e(\tau) d\tau + K_d \frac{de(t)}{dt} \quad (20.1)$$

where  $e(t) = \text{SP} - \text{PV}$  is the error.

### 20.2 The Three Terms

#### 20.2.1 Proportional (P)

$u_P = K_p \cdot e(t)$ . Output is directly proportional to the current error. Higher  $K_p$  gives faster response but more overshoot. **P-only control always has steady-state error** (called “offset”) because the controller needs a nonzero error to produce a nonzero output.

### 20.2.2 Integral (I)

$u_I = K_i \int e(\tau) d\tau$ . Output is proportional to the accumulated error over time. The integral term **eliminates steady-state error**: as long as any error exists, the integral grows, increasing the output until the error reaches zero. Too much integral action causes overshoot and oscillation (slow, wind-up driven).

### 20.2.3 Derivative (D)

$u_D = K_d \cdot de/dt$ . Output is proportional to the rate of change of error. The derivative term provides **damping**: it opposes rapid changes, reducing overshoot and improving stability. Sensitive to noise (differentiating a noisy signal amplifies the noise); usually low-pass filtered in practice.

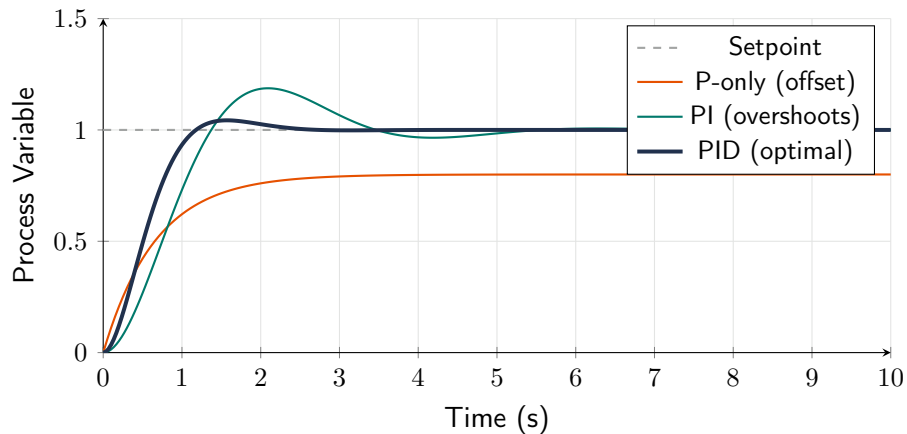


Figure 20.2: Step response comparison: P-only has steady-state offset, PI eliminates offset but overshoots, PID provides fast settling with minimal overshoot. Tune P first, then I, then D.

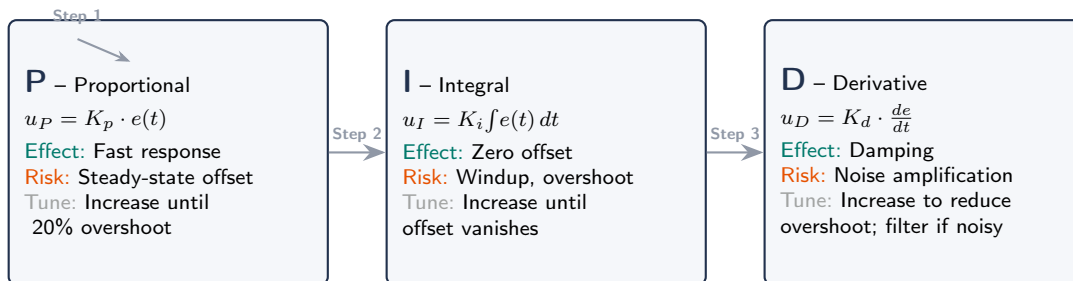


Figure 20.3: The three PID controller terms: their formulas, effects, risks, and the recommended manual tuning sequence (P first, then I, then D).

#### WE ThermoRig: PID Temperature Control

The ThermoRig controls a 100 W cartridge heater to maintain a metal block at a setpoint temperature. The sensor is a Type K thermocouple read by the NI DAQ at 10 S/s.

**P-only** ( $K_p = 5\%/\text{°C}$ ): the heater reaches 95% of setpoint but stabilizes with a 2.5 °C offset below target.

**PI** ( $K_p = 5$ ,  $K_i = 0.5\%/({}^{\circ}\text{C}\cdot\text{s})$ ): the offset is eliminated; the system reaches setpoint in 45 s with 8% overshoot.

**PID** ( $K_p = 5$ ,  $K_i = 0.5$ ,  $K_d = 2\%\cdot\text{s}/({}^{\circ}\text{C})$ ): overshoot reduced to 2%, settling time 30 s. The derivative term damps the approach to setpoint.

## 20.3 From PID Output to Physical Actuator

The PID controller computes a control variable  $u(t)$  as a percentage (0–100%). This abstract number must be converted into a physical actuation signal:

**For a DC motor** (speed control):  $u$  maps to PWM duty cycle. At  $u = 50\%$ , the MOSFET switches the motor supply at 50% duty, delivering half the average voltage. The PWM frequency (1–25 kHz) is fast enough that the motor’s inertia smooths the pulsed current.

**For an AC heater** (temperature control via SSR):  $u$  maps to time-proportional control. Over a fixed period (e.g., 1 s), the SSR is ON for  $u/100 \times 1$  s and OFF for the remainder. At  $u = 75\%$ , the heater is ON for 0.75 s and OFF for 0.25 s each cycle. The thermal mass of the system smooths this into quasi-continuous heating.

**For a valve** (flow/pressure control):  $u$  maps to valve position via a servo actuator or stepper motor driving the valve stem.

In LabVIEW, wire the PID output (0–100) to a “Rescale” function that converts to the appropriate DAQ output: a 0–3.3 V analog voltage for a proportional driver, or a digital output with timing logic for time-proportional SSR control.

### Requirements Mapping: Control Output to Shall-Statements

- “PID loop rate  $\geq 10$  Hz”  $\rightarrow$  SW-REQ: LabVIEW While Loop period shall be  $\leq 100$  ms, verified by timing measurement.
- “Heater PWM resolution  $\leq 1\%$ ”  $\rightarrow$  HW-REQ: Time-proportional period shall be  $\geq 1$  s (giving 100 discrete steps at 10 ms resolution).
- “Motor speed controllable 0–100%”  $\rightarrow$  HW-REQ: PWM duty cycle shall span 0–100% with  $\geq 8$ -bit resolution (256 steps).

## 20.4 Tuning Methods

### 20.4.1 Ziegler-Nichols (Closed-Loop)

1. Set  $K_i = 0$  and  $K_d = 0$  (P-only control).
2. Increase  $K_p$  until the system oscillates at a constant amplitude. Record this **ultimate gain**  $K_u$  and the **ultimate period**  $T_u$ .
3. Apply the Ziegler-Nichols tuning rules:

| Controller | $K_p$      | $T_i$     | $T_d$     |
|------------|------------|-----------|-----------|
| P          | $0.50 K_u$ | –         | –         |
| PI         | $0.45 K_u$ | $T_u/1.2$ | –         |
| PID        | $0.60 K_u$ | $T_u/2.0$ | $T_u/8.0$ |

Table 20.1: Ziegler-Nichols closed-loop tuning rules.  $K_i = K_p/T_i$ ,  $K_d = K_p \cdot T_d$ .

### 20.4.2 Manual Tuning

1. Start with P-only. Increase  $K_p$  until the response is reasonably fast with acceptable overshoot (typically 10–25%).
2. Add integral. Start  $K_i$  small; increase until the steady-state error is eliminated. If overshoot increases significantly, reduce  $K_i$ .
3. Add derivative. Start  $K_d$  small; increase to reduce overshoot and oscillation. If the output becomes jerky or noisy,  $K_d$  is too high.

## 20.5 Integral Windup

When the actuator saturates (e.g., heater at 100% duty, valve fully open), the error persists and the integral term continues to grow. When the error finally reverses, the large integral value causes excessive overshoot before the integral “unwinds.” **Anti-windup**: stop integrating when the actuator is saturated, or clamp the integral term to a maximum value.

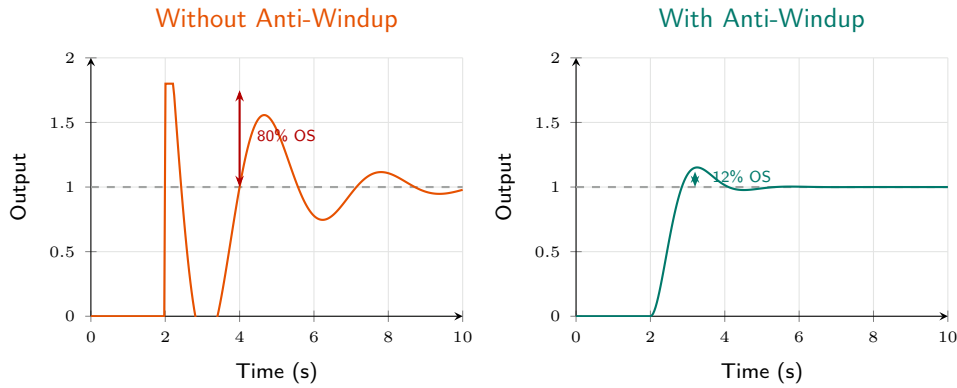


Figure 20.4: Integral windup: without anti-windup (left), the integral accumulates during saturation, causing 80%+ overshoot. With anti-windup clamping (right), the integral is frozen during saturation, limiting overshoot to ~12%. Always enable anti-windup.

## 20.6 Digital PID Implementation

In discrete time (sampling period  $T_s$ ):

$$u[n] = K_p e[n] + K_i T_s \sum_{k=0}^n e[k] + K_d \frac{e[n] - e[n-1]}{T_s} \quad (20.2)$$

This is the **positional form**. The **velocity form** computes the change in output ( $\Delta u$ ) instead of the absolute value, which naturally prevents integral windup:

$$\Delta u[n] = K_p(e[n] - e[n-1]) + K_i T_s e[n] + K_d \frac{e[n] - 2e[n-1] + e[n-2]}{T_s} \quad (20.3)$$



**Requirements Mapping: PID to Shall-Statements**

- “Maintain temperature at setpoint  $\pm 0.5^\circ\text{C}$ ”  $\rightarrow$  CTRL-REQ: PID controller shall achieve steady-state error  $\leq 0.5^\circ\text{C}$  within 60 s of a step change.
- “No overshoot  $> 5\%$ ”  $\rightarrow$  CTRL-REQ: Step response overshoot shall be  $\leq 5\%$  of the step magnitude.
- “Control loop executes at  $\geq 10\text{ Hz}$ ”  $\rightarrow$  SW-REQ: PID computation and DAQ cycle shall complete within 100 ms.

## 20.7 Practical PID Considerations

### 20.7.1 Derivative Filter

The pure derivative term  $K_d \cdot de/dt$  amplifies high-frequency noise. In practice, the derivative is always filtered:

$$u_D(s) = \frac{K_d s}{1 + \frac{s}{N\omega_c}} \quad \text{where } N = 2-20 \quad (20.4)$$

This limits the derivative gain at high frequencies. In discrete form: use a first-order low-pass on the error difference before multiplying by  $K_d$ . LabVIEW’s PID VI includes this filter automatically.

### 20.7.2 Setpoint Weighting

When the setpoint changes suddenly (step change), the proportional and derivative terms produce a large instantaneous output (“derivative kick”). Setpoint weighting reduces this: apply P and D only to the process variable (not the error), while I acts on the full error. This gives smooth response to setpoint changes while maintaining full disturbance rejection.

### 20.7.3 Bumpless Transfer

When switching between manual and automatic control modes, a poorly implemented PID can produce a large output jump. Bumpless transfer initializes the integral term so that the automatic output matches the manual output at the moment of transfer.

### 20.7.4 Cascade Control

For systems with multiple time constants (e.g., a heater heating a metal block that heats a fluid), cascade control uses two nested loops: an inner (fast) loop controls the heater temperature, and an outer (slow) loop controls the fluid temperature. The outer loop’s output becomes the inner loop’s setpoint. This rejects disturbances faster by addressing them at the inner loop before they propagate to the outer variable.

**WE ThermoRig: Complete PID Implementation in LabVIEW**

The ThermoRig PID loop runs at 10 Hz ( $T_s = 0.1\text{ s}$ ). The NI DAQ reads the thermocouple (averaged over 10 readings per cycle for noise reduction). The PID VI computes the output (0–100% duty cycle). The output drives the SSR via a digital output toggled at 1 Hz time-proportional rate.

Tuning: Ziegler-Nichols yielded  $K_u = 15$ ,  $T_u = 8\text{ s}$ . Z-N PID:  $K_p = 9.0$ ,  $K_i = 2.25/\text{s}$ ,  $K_d = 2.25\text{ s}$ . After manual refinement (reducing overshoot):  $K_p = 6.0$ ,  $K_i = 1.5/\text{s}$ ,  $K_d = 3.0\text{ s}$ . Anti-windup

enabled with integral clamp at  $\pm 50\%$ . Result: setpoint reached in 35 s, overshoot 3%, steady-state error  $< 0.2^\circ\text{C}$ .

## 20.8 PID Controller Theory

The PID (Proportional-Integral-Derivative) controller computes the control output as:

$$u(t) = K_p e(t) + K_i \int_0^t e(\tau) d\tau + K_d \frac{de(t)}{dt} \quad (20.5)$$

where  $e(t) = \text{SP} - \text{PV}$  is the error. Each term contributes a distinct behavior:

### 20.8.1 Proportional (P) Term

$u_P = K_p \cdot e$ : output proportional to current error. Higher  $K_p$  gives faster response but more overshoot and less stability margin. P-only control always has a non-zero steady-state error (offset) for step inputs in Type 0 systems:

$$e_{ss} = \frac{1}{1 + K_p K_{\text{plant}}} \quad (20.6)$$

For  $K_p = 10$  and  $K_{\text{plant}} = 1$ :  $e_{ss} = 1/11 \approx 9.1\%$  of the step size. Higher  $K_p$  reduces but never eliminates the offset.

### 20.8.2 Integral (I) Term

$u_I = K_i \int e dt$ : output proportional to the accumulated error over time. The integral action eliminates steady-state offset by continuously increasing the output as long as any error persists. However, it introduces phase lag (reduces stability) and can cause **integral windup** when the actuator saturates.

### 20.8.3 Derivative (D) Term

$u_D = K_d \cdot de/dt$ : output proportional to the rate of change of error. It provides predictive action, reducing overshoot and improving stability by “braking” when the error is decreasing rapidly. However, it amplifies high-frequency noise. In practice, the derivative is computed from the PV (not the error) to avoid setpoint step spikes, and a low-pass filter is applied to the derivative signal.

## 20.9 Tuning Methods

### 20.9.1 Ziegler-Nichols Closed-Loop Method

- (1) Set  $K_i = 0$  and  $K_d = 0$  (P-only). (2) Increase  $K_p$  until the system oscillates at constant amplitude. Record this  $K_p$  as  $K_u$  (ultimate gain) and the oscillation period as  $T_u$  (ultimate period).
- (3) Calculate gains from the Z-N table:

P-only:  $K_p = 0.5K_u$ . PI:  $K_p = 0.45K_u$ ,  $T_i = T_u/1.2$ . PID:  $K_p = 0.6K_u$ ,  $T_i = T_u/2$ ,  $T_d = T_u/8$ .

Z-N tuning produces aggressive response with significant overshoot ( $\sim 25\%$ ). Use it as a starting point and manually reduce  $K_p$  and increase  $T_i$  for less aggressive behavior.

### 20.9.2 Manual Tuning

- (1) Set  $K_i = 0$ ,  $K_d = 0$ . Increase  $K_p$  until the response is fast with acceptable overshoot ( $<10\%$ ).
- (2) Gradually increase  $K_i$  to eliminate the steady-state offset. Too much  $K_i$  causes slow oscillation.
- (3) Add  $K_d$  to reduce overshoot and improve settling. Too much  $K_d$  causes high-frequency jitter (noise amplification).

## 20.10 Anti-Windup

When the actuator saturates (e.g., heater at 100% power), the integral term continues to accumulate error, growing very large. When the error finally changes sign, the massive accumulated integral drives the output far past the setpoint, causing enormous overshoot. This is **integral windup**.

The clamping anti-windup strategy: when the output hits the actuator limit, stop accumulating the integral. Resume integration only when the output comes back within the actuator's range. The pseudocode in Section 16.4 implements this.

## 20.11 Discrete PID Implementation

In LabVIEW (or any digital controller), the continuous PID equation is discretized:

$$u[n] = K_p e[n] + K_i T_s \sum_{k=0}^n e[k] + \frac{K_d}{T_s} (e[n] - e[n-1]) \quad (20.7)$$

where  $T_s$  is the sample period. The integral is a running sum (stored in a shift register). The derivative is a first difference (also using a shift register for  $e[n-1]$ ). Anti-windup: if the output exceeds actuator limits, do not update the integral sum.

### WE ThermoRig: PID Tuning for Temperature Control

The ThermoRig heater drives a 200 W ceramic element through an SSR. Using Z-N method: with PI control only, we increase  $K_p$  until sustained oscillation at  $K_u = 35$ ,  $T_u = 18$  s. Z-N PI:  $K_p = 15.75$ ,  $T_i = 15$  s ( $K_i = K_p/T_i = 1.05$ ). This produces 22% overshoot. Manual refinement: reduce  $K_p$  to 10, increase  $T_i$  to 20 s ( $K_i = 0.5$ ), add  $K_d = 5$  with a derivative filter at 10 Hz. Result: 4% overshoot, 45 s settling to  $\pm 0.5^\circ\text{C}$  of the  $80^\circ\text{C}$  setpoint. Anti-windup clamping active during large setpoint changes.

## 20.12 Practical PID Tips

**Derivative on PV, not error:** compute  $K_d \cdot d(\text{PV})/dt$  instead of  $K_d \cdot de/dt$ . This avoids the derivative spike that occurs when the setpoint changes step-wise.

**Derivative filter:** a first-order LP filter on the derivative term with cutoff at  $5\text{--}10\times$  the closed-loop bandwidth. Without it, sensor noise is amplified by the derivative gain.

**Sampling rate:** the PID loop rate must be at least  $10\times$  the closed-loop bandwidth. For a system with 5 s settling time (bandwidth  $\sim 0.2$  Hz), the loop should update at  $\geq 2$  Hz ( $T_s \leq 0.5$  s). Faster is better; 10–100 Hz is typical for thermal systems.

**Bumpless transfer:** when switching from manual to automatic mode, initialize the integral term to the current manual output to avoid an output jump.

## 20.13 PID Gain Units and Conversion

Different PID implementations use different parameterizations. The **parallel (independent)** form:  $u = K_p e + K_i \int e \, dt + K_d de/dt$ , with units  $K_p$  [output/error],  $K_i$  [output/(error·s)],  $K_d$  [output·s/error].

The **standard (ISA)** form:  $u = K_c \left( e + \frac{1}{T_i} \int e \, dt + T_d \frac{de}{dt} \right)$ , where  $K_c = K_p$  is the controller gain,  $T_i = K_p/K_i$  is the integral time (seconds), and  $T_d = K_d/K_p$  is the derivative time (seconds). Many industrial controllers and LabVIEW's PID VI use the ISA form.

Conversion:  $K_i = K_c/T_i$  and  $K_d = K_c \times T_d$ . When reading Z-N tuning tables or textbook examples, verify which form is used before entering the gains.

## 20.14 Cascade Control

For systems with multiple time constants (e.g., a heater inside an insulated chamber: fast heater response, slow chamber response), a single PID loop may not provide adequate performance. **Cascade control** uses two nested loops: an inner (fast) loop controls the heater temperature, and an outer (slow) loop controls the chamber temperature by setting the setpoint for the inner loop. The inner loop rejects disturbances (supply voltage changes) before they propagate to the outer loop, dramatically improving the overall response.

## 20.15 Feed-Forward Combined with PID

The PID controller corrects for errors after they occur (reactive). A feed-forward term can anticipate known disturbances and act before the error appears (proactive). For the ThermoRig: measuring the door-open event with a switch and immediately increasing heater power by a predetermined amount (feed-forward), while the PID handles the residual error (feedback). The combined system responds faster to disturbances than either approach alone.

## 20.16 PID Autotuning

Manual PID tuning requires expertise and time. **Autotuning** algorithms automate the process:

**Relay feedback method** (Astrom-Hagglund): replace the controller with a relay (bang-bang controller). The system oscillates at the ultimate frequency with the relay amplitude determining the ultimate gain. From  $K_u$  and  $T_u$ , compute PID gains using Z-N rules. LabVIEW's PID Autotuning VI implements this method.

**Step response method**: apply a step in the controller output (open-loop) and measure the plant's response. Fit a FOPDT model ( $K_p$ ,  $\tau$ ,  $L$ ) and compute gains using the

### Z-N Values Are Starting Points, Not Final Gains

The Ziegler-Nichols tuning rules produce aggressive gains optimized for fast disturbance rejection with approximately 25% overshoot. In practice, these gains often produce excessive oscillation, especially in systems with dead time. After applying Z-N values: (1) reduce  $K_p$  by 30–50% for smoother response, (2) increase  $T_i$  (reduce  $K_i$ ) by 50–100% to reduce integral overshoot, (3) reduce  $T_d$  ( $K_d$ ) by 50% if derivative noise is excessive. Treat Z-N as a “ballpark” that gets you close, then refine by observing the step response.

Cohen-Coon or IMC (Internal Model Control) tuning rules, which produce less aggressive tuning than Z-N.

**IMC tuning rules:** for a FOPDT plant with gain  $K$ , time constant  $\tau$ , and dead time  $L$ :  $K_p = \tau/(K\lambda)$ ,  $T_i = \tau$ ,  $T_d = L/2$ , where  $\lambda$  is the desired closed-loop time constant (user-specified tradeoff between speed and robustness). Setting  $\lambda = L$  gives aggressive tuning;  $\lambda = 3L$  gives conservative tuning.

## 20.17 Control Latency and Its Effect on Stability

### 20.17.1 What Is Control Latency?

Control latency is the total time delay between a change in the process variable and the corresponding change in the actuator output. It includes:

**Sensor delay:** the sensor's dynamic response time (first-order time constant  $\tau_s$ , Chapter 3). For a thermocouple:  $\tau_s = 0.1$ – $1$  s. For an accelerometer:  $\tau_s = 0.01$  ms (negligible for most applications).

**Acquisition delay:** the time to digitize the signal ( $1/f_s$  for one sample, plus any multiplexer settling time). At  $f_s = 100$  S/s:  $T_{\text{acq}} = 10$  ms.

**Computation delay:** the time for the MCU to execute the filter, calibration, and PID calculations. On an ESP32 at 240 MHz: typically 0.01– $1$  ms for a PID loop with filtering, negligible. On a LabVIEW VI on a desktop PC: 1– $10$  ms due to OS scheduling jitter.

**Output delay:** the time for the DAC or PWM output to reach the actuator. For PWM: up to one PWM period ( $1/f_{\text{PWM}}$ ). For a DAC: typically  $< 0.1$  ms.

**Actuator delay:** the time for the actuator to respond physically. An SSR turns on within 1 ms (zero-cross type: up to 8.3 ms in a 60 Hz system). A motor takes 10– $100$  ms to change speed (electrical time constant  $L/R$  plus mechanical time constant  $J/B$ ).

The total control latency is the sum:

$$\tau_{\text{total}} = \tau_s + T_{\text{acq}} + T_{\text{comp}} + T_{\text{out}} + \tau_{\text{act}}$$

### 20.17.2 Phase Lag from Latency

Every second of delay adds phase lag to the feedback loop. At frequency  $f$ :

$$\phi_{\text{delay}} = -360 \times f \times \tau_{\text{total}} \quad (\text{degrees}) \quad (20.8)$$

This phase lag directly reduces the phase margin. If the original system (without delay) has a phase margin of  $60^\circ\text{C}$  at crossover frequency  $f_c$ , and the total latency introduces  $\phi_{\text{delay}} = 25^\circ\text{C}$  at  $f_c$ , the effective phase margin drops to  $60 - 25 = 35^\circ\text{C}$ . If  $\phi_{\text{delay}} > 60^\circ\text{C}$ : the phase margin becomes negative and the system oscillates.

### 20.17.3 Worked Example: ThermoRig

ThermoRig latency budget: thermocouple ( $\tau_s = 0.42$  s, but this is modeled as plant dynamics, not pure delay), SSR zero-cross ( $\tau_{\text{SSR}} = 4$  ms average), LabVIEW loop ( $T_{\text{comp}} = 5$  ms), sample period ( $T_s = 100$  ms, contributes  $T_s/2 = 50$  ms of effective delay from the zero-order hold). Total pure delay:  $\tau_{\text{delay}} \approx 50 + 5 + 4 = 59$  ms  $\approx 0.06$  s.

At the crossover frequency ( $f_c \approx 0.05$  Hz):  $\phi_{\text{delay}} = 360 \times 0.05 \times 0.06 = 1.1^\circ\text{C}$ . Negligible for this slow system.

For a hypothetical motor speed controller at  $f_c = 50$  Hz with  $\tau_{\text{delay}} = 2$  ms:  $\phi_{\text{delay}} = 360 \times 50 \times 0.002 = 36^\circ\text{C}$ . This is significant and must be accounted for in the controller design.

#### 20.17.4 Reducing Latency

(1) **Increase the sample rate:** the zero-order hold contributes  $T_s/2$  of effective delay. Doubling  $f_s$  halves this contribution.

(2) **Use deterministic timing:** LabVIEW on Windows has 1–10 ms jitter due to OS scheduling. LabVIEW Real-Time (on CompactRIO or myRIO) has  $< 0.1$  ms jitter. An ESP32 running bare-metal or FreeRTOS has  $< 0.01$  ms jitter.

(3) **Minimize computation:** use fixed-point arithmetic, pre-computed lookup tables, and optimized filter implementations. Avoid dynamic memory allocation, string operations, and file I/O inside the control loop.

(4) **Use faster actuators:** if the SSR zero-cross delay ( $\leq 8.3$  ms) is significant, switch to a random-fire SSR ( $< 0.1$  ms delay, but generates more EMI) or a MOSFET-based DC switch ( $< 0.001$  ms).

#### The Rule of 20

For stable, well-damped control: the sample rate should be at least  $20\times$  the closed-loop bandwidth. This ensures the total delay from sampling ( $T_s/2$ ) contributes less than  $360/(2 \times 20) = 9^\circ\text{C}$  of phase lag, which is comfortably within most stability margins. For the ThermoRig ( $f_c = 0.05$  Hz):  $f_s \geq 1$  Hz. We use 10 Hz, giving a factor of 200 (massive margin). For a 50 Hz motor controller:  $f_s \geq 1$  kHz.

### 20.18 Practice Questions

1. A P-only controller with  $K_p = 10$  controls a heater. The setpoint is  $50^\circ\text{C}$  and the steady-state temperature reaches  $47^\circ\text{C}$ . What is the steady-state error? Why does P-only control have this offset?
2. You perform Ziegler-Nichols tuning and find  $K_u = 8.0$  and  $T_u = 2.0$  s. Calculate the PID gains ( $K_p$ ,  $K_i$ ,  $K_d$ ) using the Z-N table.
3. Explain integral windup using a concrete example (e.g., a temperature controller with a setpoint step from  $25$  to  $80^\circ\text{C}$ ). What happens, and how does anti-windup prevent it?
4. Your PID controller for motor speed works well at moderate speeds but becomes oscillatory at high speeds. What is changing, and how would you adapt the controller?
5. Implement the discrete PID equation in pseudocode. Include anti-windup (clamp the integral term when the output saturates).

#### 20.18.1 Answers

1. Steady-state error =  $50 - 47 = 3^\circ\text{C}$ . P-only control requires  $e > 0$  to produce  $u > 0$ . If  $e = 0$ , then  $u = 0$  and the heater turns off; the temperature drops until  $e$  grows enough to produce sufficient heater output. The system settles where the heat loss equals the heater output at that error level. Only integral action can drive  $e \rightarrow 0$ .

2.  $K_p = 0.60 \times 8.0 = 4.8$ .  $T_i = 2.0/2.0 = 1.0$  s, so  $K_i = K_p/T_i = 4.8$ .  $T_d = 2.0/8.0 = 0.25$  s, so  $K_d = K_p \times T_d = 1.2$ .
3. At the step from 25 to 80 °C, the error is large (55 °C) and the heater output saturates at 100%. The integral term keeps accumulating this large error (because  $e > 0$  continuously). When the temperature approaches 80 °C, the integral has grown enormously. Even after the error crosses zero, the large positive integral forces the output to stay high, causing the temperature to overshoot well past 80 °C. It takes a long time for the negative error to “unwind” the integral. Anti-windup: when the output saturates, freeze the integral accumulator (stop adding to it). When the output leaves saturation, resume integration. This limits the overshoot to the amount caused by system dynamics alone.
4. At high speeds, the plant dynamics change: the motor has less torque margin, the load-speed relationship becomes more nonlinear, and the mechanical time constant may shift. Gains tuned for moderate speeds may provide too much gain at high speeds. Solutions: (1) gain scheduling (use different PID gains at different speed ranges), (2) reduce  $K_p$  and  $K_d$  at high speeds, or (3) use a feedforward term that accounts for the known speed-torque relationship.
5. `integral = 0; prev_error = 0`  
`loop:`  
`error = setpoint - measured`  
`integral = integral + error * Ts`  
`# Anti-windup: clamp integral`  
`if integral > I_MAX: integral = I_MAX`  
`if integral < I_MIN: integral = I_MIN`  
`derivative = (error - prev_error) / Ts`  
`output = Kp*error + Ki*integral + Kd*derivative`  
`# Clamp output to actuator range`  
`if output > OUT_MAX: output = OUT_MAX`  
`if output < OUT_MIN: output = OUT_MIN`  
`prev_error = error`  
`apply(output)`  
`wait(Ts)`

✓ **Mastery Diagnostic:**

PID Control To demonstrate mastery of this module, you must be able to:

1. Explain what each PID term does and predict the effect of increasing each gain.
2. Tune a PID controller using Ziegler-Nichols and refine manually.
3. Implement anti-windup clamping and explain why it is necessary.
4. Diagnose common PID problems from time-domain response plots.
5. Configure and tune the LabVIEW PID VI, including the derivative filter  $N$ .

**Required Reading: Why Instrumentation Projects Fail**

Before your first Design Challenge, read the “Why Instrumentation Projects Fail” appendix (page 189). It consolidates the ten most common failure modes from six years of MEGN 300 projects.



# Appendix: LabVIEW Quick Reference for MEGN 300

---

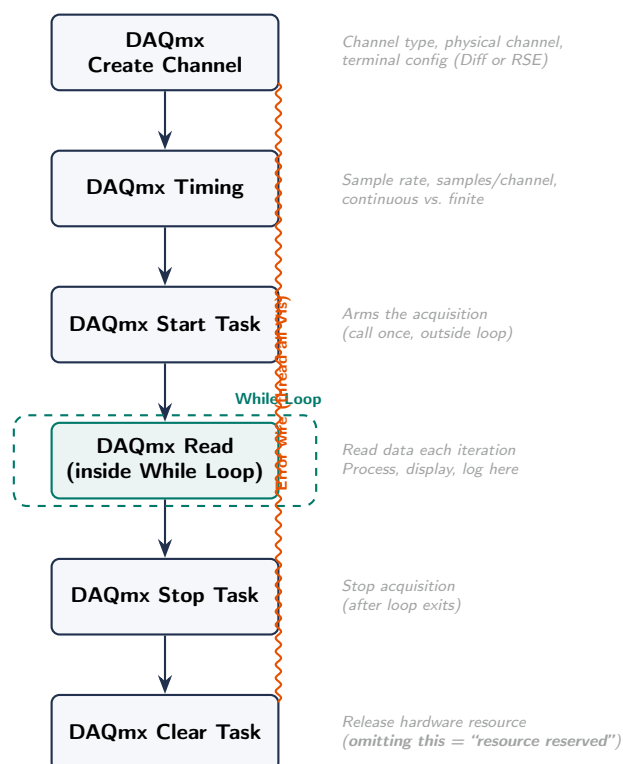


Figure 20.5: The standard DAQmx programming pattern for MEGN 300. Every LabVIEW VI that reads from the NI DAQ should follow this sequence. The error wire (orange) must connect through every VI to ensure proper cleanup on failure.

This appendix provides a condensed reference for the LabVIEW programming patterns most commonly used in MEGN 300 labs.

## Core Concepts

LabVIEW programs are called **Virtual Instruments (VIs)**. Each VI has a **Front Panel** (the user interface: controls for input, indicators for output) and a **Block Diagram** (the code: wired graphical nodes that execute dataflow). Data flows from left to right along wires; a node executes when all its inputs are available.

## DAQ Configuration

1. Open NI MAX (Measurement & Automation Explorer). Verify your DAQ device appears under “Devices and Interfaces.”
2. Right-click the device → “Test Panels” to verify analog input/output and digital I/O without writing any code.
3. In LabVIEW, use the **DAQ Assistant Express VI** for quick setup, or the **DAQmx VIs** for full control (recommended for MEGN 300 labs).

### DAQmx programming pattern:

1. DAQmx Create Virtual Channel (specify physical channel, measurement type, range).
2. DAQmx Timing (set sample rate and samples per channel).
3. DAQmx Start Task.
4. **Loop:** DAQmx Read → process data → display/log.
5. DAQmx Stop Task → DAQmx Clear Task.

## Common Programming Patterns

### While Loop with Stop Button

The fundamental LabVIEW pattern: a While Loop on the Block Diagram with a Boolean “Stop” button on the Front Panel wired to the loop’s conditional terminal. All DAQ reads, processing, and display happen inside the loop. The loop runs until the user presses Stop.

### Shift Registers for Running Calculations

Shift registers (right-click the loop border → “Add Shift Register”) pass data from one iteration to the next. Use them for: running averages, PID integral accumulation, previous-value storage (for derivative calculations), and event counting.

### Timing with Wait (ms)

Place a “Wait (ms)” function inside the While Loop to control the loop rate. For a 100 ms loop period (10 Hz): wire a constant “100” to the Wait input. Without this, the loop runs as fast as possible, consuming CPU and potentially overwhelming the DAQ.

### File I/O for Data Logging

Use the **Write to Measurement File Express VI** for simple logging, or **Write to Spreadsheet File** for custom formats. Always include a timestamp column. Log to a file *inside* the While Loop for real-time data capture; do not accumulate data in memory and write at the end (you lose everything if LabVIEW crashes).

## Signal Processing VIs

| VI / Function         | Purpose                                             | Location                     |
|-----------------------|-----------------------------------------------------|------------------------------|
| FFT Power Spectrum    | Compute single-sided amplitude or power spectrum    | Signal Processing → Spectral |
| Filter (Express VI)   | Apply LP/HP/BP/notch filter with interactive design | Signal Processing → Filters  |
| IIR/FIR Filter Design | Programmatic filter design with full control        | Signal Processing → Filters  |
| Mean / Std Dev        | Basic statistics on a waveform                      | Mathematics → Probability    |
| Curve Fit             | Polynomial or custom equation fit to data           | Mathematics → Fitting        |
| PID (autotuning)      | PID controller with autotuning option               | Control Design → PID         |
| Waveform Chart        | Real-time scrolling display                         | Graph Indicators             |
| XY Graph              | Plot any X vs. Y data (e.g., calibration curves)    | Graph Indicators             |
| Build Array / Index   | Construct and access array elements                 | Array Functions              |
| Bundle / Unbundle     | Group multiple data types into a cluster            | Cluster Functions            |

Table 20.2: Essential LabVIEW VIs for MEGN 300.

## PID Controller Implementation

LabVIEW provides a built-in PID VI (`PID.vi`) in the Control Design toolkit. Inputs: setpoint, process variable, PID gains ( $K_p$ ,  $K_i$ ,  $K_d$ ), output range, and dt. Outputs: control output and PID components (P, I, D individually for debugging).

### Implementation pattern:

1. Read the process variable from the DAQ (temperature, speed, etc.).
2. Wire the setpoint (Front Panel control) and PV to `PID.vi` inputs.
3. Wire the PID output to the actuator (DAQ analog output for motor speed, or digital output for SSR duty cycle).
4. Place `PID.vi` inside the While Loop with a consistent loop rate (e.g., 100 ms).
5. Add Front Panel controls for  $K_p$ ,  $K_i$ ,  $K_d$  so you can tune in real time.
6. Add a Waveform Chart showing setpoint, PV, and control output vs. time.

### Debugging LabVIEW VIs

- **Highlight Execution** (light bulb icon): animates dataflow so you can see values moving along wires. Slow, but reveals logic errors.
- **Probes**: right-click any wire → “Probe” to display its value in real time without adding indicators.
- **Breakpoints**: pause execution at any node to inspect data.
- **Broken wire = broken VI**: LabVIEW will not run until all wires are valid. Follow the broken wire to the source error.
- **Error clusters**: wire the “error in” and “error out” terminals of DAQmx VIs in series. If any step fails, downstream VIs skip execution and propagate the error message to a “Simple Error Handler” at the end.

## My VI is Broken: The Signal Walk Debugging Protocol

When your measurement or control system produces incorrect results, do **not** change code randomly. Walk the signal chain from physical input to software output, verifying each stage:

1. **Stage 1: Verify the raw sensor voltage with a multimeter.** Disconnect the DAQ. Measure

the sensor output directly. If the voltage is wrong here, the problem is hardware (wiring, sensor, excitation), not software.

2. **Stage 2: Verify the DAQ is reading correctly.** Reconnect the DAQ. In NI MAX Test Panels, read the analog input channel. Compare to the multimeter reading. If they disagree, check: channel number, input mode (Differential vs. RSE), input range, and wiring polarity.
3. **Stage 3: Verify the LabVIEW data path.** Add Probes (right-click wire → Probe) at key points: after the DAQ Read, after the calibration equation, after the filter, and at the PID input. Compare each value to what you expect.
4. **Stage 4: Verify the actuator responds.** Force the PID output to a manual 50% (bypass the PID, wire a constant). Does the heater/motor respond? If not, the problem is the output circuit (MOSFET, SSR, wiring), not the control algorithm.
5. **Stage 5: Close the loop.** Only after stages 1–4 pass should you troubleshoot PID tuning. If the sensor reads correctly, the actuator responds correctly, and the loop still oscillates, the gains need adjustment (reduce  $K_p$  first).

This systematic isolation prevents the most common debugging failure: “poking at the code” to fix a hardware wiring error.

## Common Mistakes in MEGN 300 Labs

1. **No loop timing:** the While Loop runs at maximum speed, overwhelming the DAQ buffer and producing erratic sampling rates. Always add a Wait (ms) function.
2. **DAQ task not closed:** forgetting DAQmx Clear Task leaves the DAQ in a locked state. The next run fails with “resource reserved.” Always wire Clear Task outside the loop (executes on exit).
3. **Wrong channel configuration:** selecting “RSE” (referenced single-ended) when the sensor requires “Differential” mode. This adds noise and ground offset errors.
4. **Waveform Chart vs. Waveform Graph:** the Chart plots data point-by-point as it arrives (real-time display). The Graph plots an entire array at once (post-acquisition). Use Chart inside the loop; Graph outside.
5. **Incorrect PID loop rate:** the PID VI uses  $dt$  in its integral and derivative calculations. If the loop rate varies (no timing control), the PID gains effectively change from iteration to iteration. Use a consistent, controlled loop period.
6. **Forgetting anti-aliasing:** sampling at 1 kS/s without a hardware anti-alias filter means any noise above 500 Hz aliases into your measurement. The NI USB-6001 has no built-in anti-alias filter; you must add an external RC or active filter.

## Part V


### Engineering Science Reference

# Fundamentals of Heat Transfer

## When to Read This Chapter

**Reference / Design Challenge:** Read when your project involves thermal management. The thermal resistance model and lumped capacitance method are particularly useful for sizing heaters, estimating cooldown times, and modeling the ThermoRig plant dynamics. **Related:** Dynamic response in Chapter 3 (p. 28); PID control in Chapter 20 (p. 211).

### Thermal Resistance Circuit

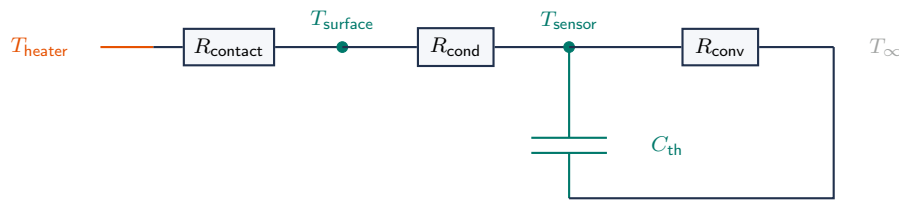

$$\text{Analogy: } \dot{Q} = \Delta T / R_{\text{th}} \text{ (cf. } I = \Delta V / R) \quad \tau = R_{\text{th}} \cdot C_{\text{th}} \text{ (cf. } \tau = RC)$$

Figure 20.6: Thermal resistance circuit for a sensor mounted on a heated surface.  $R_{\text{contact}}$  is the contact resistance (reduced by thermal paste),  $R_{\text{cond}}$  is conduction through the sensor body,  $R_{\text{conv}}$  is convection to ambient, and  $C_{\text{th}}$  is the thermal mass of the sensor. The sensor time constant  $\tau = R_{\text{th}} \cdot C_{\text{th}}$  follows exactly the same mathematics as an electrical RC circuit.

## 20.19 Why Heat Transfer Matters in Instrumentation

Temperature is the most commonly measured physical quantity in engineering. The ThermoRig system, which runs throughout this text, measures temperature and controls a heater. To design such systems intelligently, you must understand how heat moves through the system. Heat transfer determines: the sensor's time constant (how fast the thermocouple equilibrates with the medium), the heater's power requirement (how much energy is needed to maintain the setpoint), the steady-state temperature distribution (where to place the sensor for representative measurement), and the system's response to disturbances (how quickly the temperature changes when a door opens or a load changes).

This chapter provides the minimum heat transfer background needed for MEGN 300 instrumentation and control projects.

## 20.20 Modes of Heat Transfer

Heat energy transfers by three mechanisms: conduction (through solid or stationary fluid), convection (between a surface and a moving fluid), and radiation (electromagnetic waves, no medium required).

In most engineering systems, all three occur simultaneously, but one typically dominates.

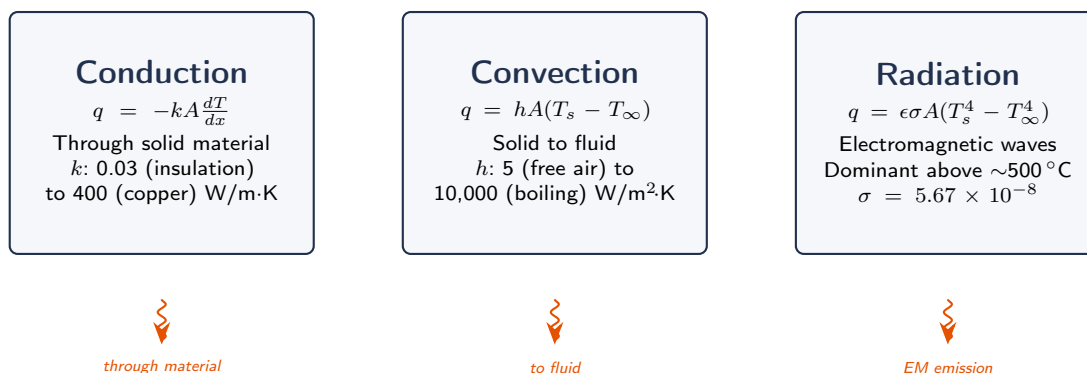


Figure 20.7: The three modes of heat transfer with governing equations and typical coefficient ranges. Convection coefficient  $h$  varies by three orders of magnitude, making it the dominant design variable for sensor thermal time constants.

## 20.21 Conduction

Conduction is heat transfer through a material by molecular vibration and free electron transport, without bulk motion of the material. Fourier's law for one-dimensional steady-state conduction through a flat plate:

$$\dot{Q} = -kA \frac{dT}{dx} = kA \frac{T_1 - T_2}{L} \quad (20.9)$$

where  $\dot{Q}$  is the heat transfer rate (W),  $k$  is the thermal conductivity (W/m·K),  $A$  is the cross-sectional area (m<sup>2</sup>),  $L$  is the thickness (m), and  $T_1 - T_2$  is the temperature difference across the plate. The heat flux (per unit area) is  $q = \dot{Q}/A = k(T_1 - T_2)/L$  (W/m<sup>2</sup>).

### 20.21.1 Thermal Conductivity

Thermal conductivity varies enormously across materials: copper  $k = 385$  W/m·K, aluminum  $k = 205$ , steel  $k = 50$ , glass  $k = 1.0$ , wood  $k = 0.15$ , polystyrene foam  $k = 0.035$ , air  $k = 0.026$ . Metals conduct well (free electrons); insulators conduct poorly (no free electrons, heat transfers by lattice vibrations only).

### 20.21.2 Thermal Resistance

By analogy to Ohm's law ( $V = IR$ ), define thermal resistance  $R_{\text{th}} = L/(kA)$  (K/W). Then  $\dot{Q} = \Delta T/R_{\text{th}}$ . For layers in series (a wall with insulation):  $R_{\text{total}} = R_1 + R_2 + \dots$ . For layers in parallel (fins):  $1/R_{\text{total}} = 1/R_1 + 1/R_2 + \dots$ . The thermal resistance analogy allows you to analyze complex heat transfer paths using circuit analysis techniques.

### 20.21.3 Composite Walls

For a wall with  $n$  layers of different materials:

$$\dot{Q} = \frac{T_{\text{hot}} - T_{\text{cold}}}{\sum_{i=1}^n L_i/(k_i A)} \quad (20.10)$$

The layer with the highest  $R_{th}$  (lowest  $k$  or greatest thickness) dominates the total resistance and limits the heat flow. This is analogous to the dominant contributor in an error budget.

### WE ThermoRig: Conduction Through the Test Specimen

The ThermoRig specimen is a 10 mm thick aluminum plate ( $k = 205 \text{ W/m}\cdot\text{K}$ ) with area  $A = 50 \times 50 \text{ mm} = 0.0025 \text{ m}^2$ . With  $\Delta T = 57^\circ\text{C}$  across the plate:  $\dot{Q} = 205 \times 0.0025 \times 57 / 0.010 = 2921 \text{ W}$ . This is very high because aluminum is an excellent conductor. If the specimen were stainless steel ( $k = 15 \text{ W/m}\cdot\text{K}$ ):  $\dot{Q} = 15 \times 0.0025 \times 57 / 0.010 = 214 \text{ W}$ . If acrylic ( $k = 0.2$ ):  $\dot{Q} = 2.85 \text{ W}$ . The material determines whether the 200 W heater is adequate.

## 20.22 Convection

Convection is heat transfer between a surface and a moving fluid (gas or liquid). Newton's law of cooling:

$$\dot{Q} = hA(T_s - T_\infty) \quad (20.11)$$

where  $h$  is the convection heat transfer coefficient ( $\text{W/m}^2\cdot\text{K}$ ),  $A$  is the surface area,  $T_s$  is the surface temperature, and  $T_\infty$  is the bulk fluid temperature far from the surface.

### 20.22.1 Natural (Free) Convection

Fluid motion driven by buoyancy (density differences caused by temperature gradients). Typical  $h$  values: still air:  $5\text{--}25 \text{ W/m}^2\cdot\text{K}$ . Still water:  $20\text{--}100 \text{ W/m}^2\cdot\text{K}$ . Natural convection is the dominant cooling mechanism for electronics enclosures, laboratory apparatus, and any surface exposed to ambient air without forced airflow.

### 20.22.2 Forced Convection

Fluid motion driven by an external source (fan, pump, wind). Typical  $h$  values: forced air (low speed):  $25\text{--}250 \text{ W/m}^2\cdot\text{K}$ . Forced air (high speed):  $250\text{--}1000$ . Forced water:  $100\text{--}20,000$ . The dramatic increase in  $h$  with forced flow is why fans are essential for cooling power electronics and why stirring a liquid dramatically accelerates heating or cooling.

### 20.22.3 Convective Thermal Resistance

$R_{conv} = 1/(hA)$  (K/W). For the ThermoRig specimen surface ( $A = 0.0025 \text{ m}^2$ ) in still air ( $h = 10 \text{ W/m}^2\cdot\text{K}$ ):  $R_{conv} = 1/(10 \times 0.0025) = 40 \text{ K/W}$ . In forced air ( $h = 100$ ):  $R_{conv} = 4 \text{ K/W}$ . The convective resistance can dominate or be negligible depending on the flow conditions.

### Estimating $h$ for Laboratory Conditions

For back-of-envelope calculations in MEGN 300:  $h \approx 10 \text{ W/m}^2\cdot\text{K}$  for still air (natural convection, small temperature difference).  $h \approx 50$  for gentle airflow from a nearby fan.  $h \approx 200$  for direct airflow from a bench fan at  $2 \text{ m/s}$ .  $h \approx 500\text{--}1000$  for water cooling. These estimates are accurate to  $\pm 50\%$ , which is often sufficient for initial design.



## 20.23 Radiation

Radiation is heat transfer by electromagnetic waves. It requires no medium and is significant at high temperatures or in vacuum. The Stefan-Boltzmann law for a gray body:

$$\dot{Q}_{\text{rad}} = \epsilon \sigma A (T_s^4 - T_{\text{surr}}^4) \quad (20.12)$$

where  $\epsilon$  is the emissivity (0–1;  $\epsilon = 1$  for a perfect blackbody,  $\epsilon \approx 0.9$  for painted surfaces,  $\epsilon \approx 0.05$  for polished metal),  $\sigma = 5.67 \times 10^{-8} \text{ W/m}^2 \cdot \text{K}^4$  is the Stefan-Boltzmann constant, and temperatures are in Kelvin.

### 20.23.1 When Radiation Matters

At low temperatures ( $<100^\circ\text{C}$ ), radiation is typically small compared to convection. At  $80^\circ\text{C}$  ( $= 353 \text{ K}$ ) with surroundings at  $20^\circ\text{C}$  ( $= 293 \text{ K}$ ),  $\epsilon = 0.9$ ,  $A = 0.0025 \text{ m}^2$ :

$$\dot{Q}_{\text{rad}} = 0.9 \times 5.67 \times 10^{-8} \times 0.0025 \times (353^4 - 293^4) = 0.9 \times 5.67 \times 10^{-8} \times 0.0025 \times (1.55 \times 10^{10} - 7.37 \times 10^9) = 1.0$$

W. Compared to convective loss of  $\dot{Q}_{\text{conv}} = 10 \times 0.0025 \times 60 = 1.5 \text{ W}$ , radiation contributes about 40% of the total heat loss. At higher temperatures or in vacuum, radiation dominates.

## 20.24 Energy Balance

The energy balance is the most powerful tool in heat transfer analysis. For any system:

$$\dot{E}_{\text{in}} - \dot{E}_{\text{out}} + \dot{E}_{\text{gen}} = \dot{E}_{\text{stored}} \quad (20.13)$$

At steady state ( $\dot{E}_{\text{stored}} = 0$ ): heat in = heat out. In transient conditions: the imbalance changes the system's thermal energy, which changes its temperature.

### 20.24.1 Steady-State Energy Balance

For the ThermoRig at steady state at  $80^\circ\text{C}$ : the heater power input must exactly balance the heat losses (conduction through insulation + convection from surfaces + radiation from surfaces). If total loss is 50 W: the heater must supply 50 W continuously. Changing the ambient temperature changes the losses, requiring the controller to adjust heater power.

### 20.24.2 Transient Energy Balance

During heating or cooling, the rate of temperature change is:

$$m C_p \frac{dT}{dt} = \dot{Q}_{\text{in}} - \dot{Q}_{\text{out}} \quad (20.14)$$

where  $m$  is the mass (kg) and  $C_p$  is the specific heat capacity ( $\text{J/kg} \cdot \text{K}$ ). For the ThermoRig aluminum specimen ( $m = 0.034 \text{ kg}$ ,  $C_p = 900 \text{ J/kg} \cdot \text{K}$ ) with 200 W heater power and 50 W losses:

$$0.034 \times 900 \times \frac{dT}{dt} = 200 - 50 = 150 \text{ W} \quad (20.15)$$

$dT/dt = 150/30.6 = 4.9^\circ\text{C/s}$ . This is the initial heating rate (when losses are small). As the specimen heats up, losses increase and  $dT/dt$  decreases, following an exponential approach to steady state.

### 20.24.3 The Lumped Capacitance Model

When the thermal resistance within the object (conduction) is much smaller than the thermal resistance at the surface (convection), the object's temperature is approximately uniform. This is the **lumped capacitance** assumption, valid when the Biot number  $Bi = hL_c/k < 0.1$ , where  $L_c = V/A_s$  is the characteristic length (volume/surface area).

Under lumped capacitance, the transient temperature response to a step change in environment is:

$$T(t) = T_\infty + (T_i - T_\infty)e^{-t/\tau}, \quad \tau = \frac{mC_p}{hA_s} = \frac{\rho VC_p}{hA_s} \quad (20.16)$$

This is a first-order response with time constant  $\tau$ . This equation directly connects heat transfer to the dynamic measurement theory of Chapter 3: the sensor's thermal time constant is  $\tau = mC_p/(hA_s)$ .

#### WE ThermoRig: Thermocouple Time Constant from Heat Transfer

A Type K thermocouple bead (diameter  $d = 1$  mm,  $\rho = 8600$  kg/m<sup>3</sup>,  $C_p = 500$  J/kg·K) in stirred water ( $h = 500$  W/m<sup>2</sup>·K). Volume  $V = \pi d^3/6 = 5.24 \times 10^{-10}$  m<sup>3</sup>. Surface area  $A_s = \pi d^2 = 3.14 \times 10^{-6}$  m<sup>2</sup>. Mass  $m = \rho V = 4.5 \times 10^{-6}$  kg. Time constant:

$$\tau = 4.5 \times 10^{-6} \times 500 / (500 \times 3.14 \times 10^{-6}) = 1.43$$

s. In still air ( $h = 10$ ):  $\tau = 71.7$  s. This explains why thermocouples respond much faster in liquids than in air: the convective resistance dominates and is  $50\times$  lower in stirred water.

## 20.25 Heat Transfer and Sensor Placement

Where you place the sensor determines what you measure. Temperature is not uniform in most systems; gradients exist due to conduction, convection, and radiation.

**Surface temperature:** mount the sensor in intimate thermal contact with the surface (thermal paste or epoxy). The sensor measures the surface temperature, not the fluid temperature. Lead wires conduct heat away from the sensor, creating “fin effects” that bias the reading toward ambient. Minimize lead wire thermal conduction by using small-diameter wire and routing leads along isotherms (not across temperature gradients).

**Fluid temperature:** immerse the sensor in the fluid with sufficient depth (at least 10 sensor diameters) to minimize conduction error along the stem. In high-velocity flow, the sensor may measure the stagnation temperature (slightly above the static temperature due to kinetic energy recovery).

**Contact resistance:** the interface between a sensor and a surface has thermal resistance from air gaps and surface roughness. Contact resistance can be  $10\times$  larger than the sensor's own thermal resistance, dominating the time constant and introducing a temperature offset. Thermal paste (zinc oxide or silicone-based) reduces contact resistance by  $5\text{--}10\times$ .

## 20.26 Thermal Design for Control Systems

When designing the ThermoRig PID control system, heat transfer analysis answers critical design questions:

**Heater power sizing:** at the maximum setpoint ( $T_{\max} = 200^\circ\text{C}$ ) with worst-case ambient ( $T_{\text{amb}} = 15^\circ\text{C}$ ), the total heat loss is

$$\dot{Q}_{\text{loss}} = (h_{\text{conv}} + h_{\text{rad}}) \times A \times (200 - 15)$$

. Size the heater for at least  $1.5 \times \dot{Q}_{\text{loss, max}}$  to ensure the controller has authority to reach the setpoint with margin.

**Insulation design:** adding insulation reduces  $\dot{Q}_{\text{loss}}$ , reducing the required heater power and making control easier (smaller disturbance sensitivity). However, insulation also increases the thermal time constant  $\tau = mC_p/(h_{\text{eff}}A)$ , making the system slower to respond.

**Achievable bandwidth:** the thermal time constant sets the fundamental speed limit. No controller can make the temperature change faster than the thermal physics allow. For the ThermoRig with  $\tau = 30$  s: the closed-loop bandwidth is limited to approximately  $1/(2\pi\tau) = 0.005$  Hz with P-only control, increased to  $\sim 0.05$  Hz with aggressive PID tuning.

## 20.27 Extended Surfaces: Fins

When natural convection from a surface is insufficient to dissipate the required heat (common in electronics cooling), **fins** (extended surfaces) increase the effective surface area. A typical heatsink is an array of aluminum fins attached to the component's case.

The fin effectiveness depends on the fin parameter  $m = \sqrt{hP/(kA_c)}$  where  $h$  is the convection coefficient,  $P$  is the fin perimeter,  $k$  is the fin thermal conductivity, and  $A_c$  is the fin cross-sectional area. The fin efficiency  $\eta_f$  (ratio of actual heat transfer to the heat transfer if the entire fin were at the base temperature):

$$\eta_f = \frac{\tanh(mL)}{mL} \quad (20.17)$$

where  $L$  is the fin length. For  $mL < 1$ :  $\eta_f > 0.76$  (efficient). For  $mL > 3$ :  $\eta_f < 0.33$  (the fin tip is near ambient temperature; the outer portion contributes little). Making fins longer beyond  $mL \approx 2.5$  has diminishing returns.

Practical rule for MEGN 300: an aluminum heatsink ( $k = 205$  W/m·K) with fins 20 mm long, 1 mm thick, in still air ( $h = 10$  W/m<sup>2</sup>·K):  $m = \sqrt{10 \times 0.042/(205 \times 0.001 \times 0.020)} = 3.2$  m<sup>-1</sup>,  $mL = 3.2 \times 0.02 = 0.064$ ,  $\eta_f = 0.9987 \approx 1.0$ . The aluminum fin is so conductive that it is essentially isothermal. Fin efficiency only becomes a concern for long fins in high- $h$  environments (forced water cooling) or for low-conductivity fin materials (steel, plastic).

## 20.28 Thermal Time Constants and Sensor Response

The lumped capacitance time constant  $\tau = mC_p/(hA_s)$  directly connects heat transfer to sensor dynamics (Chapter 3). Reducing  $\tau$  (faster sensor) requires:

**Reducing mass  $m$ :** use smaller sensor elements. A 0.25 mm diameter thermocouple bead has  $8\times$  less mass than a 0.5 mm bead, and  $4\times$  less surface area, giving  $2\times$  lower  $\tau$ .

**Increasing  $h$ :** immerse in liquid instead of air, or increase flow velocity. Moving from still air ( $h = 10$ ) to stirred water ( $h = 500$ ) reduces  $\tau$  by  $50\times$ .

**Increasing  $A_s/m$  ratio:** use thin, flat sensor elements rather than bulky probe assemblies. An exposed junction thermocouple ( $A_s/m$  ratio limited only by the wire diameter) is faster than a grounded junction in a protective sheath (which adds thermal mass without proportional surface area).

## 20.29 Thermal Interface Materials

The contact between two solid surfaces is never perfect. Microscopic surface roughness creates air gaps that act as thermal insulators. Contact resistance  $R_{\text{contact}} = 1/(h_c A)$  where  $h_c$  is the contact conductance, ranging from 3,000 W/m<sup>2</sup>·K (rough, dry metal surfaces) to 20,000 W/m<sup>2</sup>·K (smooth, greased surfaces).

Thermal interface materials (TIMs) fill the air gaps:

**Thermal paste** (silicone + ZnO or Al<sub>2</sub>O<sub>3</sub> particles):  $k = 1\text{--}5$  W/m·K. Most common for electronics. Apply a thin, uniform layer (50–100 μm). Too thick: paste itself becomes the resistance.

**Thermal pads** (silicone sheet with filler):  $k = 1\text{--}6$  W/m·K. Easier to apply than paste; maintains consistent thickness. Slightly higher resistance than paste due to greater thickness.

**Phase-change materials**: solid at room temperature, soften at operating temperature to fill gaps.  $k = 3\text{--}5$  W/m·K. Used in laptop CPU cooling.

For the ThermoRig thermocouple: attaching the bead to the specimen surface with thermal paste reduces the contact resistance from ~100 K/W (dry contact) to ~10 K/W, significantly improving the temperature measurement accuracy and reducing the apparent time constant.

## 20.30 Radiation Shields and View Factors

In high-temperature applications or vacuum environments, radiation becomes the dominant heat transfer mode. **Radiation shields** (polished metal foils between hot and cold surfaces) reduce radiative heat transfer by introducing additional resistances in the radiation path. Each shield approximately halves the radiation heat transfer. Three shields reduce it by ~8×.

The **view factor**  $F_{12}$  describes the fraction of radiation leaving surface 1 that reaches surface 2. For two parallel plates:  $F_{12} \approx 1$ . For a small surface facing a large enclosure:  $F_{12} = 1$ . For a sensor mounted on a surface facing a room:  $F_{12}$  depends on the geometry but is typically 0.5–0.8. The radiation exchange between surfaces 1 and 2:

$$\dot{Q}_{12} = \sigma A_1 F_{12} \frac{T_1^4 - T_2^4}{1/\epsilon_1 + A_1/A_2(1/\epsilon_2 - 1)} \quad (20.18)$$

For MEGN 300 applications at moderate temperatures (< 200 °C), the simplified form  $\dot{Q}_{\text{rad}} = \epsilon \sigma A (T_s^4 - T_{\text{surr}}^4)$  with  $\epsilon$  as the surface emissivity is usually sufficient.

## 20.31 Dimensional Analysis and Nusselt Number

In advanced heat transfer, the convection coefficient  $h$  is predicted using dimensionless correlations. The **Nusselt number**  $\text{Nu} = hL/k_{\text{fluid}}$  is the dimensionless heat transfer coefficient. It depends on the **Reynolds number**  $\text{Re} = \rho vL/\mu$  (forced convection) or the **Rayleigh number**  $\text{Ra} = g\beta\Delta TL^3/(\nu\alpha)$  (natural convection).

For natural convection from a vertical plate:  $\text{Nu} = 0.59 \text{Ra}^{1/4}$  for  $10^4 < \text{Ra} < 10^9$ . This allows you to estimate  $h$  from the geometry and temperature difference without experimental measurement.

While you will not need to use these correlations for MEGN 300 labs (the empirical  $h$  estimates are sufficient), understanding that  $h$  can be predicted from fluid mechanics principles connects instrumentation to your heat transfer coursework.

## 20.32 Heat Transfer Coefficient Estimation

For back-of-envelope calculations without solving the full convection equations, use these empirical correlations:

**Natural convection from a vertical plate** (laminar,  $Ra < 10^9$ ):

$$h \approx 1.42 \left( \frac{\Delta T}{L} \right)^{0.25} \text{ W/m}^2\text{K (in air)} \quad (20.19)$$

For a 100 mm plate at  $\Delta T = 50^\circ\text{C}$ :  $h \approx 1.42 \times (50/0.1)^{0.25} = 1.42 \times 4.73 = 6.7 \text{ W/m}^2\cdot\text{K}$ .

**Forced convection over a flat plate** (turbulent,  $Re > 5 \times 10^5$ ):

$$h \approx 0.037 \frac{k_{\text{air}}}{L} Re^{0.8} Pr^{0.33} \quad (20.20)$$

For air at 2 m/s over a 100 mm plate:  $Re = 1.2 \times 2 \times 0.1 / (1.8 \times 10^{-5}) = 13,333$  (laminar). Use the laminar correlation instead:

$$h \approx 0.664 \times (0.026/0.1) \times 13333^{0.5} \times 0.71^{0.33} = 0.172 \times 115.5 \times 0.89 = 17.7$$

$\text{W/m}^2\cdot\text{K}$ .

## 20.33 Transient Heating and Cooling Curves

The lumped capacitance model produces exponential heating/cooling curves that directly determine measurement system behavior:

**Heating:**  $T(t) = T_{ss} - (T_{ss} - T_i)e^{-t/\tau}$  where  $T_{ss} = T_{\text{amb}} + \dot{Q}_{\text{heater}}/(hA)$  is the steady-state temperature and  $\tau = mC_p/(hA)$ .

**Cooling** (heater off):  $T(t) = T_{\text{amb}} + (T_i - T_{\text{amb}})e^{-t/\tau}$ .

The time to reach a target temperature (within  $\delta$  of  $T_{ss}$ ):  $t_{\text{settle}} = \tau \ln((T_{ss} - T_i)/\delta)$ . For  $T_i = 22^\circ\text{C}$ ,  $T_{ss} = 80^\circ\text{C}$ ,  $\delta = 0.5^\circ\text{C}$ :  $t = \tau \ln(58/0.5) = 4.76\tau$ . With  $\tau = 30 \text{ s}$ :  $t = 143 \text{ s} \approx 2.4 \text{ minutes}$  to settle within  $0.5^\circ\text{C}$  of setpoint.

## 20.34 Multi-Node Thermal Models

When the lumped capacitance assumption is not valid ( $Bi > 0.1$ ), the system must be modeled with multiple thermal nodes, each with its own temperature. The ThermoRig with a thick steel specimen might require three nodes: (1) heater surface, (2) specimen center, (3) specimen surface exposed to air.

Each node has a thermal capacitance  $C_i = m_i C_{p,i}$  and is connected to adjacent nodes by thermal resistances  $R_{ij}$ . The energy balance for each node:

$$C_i \frac{dT_i}{dt} = \sum_j \frac{T_j - T_i}{R_{ij}} + \dot{Q}_{i,\text{ext}} \quad (20.21)$$

This system of ODEs can be solved in LabVIEW using the “ODE Solver” VI, MATLAB’s `ode45`, or a simple Euler integration in a While Loop.

The multi-node model reveals internal temperature gradients. The heater surface may be at  $120^\circ\text{C}$  while the measurement surface is at  $80^\circ\text{C}$ . If the thermocouple is on the measurement surface, the controller “sees”  $80^\circ\text{C}$ , but the heater is already at its thermal limit. This mismatch between the controlled variable and the constraint variable is a common cause of heater failure in poorly designed thermal systems.

## 20.35 Practice Questions

1. A steel plate ( $k = 50 \text{ W/m}\cdot\text{K}$ ) is 5 mm thick with area  $100 \text{ cm}^2$ . If one face is at  $120^\circ\text{C}$  and the other at  $80^\circ\text{C}$ , what is the heat transfer rate?
2. The ThermoRig specimen (aluminum,  $m = 34 \text{ g}$ ,  $C_p = 900 \text{ J/kg}\cdot\text{K}$ ) is heated by a  $100 \text{ W}$  heater in still air ( $h = 10 \text{ W/m}^2\cdot\text{K}$ ,  $A = 50 \text{ cm}^2$ ). Write the energy balance and find the steady-state temperature (ambient:  $22^\circ\text{C}$ ).
3. Calculate the Biot number for the thermocouple bead in the worked example. Is the lumped capacitance assumption valid?
4. A copper block ( $k = 385 \text{ W/m}\cdot\text{K}$ ,  $\rho = 8960 \text{ kg/m}^3$ ,  $C_p = 385 \text{ J/kg}\cdot\text{K}$ ) is a  $20 \text{ mm}$  cube cooled by forced air ( $h = 100 \text{ W/m}^2\cdot\text{K}$ ). Calculate the time constant and the time to cool from  $100^\circ\text{C}$  to within  $1^\circ\text{C}$  of ambient ( $25^\circ\text{C}$ ).
5. Explain why a thermocouple in still air has a time constant  $50\times$  longer than the same thermocouple in stirred water. Which physical parameter changes, and by how much?

### 20.35.1 Answers

1.  $\dot{Q} = 50 \times 0.01 \times (120 - 80)/0.005 = 4000 \text{ W}$ . The thin steel plate conducts very effectively.
2. Energy balance:

$$100 = 10 \times 0.005 \times (T_{ss} - 22) + \epsilon\sigma \times 0.005 \times (T_{ss}^4 - 295^4)$$

. Neglecting radiation as first approximation:  $100 = 0.05(T_{ss} - 22)$ ,  $T_{ss} = 2022^\circ\text{C}$ . This is clearly too high, the steady state would be limited by the heater surface area and the onset of higher convection at elevated temperatures. In practice, the specimen reaches the heater's surface temperature limit ( $\sim 200^\circ\text{C}$  for ceramic heaters) and the energy balance includes radiation and increased natural convection ( $h$  increases with  $\Delta T$ ). A more realistic  $h = 15 \text{ W/m}^2\cdot\text{K}$  with radiation ( $h_{\text{rad}} \approx 5$  at moderate temperatures):  $100 = (15 + 5) \times 0.005 \times (T_{ss} - 22)$ ,  $T_{ss} = 1022^\circ\text{C}$ . The problem illustrates that  $100 \text{ W}$  is far more power than needed for a small specimen in air.

3.

$$L_c = V/A_s = (5.24 \times 10^{-10})/(3.14 \times 10^{-6}) = 1.67 \times 10^{-4}$$

m. In water ( $h = 500$ ):  $\text{Bi} = 500 \times 1.67 \times 10^{-4}/22 = 0.0038 \ll 0.1$ . Lumped capacitance is valid ( $k_{\text{chromel}} \approx 22 \text{ W/m}\cdot\text{K}$ ).

4.  $V = (0.02)^3 = 8 \times 10^{-6} \text{ m}^3$ .  $A_s = 6 \times (0.02)^2 = 2.4 \times 10^{-3} \text{ m}^2$ .  $m = 8960 \times 8 \times 10^{-6} = 0.0717 \text{ kg}$ .  $\tau = 0.0717 \times 385/(100 \times 2.4 \times 10^{-3}) = 115 \text{ s}$ . Time to  $1^\circ\text{C}$  of ambient:  $T(t) = 25 + 75e^{-t/115} = 26^\circ\text{C}$  when  $75e^{-t/115} = 1$ ,  $t = 115 \ln(75) = 115 \times 4.32 = 497 \text{ s} \approx 8.3 \text{ min}$ .
5. The time constant  $\tau = mC_p/(hA_s)$  is inversely proportional to  $h$ . Only  $h$  changes: from  $\sim 10 \text{ W/m}^2\cdot\text{K}$  in still air to  $\sim 500 \text{ W/m}^2\cdot\text{K}$  in stirred water ( $50\times$  increase). All other parameters ( $m$ ,  $C_p$ ,  $A_s$ ) are properties of the thermocouple and do not change with the medium.

# Fundamentals of Fluid Power

## When to Read This Chapter

**Module 8C / Reference:** Read when your design challenge involves fluid systems (pumps, valves, flow measurement). Focus on Bernoulli's equation, flow measurement techniques, and the hydraulic system design section. **Related:** Sensors in Chapter 6 (p. 62); high-power switching for pump/valve control in Chapter 16 (p. 167).

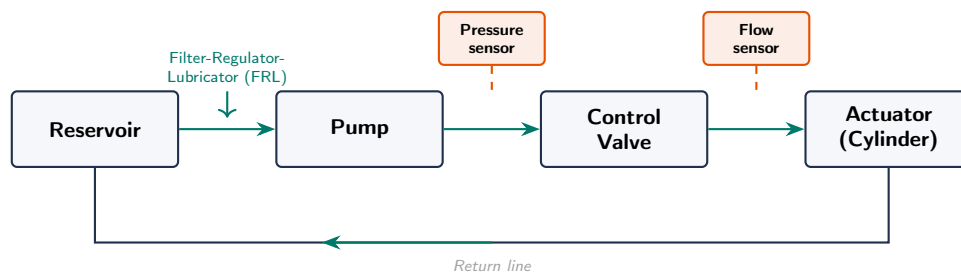


Figure 20.8: Basic hydraulic system schematic showing the flow path from reservoir through pump, control valve, and actuator, with return line. Pressure and flow sensors (orange) provide the measurement signals for monitoring and closed-loop control. Pneumatic systems follow the same topology but add a filter-regulator-lubricator (FRL) unit upstream.

Fluid power systems use pressurized liquids (hydraulics) or gases (pneumatics) to transmit force and motion. While MEGN 300 focuses on electrical instrumentation, many measurement and control systems interface with fluid systems: pressure sensors monitor hydraulic circuits, flow sensors meter process streams, and control valves regulate flow in response to PID commands. This chapter provides the fluid mechanics and system-level knowledge needed to instrument, model, and control fluid power systems.

## 20.36 Fluid Properties and Fundamentals

**Pressure** ( $P$ , measured in pascals,  $\text{Pa} = \text{N}/\text{m}^2$ , or  $\text{psi} = \text{lbf}/\text{in}^2$ ): force per unit area. Gauge pressure is referenced to atmospheric; absolute pressure is referenced to vacuum:  $P_{\text{abs}} = P_{\text{gauge}} + P_{\text{atm}}$ . Standard atmosphere:  $101.325 \text{ kPa} = 14.696 \text{ psi} = 1.013 \text{ bar} = 760 \text{ mmHg}$ .

**Density** ( $\rho$ ,  $\text{kg}/\text{m}^3$ ): mass per unit volume. Water:  $998 \text{ kg}/\text{m}^3$  at  $20^\circ\text{C}$ . Hydraulic oil:  $850\text{--}900 \text{ kg}/\text{m}^3$ . Air at sea level:  $1.225 \text{ kg}/\text{m}^3$ .

**Viscosity**: resistance to flow. **Dynamic viscosity** ( $\mu$ ,  $\text{Pa}\cdot\text{s}$ ): water at  $20^\circ\text{C}$  is  $1.002 \times 10^{-3} \text{ Pa}\cdot\text{s}$ ; hydraulic oil is  $10\text{--}100\times$  higher. **Kinematic viscosity** ( $\nu = \mu/\rho$ ,  $\text{m}^2/\text{s}$ ): determines flow regime (laminar vs. turbulent) via the Reynolds number.

**Compressibility**: liquids are nearly incompressible (bulk modulus of water:  $2.2 \text{ GPa}$ ; hydraulic oil:  $1.4\text{--}1.7 \text{ GPa}$ ). Gases are highly compressible. This fundamental difference drives the design split between hydraulic and pneumatic systems.



**Pascal's Law:** pressure applied to a confined fluid is transmitted equally in all directions. This is the operating principle of hydraulic presses, brakes, and jacks: a small force on a small piston generates a large force on a large piston ( $F_2 = F_1 \times A_2/A_1$ ).

## 20.37 Hydrostatics: Pressure in Stationary Fluids

In a stationary fluid, pressure increases with depth:

$$P = P_0 + \rho gh \quad (20.22)$$

where  $P_0$  is the surface pressure,  $\rho$  is the fluid density,  $g = 9.81 \text{ m/s}^2$ , and  $h$  is the depth below the surface. For water: pressure increases by 9.81 kPa per meter of depth (approximately 1 psi per 2.3 ft).

**Manometers** exploit this relationship: a U-tube containing a liquid of known density measures pressure difference as a height difference. The differential pressure is  $\Delta P = \rho_{\text{manometer}} g \Delta h$ . Mercury manometers (mmHg) and water manometers (cmH<sub>2</sub>O) are traditional calibration references.

## 20.38 Fluid Dynamics: Flow in Pipes and Channels

### 20.38.1 Reynolds Number and Flow Regime

The Reynolds number determines whether flow is laminar (smooth, parallel streamlines) or turbulent (chaotic, mixing):

$$\text{Re} = \frac{\rho v D}{\mu} = \frac{v D}{\nu} \quad (20.23)$$

where  $v$  is the average flow velocity,  $D$  is the pipe inner diameter, and  $\mu$  is dynamic viscosity. For pipe flow:  $\text{Re} < 2300$  is laminar,  $2300 < \text{Re} < 4000$  is transitional, and  $\text{Re} > 4000$  is turbulent. Most industrial flows are turbulent.

### 20.38.2 Bernoulli's Equation

For steady, incompressible, inviscid flow along a streamline:

$$P_1 + \frac{1}{2} \rho v_1^2 + \rho g z_1 = P_2 + \frac{1}{2} \rho v_2^2 + \rho g z_2 \quad (20.24)$$

This conservation of energy equation connects pressure, velocity, and elevation. It is the foundation of many flow measurement devices: Venturi meters, orifice plates, and Pitot tubes all create a velocity change that produces a measurable pressure difference.

### 20.38.3 Continuity Equation

For incompressible flow, mass conservation requires:

$$A_1 v_1 = A_2 v_2 = Q \quad (\text{volumetric flow rate}) \quad (20.25)$$

where  $Q$  is in  $\text{m}^3/\text{s}$  (or L/min, GPM). If a pipe narrows, velocity increases and pressure decreases (Bernoulli). This acceleration is what creates the pressure drop in a Venturi tube.



### 20.38.4 Pressure Drop in Pipes

Real fluids have viscosity, which causes energy loss as fluid flows through pipes. The Darcy-Weisbach equation gives the pressure drop for fully developed flow:

$$\Delta P = f \frac{L}{D} \frac{\rho v^2}{2} \quad (20.26)$$

where  $f$  is the Darcy friction factor (from the Moody chart: depends on Re and pipe roughness),  $L$  is the pipe length, and  $D$  is the diameter. Fittings (elbows, tees, valves) add equivalent lengths or loss coefficients:  $\Delta P_{\text{fitting}} = K \frac{\rho v^2}{2}$ .

#### Quick Pipe Sizing

For water in smooth pipe at moderate flow rates: pressure drop of approximately 1–2 psi per 10 ft of pipe at recommended velocities (3–8 ft/s for water, 1–3 ft/s for hydraulic oil). If pressure drop is excessive, increase pipe diameter; doubling the diameter reduces  $\Delta P$  by  $32\times$  (Darcy-Weisbach scales as  $D^{-5}$  for fixed flow rate).

## 20.39 Flow Measurement

### 20.39.1 Differential Pressure Methods

These methods create a constriction that accelerates the fluid, producing a pressure drop related to flow velocity by Bernoulli's equation.

**Orifice plate:** a flat plate with a circular hole installed in the pipe. Simplest and cheapest.  $Q = C_d A_o \sqrt{2\Delta P/\rho}$  where  $C_d$  is the discharge coefficient ( $\sim 0.6$  for a sharp-edge orifice) and  $A_o$  is the orifice area. Permanent pressure loss is high (40–90% of measured  $\Delta P$ ).

**Venturi tube:** a gradually converging section followed by a gradual divergence. Higher  $C_d$  ( $\sim 0.98$ ) and much lower permanent pressure loss (5–15%). More expensive and larger than an orifice plate.

**Pitot tube:** measures the difference between stagnation pressure (total) and static pressure at a point in the flow:  $v = \sqrt{2\Delta P/\rho}$ . Measures velocity at a single point; must traverse the cross-section to find average velocity.

### 20.39.2 Positive Displacement Flowmeters

Trap a fixed volume of fluid per revolution or cycle and count the cycles. Examples: oval gear, nutating disc, and piston meters. Very accurate ( $\pm 0.1$ – $0.5\%$ ) and measure total volume directly. Used for custody transfer (fuel dispensing, water metering).

### 20.39.3 Turbine Flowmeters

A rotor spins at a speed proportional to flow velocity. A magnetic pickup generates one pulse per blade passage. Frequency output is proportional to flow rate. Good accuracy ( $\pm 0.5$ – $1\%$ ) and fast response. Requires clean fluid (particles damage bearings).

### 20.39.4 Ultrasonic Flowmeters

Transit-time type: measure the difference in ultrasonic pulse travel time upstream vs. downstream. Clamp-on versions require no pipe modification. Doppler type: measure frequency shift of ultrasonic pulses reflected off particles or bubbles (requires some particulate in the fluid).

### 20.39.5 Electromagnetic Flowmeters

A conductive fluid flowing through a magnetic field generates a voltage proportional to velocity (Faraday's law):  $V = BDv$  where  $B$  is the magnetic flux density and  $D$  is the pipe diameter. No moving parts, no obstruction, works with dirty or corrosive fluids. Requires conductive fluid (water, brine, slurries; not hydrocarbons).

#### WE ThermoRig: Cooling Loop Flow Measurement

The ThermoRig cooling loop circulates water at 2 L/min through a 10 mm ID tube. To measure flow rate: a small turbine flowmeter (Gems FT-110, pulse output) installed in the tube produces 2700 pulses per liter. At 2 L/min:  $2 \times 2700 = 5400$  pulses/min = 90 Hz. The ESP32 measures the pulse frequency with a hardware timer/counter and converts to flow rate. Flow velocity:  $v = Q/A = (2/60 \times 10^{-3})/((\pi/4)(0.01)^2) = 0.42$  m/s. Reynolds number:  $Re = 998 \times 0.42 \times 0.01/0.001 = 4192$  (transitional). The flow measurement resolution depends on the counting interval: over 1 s, the resolution is  $1/2700 = 0.37$  mL, or  $\pm 0.02$  L/min.

## 20.40 Hydraulic Systems

Hydraulic systems use pressurized oil (typically 100–350 bar, 1500–5000 psi) to transmit large forces through compact actuators. Key components:

**Pump:** converts mechanical energy (from an electric motor or engine) into fluid flow at pressure. Types: gear (fixed displacement, simple, tolerant of contamination), vane (variable displacement, quieter), and piston (highest pressure and efficiency, most expensive).

**Actuators:** hydraulic cylinders (linear motion) and hydraulic motors (rotary motion). A 50 mm bore cylinder at 200 bar produces  $F = P \times A = 200 \times 10^5 \times (\pi/4)(0.05)^2 = 39.3$  kN ( $\sim 8800$  lbf) from a compact package.

**Directional control valves:** route fluid to actuators. Described by number of ports and positions ( $4/3$  = four ports, three positions). Center condition (what happens when the valve is centered) affects system behavior: closed-center locks the actuator in place; open-center allows free movement; tandem-center unloads the pump while holding the actuator.

**Pressure relief valve:** limits maximum system pressure by diverting flow back to the tank when pressure exceeds the set point. This is the primary safety device in any hydraulic circuit.

**Reservoir (tank):** stores fluid, allows air separation, and dissipates heat. Rule of thumb: tank capacity =  $3 \times$  pump flow rate (a 10 L/min pump needs a 30 L tank).

#### Hydraulic Safety

Hydraulic systems operate at pressures that can cause severe injury or death. A 200 bar (3000 psi) pinhole leak produces a jet that can penetrate skin and inject fluid into tissue (fluid injection injury, a surgical emergency). Never use your hand to check for leaks; use a piece of cardboard. Always relieve pressure before disconnecting fittings. Wear safety glasses when working near pressurized lines.

## 20.41 Pneumatic Systems

Pneumatic systems use compressed air (typically 4–8 bar, 60–120 psi) for force transmission and automation. Advantages over hydraulics: air is free, clean, and non-flammable; leaks are not messy; systems are simpler and cheaper. Disadvantages: lower force density (lower pressure), compressible fluid makes precise speed and position control difficult, and air must be dried and filtered (moisture causes corrosion and freezing in exhaust).

**Compressor:** generates compressed air. Types: reciprocating (piston), rotary screw, and diaphragm. Compressed air is stored in a receiver tank that smooths pressure pulsations.

**Air preparation unit (FRL):** Filter (removes particles and water), Regulator (reduces and stabilizes pressure), Lubricator (adds oil mist for lubrication of downstream components). Always install an FRL before pneumatic actuators.

**Pneumatic cylinders:** same principle as hydraulic cylinders but at lower pressure. A 50 mm bore cylinder at 6 bar produces  $F = 6 \times 10^5 \times (\pi/4)(0.05)^2 = 1.18 \text{ kN}$  ( $\sim 265 \text{ lbf}$ ). Adequate for clamping, pushing, and light automation.

**Proportional control:** unlike hydraulics, pneumatic systems are challenging to control proportionally due to air compressibility. Proportional valves and electronic pressure regulators enable closed-loop pressure and position control, but with lower bandwidth and precision than hydraulic equivalents.

## 20.42 Control Valves for Process Control

A **control valve** is the “final control element” in a feedback loop that regulates flow, pressure, or level. The PID controller (Chapter 17) sends a command signal (typically 4–20 mA or 0–10 V), and the valve adjusts its opening to achieve the desired flow rate.

**Valve characteristics:** describe the relationship between valve opening (0–100%) and flow. **Linear:** flow is proportional to opening (used when the system pressure drop is primarily across the valve). **Equal-percentage:** each increment of opening changes flow by a constant percentage of the current flow (used when the system pressure drop varies with flow, which is most common). **Quick-opening:** large flow change at small openings (used for on/off service).

**Valve sizing:** the flow coefficient  $C_v$  relates flow rate to pressure drop:  $Q = C_v \sqrt{\Delta P / SG}$  where  $Q$  is in GPM and  $SG$  is specific gravity. Select a valve with  $C_v$  large enough for the maximum required flow, but not so large that the valve operates below 20% opening at normal flow (poor control resolution).

### Requirements Mapping: Fluid Power Instrumentation

“The hydraulic pressure sensor shall measure 0–250 bar with  $\pm 0.5\%$  FS accuracy and a 4–20 mA output.” “The flow control valve shall have an equal-percentage characteristic with  $C_v = 12$  and a pneumatic actuator with 4–20 mA positioner input.” “The cooling loop flow sensor shall measure 0.5–5.0 L/min with  $\pm 3\%$  accuracy and a digital pulse output.” “Pneumatic supply pressure shall be regulated to  $6.0 \pm 0.2$  bar at the FRL unit.”

## 20.43 Practice Questions

1. Water flows through a 25 mm ID pipe at 3 L/min. Calculate the flow velocity, the Reynolds number (at 20 °C), and determine if the flow is laminar or turbulent.

2. An orifice plate with a 10 mm bore is installed in a 25 mm pipe carrying water. If the differential pressure across the orifice is 15 kPa, what is the volumetric flow rate? Use  $C_d = 0.62$ .
3. A hydraulic cylinder has a bore of 75 mm and operates at 150 bar. What force does it produce? If the piston must extend 200 mm in 2 s, what pump flow rate is needed?

### 20.43.1 Answers

1.  $A = (\pi/4)(0.025)^2 = 4.91 \times 10^{-4} \text{ m}^2$ .  $v = Q/A = (3/60 \times 10^{-3})/4.91 \times 10^{-4} = 0.102 \text{ m/s}$ .  
 $\text{Re} = 998 \times 0.102 \times 0.025/0.001 = 2540$ . This is in the transitional regime ( $2300 < \text{Re} < 4000$ ); flow may be laminar or turbulent depending on pipe roughness and upstream conditions.
2.  $A_o = (\pi/4)(0.01)^2 = 7.85 \times 10^{-5} \text{ m}^2$ .  
 $Q = C_d A_o \sqrt{2\Delta P/\rho} = 0.62 \times 7.85 \times 10^{-5} \times \sqrt{2 \times 15000/998} = 4.87 \times 10^{-5} \times 5.48 = 2.67 \times 10^{-4} \text{ m}^3/\text{s} = 16.0 \text{ L/min}$ .
3.  $A = (\pi/4)(0.075)^2 = 4.42 \times 10^{-3} \text{ m}^2$ .  $F = P \times A = 150 \times 10^5 \times 4.42 \times 10^{-3} = 66.3 \text{ kN}$  ( $\sim 14,900 \text{ lbf}$ ).  
Volume for 200 mm extension:  $V = A \times L = 4.42 \times 10^{-3} \times 0.2 = 8.84 \times 10^{-4} \text{ m}^3 = 0.884 \text{ L}$ . Flow rate:  $Q = V/t = 0.884/2 = 0.442 \text{ L/s} = 26.5 \text{ L/min}$ . Select a pump rated for at least 30 L/min to allow for leakage and margin.

# Glossary of Key Terms and Acronyms

---

**AC** Alternating Current. Current that periodically reverses direction; characterized by frequency and RMS amplitude.

**ADC** Analog-to-Digital Converter. Converts a continuous analog voltage to a discrete digital number.

## **Aliasing**

The misidentification of a high-frequency signal as a lower frequency due to insufficient sampling rate. Prevented by sampling at  $> 2f_{\max}$  (Nyquist criterion) and using anti-alias filters.

## **Bandwidth**

The range of frequencies a system can process or transmit. For amplifiers: the frequency range over which gain is within 3 dB of the midband value.

## **Biot Number (Bi)**

Dimensionless ratio  $Bi = hL_c/k$  comparing internal conduction resistance to external convection resistance. If  $Bi < 0.1$ , the lumped capacitance assumption is valid.

**BJT** Bipolar Junction Transistor. A current-controlled semiconductor switch (NPN or PNP).

## **Buck Converter**

A switching DC-DC converter that steps voltage down.  $V_{\text{out}} = D \times V_{\text{in}}$ .

## **Boost Converter**

A switching DC-DC converter that steps voltage up.  $V_{\text{out}} = V_{\text{in}}/(1 - D)$ .

## **Calibration**

The process of comparing a measurement device's output to a known standard and applying corrections to minimize systematic error.

## **CMRR**

Common-Mode Rejection Ratio. Measures an amplifier's ability to reject signals common to both inputs. Higher is better; instrumentation amplifiers achieve 80–120 dB.

**DAC** Digital-to-Analog Converter. Converts a digital number to an analog voltage or current.

**DAQ** Data Acquisition. The process of sampling signals from sensors and converting them to digital data for processing.

**dB** Decibel. A logarithmic unit:  $\text{dB} = 20 \log_{10}(V_{\text{out}}/V_{\text{in}})$ . Used for gain, attenuation, and signal levels.

**DC** Direct Current. Current that flows in one direction at a constant (or slowly varying) magnitude.

**DFT/FFT**

Discrete Fourier Transform / Fast Fourier Transform. Decomposes a time-domain signal into its frequency components. The FFT is an efficient algorithm for computing the DFT.

**Duty Cycle ( $D$ )**

The fraction of a PWM period during which the signal is HIGH.  $D = t_{\text{on}}/T$ .

**ENOB**

Effective Number of Bits. The actual resolution of an ADC after accounting for noise:  $\text{ENOB} = (\text{SINAD} - 1.76)/6.02$ .

**ESD** Electrostatic Discharge. A sudden flow of electricity between two objects at different potentials. Damages CMOS components.

**FIR** Finite Impulse Response. A digital filter type with guaranteed stability and exactly linear phase. Requires more computation than IIR for the same rolloff.

**Flyback Diode**

A diode placed across an inductive load to clamp voltage spikes when the current is switched off. Essential for all motor, solenoid, and relay circuits.

**GBW**

Gain-Bandwidth Product. For an op-amp,  $\text{GBW} = A_v \times f$ . The maximum usable frequency at gain  $G$  is  $f_{\text{max}} = \text{GBW}/G$ .

**GPIO**

General-Purpose Input/Output. A digital pin on a microcontroller configurable as input or output.

**Ground Loop**

A closed loop formed by multiple ground connections that picks up magnetically induced noise. Eliminated by star grounding.

**GUM** Guide to the Expression of Uncertainty in Measurement (JCGM 100:2008). The international standard for reporting measurement uncertainty.

**H-Bridge**

A circuit of four switches that drives a motor in both directions by reversing current flow.

**IIR** Infinite Impulse Response. A digital filter type that uses feedback; efficient but can be unstable and has nonlinear phase.

**INA** Instrumentation Amplifier. A precision differential amplifier with very high input impedance and high CMRR, designed for low-level sensor signals.

**KCL** Kirchhoff's Current Law. The sum of currents entering a node equals the sum leaving.

**KVL** Kirchhoff's Voltage Law. The sum of voltages around any closed loop is zero.

**LDO** Low-Dropout Regulator. A linear voltage regulator that requires only a small voltage differential between input and output.

**MOSFET**

Metal-Oxide-Semiconductor Field-Effect Transistor. A voltage-controlled semiconductor switch. N-channel is most common for low-side switching.

**MTBF**

Mean Time Between Failures. Average operating time before a system failure.

**MTTR**

Mean Time To Repair. Average time to restore a failed system to operation.

**Nyquist Frequency**

Half the sampling rate ( $f_s/2$ ). The maximum frequency that can be correctly represented in a sampled signal.

**Op-Amp**

Operational Amplifier. A high-gain differential amplifier used as a building block for signal conditioning circuits.

**PID** Proportional-Integral-Derivative controller. The standard feedback controller combining proportional response, integral error elimination, and derivative damping.

**PWM**

Pulse Width Modulation. A technique for controlling average power by varying the duty cycle of a square wave.

**Quantization**

The process of mapping a continuous value to the nearest discrete level in an ADC. Introduces quantization noise with RMS value  $q/\sqrt{12}$  where  $q$  is the LSB size.

**RMS** Root Mean Square. The effective value of an AC signal:  $V_{\text{RMS}} = V_{\text{peak}}/\sqrt{2}$  for sinusoidal signals.

**RTD** Resistance Temperature Detector. A temperature sensor based on the change of electrical resistance with temperature (typically platinum, Pt100).

**Sensitivity**

The ratio of output change to input change:  $S = \Delta V_{\text{out}}/\Delta x_{\text{measurand}}$ . Units depend on the sensor type.

**SINAD**

Signal-to-Noise and Distortion ratio. Measures total signal quality including harmonic distortion.

**SNR** Signal-to-Noise Ratio. The ratio of signal power to noise power, usually expressed in dB.

**SSR** Solid-State Relay. A relay using semiconductor switching instead of mechanical contacts. No moving parts, faster, longer life.

**Thevenin Equivalent**

Any linear circuit reduced to a voltage source ( $V_{Th}$ ) in series with a resistance ( $R_{Th}$ ).

**Time Constant ( $\tau$ )**

The time for a first-order system to reach 63.2% of its final value. For RC circuits:  $\tau = RC$ . For RL:  $\tau = L/R$ . For thermal:  $\tau = mC_p/(hA)$ .

**Type I/II/III Error**

Type I: false positive (rejecting a true null hypothesis). Type II: false negative (failing to reject a false null). Type III: correctly rejecting the null but for the wrong reason (asking the wrong question).

**Uncertainty**

A quantitative estimate of the range within which the true value of a measurand is expected to lie, expressed at a stated confidence level (typically 95%).

**Wheatstone Bridge**

A circuit of four resistances used to detect small resistance changes in sensors (strain gauges, RTDs). Produces a voltage proportional to the fractional resistance change.

**Z-Transform**

The discrete-time equivalent of the Laplace transform. Maps discrete sequences to the complex  $z$ -plane for stability analysis and digital filter design.

**Ziegler-Nichols (Z-N)**

A heuristic PID tuning method based on the ultimate gain and oscillation period of a system at marginal stability. Provides starting-point tuning parameters.



# Quick Reference Tables

## Sensor Selection Guide

| Measurand    | Sensor Type          | Range           | Accuracy | Output               |
|--------------|----------------------|-----------------|----------|----------------------|
| Temperature  | Thermocouple (K)     | −200 to 1250 °C | ±2.2 °C  | μV (needs amp)       |
| Temperature  | RTD (Pt100)          | −200 to 850 °C  | ±0.3 °C  | Resistance (bridge)  |
| Temperature  | Thermistor (NTC)     | −40 to 125 °C   | ±0.2 °C  | Resistance (divider) |
| Pressure     | Piezoresistive       | 0–10 bar        | ±0.5% FS | mV/V (bridge)        |
| Strain       | Foil gauge           | ±5%             | ±1 μϵ    | mV/V (bridge)        |
| Acceleration | MEMS (ADXL345)       | ±16 g           | ±0.5%    | Digital (I2C/SPI)    |
| Proximity    | Ultrasonic           | 2 cm–4 m        | ±3 mm    | Pulse width          |
| Current      | Hall effect (ACS712) | ±30 A           | ±1.5%    | Analog voltage       |
| Light        | Photodiode           | varies          | varies   | Current (μA)         |

## ADC Resolution and LSB Size

| Resolution | Levels | LSB (3.3 V range) | LSB (5 V range) |
|------------|--------|-------------------|-----------------|
| 8-bit      | 256    | 12.9 mV           | 19.5 mV         |
| 10-bit     | 1024   | 3.22 mV           | 4.88 mV         |
| 12-bit     | 4096   | 0.806 mV          | 1.22 mV         |
| 16-bit     | 65536  | 50.4 μV           | 76.3 μV         |
| 24-bit     | 16.7M  | 0.197 μV          | 0.298 μV        |

## Filter Type Comparison

| Filter       | Passband              | Rolloff              | Best For                  |
|--------------|-----------------------|----------------------|---------------------------|
| Butterworth  | Maximally flat        | −20n dB/dec          | General purpose           |
| Chebyshev I  | Ripple in passband    | Steeper than Butter. | Sharp cutoff needed       |
| Chebyshev II | Ripple in stopband    | Steep, flat passband | Rejecting specific band   |
| Bessel       | Max. flat group delay | Gentlest rolloff     | Preserving waveform shape |
| Elliptic     | Ripple in both bands  | Steepest possible    | Minimum order needed      |

## Thermocouple Types

| Type | Range (°C)   | Sensitivity ( $\mu\text{V}/^\circ\text{C}$ ) | Notes                                     |
|------|--------------|----------------------------------------------|-------------------------------------------|
| K    | −200 to 1250 | 41                                           | Most common, general purpose              |
| J    | −40 to 750   | 52                                           | Higher sensitivity, oxidizes above 500 °C |
| T    | −200 to 350  | 43                                           | Best for cryogenic and food applications  |
| E    | −200 to 900  | 68                                           | Highest sensitivity of common types       |
| N    | −270 to 1300 | 39                                           | Improved K-type, better stability         |
| S    | −50 to 1768  | 10                                           | Platinum, high-temperature reference      |

## Common PID Tuning Starting Points

| Method                   | $K_p$      | $T_i$     | $T_d$     |
|--------------------------|------------|-----------|-----------|
| Ziegler-Nichols (P only) | $0.5 K_u$  | —         | —         |
| Ziegler-Nichols (PI)     | $0.45 K_u$ | $P_u/1.2$ | —         |
| Ziegler-Nichols (PID)    | $0.6 K_u$  | $P_u/2$   | $P_u/8$   |
| Tyres-Luyben (PID)       | $K_u/2.2$  | $2.2 P_u$ | $P_u/6.3$ |

Where  $K_u$  is the ultimate gain and  $P_u$  is the ultimate period. These are starting points; always fine-tune experimentally.

## Key Equations at a Glance

**Ohm's Law:**  $V = IR$ . **Power:**  $P = VI = I^2R = V^2/R$ .

**Voltage divider:**  $V_{\text{out}} = V_{\text{in}} \cdot R_2/(R_1 + R_2)$ .

**RC time constant:**  $\tau = RC$ . **Cutoff frequency:**  $f_c = 1/(2\pi RC)$ .

**Nyquist criterion:**  $f_s \geq 2f_{\text{max}}$  (practical:  $f_s \geq 5\text{--}10f_{\text{max}}$ ).

**Quantization step:**  $q = V_{\text{range}}/2^n$ . **ENOB:**  $(\text{SINAD} - 1.76)/6.02$ .

**INA128 gain:**  $G = 1 + 49.4\text{ k}\Omega/R_G$ . At  $G = 100$ :  $R_G = 499\ \Omega$ . At  $G = 611$ :  $R_G = 81\ \Omega$ .

**Uncertainty propagation:**  $u_f = \sqrt{\sum (\partial f/\partial x_i)^2 \cdot u_{x_i}^2}$ .

**SNR:**  $\text{SNR (dB)} = 20 \log_{10}(V_{\text{signal}}/V_{\text{noise}})$ .

**Gain (dB):**  $20 \log_{10}(V_{\text{out}}/V_{\text{in}})$ .  $+6\text{ dB} = 2\times$ .  $-3\text{ dB} = 0.707\times$ .  $-20\text{ dB} = 0.1\times$ .

**PID:**  $u(t) = K_p \left[ e(t) + \frac{1}{T_i} \int e\,dt + T_d \frac{de}{dt} \right]$ .

**Phase lag from latency:**  $\phi = -360 \cdot f \cdot \tau_{\text{total}}$  (degrees).

**Biot number:**  $Bi = hL_c/k$ . Lumped capacitance valid if  $Bi < 0.1$ .

**Thermal time constant:**  $\tau = mC_p/(hA_s)$ .

**Steady-state temperature:**  $T_{ss} = T_{\text{amb}} + \dot{Q}/(hA)$ .

# ABET Student Outcome Mapping

---

MEGN 300 is designed to develop the following ABET student outcomes. The table below maps each outcome to the course activities and document chapters that most directly address it.

| SO | ABET Student Outcome                                                                                                                                                                                        | Course Mapping                                                                                                                                                                                                                                                                  |
|----|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 1  | Identify, formulate, and solve complex engineering problems by applying principles of engineering, science, and mathematics.                                                                                | Measurement theory (Ch 1–3), error analysis and uncertainty propagation (Ch 4), signal processing (Ch 6–12), PID control design (Ch 15–17), heat transfer modeling (Ch 18). Labs require formulating measurement problems and applying mathematical models to physical systems. |
| 2  | Apply engineering design to produce solutions that meet specified needs with consideration of public health, safety, and welfare, as well as global, cultural, social, environmental, and economic factors. | Safety chapter (Laboratory Safety), circuit protection design (Ch 14–15), functional safety requirements (Ch 15), sensor selection for real-world constraints, energy-efficient signal conditioning design.                                                                     |
| 3  | Communicate effectively with a range of audiences.                                                                                                                                                          | Lab reports requiring clear documentation of methodology, results, and uncertainty. Practice questions requiring written technical explanations. Requirements mapping boxes throughout demonstrate professional specification language.                                         |
| 5  | Function effectively on a team whose members together provide leadership, create a collaborative and inclusive environment, establish goals, plan tasks, and meet objectives.                               | Lab exercises conducted in teams. Integration of multiple subsystems (sensors, DAQ, signal conditioning, control) requiring coordinated team effort and interface management.                                                                                                   |

| SO | ABET Student Outcome                                                                                                           | Course Mapping                                                                                                                                                                                                                                                      |
|----|--------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 6  | Develop and conduct appropriate experimentation, analyze and interpret data, and use engineering judgment to draw conclusions. | All lab exercises involve experimental design, data collection, statistical analysis (Ch 5), FFT-based frequency analysis (Ch 8–9), uncertainty quantification (Ch 4), and engineering judgment in interpreting results. This is the core competency of the course. |
| 7  | Acquire and apply new knowledge as needed, using appropriate learning strategies.                                              | Students must independently read datasheets, select sensors, configure DAQ hardware, learn LabVIEW programming (Appendix), and apply filter design tools. The Master Reference Document serves as a self-study resource supporting independent learning.            |

**Note:** ABET Student Outcome 4 (recognizing ethical and professional responsibilities) is addressed primarily through the safety practices, proper uncertainty reporting (honest representation of measurement quality), and the emphasis on documentation standards throughout the course. These outcomes are assessed through lab reports, exams, and the final project deliverables.

# References and Further Resources

---

## Textbooks and Standards

- [1] J. Fraden, *Handbook of Modern Sensors*, 5th ed., Springer, 2016.
- [2] R. S. Figliola and D. E. Beasley, *Theory and Design for Mechanical Measurements*, 7th ed., Wiley, 2020.
- [3] P. R. Bevington and D. K. Robinson, *Data Reduction and Error Analysis for the Physical Sciences*, 3rd ed., McGraw-Hill, 2003.
- [4] A. V. Oppenheim and R. W. Schaffer, *Discrete-Time Signal Processing*, 3rd ed., Pearson, 2010.
- [5] S. W. Smith, *The Scientist and Engineer's Guide to Digital Signal Processing*, California Technical Publishing, 1997 (free online at dspguide.com).
- [6] P. Horowitz and W. Hill, *The Art of Electronics*, 3rd ed., Cambridge University Press, 2015.
- [7] K. J. Åström and R. M. Murray, *Feedback Systems: An Introduction for Scientists and Engineers*, 2nd ed., Princeton University Press, 2020 (free online at fbwiki.org).
- [8] JCGM, "Evaluation of measurement data: Guide to the expression of uncertainty in measurement (GUM)," JCGM 100:2008.
- [9] R. C. Dorf and R. H. Bishop, *Modern Control Systems*, 14th ed., Pearson, 2022.
- [10] B. C. Kuo and F. Golnaraghi, *Automatic Control Systems*, 10th ed., McGraw-Hill, 2017.
- [11] G. F. Franklin, J. D. Powell, and A. Emami-Naeini, *Feedback Control of Dynamic Systems*, 8th ed., Pearson, 2019.
- [12] T. Kester, *Data Conversion Handbook*, Analog Devices/Newnes, 2005.
- [13] W. J. Dally and J. W. Poulton, *Digital Systems Engineering*, Cambridge University Press, 1998.
- [14] National Instruments, "NI USB-600x Series Specifications," ni.com, Rev. 2024.
- [15] F. P. Incropera, D. P. DeWitt, T. L. Bergman, and A. S. Lavine, *Fundamentals of Heat and Mass Transfer*, 8th ed., Wiley, 2017.
- [16] H. W. Ott, *Electromagnetic Compatibility Engineering*, Wiley, 2009.
- [17] Texas Instruments, "INA128/INA129 Precision, Low Power Instrumentation Amplifiers," Datasheet SBOS051B, Rev. 2019.
- [18] ISO/IEC 17025:2017, "General requirements for the competence of testing and calibration laboratories."

## Free Online Resources

- **DSP:** S. W. Smith, *The Scientist and Engineer's Guide to DSP*, free at <https://dspguide.com>
- **Control:** Åström & Murray, *Feedback Systems*, free at <https://fbswiki.org>
- **Fourier intuition:** 3Blue1Brown, “But what is the Fourier Transform?” (YouTube)
- **PID tuning:** MATLAB Tech Talks, “Understanding PID Control” series (YouTube)
- **NI DAQ:** NI Developer Zone tutorials at <https://ni.com/docs>
- **Op-amp design:** Texas Instruments, “Analog Engineer's Pocket Reference,” 5th ed., 2024 (free PDF at ti.com)
- **Filter design:** Analog Devices Filter Wizard at <https://tools.analog.com/en/filterwizard/>
- **Electronics:** EEVblog YouTube channel (practical electronics tutorials)
- **Uncertainty:** NIST/SEMATECH e-Handbook of Statistical Methods at <https://itl.nist.gov/div898/handbook/>
- **Sensors:** Omega Engineering Technical Reference Library at <https://omega.com/en-us/resources>

# Index

---

- accuracy, 7
- actuator, 62
- aliasing, 112
- amplifier
  - instrumentation, 155
  - operational, 155
- bandwidth, 28
- Bernoulli equation, 237
- calibration
  - static, 16
- CMRR, 155
- confidence interval, 52
- control
  - closed-loop, 201
  - open-loop, 192
- cutoff frequency, 123
- debugging
  - methodology, 180
  - pyramid, 180
- dynamic response
  - first-order, 28
- error
  - random, 6
  - systematic, 6
- feedback, 201
- feedforward control, 192
- FFT, 101
- filter
  - Bessel, 123
  - Butterworth, 123
  - Chebyshev, 123
  - digital, 133
  - low-pass, 123
- FIR filter, 133
- flow measurement, 237
- fluid power, 237
- flyback diode, 167
- Fourier series, 91
- gain-bandwidth product, 155
- GUM, 39
- H-bridge, 167
- harmonics, 91
- heat transfer
  - conduction, 228
  - convection, 228
- hypothesis testing, 52
- IIR filter, 133
- integral windup, 211
- Kirchhoff's laws, 144
- lumped capacitance, 228
- measurand, 6
- measurement
  - definition, 6
- MOSFET, 167
- noise
  - sources, 80
- Nyquist theorem, 112
- Ohm's law, 144
- oversampling, 112
- PID control, 211
- precision, 7
- PWM, 167
- relay, 167
- rise time, 28
- RSS, 39
- Sallen-Key, 123
- sampling, 112
- sensitivity, 16
- sensor
  - classification, 62
- signal walk, 180
- signal-to-noise ratio, 80
- SNR, 80
- spectral leakage, 101

SSR, 167  
stability, 201  
statistics  
    descriptive, 52  
  
thermal time constant, 228  
Thevenin equivalent, 144  
time constant, 28  
transduction, 62  
  
uncertainty  
    propagation, 39  
  
voltage divider, 144  
  
Wheatstone bridge, 16  
windowing, 101  
  
Ziegler-Nichols, 211