

PLASMA SPRAY PROCESSORS

Works Instruction

QF/QMS/02/31

Rev. 00

Date : 18/09/2023



Operations/Work/Job Activity covered by this assessment: Mounting Machine

Required Personal Protective Equipment (PPE) :



Safety glasses must be worn at times.



Long and loose hair must be contained.



Appropriate footwear with substantial uppers must be worn.



Close fitting/protective clothing to cover arms and legs must be worn.



Respiratory protection devices required.





Oil free leather gloves and spats must be worn.



Hearing protection must be used when using this machine.

1. Switch ON the power (A)
2. Check the waterline to ensure constant flow of water and lock the same. (B)
3. By operating the right hand side lever (C) move the spindle UP and open the lid in the mounting machine (D)
4. Apply the WD 40 spray(aerosol) on the inner surface of chamber and on top of the spindle (E) and on the inner surface of the top cover (F)
5. Weigh 18.5 gms of phenolic powder for mounting and keep it on a butter paper (G)
6. Keep the specimen on top of the spindle as shown (H) and lower the spindle by unlocking the knob on the right hand side (I)
7. Pour the powder in the chamber at centre of the hole very slowly.

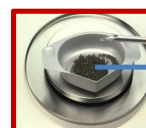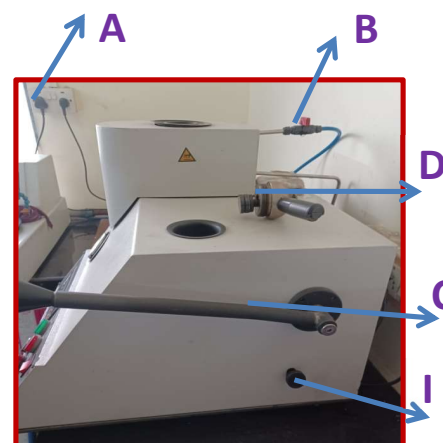

Assessor	Prasanna Wadkar	Signature:		Date:	
Approved:	Haarsh Doshi	Signature:		Date:	

PLASMA SPRAY PROCESSORS

Works Instruction

QF/QMS/02/31

Rev. 00

Date : 18/09/2023



8 Place the lid on the chamber and rotate it clockwise.

9 After tightening the lid from the top and just release a little by rotating anti-clockwise.

10 Lock the knob (I) on the right hand side.

11 Switch 'ON' the Mains situated on the backside of the machine (J)

12 Switch 'ON' Red power button (K) on the front right hand corner

13 When the display shows 'Cycle complete', switch on 'Cycle heating' (L)

14 Keep applying pressure through Right hand side lever (C) by pressing downwards continuously till the pressure reaches 2000 psi (M) and the temp reaches 160°C. Maintain the pressure.

15 At 160°C temp and 2000 psi, the heating is stopped and the cooling process begins (N)

16 Switch on the water flow to the mould by opening the valve in the pipeline (B).

17 When the temperature of the mould reaches room temp, release the knob (I) and remove the lid (E) by rotating anticlockwise

18 Lock the Knob (I) and using the right hand side lever ©, raise the spindle up and remove the specimen.



J



K

L



M

N

Assessor	Prasanna Wadkar	Signature:		Date:	
Approved:	Haarsh Doshi	Signature:		Date:	