



PLASMA SPRAY PROCESSORS Works Instruction	QF/QMS/02/34	
	Rev. 00	
	Date : 18/09/2023	


Operations/Work/Job Activity covered by this assessment: Micro hardness Tester	
Required Personal Protective Equipment (PPE) :	
 Safety glasses must be worn at times.	 Long and loose hair must be contained.
 Appropriate footwear with substantial uppers must be worn.	 Close fitting/protective clothing to cover arms and legs must be worn.
 Respiratory protection devices required.	 Oil free leather gloves and spats must be worn.
	 Hearing protection must be used when using this machine.
Note : The Vickers hardness calibration Blocks needs to be calibrate every 15 days. - After the final polishing and cleaning the surface of the mounted specimen, identify the coating side in the specimen mounted. - Place the coated specimen on the vice with coated side facing the 10X objective lens. (A) - Switch ON the power for Personal Computer and Microhardness Tester - Open The Daksh Microhardness measuring software and Click on the "Video Source " icon and set resolution at 2592 x 1944. (B) - Focus the specimen with 10X objective. - After identifying the coating area, set the crosswire on the location of interest for creating indentation and measuring the hardness. - Then shift the magnification to 40X objective by using the turret and focus the specimen. (C) - Check whether location of interest is as per S.No.6 and if required adjust the same. - Press LOAD on the hardness tester so that the process of indentation begins (D) - Then Loading, Dwelling and Unloading process follows automatically (E)After obtaining the Live image of indentation on the screen, ensure that indentation is within the crosswire region.	

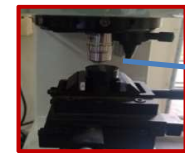


(A)




(B)

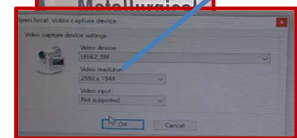

(C)

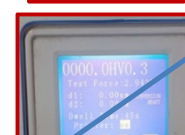

(D)

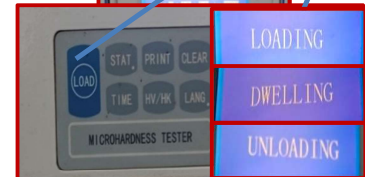

(E)

Assessor	Prasanna Wadkar	Signature:		Date:	
Approved:	Haarsh Doshi	Signature:		Date:	

PLASMA SPRAY PROCESSORS

Works Instruction

QF/QMS/02/34

Rev. 00

Date : 18/09/2023




11. Then double Click on "Live Image" and "Capture" button once (F)
12. Go to Analysis---Microhardness Measurement —A window with frmMeasure opens (G)
13. Select "Semi-automatic" in the window and Select "Load" to 300g
14. Then indent measuring grid lines appear both horizontally and vertically in red and blue as shown in (H).




(H)

16. Move RED horizontal line and RED vertical line so that it just touches the top and left extreme points of the indentation as shown (I)
17. Move BLUE horizontal line and BLUE vertical line so that it just touches the top and left extreme points of the indentation as shown. (I)
18. With actions at S.No.16 and 17, D1 and D2 are measured and the corresponding hardness is displayed on the screen. (J)
19. Then press "Add Result" so that the measured Vickers Hardness value is entered in the column below. (K)
20. Press "Save image" to save the indentation image (L)
21. Repeat the process from S.No.2 to Sl.No.20 for measuring VHN at other locations
22. Press "Graph report" to get the plot of hardness and the values of VHN in excel (M)

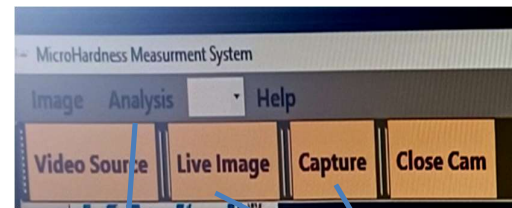


(G)


(F)

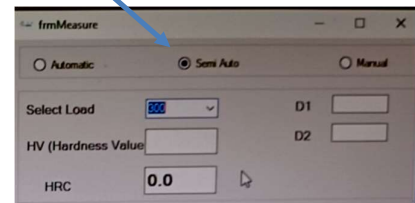

(I)

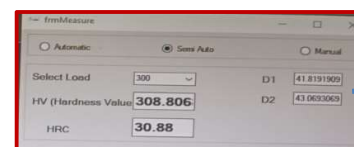

(J)

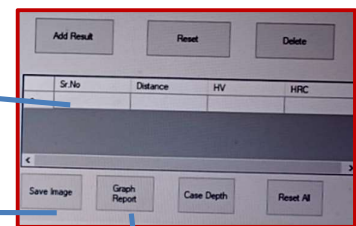

(K)

(L)

(M)

Assessor	Prasanna Wadkar	Signature:		Date:	
Approved:	Haarsh Doshi	Signature:		Date:	

PLASMA SPRAY PROCESSORS Works Instruction	QF/QMS/02/34	
	Rev. 00	
	Date : 18/09/2023	

Empty space for content

Assessor	Prasanna Wadkar	Signature:		Date:	
Approved:	Haarsh Doshi	Signature:		Date:	