

Concept Review

Brushed DC Motors

Why Brushed DC Motors?

Brushed DC motors remain one of the most widely used actuators in mechatronic systems due to their simplicity, low cost, and ease of control. Unlike more complex motor types that require sophisticated drive electronics, brushed DC motors can operate directly from a DC power source with basic speed control achieved through voltage variation. Their linear torque-speed characteristics and predictable behavior make them ideal for applications ranging from small toys and appliances to automotive systems and industrial machinery. While they may not match the efficiency or lifespan of brushless alternatives, their straightforward construction, intuitive operation, and minimal control requirements continue to make them the preferred choice for many applications where simplicity and cost-effectiveness are paramount.

1. Introduction

A brushed DC motor converts direct current electrical energy into mechanical rotational energy through electromagnetic interactions. The motor generates torque by passing current through windings in the rotor (armature) which interact with a magnetic field produced by permanent magnets or electromagnets in the stator. The distinctive feature of brushed DC motors is their use of carbon brushes and a segmented commutator to mechanically switch the direction of current flow through the rotor windings as the motor rotates, maintaining continuous torque production.

The fundamental principle relies on the Lorentz force law: when a current-carrying conductor is placed in a magnetic field, it experiences a force perpendicular to both the current direction and the magnetic field. By continuously switching the current direction through the commutator, the motor maintains a consistent torque direction, resulting in continuous rotation. This self-commutating design eliminates the need for external position sensing or complex electronic controllers, making brushed DC motors inherently simple to operate.

2. Basic Construction and Operation

A typical brushed DC motor consists of four main components: the stator (which produces the magnetic field), the rotor or armature (containing the windings), the commutator (segmented conductive ring), and the carbon brushes (which transfer current to the rotating commutator). These components work together to create controlled rotational motion, as shown in Figure 1.

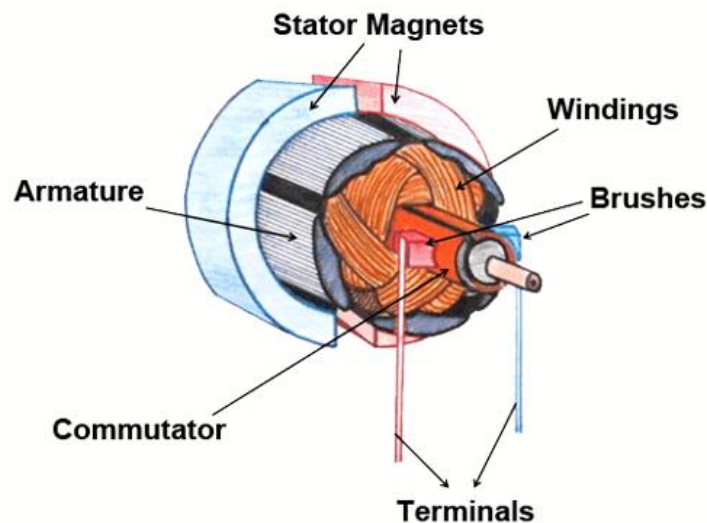


Figure 1. Brushed DC Motor

The stator provides a stationary magnetic field, typically using either permanent magnets (in permanent magnet DC motors) or electromagnets (in wound field motors). The rotor consists of multiple windings wrapped around a laminated iron

core, with each winding connected to specific segments of the commutator. As current flows through these windings, they generate their own magnetic field that interacts with the stator field to produce torque.

The commutator is a cylindrical assembly of copper segments insulated from each other, mounted on the motor shaft. Each segment connects to specific rotor windings. Carbon brushes, held against the commutator by springs, provide sliding electrical contacts that deliver current from the stationary power source to the rotating windings. As the rotor turns, different commutator segments come into contact with the brushes, switching which windings are energized and reversing the current direction at the appropriate moments to maintain continuous rotation.

a. Operating Principle

The operation follows a cyclical process of magnetic interaction and commutation. When voltage is applied across the brushes, current flows through the windings connected to the commutator segments currently in contact with the brushes. This current creates a magnetic field around the rotor windings that interacts with the stator's magnetic field according to Fleming's Left Hand Rule, generating a force that causes rotation as shown in Figure 2a. The rotor coil is powered through the commutator ring and the carbon brushes to induce a magnetic field that is opposite to the external field from the stator, hence both north and south poles repel each other. The rotor continues to rotate through the position where the magnetic field of the rotor is perpendicular to that of the stator as in Figure 2b.

As the rotor approaches alignment with the stator field (where torque would drop to zero), as shown in Figure 2c, the commutator segments rotate past the brushes, switching the current to the next set of windings. This switching reverses the rotor's magnetic polarity, ensuring the magnetic forces continue pushing in the same rotational direction. The process repeats continuously, with the commutator acting as a mechanical inverter that maintains optimal torque production throughout rotation. However, this mechanical commutation slowly wears away the commutator and the brushes.

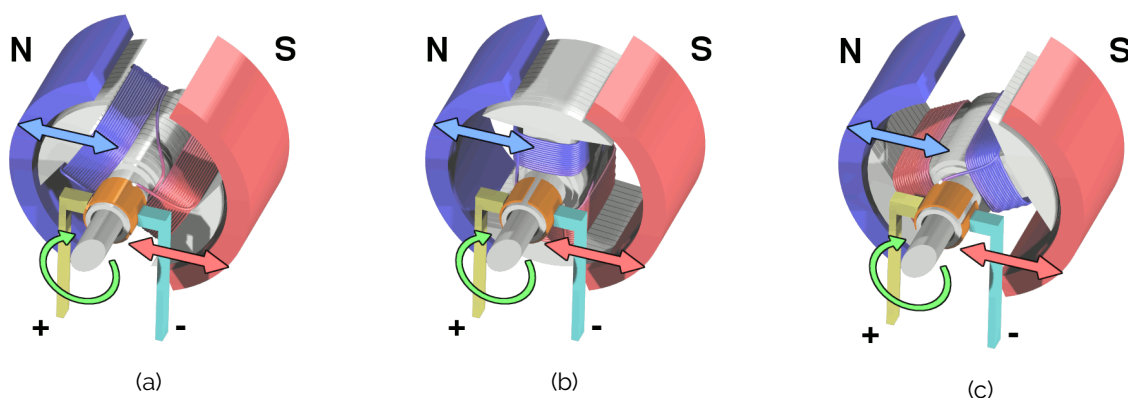


Figure 2. Sequential diagrams showing rotor position at different rotor angles


In reality, the insides of a DC motor look like the one shown in Figure 3. Although diagrams usually show a 2-pole rotor for simplicity, most motors use 3 or 5 pole rotors. This prevents dead zones where the motor produces no torque.



Figure 3. Real life rotor

3. Wiring

Brushed DC motors typically have two wire connections for basic operation, though some motors include additional connections for encoders or tachometers. The standard wiring configuration is straightforward: a positive (red) and negative or ground (black) connection. Unlike servo motors with their three-wire configuration, brushed DC motors only require power connections, making them simpler to wire but lacking built-in position control.

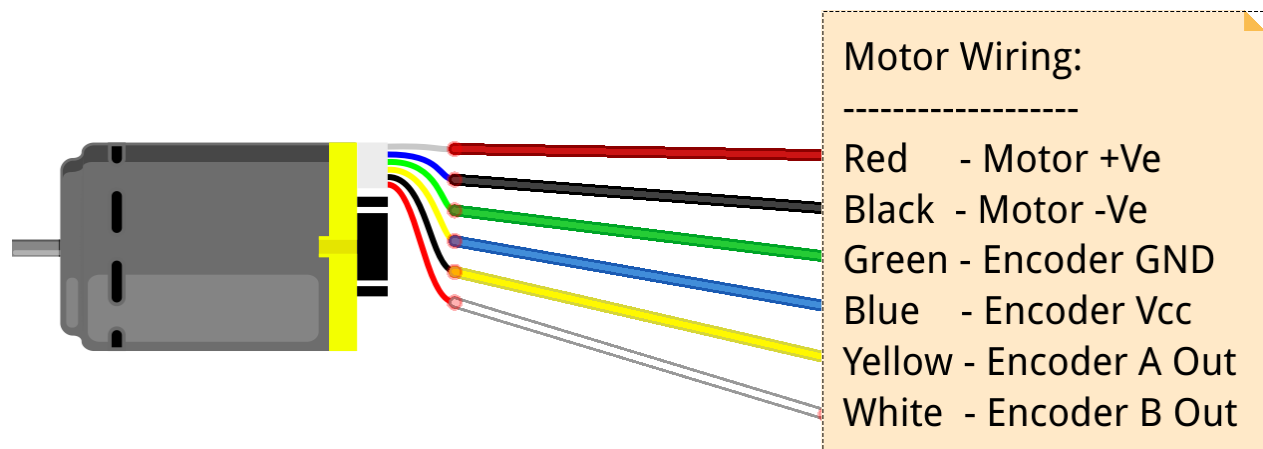

[Insert Figure 3: Typical brushed DC motor wire connections and color coding]

Note that the encoder wiring diagram tends to vary per encoder manufacturer and the datasheet needs to be used to confirm proper wiring.

The polarity of the connection determines the rotation direction—reversing the polarity reverses the motor's rotation. For motors with attached encoders like the one in the GMP24-370CA datasheet (motor supplied with the Mechatronics Actuators Trainer), the additional wires outside of the red and black help provide position feedback: typically including encoder power (Vcc), ground, and channel outputs (A, B, and sometimes Z for index).

When wiring brushed DC motors, several considerations are important:

- Wire gauge: Must be sufficient for the motor's current draw, especially stall current
- Connector type: Should be rated for the expected current and provide secure connection
- Cable length: Longer cables increase resistance and can affect motor performance
- Shielding: May be necessary for encoder signals to prevent electromagnetic interference

4. Driving a Brushed DC Motor

a. Voltage Control

The simplest method to control a brushed DC motor is through direct voltage control. The motor's speed is approximately proportional to the applied voltage (minus losses), while the torque is proportional to the current drawn. This relationship can be expressed as:

$$\text{Speed (RPM)} = (V - I \times R) \times K_v$$

Where V is applied voltage, I is current, R is motor resistance, and K_v is the motor's speed constant.

b. PWM Control

For more sophisticated control, Pulse Width Modulation (PWM) is the standard approach. PWM rapidly switches the motor between full voltage and zero voltage, with the duty cycle determining the effective average voltage. A 50% duty cycle at 12V provides an effective 6V for the motor as shown in Figure 4. PWM frequencies typically range from 1kHz to 20kHz, with higher frequencies reducing audible noise but potentially increasing switching losses.

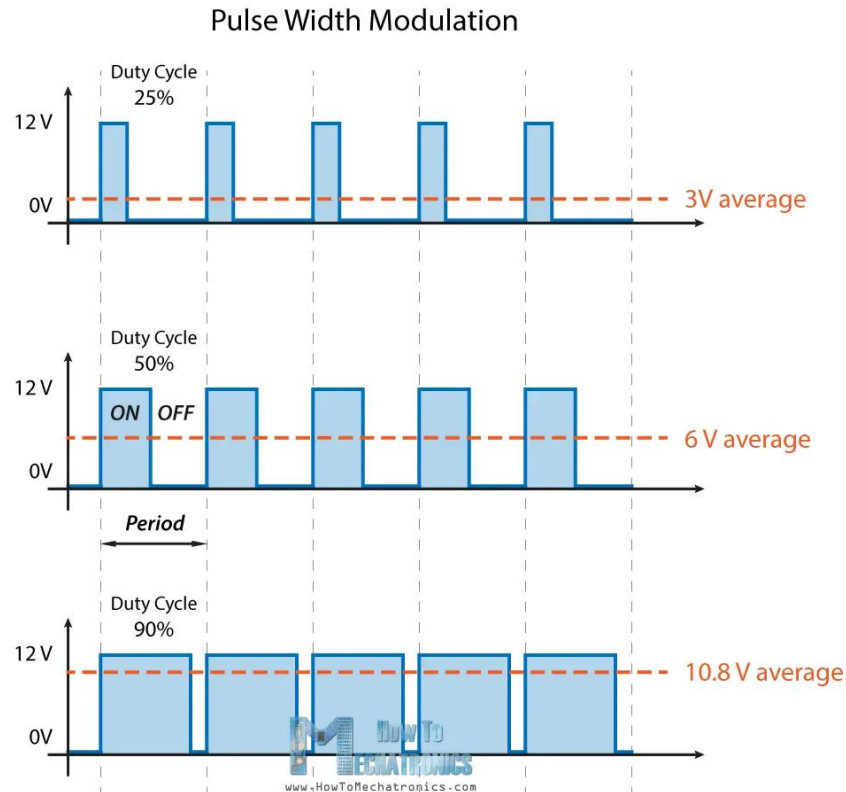


Figure 4. PWM with different duty cycles and resulting effective voltages

c. H-Bridge Configuration

To enable bidirectional control and braking, an H-bridge circuit is commonly used. This configuration uses four switches (typically MOSFETs or transistors) arranged in an 'H' pattern around the motor as shown in Figure 5. By controlling which switches are closed, the motor can be driven forward, reverse, braked, or allowed to coast.


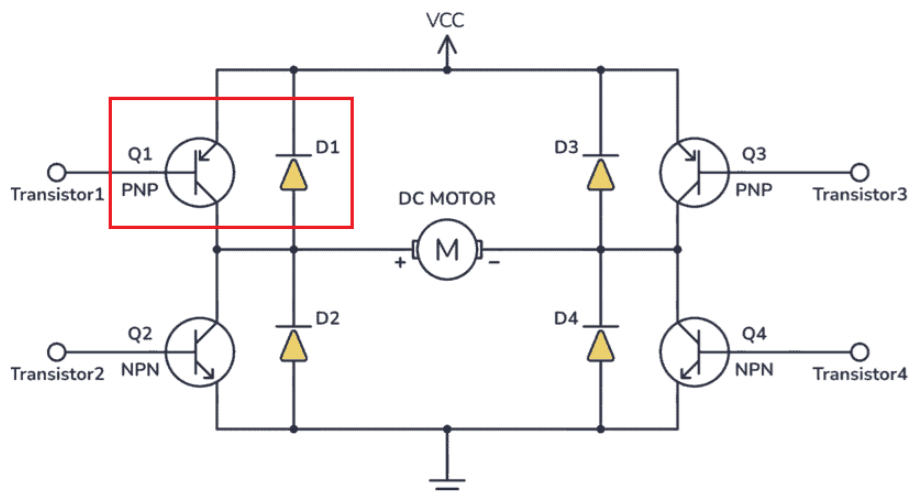


Figure 5. H bridge to help drive a motor. The circuit in red acts like a switch.

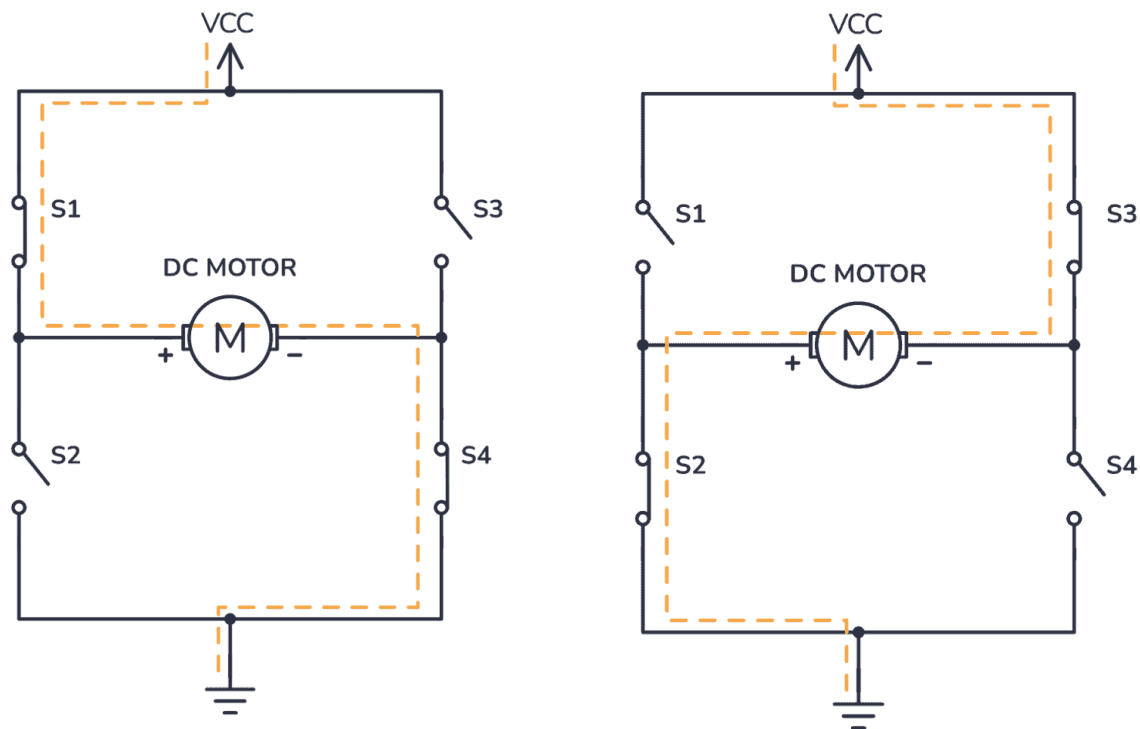

(a) Motor rotating in the positive direction

(b) Motor rotating in the negative direction

Figure 6. H-Bridge diagram with different switching modes to turn forward or backwards

The H-bridge operating modes include:

- Forward: Switches 1 and 4 closed (Figure 6a)
- Reverse: Switches 2 and 3 closed (Figure 6b)
- Brake: Both bottom (or both top) switches closed, shorting the motor
- Coast: All switches open, motor freewheels

d. Current Limiting and Protection

Since brushed DC motors can draw very high currents during stall conditions, current limiting is essential to prevent damage to both the motor and driver circuit. Methods include:

- Hardware current sensing with comparator shutdown
- Software current monitoring with PWM adjustment
- Thermal protection to prevent overheating
- Overcurrent fuses or circuit breakers for fault protection

5. Datasheet And Considerations

The motor's datasheet summarizes its key electrical and mechanical characteristics and are essential when selecting a motor for a project or application.

a. Understanding a Brushed DC Motor Datasheet

When selecting a DC motor, there are certain parts of the datasheet that might be important when looking for motors for a project. This section will mostly focus on the electrical information, however, note that there will also be mechanical information about the motor, usually in the form of a mechanical drawing. This information is important for deciding if a motor will physically fit in a required space, or mount effectively.

When selecting a brushed DC motor, there are several pieces of specification data which will be of particular interest. The datasheet for the GMP24-370CA planetary gear motor, which combines a brushed DC motor with an integrated planetary gearbox.

i. Rated Voltage

This is the voltage at which the motor is designed to run, and at which the motor will have been tested for other specifications. Small brushed DC motors typically operate at voltages between 3V and 24V, with common values being 6V, 12V, and 24V. If the motor voltage is significantly lower than the power supply, the motor may overheat or be damaged. If the supply voltage is lower than rated, the motor will produce less torque and run slower than specified. Most brushed DC motors can tolerate $\pm 10\text{-}20\%$ voltage variation for short periods.

ii. No Load Speed

This parameter indicates the maximum rotational velocity when no external load is applied to the motor shaft. It represents the theoretical maximum speed the motor can achieve. The actual operating speed will always be lower than this value and depends on the applied load torque. For geared motors, this speed is already reduced by the gear ratio—for instance, a motor with 3000 RPM and a 1:100 gear ratio would have a no-load output speed of 30 RPM.

iii. Rated Speed and Torque

Unlike the extremes of no-load and stall conditions, rated values represent the motor's intended continuous operating point. Rated speed is the rotational velocity under rated load, while rated torque is the sustainable torque output without overheating. These values indicate where the motor operates most efficiently and can run indefinitely without damage. When selecting a motor, ensure the rated torque exceeds your application's typical requirements by at least 20-30% for safety margin.

iv. Stall Current and Stall Torque

Stall torque is the maximum torque the motor can produce when the shaft is prevented from rotating. At this point, the motor draws its maximum current (stall current). While useful for determining if a motor can overcome initial resistance or handle brief overloads, motors should never operate at stall for more than a few seconds as they will rapidly overheat. The stall current can be 5-10 times higher than the rated current, so power supplies and drivers must be sized accordingly.

v. Gear Reduction Ratio

For geared motors, the reduction ratio indicates how much the motor's speed is reduced (and torque is increased) by the gearbox. A 1:100 ratio means the output shaft rotates 100 times slower than the motor but with approximately 100 times more torque, minus efficiency losses. Common configurations include:

- Direct drive (1:1): Maximum speed, minimum torque
- Low reduction (1:4 to 1:20): Balanced speed and torque
- High reduction (1:50 to 1:500+): High torque, low speed applications

Each gear stage typically reduces efficiency by 5-10%, so a 4-stage gearbox might only deliver 65-75% of the theoretical torque multiplication.

b. Design Decisions

i. Torque-Speed Characteristics

Brushed DC motors exhibit a linear inverse relationship between torque and speed: maximum torque occurs at zero speed (stall), while maximum speed occurs at zero torque (no-load). This characteristic, shown in Figure 7, helps predict motor performance at any operating point. The motor naturally finds its operating speed where the torque it produces matches the load torque.

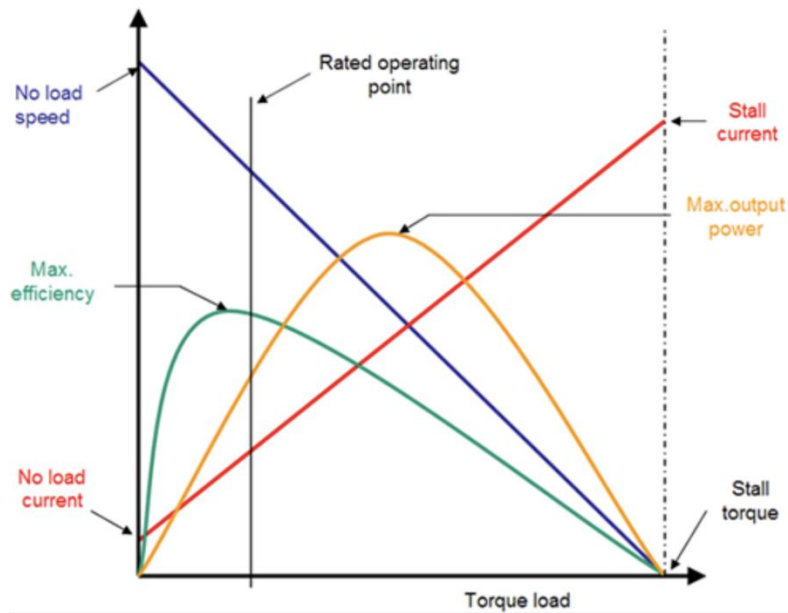


Figure 7. Tor DC Motor Torque-Speed Characteristic

ii. Power and Efficiency

Motor efficiency peaks at approximately 10-20% of stall torque, typically achieving 75-85% efficiency for quality motors. Efficiency drops significantly at very light loads (due to friction losses) and heavy loads (due to I^2R losses in the windings). When calculating battery life or heat dissipation, assume 70% efficiency for conservative estimates. Geared motors have lower overall efficiency due to gear losses.

iii. Control Complexity

One of the primary advantages of brushed DC motors is their simplicity. Basic operation requires only:

- On/off control: Simple switch or relay
- Speed control: Variable resistor or PWM controller
- Direction control: H-bridge or DPDT relay
- Precision control: Encoder feedback with PID controller

This minimal control requirement reduces system cost and complexity compared to stepper or BLDC motors, making brushed motors ideal for cost-sensitive or simple applications.

iv. Maintenance and Lifespan

The brushes and commutator are wear items that limit motor lifespan. Typical brush life ranges from:

- Light duty (intermittent operation): 2000-5000 hours
- Continuous operation: 1000-2000 hours

- Heavy/stall loads: 100-500 hours

Environmental factors like dust, humidity, and temperature extremes reduce brush life. Plan for maintenance access in critical applications or consider brushless alternatives for maintenance-free operation.

v. Noise and EMI Considerations

Brush-commutator interaction generates:

- Acoustic noise: Mechanical friction and commutation create audible noise
- Electrical noise: Sparking generates electromagnetic interference (EMI)

Mitigation strategies include:

- Capacitors across motor terminals (0.01-0.1 μ F ceramic)
- Ferrite beads on motor leads
- Twisted pair wiring for motor connections
- Physical separation from sensitive electronics
- Metal shielding for extreme cases

© Quanser Inc., All rights reserved.



Solutions for teaching and research. Made in Canada.