Trusted ePlatform Services

ADVANTECH


2019/02/26

SOM-5871 Application Note

Module: SOM-5871 COM Express Basic module
Description: Yellow bang issue in device manager when plugging an external graphic card based on default BIOS setting (eDP).

Details:

When users use an external graphic card on SOM-5871 Basic module with default BIOS, **Display adapters** item's "**AMD Radeom™ Vega 11 Graphics"** will cause yellow bang in device manager. It is a known issue confirmed by AMD.

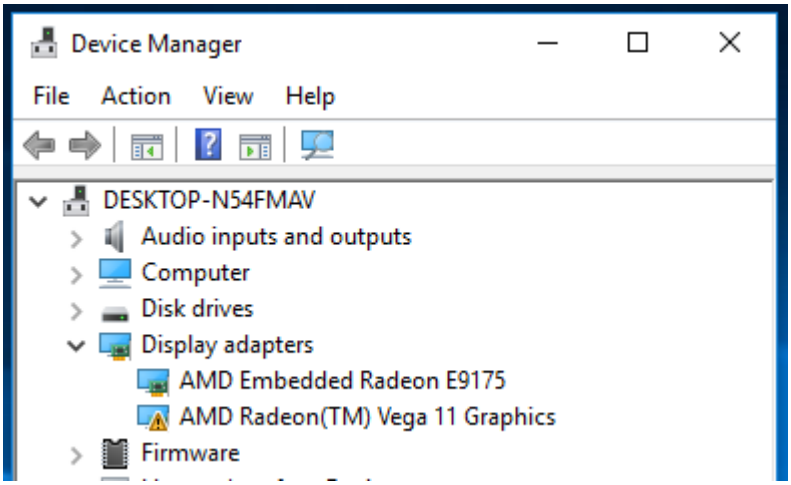

Workaround Solution:

When plug an external graphic card with BIOS setting **Primary Video Adapter** item as "Int Graphics (IGD)" (Default) , the system will become single display (Int Graphics IGD)) during POST stage. When system into OS, there is no yellow bang and can support both Int Graphics (IGD) and Ext Graphics (PEG).

Long-term Solution:

It is an AMD known issue; we will update the solution soon.

AMD confirmed email:

Since this scenario has been identified and could be reproduced on AMD Dibbler CRB platform with below configurations:

- *Installed AMD PEG (PCIe External Graphic) on V1000 platform*
- *UEFI Boot*
- *eDP display configuration on V1000 IGD(Integrated Graphic Device)*

This issue has been classified "**Known issue**" as of now.
This issue is also found on other V1000 customer platforms with above configuration.
AMD internal engineering team(BIOS and Driver developer) are aggressively working on the root cause, and solution.

Please kindly let your end customer aware this now, if they intend to use eDP/LVDS native display in their use case.