

SHARP SERVICE MANUAL

CODE: 00ZMXB468PS2E

DIGITAL LASER PRINTER



MODEL MX-B468P


CONTENTS

Service Manual Part 1

[1] PRODUCT OUTLINE	1-1
[2] CONSUMABLE PARTS	2-1
[3] UPGRADING AND MIGRATING	3-1
[4] REPLACING PARTS AND SUPPLIES	4-1
[5] PARTS LIST	5-1
Service Manual Part 2	1

Parts marked with "⚠" are important for maintaining the safety of the set. Be sure to replace these parts with specified ones for maintaining the safety and performance of the set.

[1] PRODUCT OUTLINE (OPTION)

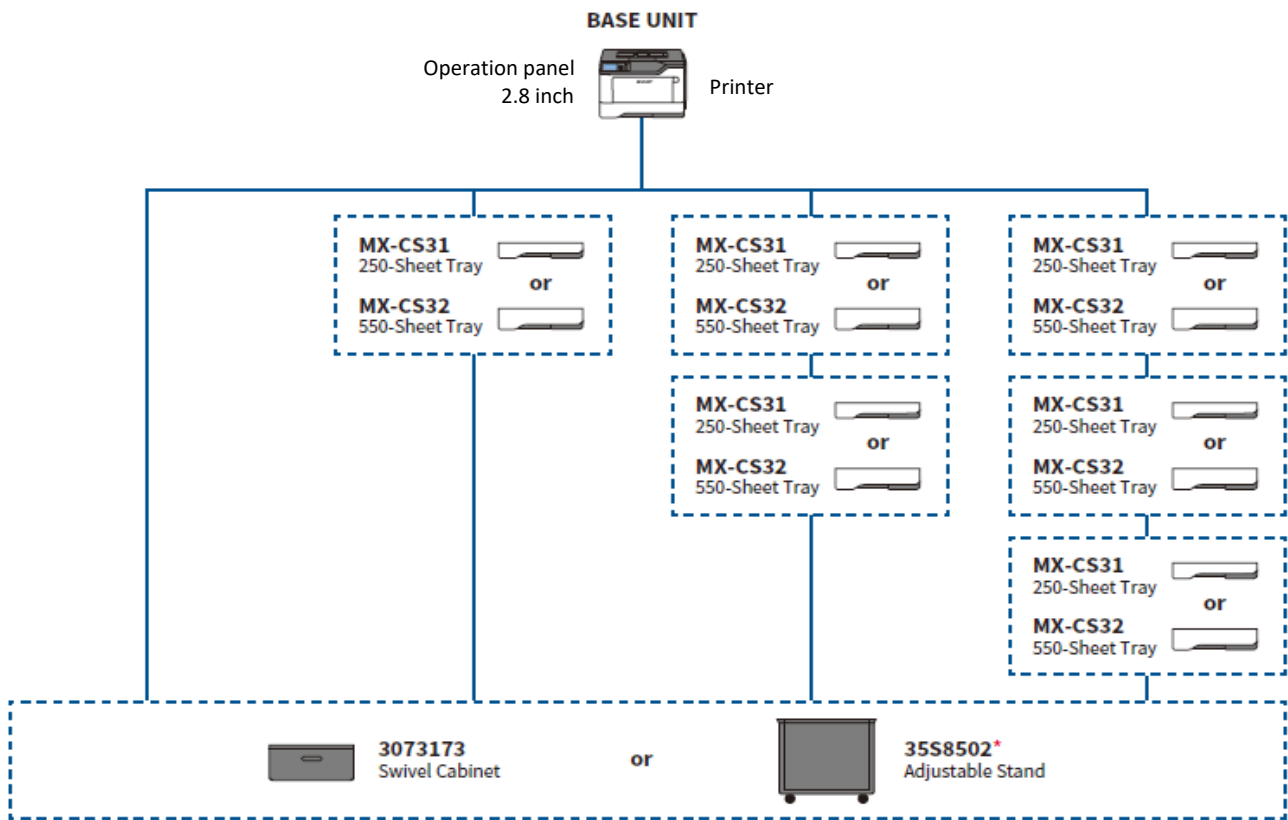

* Cannot be installed for desktop use.

Product Name	Description	
MX-CS31	250 Sheet Tray	●
MX-CS32	550 Sheet Tray	●
35S8502	Adjustable Printer Stand	● (Local Option)
3073173	Swivel Cabinet	● (Local Option)
57X0295	Trusted Platform Module	● (Local Option)
1021294	USB Cable (2-meter)	● (Local Option)
1021231	Parallel cable	● (Local Option)
27X0900	RS-232 serial interface card	● (Local Option)
27X0901	Parallel 1284-B interface card	● (Local Option)
57X9528	Intelligent Storage Device (ISD)	● (Local Option)
57X7040	Keyboard Kit - English	● (Local Option)
SPD0001	Surge protector - low volt	● (Local Option)
SPD0002	Surge protector - high volt	● (Local Option)
27X0912	MarkNet N8230 Fiber Ethernet 100BASE-FX(LC), 1000BASE-SX(LC) (Fiber + side cover)	● (Local Option)
27X6430	MarkNet N8450 Wireless Card with BLE	● (Local Option)
82S1205	IPDS License	● (License option)
82S1206 *1	Bar Code License	● (License option)

*1 : Requires optional 57X9528

[2] CONSUMABLE PARTS

MX-B468P

1, Consumable system table

North America, Canada, Mexico, Europe, Australia, New Zealand, Middle East, Africa

Machine model	Content	Model name
MX-B468P	Toner Cartridge (Black)	MX-B47T
	Black Imaging Unit	MX-B47DU

2, Maintenance parts list

North America, Canada, Mexico

Item	Model name	Content	Number	Life
Fuser Maintenance kit (110V)	MX-B46KA1	Fuser (110V)	1	200K
		MPF pick roller and separator pad	1	
		Pick tires	1	
		Transfer roller	1	

Europe, Middle East, Africa

Item	Model name	Content	Number	Life
Fuser Maintenance kit (220V)	MX-B46KA	Fuser (220V)	1	200K
		MPF pick roller and separator pad	1	
		Pick tires	1	
		Transfer roller	1	

[3] UPGRADING AND MIGRATING

Refer to the User's guide

[4] REPLACING PARTS AND SUPPLIES

Refer to the User's guide

[5] PARTS LIST (MX-B468P)

No.	Section	Section name	Asm-index	Manufacture parts number	Sharp parts number	Description
1	Assembly 1	Covers	1	41X1171	0SP41X1171///	Top cover
2	Assembly 1	Covers	2	41X2262	0SP41X2262///	Output extender
3	Assembly 1	Covers	3	41X1169	0SP41X1169///	Rear door and cover
4	Assembly 1	Covers	4	41X2263	0SP41X2263///	Rear door
5	Assembly 1	Covers	5	40X8520	0SP40X8520///	Dust cover
6	Assembly 1	Covers	6	41X1165	0SP41X1165///	Right cover
7	Assembly 1	Covers	7	41X1233	0SP41X1233///	Controller board cover
8	Assembly 1	Covers	8	41X2273	0SP41X2273///	Front cover
9	Assembly 1	Covers	9	41X1167	0SP41X1167///	Left cover
10	Assembly 1	Covers	10	41X2300	0SP41X2300///	Access cover link
11	Assembly 3	Control panel	1	41X4359	0SP41X4359///	Control panel display for MS531, MS631, and MS639
12	Assembly 3	Control panel	3	41X4421	0SP41X4421///	Bezel (blank)
13	Assembly 3	Control panel	4	41X4412	0SP41X4412///	Control panel front cover for MS531, MS631, and MS639
14	Assembly 3	Control panel	5	41X4547	0SP41X4547///	Control panel FFC
15	Assembly 3	Control panel	6	41X4537	0SP41X4537///	Front USB cable
16	Assembly 4	Electronics	1	41X1185	0SP41X1185///	Printhead
17	Assembly 4	Electronics	2	41X1178	0SP41X1178///	Fuser, 110 V
18	Assembly 4	Electronics	2	41X1179	0SP41X1179///	Fuser, 220 V
19	Assembly 4	Electronics	3	41X4154	0SP41X4154///	Engine board
20	Assembly 4	Electronics	4	41X4151	0SP41X4151///	Controller board for MS531, MS631
21	Assembly 4	Electronics	5	41X4411	0SP41X4411///	Power supply, 100 / 110 V
22	Assembly 4	Electronics	5	41X4410	0SP41X4410///	Power supply, 230 V
23	Assembly 5	Motors	1	41X2259	0SP41X2259///	Cooling fan
24	Assembly 5	Motors	2	41X1213	0SP41X1213///	MPF solenoid
25	Assembly 5	Motors	3	41X1224	0SP41X1224///	Main drive gearbox
26	Assembly 5	Motors	4	41X1237	0SP41X1237///	Cartridge gearbox
27	Assembly 5	Motors	5	41X1214	0SP41X1214///	Reverse solenoid
28	Assembly 6	Sensors 1	1	41X1988	0SP41X1988///	Sensor (cartridge barrel)
29	Assembly 6	Sensors 1	2	41X1162	0SP41X1162///	Toner cartridge smart chip contact
30	Assembly 6	Sensors 1	3	41X1209	0SP41X1209///	Sensor (front door)
31	Assembly 6	Sensors 1	4	41X4549	0SP41X4549///	Interconnect cable
32	Assembly 6	Sensors 1	5	41X1210	0SP41X1210///	Sensor (MPF paper present)
33	Assembly 6	Sensors 1	6	41X4991	0SP41X4991///	Sensor (tray present)
34	Assembly 7	Sensors 2	2	41X4548	0SP41X4548///	Sensor (duplex and input)
35	Assembly 7	Sensors 2	4	41X4453	0SP41X4453///	Paper present sensor flag parts kit • Paper present flag and bracket • Toner density sensor and bracket • Spring • Screw • Grease
36	Assembly 7	Sensors 2	5	41X4456	0SP41X4456///	Toner density sensor parts kit • Toner density sensor and bracket • Spring • Screw • Grease
37	Assembly 8	Paper feed	1	41X1183	0SP41X1183///	Jam access cover
38	Assembly 8	Paper feed	2	41X1184	0SP41X1184///	Front input guide
39	Assembly 8	Paper feed	3	41X1176	0SP41X1176///	Duplex unit
40	Assembly 8	Paper feed	4	41X4214	0SP41X4214///	Duplex gear kit
41	Assembly 8	Paper feed	5	41X1182	0SP41X1182///	MPF gearbox
42	Assembly 8	Paper feed	6	41X2255	0SP41X2255///	Fuser actuator
43	Assembly 8	Paper feed	7	41X2268	0SP41X2268///	Redrive gear plate for MS531
44	Assembly 9	Paper pick	1	41X1223	0SP41X1223///	Pick roller assembly
45	Assembly 9	Paper pick	2	41X0918	0SP41X0918///	Pick tire
46	Assembly 9	Paper pick	3	41X2391	0SP41X2391///	Pick roller clutch
47	Assembly 11	Rollers	1	41X4425	0SP41X4425///	Redrive for MS531
48	Assembly 11	Rollers	2	40X8393	0SP40X8393///	Transfer roller
49	Assembly 11	Rollers	3	41X1197	0SP41X1197///	MPF pick roller and separator pad
50	Assembly 12	MPF and standard tray	1	50X1135	0SP50X1135///	MPF with front cover
51	Assembly 12	MPF and standard tray	2	41X1220	0SP41X1220///	Standard 250-sheet tray insert for MS531
52	Assembly 14	Optional trays	2	41X1239	0SP41X1239///	Pick roller
53	Assembly 14	Optional trays	3	41X1222	0SP41X1222///	550-sheet tray insert (optional tray)
54	Assembly 14	Optional trays	3	41X1221	0SP41X1221///	250-sheet tray insert (optional tray)
55	Assembly 15	Printer stand	2	41X0775	0SP41X0775///	Nonlocking caster
56	Assembly 15	Printer stand	3	41X0774	0SP41X0774///	Locking caster

MX-B468P

Service Manual Part 2

- [Start diagnostics](#)
 - [Maintenance](#)
 - [Safety and notices](#)
 - [Trademarks](#)
 - [Index](#)
-

Table of contents

Product information.....	2
Edition notice.....	2
Notices, conventions, and safety information.....	11
Laser notice.....	11
Avis relatif à l'utilisation du laser.....	11
Aviso de láser.....	11
Laser-Hinweis.....	12
Conventions.....	12
Conventions.....	12
Convenciones.....	13
Konventionen.....	13
Safety information.....	14
 General information.....	 21
Printer model configurations.....	21
Finding the printer serial number.....	21
Selecting paper.....	22
Paper guidelines.....	22
Paper characteristics	22
Unacceptable paper	23
Storing paper.....	24
Selecting preprinted forms and letterhead	24
Supported paper sizes.....	24
Supported paper types	27
Supported paper weights	27
Tools required for service.....	27
 Diagnostics and troubleshooting.....	 29
Troubleshooting precautions.....	29
Troubleshooting overview.....	31
Performing the initial troubleshooting check.....	31
Power-on Reset (POR) sequence	31

Using Safe Mode	32
Replace cartridge, printer region mismatch	33
Non-Lexmark supply	33
Securing the printer.....	34
Resetting the printer without admin credentials	34
Using the security reset jumper	34
Data security notice	35
Fixing print quality issues.....	36
Initial print quality check	36
Gray background or toner fog	37
Blank pages	39
Print is too dark	41
Print is too light	42
Paper curl.....	43
Folded or wrinkled paper.....	44
Solid black pages	44
Repeating defects	45
Skewed print	46
Streaked vertical lines appear on prints.....	46
Horizontal light bands	47
Vertical light bands	47
Vertical dark bands	48
Vertical dark streaks with print missing.....	49
White streaks and voided areas.....	50
Fine lines such as Chinese characters are not printed correctly	52
Text or images cut off.....	52
Compressed images appear on prints	53
Incorrect margins on prints.....	54
Toner rubs off	54
Mottled prints or dots	55
Paper jams.....	55
Avoiding jams	55
Identifying jam locations.....	56
200 paper jams.....	58
202 paper jams.....	67
230 paper jams	71
232 paper jams	73
241 paper jams	75
242–244 paper jams	76
User attendance messages.....	81
0y user attendance errors.....	81
1y user attendance errors.....	83
2y user attendance errors.....	84
3y user attendance errors.....	85

4y user attendance errors.....	91
5y user attendance errors.....	95
6y user attendance errors.....	95
7y user attendance errors.....	96
8y user attendance errors.....	97
Printer hardware errors.....	100
111 errors.....	100
121 errors.....	101
126 errors.....	103
128 errors.....	104
133 errors.....	105
140 errors.....	105
155 errors.....	106
16y errors.....	107
171 errors.....	111
6yy errors.....	111
Procedure before starting the 9yy service checks.....	114
900-901 errors.....	116
912 errors.....	117
938-958 errors.....	119
980-992 errors.....	120
Other symptoms.....	120
Base printer symptoms.....	120
Dead optional tray service check.....	121

Service menus..... 123

Understanding the printer control panel.....	123
Using the control panel.....	123
Understanding the status of the indicator light.....	123
Diagnostics menu.....	124
Entering the Diagnostics Menu.....	124
Reports.....	125
Advanced Print Quality Samples.....	125
Event Log.....	125
Input tray quick print.....	126
Output bin quick feed.....	126
Printer Setup.....	126
Printer diagnostics and adjustments.....	128
Additional input tray diagnostics.....	130
Entering Configuration Menu.....	130
Configuration Menu.....	131
Entering Invalid engine mode.....	133
Entering Recovery mode.....	134

Service Engineer menu.....	135
Entering the SE Menu.....	135
General SE Menu.....	136
Network SE Menu.....	137

Parts removal..... 139

Important removal information.....	139
Removal precautions	139
Handling ESD-sensitive parts.....	141
Critical information for controller board or engine board replacement.....	141
Restoring the printer configuration.....	142
Restoring solutions, licenses, and configuration settings	145
Updating the printer firmware	146
Backing up eSF solutions and settings	147
Disconnecting ribbon cables.....	148
Ribbon cable connectors	149
Zero Insertion Force (ZIF) connectors.....	149
Horizontal top contact connector	150
Horizontal bottom contact connector	153
Vertical mount contact connector	156
Horizontal sliding contact connector	159
Low Insertion Force (LIF) connector	162
Printhead adjustment	163
Removal procedures.....	165
Left side removals.....	165
Left cover removal	165
Main drive gearbox removal.....	166
MPF gearbox removal	167
Fuser actuator removal	170
Reverse solenoid removal	171
Cartridge gearbox removal.....	172
MPF solenoid removal	173
Pick roller clutch removal.....	174
Duplex gear kit removal	176
Right side removals.....	179
Right cover removal.....	179
Interconnect cable removal	180
Fan removal	182
Controller board removal	183
Engine board removal.....	184
Wireless module removal.....	185
Toner cartridge smart chip contact removal	186
Cartridge barrel shutter sensor kit removal	189

Front removals.....	192
Front cover removal.....	192
MPF with front access cover removal.....	192
Control panel removal.....	193
Transfer roller removal.....	195
Jam access cover removal	195
Sensor (front door) removal.....	196
MPF pick roller and separator pad removal	198
Sensor (MPF paper present) removal	201
Front input guide removal.....	202
Sensor (tray present) removal.....	202
USB cable removal.....	203
Bottom removals.....	204
Power supply removal.....	204
Duplex removal.....	206
Sensors (duplex and input) removal.....	208
Pick roller removal.....	214
Pick roller (MS531) removal.....	215
Pick tire (MS531) removal	219
Motor (pick) removal	221
Pick/lift motor gearbox removal.....	222
Sensor (toner density) and media present sensor flag removal.....	224
Lift cam removal.....	230
Rear side removals.....	232
Rear door and cover removal.....	232
Fuser removal.....	232
Redrive removal.....	233
Redrive gear plate removal	234
Sensor (bin full) removal	235
Top side removals.....	236
Top cover removal.....	236
Top front cover removal.....	237
Printhead removal	238
Optional 250/550-sheet tray removals.....	240
Separator roller removal.....	240
Replacing parts and supplies.....	242
Replacing the toner cartridge	242
Replacing the imaging unit	243
Replacing MarkNet N8450 Wireless Print Server.....	246

Replacing the pick tires	250
Resetting the supply usage counters	252

Component locations.....253

Printer configurations.....	253
Printer roller locations.....	254
Printer sensor locations.....	255

Maintenance.....257

Inspection guide.....	257
Scheduled maintenance.....	257
Maintenance kits.....	257
Resetting the maintenance counter	259
Cleaning the printer.....	259
Cleaning the touch screen.....	260
Cleaning the printhead mirror.....	260
Loading trays.....	261
Loading the multipurpose feeder.....	263

Parts catalog..... 266

Legend.....	266
Assembly 1: Covers.....	267
Assembly 2:	
Assembly 3: Control panel.....	271
Assembly 4: Electronics.....	273
Assembly 5: Motors.....	275
Assembly 6: Sensors 1.....	277
Assembly 7: Sensors 2.....	279
Assembly 8: Paper feed.....	281
Assembly 9: Paper pick.....	283
Assembly 10:	
Assembly 11: Rollers.....	287
Assembly 12: MPF and standard tray.....	289
Assembly 13:	
Assembly 14: Optional trays.....	293
Assembly 15: Printer stand.....	295
Assembly 16:	
Assembly 17:	

Printer specifications.....	301
Power consumption.....	301
Product power consumption	301
Sleep Mode.....	301
Hibernate Mode.....	302
Off mode	302
Total energy usage	302
Applicability of Regulation (EU) 2019/2015 and (EU) 2019/2020.....	302
Selecting a location for the printer.....	302
Noise emission levels.....	303
Temperature information.....	304
Options and features.....	305
Available internal options.....	305
Contacting customer support.....	305
Installing optional trays.....	305
Adding available options in the print driver.....	307
Theory of operation.....	309
POR sequence.....	309
Print cycle operation.....	309
Print engine layout.....	309
Flowchart	310
EP process.....	310
Printer operation.....	316
Printer sections	316
Printer paper path	317
Printer paper path sensors	319

General information

Printer model configurations


MX-B468P printer is network-capable, laser printer. The printer supports monochrome printing and is embedded with home screen solutions and applications. All information in this service manual pertains to all models unless explicitly noted.

The printers are available in the following models:


Model	Configurations	Machine type/model number
MX-B468P	Monochrome with 2.8-inch touch-screen display, duplex print, networking, intelligent storage drive (ISD) support, optional tray support, wireless module support	4602-48H

Finding the printer serial number

- 1 Open door A.

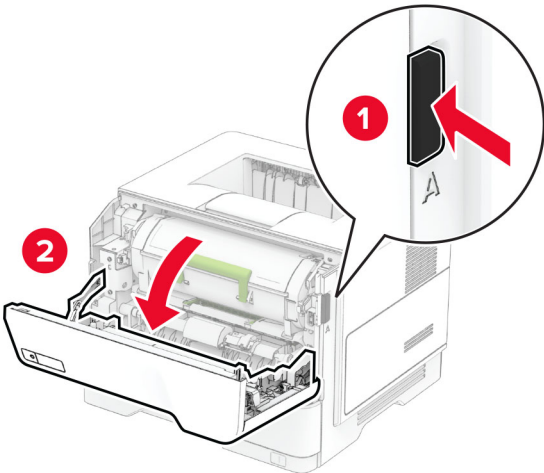

- 2 Locate the serial number.

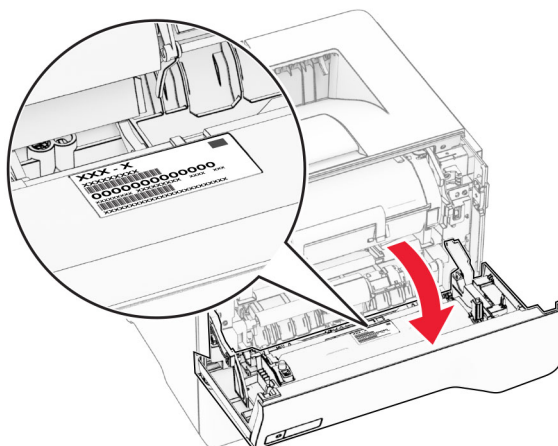

Selecting paper

Paper guidelines

Use the appropriate paper to prevent jams and help ensure trouble-free printing.

- Always use new, undamaged paper.
- Before loading paper, know the recommended printable side of the paper. This information is usually indicated on the paper package.
- Do not use paper that has been cut or trimmed by hand.
- Do not mix paper sizes, types, or weights in the same tray; mixing results in jams.
- Do not use coated papers unless they are specifically designed for electrophotographic printing.

For more information, see the *Paper and Specialty Media Guide*.

Paper characteristics

The following paper characteristics affect print quality and reliability. Consider these factors before printing on them.

Weight

Trays can feed paper of varying weights. Paper lighter than 60 g/m² (16 lb) may not be stiff enough to feed properly, and may cause jams. For more information, see the “Supported paper weights” topic.

Curl

Curl is the tendency for paper to curl at its edges. Excessive curl can cause paper feeding problems. Curl can occur after the paper passes through the printer, where it is exposed to high temperatures. Storing paper unwrapped in hot, humid, cold, or dry conditions can contribute to paper curling before printing and can cause feeding problems.

Smoothness

Paper smoothness directly affects print quality. If paper is too rough, toner cannot fuse to it properly. If paper is too smooth, it can cause paper feeding or print quality issues. We recommend the use of paper with 50 Sheffield points.

Moisture content

The amount of moisture in paper affects both print quality and the printer ability to feed the paper correctly. Leave paper in its original wrapper until you use it. Exposure of paper to moisture changes can degrade its performance.

Before printing, store paper in its original wrapper for 24 to 48 hours. The environment in which the paper is stored must be the same as the printer. Extend the time several days if the storage or transportation environment is very different from the printer environment. Thick paper may also require a longer conditioning period.

Grain direction

Grain refers to the alignment of the paper fibers in a sheet of paper. Grain is either *grain long* which runs the length of the paper, or *grain short* which runs the width of the paper. For recommended grain direction, see the “Supported paper weights” topic.

Fiber content

Most high-quality xerographic paper is made from 100 percent chemically treated pulped wood. This content provides the paper with a high degree of stability, resulting in fewer paper feeding problems and better print quality. Paper containing fibers such as cotton can negatively affect paper handling.

Unacceptable paper

The following paper types are not recommended for use with the printer:

- Chemically treated papers that are used to make copies without carbon paper. They are also known as carbonless papers, carbonless copy paper (CCP), or no carbon required (NCR) paper.
- Preprinted papers with chemicals that may contaminate the printer.
- Preprinted papers that can be affected by the temperature in the printer fuser.
- Preprinted papers that require a registration (the precise print location on the page) greater than ± 2.3 mm (± 0.09 in.). For example, optical character recognition (OCR) forms.

Sometimes, registration can be adjusted with a software app to print successfully on these forms.

- Coated papers (erasable bond), synthetic papers, or thermal papers.
- Rough-edged, rough or heavily textured surface papers, or curled papers.
- Recycled papers that fail EN12281:2002 (European).
- Paper weighing less than 60 g/m² (16 lb).
- Multiple-part forms or documents.

Storing paper

Use these paper storage guidelines to help avoid jams and uneven print quality:

- Store paper in its original wrapper in the same environment as the printer for 24 to 48 hours before printing.
- Extend the time several days if the storage or transportation environment is very different from the printer environment. Thick paper may also require a longer conditioning period.
- For best results, store paper where the temperature is 21°C (70°F) and the relative humidity is 40 percent.
- Most label manufacturers recommend printing in a temperature range of 18–24°C (65–75°F) with relative humidity between 40 and 60 percent.
- Store paper in cartons, on a pallet or shelf, rather than on the floor.
- Store individual packages on a flat surface.
- Do not store anything on top of individual paper packages.
- Take paper out of the carton or wrapper only when you are ready to load it in the printer. The carton and wrapper help keep the paper clean, dry, and flat.

Selecting preprinted forms and letterhead

- Use grain long paper.
- Use only forms and letterhead printed using an offset lithographic or engraved printing process.
- Avoid paper with rough or heavily textured surfaces.
- Use inks that are not affected by the resin in toner. Inks that are oxidation-set or oil-based generally meet these requirements; latex inks might not.
- Print samples on preprinted forms and letterheads considered for use before buying large quantities. This action determines whether the ink in the preprinted form or letterhead affects print quality.
- When in doubt, contact your paper supplier.
- When printing on letterhead, load the paper in the proper orientation for your printer. For more information, see the *Paper and Specialty Media Guide*.

Supported paper sizes

Paper size	Standard 250- or 550-sheet tray	Optional 250- or 550-sheet tray	Multipurpose feeder	Two-sided printing
A4 210 x 297 mm (8.27 x 11.7 in.)	✓	✓	✓	✓
A5 Portrait (SEF) 148 x 210 mm (5.83 x 8.27 in.)	✓	✓	✓	x
¹ The default support is short-edge feed. ² Supported only in the MS639 printer model. ³ When Universal is selected, the page is formatted for 215.90 x 355.60 mm (8.5 x 14 in.) unless specified by the application. ⁴ Paper must at least be 210 mm (8.27 in.) wide and 279.4 mm (11 in.) long for two-sided printing.				

Paper size	Standard 250- or 550-sheet tray	Optional 250- or 550-sheet tray	Multipurpose feeder	Two-sided printing
A5 Landscape (LEF) ¹ 210 x 148 mm (8.27 x 5.83 in.)	✓	✓ ²	✓	X
A6 ² 105 x 148 mm (4.13 x 5.83 in.)	✓	✓	✓	X
JIS B5 182 x 257 mm (7.17 x 10.1 in.)	✓	✓	✓	X
Oficio (Mexico) 216 x 340 mm (8.5 x 13.4 in.)	✓	✓	✓	✓
Hagaki 100 x 148 mm (3.93 x 5.83 in.)	X	X	✓	X
Statement 139.7 x 215.9 mm (5.5 x 8.5 in.)	✓	✓	✓	X
Executive 184.2 x 266.7 mm (7.25 x 10.5 in.)	✓	✓	✓	X
Letter 215.9 x 279.4 mm (8.5 x 11 in.)	✓	✓	✓	✓
Legal 215.9 x 355.6 mm (8.5 x 14 in.)	✓	✓	✓	✓
Folio 215.9 x 330.2 mm (8.5 x 13 in.)	✓	✓	✓	✓
Universal ³ 105 x 148 mm to 215.9 x 359.92 mm (4.13 x 5.83 in. to 8.5 x 14.17 in.)	✓	✓	X	✓ ⁴

¹ The default support is short-edge feed.

² Supported only in the MS639 printer model.

³ When Universal is selected, the page is formatted for 215.90 x 355.60 mm (8.5 x 14 in.) unless specified by the application.

⁴ Paper must at least be 210 mm (8.27 in.) wide and 279.4 mm (11 in.) long for two-sided printing.

Paper size	Standard 250- or 550-sheet tray	Optional 250- or 550-sheet tray	Multipurpose feeder	Two-sided printing
Universal³ 76.2 x 127 mm to 215.9 x 359.92 mm (3 x 5.83 in. to 8.5 x 14.17 in.)	X	X	✓	X
Universal³ 25.4 x 25.4 mm to 215.9 x 355.6 mm (1 x 1 in. to 8.5 x 14 in.)	X	X	X	X
7 3/4 Envelope 98.4 x 190.5 mm (3.875 x 7.5 in.)	X	X	✓	X
9 Envelope 98.4 x 225.4 mm (3.875 x 8.9 in.)	X	X	✓	X
10 Envelope 104.8 x 241.3 mm (4.12 x 9.5 in.)	X	X	✓	X
DL Envelope 110 x 220 mm (4.33 x 8.66 in.)	X	X	✓	X
C5 Envelope 162 x 229 mm (6.38 x 9.01 in.)	X	X	✓	X
B5 Envelope 176 x 250 mm (6.93 x 9.84 in.)	X	X	✓	X
Other Envelope 76.2 x 127 mm to 215.9 x 359.92 mm (3 x 5.83 in. to 8.5 x 14.17 in.)	X	X	✓	X

¹ The default support is short-edge feed.

² Supported only in the MS639 printer model.

³ When Universal is selected, the page is formatted for 215.90 x 355.60 mm (8.5 x 14 in.) unless specified by the application.

⁴ Paper must at least be 210 mm (8.27 in.) wide and 279.4 mm (11 in.) long for two-sided printing.

Supported paper types

Paper type	Standard 250- or 550-sheet tray	Optional 250- or 550-sheet tray	Multipurpose feeder	Two-sided printing
Plain paper	✓	✓	✓	✓
Card stock	X	X	✓	X
Recycled	✓	✓	✓	✓
Paper labels*	✓	✓	✓	X
Bond	✓	✓	✓	✓
Letterhead	✓	✓	✓	✓
Preprinted	✓	✓	✓	✓
Colored Paper	✓	✓	✓	✓
Light Paper	✓	✓	✓	✓
Heavy Paper	✓	✓	✓	✓
Rough/Cotton	✓	✓	✓	✓
Envelope	X	X	✓	X
Rough envelope	X	X	✓	X

* One-sided paper labels are supported for occasional use of less than 20 pages per month. Vinyl, pharmacy, or two-sided labels are not supported.

Supported paper weights

Standard 250- or 550-sheet tray	Optional 250- or 550-sheet tray	Multipurpose feeder	Two-sided printing*
60–120 g/m ² (16–32 lb. bond)	60–120 g/m ² (16–32 lb. bond)	60–216 g/m ² (16–58 lb. bond)	60–120 g/m ² (16–24 lb. bond)

* Does not support card stock, labels, or envelopes.

Tools required for service

- Flat-blade screwdrivers, various sizes
- #1 Phillips screwdriver, magnetic

- #2 Phillips screwdriver, magnetic
- #2 Phillips screwdriver, magnetic short-blade
- Torx screwdriver (T20 head)
- Needle-nose pliers
- Diagonal side cutters
- Spring hook
- Feeler gauges
- Analog or digital multimeter
- 3-mm ball hex wrench
- Toner vacuum
- Flashlight



VORSICHT – QUETSCHGEFAHR: Um das Risiko einer Quetschung zu vermeiden, gehen Sie in Bereichen, die mit diesem Etikett gekennzeichnet sind, mit Vorsicht vor. Quetschungen können im Bereich von beweglichen Komponenten auftreten, wie z. B. Zahnrädern, Klappen, Fächern und Abdeckungen.

Troubleshooting overview

Performing the initial troubleshooting check

Before you start the troubleshooting procedures, perform the following checks:

- Use genuine Lexmark supplies and parts for the best results. Third-party supplies or parts may affect the performance, reliability, or life of the printer and its imaging components.
- With the power cord unplugged from the electrical outlet, check that the cord is free from the breakage, short circuits, disconnected wires, or incorrect connections.
- Make sure the printer is properly grounded. Check the power cord ground terminal.
- Make sure the power supply line voltage is within 10% of the rated line voltage.
- Make sure the machine is securely installed on a level surface in a well-ventilated area.
- Make sure the room temperature is between 16 and 32°C (60 and 90°F) and that the relative humidity is between 20 and 80%.
- Avoid sites generating ammonia gas, high temperature, high humidity (near water faucets, kettles, humidifiers), cold spaces, near open flames, and dusty areas.
- Avoid sites exposed to direct sunlight.
- Make sure the paper is the recommended paper for this printer.
- Make a trial print with paper from a newly opened package, and check the result.

Power-on Reset (POR) sequence

When you turn on the printer, it performs a POR sequence.

Check for correct POR functioning of the base printer by observing the following:

- 1** The control panel indicator light turns on.
- 2** The control panel display turns on.
- 3** A splash screen appears on the display.
- 4** The cooling fan turns on.
- 5** The fuser heater turns on.

Note: The fuser takes longer to warm up from a cold start than from a warm start.

- 6** The main drive motor turns on.

- 7 The EP drive drives the developer shaft located in the imaging unit.
- 8 The exit rollers turn.
- 9 The control panel indicator light blinks.
- 10 **Ready** appears on the display.

Using Safe Mode

Safe Mode lets the printer continue to operate in a special limited mode in which it attempts to continue offering as much functionality as possible despite known issues.

Warning—Potential Damage: Safe Mode is intended as a short-term workaround and should be used only in the case of a non-critical error when a print job must be completed before service can be arranged to repair the printer. The printer must be returned to standard operating mode before diagnostics can be run or full-function printing can continue.

You can enter Safe Mode in one of the following ways:

- Enable Safe Mode from the Configuration menu, and then POR the printer.
- Press the **Stop** and **Back** keys, and then POR the printer.

Return the printer to standard operating mode to service the printer and return to full-function printing.

Safe Mode print behavior

The following table outlines the behavior for this printer model while in Safe Mode:

Safe Mode engine features	Engine behavior	Control panel behavior
Simplex printing only	Will report that no duplexer is installed.	Duplex print option will not be selectable.
Ignore duplex sensor		
Ignore bin full sensor	Bin full messages will not be reported.	Bin full messages will not occur.
Print at narrow media operating point	Pages will be printed slower.	N/A
Ignore narrow media sensor	Narrow media will print without restrictions.	N/A
Ignore all input options	Will report that only Tray 1 is installed.	Only Tray 1 and the MPF will be selectable.
Ignore all output options	Will not report any installed finishing options.	Finishing options will not be selectable.
Use large interpage gaps	Pages will have large interpage gaps.	N/A

Replace cartridge, printer region mismatch

To correct this problem, purchase a cartridge with the correct region that matches the printer region, or purchase a worldwide cartridge.

- The first number in the message after 42 indicates the region of the printer.
- The second number in the message after 42 indicates the region of the cartridge.

Printer and toner cartridge regions

Region	Numeric code
Worldwide or Undefined region	0
North America (United States, Canada), Australia, New Zealand	1
European Economic Area, Iceland, Liechtenstein, and Norway	2
Asia Pacific	3
Latin America	4
Rest of Europe, Middle East, Africa	5
Invalid region	9

Note: To find the region settings of the printer and toner cartridge, print the print quality test pages. From the home screen, touch **Settings > Troubleshooting > Print Quality Test Pages**.

Non-Sharp supply

The printer has detected a non-Sharp supply or part installed in the printer.

Your Sharp printer is designed to function best with genuine Sharp supplies and parts. Use of third-party supplies or parts may affect the performance, reliability, or life of the printer and its imaging components.

All life indicators are designed to function with Sharp supplies and parts and may deliver unpredictable results if third-party supplies or parts are used. Imaging component usage beyond the intended life may damage your Sharp printer or associated components.

Warning—Potential Damage: Use of third-party supplies or parts can affect warranty coverage. Damage caused by the use of third-party supplies or parts may not be covered by the warranty.

To accept any and all of these risks and to proceed with the use of non-genuine supplies or parts in your printer, touch and hold the error message on the display using two fingers for 15 seconds. When a confirmation dialog box appears, touch **Continue**.

If you do not want to accept these risks, then remove the third-party supply or part from your printer and install a genuine Sharp supply or part. For more information, see [“Using genuine Lexmark parts and supplies” on page 90](#).

If the printer does not print after clearing the error message, then reset the supply usage counter.

- 1 From the home screen, touch **Settings > Device > Maintenance > Configuration Menu > Supply Usage And Counters**.
- 2 Select the part or supply that you want to reset, and then touch **Start**.

3 Read the warning message, and then touch **Continue**.

4 Using two fingers, touch the display for 15 seconds to clear the message.

Note: If you are unable to reset the supply usage counters, then return the supply item to the place of purchase.

Securing the printer

Resetting the printer without admin credentials

Notes:

- Resetting the printer or replacing the controller board deletes all security settings.
- Before changing the security settings, ask permission from your administrator.

1 Perform an Out of Service Erase to reset the printer to factory defaults without using admin credentials. For more information, see [“Erasing printer memory” on page 36](#).

Warning—Potential Damage: This method makes the device vulnerable to hacking because it allows the creation of an admin account afterwards. By default, newer firmware versions restrict Out of Service Erase to admin users only, making the printer more secure and remembering the admin password more important.

2 If Out of Service Erase is unavailable, then use the security reset jumper to reset the printer to factory defaults. For more information, see [“Using the security reset jumper” on page 34](#).

3 If the effect of the jumper reset is disabled, then replace the controller board. For more information, see [“Controller board removal” on page 183](#).

Using the security reset jumper

The security reset jumper is on the controller board. It can be used if the admin password is lost or forgotten, and Out of Service Erase is not available.


Notes:

- To enable the effect of the security reset jumper, from the home screen navigate to: **Security > Miscellaneous > Security Reset Jumper > Enable “Guest” Access**.
- To disable the effect of the jumper, select **No Effect** from the Security Reset Jumper section in the Security menu. If the password is forgotten or lost, perform an Out of Service Erase or replace the controller board. See [“Resetting the printer without admin credentials” on page 34](#) or [“Controller board removal” on page 183](#).

1 Turn off the printer.

2 Remove the controller board shield.

- 3 Locate the security jumper (A) on the controller board.

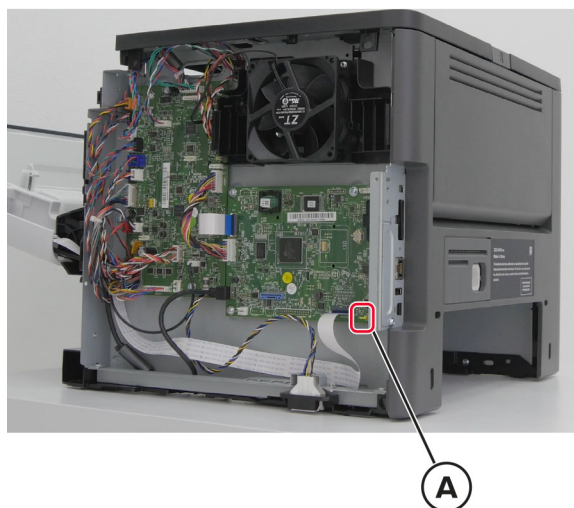

- 4 Move the jumper to cover the middle and exposed prongs.

Note: The movement of the jumper triggers the reset, not the jumper position.

- 5 Attach the controller board shield.

- 6 Turn on the printer.

Notes:

- The security framework remains in place after the reset. Public permissions are reset to default and now include Out of Service Erase as an option.
- If LDAP is used to authenticate the copy function in MFPs, then the LDAP configuration and copy function are no longer protected.
- If Enable Audit is activated in the Security Audit Log, then the printer logs a message each time the jumper is reset.
- Physical access to the printer is required to use the jumper, making it more secure against hacking. To prevent tampering of the jumper, secure the controller board cage with a Kensington lock.

Data security notice

Identifying printer memory

- **Volatile memory**—The printer uses standard random access memory (RAM) to buffer user data temporarily during simple print and copy jobs.
- **Nonvolatile memory**—The printer may use two forms of nonvolatile memory: EEPROM and NAND (flash memory). Both types are used to store the operating system, printer settings, network information, scanner and bookmark settings, and embedded solutions.
- **Hard disk memory**—Some printers have a hard disk drive installed. The hard disk is designed for printer-specific functionality and cannot be used for long-term storage of data that is not print-related. The hard disk does not let users extract information, create folders, create disk or network file shares, or transfer FTP information directly from a client device. The hard disk can retain buffered user data from complex print jobs, form data, and font data.

The following parts can store memory:

- Engine board
- User interface controller card (UICC)
- Controller board
- Optional hard disks

Note: The printer engine board and controller board contain NVRAM.

Erasing printer memory

To erase volatile memory, turn off the printer.

To erase nonvolatile memory, do the following:

- 1** From the control panel, navigate to **Settings > Device > Maintenance > Out of Service Erase > Sanitize all information on nonvolatile memory**.
- 2** Select **Sanitize all information on nonvolatile memory**, and then select **ERASE**.
- 3** Follow the instructions on the screen.

To erase hard disk memory, do the following:

- 1** From the control panel, navigate to **Settings > Device > Maintenance > Out of Service Erase > Sanitize all information on hard disk**.
- 2** Select **Sanitize all information on hard disk**, and then select **ERASE**.
- 3** Follow the instructions on the screen.

Note: This process can take from several minutes to more than an hour, making the printer unavailable for other tasks.

If a hard disk is replaced, then do the following:

- 1** Remove the hard disk, and then return it to the customer.
- 2** Request the customer to sign the *Customer Retention* form.
Note: You can get printed copies of the form from your Lexmark partner manager.
- 3** Take a photo of the signed form, and then upload it to the Service Request debrief tool.
- 4** Fax or e-mail the signed form to the number or e-mail address shown at the bottom of the form.

Fixing print quality issues


Initial print quality check

Before troubleshooting print problems, do the following:

- Make sure that the printer is in an area that follows the recommended operating environment and power requirement specifications.
- Check the status of the supplies. Replace supplies that are low or empty.

- Load 20–21-lb bond (75–80 g/m²) plain letter or A4 paper. Make sure that the paper guides are properly set and locked. From the home screen, set the paper size and type to match the paper loaded in the tray.
- From the home screen, touch **Settings** > **Troubleshooting** > **Print Quality Test Pages**.
- Print and keep the Menu Settings Page. The original page is used to restore the custom settings if necessary. From the home screen, touch **Settings** > **Reports** > **Menu Settings Page**.
- On the printed Menu Settings Page, check if the print resolution is set to 1200 IQ and the toner darkness is set to 8.
- Check the toner cartridge for damage, and replace if necessary.
- Make sure that the correct print driver is installed. If the wrong print driver is installed, then incorrect characters could print and the copy may not fit the page correctly.
- Make sure that the paper loaded is from a fresh package. Paper absorbs moisture due to high humidity. Store paper in its original wrapper until you use it.

Gray background or toner fog

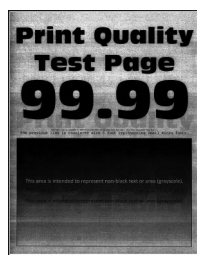


Note: Before doing this print quality check, see [“Initial print quality check” on page 36](#).

- 1 Restart the printer.
- 2 From the home screen, do the following:
 - Increase the toner darkness in the Quality menu. Touch **Settings** > **Print** > **Quality**.
Note: 8 is the factory default setting.
 - Set the paper type, texture, and weight in the Paper menu to match the paper loaded. Touch **Settings** > **Paper**.
- 3 Check if the printer is using a genuine and supported Lexmark toner cartridge.


Note: If the printer is using a third-party toner cartridge, then refer the users to their supplier.

- 4 Check for any packing material left on the imaging unit, including the red plastic separator plastic (A).

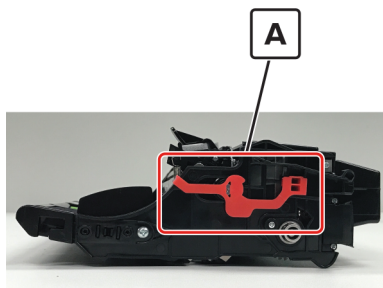


Note: You may need a pair of pliers to remove a piece of broken plastic inside the imaging unit.

- 5 Check the charge roller contact (B) on the right side of the imaging unit for damage and contamination.

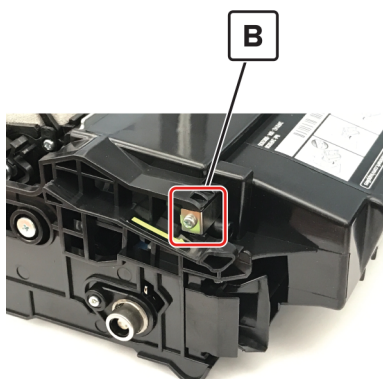


- 6 Make sure that the connections between the controller board and the power supply are properly connected.
- 7 Check the photoconductor charge contact (C) on the right side of the printer frame for contamination.

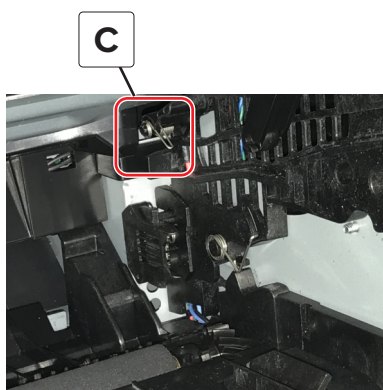

Note: Poor electrical contact to the photoconductor is the most likely source of a full-page background defect.


- 8 Check if the photoconductor charge contact is bent, damaged, or not in proper contact with the imaging unit.

Blank pages

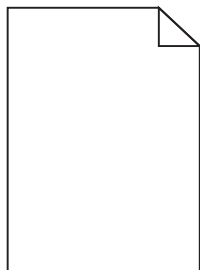


Note: Before doing this print quality check, see [“Initial print quality check” on page 36](#).


- 1** Check if the printer is using a genuine and supported Lexmark toner cartridge.
Note: If the printer is using a third-party toner cartridge, then refer the users to their supplier.
- 2** Check the imaging unit for the following:
 - a** Residual packing material
 - b** Damage and improper installation
- 3** Firmly shake the imaging unit to redistribute the toner, and then reinstall it.
- 4** With the imaging unit removed, do the following to check if the coupler is stuck.
 - a** While slowly closing the door, observe if the coupler moves inward.

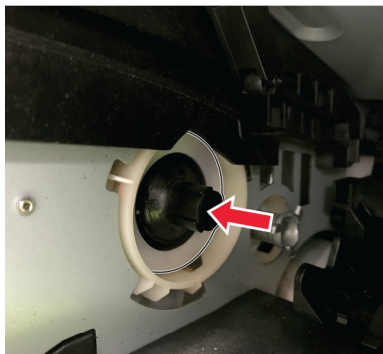


- b** While slowly opening the door, observe if the coupler moves outward.

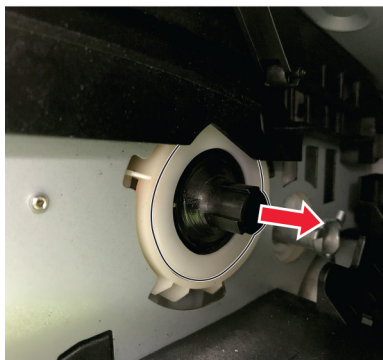

If the coupler is stuck, then reach inside the printer and manually reposition the coupler as shown.

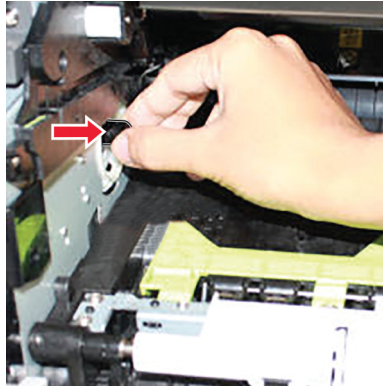

- 5** Check if the imaging unit contact (A) is bent, damaged, or not in proper contact with the imaging unit.

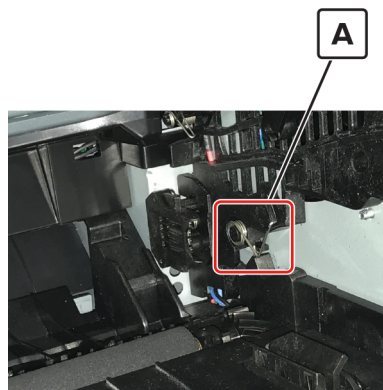

- 6** Make sure that the connections between the controller board and power supply are properly connected.
- 7** Check the transfer roller for the following:
- a** Improper installation
 - b** Contamination and damage
 - c** Damage on the transfer roller left contact spring in the transfer roller left arm

For more information, see [“Transfer roller removal” on page 195](#).

- 8** Check the coupler for signs of damage. The coupler is on the main drive motor.
- Coupler in good condition



- Coupler in bad condition



For more information, see [“Main drive gearbox removal” on page 166](#).

- 9 Make sure that the connections on the controller board and printhead are properly connected.
- 10 Check the printhead for damage and improper installation. For more information, see [“Printhead removal” on page 238](#).

Print is too dark



Note: Before doing this print quality check, see [“Initial print quality check” on page 36](#).

- 1 Check if the printer is using a genuine and supported Lexmark toner cartridge.

Note: If the printer is using a third-party toner cartridge, then refer the users to their supplier.

- 2 Restart the printer.


- 3 From the home screen, do the following:

- Decrease the toner darkness. Touch **Settings** > **Print** > **Quality** > **Toner Darkness**.

Note: 8 is the factory default setting.


- Set the paper type, texture, and weight in the Paper menu to match the paper loaded. Touch **Settings** > **Paper**.
- Depending on the operating system, specify the paper type from Printing Preferences or Print dialog.

- 4 Check if the imaging unit contacts (A) are bent, damaged, or not in proper contact with the imaging unit.

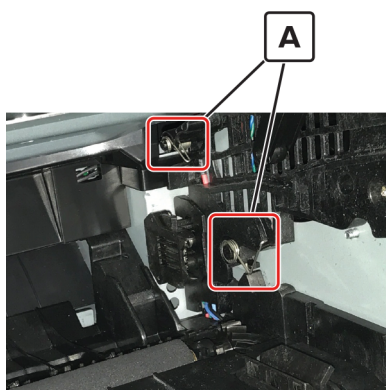

- 5 Make sure that the connections between the controller board and the power supply are properly connected.
- 6 Check the power supply for damage and improper installation. For more information, see [“Power supply removal” on page 204](#).

Print is too light

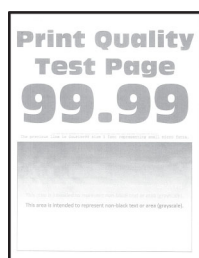

Note: Before doing this print quality check, see [“Initial print quality check” on page 36](#).

- 1 Check if the printer is using a genuine and supported Lexmark toner cartridge.

Note: If the printer is using a third-party toner cartridge, then refer the users to their supplier.

- 2 Restart the printer.
- 3 From the home screen, do the following:
 - Increase the toner darkness. Touch **Settings** > **Paper** > **Quality** > **Toner Darkness**.
Note: 8 is the factory default setting.
 - Set the paper type, texture, and weight in the Paper menu to match the paper loaded. Touch **Settings** > **Paper**.
- 4 Push either side of the transfer roller to check if it depresses and bounces back into place.
 If the transfer roller does not depress and bounce back into place, then reinstall it by doing the following:
 - a Pull up the blue gear on the transfer roller.
 - b Pull out the blue gear from the right side to the left.

For more information, see [“Transfer roller removal” on page 195](#).

- 5 Check the imaging unit for the following:
 - a Damage to the shutter

Note: The shutter opens to receive toner from the toner cartridge.
 - b Status of the imaging unit
 - 1 From the home screen, touch **Status/supplies**.
 - 2 Touch **View Supplies**.
 - c Damage, contamination, and improper installation
- 6 Firmly shake the imaging unit to redistribute the toner, and then reinstall it.
- 7 Clean the printhead lens. For more information, see [“Cleaning the printhead mirror” on page 260](#).
- 8 Check the power supply for damage, contamination, and improper installation. For more information, see [“Power supply removal” on page 204](#).
- 9 Make sure that the connections between the controller board and the cartridge gearbox are properly connected.
- 10 Check the cartridge gearbox for damage and improper installation. For more information, see [“Cartridge gearbox removal” on page 172](#).
- 11 Check the controller board for damage, contamination, and improper installation. For more information, see [“Controller board removal” on page 183](#).

Paper curl



Note: Before doing this print quality check, see [“Initial print quality check” on page 36](#).

- 1 Check if the printer is using a genuine and supported Lexmark toner cartridge.

Note: If the printer is using a third-party toner cartridge, then refer the users to their supplier.
- 2 Make sure that the guides in the tray are in the correct position for the paper loaded.
- 3 From the home screen, do the following:
 - a Set the paper size, type, and weight in the Paper menu to match the paper loaded. Touch **Settings** > **Paper**.
 - b Depending on the operating system, specify the paper size from Printing Preferences or Print dialog.

Folded or wrinkled paper



Note: Before doing this print quality check, see [“Initial print quality check” on page 36](#).

- 1 Check if the printer is using a genuine and supported Lexmark toner cartridge.


Note: If the printer is using a third-party toner cartridge, then refer the users to their supplier.

- 2 Check if the toner cartridge is compatible with the imaging unit.
- 3 Make sure that the fuser entry guide is free of waste toner and dust.

Warning—Potential Damage: Clean the fuser entry guide with a toner vacuum and cloth. Do not use compressed air.

- 4 Check if the fuser has reached end of life.

Solid black pages

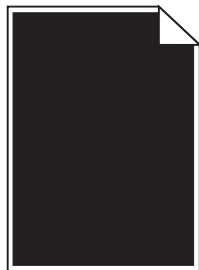


Note: Before doing this print quality check, see [“Initial print quality check” on page 36](#).

- 1 Check if the printer is using a genuine and supported Lexmark toner cartridge.


Note: If the printer is using a third-party toner cartridge, then refer the users to their supplier.

- 2 Check for any packing material left on the imaging unit, including the red plastic separator (A).

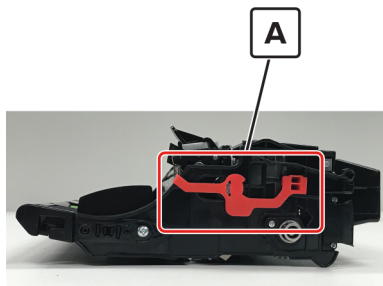


Note: You may need a pair of pliers to remove a piece of broken plastic inside the imaging unit.

- 3 Check the charge roller contact (B) on the right side of the imaging unit for damage and contamination.

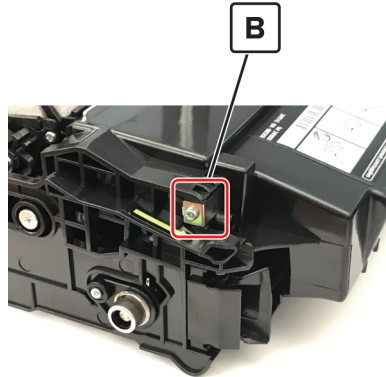

- 4 Check if the imaging unit contact (C) is contaminated, broken, or bent out of proper position.

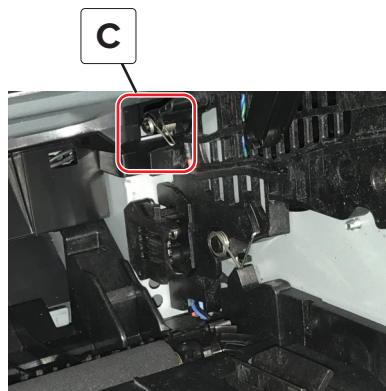

- 5 Check the high voltage metal contacts on the imaging unit for damage.
- 6 Make sure that the connections between the controller board and the power supply are properly connected.

Repeating defects



Note: Before doing this print quality check, see [“Initial print quality check” on page 36](#).

- 1 Using the Print Quality Test Pages, check if the distance between the repeating defects is equal to any of the following:
- 97 mm (3.82 in.)
 - 47 mm (1.85 in.)
 - 38 mm (1.5 in.)

If the distance between the repeating defects is equal to the listed measurements, then check the imaging unit for damage, contamination, and improper installation.

- 2 Check if the distance between the repeating defects is equal to 3.15 inches (85 mm).

If the distance between the repeating defects is equal to 3.15 inches (85 mm), then check the fuser for damage, contamination, and improper installation. For more information, see [“Fuser removal” on page 232](#).

- 3 Check the transfer roller for damage, contamination, and improper installation. For more information, see [“Transfer roller removal” on page 195](#).

Skewed print



Note: Before doing this print quality check, see [“Initial print quality check” on page 36](#).

- 1 Make sure that the guides in the tray are in the correct position for the paper loaded.
- 2 Check the tray pick roller or MPF pick roller for wear, damage, and contamination. For more information, see [“Pick roller removal” on page 214](#) and [“MPF pick roller and separator pad removal” on page 198](#).
- 3 Do a print test. Enter the Diagnostics menu, and then touch **PRINT TESTS** > **Tray [x]**.

Note: [x] refers to the tray where the skewed prints are printed come from.

- 4 Adjust the margins. Enter the Diagnostics menu, and then touch **REGISTRATION**.
- 5 Perform the paper skew adjustment. See [“Printhead adjustment” on page 163](#).

Streaked vertical lines appear on prints



Note: Before doing this print quality check, see [“Initial print quality check” on page 36](#).

- 1 Check if the printer is using a genuine and supported Lexmark toner cartridge.
Note: If the printer is using a third-party toner cartridge, then refer the users to their supplier.
- 2 Check the imaging unit for damage, contamination, and improper installation.

- 3 Check the fuser for the following:
 - a Damage, contamination and improper installation
 - b Debris on the rollers and belts

Horizontal light bands




Note: Before doing this print quality check, see [“Initial print quality check” on page 36](#).

- 1 Check if the printer is using a genuine and supported Lexmark toner cartridge.

Note: If the printer is using a third-party toner cartridge, then refer the users to their supplier.

- 2 Restart the printer.
- 3 Check the imaging unit contact block (A), including the white and red wires, for damage and improper installation.

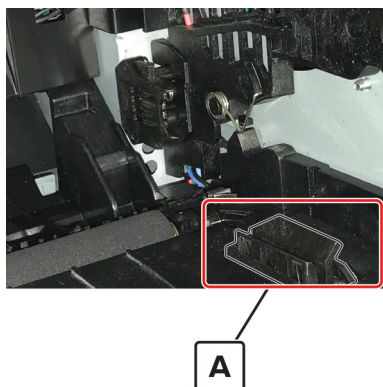

- 4 Check the power supply for damage, contamination, and improper installation. For more information, see [“Power supply removal” on page 204](#).

Vertical light bands



Note: Before doing this print quality check, see [“Initial print quality check” on page 36](#).

- 1 Check if the printer is using a genuine and supported Lexmark toner cartridge.

Note: If the printer is using a third-party toner cartridge, refer the users to their supplier.

- 2 Check the printhead for the following:


- a Clean the printhead lens. See [“Cleaning the printhead mirror” on page 260](#).

Note: This step applies only to printer models that are installed with a galvo printhead. To determine whether the printhead is galvo, check the serial number of the printer. The sixth digit character must be in the 0–9 or B–N range. For example: 4514 20HH 007CR.

- b Check for damage, contamination, and improper installation. For more information, see the [“Printhead removal” on page 238](#).

- 3 Check the imaging unit for damage, contamination, and improper installation.

Vertical dark bands

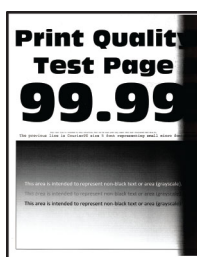


Note: Before doing this print quality check, see [“Initial print quality check” on page 36](#).

- 1 Check if the printer is using a genuine and supported Lexmark toner cartridge.

Note: If the printer is using a third-party toner cartridge, then refer the users to their supplier.

- 2 Check the imaging unit for damage, contamination, and improper installation.
- 3 Check for any packing material left on the imaging unit, including the red plastic separator (A).

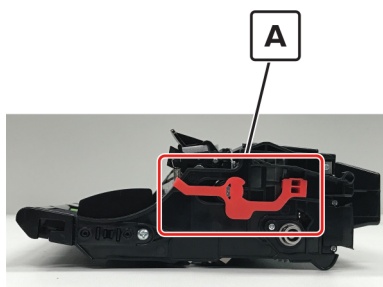


Note: You may need a pair of pliers to remove a piece of broken plastic inside the imaging unit.

- 4 Make sure to block the bright light from entering the right side of the printer.

Note: In cases where the printer cannot be moved or relocated, add a cover to the fan inlet vent to block the light from entering the printer, or contact the next level of support.

Vertical dark streaks with print missing

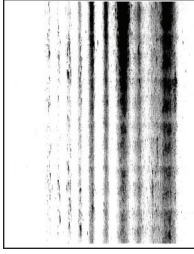


Note: Before doing this print quality check, see [“Initial print quality check” on page 36](#).

- 1 Check if the printer is using a genuine and supported Lexmark toner cartridge.


Note: If the printer is using a third-party toner cartridge, then refer the users to their supplier.

- 2 Check for any packing material left on the imaging unit, including the red plastic separator (A).

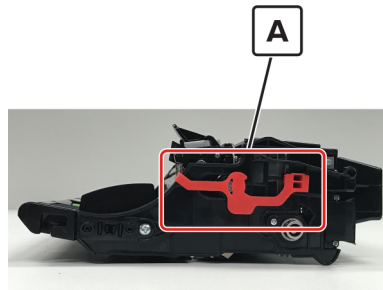


Note: You may need a pair of pliers to remove a piece of broken plastic inside the imaging unit.

- 3 Check the charge roller contact (B) on the right side of the imaging unit for damage and contamination.

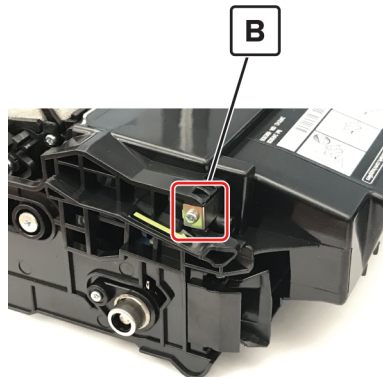

- 4 Check if the imaging unit contacts (C) are contaminated or bent out of proper position.

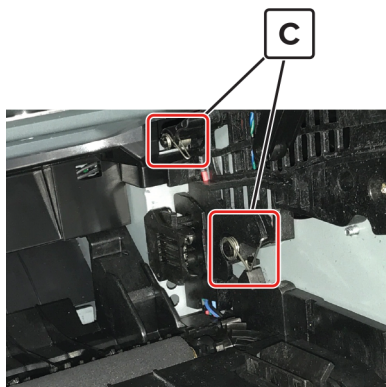

- 5 Check the imaging unit for damage, contamination, and improper installation.
- 6 Make sure that the connections between the controller board and the power supply are properly connected.
- 7 Check the power supply for damage, contamination, and improper installation. For more information, see [“Power supply removal” on page 204](#).

White streaks and voided areas



Note: Before doing this print quality check, see [“Initial print quality check” on page 36](#).

- 1 Check if the printer is using a genuine and supported Lexmark toner cartridge.

Note: If the printer is using a third-party toner cartridge, do not replace the imaging unit. Refer the users to their supplier.


- 2 From the home screen, do the following:

- Set the paper type and weight in the Paper menu to match the paper loaded. Touch **Settings** > **Paper**.
- Update the firmware to the latest version available.
- Enter the Diagnostics menu, and then change the EngSetting 14 value to 48.


Note: You can also change the setting through a bundle file or NPA command.

- Set the Quiet Mode to **Off**. Touch **Settings** > **Device** > **Maintenance** > **Configuration Menu**.
- Review the Event Log Summary sheets and check if either error code 31.46 or 31.66 occurred for the imaging unit. If they did, check if they also occurred for the toner cartridge.

- 3 Check the shutter tab (A) on the toner cartridge for signs of damage.

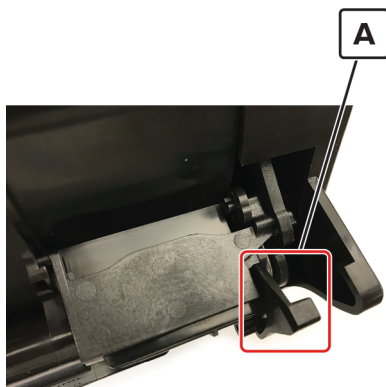

- 4 Check if the imaging unit contacts (B) are contaminated or bent out of proper position.

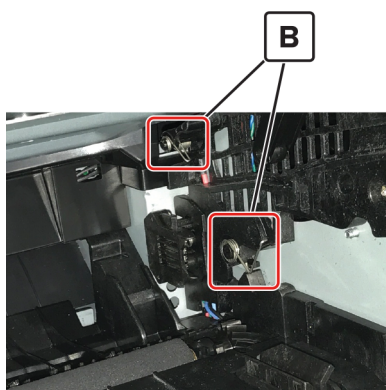

- 5 Check the toner cartridge and imaging unit for damage, contamination, and improper installation.
- 6 Make sure that the connections between the controller board and the power supply are properly connected.
- 7 Check the power supply for damage, contamination, and improper installation. For more information, see [“Power supply removal” on page 204](#).
- 8 Clean the printhead lens. For more information, see [“Cleaning the printhead mirror” on page 260](#).

Note: This step applies only to printer models that are installed with a galvo printhead. To determine whether the printhead is galvo, check the serial number of the printer. The sixth digit character must be in the 0–9 or B–N range. For example: 4514 20HH 007CR.

- 9 Check the printhead for damage, contamination, and improper installation. For more information, see [“Printhead removal” on page 238](#).

Fine lines such as Chinese characters are not printed correctly



Note: Before doing this print quality check, see [“Initial print quality check” on page 36](#).

- 1 Check if the printer is using a genuine and supported Lexmark toner cartridge.

Note: If the printer is using a third-party toner cartridge, then refer the users to their supplier.


- 2 From the home screen, do the following:

- a Touch **Settings > Print > Quality > Pixel Boost > Fonts**.
- b Increase the toner darkness to 7. Touch **Settings > Print > Quality > Toner Darkness**.

Note: Adjusting the Toner Darkness setting to 7 results in a slightly lighter print.

Note: You may leave the Toner Darkness value at 8 in order to maintain the darkness that you are used to, but this will result in decreased toner yield.

Text or images cut off

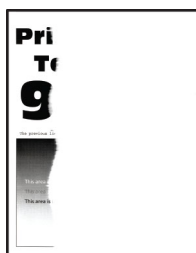


Note: Before doing this print quality check, see [“Initial print quality check” on page 36](#).

- 1 Check if the printer is using a genuine and supported Lexmark toner cartridge.


Note: If the printer is using a third-party toner cartridge, then refer the users to their supplier.

- 2 Check for any packing material left on the imaging unit, including the red plastic separator (A).

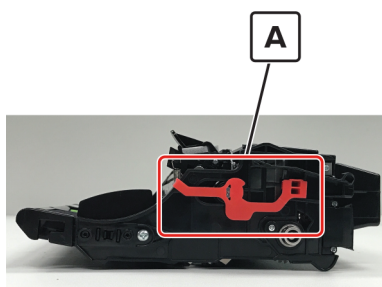


Note: You may need a pair of pliers to remove a piece of broken plastic inside the imaging unit.

- 3 Check the imaging unit contact block (B) for damage and improper installation.

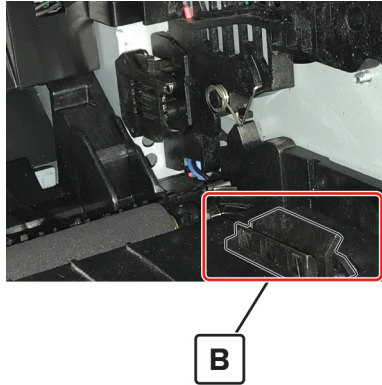


- 4 Check the imaging unit for damage, contamination, and improper installation.

Compressed images appear on prints

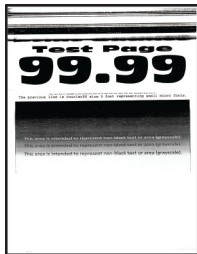

Note: Before doing this print quality check, see [“Initial print quality check” on page 36](#).

- 1 Make sure that the white photoconductor coupler (A) is firmly connected to the imaging unit and does not freely rotate.

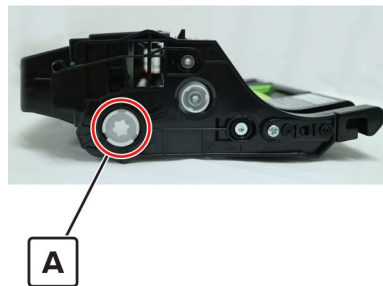

- 2 Check the imaging unit for damage, contamination, and improper installation.
- 3 Check the main drive gearbox for damage, contamination, and improper installation. For more information, see [“Main drive gearbox removal” on page 166](#).

Incorrect margins on prints



Note: Before doing this print quality check, see [“Initial print quality check” on page 36](#).

- 1 Make sure that the guides in the tray are in the correct position for the paper loaded.
- 2 From the home screen, do the following:
 - Set the paper size in the Paper menu to match the paper loaded.
 - Change the paper loaded to match the paper size specified in the tray settings.
 - Depending on the operating system, specify the paper size from Printing Preferences or Print dialog.
 - Adjust the margins as necessary. Enter the Diagnostics menu, and then touch **Registration**.

Toner rubs off



Note: Before doing this print quality check, see [“Initial print quality check” on page 36](#).

- 1 Check if the printer is using a genuine and supported Lexmark toner cartridge.

Note: If the printer is using a third-party toner cartridge, then refer the users to their supplier.
- 2 From the home screen, set the paper type, texture, and weight in the Paper menu to match the paper loaded.
- 3 Check the fuser for damage, contamination, and improper installation. For more information, see [“Fuser removal” on page 232](#).
- 4 Make sure that the connections between the controller board and the power supply are properly connected.
- 5 Check the power supply for damage, contamination, and improper installation. For more information, see [“Power supply removal” on page 204](#).

Mottled prints or dots



Note: Before doing this print quality check, see [“Initial print quality check” on page 36](#).

- 1 Check if the printer is using a genuine and supported Lexmark toner cartridge.

Note: If the printer is using a third-party toner cartridge, then refer the users to their supplier.

- 2 Check the status of the imaging unit.

a From the home screen, touch **Status/supplies**.

b Touch **View Supplies**.

- 3 Check the imaging unit for damage, contamination, and improper installation.

- 4 Using an approved toner vacuum cleaner, completely clean the printer, toner cartridge, and imaging unit of toner contamination.


- 5 Check the transfer roller for damage, contamination, and improper installation. For more information, see [“Transfer roller removal” on page 195](#).

Paper jams

Avoiding jams


Load paper properly

- Make sure that the paper lies flat in the tray.

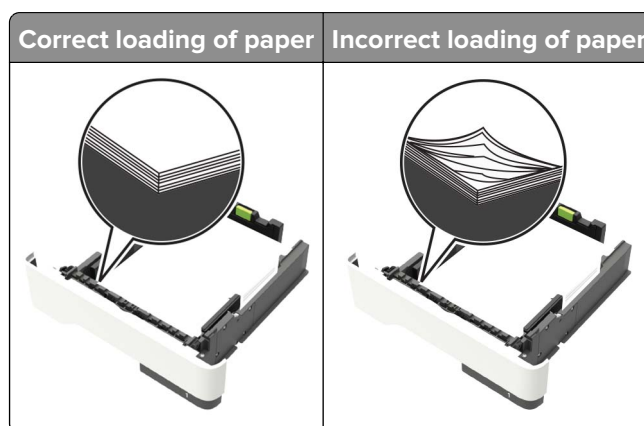

- Do not load or remove a tray while the printer is printing.
- Do not load too much paper. Make sure that the stack height is below the maximum paper fill indicator.


- Do not slide paper into the tray. Load paper as shown in the illustration.

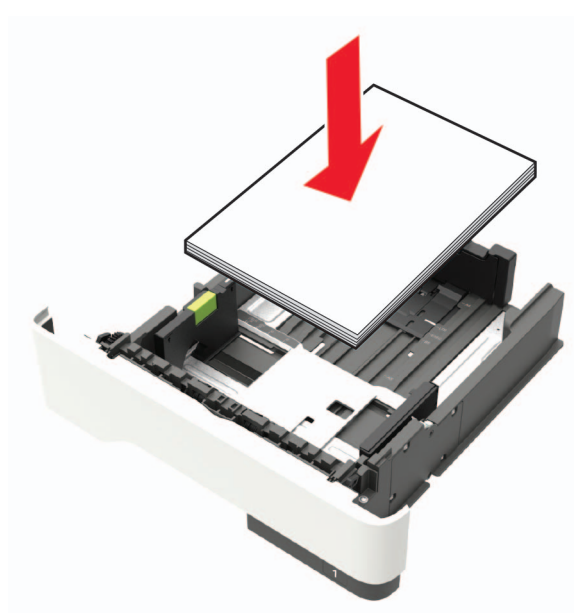

- Make sure that the paper guides are positioned correctly and are not pressing tightly against the paper or envelopes.
- Push the tray firmly into the printer after loading paper.

Use recommended paper

- Use only recommended paper or specialty media.
- Do not load paper that is wrinkled, creased, damp, bent, or curled.
- Flex, fan, and align the paper edges before loading.

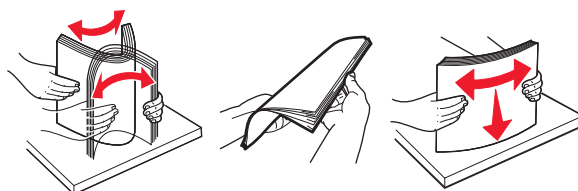


- Do not use paper that has been cut or trimmed by hand.
- Do not mix paper sizes, weights, or types in the same tray.
- Make sure that the paper size and type are set correctly on the computer or printer control panel.
- Store paper according to manufacturer recommendations.

Identifying jam locations

Notes:

- When Jam Assist is set to On, the printer flushes blank pages or pages with partial prints after a jammed page has been cleared. Check your printed output for blank pages.
- When Jam Recovery is set to On or Auto, the printer reprints jammed pages.

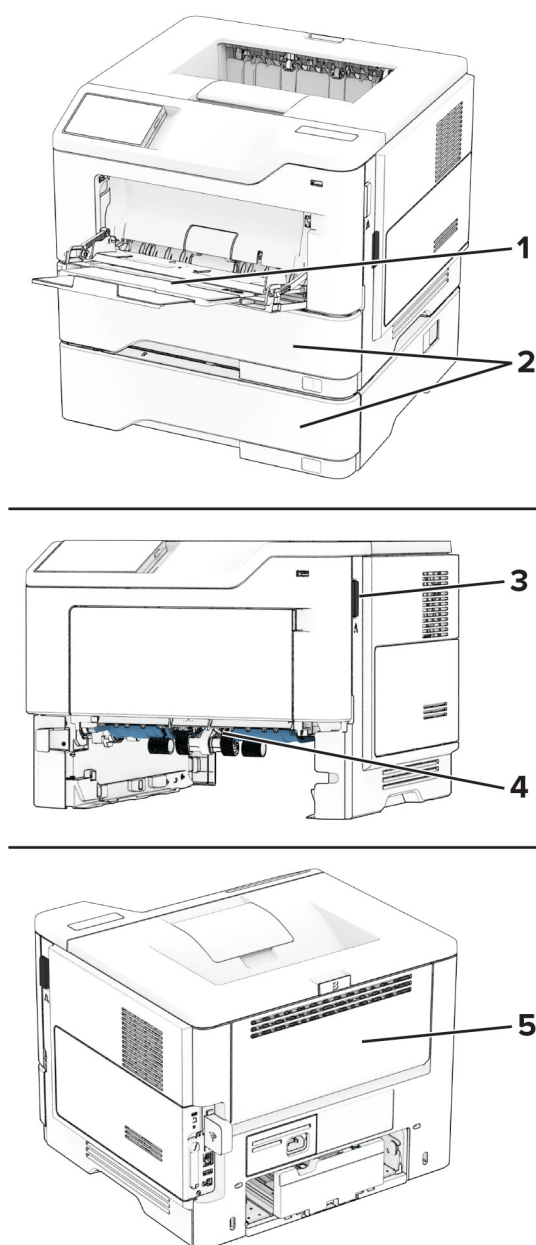

	Jam locations
1	Multipurpose feeder
2	Trays
3	Door A
4	Duplex unit
5	Door B

200 paper jams

200 paper jam messages

Error code	Description	Action
200.03	Paper fed from the MPF was detected later than expected or was never detected at the sensor (input).	See “Sensor (input): Paper failed to arrive from the MPF jam service check” on page 59.
200.04	Paper fed from the MPF cleared the sensor (input) earlier than expected.	See “Sensor (input): Paper cleared too early from the MPF jam service check” on page 60.
200.05	Paper fed from the MPF never cleared the sensor (input).	See “Sensor (input): Paper failed to clear from the MPF jam service check” on page 61.
200.06	Paper fed from the MPF was detected later than expected or was never detected at the sensor (input).	See “Sensor (input): Paper failed to arrive from the MPF jam service check” on page 59.
200.12	Paper fed from tray 1 was detected earlier than expected at the sensor (input).	See “Sensor (input): Paper arrived too early or failed to arrive jam service check” on page 62.
200.13	Paper fed from tray 1 was detected later than expected or was never detected at the sensor (input).	
200.14	Paper fed from tray 1 cleared the sensor (input) earlier than expected.	See “Sensor (input): Paper cleared too early jam service check” on page 63.
200.15	Paper fed from tray 1 never cleared the sensor (input).	See “Sensor (input): Paper failed to clear jam service check” on page 63.
200.16	Paper fed from tray 1 was picked but it never reached the sensor (input).	See “Tray 1 pick error service check” on page 59.
200.22	Paper fed from tray 2 was detected earlier than expected at the sensor (input).	See “Sensor (input): Paper arrived too early from optional tray jam service check” on page 64.
200.23	Paper fed from tray 2 was detected later than expected or was never detected at the sensor (input).	See “Sensor (input): Paper failed to arrive from optional tray jam service check” on page 65.
200.24	Paper fed from tray 2 cleared the sensor (input) earlier than expected.	See “Sensor (input): Paper cleared too early from optional tray jam service check” on page 65.
200.25	Paper fed from tray 2 never cleared the sensor (input).	See “Sensor (input): Paper failed to clear from optional tray jam service check” on page 66.
200.32	Paper fed from tray 3 was detected earlier than expected at the sensor (input).	See “Sensor (input): Paper arrived too early from optional tray jam service check” on page 64.
200.33	Paper fed from tray 3 was detected later than expected or was never detected at the sensor (input).	See “Sensor (input): Paper failed to arrive from optional tray jam service check” on page 65.
200.34	Paper fed from tray 3 cleared the sensor (input) earlier than expected.	See “Sensor (input): Paper cleared too early from optional tray jam service check” on page 65.
200.35	Paper fed from tray 3 never cleared the sensor (input).	See “Sensor (input): Paper failed to clear from optional tray jam service check” on page 66.

Error code	Description	Action
200.42	Paper fed from tray 4 was detected earlier than expected at the sensor (input).	See “Sensor (input): Paper arrived too early from optional tray jam service check” on page 64.
200.43	Paper fed from tray 4 was never detected at the sensor (input).	See “Sensor (input): Paper failed to arrive from optional tray jam service check” on page 65.
200.44	Paper fed from tray 4 cleared the sensor (input) earlier than expected.	See “Sensor (input): Paper cleared too early from optional tray jam service check” on page 65.
200.45	Paper fed from tray 4 never cleared the sensor (input).	See “Sensor (input): Paper failed to clear from optional tray jam service check” on page 66.
200.91	Paper remains detected at the sensor (input) after the printer is turned on.	See “Sensor (input): Static jam service check” on page 66.
200.95	Unexpected page showed up when flushing the paper path.	

Tray 1 pick error service check

- 1 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55.](#)
- 2 Make sure that the paper is free of debris and obstructions.
- 3 Perform a POR.
- 4 Check if the paper jam error occurs when using other trays.
- 5 If the paper jam error occurs only when using tray 1, then do the following:
 - a Check the pick roller for wear, damage, contamination, and improper installation.
 - b Check the separator pad or separator roller for wear, damage, contamination, and improper installation.

Note: The MS531 and MS63x printer models have different pick and tray mechanisms. Choose the appropriate part for each printer model. For more information, see [“Pick roller removal” on page 214](#) or [“Pick roller \(MS531\) removal” on page 215.](#)

- 6 Check the pick arm and pick roller for damage and improper installation.

Note: The MS531 and MS63x printer models have different pick and tray mechanisms. Choose the appropriate part for each printer model. For more information, see [“Pick roller removal” on page 214](#) or [“Pick roller \(MS531\) removal” on page 215.](#)

- 7 The following instructions are not applicable to the MS531 printer model:
 - a Check the tray insert for damage and improper installation.
 - b Check the tray guides for damage and improper operation.
 - c Check the lift plate for damage and improper operation.
 - d Check the tray gears for wear and damage.

Sensor (input): Paper failed to arrive from the MPF jam service check

- 1 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55.](#)
- 2 Make sure that the paper is free of debris and obstructions.

- 3 Perform a POR.
- 4 Check if the paper jam error occurs when using other trays.
- 5 If the paper jam error occurs only when using the MPF, then do the following:
 - a Check the MPF pick roller and separator roller for wear, damage, and contamination.
 - b Make sure that the MPF solenoid is functional. Do the following:
 - 1 Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Motors tests**.
 - 2 Select **MPF pick**.
 - c Check the MPF gearbox for wear, damage, and improper mesh. For more information, see [“MPF gearbox removal” on page 167](#).
- 6 If the paper jam error occurs regardless of the source tray, then do the following:
 - a Identify the location of the leading edge of the paper.
 - b If the leading edge of the paper did not reach the fuser, then check the imaging unit and transfer roller for damage and improper installation. For more information, see [“Transfer roller removal” on page 195](#).
 - c If the leading edge of the paper reached the fuser, then check the fuser for wear, damage, and improper installation. For more information, see [“Fuser removal” on page 232](#).

Sensor (input): Paper cleared too early from the MPF jam service check

- 1 Set the paper size in the Paper menu to match the paper loaded. From the home screen, touch **Settings > Paper > Tray Configuration**.
- 2 Adjust the paper guides in the tray to correct position for the paper loaded.
Make sure that the guides fit snugly against the paper.
- 3 Replace with correct paper type or size.
- 4 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55](#).
- 5 Make sure that the paper is free of debris and obstructions.
- 6 Perform a POR.
- 7 Check if the paper jam error occurs when using other trays.
- 8 If the paper jam error occurs regardless of the source tray, then do the following:
 - a Check the input sensor actuator for damage, and improper installation.
 - b Make sure that the sensor (duplex and input) is functional. Do the following:
 - 1 Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Sensor tests**.
 - 2 Find the sensor (duplex and input).
 - c Make sure that the connections between the sensor (duplex and input) and the controller board are properly connected.
 - d Check the sensor (duplex and input) for damage and improper installation. For more information, see [“Sensors \(duplex and input\) removal” on page 208](#).

Sensor (input): Paper failed to clear from the MPF jam service check

- 1 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55](#).
- 2 Make sure that the paper is free of debris and obstructions.
- 3 Perform a POR.
- 4 Check if the paper jam error occurs when using other trays.
- 5 If the paper jam error occurs only when using the MPF, then do the following:
 - a Check the MPF pick roller and separator roller for wear, damage, and contamination.
 - b Make sure that the MPF solenoid is functional. Do the following:
 - 1 Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Motors tests**.
 - 2 Select **MPF pick**.
 - c Check the MPF gearbox for wear, damage, and improper mesh. For more information, see [“MPF gearbox removal” on page 167](#).
- 6 If the paper jam error occurs regardless of the source tray, then do the following:
 - a Identify the location of the leading edge of the paper.
 - b If the leading edge of the paper did not reach the fuser, then check the imaging unit and transfer roller for damage and improper installation. For more information, see [“Transfer roller removal” on page 195](#).
 - c If the leading edge of the paper reached the fuser, then check the fuser for wear, damage, and improper installation. For more information, see [“Fuser removal” on page 232](#).

Sensor (input): Paper failed to arrive from the MPF jam service check

- 1 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55](#).
- 2 Make sure that the paper is free of debris and obstructions.
- 3 Perform a POR.
- 4 Check if the paper jam error occurs when using other trays.
- 5 If the paper jam error occurs only when using the MPF, then do the following:
 - a Check the MPF pick roller and separator roller for wear, damage, and contamination.
 - b Make sure that the MPF solenoid is functional. Do the following:
 - 1 Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Motors tests**.
 - 2 Select **MPF pick**.
 - c Check the MPF gearbox for wear, damage, and improper mesh. For more information, see [“MPF gearbox removal” on page 167](#).
- 6 If the paper jam error occurs regardless of the source tray, then do the following:
 - a Identify the location of the leading edge of the paper.
 - b If the leading edge of the paper did not reach the fuser, then check the imaging unit and transfer roller for damage and improper installation. For more information, see [“Transfer roller removal” on page 195](#).
 - c If the leading edge of the paper reached the fuser, then check the fuser for wear, damage, and improper installation. For more information, see [“Fuser removal” on page 232](#).

Sensor (input): Paper arrived too early or failed to arrive jam service check

- 1 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55](#).
- 2 Make sure that the paper is free of debris and obstructions.
- 3 Perform a POR.
- 4 Check if the paper jam error occurs when using other trays.
- 5 Check the pick arm and pick roller for damage and improper installation.

Note: The MS531 and MS63x printer models have different pick and tray mechanisms. Choose the appropriate part for each printer model. For more information, see [“Pick roller removal” on page 214](#) or [“Pick roller \(MS531\) removal” on page 215](#).

- 6 The following instruction applies to only the MS63x, MX53x, and MX63x printer models.
 - a Make sure that the pick/lift motor gearbox is functional. Do the following:
 - 1 Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Motors tests**.
 - 2 Select **Motor (tray 1 pick/lift)**.
 - b Make sure that the connections between the motor (pick/lift) and the controller board are properly connected.
 - c Check the pick/lift motor gearbox for damage, contamination, and improper installation. For more information, see [“Pick/lift motor gearbox removal” on page 222](#).
- 7 The following instruction applies to only the MS531 printer model:
 - a Make sure that the pick roller clutch is functional. Do the following:
 - 1 Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Motors tests**.
 - 2 Select **Clutch**.
 - b Make sure that the connections between the pick roller clutch and the controller board are properly connected.
 - c Check the pick roller clutch for damage, contamination, and improper installation. For more information, see [“Pick roller clutch removal” on page 174](#).

Most likely parts to replace

Customer replaceable unit

- Pick rollers
 - For the part number, go to [“Paper pick for MS531” on page 283](#) or [“Paper pick for M3350, MS631, MS632, and MS639” on page 285](#).

Field replaceable unit

- Pick roller assembly

For MS531 models:

- For the part number, go to [“Paper pick for MS531” on page 283](#).
- For the removal procedure, go to [“Pick roller \(MS531\) removal” on page 215](#).

For M3350, MS631, MS632, and MS639 models:

- For the part number, go to [“Paper pick for M3350, MS631, MS632, and MS639” on page 285](#).
- For the removal procedure, go to [“Pick roller removal” on page 214](#).

Sensor (input): Paper cleared too early jam service check

- 1 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55](#).
- 2 Make sure that the paper is free of debris and obstructions.
- 3 Perform a POR.
- 4 Check if the paper jam error occurs when using other trays.
- 5 Check the pick roller for wear, damage, contamination, and improper installation.

Note: The MS531 and MX63x printer models have different pick and tray mechanisms. Choose the appropriate part for each printer model. For more information, see [“Pick roller removal” on page 214](#) or [“Pick roller \(MS531\) removal” on page 215](#).

- 6 Make sure that the reverse solenoid is functional. Do the following:
 - a Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Motors tests**.
 - b Select **Redrive solenoid**.
- 7 Check the reverse solenoid and its actuator for wear, damage, and improper operation. For more information, see [“Reverse solenoid removal” on page 171](#).
- 8 Check the redrive for wear, damage, and improper mesh. For more information, see [“Redrive removal” on page 233](#).

Sensor (input): Paper failed to clear jam service check

- 1 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55](#).
- 2 Make sure that the paper is free of debris and obstructions.
- 3 Perform a POR.
- 4 Check if the paper jam error occurs when using other trays.
- 5 If the paper jam error occurs only when using tray 1, then do the following:
 - a Check the pick roller for wear, damage, contamination, and improper installation.
 - b Check the separator pad or separator roller for wear, damage, contamination, and improper installation.

Note: The MS531 and MS63x printer models have different pick and tray mechanisms. Choose the appropriate part for each printer model. For more information, see [“Pick roller removal” on page 214](#) or [“Pick roller \(MS531\) removal” on page 215](#).

- 6 If the paper jam error occurs regardless of the source tray, then do the following:
 - a Check the input sensor actuator for damage, and improper installation.
 - b Make sure that the sensor (duplex and input) is functional. Do the following:
 - 1 Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Sensor tests**.
 - 2 Find the sensor (duplex and input).
 - c Make sure that the connections between the sensor (duplex and input) and the controller board are properly connected.
 - d Check the sensor (duplex and input) for damage and improper installation. For more information, see [“Sensors \(duplex and input\) removal” on page 208](#).

- 7 If the paper jam error occurs regardless of the source tray, then do the following:
 - a Identify the location of the leading edge of the paper.
 - b If the leading edge of the paper did not reach the fuser, then check the imaging unit and transfer roller for damage and improper installation. For more information, see [“Transfer roller removal” on page 195](#).
 - c If the leading edge of the paper reached the fuser, then check the fuser for wear, damage, and improper installation. For more information, see [“Fuser removal” on page 232](#).

Sensor (input): Paper arrived too early from optional tray jam service check

- 1 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55](#).
- 2 Make sure that the paper is free of debris and obstructions.
- 3 Perform a POR.
- 4 Check if the paper jam error occurs when using other trays.
- 5 If the paper jam error occurs regardless of the source tray, then do the following:
 - a Check the input sensor actuator for damage, and improper installation.
 - b Make sure that the sensor (duplex and input) is functional. Do the following:
 - 1 Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Sensor tests**.
 - 2 Find the sensor (duplex and input).
 - c Make sure that the connections between the sensor (duplex and input) and the controller board are properly connected.
 - d Check the sensor (duplex and input) for damage and improper installation. For more information, see [“Sensors \(duplex and input\) removal” on page 208](#).
- 6 Check the pick arm and pick roller for damage and improper installation.

Note: The MS531 and MS63x printer models have different pick and tray mechanisms. Choose the appropriate part for each printer model. For more information, see [“Pick roller removal” on page 214](#) or [“Pick roller \(MS531\) removal” on page 215](#).
- 7 The following instruction applies to only the MS63x, MX53x, and MX63x printer models.
 - a Make sure that the pick/lift motor gearbox is functional. Do the following:
 - 1 Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Motors tests**.
 - 2 Select **Motor (tray 1 pick/lift)**.
 - b Make sure that the connections between the motor (pick/lift) and the controller board are properly connected.
 - c Check the pick/lift motor gearbox for damage, contamination, and improper installation. For more information, see [“Pick/lift motor gearbox removal” on page 222](#).
- 8 The following instruction applies to only the MS531 printer model:
 - a Make sure that the pick roller clutch is functional. Do the following:
 - 1 Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Motors tests**.
 - 2 Select **Clutch**.
 - b Make sure that the connections between the pick roller clutch and the controller board are properly connected.

- c Check the pick roller clutch for damage, contamination, and improper installation. For more information, see [“Pick roller clutch removal” on page 174.](#)

Sensor (input): Paper failed to arrive from optional tray jam service check

- 1 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55.](#)
- 2 Make sure that the paper is free of debris and obstructions.
- 3 Perform a POR.
- 4 Check if the paper jam error occurs when using other trays.
- 5 If the paper jam error occurs when using optional trays (tray 2 to tray 4), then do the following:
 - a Check the pick roller for wear, damage, contamination, and improper installation.
 - b Check the separator pad or separator roller for wear, damage, contamination, and improper installation.
 - c Check the paper path above the tray for debris and foreign object.
- 6 If the paper jam error occurs regardless of the source tray, then do the following:
 - a Check the input sensor actuator for damage, and improper installation.
 - b Make sure that the sensor (duplex and input) is functional. Do the following:
 - 1 Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments** > **Sensor tests**.
 - 2 Find the sensor (duplex and input).
 - c Make sure that the connections between the sensor (duplex and input) and the controller board are properly connected.
 - d Check the sensor (duplex and input) for damage and improper installation. For more information, see [“Sensors \(duplex and input\) removal” on page 208.](#)
- 7 If the paper jam error occurs regardless of the source tray, then do the following:
 - a Identify the location of the leading edge of the paper.
 - b If the leading edge of the paper did not reach the fuser, then check the imaging unit and transfer roller for damage and improper installation. For more information, see [“Transfer roller removal” on page 195.](#)
 - c If the leading edge of the paper reached the fuser, then check the fuser for wear, damage, and improper installation. For more information, see [“Fuser removal” on page 232.](#)

Sensor (input): Paper cleared too early from optional tray jam service check

- 1 Set the paper size in the Paper menu to match the paper loaded. From the home screen, touch **Settings** > **Paper** > **Tray Configuration**.
- 2 Adjust the paper guides in the tray to correct position for the paper loaded.
Make sure that the guides fit snugly against the paper.
- 3 Replace with correct paper type or size.
- 4 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55.](#)
- 5 Make sure that the paper is free of debris and obstructions.
- 6 Perform a POR.

- 7 Check if the paper jam error occurs when using other trays.
- 8 If the paper jam error occurs when using optional trays (tray 2 to tray 4), then do the following:
 - a Check the pick roller for wear, damage, contamination, and improper installation.
 - b Check the separator pad or separator roller for wear, damage, contamination, and improper installation.
 - c Check the paper path above the tray for debris and foreign object.

Sensor (input): Paper failed to clear from optional tray jam service check

- 1 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55](#).
- 2 Make sure that the paper is free of debris and obstructions.
- 3 Perform a POR.
- 4 Check if the paper jam error occurs when using other trays.
- 5 If the paper jam error occurs when using optional trays (tray 2 to tray 4), then do the following:
 - a Check the pick roller for wear, damage, contamination, and improper installation.
 - b Check the separator pad or separator roller for wear, damage, contamination, and improper installation.
 - c Check the paper path above the tray for debris and foreign object.
- 6 If the paper jam error occurs regardless of the source tray, then do the following:
 - a Check the input sensor actuator for damage, and improper installation.
 - b Make sure that the sensor (duplex and input) is functional. Do the following:
 - 1 Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments** > **Sensor tests**.
 - 2 Find the sensor (duplex and input).
 - c Make sure that the connections between the sensor (duplex and input) and the controller board are properly connected.
 - d Check the sensor (duplex and input) for damage and improper installation. For more information, see [“Sensors \(duplex and input\) removal” on page 208](#).
- 7 If the paper jam error occurs regardless of the source tray, then do the following:
 - a Identify the location of the leading edge of the paper.
 - b If the leading edge of the paper did not reach the fuser, then check the imaging unit and transfer roller for damage and improper installation. For more information, see [“Transfer roller removal” on page 195](#).
 - c If the leading edge of the paper reached the fuser, then check the fuser for wear, damage, and improper installation. For more information, see [“Fuser removal” on page 232](#).

Sensor (input): Static jam service check

- 1 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55](#).
- 2 Make sure that the paper is free of debris and obstructions.
- 3 Perform a POR.
- 4 Check if the paper jam error occurs when using other trays.

- 5 If the paper jam error occurs regardless of the source tray, then do the following:
- a Check the input sensor actuator for damage, and improper installation.
 - b Make sure that the sensor (duplex and input) is functional. Do the following:
 - 1 Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Sensor tests**.
 - 2 Find the sensor (duplex and input).
 - c Make sure that the connections between the sensor (duplex and input) and the controller board are properly connected.
 - d Check the sensor (duplex and input) for damage and improper installation. For more information, see [“Sensors \(duplex and input\) removal” on page 208](#).

202 paper jams

202 paper jam messages

Error code	Description	Action
202.03	Paper fed from the MPF never reached the sensor (fuser exit).	See “Sensor (fuser exit): Paper failed to arrive from MPF jam service check” on page 68 .
202.05	Paper fed from the MPF never cleared the sensor (fuser exit).	See “Sensor (fuser exit): Paper failed to clear jam service check” on page 69 .
202.13	Paper fed from tray 1 never reached the sensor (fuser exit).	See “Sensor (fuser exit): Paper failed to arrive jam service check” on page 68 .
202.15	Paper fed from tray 1 never cleared the sensor (fuser exit).	See “Sensor (fuser exit): Paper failed to clear jam service check” on page 69 .
202.23	Paper fed from tray 2 never reached the sensor (fuser exit).	See “Sensor (fuser exit): Paper failed to arrive from optional tray jam service check” on page 69 .
202.25	Paper fed from tray 2 never cleared the sensor (fuser exit).	See “Sensor (fuser exit): Paper failed to clear from optional tray jam service check” on page 70 .
202.33	Paper fed from tray 3 never reached the sensor (fuser exit).	See “Sensor (fuser exit): Paper failed to arrive from optional tray jam service check” on page 69 .
202.35	Paper fed from tray 3 never cleared the sensor (fuser exit).	See “Sensor (fuser exit): Paper failed to clear from optional tray jam service check” on page 70 .
202.43	Paper fed from tray 4 never reached the sensor (fuser exit).	See “Sensor (fuser exit): Paper failed to arrive from optional tray jam service check” on page 69 .
202.45	Paper fed from tray 4 never cleared the sensor (fuser exit).	See “Sensor (fuser exit): Paper failed to clear from optional tray jam service check” on page 70 .

Error code	Description	Action
202.91	Paper remains detected at the sensor (fuser exit) after the printer is turned on.	See “Sensor (fuser exit): Static jam service check” on page 71.
202.93	The sensor (fuser exit) detected a jam during or after a flush action.	
202.95	Paper fed from an unknown tray never cleared the sensor (fuser exit).	

Sensor (fuser exit): Paper failed to arrive from MPF jam service check

- 1 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55.](#)
- 2 Make sure that the paper is free of debris and obstructions.
- 3 Perform a POR.
- 4 Check if the paper jam error occurs when using other trays.
- 5 If the paper jam error occurs only when using the MPF, then do the following:
 - a Check the MPF pick roller and separator roller for wear, damage, and contamination.
 - b Make sure that the MPF solenoid is functional. Do the following:
 - 1 Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Motors tests.**
 - 2 Select **MPF pick.**
 - c Check the MPF gearbox for wear, damage, and improper mesh. For more information, see [“MPF gearbox removal” on page 167.](#)
- 6 If the paper jam error occurs regardless of the source tray, then do the following:
 - a Identify the location of the leading edge of the paper.
 - b If the leading edge of the paper did not reach the fuser, then check the imaging unit and transfer roller for damage and improper installation. For more information, see [“Transfer roller removal” on page 195.](#)
 - c If the leading edge of the paper reached the fuser, then check the fuser for wear, damage, and improper installation. For more information, see [“Fuser removal” on page 232.](#)

Sensor (fuser exit): Paper failed to arrive jam service check

- 1 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55.](#)
- 2 Make sure that the paper is free of debris and obstructions.
- 3 Perform a POR.
- 4 Check if the paper jam error occurs when using other trays.
- 5 If the paper jam error occurs only when using tray 1, then do the following:
 - a Check the pick roller for wear, damage, contamination, and improper installation.
 - b Check the separator pad or separator roller for wear, damage, contamination, and improper installation.

Note: The MS531 and MS63x printer models have different pick and tray mechanisms. Choose the appropriate part for each printer model. For more information, see [“Pick roller removal” on page 214](#) or [“Pick roller \(MS531\) removal” on page 215](#).

- 6 If the paper jam error occurs regardless of the source tray, then do the following:
 - a Identify the location of the leading edge of the paper.
 - b If the leading edge of the paper did not reach the fuser, then check the imaging unit and transfer roller for damage and improper installation. For more information, see [“Transfer roller removal” on page 195](#).
 - c If the leading edge of the paper reached the fuser, then check the fuser for wear, damage, and improper installation. For more information, see [“Fuser removal” on page 232](#).

Sensor (fuser exit): Paper failed to clear jam service check

- 1 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55](#).
- 2 Make sure that the paper is free of debris and obstructions.
- 3 Perform a POR.
- 4 Check if the paper jam error occurs when using other trays.
- 5 If the paper jam error occurs regardless of the source tray, then do the following:
 - a Make sure that the fuser is functional. Do the following:
 - 1 Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Sensor tests**.
 - 2 Find the sensor (fuser).
 - b Make sure that the connections between the fuser and the controller board are properly connected.
 - c Check the fuser for wear, damage, and improper installation. For more information, see [“Fuser removal” on page 232](#).
 - d Check the fuser actuator for wear, damage, and improper installation. For more information, see [“Fuser actuator removal” on page 170](#).
 - e Check the redrive for wear, damage, and improper mesh. For more information, see [“Redrive removal” on page 233](#).

Sensor (fuser exit): Paper failed to arrive from optional tray jam service check

- 1 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55](#).
- 2 Make sure that the paper is free of debris and obstructions.
- 3 Perform a POR.
- 4 Check if the paper jam error occurs when using other trays.
- 5 If the paper jam error occurs when using optional trays (tray 2 to tray 4), then do the following:
 - a Check the pick roller for wear, damage, contamination, and improper installation.
 - b Check the separator pad or separator roller for wear, damage, contamination, and improper installation.
 - c Check the paper path above the tray for debris and foreign object.

- 6 If the paper jam error occurs regardless of the source tray, then do the following:
 - a Check the input sensor actuator for damage, and improper installation.
 - b Make sure that the sensor (duplex and input) is functional. Do the following:
 - 1 Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Sensor tests**.
 - 2 Find the sensor (duplex and input).
 - c Make sure that the connections between the sensor (duplex and input) and the controller board are properly connected.
 - d Check the sensor (duplex and input) for damage and improper installation. For more information, see [“Sensors \(duplex and input\) removal” on page 208](#).
- 7 If the paper jam error occurs regardless of the source tray, then do the following:
 - a Identify the location of the leading edge of the paper.
 - b If the leading edge of the paper did not reach the fuser, then check the imaging unit and transfer roller for damage and improper installation. For more information, see [“Transfer roller removal” on page 195](#).
 - c If the leading edge of the paper reached the fuser, then check the fuser for wear, damage, and improper installation. For more information, see [“Fuser removal” on page 232](#).

Sensor (fuser exit): Paper failed to clear from optional tray jam service check

- 1 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55](#).
- 2 Make sure that the paper is free of debris and obstructions.
- 3 Perform a POR.
- 4 Check if the paper jam error occurs when using other trays.
- 5 If the paper jam error occurs when using optional trays (tray 2 to tray 4), then do the following:
 - a Check the pick roller for wear, damage, contamination, and improper installation.
 - b Check the separator pad or separator roller for wear, damage, contamination, and improper installation.
 - c Check the paper path above the tray for debris and foreign object.
- 6 If the paper jam error occurs regardless of the source tray, then do the following:
 - a Check the input sensor actuator for damage, and improper installation.
 - b Make sure that the sensor (duplex and input) is functional. Do the following:
 - 1 Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Sensor tests**.
 - 2 Find the sensor (duplex and input).
 - c Make sure that the connections between the sensor (duplex and input) and the controller board are properly connected.
 - d Check the sensor (duplex and input) for damage and improper installation. For more information, see [“Sensors \(duplex and input\) removal” on page 208](#).
- 7 If the paper jam error occurs regardless of the source tray, then do the following:
 - a Identify the location of the leading edge of the paper.
 - b If the leading edge of the paper did not reach the fuser, then check the imaging unit and transfer roller for damage and improper installation. For more information, see [“Transfer roller removal” on page 195](#).

- c If the leading edge of the paper reached the fuser, then check the fuser for wear, damage, and improper installation. For more information, see [“Fuser removal” on page 232](#).

Sensor (fuser exit): Static jam service check

- 1 Turn off the printer.
- 2 Check the optional tray for improper installation.
- 3 Remove the optional tray, and then check the connectors on the printer and optional tray for damage and improper connection.
- 4 Reinstall the optional tray, and then turn on the printer.
- 5 Remove the tray insert.
- 6 Check the tray insert and its lift plate gears for damage and improper operation.
- 7 Make sure that the following motors are functional:
 - Motor (pick (tray (x)))
 - Motor (pass-through (tray(x)))
 Do the following:
 - a Enter the Diagnostics menu, and then touch **Additional input tray diagnostics** > **Motors tests**.
 - b Select **Pick (tray [x])** and **Pass-through (tray [x])**.
- 8 Make sure that the connections between the motors and the controller board are properly connected.
- 9 Check the motors for damage, and improper installation.

230 paper jams

230 paper jam messages

Error code	Description	Action
230.03	Paper fed from the MPF never reached the sensor (duplex).	See “Sensor (redrive): Paper (duplex job) failed to arrive jam service check” on page 72 .
230.05	Paper fed from the MPF never cleared the sensor (duplex).	See “Sensor (redrive): Paper (duplex job) failed to clear jam service check” on page 72 .
230.13	Paper fed from tray 1 never reached the sensor (duplex).	See “Sensor (redrive): Paper (duplex job) failed to arrive jam service check” on page 72 .
230.15	Paper fed from tray 1 never cleared the sensor (duplex).	See “Sensor (redrive): Paper (duplex job) failed to clear jam service check” on page 72 .
230.23	Paper fed from tray 2 never reached the sensor (duplex).	See “Sensor (redrive): Paper (duplex job) failed to arrive jam service check” on page 72 .
230.25	Paper fed from tray 2 never cleared the sensor (duplex).	See “Sensor (redrive): Paper (duplex job) failed to clear jam service check” on page 72 .
230.33	Paper fed from tray 3 never reached the sensor (duplex).	See “Sensor (redrive): Paper (duplex job) failed to arrive jam service check” on page 72 .

Error code	Description	Action
230.35	Paper fed from tray 3 never cleared the sensor (duplex).	See “Sensor (redrive): Paper (duplex job) failed to clear jam service check” on page 72.
230.43	Paper fed from tray 4 never reached the sensor (duplex).	See “Sensor (redrive): Paper (duplex job) failed to arrive jam service check” on page 72.
230.45	Paper fed from tray 4 never cleared the sensor (duplex).	See “Sensor (redrive): Paper (duplex job) failed to clear jam service check” on page 72.
230.52	Paper fed from tray 5 reached sensor (duplex) earlier than expected.	N/A
230.91	Paper remains detected at the sensor (duplex) after the printer is turned on.	N/A

Sensor (redrive): Paper (duplex job) failed to arrive jam service check

- 1 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55.](#)
- 2 Make sure that the paper is free of debris and obstructions.
- 3 Perform a POR.
- 4 Check if the paper jam error occurs when using other trays.
- 5 Make sure that the reverse solenoid is functional. Do the following:
 - a Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Motors tests.**
 - b Select **Redrive solenoid.**
- 6 Check the reverse solenoid and its actuator for wear, damage, and improper operation. For more information, see [“Reverse solenoid removal” on page 171.](#)
- 7 Check the redrive for wear, damage, and improper mesh. For more information, see [“Redrive removal” on page 233.](#)
- 8 Check the printed page count.
 - a Enter the Diagnostics menu, and then touch **Printer Setup.**
 - b If the page count is near 400K, then replace the duplex. For more information, see [“Duplex removal” on page 206.](#)
- 9 Check the duplex paper path for jammed paper, debris, and obstructions.
- 10 Check the duplex rollers for debris, wear, damage, contamination, and improper installation. For more information, see [“Duplex gear kit removal” on page 176.](#)
- 11 Check the duplex linkage and belt for damage and improper installation. For more information, see [“Duplex removal” on page 206.](#)

Sensor (redrive): Paper (duplex job) failed to clear jam service check

- 1 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55.](#)
- 2 Make sure that the paper is free of debris and obstructions.
- 3 Perform a POR.

- 4 Check if the paper jam error occurs when using other trays.
- 5 If the paper jam error occurs regardless of the source tray, then do the following:
 - a Check the input sensor actuator for damage, and improper installation.
 - b Make sure that the sensor (duplex and input) is functional. Do the following:
 - 1 Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Sensor tests**.
 - 2 Find the sensor (duplex and input).
 - c Make sure that the connections between the sensor (duplex and input) and the controller board are properly connected.
 - d Check the sensor (duplex and input) for damage and improper installation. For more information, see [“Sensors \(duplex and input\) removal” on page 208](#).
- 6 Check the printed page count.
 - a Enter the Diagnostics menu, and then touch **Printer Setup**.
 - b If the page count is near 400K, then replace the duplex. For more information, see [“Duplex removal” on page 206](#).
- 7 Check the duplex paper path for jammed paper, debris, and obstructions.
- 8 Check the duplex rollers for debris, wear, damage, contamination, and improper installation.
- 9 Check the duplex linkage and belt for damage and improper installation. For more information, see [“Duplex removal” on page 206](#).
- 10 Check the isolation roller for wear, damage, and contamination.

232 paper jams

232 paper jam messages

Error code	Description	Action
232.03	Paper fed from the MPF was detected later than expected or was never detected the sensor (input) during a duplex print job.	See “Sensor (input): Paper (duplex job) failed to arrive jam service check” on page 74 .
232.05	Paper fed from the MPF never cleared the sensor (input) during a duplex print job.	See “Sensor (input): Paper (duplex job) failed to clear jam service check” on page 74 .
232.13	Paper fed from tray 1 was detected later than expected or was never detected the sensor (input) during a duplex print job.	See “Sensor (input): Paper (duplex job) failed to arrive jam service check” on page 74 .
232.15	Paper fed from tray 1 never cleared the sensor (input) during a duplex print job.	See “Sensor (input): Paper (duplex job) failed to clear jam service check” on page 74 .
232.23	Paper fed from tray 2 was detected later than expected or was never detected the sensor (input) during a duplex print job.	See “Sensor (input): Paper (duplex job) failed to arrive jam service check” on page 74 .
232.25	Paper fed from tray 2 never cleared the sensor (input) during a duplex print job.	See “Sensor (input): Paper (duplex job) failed to clear jam service check” on page 74 .
232.33	Paper fed from tray 3 never reached the sensor (input) during a duplex print job.	See “Sensor (input): Paper (duplex job) failed to arrive jam service check” on page 74 .

Error code	Description	Action
232.35	Paper fed from tray 3 never cleared the sensor (input) during a duplex print job.	See “Sensor (input): Paper (duplex job) failed to clear jam service check” on page 74.
232.43	Paper fed from tray 4 never reached the sensor (pass-through) during a duplex print job.	See “Sensor (input): Paper (duplex job) failed to arrive jam service check” on page 74.
232.45	Paper fed from tray 4 never cleared the sensor (pass-through) during a duplex print job.	See “Sensor (input): Paper (duplex job) failed to clear jam service check” on page 74.
232.53	Paper fed from tray 5 never reached the sensor (pass-through) during a duplex print job.	See “Sensor (input): Paper (duplex job) failed to arrive jam service check” on page 74.
232.55	Paper fed from tray 5 never cleared the sensor (pass-through) during a duplex print job.	See “Sensor (input): Paper (duplex job) failed to clear jam service check” on page 74.
232.93	Paper fed from an unknown tray was detected later than expected or was never detected at the sensor (input) during a duplex print job.	See “Sensor (input): Paper (duplex job) failed to arrive jam service check” on page 74.
232.95	Paper fed from an unknown tray never cleared the sensor (input) during a duplex print job.	See “Sensor (input): Paper (duplex job) failed to clear jam service check” on page 74.

Sensor (input): Paper (duplex job) failed to arrive jam service check

- 1 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55.](#)
- 2 Make sure that the paper is free of debris and obstructions.
- 3 Perform a POR.
- 4 Check if the paper jam error occurs when using other trays.
- 5 Check the printed page count.
 - a Enter the Diagnostics menu, and then touch **Printer Setup**.
 - b If the page count is near 400K, then replace the duplex. For more information, see [“Duplex removal” on page 206.](#)
- 6 Check the duplex paper path for jammed paper, debris, and obstructions.
- 7 Check the duplex rollers for debris, wear, damage, contamination, and improper installation.
- 8 Check the duplex linkage and belt for damage and improper installation. For more information, see [“Duplex removal” on page 206.](#)

Sensor (input): Paper (duplex job) failed to clear jam service check

- 1 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55.](#)
- 2 Make sure that the paper is free of debris and obstructions.
- 3 Perform a POR.
- 4 Check if the paper jam error occurs when using other trays.

- 5 Check the printed page count.
 - a Enter the Diagnostics menu, and then touch **Printer Setup**.
 - b If the page count is near 400K, then replace the duplex. For more information, see [“Duplex removal” on page 206](#).
- 6 Check the duplex paper path for jammed paper, debris, and obstructions.
- 7 Check the duplex rollers for debris, wear, damage, contamination, and improper installation.
- 8 Check the duplex linkage and belt for damage and improper installation. For more information, see [“Duplex removal” on page 206](#).
- 9 Check the isolation roller for wear, damage, and contamination.

241 paper jams

241 paper jam messages

Error code	Description	Action
241.82	The motor (tray 1 pick) has stalled or did not reach the expected speed.	See “Motor (tray 1 pick) jam service check” on page 75 .
241.83	The motor (tray 1 pick) has stalled or did not reach the expected speed.	
241.84	The motor (tray 1 pick) has stalled or did not reach the expected speed.	

Motor (tray 1 pick) jam service check

- 1 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55](#).
- 2 Make sure that the paper is free of debris and obstructions.
- 3 Perform a POR.
- 4 Check if the paper jam error occurs when using other trays.
- 5 The following instruction applies to only the MS63x, MX53x, and MX63x printer models.
 - a Make sure that the pick/lift motor gearbox is functional. Do the following:
 - 1 Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Motors tests**.
 - 2 Select **Motor (tray 1 pick/lift)**.
 - b Make sure that the connections between the motor (pick/lift) and the controller board are properly connected.
 - c Check the pick/lift motor gearbox for damage, contamination, and improper installation. For more information, see [“Pick/lift motor gearbox removal” on page 222](#).
- 6 The following instruction applies to only the MS531 printer model:
 - a Make sure that the pick roller clutch is functional. Do the following:
 - 1 Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Motors tests**.
 - 2 Select **Clutch**.

- b** Make sure that the connections between the pick roller clutch and the controller board are properly connected.
 - c** Check the pick roller clutch for damage, contamination, and improper installation. For more information, see [“Pick roller clutch removal” on page 174](#).
- 7** Check the pick arm and pick roller for damage and improper installation.

Note: The MS531 and MS63x printer models have different pick and tray mechanisms. Choose the appropriate part for each printer model. For more information, see [“Pick roller removal” on page 214](#) or [“Pick roller \(MS531\) removal” on page 215](#).

242–244 paper jams

242 paper jam messages

Error code	Description	Action
242.21	Paper fed from tray 2 remains detected at the sensor (tray 2 pass-through) or at the sensor (tray 2 trailing edge) after the printer is turned on.	See “Optional tray sensors jam service check” on page 80 .
242.26	Paper fed from tray 2 was picked but it never reached the sensor (input).	
242.31	Paper fed from tray 3 remains detected at the sensor (tray 2 pass-through) or sensor (tray 2 trailing edge) after the printer is turned on.	
242.33	Paper fed from tray 3 never reached the sensor (tray 2 pass-through).	
242.35	Paper fed from tray 3 cleared the sensor (tray 2 pass-through) later than expected.	
242.37	Paper fed from tray 3 never cleared the sensor (tray 2 pass-through).	
242.41	Paper fed from tray 4 remains detected at the sensor (tray 2 pass-through) or sensor (tray 2 trailing edge) after the printer is turned on.	
242.43	Paper fed from tray 4 never reached the sensor (tray 2 pass-through).	
242.45	Paper fed from tray 4 cleared the sensor (tray 2 pass-through) or sensor (tray 2 trailing edge) later than expected.	
242.47	Paper fed from tray 4 never cleared the sensor (tray 2 pass-through).	

Error code	Description	Action
242.70	Motor (tray 2 transport) does not turn on.	See “Optional tray motors jam service check” on page 80.
242.71	Motor (tray 2 transport) does not turn off.	
242.72	Motor (550-sheet tray 2 transport) speed did not ramp up to expected level.	
242.73	Motor (550-sheet tray 2 transport) stalled.	
242.74	Motor (tray 2 transport) ran too slow.	
242.75	Motor (tray 2 transport) ran too fast.	
242.76	Motor (550-sheet tray 2 transport) ran too long.	
242.80	Motor (tray 2) did not turn on	
242.81	Motor (tray 2) did not turn off.	
242.82	Motor (tray 2) speed did not ramp up to expected level.	
242.83	Motor (tray 2) has stalled.	
242.84	Motor (tray 2) ran too slow.	
242.85	Motor (tray 2) ran too fast.	
242.86	Motor (tray 2) ran too long.	
242.91	Paper remains detected at the sensor (tray 2 pass-through) after the printer is turned on.	See “Optional tray sensors jam service check” on page 80.
242.93	Paper fed from an unknown tray never arrived at the sensor (tray 2 pass-through).	
242.95	Paper fed from an unknown tray cleared the sensor (tray 2 pass-through) or sensor (tray 2 trailing edge) later than expected.	
242.96	Paper fed from an unknown tray was picked but it never arrived at the sensor (input).	
242.97	Paper fed from an unknown tray never cleared the sensor (tray 2 pass-through).	

243 paper jam messages

Error code	Description	Action
243.36	Paper fed from tray 3 was picked but it never arrived at the sensor (tray 2 pass-through).	See “Optional tray sensors jam service check” on page 80.
243.41	Paper fed from tray 4 remains detected at the sensor (tray 3 pass-through) or sensor (tray 3 trailing edge) after the printer is turned on.	
243.43	Paper fed from tray 4 never reached the sensor (tray 3 pass-through).	
243.45	Paper fed from tray 4 cleared the sensor (tray 3 pass-through) or sensor (tray 3 trailing edge) later than expected.	
243.47	Paper fed from tray 4 never cleared the sensor (tray 3 pass-through).	
243.70	Motor (550-sheet tray 3 transport) does not turn on.	See “Optional tray motors jam service check” on page 80.
243.71	Motor (550-sheet tray 3 transport) does not turn off.	
243.72	Motor (550-sheet tray 3 transport) speed did not ramp up to expected level.	
243.73	Motor (550-sheet tray 3 transport) has stalled.	
243.74	Motor (tray 3 transport) ran too slow.	
243.75	Motor (tray 3 transport) ran too fast.	
243.76	Motor (550-sheet tray 3 transport) ran too long.	
243.80	Motor (550-sheet tray 3 pick/lift) does not turn on.	
243.81	Motor (550-sheet tray 3 pick/lift) does not turn on.	
243.82	Motor (550-sheet tray 3 pick/lift) does not turn off.	
243.83	Motor (550-sheet tray 3 pick/lift) has stalled.	
243.84	Motor (550-sheet tray 3 pick/lift) ran too slow.	
242.85	Motor (550-sheet tray 3 pick/lift) ran too fast.	
242.86	Motor (550-sheet tray 3 pick/lift) ran too long.	

Error code	Description	Action
243.91	Paper remains detected at the sensor (tray 3 pass-through) after the printer is turned on.	See “Optional tray sensors jam service check” on page 80.
243.92	Paper fed from an unknown tray was detected earlier than expected at the sensor (tray 3 pass-through) or sensor (tray 3 trailing edge).	
243.93	Paper fed from an unknown tray never reached the sensor (tray 2 pass-through).	
243.95	Paper fed from an unknown tray cleared the sensor (tray 3 pass-through) or sensor (tray 3 trailing edge) later than expected.	
243.96	Paper fed from an unknown tray was picked but it never reached the sensor (tray 3 pass-through).	
243.97	Paper fed from an unknown tray never cleared the sensor (tray 3 pass-through).	

244 paper jam messages

Error code	Description	Action
244.46	Paper fed from tray 4 was picked but it never reached the sensor (tray 4 trailing edge).	See “Optional tray sensors jam service check” on page 80.
244.70	Motor (550-sheet tray 4 transport) does not turn on.	
244.71	Motor (550-sheet tray 4 transport) does not turn off.	See “Optional tray motors jam service check” on page 80.
244.72	Motor (550-sheet tray 4 transport) speed did not ramp up to expected level.	
244.73	Motor (550-sheet tray 4 transport) has stalled.	
244.74	Motor (550-sheet tray 4 transport) ran too slow.	
244.75	Motor (550-sheet tray 4 transport) ran too fast.	
244.76	Motor (550-sheet tray 4 transport) ran too long.	
244.80	Motor (550-sheet tray 4 pick/lift) does not turn on.	
244.81	Motor (550-sheet tray 4 pick/lift) does not turn off.	
244.82	Motor (550-sheet tray 4 pick/lift) speed did not ramp up to expected level.	
244.83	Motor (550-sheet tray 4 pick/lift) has stalled.	
244.84	Motor (550-sheet tray 4 pick/lift) ran too slow.	
244.85	Motor (550-sheet tray 4 pick/lift) ran too fast.	
244.86	Motor (550-sheet tray 4 pick/lift) ran too long.	

Error code	Description	Action
244.91	Paper remains detected at the sensor (tray 4 pass-through) or sensor (tray 4 trailing edge) after the printer is turned on.	See “Optional tray sensors jam service check” on page 80.

Optional tray sensors jam service check

- 1 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55.](#)
- 2 Perform a POR.
- 3 Identify the tray that causes the paper jam error. Place the affected tray insert at the bottom. For example, If tray 2 is causing the paper jam error in a 4-tray configuration, then swap tray 2 and tray 4.
- 4 Make sure the following sensors are functional:
 - Sensor (pass-through)
 - Sensor (index)
 - Sensor (trailing edge)
 - Sensor (media present)
 Do the following:
 - a Enter the Diagnostics menu, and then touch **Additional input tray diagnostics > Sensor tests.**
 - b Find the listed sensors.
- 5 Make sure that the connections between the listed sensors and the controller board are properly connected.
- 6 Check the sensors and its actuators for damage and improper installation.
- 7 Check the tray insert for damage and improper installation.
- 8 Check the tray guides for damage and improper operation.
- 9 Check the lift plate for damage and improper operation.

Optional tray motors jam service check

- 1 Make sure that paper is supported and loaded properly. See [“Avoiding jams” on page 55.](#)
- 2 Perform a POR.
- 3 Identify the tray that causes the paper jam error. Place the affected tray insert at the bottom. For example, If tray 2 is causing the paper jam error in a 4-tray configuration, then swap tray 2 and tray 4.
- 4 Remove the tray insert.
- 5 Check the tray insert and its lift plate gears for damage and improper operation.
- 6 Make sure that the following motors are functional:
 - Motor (pick (tray (x))
 - Motor (pass-through (tray(x))

Do the following:

- a Enter the Diagnostics menu, and then touch **Additional input tray diagnostics** > **Motors tests**.
 - b Select **Pick (tray [x])** and **Pass-through (tray [x])**.
- 7 Make sure that the connections between the motors and the controller board are properly connected.
 - 8 Check the motors for damage, and improper installation.

User attendance messages

0y user attendance errors

2-9 user attendance messages

Error code	Description	Action
2.01	A supply is needed for a job.	N/A
8.00	A door was detected as open.	See “Undetected door service check” on page 81.
8.01	Door A was detected as open.	
8.02	Door B was detected as open.	
8.03	ADF top cover was detected as open.	See “ADF top cover open service check” on page 82.
9.00	A problem caused the printer to restart automatically.	See “Auto reboot error service check” on page 82.

Undetected door service check

- 1 Check the doors for the following:
 - Obstructions
 - Damage
 - Improper operation
- 2 Close the doors properly.

Note: Make sure that there is no gap between the door and the printer.
- 3 Make sure that the door links and hinges are properly interlocked and the sensor actuator is not damaged.
- 4 Press the power button to turn off the printer, and then disconnect the power cord from the electrical outlet.
- 5 Wait for 30 seconds to make sure that all electrical charges have dissipated from the printer.
- 6 Connect the power cord to the electrical outlet, and then press the power button to turn on the printer.
- 7 Wait for the printer to completely boot up and initialize all its components before sending the print job again.
- 8 Check the sensor (door interlock) actuator for damage and improper installation.

- 9 Make sure that the sensor (door interlock) is functional, do the following:
 - a Enter the Diagnostics menu, and then touch **Printer diagnostics and adjustments > Sensor tests**.
 - b Find the sensor (door interlock).
- 10 Make sure that the connections between the controller board and sensor (door interlock) are properly connected.

ADF top cover open service check

- 1 Check the ADF doors for the following:
 - Obstructions
 - Damage
 - Improper operation
- 2 Close the ADF doors properly.

Note: Make sure that there is no gap between the door and the ADF.
- 3 Make sure that the ADF door links and hinges are properly interlocked and the sensor actuator is not damaged.
- 4 Press the power button to turn off the printer, and then disconnect the power cord from the electrical outlet.
- 5 Wait for 30 seconds to make sure that all electrical charges have dissipated from the printer.
- 6 Connect the power cord to the electrical outlet, and then press the power button to turn on the printer.
- 7 Wait for the printer to completely boot up and initialize all its components before sending the print job again.
- 8 Check the sensor (ADF top door interlock) actuator for damage and improper installation.
- 9 Make sure that the sensor (ADF top door interlock) is functional, do the following:
 - a Enter the Diagnostics menu, and then touch **Scanner diagnostics > Sensor tests**.
 - b Find the sensor (ADF top door interlock).
- 10 Make sure that the connections between the controller board and sensor (ADF top door interlock) are properly connected.

Auto reboot error service check

- 1 Clear the intervention message, and then send the print job again.
- 2 Press the power button to turn off the printer, and then disconnect the power cord from the electrical outlet.
- 3 Wait for 30 seconds to make sure that all electrical charges have dissipated from the printer.
- 4 Connect the power cord to the electrical outlet, and then press the power button to turn on the printer.
- 5 Wait for the printer to completely boot up and initialize all its components before sending the print job again.

1y user attendance errors

11–12 user attendance messages

Error code	Description	Action
11.11	A wrong paper type or size was detected on tray 1.	See “Mismatched paper size and paper printer setting error service check” on page 84.
11.12	A wrong paper type, size, or orientation was detected on tray 1.	
11.21	A wrong paper type or size was detected on tray 2.	
11.22	A wrong paper type, size, or orientation was detected on tray 2.	
11.31	A wrong paper type or size was detected on tray 3.	
11.32	A wrong paper type, size, or orientation was detected on tray 3.	
11.41	A wrong paper type or size was detected on tray 4.	
11.42	A wrong paper type, size, or orientation was detected on tray 4.	
11.71	An unsupported orientation was detected for an envelope loaded.	
11.81	A wrong paper type or size was detected on the MPF.	
11.82	A wrong paper type, size, or orientation was detected on the MPF.	
11.91	A wrong paper type or size was detected on the MPF.	
11.92	A wrong paper type, size, or orientation was detected on the MPF.	

Error code	Description	Action
12.11	A wrong setting for paper type or size was detected on tray 1.	See “Mismatched paper size and paper printer setting error service check” on page 84.
12.12	A wrong setting for paper type, size, or orientation was detected on tray 1.	
12.21	A wrong setting for paper type or size was detected on tray 2.	
12.22	A wrong setting for paper type, size, or orientation was detected on tray 2.	
12.31	A wrong setting for paper type or size was detected on tray 3.	
12.32	A wrong setting for paper type, size, or orientation was detected on tray 3.	
12.41	A wrong setting for paper type or size was detected on tray 4.	
12.42	A wrong setting for paper type, size, or orientation was detected on tray 4.	
12.81	A wrong setting for paper type or size was detected on the MPF.	
12.82	A wrong setting for paper type, size, or orientation was detected on the MPF.	
12.91	A wrong setting for paper type or size was detected on the MPF.	
12.92	A wrong setting for paper type, size, or orientation was detected on the MPF.	

Mismatched paper size and paper printer setting error service check

- 1 Set the paper size in the Paper menu to match the paper loaded. From the home screen, touch **Settings** > **Paper** > **Tray Configuration**.
- 2 Adjust the paper guides in the tray to correct position for the paper loaded.
Make sure that the guides fit snugly against the paper.
- 3 Replace with correct paper type or size.

2y user attendance errors

29 user attendance messages

Error code	Description	Action
29.00	Packing material present on supplies.	See “Removing the packing material from the supplies” on page 85.
29.08		

Removing the packing material from the supplies

- 1 Make sure to remove all packing materials such as tape, foam, or plastic.
- 2 Check all areas of the printer for packing materials.
- 3 Remove all supplies, and then check for any packing material left.

3y user attendance errors

31 user attendance error messages

Error code	Description	Action
31.00	An MICR print cartridge is required.	See “MICR supplies service check” on page 88.
31.40	The toner cartridge is missing or unresponsive.	See “Toner cartridge (K) error service check” on page 89.
31.40A	A black toner cartridge smart chip or sensor communication error was detected.	
31.40AN		
31.40B	A black toner cartridge smart chip or sensor communication error was detected.	
31.40C	A black toner cartridge smart chip or sensor communication error was detected.	
31.40CN		
31.40D	A black toner cartridge smart chip or sensor communication error was detected.	
31.40E	A black toner cartridge smart chip or sensor communication error was detected.	
31.40F	A black toner cartridge smart chip or sensor communication error was detected.	
31.40FN		
31.40G	A black toner cartridge smart chip or sensor communication error was detected.	
31.40GN		
31.40H	A black toner cartridge smart chip or sensor communication error was detected.	
31.40K	A black toner cartridge smart chip or sensor communication error was detected.	
31.40R	A black toner cartridge smart chip or sensor communication error was detected.	
31.40Y	A black toner cartridge smart chip or sensor communication error was detected.	

Error code	Description	Action
31.60	The imaging unit is missing or unresponsive.	See “Imaging unit (K) error service check” on page 89.
31.60A	A black imaging unit smart chip or sensor communication error was detected.	
31.60AN		
31.60B	A black imaging unit smart chip or sensor communication error was detected.	
31.60C	A black imaging unit smart chip or sensor communication error was detected.	
31.60CN		
31.60D	A black imaging unit smart chip or sensor communication error was detected.	
31.60E	A black imaging unit smart chip or sensor communication error was detected.	
31.60F	A black imaging unit smart chip or sensor communication error was detected.	
31.60G	A black imaging unit smart chip or sensor communication error was detected.	
31.60H	A black imaging unit smart chip or sensor communication error was detected.	
31.60Q	A black imaging unit smart chip or sensor communication error was detected.	
31.60R	A black imaging unit smart chip or sensor communication error was detected.	
31.60T	A black imaging unit smart chip or sensor communication error was detected.	
31.60U	A black imaging unit smart chip or sensor communication error was detected.	
31.60V	A black imaging unit smart chip or sensor communication error was detected.	
31.60Z	A black imaging unit smart chip or sensor communication error was detected.	

32 user attendance error messages

Error code	Description	Action
32.40	The toner cartridge is unsupported.	See “Toner cartridge (K) error service check” on page 89.
32.40A	The black toner cartridge is unsupported—Unsupported memory map version in the smart chip.	
32.40B	The black toner cartridge is unsupported—Failed capacity class/model compatibility check.	
32.40C	The black toner cartridge is unsupported—Failed OEM check.	
32.40D	The black toner cartridge is unsupported—Failed SWE marriage check.	
32.40E	The black toner cartridge is unsupported—The supply is on the revoked list.	
32.40F	The black toner cartridge is unsupported—The print cartridge is MICR, and the release does not support MICR.	
32.40G	The black toner cartridge is unsupported.	
32.40H	The black toner cartridge is unsupported.	
32.40I	The black toner cartridge is unsupported.	
32.40J	The black toner cartridge is unsupported.	
32.40K	The black toner cartridge is unsupported.	
32.40L	The black toner cartridge is unsupported.	
32.40M	The black toner cartridge is unsupported.	
32.40Z	The black toner cartridge is unsupported.	
32.60	The imaging unit is unsupported.	See “Imaging unit (K) error service check” on page 89.
32.60A	The black imaging unit is unsupported.	
32.60AN		
32.60B	The black imaging unit is unsupported.	
32.60C	The black imaging unit is unsupported.	
32.60D	The black imaging unit is unsupported.	
32.60E	The black imaging unit is unsupported.	
32.60F	The black imaging unit is unsupported.	

33 user attendance error messages

Note: For more information, see [“Non-Sharp supply” on page 33.](#)

Error code	Description	Action
33.40	An inauthentic black toner cartridge was detected.	See “Toner cartridge (K) error service check” on page 89.
33.40A	An inauthentic black toner cartridge was detected.	
33.40AN		
33.40BN	An inauthentic black toner cartridge was detected.	
33.60	An inauthentic black imaging unit was detected.	See “Imaging unit (K) error service check” on page 89.
33.60A	An inauthentic black imaging unit was detected.	
33.60AN		
33.60B	An inauthentic black imaging unit was detected.	
33.60BN		
33.60C	An inauthentic black imaging unit was detected.	

37–39 user attendance messages

Error code	Description	Action
37.01	The memory is insufficient to collate the job.	See “Insufficient memory service check” on page 89.
37.03		
38.00	The scan job is too long.	
38.01	The memory is full.	
39.01	The page is too complex to print. The printer memory is not enough for the details on the page.	
39.02		

MICR supplies service check

- 1 Make sure that the toner cartridge and imaging unit are not damaged, not leaking, genuine, and support MICR supplies.
- 2 Make sure that the imaging unit or imaging kit and the toner cartridge are free of toner buildup. Using an approved toner vacuum cleaner, completely clean the supplies.
- 3 Press the power button to turn off the printer, and then disconnect the power cord from the electrical outlet.
- 4 Wait for 30 seconds to make sure that all electrical charges have dissipated from the printer.
- 5 Connect the power cord to the electrical outlet, and then press the power button to turn on the printer.
- 6 Wait for the printer to completely boot up and initialize all its components before sending the print job again.

Toner cartridge (K) error service check

- 1 Check if the printer is using a genuine and supported Lexmark toner cartridge.
Note: If the printer is using a third-party toner cartridge, then refer the users to the supplier.
- 2 Make sure that the cartridge region matches the printer region.
- 3 Make sure that the toner cartridge is not damage and not leaking.
- 4 Make sure that the toner cartridge is free of toner buildup. Using an approved toner vacuum cleaner, completely clean the supplies.
- 5 When installing a genuine after market supply for the first time and a supplies message error occurs, install the latest firmware version available for your printer.
- 6 Clean the toner cartridge contacts for any toner contamination.
- 7 Check the toner cartridge contacts for damage.
- 8 Make sure that the connections between the controller board and the toner cartridge are properly connected.

Imaging unit (K) error service check

- 1 Check if the printer is using a genuine and supported Lexmark imaging unit or imaging kit.
Note: If the printer is using a third-party imaging unit or imaging kit, then refer the users to the supplier.
- 2 Check the imaging unit or imaging kit for damage.
- 3 Make sure that the imaging unit or imaging kit is free of toner buildup. Using an approved toner vacuum cleaner, completely clean the supplies.
- 4 When installing a genuine after market supply for the first time and a supplies message error occurs, install the latest firmware version available for your printer.
- 5 Clean the toner cartridge contacts for any toner contamination.
- 6 Check the toner cartridge contacts for damage.
- 7 Make sure that the connections between the controller board and the toner cartridge are properly connected.

Insufficient memory service check

- 1 Erase the printer memory. Do the following:
 - a Turn off the printer, and then disconnect the power cord from the electrical outlet.
 - b Wait for a few minutes, connect the power cord to the electrical outlet, and then turn on the printer.
- 2 Reduce the complexity of the print job. Do any of the following:
 - Lower the print quality.
 - Reduce the number of pages being printed at once.
- 3 If the file format is causing the issue, then convert the file to a different format that is more efficient in printing such as PDF.

- 4 Use a different driver, such as PostScript driver, to handle the print job more efficiently.
Some printer drivers may be more efficient at handling large or complex print jobs than others.
- 5 Upgrade the printer memory by adding additional RAM or installing an ISD. For more information, see [“Available internal options” on page 305](#).

Non-Lexmark supply

The printer has detected a non-Lexmark supply or part installed in the printer.

The Lexmark printer is designed to function best with genuine Lexmark supplies and parts. Use of third-party supplies or parts may affect the performance, reliability, or life of the printer and its imaging components.

All life indicators are designed to function with Lexmark supplies and parts and may deliver unpredictable results if third-party supplies or parts are used. Imaging component usage beyond the intended life may damage the Lexmark printer or associated components.

Warning—Potential Damage: Use of third-party supplies or parts can affect warranty coverage. Damage caused by the use of third-party supplies or parts may not be covered by the warranty.

To accept any and all of these risks and to proceed with the use of non-genuine supplies or parts in your printer, instruct the customer to touch and hold the error message on the display using two fingers for 15 seconds. When a confirmation dialog box appears, touch **Continue**.

If the customer does not want to accept these risks, then remove the third-party supply or part from the printer and install a genuine Lexmark supply or part.

If the printer does not print after clearing the error message, then instruct the customer to reset the supply usage counter.

Resetting the supply usage counter

- 1 From the home screen, touch **Settings > Device > Maintenance > Configuration Menu > Supply Usage And Counters > Reset Maintenance Counter**.
- 2 Touch **Start**.

Note: If resetting the supply usage counter fails, then the customer should return the supply item to the place of purchase.

Using genuine Lexmark parts and supplies

Your Lexmark printer is designed to function best with genuine Lexmark parts and supplies. Use of third-party supplies or parts may affect the performance, reliability, or life of the printer and its imaging components. It can also affect warranty coverage. Damage caused by the use of third-party parts and supplies is not covered by the warranty. All life indicators are designed to function with Lexmark parts and supplies, and may deliver unpredictable results if third-party parts and supplies are used. Imaging component usage beyond the intended life may damage your Lexmark printer or its associated components.

Warning—Potential Damage: Supplies and parts without Return Program agreement terms may be reset and remanufactured. However, the manufacturer's warranty does not cover any damage caused by non-genuine supplies or parts. Resetting counters on the supply or part without proper remanufacturing can cause damage to your printer. After resetting the supply or part counter, your printer may display an error indicating the presence of the reset item.

4y user attendance errors

41-42 user attendance messages

Error code	Description	Action
41.60	The imaging unit and toner cartridge are mismatched or incompatible.	N/A
41.60A	The imaging unit and toner cartridge are mismatched or incompatible—Toner type mismatch.	N/A
41.60AN		
42.01	The toner cartridge and printer regions are mismatched.	See “Mismatched supplies service check” on page 94.
42.02	The toner cartridge and printer regions are mismatched.	
42.03	The toner cartridge and printer regions are mismatched.	
42.04	The toner cartridge and printer regions are mismatched.	
42.05	The toner cartridge and printer regions are mismatched.	
42.09	The toner cartridge and printer regions are mismatched.	
42.10	The toner cartridge and printer regions are mismatched.	See “Mismatched supplies service check” on page 94.
42.10K		
42.12	The toner cartridge and printer regions are mismatched.	
42.12K		
42.13	The toner cartridge and printer regions are mismatched.	
42.13K		
42.14	The toner cartridge and printer regions are mismatched.	
41.14K		
42.15	The toner cartridge and printer regions are mismatched.	
42.19	The toner cartridge and printer regions are mismatched.	

Error code	Description	Action
42.20	The toner cartridge and printer regions are mismatched.	See “Mismatched supplies service check” on page 94.
42.21	The toner cartridge and printer regions are mismatched.	
42.21K		
42.23	The toner cartridge and printer regions are mismatched.	
42.23K		
42.24	The toner cartridge and printer regions are mismatched.	
42.25	The toner cartridge and printer regions are mismatched.	
42.25K		
42.26K	The toner cartridge and printer regions are mismatched.	
42.29	The toner cartridge and printer regions are mismatched.	
42.30	The toner cartridge and printer regions are mismatched.	See “Mismatched supplies service check” on page 94.
42.31	The toner cartridge and printer regions are mismatched.	
42.32	The toner cartridge and printer regions are mismatched.	
42.34	The toner cartridge and printer regions are mismatched.	
42.34K		
42.35	The toner cartridge and printer regions are mismatched.	
42.39	The toner cartridge and printer regions are mismatched.	

Error code	Description	Action
42.40	The toner cartridge and printer regions are mismatched.	See “Mismatched supplies service check” on page 94.
42.40K		
42.41	The toner cartridge and printer regions are mismatched.	
42.41K		
42.42	The toner cartridge and printer regions are mismatched.	
42.43	The toner cartridge and printer regions are mismatched.	
42.43K		
42.45	The toner cartridge and printer regions are mismatched.	
42.46	The toner cartridge and printer regions are mismatched.	
42.46K		
42.49	The toner cartridge and printer regions are mismatched.	
42.50	The toner cartridge and printer regions are mismatched.	See “Mismatched supplies service check” on page 94.
42.51	The toner cartridge and printer regions are mismatched.	
42.52	The toner cartridge and printer regions are mismatched.	
42.52K		
42.53	The toner cartridge and printer regions are mismatched.	
42.54	The toner cartridge and printer regions are mismatched.	See “Mismatched supplies service check” on page 94.
42.59	The toner cartridge and printer regions are mismatched.	
42.60	The toner cartridge and printer regions are mismatched.	
42.60K		
42.61	The toner cartridge and printer regions are mismatched.	
42.61K		
42.62	The toner cartridge and printer regions are mismatched.	
42.62K		
42.63	The toner cartridge and printer regions are mismatched.	
42.63K		
42.64	The toner cartridge and printer regions are mismatched.	
42.64K		

Error code	Description	Action
42.90	The toner cartridge and printer regions are mismatched.	See “Mismatched supplies service check” on page 94.
42.91	The toner cartridge and printer regions are mismatched.	
42.92	The toner cartridge and printer regions are mismatched.	
42.93	The toner cartridge and printer regions are mismatched.	
42.94	The toner cartridge and printer regions are mismatched.	
42.94K		
42.95	The toner cartridge and printer regions are mismatched.	

43-44 user attendance error messages

Error code	Description	Action
43.40	A toner cartridge sensor error was detected.	See “Toner meter card error service check” on page 94.
43.40Z	A black TMC error was detected.	
44.40	The toner cartridge and printer are mismatched or incompatible.	See “Replace cartridge, printer region mismatch” on page 33.
44.40B		
44.60	The imaging unit and printer are mismatched or incompatible.	

Mismatched supplies service check

- 1 Check if the printer is using a genuine and supported Lexmark toner cartridge.
Note: If the printer is using a third-party toner cartridge, then refer the users to the supplier.
- 2 Make sure that the cartridge region matches the printer region.
- 3 Make sure that the toner cartridge is not damage and not leaking.
- 4 Make sure that the toner cartridge is free of toner buildup. Using an approved toner vacuum cleaner, completely clean the supplies.
- 5 When installing a genuine after market supply for the first time and a supplies message error occurs, install the latest firmware version available for your printer.

Toner meter card error service check

- 1 Make sure that the toner meter card is properly installed.
- 2 Check the sensor (toner meter) for contamination.
- 3 Make sure that the printer is free of toner buildup. Using an approved toner vacuum cleaner, completely clean the supplies.

4 Make sure that the sensor (toner meter) is functional. Do the following:

- a** Enter the Diagnostics menu, and then touch **Printer diagnostics and adjustments > Sensor tests**.
- b** Find the sensor (toner meter).

5y user attendance errors

55–59 user attendance error messages

Error code	Description	Action
55.1	An unsupported USB device was detected.	Remove the flash drive to continue.
55.2	An unsupported USB hub was detected.	Remove the USB hub to continue.
58.00	Too many optional trays and finishers were detected.	1 Turn off the printer, and then unplug the power cord from the electrical outlet. 2 Remove one or more trays. 3 Connect the power cord to the electrical outlet, and then turn on the printer.
58.00A	Too many optional trays were detected.	
58.00B	Too many optional trays were detected.	
58.00C	Too many optional trays were detected.	
58.00D	Too many optional trays were detected.	
59.00	An unsupported option was detected. The option software version is not supported by the engine.	1 Turn off the printer, and then unplug the power cord from the electrical outlet. 2 Remove the indicated tray. 3 Connect the power cord to the electrical outlet, and then turn on the printer.
59.00C	An unsupported option was detected.	
59.00D	An unsupported option was detected.	

6y user attendance errors

61–66 user attendance error messages

Error code	Description	Action
61.00	The hard disk is defective.	Replace the defective storage drive.
62.00	The hard disk is full.	Try one or more of the following: • Touch Continue to clear the message. • Delete fonts, macros, and other data stored in the printer hard disk. • Install a printer hard disk.
63.00	The hard disk is not formatted.	To format the storage drive later, do the following: 1 From the home screen, touch Settings > Device > Maintenance > Out of Service Erase. 2 Touch Erase Intelligent Storage Drive, and then touch ERASE.
64.00	The hard disk format is unsupported.	--

Error code	Description	Action
66.00	The hard disk needs to be formatted.	--

7y user attendance errors

71–72 user attendance error messages

Error code	Description	Action
71.01	The fax station name is not set up.	N/A
71.02	The fax station number is not set up.	
71.03	The analog phone line is not found.	N/A
71.04	The analog phone line is incorrectly connected.	
71.05	An invalid FoIP license was detected.	
71.06	The fax server is not found.	
71.07	The printer is not registered to HTTPS Fax Server.	Register the printer to HTTPS Fax server.
71.12	The printer cannot print faxes because the fax memory is full.	N/A
71.13	The printer cannot send faxes because the fax memory is full.	
71.20	The fax partition is not working.	
72.01	The SMTP server is not set up.	N/A
72.02	The Web Link server is not set up.	Contact system administrator.
72.04	The Fax server to Format is not set up.	Contact system administrator.

8y user attendance errors

80 user attendance error messages

Error code	Description	Action
80.00	The maintenance kit is nearly low.	Touch Continue to clear the message or see “Maintenance kit service check” on page 99.
80.01	The maintenance kit is nearly low. The backup roll or fuser page count threshold has been reached.	
80.03	The maintenance kit is nearly low.	
80.09	The maintenance kit is nearly low. The user-selected EWS set point has been reached.	
80.11	The maintenance kit is low. The backup roll or fuser page count threshold has been reached.	
80.13	The maintenance kit is low.	
80.19	The maintenance kit is low. The user-selected EWS set point has been reached.	
80.21	The maintenance kit is very low. The backup roll or fuser page count threshold has been reached.	
80.23	The maintenance kit is very low.	
80.29	The maintenance kit is very low. The user-selected EWS set point has been reached.	
80.31	Replace the maintenance kit. The backup roll or fuser page count threshold has been reached. The fuser may continue to function beyond end of life.	
80.33	Replace the maintenance kit.	
80.39	Replace the maintenance kit. The user-selected EWS set point has been reached. The fuser may continue to function beyond end of life.	

84 user attendance error messages

Error code	Description	Action
84.00	The black imaging unit is nearly low.	Touch Continue to clear the message.
84.01	The black imaging unit is nearly low.	
84.02	The black imaging unit is nearly low.	
84.03	The black imaging unit is nearly low. The side count set point has been reached.	
84.09	The black imaging unit is nearly low. The user-selected EWS set point has been reached.	
84.11	The black imaging unit is low.	
84.12	The black imaging unit is low.	
84.13	The black imaging unit is low. The side count set point has been reached.	
84.19	The black imaging unit is low. The user-selected EWS set point has been reached.	
84.20	The black imaging unit is very low.	
84.21	The black imaging unit is very low.	
84.22	The black imaging unit is very low.	
84.23	The black imaging unit is very low. The side count set point has been reached.	
84.29	The black imaging unit or CMY imaging kit is very low. The user-selected EWS set point has been reached.	
84.30	The black imaging unit has reached end-of-life.	See “Replacing the imaging unit” on page 243 .
84.31	The black imaging unit has reached end-of-life.	
84.32	The black imaging unit has reached end-of-life.	
84.33	The black imaging unit has reached end-of-life.	
84.41	The black imaging unit has reached beyond end-of-life.	
84.42	The black imaging unit has reached beyond end-of-life.	
84.43	The black imaging unit has reached beyond end-of-life.	

88 user attendance error messages

Error code	Description	Action
88.00	The black toner cartridge is nearly low.	Touch Continue to clear the message.
88.01	The black toner cartridge is nearly low.	
88.08	The black toner cartridge quanta error has occurred.	
88.09	The black toner cartridge is nearly low. The user-selected EWS set point has been reached.	
88.10	The black toner cartridge is low.	
88.18	The black toner cartridge is low.	
88.19K	The black toner cartridge is low. The user-selected EWS set point has been reached.	
88.20K	The black toner cartridge is very low.	
88.28K	The black toner cartridge is very low.	
88.29K	The black toner cartridge is very low. The user-selected EWS set point has been reached.	
88.30K	The black toner cartridge is at end-of-life.	See “Replacing the toner cartridge” on page 242.
88.37K	The black toner cartridge is at end-of-life.	
88.38K	The black toner cartridge is at end-of-life.	
88.40K	The black toner cartridge is beyond end-of-life.	
88.47K	The black toner cartridge is beyond end-of-life.	
88.48K	The black toner cartridge is beyond end-of-life.	

Maintenance kit service check

Warning—Potential Damage: Do not perform these steps if the printer is on.

- 1 Replace the required maintenance kit.
- 2 Reset the maintenance counter. See the “Resetting counters” section.

Printer hardware errors

111 errors

111 error messages

Error code	Description	Action
111.20	Printhead error (mirror motor lock) was detected before the motor was turned on.	See “Printhead error service check” on page 101.
111.21	No printhead power (+5 V) when the laser servo started.	
111.30	The printhead failed during power-on tests.	
111.30A	The printhead failed during power-on tests—Old engine code.	
111.30B	The printhead failed during power-on tests—Boost failure.	
111.30C	The printhead failed during power-on tests—Capture time incorrect.	
111.30D	The printhead failed during power-on tests—Unknown.	
111.30E	The printhead failed during power-on tests—Every test has produced HSYNCs.	
111.30F	The printhead failed during power-on tests—Failure to produce HSYNCs.	
111.30G	The printhead failed during power-on tests—Diode A failure.	
111.30H	The printhead failed during power-on tests—Diode B failure.	
111.30L	The printhead failed during power-on tests—Lpow failure.	
111.31	Printhead error (no first HSYNC) was detected.	
111.32	Printhead error (lost HSYNC) was detected.	
111.33	Printhead error (lost HSYNC) was detected during servo.	
111.35	Printhead error (mirror motor never got first lock) was detected.	
111.36	Printhead error (mirror motor never stabilized) was detected.	
111.37	Paper reached the sensor (input) but the mirror motor was not locked.	
111.38	Paper reached the sensor (input) but the printhead startup was not incomplete.	
111.40	The printhead installed is incorrect.	
111.91	Printhead error (bad facet time reading).	

Diagnostics and troubleshooting

Printhead error service check

- 1 Perform a POR.
- 2 Make sure that the connections between the controller board and the printhead are properly connected.
- 3 Check the printhead for damage, contamination, and improper installation. For more information, see [“Printhead removal” on page 238](#).

121 errors

121 error messages

Error code	Description	Action
121.00	Fuser did not reach the required temperature.	See “Fuser temperature error service check” on page 102 .
121.01	During an attempt to heat up, the fuser was not detected.	
121.02	Fuser went over the required temperature (during EWC/line voltage detection).	
121.10	Fuser did not reach the required temperature (during start of EWC/line voltage detection).	
121.11	Fuser reached the required temperature (during final EWC/line voltage detection) too late.	
121.12	Fuser did not reach the required temperature (during final EWC/line voltage detection).	
121.13	Fuser reached the required temperature (during final EWC/line voltage detection) too fast.	
121.14	Fuser is heating too fast.	
121.20	Fuser did not reach the required temperature during steady state control. This can occur during printing or in standby mode.	

Error code	Description	Action
121.22	Open fuser relay was detected.	See “Fuser temperature error service check” on page 102.
121.23	Fuser relay was turned off but the feed back to the engine code indicated that it was still open.	
121.24	Fuser did not reach the required temperature during the final EWC/line voltage detection.	
121.28	Fuser did not reach the required temperature during EP warm-up.	
121.32	Fuser did not reach the required temperature at 100% power.	
121.33	Fuser did not reach the required temperature while page is in the fuser.	
121.34	Fuser did not reach the required temperature during steady state control.	
121.50	Fuser went over the required temperature during global over-temp check.	
121.52	Main thermistor temperature is out of range.	
121.53	Main thermistor temperature change rate is out of range.	
121.71	Open fuser main heater thermistor was detected.	

Fuser temperature error service check

- 1 Make sure that the printer is placed in a location with the following temperature and humidity:
 - 60°F to 90°F temperature range
 - 8% to 80% relative humidity
- 2 If the printer must be placed in a below freezing environment, then do the following:
 - a Remove the fuser, and then allow it to slowly warm above freezing temperature.
 - b Reinstall the fuser, and then turn on the printer.
 - c Increase the timeout value for sleep mode to 114. From the home screen, touch **Settings** > **Device** > **Power Management** > **Timeouts** > **Sleep Mode**.

Note: 114 minutes is the maximum acceptable timeout value.

- 3 Make sure the wall outlet where the printer is connected provides >95% of rated voltage when printer is in "Ready State" (>109 VAC U.S., >218 VAC for HV Geos, >95 VAC for Japan).

Notes:

- Do not use this product with extension cords, multioutlet power strips, multioutlet extenders, or UPS devices. The power capacity of these types of accessories can be easily overloaded by a laser printer. This can result in a risk of fire, property damage, or poor printer performance.
- Power strips and uninterrupted power supplies can cause a low amperage condition to occur within the printer, which in turn may trigger a false fuser error.
- Make sure that the printer is plugged into an appropriate rate and properly grounded electrical outlet or supported Inline Surge Protector.

- 4 Perform a POR.
- 5 Make sure that the correct voltage is supplied to the fuser from the power supply. For more information, see the Wiring diagram and [“Power supply removal” on page 204](#).
- 6 Make sure that the connections between the controller board and the fuser are properly connected.
- 7 Check the fuser for damage, contamination, and improper installation. For more information, see [“Fuser removal” on page 232](#).

Most likely parts to replace

- Fuser
 - For the part number, go to [“Electronics” on page 273](#).
 - For the removal procedure, go to [“Fuser removal” on page 232](#).
- Power supply
 - For the part number, go to [“Electronics” on page 273](#).
 - For the removal procedure, go to [“Power supply removal” on page 204](#).

126 errors

126 error messages

Error code	Description	Action
126.01	Line frequency has gone outside the operating range.	See “LVPS error service check” on page 103 .
126.05	The LVPS power dropped but the printer was not in sleep mode.	
126.06	LVPS 7 V line error was detected.	
126.07	LVPS 7 V rail was down during power-on.	
126.10	No line frequency was detected.	
126.11	Line frequency has exceeded the operating range.	
126.12	LVPS mismatch was detected.	
126.13	LVPS mismatch was detected.	
126.14	LVPS relay is stuck or closed.	

LVPS error service check

- 1 Make sure that the printer is plugged into a into an appropriate rate and properly grounded electrical out let or supported Inline Surge Protector.
- 2 Perform a POR.
- 3 Make sure that the connections between the controller board and the LVPS are properly connected.

- 4 Make sure that the printer is plugged into a supported power strip or uninterruptable power supply (UPS).
- 5 Make sure that voltage output of the electrical outlet matches the voltage rating of the printer.

Note: A poor power source may trigger a false fuser error.

128 errors

128 error messages

Error code	Description	Action
128.01	TDS baseline is too low.	See “Sensor (toner density) error service check” on page 104.
128.02	TDS baseline is too high.	
128.03	TDS baseline range is excessive.	
128.16	TDS calibration is at maximum.	
128.17	TDS calibration is too low.	
128.18	TDS calibration is too close to baseline.	
128.32	Photoconductor drum measurement is too high.	
128.33	Photoconductor drum measurement is too different from calibration.	
128.34	Photoconductor drum measurement is too close to baseline.	
128.35	Photoconductor drum measurement data is not enough.	

Sensor (toner density) error service check

- 1 Check if the printer is using a genuine and supported Lexmark toner cartridge.

Note: If the printer is using a third-party toner cartridge, then refer the user to their supplier.
- 2 Check the image unit and toner cartridge for damage and leakage.
- 3 Make sure that the imaging unit and the toner cartridge are free of toner buildup. using an approved toner vacuum cleaner, completely clean the supplies.
- 4 Perform a POR.
- 5 Check the cleaning mechanism actuator for improper operation and damage.
- 6 Clear the area under the transfer roller of dust and toner contamination. For more information, see [“Transfer roller removal” on page 195.](#)
- 7 Remove tray 1, and then manually actuate the toner density sensor wiper by moving the pick roller up and down.
- 8 Make sure the connections between the controller board and sensor (toner density) are properly connected.

- 9 Check the pick roller cam for damage.

Note: The rotation of the pick roller cam triggers the movement of the wiper bracket.

- 10 Check the sensor (toner density) and its wiper bracket for damage, contamination, and improper installation. For more information, see [“Sensor \(toner density\) and media present sensor flag removal” on page 224](#).

133 errors

133 error messages

Error code	Description	Action
133.04	CTLS timeout was detected at the imaging unit.	See “Imaging unit CTLS error service check” on page 105
133.05	CTLS reading at the imaging unit is above the maximum expected value.	
133.06	CTLS reading at the imaging unit is below the minimum expected value.	
133.08	Excessive CTLS noise was detected at the imaging unit.	

Imaging unit CTLS error service check

- 1 Check the imaging unit for damage, contamination, and improper installation.
- 2 Check the imaging unit contacts for contamination.
- 3 Perform a POR.
- 4 Make sure that the connections between the controller board and the imaging unit are properly connected.

140 errors

140 error messages

Error code	Description	Action
140.80	Motor (main) does not turn on.	See “Motor (main) error service check” on page 106 .
140.81	Motor (main) does not turn off.	
140.82	Motor (main) speed did not ramp up to the required level.	
140.83	Motor (main) stalled.	
140.84	Motor (main) ran too slow.	
140.85	Motor (main) ran too fast.	
140.86	Motor (main) ran too long.	

Motor (main) error service check

- 1 Check if the error occurs only after printing. If yes, then check the imaging unit for damage, contamination, and improper installation.
- 2 Perform a POR.
- 3 Make sure that the motor (main) is functional. Do the following:
 - a Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Motors tests**.
 - b Select **Transport**.
- 4 Make sure that the connections between the motor (main) and the controller board are properly connected.
- 5 Check the main drive gearbox for damage, contamination, and improper installation. For more information, see [“Main drive gearbox removal” on page 166](#).

155 errors

155 error messages

Error code	Description	Action
155.80	Motor (cartridge) does not turn on.	See “Cartridge drive error service check ” on page 106 .
155.81	Motor (cartridge) does not turn off.	
155.82	Motor (cartridge) speed did not ramp up to the required level.	
155.83	Motor (cartridge) has stalled.	
155.84	Motor (cartridge) ran too slow.	
155.85	Motor (cartridge) ran too fast.	
155.86	Motor (cartridge) ran too long.	

Cartridge drive error service check

- 1 Check if the printer is using a genuine and supported Lexmark toner cartridge.

Note: If the printer is using a third-party toner cartridge, then refer the user to their supplier.
- 2 Check the toner cartridge for damage and improper installation.
- 3 Manually turn the cartridge gear, and then make sure it is not stuck.
- 4 Open the front access door, and then check if the cartridge plunger is damaged.
- 5 Make sure that the toner cartridge is free of toner buildup. Using an approved toner vacuum cleaner, completely clean the toner cartridge.
- 6 Make sure that the connections between the toner cartridge and the controller board are properly connected.
- 7 Perform a POR.

- 8 Make sure that the motor (main) is functional. Do the following:
 - a Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Motors tests**.
 - b Select **Transport**.
- 9 Make sure that the connections between the motor (main) and the controller board are properly connected.
- 10 Check the main drive gearbox for damage, contamination, and improper installation. For more information, see [“Main drive gearbox removal” on page 166](#).

16y errors

161 error messages

Error code	Description	Action
161.80	The motor (tray 1 pick/lift) does not turn on.	See “Motor (tray 1 pick/lift) error service check” on page 109 .
161.81	The motor (tray 1 pick/lift) does not turn off.	
161.82	The motor (tray 1 pick/lift) speed did not ramp up to the required level.	
161.83	The motor (tray 1 pick/lift) stalled.	
161.84	The motor (tray 1 pick/lift) ran too slow.	
161.85	The motor (tray 1 pick/lift) ran too fast.	
161.86	The motor (tray 1 pick/lift) ran too long.	

162-164 error messages

Error code	Description	Action
162.80	The motor (tray 2 pick) does not turn on.	See “Optional tray pick drive error service check” on page 110 .
162.81	The motor (tray 2 pick) does not turn off.	
162.82	The motor (tray 2 pick) speed did not ramp up to the required level.	
162.83	The motor (tray 2 pick) stalled.	
162.84	The motor (tray 2 pick) ran too slow.	
162.85	The motor (tray 2 pick) ran too fast.	
162.86	The motor (tray 2 pick) ran too long.	

Error code	Description	Action
163.80	The motor (tray 3 pick) does not turn on.	See “Optional tray motor error service check” on page 110.
163.81	The motor (tray 3 pick) does not turn off.	
163.82	The motor (tray 3 pick) speed did not ramp up to the required level.	
163.83	The motor (tray 3 pick) stalled.	
163.84	The motor (tray 3 pick) ran too slow.	
163.85	The motor (tray 3 pick) ran too fast.	
163.86	The motor (tray 3 pick) ran too long.	
164.80	The motor (tray 4 pick) does not turn on.	
164.81	The motor (tray 4 pick) does not turn off.	
164.82	The motor (tray 4 pick) speed did not ramp up to the required level.	
164.83	The motor (tray 4 pick) stalled.	
164.84	The motor (tray 4 pick) ran too slow.	
164.85	The motor (tray 4 pick) ran too fast.	
164.86	The motor (tray 4 pick) ran too long.	

166-168 error messages

Error code	Description	Action
166.80	The motor (tray 2 transport) does not turn on.	See “Optional tray motor error service check” on page 110.
166.81	The motor (tray 2 transport) does not turn off.	
166.82	The motor (tray 2 transport) speed did not ramp up to the required level.	
166.83	The motor (tray 2 transport) stalled.	
166.84	The motor (tray 2 transport) ran too slow.	
166.85	The motor (tray 2 transport) ran too fast.	
166.86	The motor (tray 2 transport) ran too long.	
167.80	The motor (tray 3 transport) does not turn on.	
167.81	The motor (tray 3 transport) does not turn off.	
167.82	The motor (tray 3 transport) speed did not ramp up to the required level.	
167.83	The motor (tray 3 transport) stalled.	
167.84	The motor (tray 3 transport) ran too slow.	
167.85	The motor (tray 3 transport) ran too fast.	
167.86	The motor (tray 3 transport) ran too long.	
168.80	The motor (tray 4 transport) does not turn on.	
168.81	The motor (tray 4 transport) does not turn off.	
168.82	The motor (tray 4 transport) speed did not ramp up to the required level.	
168.83	The motor (tray 4 transport) stalled.	
168.84	The motor (tray 4 transport) ran too slow.	
168.85	The motor (tray 4 transport) ran too fast.	
168.86	The motor (tray 4 transport) ran too long.	

Motor (tray 1 pick/lift) error service check

- 1 Check the tray insert for damage and improper installation.
- 2 Check the tray guides for damage and improper operation.
- 3 Check the lift plate for damage and improper operation.
- 4 Perform a POR.
- 5 The following instruction applies to only the MS63x, MX53x, and MX63x printer models.
 - a Make sure that the pick/lift motor gearbox is functional. Do the following:
 - 1 Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Motors tests.**
 - 2 Select **Motor (tray 1 pick/lift).**

- b Make sure that the connections between the motor (pick/lift) and the controller board are properly connected.
 - c Check the pick/lift motor gearbox for damage, contamination, and improper installation. For more information, see [“Pick/lift motor gearbox removal” on page 222](#).
- 6 Check the pick roller for damage and improper operation. For more information, see [“Pick roller removal” on page 214](#).

Optional tray motor error service check

- 1 Make sure that the printer is placed in a location with the recommend airflow, ventilation, and clearance around the printer. For more information, see [“Selecting a location for the printer” on page 302](#).
- 2 Make sure that the cooling fan is functional. Do the following:
 - a Enter the Diagnostics menu, and then touch **Printer diagnostics & adjustments > Motors tests**.
 - b Select **Fan (main)**.
- 3 Make sure that the connections between the cooling fan and the controller board are properly connected.
- 4 Check the cooling fan for damage, contamination, and improper installation. For more information, see [“Fan removal” on page 182](#).

Optional tray pick drive error service check

- 1 Turn off the printer.
- 2 Check the optional tray for improper installation.
- 3 Remove the optional tray, and then check the connectors on the printer and optional tray for damage and improper connection.
- 4 Reinstall the optional tray, and then turn on the printer.
- 5 Remove the tray insert.
- 6 Check the tray insert and its lift plate gears for damage and improper operation.
- 7 Make sure that the following motors are functional:
 - Motor (pick (tray (x)))
 - Motor (pass-through (tray(x)))
 Do the following:
 - a Enter the Diagnostics menu, and then touch **Additional input tray diagnostics > Motors tests**.
 - b Select **Pick (tray [x])** and **Pass-through (tray [x])**.
- 8 Make sure that the connections between the motors and the controller board are properly connected.
- 9 Check the motors for damage, and improper installation.

171 errors

171 error messages

Error code	Description	Action
171.82	The main fan speed did not ramp up to the required level.	N/A
171.83	The main fan stalled.	
171.84	The main fan ran too slow.	
171.85	The main fan ran too fast.	

6yy errors

600-680 error messages

Error code	Description	Action
600.01	Toner tally from the RIP was not received.	See “Printhead error service check” on page 101.
600.02	Video did not start.	
600.03	Transfer Servo never started.	
600.04	Duplex page was not picked.	
600.05	Invalid PH NVRAM Type error was detected.	
600.06	Paper port driver is unresponsive.	
600.07	Page is at image point before EP is ready.	
600.07A		
600.07B	Page is at input sensor before EP is ready.	
600.07C	Page is at image point before EP is ready.	
600.09	EP update error was detected.	
600.10	EP late run-in error was detected.	
600.95	RIP intentionally declared a jam error, usually to prevent a kiosk user from printing free pages.	
602.29	Tray 2 was unable to be ready for picking.	N/A
602.39	Tray 3 was unable to be ready for picking.	N/A
602.49	Tray 4 was unable to be ready for picking.	N/A
602.59	Tray 5 was unable to be ready for picking.	

Error code	Description	Action
611.02	An Input ISR error occurred and the printhead was not ready.	See “Printhead error service check” on page 101.
611.32	Lost Hsync errors were detected. Laser safety interlock system may be the cause.	
611.33	Lost Hsync errors were detected during servo.	
611.34	A mirror motor lock error was detected.	
611.35	The mirror motor never got first lock.	
611.36	The mirror motor never stabilized.	
611.37	Paper reached the sensor (input) but the mirror motor was not locked.	
611.38	Paper reached the sensor (input) but the printhead startup was incomplete.	
621.01	Fuser heater was too cold when paper entered the fuser nip.	See “Fuser temperature error service check” on page 102.
655.80	Motor (cartridge) does not turn on.	See “Cartridge drive error service check ” on page 106.
655.81	Motor (cartridge) does not turn off.	
655.82	Motor (cartridge) speed did not ramp up to the required level.	
655.83	Motor (cartridge) has stalled.	
655.84	Motor (cartridge) ran too slow.	
655.85	Motor (cartridge) ran too fast.	
655.86	Motor (cartridge) ran too long.	
661.13	The tray 1 lift plate failed to lift.	See “Motor (tray 1 pick/lift) error service check” on page 109.
661.80	Motor (tray 1 pick/lift) does not turn on.	
661.81	Motor (tray 1 pick/lift) does not turn off.	
661.82	Motor (tray 1 pick/lift) speed did not ramp up to the required level.	
661.83	Motor (tray 1 pick/lift) has stalled.	
661.84	Motor (tray 1 pick/lift) ran too slow.	
661.85	Motor (tray 1 pick/lift) ran too fast.	
661.86	Motor (tray 1 pick/lift) ran too long.	

Error code	Description	Action
662.23	The tray 2 lift plate failed to lift.	See “Optional tray pick drive error service check” on page 110.
662.80	Motor (tray 2 pick) does not turn on.	
662.81	Motor (tray 2 pick) does not turn off.	
662.82	Motor (tray 2 pick) speed did not ramp up to the required level.	
662.83	Motor (tray 2 pick) has stalled.	
662.84	Motor (tray 2 pick) ran too slow.	
662.85	Motor (tray 2 pick) ran too fast.	
662.86	Motor (tray 2 pick) ran too long.	See “Optional tray motor error service check” on page 110.
663.23	The tray 3 lift plate failed to lift.	
663.80	Motor (tray 3 pick) does not turn on.	
663.81	Motor (tray 3 pick) does not turn off.	
663.82	Motor (tray 3 pick) speed did not ramp up to the required level.	
663.83	Motor (tray 3 pick) has stalled.	
663.84	Motor (tray 3 pick) ran too slow.	
663.85	Motor (tray 3 pick) ran too fast.	
663.86	Motor (tray 3 pick) ran too long.	
664.43	The tray 4 lift plate failed to lift.	
664.80	Motor (tray 4 pick) does not turn on.	
664.81	Motor (tray 4 pick) does not turn off.	
664.82	Motor (tray 4 pick) speed did not ramp up to the required level.	
664.83	Motor (tray 4 pick) has stalled.	
664.84	Motor (tray 4 pick) ran too slow.	
664.85	Motor (tray 4 pick) ran too fast.	
664.86	Motor (tray 4 pick) ran too long.	
666.80	The motor (tray 2 pass-through) did not turn on.	
666.81	The motor (tray 2 pass-through) did not turn off.	
666.82	The motor (tray 2 pass-through) speed did not ramp up to the required level.	
666.83	The motor (tray 2 pass-through) has stalled.	
666.84	The motor (tray 2 pass-through) ran too slow.	
666.85	The motor (tray 2 pass-through) ran too fast.	

Error code	Description	Action
666.86	The motor (tray 2 pass-through) ran too long.	See “Optional tray motor error service check” on page 110.
667.80	The motor (tray 3 pass-through) did not turn on.	
667.81	The motor (tray 3 pass-through) did not turn off.	
667.82	The motor (tray 3 pass-through) speed did not ramp up to the required level.	
667.83	The motor (tray 3 pass-through) has stalled.	
667.84	The motor (tray 3 pass-through) ran too slow.	
667.85	The motor (tray 3 pass-through) ran too fast.	
667.86	The motor (tray 3 pass-through) ran too long.	
668.80	The motor (tray 4 pass-through) did not turn on.	
668.81	The motor (tray 4 pass-through) did not turn off.	
668.82	The motor (tray 4 pass-through) speed did not ramp up to the required level.	
668.83	The motor (tray 4 pass-through) has stalled.	
668.84	The motor (tray 4 pass-through) ran too slow.	
668.85	The motor (tray 4 pass-through) ran too fast.	
668.86	The motor (tray 4 pass-through) ran too long.	
680.10	ADF cover was open during an ADF job.	N/A
680.20	Paper was not detected on the ADF tray during an ADF job.	N/A
680.40	A communication error has occurred during a scan job.	N/A
680.50	An imagepip error/prohibited image error has been detected.	

Procedure before starting the 9yy service checks

Retrieve certain information that helps your next level of support in diagnosing the problem before replacing the controller board.

Warning—Potential Damage: Do not replace the controller board unless instructed by your next level of support.

- 1 Collect the history information and firmware logs (Fwdebug and logs.tar.gz) from the SE menu.
- 2 Collect the settings from the Menu Settings Page.
- 3 Collect information from the user.

Note: Not all of the items are retrievable from the printer that you are working on.

A. Collecting the history information from the SE menu

Note: Make sure that your printer is connected to a network or to a print server.

- 1 Open a web browser, type **http://printer_IP_address/se**, and then press **Enter**.

Notes:

- **printer_IP_address** is the TCP/IP address of the printer.
- **se** is required to access the printer diagnostic information.

- 2 Click **History Information**, copy all information, and then save it as a text file.
- 3 Email the text file to your next level of support.

B. Collecting the firmware logs (Fwdebug and logs.tar.gz) from the SE menu

Notes:

- Make sure that your printer is connected to a network or to a print server.
- Some printers are designed to restart automatically after a 9yy error. On these printers, you can retrieve the secondary crash code information using the SE menu.

- 1 Open a web browser, type **http://printer_IP_address/se**, and then press **Enter**.
- 2 Click **Logs Gzip Compressed**.

Note: A logs.tar.gz file is saved to the Downloads folder. The file may take several minutes to save. You may rename the file if a logs.tar.gz already exists in the Downloads folder.

- 3 Email the logs to your next level of support.

Note: To download the FWdebug log to a flash drive, see [“General SE Menu” on page 136](#).

C. Collecting the settings from the Menu Settings Page

Note: The Menu Settings Page is different for each printer. For more information, see the *User's Guide*. Your next level of support will tell you which page they want to see.

Copying the Menu Settings Page from the Embedded Web Server (EWS)

Note: Make sure that your printer is connected to a network or to a print server.

- 1 Open a web browser, type **http://printer_IP_address**, and then press **Enter**.
- 2 Click **Settings**, and then select one of the settings pages from the links shown on the page.
- 3 Copy all the information, and then save it as a text file.
- 4 Email the text file to your next level of support.

Printing the Menu Settings Page

- 1 From the home screen, navigate to:
Reports > Menu Settings Page
- 2 Print the Menu Settings Page, and then email a scanned copy of the page to your next level of support.

D. Collecting information from the user

Ask the user for information about the following:

- Print job being run
- Operating system being used
- Print driver being used
- Other information on what was happening when the 9yy error occurred

900-901 errors

900-901 error messages

Error code	Description	Action
900.00	Unrecoverable RIP software error/illegal trap.	See “900 error service check” on page 116.
900.70		
901.01	A RIP firmware error has occurred.	
901.02		

900 error service check

- 1 Clear all jobs in the printer and computer print queue.
- 2 Perform a POR.
- 3 Turn off the printer.
- 4 Disconnect the USB cable, fax line, and network cable from the printer.
- 5 Turn on the printer.
- 6 If the error does not occur, then install each cable one at a time and perform a POR after each cable installation.
- 7 Make sure that the printer is running the latest firmware version.
If the printer cannot connect to the network due to a 900 error, then do the following:
 - a Enter Recovery mode. For more information, see [“Entering Recovery mode” on page 134.](#)
 - b Flash the firmware code through a USB cable that is directly connected to a computer.
- 8 Turn off the printer.
- 9 Remove all electronic options (hard disk, ISD, wireless module, ISP, and memory options).
- 10 Turn on the printer.
- 11 If the error does not occur, then install the electronic options one at a time and perform a POR after each electronic option installation.
- 12 Replace the electronic option that causes the error.
- 13 Make sure that the connections between the engine board and the controller board are properly connected.

14 Check the controller board for the following:

- Foreign debris (dust, dirt, or any accumulated material)
- Circuit board expansion due to heat and humidity
- Damaged pins, burnt-out components, and signs of overheating and bulging
- Missing components and solder joint connection issues
- Contamination issues (corrosion, degradation, metallization, and chemical leakage)
- Incorrect input or output voltages. See the wiring diagram.

For more information, see [“Controller board removal” on page 183](#).

912 errors

912 error messages

Error code	Description	Action
912.00	An engine software error has occurred.	See “900 error service check” on page 116 .
912.01	An engine error occurred.	Resend the print job. If the problem remains, then contact the next level of support.
912.02	An engine error occurred.	
912.04	An engine error occurred.	
912.05	An engine error occurred.	
912.06	An engine error occurred.	
912.07	An engine error occurred.	See “900 error service check” on page 116 .
912.08	An engine error occurred.	Resend the print job. If the problem remains, then contact the next level of support.
912.09	An engine error occurred.	
912.13	An engine error occurred.	
912.14	An engine error occurred.	
912.15	An engine error occurred.	
912.16	An engine error occurred.	
912.17	An engine error occurred.	
912.18	An engine error occurred.	
612.19	An engine error occurred.	
912.20	An engine error occurred.	
912.21	An engine error occurred.	
912.28	An engine error occurred.	

Error code	Description	Action
912.30	An engine error occurred.	Resend the print job. If the problem remains, then contact the next level of support.
912.31	An engine error occurred.	
912.32	An engine error occurred.	
912.33	An engine error occurred.	
912.34	An engine error occurred.	
912.36	An engine error occurred.	
912.38	An engine error occurred.	See “900 error service check” on page 116.
912.39	An engine error occurred.	Resend the print job. If the problem remains, then contact the next level of support.
912.40	An engine error occurred.	
912.42	An engine error occurred.	
912.43	An engine error occurred.	
912.44	An engine error occurred.	
912.45	An engine error occurred.	
912.46	An engine error occurred.	
912.48	An engine error occurred.	
912.49	An engine error occurred.	
912.50	An engine error occurred.	See “900 error service check” on page 116.
912.51	An engine error occurred.	Resend the print job. If the problem remains, then contact the next level of support.
912.53	An engine error occurred.	
912.54	An engine error occurred.	
912.55	An engine error occurred.	
912.56	An engine error occurred.	
912.57	An engine error occurred.	
912.58	An engine error occurred.	
912.60	An engine error occurred.	
912.61	An engine error occurred.	
912.64	An engine error occurred.	
912.65	An engine error occurred.	
912.66	An engine error occurred.	

Error code	Description	Action
912.69	An engine error occurred.	Resend the print job. If the problem remains, then contact the next level of support.
912.70	An engine error occurred.	
912.72	An engine error occurred.	
912.73	An engine error occurred.	
912.74	An engine error occurred.	
912.75	An engine error occurred.	
912.77	An engine error occurred.	
912.79	An engine error occurred.	See “900 error service check” on page 116.
912.85	An engine error occurred.	
912.86	An engine error occurred.	Resend the print job. If the problem remains, then contact the next level of support.
912.88	An engine error occurred.	See “900 error service check” on page 116.
912.99	RIP command interface issue to the engine.	

938-958 errors

938–958 error messages

Error code	Description	Action
938.01	An unknown card type was detected by the thick engine code.	See “900 error service check” on page 116.
938.04	The supplies security is disabled.	Restart the printer. If the problem remains, then contact the next level of support.
938.05	A bad cal cap on the system cap.	N/A
940.00	Controller to engine communication error has occurred.	See “900 error service check” on page 116.
941.03	An engine communication error has occurred.	
950.10	An NVRAM mismatch error occurred—Non-generic FRU installed.	
953.99	An NVRAM chip failure with mirror part.	
958.99	A controller board NAND error has occurred..	

980-992 errors

980-992 error messages

Error code	Description	Action
980.01	An option communication error has occurred.	See “Dead optional tray service check” on page 121.
980.02	An option communication error has occurred.	
980.03	An option communication error has occurred.	
980.04	An option communication error has occurred.	
980.05	An option communication error has occurred.	
980.11	An option communication error has occurred.	
980.13	An option communication error has occurred.	
980.14	An option communication error has occurred.	
980.15	An option communication error has occurred.	
981.91	An invalid paper port protocol error has occurred.	
982.92	A paper port error occurred.	
982.94	A paper port error occurred.	
982.95	A paper port error occurred.	
982.96	A paper port error occurred.	
982.97	A paper port error occurred.	
983.98	An unsupported paper port command error has occurred.	
984.99	An invalid paper port parameter error has occurred.	
992.00	An option device software error has occurred.	
992.01	An option device software error has occurred.	


Other symptoms

Base printer symptoms

Symptom	Action
The optional tray is unresponsive.	See “Dead optional tray service check” on page 121.

Dead optional tray service check

- 1 Check the compatibility of the optional tray. Do the following:
 - a Make sure that the optional tray is supported by the printer model. For more information, see [“Optional trays” on page 293](#).
 - b Remove the tray insert, and then check if the label is present.

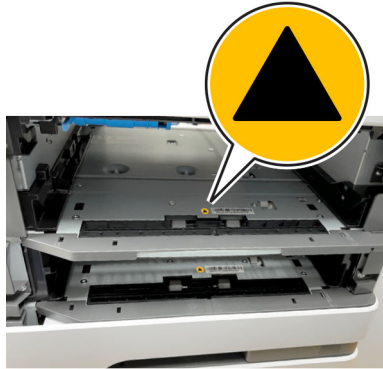


If the part number of the optional tray does not start with 36S or the label is not present, then the optional tray is incompatible.

- 2 If the error persists after installing a compatible tray, then check the interconnect cable for damage and improper installation. For more information, see [“Interconnect cable removal” on page 180](#).

Service menus

Understanding the printer control panel

Using the control panel

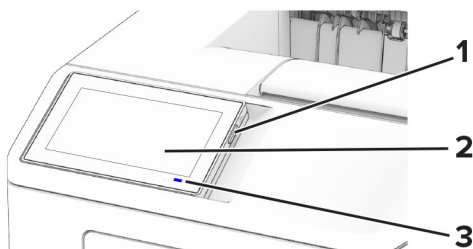

	Control panel part	Function
1	Power button	- Turn on or turn off the printer. Note: To turn off the printer, press and hold the power button for five seconds. - Set the printer to Sleep mode. - Wake the printer from Sleep or Hibernate mode.
2	Display	- View the printer messages and supply status. - Set up and operate the printer.
3	Indicator light	Check the status of the printer.

Understanding the status of the indicator light


Indicator light	Printer status
Off	The printer is off.
Solid blue	The printer is ready.
Blinking blue	The printer is printing or processing data.
Blinking red	The printer requires user intervention.
Solid amber	The printer is in Sleep mode.
Blinking amber	The printer is in Deep Sleep or Hibernate mode.

Diagnostics menu


Entering the Diagnostics Menu

The Diagnostics Menu contains tests that are used to help isolate printer issues.

- To access the menu from POST, do the following:
 - 1** Unplug the power cord from the electrical outlet.
 - 2** Open tray 1.
 - 3** Connect the power cord to the electrical outlet.
 When the display shows the following icon, close tray 1.

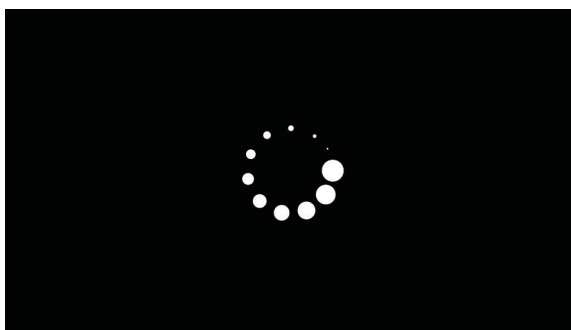

- 4** From the menu that appears on the display, select **Diagnostics_Mode**.

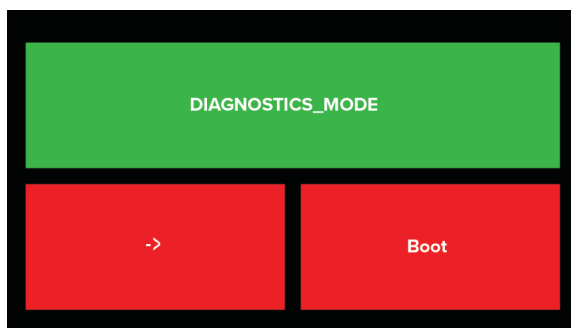

Notes:

- Make sure that the selected menu turns green.
- If the **Diagnostics_Mode** option does not show on the display, touch -> repeatedly until it appears.

- 5** Select **Boot**.

- To access the Diagnostics Menu from a 4.3-in. touch screen display, do the following:
 - 1** From the home screen, touch .
 - 2** Touch ****36**, and then touch the start button.
- To access the Diagnostics Menu from a 2.8-in. touch screen display, do the following:
 - 1** Press the following buttons in this sequence: **Back, Back, Start, Start**.

Reports

Device Settings

This report lists all the current printer settings.

Enter the Diagnostics menu, and then navigate to:

Reports > Device > Device Settings

Installed Licenses

This setting lists all the installed licenses and their feature data.

Enter the Diagnostics menu, and then navigate to:

Reports > Licenses > Installed Licenses

Advanced Print Quality Samples

This setting prints a list of the printer settings and sample pages to check print quality.

Enter the Diagnostics menu, and then navigate to:

Advanced Print Quality Samples

Event Log

Display Log

This setting displays the message text that appears when a printer event occurs.

- 1 Enter the Diagnostics menu, and then navigate to:

Event Log > Display Log

- 2 Select a log to print.

Print Log

This setting lists an extended version of the various printer events.

- 1 Enter the Diagnostics menu, and then navigate to:

Event Log > Print Log

- 2 Touch **Print Log**.

Note: The events that appear in the report vary depending on the operational history of the printer.

Print Log Summary

This setting lists a brief summary of the various printer events.

- 1 Enter the Diagnostics menu, and then navigate to:

Event Log > Print Log Summary

- 2 Touch **Print Log Summary**.

Note: The events that appear in the report vary depending on the operational history of the printer.

Mark Log

This setting allows you to create a service, maintenance, or custom log entry. Each log entry is added in the printer event log.

- 1 Enter the Diagnostics menu, and then navigate to:

Event Log > Mark Log

- 2 Select a log that you want to create.

Input tray quick print

This setting lets you print a single or continuous Quick Test page in either duplex or simplex mode.

- 1 Enter the Diagnostics menu, and then touch **Input tray quick print**.
- 2 Select where you want to print the pages from.
- 3 Select whether to print a single or continuous test page, and then touch **Start**.

Output bin quick feed

This setting lets you send a single or continuous test page to a bin.

- 1 Enter the Diagnostics menu, and then touch **Output bin quick feed**.
- 2 Select the bin to send the test page to.
- 3 Select whether to send a single or continuous test page.

Printer Setup

Printed page count (mono)

This setting displays the amount of pages printed in mono.

- 1 Enter the Diagnostics menu, and then touch **Printer Setup**.
- 2 View the printed page count for mono.

Permanent page count

This setting displays the total number of pages printed in mono and color. After all the print tests are completed, this value resets to zero.

- 1 Enter the Diagnostics menu, and then touch **Printer Setup**.
- 2 View the permanent page count.

Enable edge-to-edge (printing)

This setting shifts all four margins to the physical edges of the page.

- 1 Enter the Diagnostics menu, and then navigate to:
Printer Setup > Enable edge-to-edge (printing)
- 2 Select a setting to adjust.

Note: This feature does not work in PPDS emulation.

Processor ID

This setting indicates the ID of the processor on the controller board.

- 1 Enter the Diagnostics menu, and then touch **Printer Setup**.
- 2 View the processor ID.

Serial number

This setting displays a read-only value of the serial number.

- 1 Enter the Diagnostics menu, and then touch **Printer Setup**.
- 2 View the serial number.

Model name

This setting displays the model name of the printer.

- 1 Enter the Diagnostics menu, and then touch **Printer Setup**.
- 2 View the model name.

Engine setting [x]

Warning—Potential Damage: Do not change this setting without specific instructions from the next level of support.

This setting allows you to select a printer engine setting. Possible values are 0–255. 0 is the default.

- 1 Enter the Diagnostics menu, and then navigate to:
Printer Setup > Engine setting [x]
- 2 Select a setting, enter a value, and then touch **OK**.

EP setup

Warning—Potential Damage: Do not change this setting without specific instructions from the next level of support.

This setting allows you to adjust the EP setup of the printer.

- 1 Enter the Diagnostics menu, and then navigate to:

Printer Setup > EP setup

- 2 Select a setting.

Printer diagnostics and adjustments

Sensor tests

- 1 Enter the Diagnostics menu, and then navigate to:

Printer diagnostics & adjustments > Sensor tests

- 2 Select a sensor.
- 3 Find, and then manually toggle the sensor.

Notes:

- The sensor status on the screen toggles between **1** and **0** when the sensor is properly working.
- If a sensor test fails, the test failure may not indicate a failed sensor. Further troubleshooting may be required. Check the boards and cables for possible issues.
- For the fuser exit sensor actuator, toggle it toward the rear door.

List of sensor tests

Test
MPF media present
Pick roller index (tray 1)
Media out (tray 1)
Input
Fuser exit
Duplex path 1
Output bin full
Door interlock
Trailing edge

Motor tests

- 1 Enter the Diagnostics menu, and then navigate to:

Printer diagnostics & adjustments > Motor tests

- 2 Select a motor.

Notes:

- If the motor is activated, then it is properly working.
- Some motors require automatic deactivation to avoid secondary issues such as possible damage and contamination.
- Some tests require a special action to activate a motor such as removing a major component.
- If the motor fails, the test failure may not indicate a failed motor. Further troubleshooting may be required. Check the boards and cables for possible issues.
- To stop a running motor in non-touch-screen printer models, touch **OK**.

List of motor tests

Test
MPF pick
Pick (tray 1)
Duplex solenoid
Redrive solenoid
K toner add
Transport
Fan (main)

Registration adjust

This setting lets you adjust the skew and margins. You can also perform a Quick test after the adjustment.

- 1 Enter the Diagnostics menu, and then navigate to:
Printer diagnostics & adjustments > Registration adjust
- 2 Select a setting.

Margin Offset

This setting lets you adjust the margin offset and to print or reset the default settings.

- 1 Enter the Diagnostics menu, and then navigate to:
Printer diagnostics & adjustments > Margin Offset
- 2 Select a setting.

Universal Override

This setting lets you feed custom paper sizes to a Custom Media Tray.

- 1 Enter the Diagnostics menu, and then navigate to:
Printer diagnostics & adjustments > Universal Override
- 2 Select a paper source, and then adjust the settings.

Additional input tray diagnostics

Sensor tests

- 1 Enter the Diagnostics menu, and then touch **Additional input tray diagnostics**.
- 2 Select a sensor.
- 3 Find, and then manually toggle the sensor.

Notes:

- The sensor status on the screen toggles between **1** and **0** when the sensor is properly working.
- If a sensor test fails, the test failure may not indicate a failed sensor. Further troubleshooting may be required. Check the boards and cables for possible issues.

List of sensor tests

Test
Pick roller index (tray [x])
Media out (tray [x])
Pass-through (tray [x])
Trailing edge (tray [x])

Motor tests

- 1 Enter the Diagnostics menu, and then navigate to:
Additional input tray diagnostics > Motor tests

- 2 Select a motor.

Notes:

- If the motor is activated, then it is properly working.
- Some motors require automatic deactivation in order to avoid secondary issues such as possible damage and contamination.
- Some tests require a special action to activate a motor such as removing a major component.
- If the motor fails, the test failure may not indicate a failed motor. Further troubleshooting may be required. Check the boards and cables for possible issues.

Test
Pass-through (tray [x])

Entering Configuration Menu

From the home screen, touch **Settings > Device > Maintenance > Configuration Menu**.