



ODOO PRODUCTION USER GUIDE


TCG Machines - Odoo Guide

Department-specific reference for 10-machine manufacturing batches, data entry, and testing quality checks.

- Manufacturing x10
- 3 Production Stages
- Quality Checks
- Testing Handoff

10

MACHINE BATCH

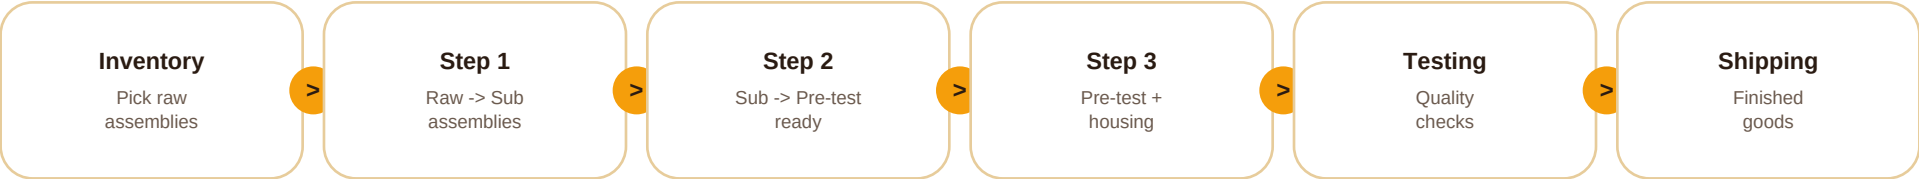

Use this guide on the floor
Open the matching department section, follow the numbered Odoo screen callouts, enter only real completed work, and hand off in Odoo before the physical batch moves.

1. Odoo Setup Configure 3-step manufacturing, routes, work centers, BoMs, and quality control points.	2. Production Lead Create and confirm the 10-machine manufacturing order.	3. Inventory / Kitting Pick raw assemblies and kits using the WH/PC transfer.
4. Step 1 - Sub Assemblies Convert raw assemblies into sub-assemblies for the batch.	5. Step 2 - Pre-Test Ready Build sub-assemblies into assemblies ready for pre-test.	6. Step 3 - Pre-Test & Housing Run pre-test/housing and hand off to Testing.
7. Testing / Quality Use quality checks, QCPs, pictures, measures, and alerts.	8. Shipping Handoff Release only passed units or approved exceptions.	9. Data Standards Consistent field names, notes, serials, and status language.
10. Screen Map Fast click-path reference for each department.		

1. Odoo Setup - Configure Once

Use Odoo warehouse 3-step manufacturing, then map TCG Machines production work as work orders inside the manufacturing order.

Odoo

Inventory

Manufacturing

Quality

Transfers

Reporting

Save

1

3

d

Warehouses / TCG Main Warehouse

Warehouse Name

TCG Main Warehouse

Short Name

TCG

Manufacture

☐ Manufacture (1 step)

☐ Pick components and manufacture (2 steps)

☒ Pick components, manufacture and store produ...

2

Important distinction

Odoo 3-step manufacturing means Pick Components, Manufacturing Order, and Store Finished Products. TCG production stages are work orders inside the MO.

Setup sequence

1. Enable/configure the TCG warehouse to manufacture in 3 steps.
2. Create work centers: Sub Assembly, Main Assembly, Pre-Test & Housing, Testing.
3. Create one TCG batch BoM and route that produces ten machines worth of work.
4. Attach Quality Control Points to the Testing work order operation.
5. Test the process with one internal training MO before going live.

Recommended work centers

Work Center	Odoo purpose	TCG data captured
Sub Assembly	Step 1 work order	Quantity of sub-assembly sets completed, deviations, scrap, missing parts.
Main Assembly	Step 2 work order	Machine serials, build notes, sub-assemblies consumed.
Pre-Test & Housing	Step 3 work order	Bench pre-test status, housing completion, evidence photo, Testing handoff.
Testing	Quality checks / testing work order	Pass/fail results, measurements, pictures, worksheets, quality alerts.

2. Production Lead - Create the 10-Machine MO

The manufacturing order is the weekly production pull. It should represent ten machines worth of work and become the source of truth for components, work orders, and testing status.

Odoo

Inventory

Manufacturing

Quality

Transfers

Reporting

1 Confirm

Save

Discard

MO / New Manufacturing Order

Draft

Product

TCG Machine Batch - 10 Set

Quantity

10.00

BoM

TCG Machine Batch - 10 Set BoM

Scheduled Date

Monday

Source Document

TCG-MO-YYYYWW-##

Component	To Consume	Reserved
Raw Assembly Kit	10	Ready
Hardware / Fastene...	10	Ready
Scanner, Chassis, ...	10 sets	Check

Data-entry steps

1. Go to Manufacturing -> Operations -> Manufacturing Orders -> New.
2. Select the TCG batch product, such as TCG Machine Batch - 10 Set.
3. Enter 10.00 as the quantity.
4. Select the correct TCG batch BoM so components and work orders auto-fill.
5. Confirm that components, work orders, source document, and schedule are correct.
6. Click Confirm only when the batch is ready to release to Inventory/Kitting.

Production lead rule

Do not confirm a batch MO just to reserve an idea. Confirm only when the ten-machine batch is real, scheduled, and ready for kitting.

Fields to enter

Field	TCG value	Notes
Product	TCG Machine Batch - 10 Set	Use the batch product/BoM that drives all work orders.
Quantity	10.00	The weekly batch process is ten machines unless the production lead explicitly approves a partial batch.
BoM	TCG Batch BoM	Must generate Step 1, Step 2, Step 3, and Testing work orders.
Source Document	TCG-MO-YYYYWW-##	Use a searchable batch ID for weekly reporting.
Responsible	Production lead owner	The person accountable for the MO from creation through testing handoff.

3. Inventory / Kitting - Pick Raw Assemblies

Inventory supports the confirmed production pull by staging raw assemblies, hardware, and kit components for the ten-machine batch.

MO / Transfers / Pick Components

mock Odoo screen

Odoo

Inventory

Manufacturing

Quality

Transfers

Reporting

Validate

Check Availability

Print Picking

W.C/00082 - Pick Components

Ready

Source Location

Destination

Operation Type

WH/Stock

Production

Pick Components

Part / Kit	Demand	Done	Lot / Serial
Raw Assembly	10	10	Scan
Scanner Part Pa...	10	10	Scan
Chassis / Conve...	10	10	Scan

Data-entry steps

1. Open the confirmed MO and click the Transfers smart button.
2. Open the WH/PC/xxxxx Pick Components transfer.
3. Click Check Availability if components are not already reserved.
4. Pick raw assembly kits, hardware kits, scanner parts, chassis parts, and conveyor parts for ten machines.
5. Enter Done quantities and scan lots/serial numbers when Odoo requests tracking.
6. Physically move the kit to the production/pre-production location.
7. Click Validate only after the physical move is complete.

Kitting rule


The Done quantity in Odoo must match the physical kit. If only eight kits are physically ready, do not validate ten.

Fields to verify

Field	Expected value	What to check
Operation Type	Pick Components / WH/PC	This is the official kitting record for the MO.
Source Location	WH/Stock or configured storage	Where raw assemblies physically leave from.
Destination Location	Production / Pre-Production	Where the kit is physically staged.
Demand	10 sets or required component count	Should match the confirmed MO requirement.
Done	Actual picked count	Enter only what was physically moved.
Lot/Serial	Scanned when required	Needed for traceability and issue investigation.

4. Step 1 - Raw Assemblies to Sub Assemblies

The first production work order converts raw assembly inputs into controlled sub-assemblies for ten machines.

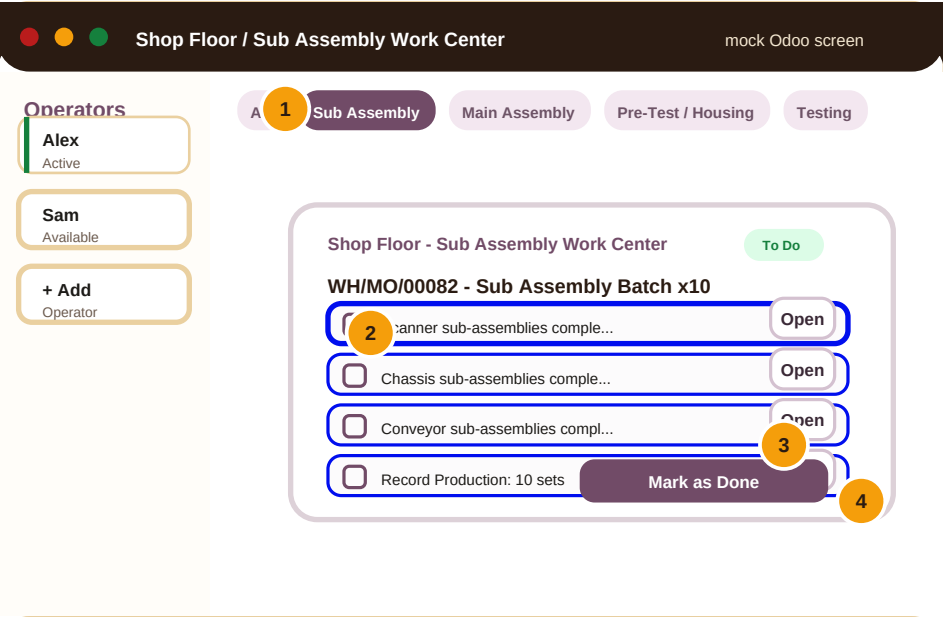

Data-entry steps

1. Open Shop Floor and select the Sub Assembly work center.
2. Find the current MO number or scan/search the reference.
3. Sign in the operator and open the work order card.
4. Complete each sub-assembly step: scanner, chassis, conveyor, and required support assemblies.
5. Add notes for deviations, missing parts, rework, or substitutions.
6. Record production for completed sub-assembly sets. Use 10 only when all ten sets are complete.
7. Use Scrap or a Quality Alert when a sub-assembly cannot continue.

Step 1 output

The expected output is ten complete, usable sub-assembly sets for the next work order.

What Step 1 records

Data item	Enter / record	Why it matters
Completed quantity	0-10 sub-assembly sets	Prevents the next step from assuming more WIP than exists.
Operator	Signed-in user	Creates ownership and traceability.
Notes	Issue / Unit / Action needed / Owner	Makes blockers visible before Step 2 starts.
Scrap/rework	Use Odoo scrap or alert process	Keeps inventory and quality records honest.

5. Step 2 - Sub Assemblies to Pre-Test Ready Assemblies

The second work order consumes approved sub-assemblies and builds them into machine assemblies ready for pre-testing and housing.

The screenshot shows the 'Shop Floor / Main Assembly' interface. On the left, there's a sidebar with 'Operators' (Alex - Active, Sam - Available, + Add Operator). The main area has a top navigation bar with tabs: 'Sub Assembly' (highlighted with a yellow circle 1), 'Main Assembly', 'Pre-Test / Housing', and 'Testing'. Below the tabs, there's a section titled 'Shop Floor - Pre-Test Ready Build' with a 'To Do' status. The main task list is titled 'WH/MO/00082 - Pre-Test Ready Assembli...'. It contains four tasks: 'Consume sub-assemblies' (highlighted with a yellow circle 2 and an 'Open' button), 'Assign / verify machine seria...' (with an 'Open' button), 'Attach wiring and module notes' (with an 'Open' button), and 'Record Production: 10 assem...' (with a 'Mark as Done' button). A yellow circle 3 is next to the 'Mark as Done' button, and a yellow circle 4 is at the bottom right of the task list.

Data-entry steps

1. Open Shop Floor -> Main Assembly.
2. Select the current ten-machine MO work order.
3. Confirm the previous Sub Assembly work order is finished or partially released with approval.
4. Consume sub-assemblies into each machine build.
5. Assign or verify machine serial numbers if your product is serial-tracked.
6. Record build notes, rework, missing items, or substitutions.
7. Register production and mark done only when assemblies are physically pre-test ready.

Step 2 output

The expected output is ten pre-test ready assemblies with traceable serial/build notes.

What Step 2 records

Data item	Enter / record	Why it matters
Consumed sub-assemblies	Actual sub-assembly sets used	Connects Step 1 output to final machine build.
Machine serials	TCG-#### or active pattern	Required for testing, service, and shipping.
Build notes	Deviation, rework, substituted parts	Gives Testing context before failures are logged.
Completed quantity	0-10 pre-test ready assemblies	Controls the Step 3 queue.

6. Step 3 - Pre-Testing, Housing, and Handoff to Testing

The third production work order confirms the machine can move into formal Testing. This is the last production-owned gate before Testing owns pass/fail documentation.

Shop Floor / Pre-Test & Housing mock Odoo screen

Operators

- Alex (Active)
- Sam (Available)
- + Add (Operator)

1 Sub Assembly Main Assembly **Pre-Test / Housing** Testing

Shop Floor - Pre-Test & Housing To Do

WH/MO/00082 - Housed / Testing-Ready ...

- 2** ☐ Bench pre-test **Open**
- ☐ Install housing **Open**
- ☐ Upload final pre-test photo **Open**
- ☐ Handoff to Testing queue **Close Production / Handoff** **3** **4**

Data-entry steps

1. Open Shop Floor -> Pre-Test / Housing.
2. Select the current MO work order.
3. Run the bench pre-test steps listed on the work order.
4. Install housing and verify that each unit is physically ready for Testing.
5. Attach final pre-test photo or required notes if configured.
6. Set the handoff status to Ready for Testing.
7. Close the work order only after Testing can take ownership.

Handoff requirement

Before handoff: serial numbers are assigned, housing is installed, pre-test is complete, photos/notes are attached, and no unresolved production blocker remains.

Store finished products / Testing queue transfer

MO / Transfers / Store Finished Products mock Odoo screen

Odoo

- Inventory
- Manufacturing
- Quality
- Transfers
- Reporting

1 **Validate** **Print** **3**

WH/MO/00082 - Finished Goods / Shipping

Source Location: **Testing Queue** Destination: **WH/Finished Goods** **2** Operation Type: **Store / FG**

Product	Demand	Done	Serials
Testing-Ready TC...	10	10	TCG-0001...0010

Release Status: Passed Done: OK Serials: No Alerts

Use the final transfer as the official queue movement.

- Source: Production / Pre-Test area.
- Destination: Testing Queue or configured finished goods/testing location.
- Product: Testing-ready TCG Machine.
- Done: actual number physically moved to Testing.
- Serials: all moved units must match physical labels.

7. Testing / Quality - Use Quality Checks

Testing should use Odoo Quality Control Points to automatically generate checks on the Testing work order. Each unit in the ten-machine batch should have clear pass/fail, measurement, picture, or worksheet evidence.

Odoo

Inventory

Manufacturing

Quality

Transfers

Reporting

Save

Discard

1

Control Point / New

Title

Testing Gate

Operations

Testi2rk Order

Control Per

Qu: 3

Type

Pass-Fail / Measure / Picture

Team

Testing

Instru4

3

Run test exactly as written. Record serial/MAC. If failure is confirmed, create Quality Alert and hold the unit.

How Testing enters data

1. Open the Testing work order or Quality Checks list for the current MO.
2. Open each generated quality check for the unit being tested.
3. Verify or enter the machine serial before testing.
4. Follow the instruction exactly and enter the result: Pass, Fail, Measure, Picture, or Worksheet.
5. If a unit fails, click Fail and create or link a Quality Alert.
6. Do not pass the check until retest evidence is completed.


Testing rule

Testing owns evidence. A machine is not released because it was built - it is released because the required checks are passed or exceptions are approved.

Recommended QCP setup

QCP field	TCG setting	Reason
Title	Short searchable test name	Examples: Visual Build Inspection, Power-On Smoke Test, Final Calibration.
Product	TCG machine or batch product	Limits checks to the correct build.
Operation	Testing work order operation	Generates checks at the Testing gate.
Control Per	Quantity	Creates one check per unit when ten machines need ten records.
Type	Pass-Fail, Measure, Picture, Worksheet	Match the evidence required by the test.
Failure Instructions	Create Quality Alert and hold unit	Prevents failed units from reaching Shipping.

8. Testing Check Library and Quality Alerts

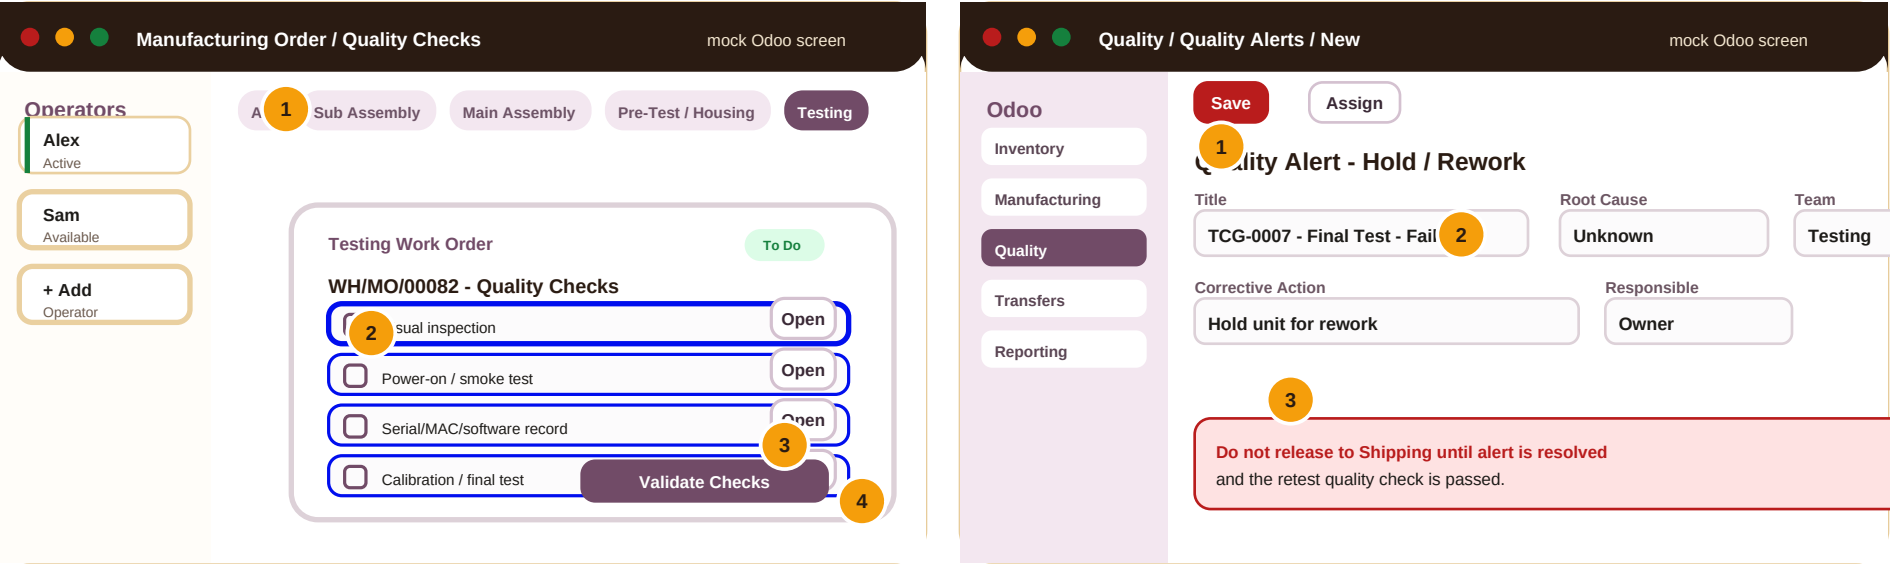

TCG testing check library

Check	Type	Required evidence
Visual build inspection	Pass-Fail + Picture	Photo of unit and note any cosmetic/build issues.
Power-on / smoke test	Pass-Fail	Pass only if boot/power indicators are expected and no smoke or abnormal behavior occurs.
Serial, MAC, and software record	Worksheet or Instructions	Record machine serial, MAC, software/firmware version, and tester name.
Calibration values	Measure	Enter numeric values with tolerances where available.
Fisheye / empty dock image evidence	Picture	Attach final image evidence when required by TCG testing standard.
Final release decision	Pass-Fail	Pass means Ready for Shipping; Fail means Quality Alert / Testing Hold.

Quality Alert rule

When a unit fails, create a Quality Alert with the serial number, failed test, observed issue, owner, and next action. The unit stays on Testing Hold until the alert is resolved and retest passes.

9. Shipping / Finished Goods Handoff

Shipping should only receive a machine that has passed required Testing quality checks or has an approved exception. The Odoo handoff should make release status visible.

Odoo

Inventory

Manufacturing

Quality

Transfers

Reporting

Validate

Print

WH/FG/00082 - Finished Goods / Shipping

Source Location

Destination

Operation Type

Testing Queue

WH/Finished Goods

Store / FG

Product	Demand	Done	Serials
Testing-Ready TC...	10	10	TCG-0001...0010
Release Status	Passed	OK	No Alerts

Data-entry steps

1. Confirm the Testing work order is complete and required quality checks passed.
2. Open the final transfer or finished goods movement for the MO.
3. Verify destination location: WH/Finished Goods, WH/Shipping, or the configured shipping queue.
4. Verify machine serials match the physical units.
5. Validate the transfer only when the physical move is complete.
6. Add a note/activity for any customer-specific shipping, documentation, or hold requirement.

Release checklist

Testing checks passed or exceptions approved; no open Quality Alert blocks release; serial numbers match physical labels; final location matches physical location.

Handoff statuses

Status phrase	Use when	Next owner
Ready for Testing	Production has completed Step 3 and moved units to Testing queue.	Testing
Testing Hold	A test failed or evidence is incomplete.	Testing / Rework owner
Ready for Shipping	All required testing checks passed or an exception was approved.	Shipping
Shipping Hold	Packaging, documentation, customer, or release issue blocks shipment.	Shipping / Admin owner

10. TCG Data Standards

Use consistent names so searches, reports, and handoffs are reliable. Odoo should match the floor, not the plan.

Field	TCG value to enter	Why it matters
Batch ID	TCG-MO-YYYYWW-##	Use in Source Document or MO note for weekly searchability.
MO quantity	Always 10 for this weekly batch process unless explicitly partial	Keeps the production pull consistent.
Machine serial	TCG-#### or active serial pattern	Links assembly, testing, service, and shipping records.
Work order note format	Issue / Unit / Action needed / Owner	Makes blockers easy to scan.
Quality failure title	[Serial] - [Test] - [Failure]	Makes alerts searchable and easy to triage.
Handoff phrase	Ready for Testing / Testing Hold / Ready for Shipping	Keeps departments using the same status language.

Global stop rule

Do not mark a work order, transfer, or quality check complete unless the physical work is actually complete. Never use Odoo to make the floor look ahead of reality.

Minimum data before each handoff

Handoff	Minimum Odoo data required
Inventory -> Step 1	WH/PC transfer validated, Done quantities match kit, lots/serials entered when required.
Step 1 -> Step 2	Sub-assembly quantity completed, notes/scrap/alerts entered, work order marked done only for actual completions.
Step 2 -> Step 3	Serials/build notes recorded, pre-test ready quantity accurate, blockers visible.
Step 3 -> Testing	Pre-test and housing complete, photo/note evidence attached if required, Ready for Testing status visible.
Testing -> Shipping	All checks passed or exceptions approved, no open Quality Alert blocks release, serials verified.

11. Screen Map - Where Each Department Clicks

Use this page as a fast visual reference during training. The screen names may be adapted to your exact Odoo labels, but the data-entry sequence should stay consistent.

Department	Odoo path	Main action	Do not validate until
Odoo Admin	Inventory -> Configuration -> Warehouses	Enable 3-step manufacturing; configure work centers and routes.	Warehouse route and test MO are reviewed.
Production Lead	Manufacturing -> Operations -> Manufacturing Orders -> New	Create ten-machine batch MO, select BoM, confirm.	Quantity, BoM, schedule, and source document are correct.
Inventory / Kitting	MO -> Transfers -> WH/PC Pick Components	Check availability, enter Done quantities, scan lots/serials, validate pick.	Physical kit has moved to Production.
Step 1	Shop Floor -> Sub Assembly	Complete scanner/chassis/conveyor sub-assemblies; record production.	The entered quantity physically exists.
Step 2	Shop Floor -> Main Assembly	Consume sub-assemblies, assign serials, record build notes.	Assemblies are physically pre-test ready.
Step 3	Shop Floor -> Pre-Test / Housing	Run pre-test, install housing, attach evidence, set Ready for Testing.	Testing can take ownership.
Testing / Quality	Quality -> Quality Checks or Testing Work Order	Record pass/fail, measures, pictures, worksheets, and alerts.	Evidence is complete and failed units are on hold.
Shipping	Transfers -> Finished Goods / Shipping	Verify serials and release status, validate final move.	Testing has released the units.

Suggested first training exercise

1. Create one training MO for TCG Machine Batch - 10 Set.
2. Walk each department through its own page in this guide.
3. Have each department enter one realistic note and one realistic blocker/alert scenario.
4. Review the final Odoo traceability from MO creation to Shipping release.
5. Update this guide with your final Odoo field labels after the first live batch.