

STAMPING PRESS STANDARD OPERATING PROCEDURE

WORK SAFE • KNOW THE HAZARDS • PROTECT YOURSELF



Safety
Footwear




Safety Glasses /
Face Shield



Hearing
Protection




No Gloves
Near Spindle

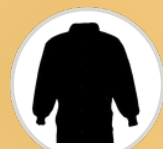


Snug Clothing /
Hair Tied Back

1 PRE-OPERATION INSPECTION

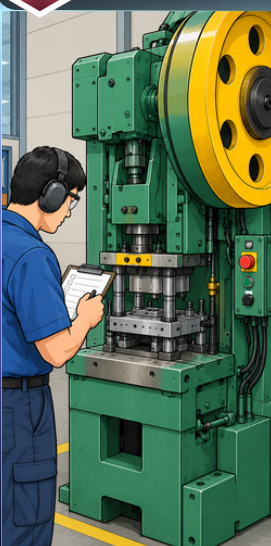

- ▼ Ensure the machine is powered off and LOTO has been removed by an authorized person.
- ▼ Check that the point-of-operation guard is installed and working properly.
- ▼ Inspect the die for damage or misalignment; confirm punch and die are secured correctly.
- ▼ Test that the clutch/brake engages, releases, and holds the slide properly.
- ▼ Verify the anti-repeat and single-stroke features work — one stroke per trip.
- ▼ Check flywheel and clutch/brake lubrication per schedule.
- ▼ Confirm the emergency stop is accessible and functional.
- ▼ Clear the work area of personnel, tools, and obstructions.

2 STARTUP

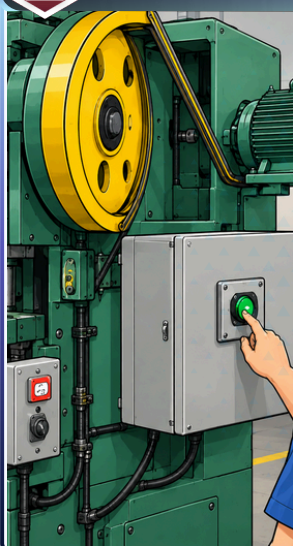


- Clear the work area of personnel and obstructions.
- Start the drive motor and allow the flywheel to reach full operating speed before engaging the clutch.
- Run one test stroke with hands clear of the die area to confirm the press cycles and stops correctly.
- Confirm the stroke control (foot pedal, two-hand trip, or hand lever) is functioning and guarded against accidental activation.

3 NORMAL OPERATION


- 1 Keep hands, tools, and loose material clear of the die at all times — never reach into the die, even briefly.
- 2 Use a push stick, feeding tongs, or mechanical feed to place and remove stock.
- 3 Trip the press only when hands are clear and the guard is in place.
- 4 Wait for a full stroke to finish before reaching toward the die — never anticipate the stroke's end.
- 5 Don't hold the foot pedal or trip control down for repeat strokes unless the press is set up and guarded for continuous operation.
- 6 Stop the press and let the flywheel fully coast to a stop before clearing jams, adjusting stock, or reaching near the die.
- 7 Inspect stamped parts per the quality plan's required frequency.

4 SHUTDOWN

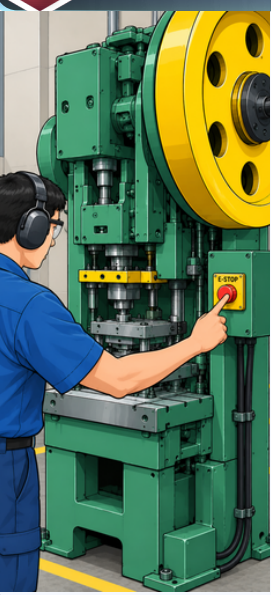

- 1 Complete the current stroke and release the trip control; do not leave the press mid-cycle.
- 2 Disengage the clutch and allow the brake to hold the slide at top of stroke.
- 3 Power off the drive motor and allow the flywheel to coast to a complete stop before leaving the machine.
- 4 Clean scrap, slugs, and debris from the die area and press bed.

5 DIE/TOOL CHANGEOVER

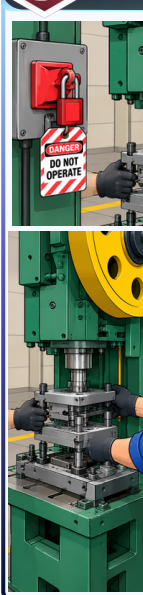

- ▼ Follow LOTO procedure — disconnect power and allow the flywheel to come to a complete stop before changing dies.
- ▼ Verify zero energy state by attempting the stroke control; confirm the press will not cycle.
- ▼ Remove the current die set, supporting it properly during removal.
- ▼ Install the new die set, ensuring punch-to-die alignment and shut height are correct per the setup sheet.
- ▼ Secure all die clamps, bolts, and stops to the manufacturer's torque specification.
- ▼ Adjust or reinstall the point-of-operation guard or safeguarding device for the new die.
- ▼ Manually bar over the flywheel — power off, using the barring hole and turnover bar — to confirm clearance through a full cycle.
- ▼ Remove the lock/tag, re-energize the press, and run a single test stroke before resuming production.

KEY SAFE REMINDERS

Keep hands out of the die area.

Use proper feeding tools.

Keep guards in place.

Complete the full stroke.

Wait for the flywheel to stop.

Follow LOTO before die changes.



EMERGENCY:

PRESS E-STOP • KEEP HANDS OUT • WAIT FOR COMPLETE STOP • FOLLOW LOTO • NOTIFY SUPERVISOR