Statistical Quality Control with the qcr Package

Seems that the reference/bib did not Knit successfully. They are printed as

by Miguel Flores, Rubén Fernández-Casal, Salvador Naya, Javier Tarrío-Saavedra

Abstract The R package qcr for Statistical Quality Control (SQC) is introduced and described. It includes a comprehensive set of univariate and multivariate SQC tools that completes and increases the SQC techniques available in R. Apart from integrating different R packages devoted to SQC (qcc, MSQC), qcr provides nonparametric tools that are highly useful when Gaussian assumption is not met. This package computes standard univariate control charts for individual measurements, EWMA and CUSUM. In addition, it includes functions to perform multivariate control charts such as Hotelling T², MEWMA and MCUSUM. As representative feature, multivariate nonparametric alternatives based on data depth are implemented in this package. The qcr library also estimates the most complete set of capability indices from first to fourth generation, covering the nonparametric alternatives, and performing the corresponding capability analysis graphical outputs, including the process capability plots. Moreover, Phase I and II control charts for functional data are included.

Introduction

Throughout the last decades, there has been an increasing interest to measure, improve, and control the quality of products, services, and procedures. This is connected to the strong relationship between quality, productivity, prestige, trust, and brand image. In fact, implementing procedures of statistical quality control (SQC) are currently related to increasing companies' competitiveness.

The concept of quality control has been extended from the first definitions based on the idea of adjusting production, to a standard model to satisfy customer requirements and include all participants. Nowadays, SQC is not only applied to manufactured products but to all industrial and service processes.

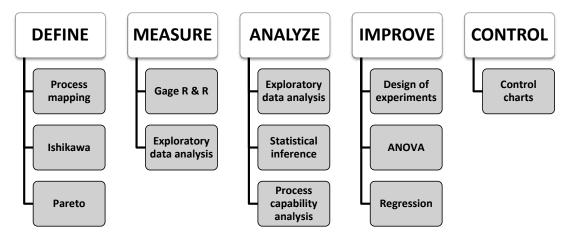


Figure 1: Statistical tools applied in each steps of the Six Sigma methodology.

The use of different SQC techniques were standarized With the development of the Six Sigma method by Motorola in 1997 (?). Six Sigma is a methodology or even philosophy focused on the variability reduction that promotes the use of statistical methods and tools in order to improve processes in industry and services. The Six Sigma application is composed by five stages: Define, Measure, Analyze, Improve, and Control (DEMAIC). The Figure 1 shows some representative statistical techniques applied in each of the Six Sigma stages. The two most representative statistical tools of SQC are the control charts and the process capability analysis (?). Therefore, the proposed qcr package has been developed in order to provide users a comprehensive and free set of programming tools to apply control charts and perform capability analysis in the SQC framework.

The control stage is characterized by the use of tools based on anomaly detection and correction (?). The most representative techniques of this stage and the primary tool of the Statistical Process Control (SPC) are the control charts (?). They have been developed to evaluate the process performance and at any time. The use of control charts prevents the process getting out of control and helping to detect the assignable causes corresponding to variations of the critical-to-quality

features (CTQs), thus performing process changes when actually required. Furthermore, control charts provide estimates of the natural range of process variation (natural control limits), allowing us to compare this range with those limits specified by standards, company managers or customers (specification limits). Hence, the process monitoring can be carried out by comparing each new observation with these natural limits, preventing defects in the final product. Briefly, a control chart is a two dimensional graph whose axis represents the variable or attribute that is being monitored (CTQ variables). The estimation of natural control limits of the CTQ variables is developed by a process composed of two phases: In Phase I, the natural control limits are estimated using a preliminary sample (calibration sample) where we assume that the causes of variation are only random. In Phase II, each new observation is plotted on the control chart along with the natural limits obtained in the previous step. The set of new observations (twhich are not used to calculate the natural control limits) make up the so-called monitoring sample. Patterns, observations of out of control limits, runs of more than six observations on one side of the central line, among others, are some of the different criteria to identify out of control states in a specific process, providing also valuable information about the detection of any assignable causes of variation in the monitoring.

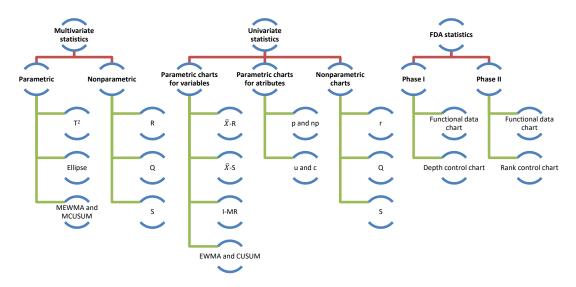


Figure 2: Control charts implemented in the qcr package.

The most used control charts are based on the assumptions of normality and independence of the studied CTQ variables. These charts are used to control position and dispersion of CTQ attributes and variables. Figure 2 shows some of the most important types of control charts. These can be classified according to the type of feature that is being controlled (attribute or variable), the variable dimension (univariate or multivariate), and assuming or not a parametric distribution of the variable (parametric or nonparametric). The qcr package provides charts for the mean (\bar{x}) , standard deviation (s), range (R), individual measurements (I), moving ranges (MR), proportion of nonconforming units (p), number of nonconforming units (np), number of defects per unit (c), mean number of defects per control unit (u), exponentially weighted moving average (EWMA), and cumulative sum control chart (CUSUM). The last two techniques are also called memory control charts and they are the specially designed to detect shifts of less than two standard deviations, both when using rational samples or individual measurements. On the other hand, new control charts based on the concept of data depth and developed by? are implemented in qcr. Those are the r, Q_{\uparrow} and S control charts, the nonparametric alternatives for individual measurements, mean control chart, and CUSUM control chart, respectively. When more than one variable defines the process $\frac{1}{2}$ quality, multivariate control charts are applied. If the Gaussian assumption is met, Hotelling T^2 control chart can be applied. If we want to detect small deviations, multivariate EWMA (MEWMA) and multivariate CUSUM (MCUSUM) can be implemented. When no parametric distribution is assumed, r, Q_{Λ} and S charts can be used.

Another interesting SQC tool, which is very useful in industry, is the Process Capability Analysis (PCA). It estimates how well a process meets the tolerances defined by the company, customers, standards, etc., by comparing the specification tolerances with respect to the natural range of variation of CTQ features. The process capability is measured using capability indicators, Process Capability Ratio (PCR) is a numerical score that helps the manufacturers know whether the output of a process meets the engineering specifications. Large PCR values show that the industrial or service process is capable of meeting the customer requirements. There have been many different

PCRs developed in the last four decades that require the Gaussian assumption for the CTQ variable PCRs developed in the last four decades that require the Gaussian assumption for the CTQ variable PCR that many processes in industry and real applications do not meet this hypothesis, we could introduce the capability using PCR then many authors have studied different nonparametric alternatives to traditional PCR (?).

The qcr package has been developed in R ? under the GNU license. Nowadays, there are other R packages that currently provide quality control tools for users. The use of each one is shown in Figure 3.

The qcc package ?? was developed by Professor Luca Scrucca of the Department of Economics, Finance, and Statistics at the University of Perugia. It enables us to perform Shewhart quality control charts for variables and attributes, as well as the CUSUM and EWMA charts for detecting small changes in the CTQ variable. Multivariate analysis is performed applying the Hotelling T² control chart. Additionally, it has functions implemented to obtain the operating characteristic curves (OC) and to estimate process capability analysis indices. Pareto and Ishikawa diagrams are also implemented. Otherwise, the IQCC package (?) is maintained by Professor Emanuel P. Barbosa of the Institute of Mathematics in the State University of Campinas. It has a smaller number of control charts implemented, but it incorporates multivariate graphics. The qualityTools package ?? was developed to aid learning in quality sciences. The Figure 3 shows some of its utilities, e.g., capability analysis (providing a comprehensive set of parametric distributions) and design of experiments. In addition, the SixSigma library (??) provides alternative functions to qualityTools and qcc packages, and the possibility of implementing process maps.

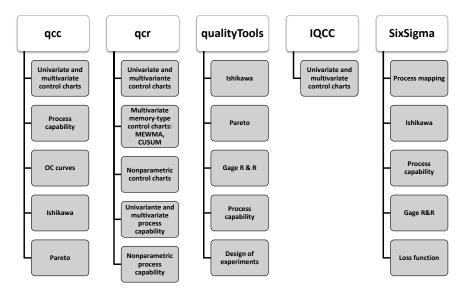


Figure 3: Comparison between the main packages in R devoted to Statistical Quality Control and the qcr package.

Furthermore, there are other libraries specifically focused on control chart applications. Namely, the speadjust ? that allows us to estimate the calibration control limits of Shewhart, CUSUM, and EWMA control charts, and the spc ? which provides tools for the evaluation of EWMA, CUSUM, and Shiryaev-Roberts control charts by using Average Run Length and RL quantiles criteria. Moreover, the MSQC package ? is a set of tools for multivariate process control, mainly control charts. It contains the main alternatives for multivariate control charts such as Hotelling (T²), Chi squared, MEWMA, MCUSUM and Generalized Variance control charts. It also includes some tools to evaluate the multivariate normal assumption. The corresponding multivariate capability analysis can be performed using the MPCI library ? that provides different multivariate capability indices. It is also interesting to mention the edcc package ? for its economic design of control charts by minimizing the expected cost per hour of the studied process.

It is important to emphasize that the qcr package also includes new applications such as nonparametric approaches of control charts and capability indices (also covering the capability plots), which are currently unavailable in the R software.

Datasets in the qcr package

The qcr package contains new databases (see table 1) based on study cases tackled by the authors during their professional activity as well as well-known datasets implemented on other packages focused on statistical quality control such as:

- archery1: It consists of a stage in which the archer shoots 72 arrows. The information is given in x and y coordinates. It is implemented in the MSQC package (?).
- circuit: Number of nonconformities observed in 26 successive samples of 100 printed circuit boards. It is implemented in the qcc package ?.
- dowel1: Diameter and length of a dowel pin. It is implemented in the MSQC package (?).
- orangejuice: Frozen concentrated orange juice is packed in 6-oz cartons. These cartons are formed on a machine by spinning them from a cardboard stock and attaching a metal bottom panel. A can is then inspected to determine whether, when filled, the liquid could possibly leak either on the side seam or around the bottom joint. If this occurs a can is considered nonconforming. The data were collected as 30 samples of 50 cans each at half-hour intervals over a three-shift period in which the machine was in continuous operation. It is implemented in the qcc package ?.
- pcmanufact: A personal computer manufacturer counts the number of nonconformities per unit on the final assembly line. He collects data on 20 samples of 5 computers each. It is implemented in the qcc package ?.
- **pistonrings:** Piston rings for an automotive engine are produced by a forging process. The inside diameter of the rings manufactured by the process is measured on 25 samples, each of size 5, drawn from a process being considered 'in control'. It is implemented in the **qcc** package ?.

Univariate and multivariate parametric control charts in qcr

The construction of a control chart is equivalent to the plotting of the acceptance regions of a sequence of hypothesis tests over time. Namely, the \bar{x} chart is a control chart used to monitor the process mean μ . It plots the sample means, \bar{X} 's, corresponding to subgroups of the $\{X_1, X_2, ...\}$ observations and is equivalent to test the hypotheses $H_0: \mu = \mu_0$ versus $H_\alpha: \mu \neq \mu_0$ (for some target value μ_0) conducted over time, using \bar{x} as the test statistic. Here we assume that $\{X_1, X_2, ...\}$ are the sample measurements of a particular CTQ feature that follows the F distribution with mean μ and standard deviation σ . When there is insufficient evidence to reject H_0 , we can state that the process is under control; otherwise, the process is out of control. In other words, processes are under control when their sources of variation are only the sources common to the process \P . The decision to reject or not H_0 is based on the value of the sample mean \bar{x} observed at each time interval \P . The control charts are easy to construct, visualize, and interpret, and most important, have proven their effectiveness in practice since the 1920 s.

Control charts are defined, on the one hand, by a center line that represents the average value of the the CTQ feature corresponding to the in-control state and, on the other hand, two horizontal lines, called the upper control limit (UCL) and the lower control limit (LCL). The region between the control limits corresponds to the region where H_0 is not rejected (defined in the previous section). As a consequence, the process will be out of control when an observed rational sample or an individual measurement falls outside the limits. Let w be a sample statistic that measures a quality characteristic of interest, and suppose that the mean of w is μ_w and the standard deviation of w is σ_w . Then the center line, the upper control limit, and the lower control limit become:

$$UCL = \mu_w + L\sigma_w$$

$$CL = \mu_w$$

$$LCL = \mu_w - L\sigma_w$$

lower case

Where L is the "distance" of the control limits from the center line, expressed in standard deviation

When several random variables characterize the quality of a process/service, applying statistical multivariate quality control technique becomes necessary. In fact, if we analyze each variable separately, the probability that an observation of a variable will fall within the calculated limits when it is known that the process is actually under control, will no longer be 0.9973 for 6σ amplitude.

Name	Description		
counters	A water supply company wants to control the performance of the water		
	counters installed throughout a city. For this purpose, 60 rational		
	samples have been taken, each one composed by 3 measurements, from		
	the same age (10 years) and caliber water counters corresponding to		
	two different brands, and during a period of 5 years. This dataset		
	is based on a study case of A Coruña's water supply company,		
	Empresa Municipal de Aguas de La Coruña (Emalcsa).		
employment	A Spaniard-Argentinian hotel company wants to control the level of		
	occupancy (measured in $\%$) in their establishments through the		
	application of a continuous control. For this purpose, 48 subsamples have		
	been taken from six hotels corresponding to two different countries.		
oxidation	This database contains information about the resistance against the		
	oxidation of olive oil of the Picual variety. Five measurements of the		
	Onset Oxidation Temperature (OOT, index that measures the		
	resistance against the oxidation) are obtained from 50 batches of Picual		
	olive oil produced in chronological order. It is important to note		
	that OOT decreases as the oil is progressively mixed with other		
	olive oil varieties defined by a lower OOT.		
	A chemical company is developing a patent for a new variant of artificial		
plates	stone mostly made of quartz (93wt% and polyester resin). This company		
	is launching a pilot plant where it begins to produce plates of this		
	material to industry scale. The CTQ variable of this product is the		
	Vickers hardness. In order to measure the hardness level and hardness		
	homogeneity of the product, 50 plates have been measured 5 times in		
	different sections. The characteristic learning curves, through gradual		
	level change, can be observed.		
presion	A shippard of recreational boats is intended to optimize and control the		
	mechanical properties of the yacht hulls made of a composite based on		
	epoxy resin. At this regard, the modulus of elasticity due to tensile		
	efforts is measured after applying two different curing pressures: 0.1		
	and 10 MPa. Overall, 60 subsamples, composed of three measurements,		
	obtained from 60 vessels, have been taken.		

Table 1: Some of the specific datasets included in the qcr package

Assuming independence, it will be 0.9973^p , where p is the number of CTQ features, while the probability of type I will actually lead to $\alpha'=1-(1-\alpha)^p$. Therefore, the control limits are different from those drawn assuming the control of each CTQ variable independently from the others. Moreover, if the variables are dependent, the calculation of α becomes more complex. This subject is particularly important today, as automatic inspection procedures make it customary to measure many parameters of each product over time. The more common multivariate parametric control charts are the Hotelling T² (to identify big shifts) and the multivariate CUSUM (MCUSUM) and EWMA (MEWMA) for identifying small shifts.

The functions that compute the quality control statistics for the different univariate control charts (involving continuous, attribute or count data) are shown in Table 2. For the sake of simplicity, and taking into account that these types of control charts are implemented in other packages, the use of these functions is not shown in this work. More details are given in the help of qcr package ?.

Nonparametric control charts based on data depth

The control charts presented in this section were proposed by? as an alternative to those described in previous section. The main idea of its control graphs is to reduce each multivariate measure to a univariate index, that is, its relative center-exterior classification induced by a depth of data. This approach is completely nonparametric, therefore, these control charts are not defined by any parametric assumption regarding the process model. Thus, they are applicable in a wider number of case studies than those counterparts such as T^2 , MSUSUM, and MEWMA control charts. In addition, these graphs allow the simultaneous detection of the change of location (shift of the mean)

		Statistical quality control charts for		
Function	Chart name	Variables		
qcs.xbar	$ar{X}$	Sample means of a continuous process variable are plotted to control the process average.		
qcs.R	R	Sample ranges of a continuous process variable are plotted to control the process variability.		
qcs.S	S	Sample standard deviations of a continuous variable are plotted to control the process variability.		
qcs.one	I	Sample values from a I chart data of a continuous process variable to control the level (position) of the process.		
		Attributes		
qcs.p	p	Proportion of nonconforming units is plotted, the number of defective items follow a binomial distribution.		
qcs.np	np	Number of nonconforming units is plotted, and the chart is constructed based on the average of the process.		
qcs.c	c	Nonconformities per unit are plotted, number of defects in a large population follow a Poisson distribution.		
qcs.u	u	Average nonconformities per unit are plotted, this chart does not require a constant number of units.		
qcs.g	g	Number of non-events between events are plotted, it counts the number of events between rarely-occurring errors or nonconforming incidents. Attributes and variables		
		Cumulative sums for individual observations or for the		
qcs.cusum	CUSUM	averages of rational subgroups are plotted to monitor the process mean.		
qcs.ewma	EWMA	The exponential weighed average of CTQ variables are plotted to identify small changes in the process (measured as rational samples or individual observations). Multivariate control charts		
mqcs.t2	T^2	Multivariante Hotelling T ² control chart for individual observations (vectors).		
mqcs.mcusum	MCUSUM	Multivariate Cumulative Sum control chart for individual observations (vectors).		
mqcs.ewma	MEWMA	Multivariate EWMA control chart for individual observations (vectors).		
		Functional data control charts Phase Leastrol chart for functional data:		
fdqcs.depth	Phase I	Phase I control chart for functional data: depth control chart and deepest curves envelope.		
fdqcs.rank	Phase II	Phase II control chart for functional data: rank control chart and deepest curves envelope.		
plot.fdqcs	FDA plots	Graphical outputs for Phase I and Phase II control charts for functional data.		

Table 2: Univariate Shewhart, multivariate Hotelling T^2 , univariate and multivariate CUSUM and EWMA and FDA control charts available in the qcr package

and the increase of the scale (change in variability) in a process.

Liu proposed and justified three types of control charts, the r, Q, and S charts which can be considered as data-depth-based multivariate generalizations of the univariate X, \bar{x} , and CUSUM charts, respectively.

Data depth

In multivariate analysis, the term depth refers to the degree of centrality of a point regarding to a data cloud or a probability distribution. Therefore, it is possible to define a rank in the multidimensional Euclidean space through the calculation of observation depth. According to? and

? the depth function can be defined as a bounded function $D_p: \mathbb{R}^d \longrightarrow \mathbb{R}$, with P the distribution set in \mathbb{R}^d , that assigns at each point of \mathbb{R}^d its degree of centrality with respect to P. Depth functions with which control charts can be performed are the

- Simplicial depth (?),
- Mahalanobis depth (?),
- Halfspace or Tukey depth (?),
- Likelihood depth (?), and
- Random projection depth (?).

Statistics derived from data depth

Let G a k-dimensional distribution, and let Y_1,\ldots,Y_m be m random observations from G. The sample Y_1,\ldots,Y_m is generally the reference sample of a CTQ variable in the context of quality control, composed of measurements from products obtained by an under control process. If X_1,X_2,\ldots are the new observations from the manufacturing process, assuming that the different X_i values follow an F distribution if the quality of the studied product has been deteriorated or, in other words, if the process is out of control. Otherwise they follow a G distribution. Let $D_G(\cdot)$ denote a notion of depth, and assume that G and F are two continuous distributions. Thus, if all the $D_G(Y_i)$ values are sorted in increasing order, and $Y_{[j]}$ denotes the sample value associated with the jth smallest depth value, then $Y_{[1]},\ldots,Y_{[m]}$ are the order statistics of Y_i 's, with $Y_{[m]}$ being the most central point. Therefore, the smaller the order (or the rank) of a point, the farther that point will be from the underlying distribution $G(\cdot)$.

(?) defines the rank statistic as

whereby $Y \sim G$ indicates that the random variable Y follows the distribution G. When G is unknown, the empirical distribution G_m of the sample $\{Y_1, \ldots, Y_m\}$ can be used instead, and the statistic is defined by

$$r_{G_m}\left(y\right) = \frac{\#\left\{D_{G_m}\left(Y_j\right) \leq D_{G_m}\left(y\right), j = 1, \dots, m\right\}}{m}$$

In the same way that r_G and r_{G_m} , the Q statistics can be also defined as follows

$$Q\left(G,F\right) = P\left\{D_{G}\left(Y\right) \leq D_{G}\left(X\right) \mid Y \sim G, X \sim F\right\} = E_{F}\left[r_{G}\left(X\right)\right]$$

$$Q\left(G,F_{n}\right) = \frac{1}{n} \sum_{i=1}^{n} r_{G}\left(X_{i}\right)$$

$$Q\left(G_{m},F_{n}\right) = \frac{1}{n} \sum_{i=1}^{n} r_{G_{m}}\left(X_{i}\right)$$

whereby $F_n(\cdot)$ denotes the empirical distribution of the sample $\{X_1, \ldots, X_n\}$. The control charts corresponding to these statistics can be developed as described in the following sections.

The r chart

Calculate $\{r_G\left(X_1\right), r_G\left(X_2\right), \dots, r_G\left(X_n\right)\}$ or $\{r_{G_m}\left(X_1\right), r_{G_m}\left(X_2\right), \dots, r_{G_m}\left(X_n\right)\}$ if G is unknown but Y_1, \dots, Y_m are available. As a result, the r chart consists of plotting the rank statistic in regard to time. The control chart central line is $\mathrm{CL} = 0.5$, whereas the lower limit is $\mathrm{LCL} = \alpha$, with α accounting for the false alarm rate. The process will be out of control if $r_G(\cdot)$ falls under LCL. A small value of the rank statistic $r_{Gm}(X)$ means that only a very small proportion of Y_i values are more outlying than X. Therefore, assuming that $X \sim F$, then a small value of $r_{Gm}(X)$ suggests a possible deviation from G to F. This may be due to a shifting in the location and/or an increase in the scale of the studied CTQ variable. Taking into account that the UCL is not defined for the r chart, the CL line serves as a reference to identify emerging patterns, runs or trends. If $r_{Gm}(X)$ is greater than 0.5, there is an evidence of scale decreasing, and also could take place a negligible location shift. This case should be tackled as an improvement in quality given a gain in accuracy, and thus the process should not considered as out of control.

The Q chart

The idea behind the Q chart is similar to the one behind the \bar{x} chart. If X_1, X_2, \ldots are univariate and G is a normal distribution, the \bar{x} chart plots the averages of consecutive subsets of the (e)? different X_i . A goal of this type of chart is that it can prevent the identification of false alarm when the process is actually in control (even when some individual sample points fall out of control limits due to random fluctuations).

The Q chart is the nonparametric alternative to \sqrt{x} chart. It is performed by plotting the averages of consecutive subsets of size n corresponding to the rank statistic $(r_G(X_i))$ or $r_{Gm}(X_i)$, given by $Q\left(G,F_n^j\right)$ or $Q\left(G_m,F_n^j\right)$, whereas F_n^j is the empirical distribution of the X_i 's in the jth subset, $j=1,2,\ldots$ Accordingly, if only $\{Y_1,Y_2,\ldots,Y_m\}$ are available, the Q chart plots the sequence $\left\{Q\left(G_m,F_n^j\right),Q\left(G_m,F_n^j\right),\ldots\right\}$. Depending on the value of n, the corresponding control limits are as follows \bigcirc :

• If
$$n \geq 5$$
, $CL = 0.5$ and

$$-LCL = 0.5 - Z_{\alpha} \left(12n\right)^{\frac{1}{2}} \text{ for } Q\left(G, F_n^j\right).$$

$$-LCL = 0.5 - Z_{\alpha} \sqrt{\frac{1}{12} \left(\frac{1}{m} + \frac{1}{n}\right)} \text{ for } Q\left(G_m, F_n^j\right).$$

• If
$$n < 5$$
, $CL = 0.5$ and $LCL = \frac{(n!\alpha)^{\frac{1}{n}}}{n}$.

The S control chart

The S control chart is based on the CUSUM univariate control chart, which is basically the plot of $\sum_{i=1}^{n} (X-\mu)_{0}$ which reflects the pattern of the total deviation from the expected value. As mentioned above, it is more effective than the X chart or the \bar{x} chart in detecting small process changes. The nonparametric CUSUM chart based on data depth suggests plotting $S_n(G)$ and $S_n(G_m)$, defined by

$$S_n\left(G\right) = \sum_{i=1}^n \left(r_G\left(X_i\right) - \frac{1}{2}\right)$$

with control limits CL = 0 and $LCL = -Z_{\alpha} \left(\frac{n}{12}\right)^{\frac{1}{2}}$ and

$$S_n\left(G_m\right) = \sum_{i=1}^n \left(r_{G_m}\left(X_i\right) - \frac{1}{2}\right)$$

And, If only $Y_1, ..., Y_m$ are available, the control limits are CL = 0 and $LCL = -Z_{\alpha} \sqrt{n^2 \frac{\left(\frac{1}{m} + \frac{1}{n}\right)}{12}}$. The LCL control limits in both cases constitute a curve instead of a straight line; if n is large, the control chart S should be standardized as follows C

$$S_n^*\left(G\right) = \frac{S_n^*\left(G\right)}{\sqrt{\frac{n}{12}}}$$

$$S_n^*\left(G_m\right) = \frac{S_n\left(G_m\right)}{\sqrt{n^2 \frac{\left(\frac{1}{m} + \frac{1}{n}\right)}{12}}}$$

Therefore, this S^* chart is defined by CL = 0 and $LCL = -Z_{\alpha}$.

Examples of r, Q and S control charts applied using synthetic data

A bivariate data set is used to illustrate how the previously discussed control charts arise. In fact, a synthetic dataset composed of 540 observations of a bidimensional standard Gaussian variable has been simulated, in addition to 40 individuals corresponding to another bidimensional Gaussian variable with mean and standard deviation equal to 2.

```
R> S <- matrix(c(4, 0, 0, 4), nrow = 2)
R> x <- rmvnorm(40, mean = u, sigma = S)
```

Prior to the application of nonparametric control charts, the dataset has to be converted into an npqcsd object. The synthetic dataset is arranged as two matrices, G composed of the 500 first rows (multivariate observations) of Y, and X with the remaining ones and including those belonging to the second bidimensional variable

```
R> x <- rbind(Y[501:540, ], x)
R> G <- Y[1:500, ]
R> data.npqcd <- npqcd(x, G)</pre>
```

In the same way, the npqcd function creates a data object for non parametric quality control, the npqcs.r(), npqcs.Q(), and npqcs.S() functions computes all the statistics required to obtain the r,Q, and S control charts, respectively. The argument method = c("Tukey", "Liu", "Mahalanobis", "RP", "LD") specify the data depth function, and s alpha is the signification level that defines the LCL. See to obtain additional information about these functions and their arguments.

r chart

The r control chart can be obtained by applying the npqcs.r() function to the npqcd object and plotting the result \bigcirc

```
R> res.npqcs <- npqcs.r(data.npqcd, method = "Tukey", alpha = 0.025)
R> plot(res.npqcs, title = " r Control Chart")
```

The resulting chart is shown in Figure 4, where it can be observed that the process is out of control from the 42nd observation, as expected, taking into account that most of the $r_{Gm}(X_i)$ values are falling below the LCL.

r Control Chart

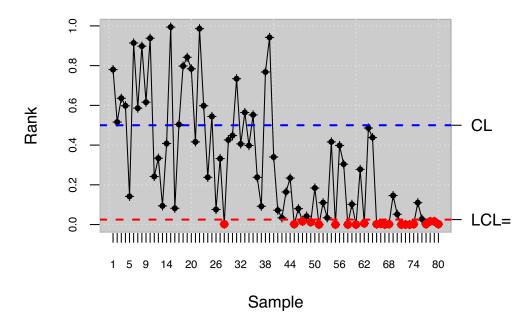


Figure 4: r control chart.

Q chart

In this case, the dataset is assumed to be composed of rational samples of size 4_{10} thus, the Q nonparametric alternative of \bar{x} chart is proposed and applied to control the bidimensional process \hat{c} .

Figure 5 clearly shows that the process is out of control in the second half, from the 20th rational sample. We can also see that the high random fluctuations of the r chart are attenuated in the Q chart due to the averaging effect.

Q Control Chart

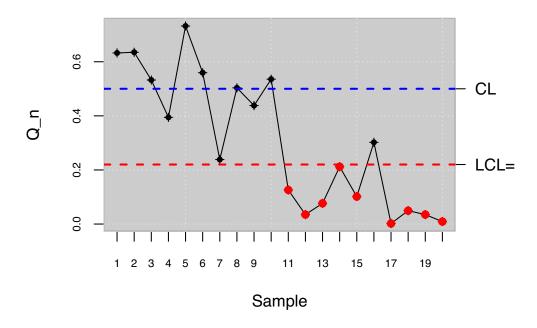


Figure 5: Q control chart.

S chart

Finally, the nonparametric counterpart of CUSUM control chart is performed from the multivariate individual observations \odot

```
R> data.npqcd <- npqcd(x, G)
R> res.npqcs <- npqcs.S(data.npqcd, method = "Tukey", alpha = 0.05)
R> plot(res.npqcs, title = "S Control Chart")
```

Figure 6 shows that the process is out of control from the 48th observation. Note that the S graph performs better in identifying small changes in a process. In this case, the performance of Q chart is better than the corresponding to the S chart.

Control charts for functional data based on data depth

In the paradigm of Industry 4.0, processes and services are many times described by continuously monitored data of hourly, daily, monthly curves or smooth functions. When the processes are defined by functional data, the authors encourage to apply control charts based on Functional Data Analysis

S Control Chart

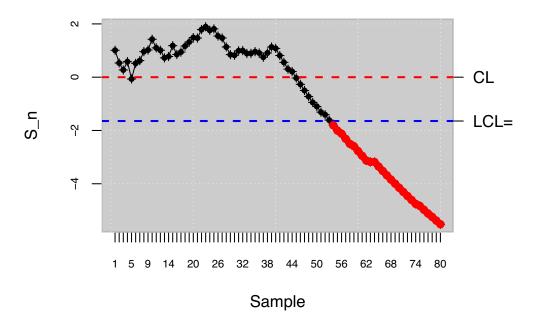


Figure 6: S control chart.

(FDA) in order to implement control and improvement tasks. In this section, the use of the control charts presented in Flores et al. (?). Summarizing, this methodology consists the proposal of new Phase I and Phase II control charts to be applied in those case study in which the datum unit is a curve. Phase I control chart is based on the computation of functional data depth (specifically Fraiman and Muniz (?), Mode (?), and random projections (?) data depth) from which a data depth control chart is developed. Once the incontrol calibration sample is obtained, the Phase II control chart based on functional data depth and rank nonparametric control chart can be applied. In addition to the Phase I functional data depth and Phase II rank control charts, plots of functional envelopes from the original curves are provided in order to help to identify the possible assignable causes of out of control states.


Estimating a Phase I control chart for functional data (calibration)

A dataset is simulated in order to illustrate the use of FDA control charts for Phase I and II. A functional mean, mu_0 , and a functional standard deviation, sigma, are defined as shown in ?. A $n_0 = 100$ hundred curves composed of m = 30 points are simulated. They account for the calibration or retrospective sample.

```
R> library(fda.usc)
R> m <- 30
R> tt<-seq(0,1,len=m)
# H0
R> mu_0<-30 * tt * (1 - tt)^(3/2)
R> n0 <- 100
R> mdata<-matrix(NA,ncol=m,nrow=n0)
R> sigma <- exp(-3*as.matrix(dist(tt))/0.9)
R> for (i in 1:n0) mdata[i,]<- mu_0+0.5*mvrnorm(mu = mu_0,Sigma = sigma )</pre>
```

Prior the application of control charts, the dataset is converted in a specific format by the fdqcd function. A plot function is also programed to properly show the original functional data, plot.fdqcd. Figure 7 shows the original functional data consisting on curves.

```
R> fdchart <- fdqcd(mdata)
R> plot(fdchart,type="l",col="gray",main="Functional data")
```



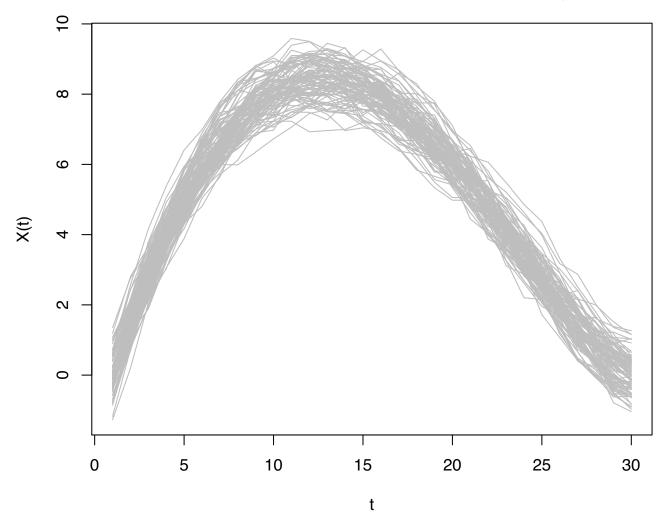


Figure 7: Original curves that account for the calibration sample.

The following step is to identify those curves that account for the inecontrol process. This task is done by the application of a Phase I control chart for functional data. This method is implemented in the qcr package by the fdqcs.depth function. Specifically, the arguments and default values for this functions are these

where func.depth is the type of depth measure, by default depth.mode, nb the number of bootstrap resamples, type accounts for the method used to trim the data, trim or pond (?), ns is the quantile to determine the cutoff from the bootstrap procedure (?), plot a logical value indicating that it should be plotted, trim the percentage of the trimming, smo the smoothing parameter for the bootstrap resampling (?), whereas draw.control specifies the col, lty, and lwd for the fdataobj, statistic, IN and OUT objects. When the fdqcs.depth function is applied to the curves of calibration sample, the fddep object of fdqcs.depth class is obtained. It is composed by the original data, the depth corresponding to each curve, the lower control limit of the depth chart, the index of those curves out of control, the curves that accounts for the limits of the envelope composed by the deepest curve, and the deepest curve or functional median.

```
R> fddep <- fdqcs.depth(fdchart)</pre>
```

```
R> summary(fddep)
```

```
Length Class Mode
fdata 100
             fdata list
Depth 100
             -none- numeric
LCL
        1
             -none- numeric
out
             -none- numeric
        1
fmin
             fdata list
fmax
             fdata
                    list
             fdata
                    list
fmed
             -none- numeric
R> class(fddep)
[1] "fdqcs.depth"
R> plot(fddep,title.fdata = "FDA chart",title.depth = "Depth chart")
R> out <- fddep$out; out
[1] 29
```

Figure 8 shows the control chart for the depth of the curves (right panel). The LCL is estimated by a smoothed bootstrap procedure (?). In order to provide a tool to identify the assignable cause of each out of control curve, the original curves with the envelope with the 99% of the deepest curves are also shown (left panel). The analysis of the shape and magnitude of the curves in and out of bounds can help to associate each curve out of control to an assignable cause, allowing for processes control, maintenance, and improvement.

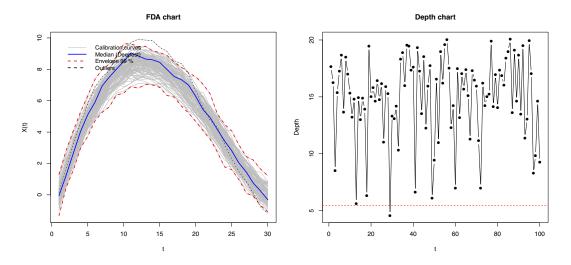


Figure 8: Left panel: Original curves with the envelope composed of the 90% of the deepest curves. Right panel: Control chart for the depths of the curves (the LCL has been estimated by bootstrap procedures at a signification level of 10%.

The Phase I ends when a calibration sample without curves out of control is obtained. The iterative procedure to obtain an in control calibration sample in shown in the following lines.

```
R> alpha <- 0.1
R> trim <- 0.1
R> while (length(out)>0) {
R> mdata <- fddep$fdata$data[-out,]
R> fddep <- fdqcs.depth(mdata,ns = alpha, trim=trim, plot=FALSE)
R> out <- fddep$out
R> }
R> plot(fddep,title.fdata = "Envelope with the 90\% deepest curves", + title.depth = "Depth control chart")
```

Figure 9 is obtained from the application of plot function to fddep object. It shows that all the curves of the calibration sample are in control, thus, the natural variability of the process is estimated.

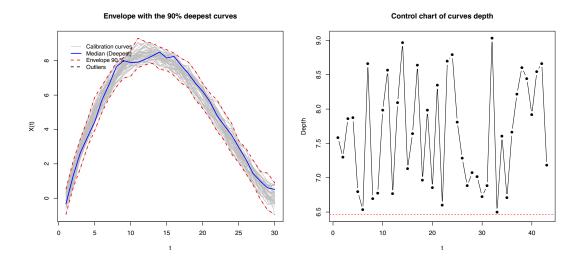


Figure 9: Results corresponding to the second iteration to obtain the in control calibration sample. Left panel: Original curves with the envelope composed of the 90% of the deepest curves. Right panel: Control chart for the depths of the curves (the LCL has been estimated by bootstrap procedures at a signification level of 10%.

Estimating a Phase II control chart for functional data (monitoring)

The next step is to perform the Phase II of process control. The monitoring phase is performed by the application of Phase II control charts for functional data based on multivariate nonparametric control charts. Firstly, a monitoring sample composed by 50 curves is simulated by the following code.

```
R> mu_a<- 30 * tt^(3/2) * (1 - tt)
R> n_a <- 50
R> mdata_a<-matrix(NA,ncol=m,nrow=n_a)
R> for (i in 1:n_a) mdata_a[i,]<- mu_a+0.5*mvrnorm(mu = mu_a,Sigma = sigma )</pre>
```

The curves of the monitoring sample are defined with fdqcd format and a control chart for Phase II is developed by applying the fdqcs.rank function. It is composed by the following arguments, fdqcs.rank(x,y = x,func.depth = depth.FM,alpha = 0.01,plot = TRUE,trim = 0.1,draw.control = NULL,...).

```
R> fdchart_a <- fdqcd(mdata_a, "Monitoring curves")
R> phase2.chart <- fdqcs.rank(fdchart,fdchart_a)
R> plot(phase2.chart)
R> summary(phase2.chart)
```

Figure 10 accounts for the FDA chart with the calibration sample and its envelope composed by the deepest curves. Moreover, the monitoring sample is also included and compared with the calibration sample by using the FDA chart. In addition, the Phase II rank control chart for functional data is shown including both calibration and monitoring samples or only the ranks corresponding to the monitoring sample. The second population that corresponds with the monitoring sample is identified by the control chart from the first monitored curve (panels below in Figure 10).

Process capability analysis

The analysis of the capability of a process in the case of statistical quality control is done through the calculation of the socialed capability. These indices measure whether a process is capable or not of meeting the corresponding technical specifications set by the customer, or the manufacturer, by comparing those with the natural variability of the CTQ variable that characterizes the process. The interpretation of these indices is associated with the result of this relation. Capability indices are generally calculated as the ratio between the length of the specification interval and the natural variability of the process in terms of σ . Large values of these indices mean that the corresponding process is capable of producing articles that meet the requirements of the client, and manufacturers.

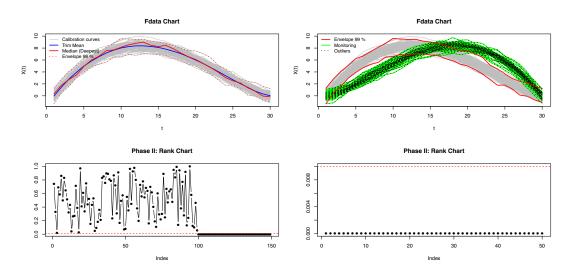


Figure 10: First row: the left and right panels show the FDA charts for the calibrating and monitoring samples with a signification level of 0.01. Second row: The left and right panels show the Phase II rank control chart for functional data, including calibration and monitoring sample (left panel) and only monitoring sample (right panel).

In other words, the larger the value of the capability index, the smaller the number of products outside the specification limits.

In this section, we describe the capability indices for processes whose underlying distribution is normal and not normal (exponential, Weibull, etc.). However, it is important to note that the development of programming tools for nonparametric capability analysis is one of the main goals and contributions of the qcr package. In addition to the estimation of capability indices, a graphical output is provided. Based on the proposal of qualityTools package, the qcr graphical output for capability analysis includes a normality test for the CTQ variable, a Q-Q plot, a histogram with the theoretical Gaussian distribution density, parametric and nonparametric estimates of capability indices, and a contour capability control chart. In the following lines, parametric and nonparametric capability analysis utilities are described using different examples of applications.

Assuming a normal distribution

The most widely used capability indexes in the industry analyze the process capability under the assumptions of stabilized process (in control) and a Gaussian distributed CTQ variable. Table 3 shows the main parametric (assuming Gaussian distribution) indices, namely C_p , C_{pk} , C_{pm} , and C_{pmk} .

? proposed a general formulation of these indices by an expression that depends on the non-negative parameters u and v:

$$C_p(u,v) = \frac{d - u|\mu - m|}{3\sqrt{\sigma^2 + v(\mu - T)^2}}$$

lowercase

Whereby d = (USL - LSL)/2, m = (LSL + USL)/2, USL is the upper specification limit, the LSL is the lower specification limit, σ is the theoretical standard deviation, μ accounts for the theoretical mean of the CTQ variable, and T is the specification target (by default the mean between the LSL and USL). The indices shown in Table 3 are obtained from this expression just considering values of 0 or 1 for u and v: $C_p(0,0) = C_p$, $C_p(1,0) = C_{pk}$, $C_p(0,1) = C_{pm}$, $C_p(1,1) = C_{pmk}$.

The piston rings data set is used to illustrate the calculation of the capability indices using the qcs.cp() function based on the expressions previously described in the Table 3. From the statistics obtained from the \bar{x} control chart of pistonrings dataset, the γ and β values are estimated, and the corresponding capability index is computed \bigcirc

```
R> data("pistonrings")
R> xbar <- qcs.xbar(pistonrings[1:125, ], plot = FALSE)
R> limits <- c(lsl = 73.99, usl = 74.01)</pre>
```

Potential capability	$\hat{C}_p = \frac{USL - LSL}{6\hat{\sigma}}$
	$\hat{C}_{p,lower} = \frac{\hat{\mu} - LSL}{3\hat{\sigma}}$
Actual capability with respect to the specification limits	$\hat{C}_{p,upper} = \frac{USL - \hat{\mu}}{3\hat{\sigma}}$
	$\hat{C}_{pk} = \min \left[\frac{USL - \hat{\mu}}{3\hat{\sigma}}, \frac{\hat{\mu} - LSL}{3\hat{\sigma}} \right]$
Shifting of the mean with respect to the target	$\hat{C}_{pm} = \frac{\hat{C}_p}{\sqrt{1 + \left(\frac{\hat{\mu} - T}{\hat{\sigma}}\right)^2}}$
C_{pk} correction for detecting deviations with respect to the target	$\hat{C}_{pkm} = \frac{\hat{C}_{pk}}{\sqrt{1 + \left(\frac{\hat{\mu} - T}{\hat{\sigma}}\right)^2}}$

Table 3: PCR from first to fourth generation, USL is the upper specification limit, LSL is the lower specification limit, μ is the real mean, $\hat{\mu}$ is the estimated mean, and $\hat{\sigma}$ is the estimated standard deviation.

```
R> # qcs.cp(object = xbar, parameters = c(0, 0), limits = limits,
R> # contour = FALSE)
R> # qcs.cp(object = xbar, parameters = c(1, 0), limits = limits,
R> # contour = FALSE)
R> # qcs.cp(object = xbar, parameters = c(0, 1), limits = limits,
R> # contour = FALSE)
R> qcs.cp(object = xbar, parameters = c(1, 1), limits = limits,
+ contour = FALSE)

Cpmk delta.usl gamma.usl
0.2984 0.1176 0.9785
```

Consequently, the obtained results are $C_p = 0.3407$, $C_{pk} = 0.3006$, $C_{pm} = 0.3382$, and $C_{pmk} = 0.2984$, respectively. The argument parameters accounts for the u and v values, while object is the type of control chart from which the σ is estimated, limits are the specification control limits, and contour the parameter that indicates when the process capability contour chart is plotted.

Process capability plot

In ? and ? a graphical method (based on common capbility indices) to analyze the capability of a process is proposed. The goal of using this type of plot (if compared with respect to only capability indices calculation) is to provide immediate information of the location and spread of the CTQ feature, and about the capability to meet the specifications of the corresponding process. When using this chart, a process will be capable if the process capability index is higher than a certain value k, with k>1. The most used values for k are k=1, k=4/3, or k=5/3, even 2 at a Six Sigma level, taking into account the usual index limits for which a process could be assumed capable. It will also be assumed that the target value matches the center of the specification interval, that is, $T=\frac{(USL+LSL)}{2}=m$. Then, one of the indices defined by the $C_P(u,v)$ family is used, e.g., C_{pk} or C_{pm} , and the process will be defined as capable if $C_P(u,v)>k$, given the values of u,v, and u,v, and u,v, and u,v, and u,v, indices are defined by the same expression as the u,v-and u,v-

$$\gamma = \sqrt{\frac{(1 - u|\delta|)}{9k^2} - v\delta^2}, \ |\delta| \le \frac{1}{u + 3k\sqrt{v}}, \ (u, v) \ne (0, 0)$$

When u = v = 0, that is, when we consider the index $C_p = k$, we have $\gamma = \frac{1}{3k}$ and $|\delta| \le 1$. It is important to highlight that the γ_{ν} axis accounts for the process spread, whereas the δ_{ν} axis accounts for the process location. The values of the parameters μ and σ which provide values (δ, γ) within

the region bounded by the contour line $C_p(u,v)=k$ and the $\delta_{\mathfrak{P}}^*$ axis will provide a larger $C_p(u,v)$ value than k, leading a capable process. Furthermore, values of μ and σ which provide values (δ,γ) outside this region will provide a value $C_p(u,v)$ smaller than k, i.e., a non-capable process. In the case of the process not being capable, this type of plot is useful to understand if the corrective actions have to be performed to decrease the process spread, or the process location (deviation with respect to target) or even when both changes are needed to improve the process capability. This can be observed by observing the distance with respect to the x and $y_{\mathfrak{P}}^*$ axis. Below are some examples of capability plot application which can be generated through the application of the qcs.cp function with contour=TRUE and k=1 (default values)

The result is shown in Figure 11. In all the cases the points in red are out of the area defined by the line in blue and the δ axis. Thus, the corresponding process is not capable no matter the capability index that is used. In any case, note that the C_p index is useless in identifying non capable processes due to location shifts with respect to the target. In the same way, the C_{pk} index assumed as capable processes that are far from the target as long as it were close to the specification limits (as shown in Figure 11). Thus, the use of the C_{pm} and C_{pmk} are recommended due to they take into account both shifts from the target and the spread. In the present case the process is not capable due to the spread rather than the target shift. Therefore, the process changes could be due to decreases in the variability process.

Estimated process capability plot

In practice, the process parameters are unknown and we need to estimate them. We can perform a decision rule based on the sample statistics that provide a sample estimate of the capability index and, finally the social destimated process capability plot, also called $\gamma^* - \delta^*$ plot (?). It allows us to decide whether a process is capable or not assuming that μ and σ parameters are unknown and estimated by $\hat{\mu} = \bar{X}$ and $\hat{\sigma}^2 = \frac{1}{n} \sum_{i=1}^n X_i^2 - \bar{X}^2$. They are the maximum likelihood estimators when the CTQ variable of the process is normally distributed, and X_1, X_2, \ldots, X_n random sample of a normal distribution with μ mean and σ^2 variance.

The qcr package only provides the $\gamma^* - \delta^*$ plot corresponding to the C_{pm} index taking into account that the other capability indices do not consider shifts from the target value in their calculations. For the general case, see the work of ? In order to obtain an appropriate decision rule for the case of C_{pm} index, we test the hypotheses $H_0: C_{pm} \leq k_0$ versus $H_1: C_{pm} > k_0$, using

$$\hat{C}_{pm} = \frac{d}{3\sqrt{\hat{\sigma}^2 + (\hat{\mu} - T)^2}}$$

as test statistic. The null hypothesis will be rejected if $\hat{C}_{pm} > c_{\alpha}$, where the constant c_{α} is determined by previously defining a signifition test level α . ? showed that the null hypothesis $H_0: C_{pm} \leq k_0$ can be reduced to $H_0: C_{pm} = k_0$. Thus, for given values of α and n, the process will be considered capable if $\hat{C}_{pm} > c_{\alpha}$, with $c_{\alpha} > k_0$. ? proved that, when the C_{pm} index is used, the critical value for a given α is obtained as

$$c_{\alpha} = k_0 \sqrt{\frac{n}{\chi_{\alpha,n}^2}},$$

where $\chi^2_{\alpha,n}$ is the quantile α of a χ^2 distribution with n degrees of freedom. The qcr package includes the qcs.hat.cpm() function to obtain both the theoretical capability plot and the estimated capability plot from sample statistics. Among other options, the user can indicate the control chart from which the estimates $\hat{\mu}$ and $\hat{\sigma}$ are obtained (alternatively, $\hat{\mu}$ and $\hat{\sigma}$ can be introduced through mu and std.dev), and the specification limits using limits. Furthermore, the signification level and the capability limit can be modified, as they are set to $\alpha = 0.05$ and $k_0 = 1$ by default. The following code illustrates its application to pistonrings data.

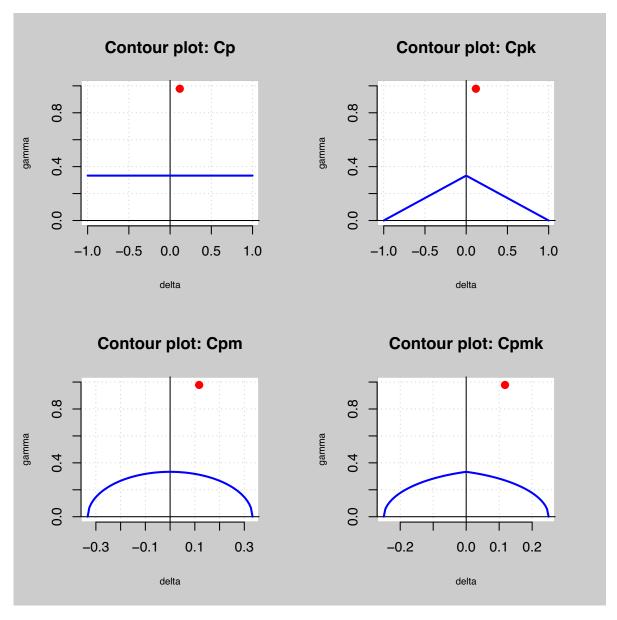


Figure 11: Process capability plots using the C_p , C_{pk} , C_{pm} , and C_{pmk} indexes.

```
R> xbar <- qcs.xbar(pistonrings[1:125, ], plot = FALSE)
R> limits <- c(ls1 = 73.99, us1 = 74.01)
R> # qcs.hat.cpm(object = xbar, limits = limits, ylim = c(0,1))
R> mu <- xbar$center
R> std.dev <- xbar$std.dev
R> qcs.hat.cpm(limits = limits, mu = mu, std.dev = std.dev, ylim = c(0,1))
```

The result is shown in Figure 12. The contour line corresponding to the capability region obtained from the capability index sample is always more restrictive than the corresponding theoretical one.

Nonparametric capability analysis

Traditional assumptions about data such as normality or independence are frequently violated in many real situations. Thus, in scenarios in which assumptions of normality are not verified, the indices defined in the previous sections are not valid. ? and ? proposed generalizations of $C_p(u, v)$ for the case of arbitrary distributions of data

$$C_{Np}(u,v) = \frac{d - u|M - m|}{3\sqrt{\left(\frac{F_{99.865} - F_{0.135}}{6}\right)^2 + v\left(M - T\right)^2}}$$

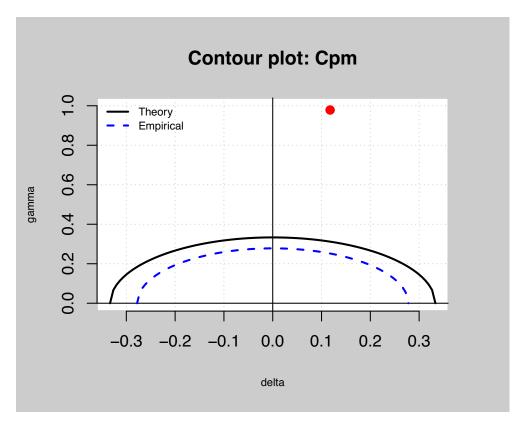


Figure 12: Comparison between theorical and estimated process capability plots.

where F_{α} is the percentile $\alpha\%$ of the corresponding distribution and M the median of the process. However, the distribution of the underlying process is always unknown. Calculated estimates for $F_{99.865}$, $F_{0.135}$ and M based on the sample percentiles.

? proposed the following estimator

$$\hat{C}_{Np}\left(u,v\right) = \frac{d-u|\hat{M}-m|}{3\sqrt{\left(\frac{U_p-L_p}{6}\right)^2 + v\left(\hat{M}-T\right)^2}} \qquad \uparrow$$

where U_p is an estimator for $F_{99.865}$, L_p is an estimator for $F_{0.135}$ and \hat{M} is an estimator for M, obtained from the tables developed by ?.

The qcs.cpn() function of qcr calculates C_{Np} , C_{Npk} , C_{Npm} and C_{Npmk} using the formulation described by ? The code that illustrates its use is shown below. To obtain the nonparametric capability indices it is necessary to indicate the u and v parameters.

```
R> xbar <- qcs.xbar(pistonrings[1:125, ], plot = FALSE)
R> limits <- c(lsl = 73.99, usl = 74.01)
R> # x <- xbar$statistics[[1]]
R> # median <- median(x)
R> # q = quantile(x, probs = c(0.00135, 0.99865)) # c(lq, uq)
R> # qcs.cpn(parameters = c(0, 0), limits = limits, median = median, q = q)
R> # qcs.cpn(object = xbar, parameters = c(0, 0), limits = limits)
R> # qcs.cpn(object = xbar, parameters = c(1, 0), limits = limits)
R> # qcs.cpn(object = xbar, parameters = c(0, 1), limits = limits)
R> qcs.cpn(object = xbar, parameters = c(1, 1), limits = limits)
CNpmk
0.9015
```

Thus, the values obtained are $C_{Np} = 1.0082$, $C_{Npk} = 0.9275$, $C_{Npm} = 0.9799$ and $C_{Npmk} = 0.9015$. If a capability limit of k = 1 or k = 1.33 is assumed, we can infer that the process is not actually capable to meet the customers or manager's requirements.

Tools for a comprehensive processs capability analysis

Function qcs.ca() provides a comprehensive information of the capability of a process, summarized trough a graphica output. This function calculates the process capability indices C_p , C_{pk} , C_{pL} , C_{pU} , C_{pm} , C_{pmk} from a qcs object, assuming a Gaussian distribution. Moer vover, it computes confidence limits for C_p using the method described by ? Approximate confidence limits for C_{pl} , C_{pu} and C_{pk} are also estimated using the method described in ?, while the confidence limits for C_{pm} are based on the approximated method of (?), that assumes the target is the mean of the specification limits. Moreover, the C_{Np} , C_{Npk} , C_{Npm} , and C_{Npmk} nonparametric capability indices are also obtained. There is also an specific box within the summary plot that shows the proportion of observations, and expected observations under the Gaussian assumption, out of the specification limits (nonconforming observations). Further, a histogram of data sample is provided, in addition to the corresponding Gaussian density curves obtained from the sample estimates (one per standard deviation estimate procedure). They are displayed along with the specification limits, a quantile-quantile plot for the specified distribution and a process capability plot obtained from the C_{pm} index (both using theoretical and sample alternatives). In order to describe the qcs.ca() performance, the following code corresponds to the analysis of the first 125 observations of the pistonrings dataset (the corresponding output is shown in Figure 13).

```
R > qcs.ca(xbar, limits = c(lsl = 73.99, usl = 74.01))
Process Capability Analysis
qcs.ca(object = xbar, limits = c(lsl = 73.99, usl = 74.01))
Number of obs = 125
                            Target = 74
      Center = 74
                                 LSL = 73.99
      StdDev = 0.009785
                                 USL = 74.01
Paremetric Capability indices:
      Value
               0.1%
Ср
      0.3407 0.2771 0.4065
Cp_1 0.3807 0.2739 0.4875
Cp_u 0.3006 0.2021 0.3991
Cp_k 0.3006 0.1944 0.4068
Cpm 0.3382 0.2749 0.4038
Non parametric Capability indices:
       Value
CNp
       1.0082
CNpK
      0.9275
CNpm
      0.9799
CNpmk 0.9015
PPM:
         Exp<LSL 1.267e+07
                                Obs<LSL 0
        Exp>USL 1.836e+07
                                Obs>USL 8e+05
       Exp Total 3.103e+07
                              Obs Total 8e+05
Test:
        Anderson Darling Test for normal distribution
data: xbar
A = 0.1399, mean = 74.001, sd = 0.005, p-value = 0.9694
alternative hypothesis: true distribution is not equal to normal
```

Consider to make the plot Smaller to avoid the plot being truncated.

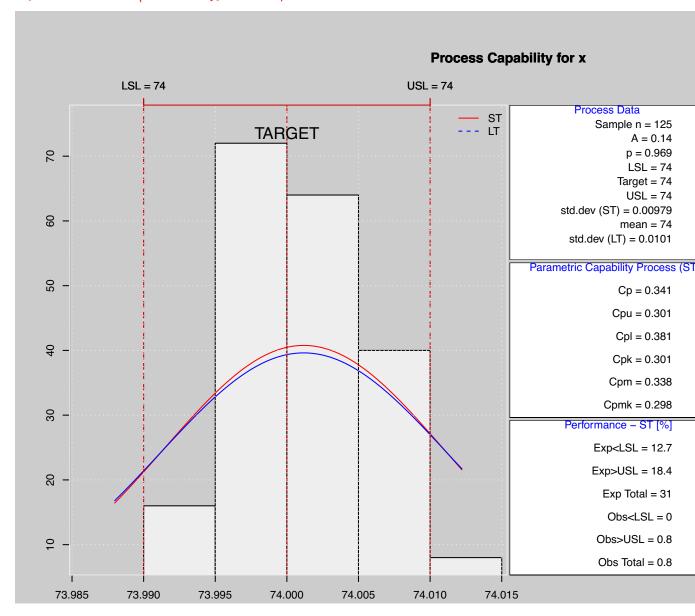


Figure 13: A complete analysis of the process capability.

Conclusions

The qcr package has been developed to provide users with a comprehensive set of functions that manage statistical process control, ranging from univariate parametric analysis to multivariate and FDA nonparametric statistics. This package includes the main types of control charts and capability indices. It combines the main features of reputed SQC packages in R such as qcc and qualityTools with the proposal of a new graphical appearance and the implementation of new SQC tools with increasing importance in Industry 4.0 such as multivariate and nonparametric analysis. In addition to some utilities provided by reference R packages such as qcc, SixSigma, and qualityTools, qcr implements very important statistical techniques of Control and Analysis tasks of the Six Sigma procedure that are not included in other libraries. In the case of multivariate control charts, these tools are the MEWMA and MCUSUM multivariate control charts, on the one hand, and the r, Q and S nonparametric control charts based on data depth, on the other hand. In addition, Phase I and Phase II control charts for functional data (monthly, dialy, hourly curves) based on functional data depth, bootstrap procedures, and nonparametric rank charts have been also implemented in the

It is also very important to note that qcr provides functions to perform nonparametric capability analysis. In addition, the new implementation of the process capability plots for the main parametric

when their CTQ variables are obtained as hourly, monthly, daily, yearly smooth curves.

qcr package. These control charts for functional data provide tools to control and improve processes

capability indices allows us to analyze if improvements in process spread or/and process location are needed to obtain a capable process. The comparison between suppliers, machines, etc., is enabled through capability plots.

All these utilities intend to make qcr a useful tool for users of a wide variety of industries, providing a competitive alternative to commercial software.

Acknowledgments

The work of Salvador Naya, Javier Tarrío-Saavedra, Miguel Flores and Rubén Fernández-Casal has been supported by MINECO grant MTM2017-82724-R, and by the Xunta de Galicia (Grupos de Referencia Competitiva ED431C-2020-14 and Centro de Investigación del Sistema universitario de Galicia ED431G 2019/01), all of them through the ERDF. The research of Miguel Flores has been partially supported by Grant PII-DM-002-2016 of Escuela Politécnica Nacional of Ecuador. In addition, the research of Javier Tarrío-Saavedra has been also founded by the eCOAR project (PC18/03) of CITIC. The authors thank Mateo Larco and Bibiana Santiso for their valuable help with the English edition.

Miguel Flores
MODES, SIGTI, ADIAAC, Departamento de Matemáticas, Escuela Politécnica Nacional
170517 Quito
Ecuador
0000-0002-7742-1247
miguel.flores@epn.edu.ec

Rubén Fernández-Casal MODES, CITIC, Universidade da Coruña Facultade de Informática, Campus de Elviña, A Coruña Spain 0000-0002-5785-3739 ruben.fcasal@udc.es

Salvador Naya MODES, CITIC, ITMATI, Universidade da Coruña Escola Politécnica Superior, Mendizábal s/n, Ferrol Spain 0000-0003-4931-9859 salva@udc.es

Javier Tarrío-Saavedra MODES, CITIC, Universidade da Coruña Escola Politécnica Superior, Mendizábal s/n, Ferrol Spain 0000-0003-4931-9859 javier.tarrio@udc.es