Engineering Change Notice(ECN)

ECN-E-2606-06(ECP AP&3D TYPE_PIO CABLE PIN Sequence Change)

FA Research EE team

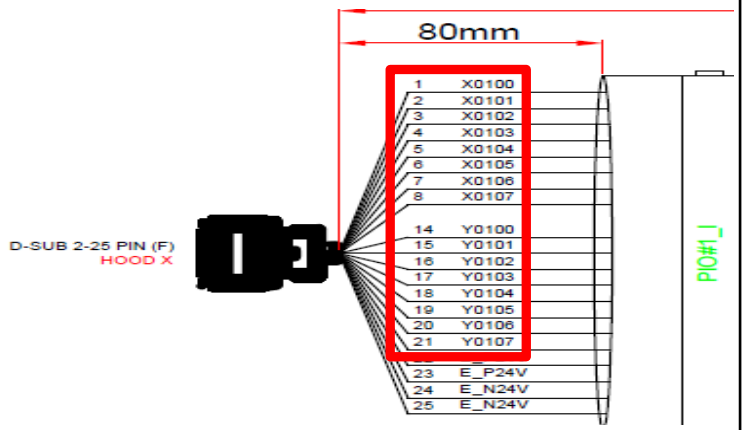
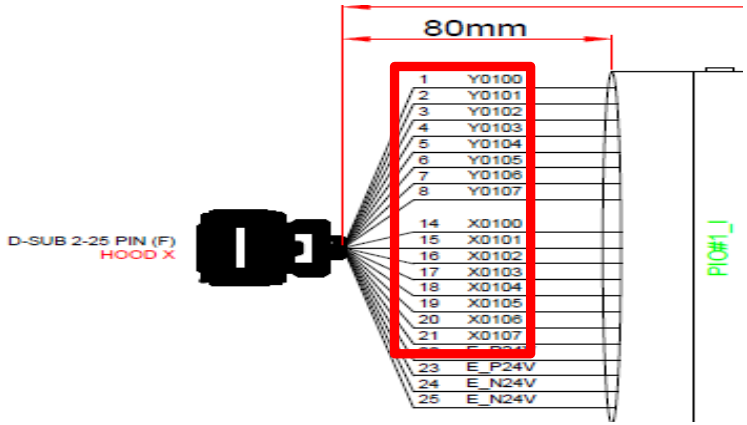
Written	Review	Confirm
김태영	양원주	이태경
26/06/12	26/06/12	26/06/13

NINEBELL

1. Engineering Change Request

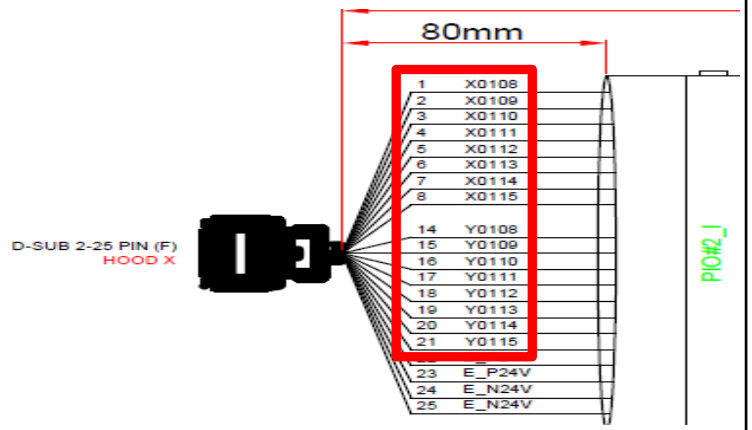
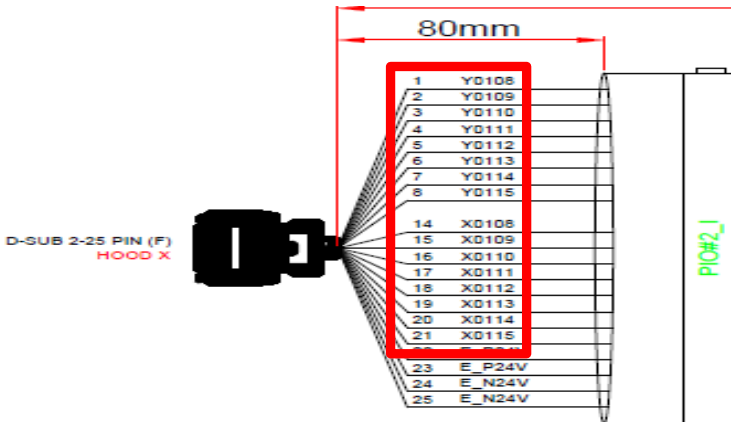
N/A

2. Engineering Change Notice

적용 장비 타입 Applicable project type	ECP AP&3D TYPE	적용 범위 Scope	■ 신규 발주분 (New order) □ 기발주분 (Previous order) □ 기출하장비 (Existing shipped equipment)
변경 사유 Reason for change	□ 고객 요청 (Customer request) ■ 품질개선 (Quality improve) □ 원가절감 (Cost reduction) □ 생산성 향상 (Increase productivity) □ 부품 단종 (Part discontinuation) □ 기타 (ETC)	ECR NO.	N/A
		ECN NO.	ECN-E-2606-06
변경 상세 사유 Detailed reason for change	PIO#1~3 Cable 1~8번 PIN과 14~21번 PIN이 뒤바뀌어 DMS 센서 입/출력 신호가 반대로 주고 받는 현상 발생 An issue occurred where PINs 1–8 and PINs 14–21 of the PIO #1–3 cables were reversed, causing the DMS sensor input/output signals to be transmitted and received inversely.		
변경 사항 Changes	변경 전(Before)	변경 후(After)	
	 PIO #1	 PIO #1
상세내용 Detail	1) Previous Dwg No. : EAP-E-I12-7000-0 2) Description : No. 1~8 PIN(X0100~X0107), No. 14~21 PIN(Y0100~Y0107)	1) New Dwg No. : EAP-E-I12-7000-1 2) Description after change : No. 1~8 PIN(Y0100~Y0107), No. 14~21 PIN(X0100~X0107)	

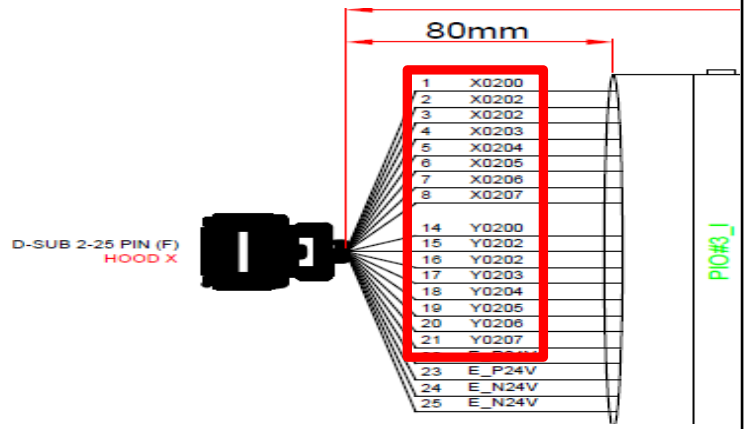
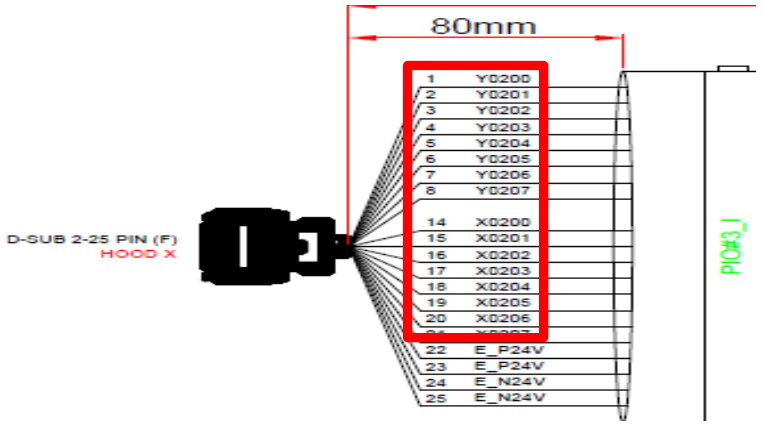
CONFIDENTIAL

2. Engineering Change Notice

적용 장비 타입 Applicable project type	**ECP AP&3D TYPE**	적용 범위 Scope	■ 신규 발주분 (New order) □ 기발주분 (Previous order) □ 기출하장비 (Existing shipped equipment)
변경 사유 Reason for change	□ 고객 요청 (Customer request) ■ 품질개선 (Quality improve) □ 원가절감 (Cost reduction) □ 생산성 향상 (Increase productivity) □ 부품 단종 (Part discontinuation) □ 기타 (ETC)	ECR NO.	N/A
		ECN NO.	ECN-E-2606-06
변경 상세 사유 Detailed reason for change	PIO#1~3 Cable 1~8번 PIN과 14~21번 PIN이 뒤바뀌어 DMS 센서 입/출력 신호가 반대로 주고 받는 현상 발생 An issue occurred where PINs 1–8 and PINs 14–21 of the PIO #1–3 cables were reversed, causing the DMS sensor input/output signals to be transmitted and received inversely.		
변경 사항 Changes	변경 전(Before)	변경 후(After)	
	 PIO #2	 PIO #2
상세내용 Detail	1) Previous Dwg No. : EAP-E-I13-7000-0 2) Description : No. 1~8 PIN(X0108~X0115), No.14~21 PIN(Y0108~Y0115)	1) New Dwg No. : EAP-E-I13-7000-1 2) Description after change : No. 1~8 PIN(Y0108~Y0115), No.14~21 PIN(X0108~X0115)	

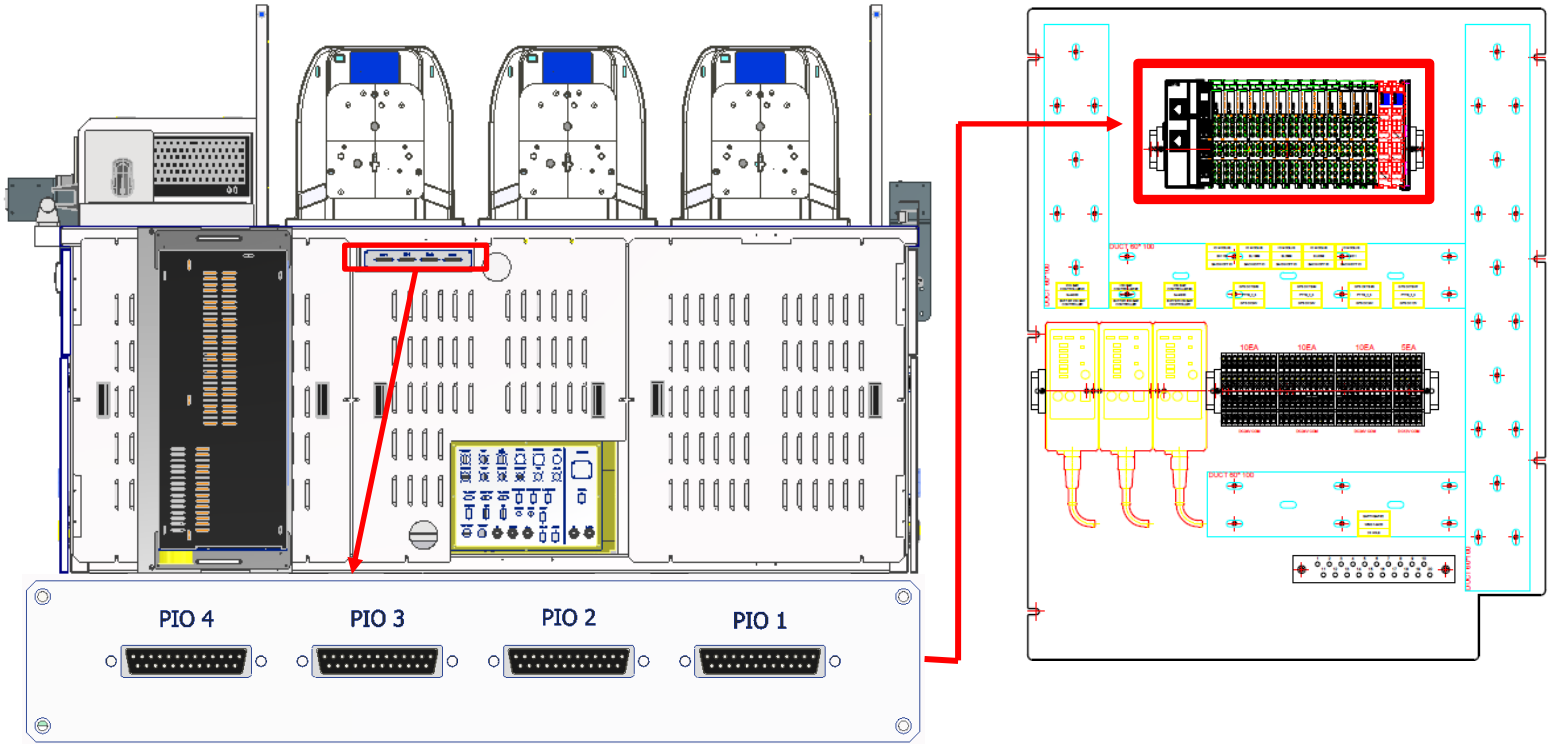
CONFIDENTIAL

2. Engineering Change Notice

적용 장비 타입 Applicable project type	**ECP AP&3D TYPE**	적용 범위 Scope	■ 신규 발주분 (New order) □ 기발주분 (Previous order) □ 기출하장비 (Existing shipped equipment)
변경 사유 Reason for change	□ 고객 요청 (Customer request) ■ 품질개선 (Quality improve) □ 원가절감 (Cost reduction) □ 생산성 향상 (Increase productivity) □ 부품 단종 (Part discontinuation) □ 기타 (ETC)	ECR NO.	N/A
		ECN NO.	ECN-E-2606-06
변경 상세 사유 Detailed reason for change	PIO#1~3 Cable 1~8번 PIN과 14~21번 PIN이 뒤바뀌어 DMS 센서 입/출력 신호가 반대로 주고 받는 현상 발생 An issue occurred where PINs 1–8 and PINs 14–21 of the PIO #1–3 cables were reversed, causing the DMS sensor input/output signals to be transmitted and received inversely.		
변경 사항 Changes	변경 전(Before)	변경 후(After)	
	 PIO #3	 PIO #3
상세내용 Detail	1) Previous Dwg No. : EAP-E-I14-7000-0 2) Description : No. 1~8 PIN(X0200~X0207), No.14~21 PIN(Y0200~Y0207)	1) New Dwg No. : EAP-E-I14-7000-1 2) Description after change: No. 1~8 PIN(Y0200~Y0207), No. 14~21 PIN(X0200~X0207)	

CONFIDENTIAL

2. Engineering Change Notice

전체 이미지 Full Image	

검토 결과 Test Result	검토 여부 Test or not	Y / N	검토 부서 Department	전장팀	첨부파일 유무 Attachments	Y / N
승인 날짜 Approval date	1. Ninebell : 2026.06.15 2. Customer : / /		나인벨 승인 Ninebell approval	QC 2026.06.15 PASS	고객사 승인 Customer approval	ACM ECP 3D team confirms 6/16/26 Zhongguo.yu ACM ECP AP team confirms 6/19 ShijieLiu
적용 일자 Effective date	2026.06.15~		최초 적용 장비 Initially Applied Equipment	NEW PO		

3. Attachments

Part No.		
Before	**→**	**After**
EAP-E-I12-7000-0	→	EAP-E-I12-7000-1
EAP-E-I13-7000-0	→	EAP-E-I13-7000-1
EAP-E-I14-7000-0	→	EAP-E-I14-7000-1