
UR3e | R3 EIT weight attachment

Assembly positions from the R3 CAD • dimensions in mm • robot wrist shown schematically

A Mounted at the UR3e tool flange

Four M6 bolts through the frame plate into the robot flange

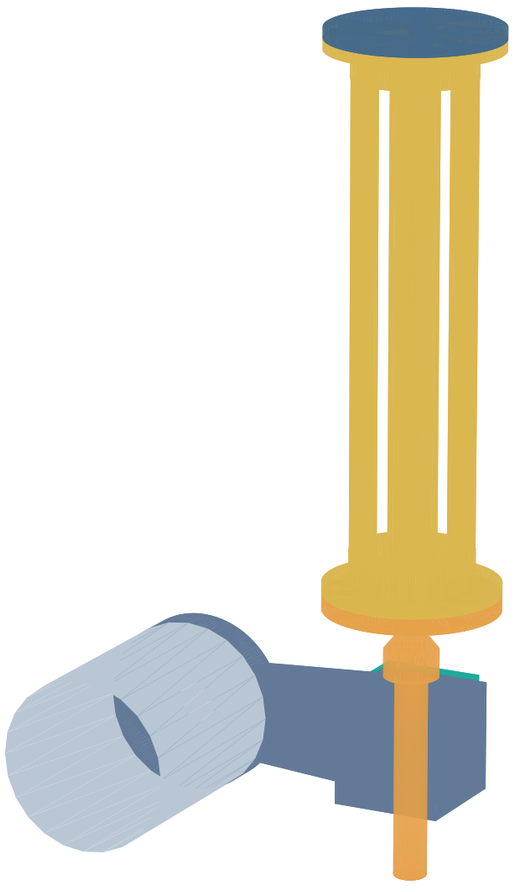


UR wrist → frame → vertical guide + floating weight head

At the revised mount pose: cage up; probe tip down; bridge toward Base +Y.

B Parts before assembly

Lower parts onto the fixed frame along the guide axis

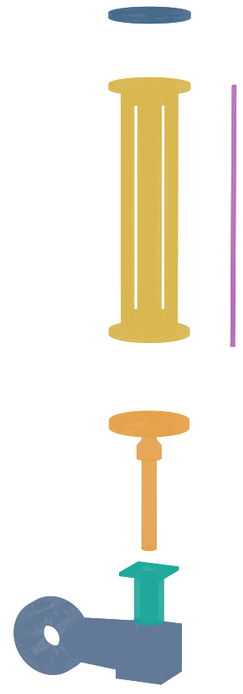

Printed parts

- 01 Frame / UR flange
- 02 Tray + contact plunger
- 03 Guide
- 04 Weight cage
- 05 Top cap
- 06 Center rod

Assembly order

1. 03 guide into 01 frame
2. 02 plunger through guide
3. 04 cage onto tray
4. 06 rod into tray; add weights
5. 05 cap onto cage and rod
6. 01 frame onto UR tool flange

Orientation: UR tool0 +Z = Base −X; CAD +Y follows tool0 +Z; CAD +X points toward Base +Y; CAD +Z points up.

Fit and fastener details: R3 README. Verify the physical flange clocking and clearance before moving the loaded robot.