



AANDINET

ICT SOLUTIONS

INSTRUCTION MANUAL

**65 INCH DIGITAL SIGNAGE
WELDING INSTRUCTION MANUAL**



Accessory list

NO.	SPEC.	QTY
1	M4	8+
2	M6-small	40+
3	M6-large	8+
4	M12	8+
5	M6 allen key	1
6	M12 allen key	1
7.	M19 ratchet	1


Technical data

NO.	CATEGORY	SPEC.
1	Screen size	65 inches
2	Overall dimension (L x W x H) mm	963 x 440 x 2024
3	Mounting	Floor standing
4	Material	Steel



Attention: The drawings below are for guidance only and they may differ slightly from the product and fittings received. Please contact our customer service department if you have any queries.

PARTS LIST

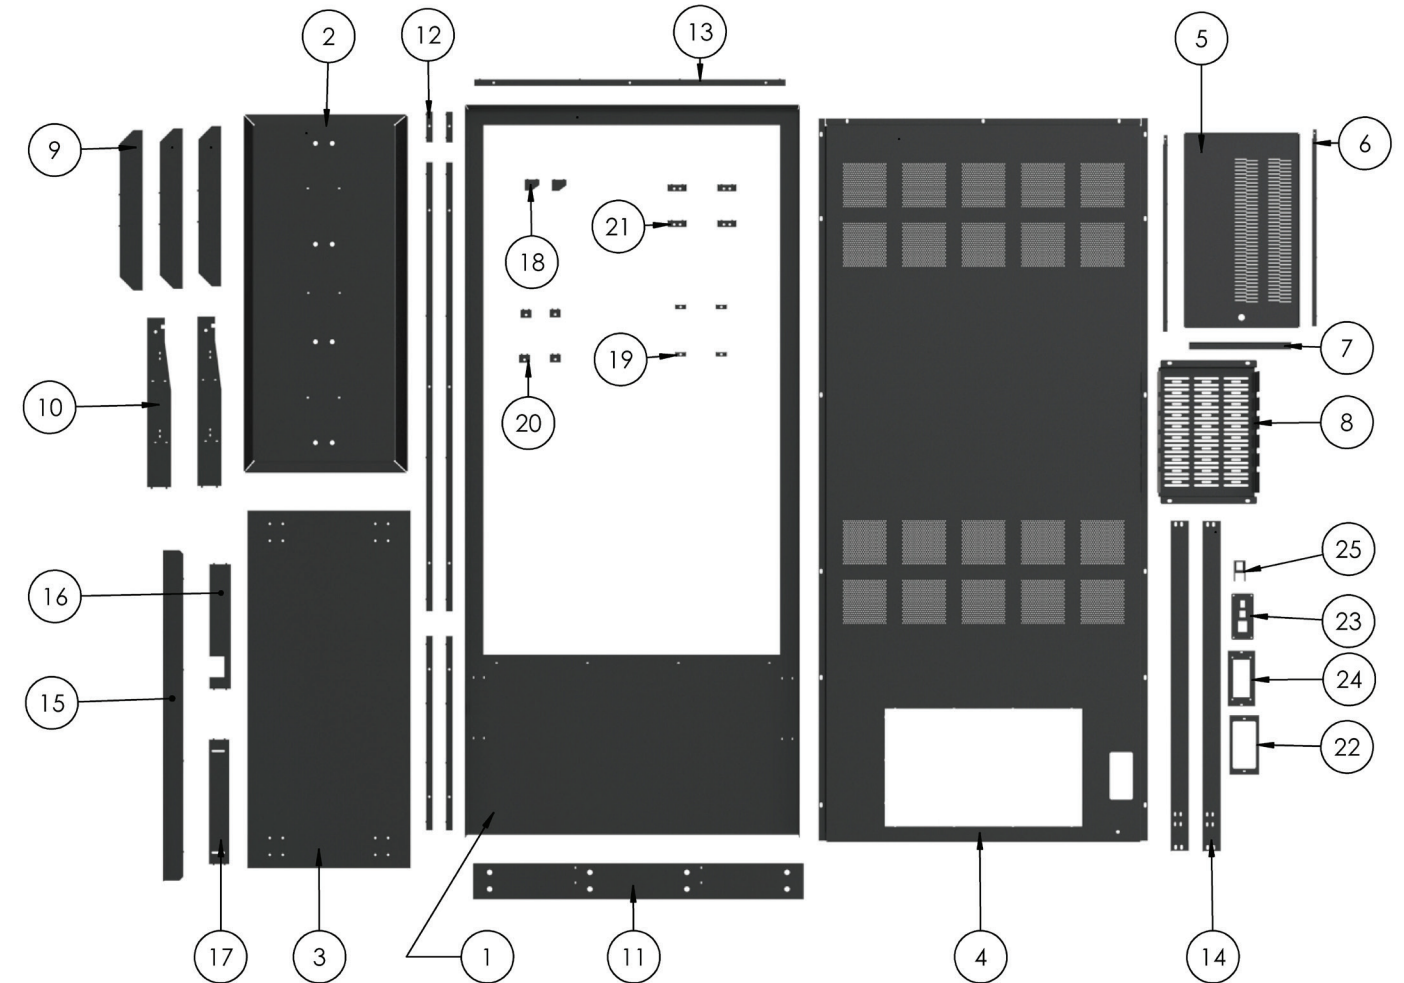


NO	PART NAME	QTY
1	Front cover sheet	1
2	base sheet	1
3	base plate	1
4	Back cover	1
5	Door	1
6	Door bottom frame	2
7	Door left frame	1
8	Board cover	1
9	Base support plate	3
10	Screen vertical support	2
11	5mm bottom plate	1
12	Back cover nut rib	2
13	Back cover nut rib	1

NO	PART NAME	QTY
14	Screen back hold sheet	2
15	Screen bottom sheet	1
16	Board base plate	1
17	Adaptor base plate	1
18	Screen bottom sheet rib	2
19	Speaker nut rib	4
20	Board cover nut rib	4
21	Screen back hold sheet nut	4
22	Port tolerance plate	1
23	Port front plate	1
24	Port back nuut plate	1
25	Port hardware housing	1

STEP 1



weld the 5 mm plate to the front

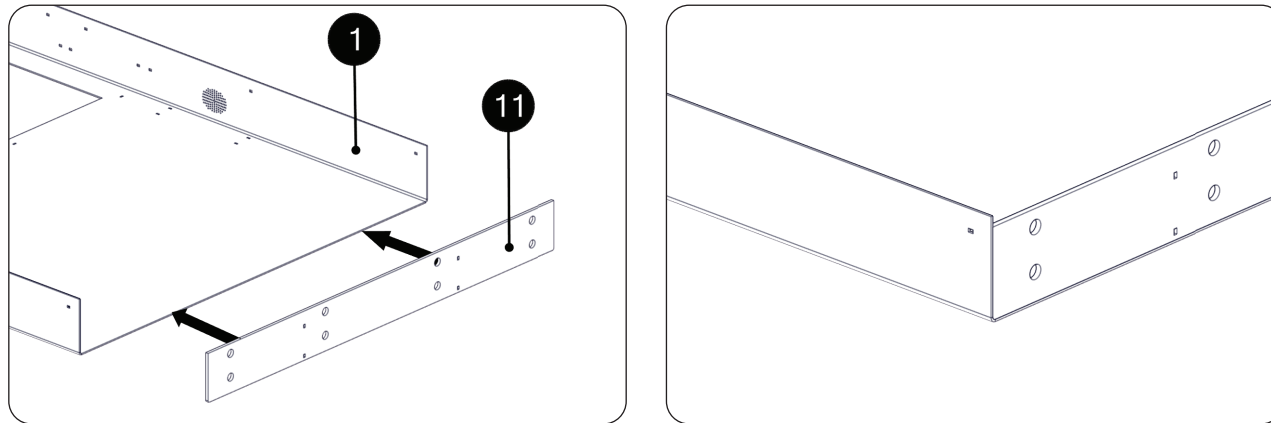

Notice: when welding these two pieces, the 5mm sheet metal plate has to be welded inside the front cover sheet

STEP 2



welding the bottom screen sheet rib

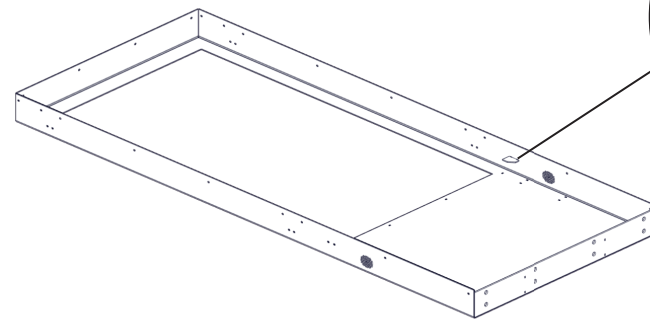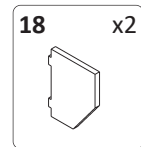

it has two pieces of this part opposite to each other. the welding should be done after the part is inserted to the intended slot on the front sheet cover

STEP 3

welding the screen vertical support

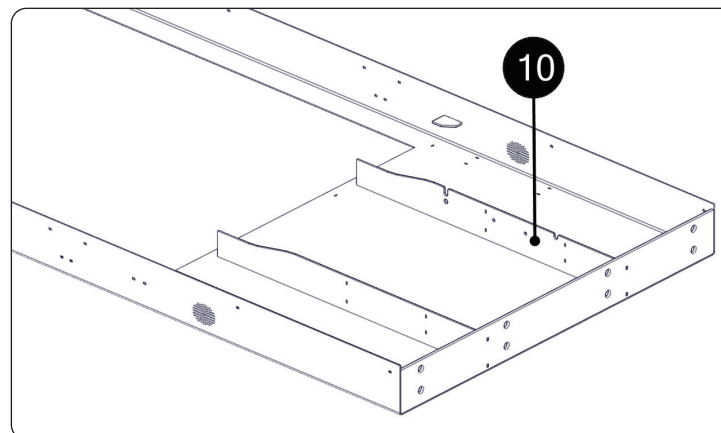
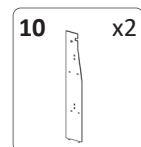


it has to be inserted to the intended slot on the 5mm sheet (11) before welding.

it has two pieces of this part opposite to each other. the welding should be done after the part is inserted to the intended slot on the front sheet cover

STEP 4




welding the bottom screen bottom sheet

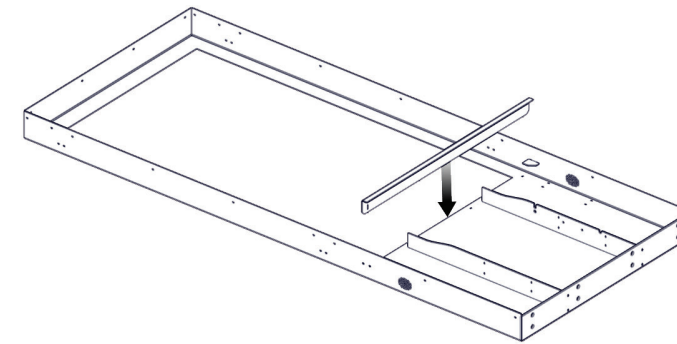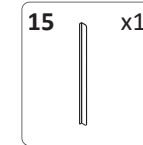



the part should be placed onto the front sheet cover through the intended slot for it on the front sheet metal.

STEP 5

welding adaptor and board plate

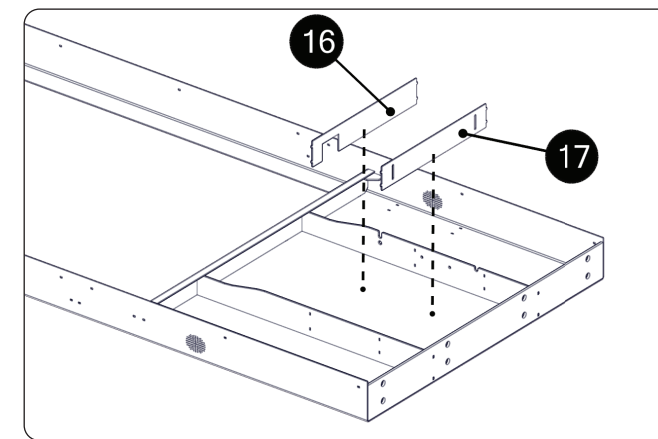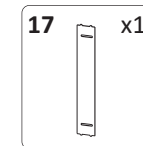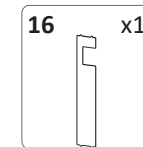




both parts should be placed on the screen vertical support through the intended slot cut.

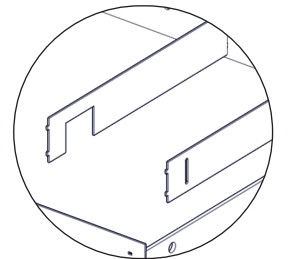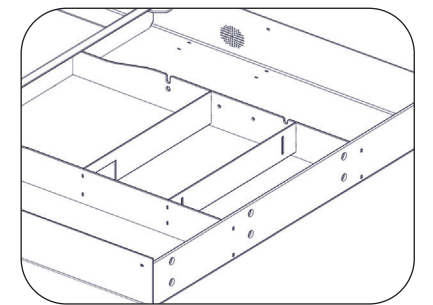


Notice: the rectangular cut on part (16) should be facing downward when welding.

STEP 6


welding speaker rest rib

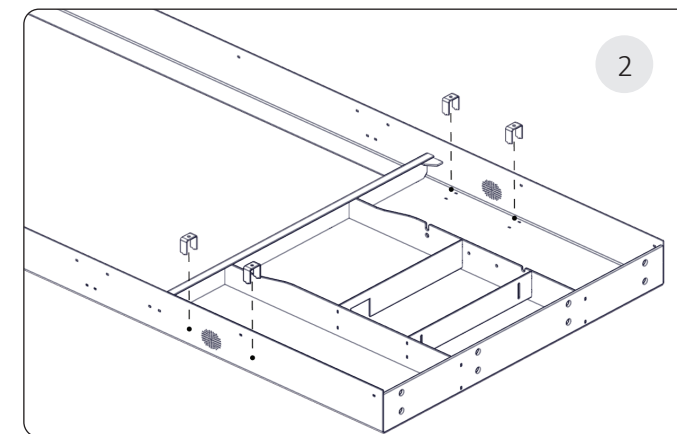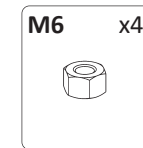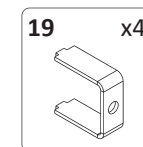

After welding the M6 nut on the bended sheet, it is then welded to the front cover through the intended slot.



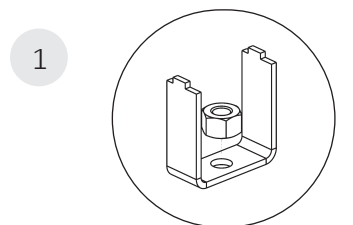


the M6 nut is first welded to the speaker rest sheet

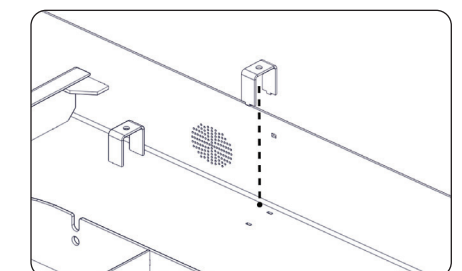


STEP 7

welding screen back hold sheet rib

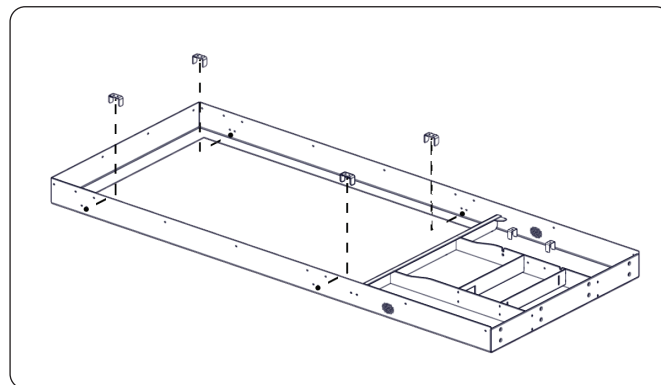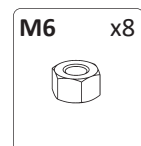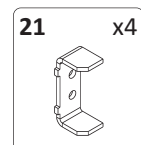


1

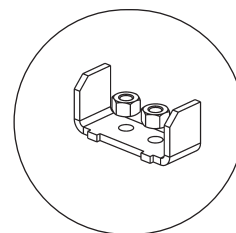

weld the M6 nut is first before welding the bended sheet

2




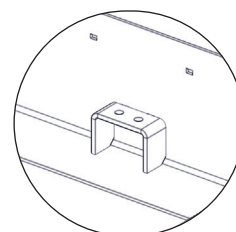


Insert the part through the intended slot


After welding the M6 nut to part (21), then it should be welded after it is placed on the front sheet metal.

STEP 8


welding top and side back cover ribs

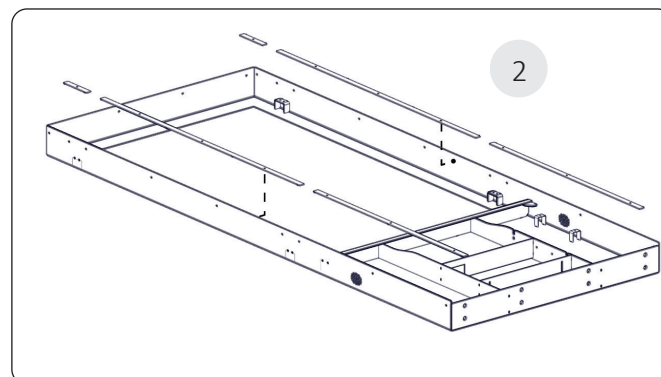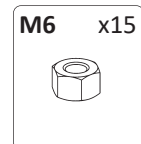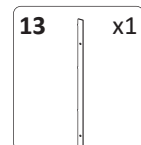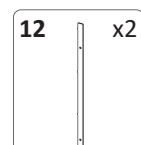


1

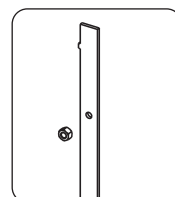

weld the M6 nut is first before welding to the front cover sheet.

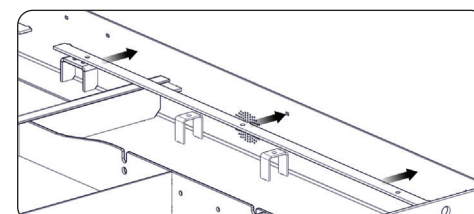




3

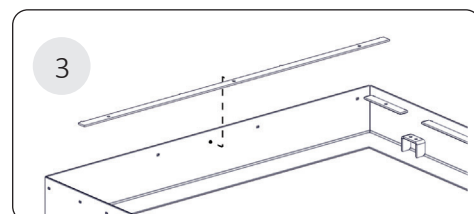

After welding the M6 nut to the ribs, insert the top and side ribs to the front cover through the intended slot cut.

STEP 9

welding base support plate

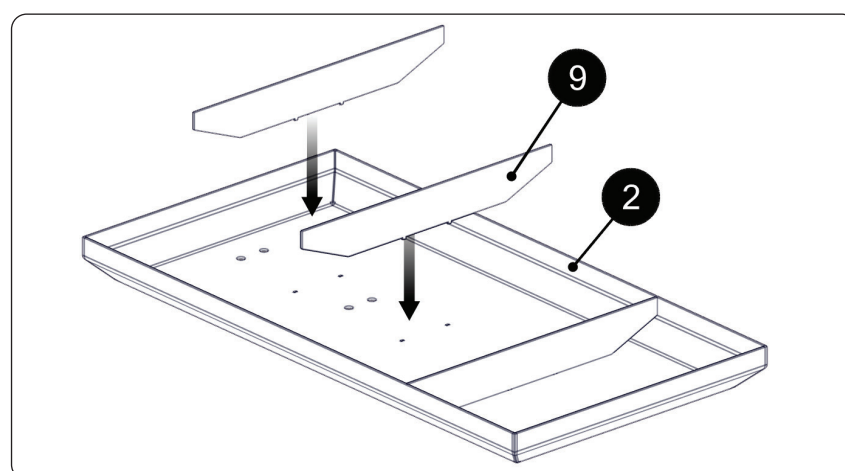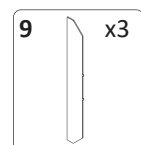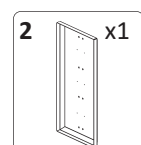



9

2

weld the plate after inserting to the intended slot on the base.

STEP 10




welding M12 bolt to the base

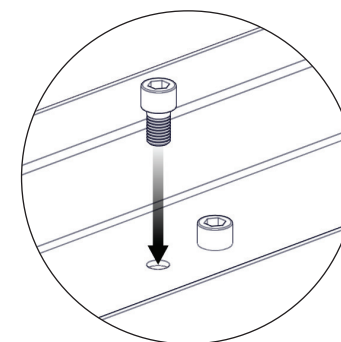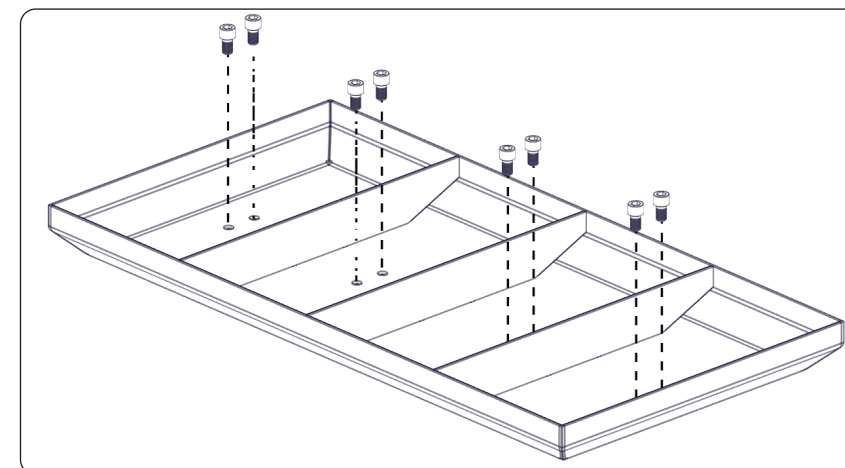

Notice: when welding the M12 bolts to the base use a corresponding nut to keep the alignment straight.

STEP 11



welding M6 bolt to the base plate

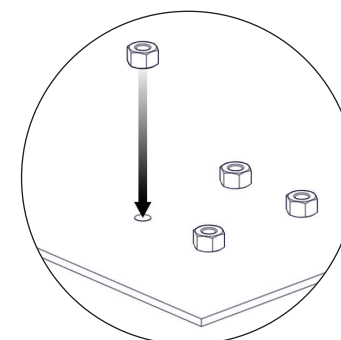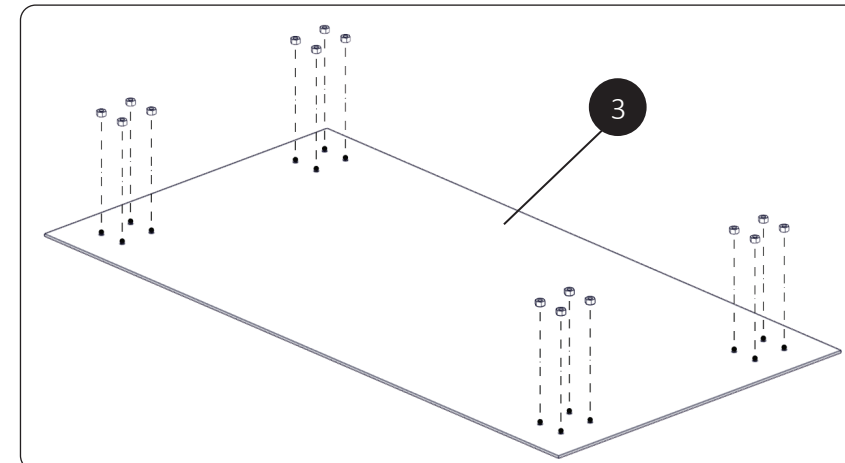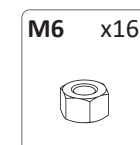

Notice: when welding the M6 bolts to the base use a corresponding nut to keep the alignment straight.

STEP 12

welding base plate to the base

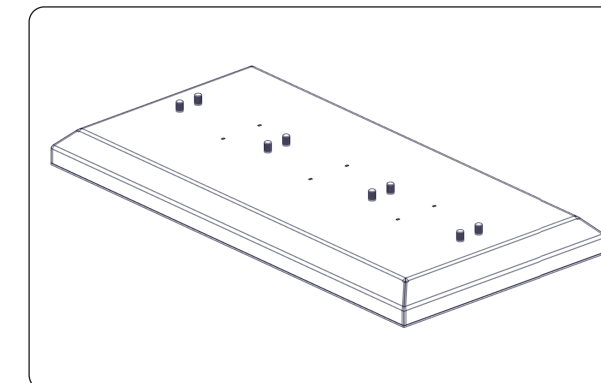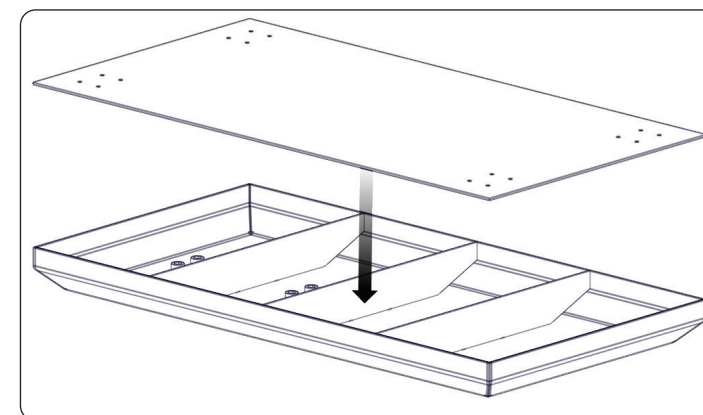


Notice: the base plate should be welded on the top of the base (the outer edge of base plate and base should be colinear)


After welding the necessary components the final product should look like this.

STEP 13


welding door frames

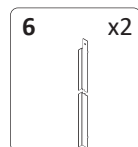

x2


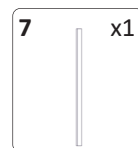


x1

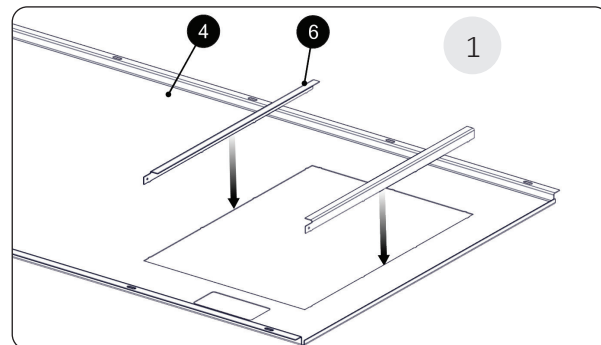

weld the top and bottom frames of the door


Notice: the top and bottom frames the door should be welded in a way that the holes are directing the ports plate cut.

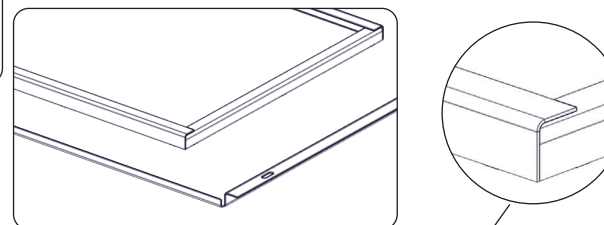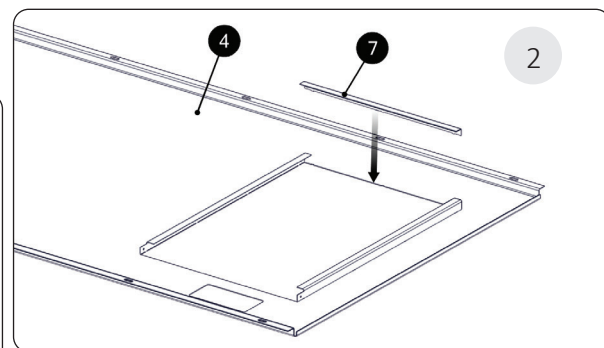


the side door frame (7) should be welded underneath the top and bottom door frame (6).

STEP 14


welding port back plates

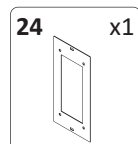



x1

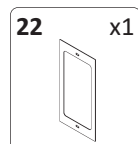

x1

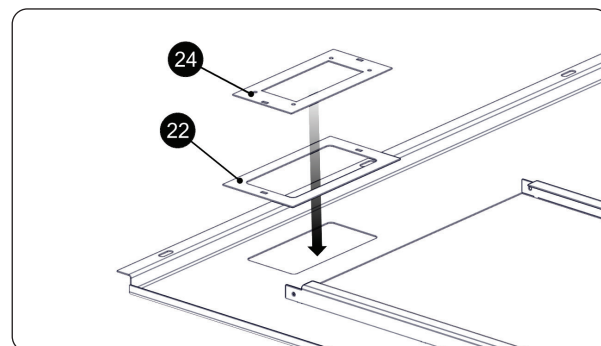


make sure the rectangular cut-out on both plates should be concentric when welding

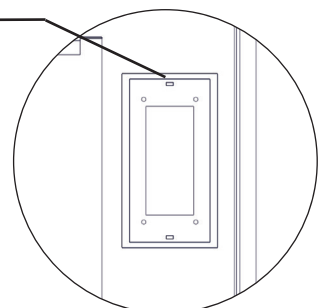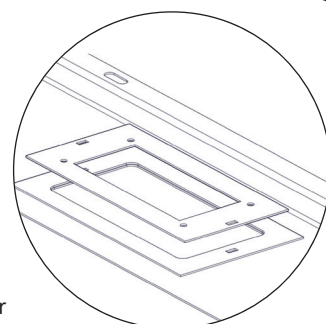


Notice: when welding part 22, make sure the inner cut radius matches with the back cover port cut-out radius.

STEP 15


welding port hardware housing plates

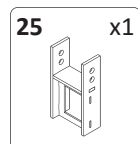


x1

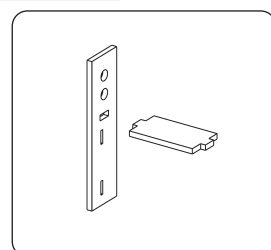


1

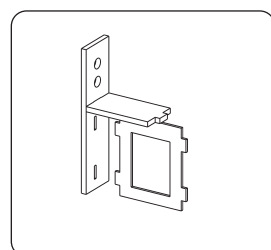

2

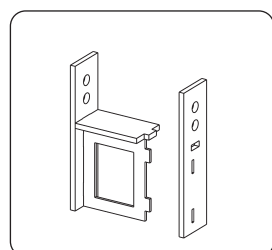


3

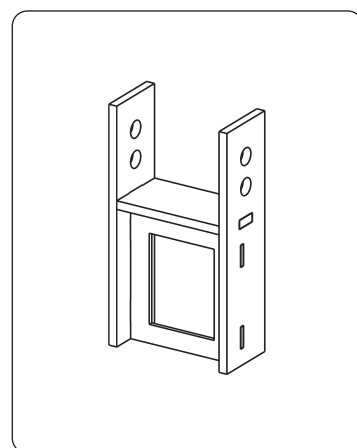



weld each piece respectively after inserting into their respective slot feature.

STEP 16


welding door frames

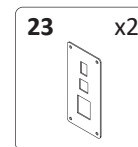


x2

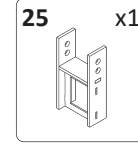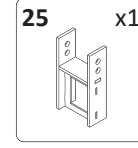


x1

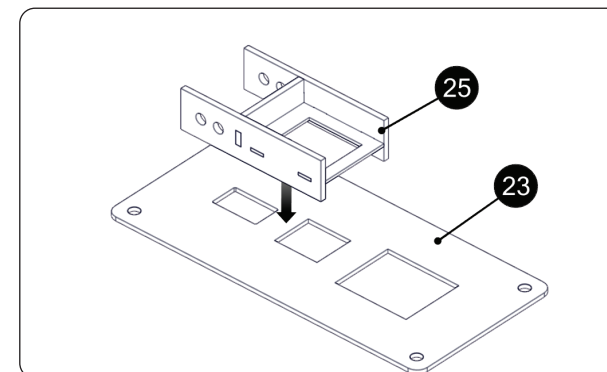

Notice: when welding, the two parts should be symmetrical in the top view.

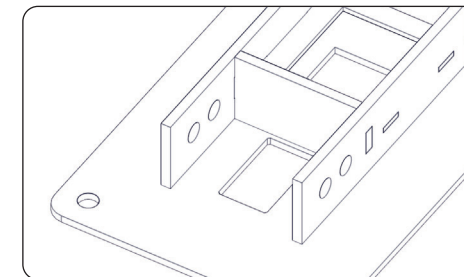

make sure part (25) is not flipped vertically or horizontally. weld them as in this picture.

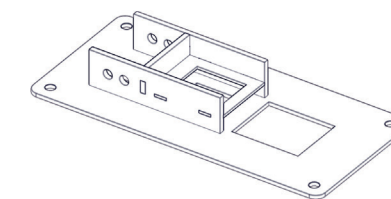

Troubleshooting

The following tips help identify and eliminate common faults and errors.


Issue	solution
Excessive Warping or Distortion	Use intermittent or stitch welding instead of continuous welds. Weld symmetrically and in steps to balance heat input.
Cracks in Welds	Reduce welding speed for better fusion. Clean surfaces thoroughly before welding.
Porosity (Small Holes in Welds)	Clean surfaces before welding. Slow down travel speed to allow gas to escape.
Weak or Incomplete Weld Fusion	Increase welding voltage or amperage.
Excessive Spatter	Reduce welding current.
Undercut (Groove at the Weld Toe)	Reduce welding current and voltage.
Weld Bead Too High or Narrow	Increase heat input by raising voltage/amperage.



Attention

- Ensure Proper Fit-Up Before Welding
 - Misaligned parts can compromise structural integrity.
- Control Heat Input to Prevent Warping
 - Excessive heat can deform the frame, affecting screen installation.
- Do Not Weld Near Electronic Components
 - Heat and electromagnetic interference can damage internal circuits.
- Check Welding Sequence to Prevent Stress Buildup
 - Weld symmetrically and in steps to avoid uneven stress.
 - Over-welding may cause brittleness and premature failure.
- Maintain Consistent Weld Bead Quality
 - Porosity, cracks, or undercuts weaken the structure.
- Post-Weld Cleaning is Mandatory
 - Remove slag, spatter, and oxidation before applying coatings.
 - Clean all welded surfaces to ensure strong adhesion for paint or powder coating.
- Verify Structural Integrity After Welding
 - Perform visual and dimensional inspection before final assembly.
 - Rework or repair any welds that show defects.
- Follow Corrosion Protection Guidelines
 - Apply anti-rust treatment (e.g., zinc primer, powder coating).
 - Store in a dry, controlled environment before installation.

Waste disposal

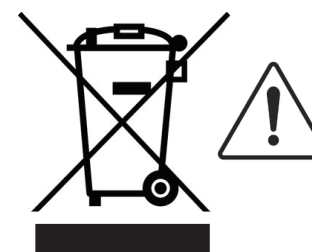

This marking indicates that this product should not be disposed with other household wastes. To prevent possible harm to the environment or human health from uncontrolled waste disposal, recycle it responsibly. To return your used device or unwanted materials please contact the retailer. They can take this product for environmentally safe recycling.

Need more help?

call: +251-911-743-326



www.andinetsolutions.com