Method Statement

Ref. #: DCP00/08-0206-C-2026



DonProof PU-P150

(Spray applied, pure polyurea membrane for waterproofing and protection)

Table of Content

SECTION A: GENERAL COMMENTS	3
General Notes	3
High-Temperature Working	3
Low-Temperature Working	3
Storage	3
System Products	3
Tools and Equipment	4

SECTION B: APPLICATION	5
Substrate Preparation	5
Priming	8
Application	9
Protection Coat Application	12
Application Details	12
Cleaning	14
Limitations	14

SECTION C: CAUTIONS	15
Health & Safety	15

SECTION D: APPROVAL AND VARIATIONS	15

Section A: General Comments

General Notes:

The information below is a detailed overview of the application of DCP's **DonProof PU-P150** waterproofing and protection system and should be read in conjunction with the relevant technical data sheet prior to application. All DCP Products should be applied by experienced specialist contractors.

All the points below assume the correct preparation of the relevant surface.

High-Temperature Working:

Application temperature ranges from 5°C to 50°C and relative humidity must not exceed 85%. The substrate's temperature must be at least 3°C above the measured due point temperature if any.

It is suggested that, for temperatures above 35°C, the following guidelines are adopted as good working practice:

i. Unmixed materials and equipment should be stored in a cool place and away from direct sunlight.
ii. Avoid application during the peak temperature of the day.
iii. Ensure proper and adequate ventilation.
iv. Plan for enough materials, tools, and labor to ensure a continuous applicant process.
v. Air temperature, substrate temperature, relative humidity and dew point shall be measured and recorded at regular intervals throughout each working day.

Low-Temperature Working:

It is suggested that, for temperatures below 10°C, the following guidelines are adopted as good working practice:

i. Unmixed materials should be stored in a warm.
ii. Cold temperatures will affect the properties of the material.
iii. Avoid applying the material if the temperature is around 5°C and falling.
iv. Do not apply under rain or snow, and avoid dew points conditions during application.

Storage:

Store all products in their original sealed containers in a dry, covered and shaded area, within the storage temperature range stated in the relevant TDS. Protect from moisture and freezing. Keep containers tightly closed when not in use.

System Products:

Primer: **DonProof Primer EP** or **DonProof Primer PU**

Waterproofing Membrane: **DonProof PU-P150**

Tools and Equipment:

It is suggested that the following list of equipment are adopted as a minimum requirement

Personal protection	:	*Protective overalls*
	:	*Goggles or a face mask*
	:	*Good quality gloves*
	:	*Safety shoes*
	:	*Safety helmet*
Preparation equipment	:	*Concrete vacuum (Fig.1)*
	:	*Grit blasting machine (Fig.2)*
	:	*Brush (Fig.3)*
	:	*Grinding machine (Fig.4)*
Mixing equipment	:	*Power-whisk fitted in a heavy-duty slow speed electric drill (Fig.5)*
	:	*Empty bucket (25 litre) (Fig.6)*
Application equipment	:	*Roller (Fig.7)*
	:	*Two Component spray machine with a hose (Fig.8)*

[For more details refer to the Applications section (Fig.5 – 8)]





Fig.1: Concrete vacuum



Fig.2: Grit blasting machine



Fig.3: Brush



Fig.4: Grinding machine



Fig.5: Power-whisk fitted in a heavy-duty slow speed electric drill



Fig.6: Empty bucket



Fig.7: Roller



Fig.8: Two Component spray machine with a hose

Section B: Application

1.0 Substrate Preparation




1.1 Concrete Substrates

1.1.1 New concrete or cementitious substrates should be at least 28 days old. Maximum relative humidity should not exceed 80%. Perform a relative humidity test using in situ devices according to ASTM F2170.

1.1.2 The substrate (new or existing) should be dry, smooth, clean, sound, and free from any contamination such as mortar and paint splashes, curing compounds, silicones, oil, and grease.

1.1.3 Excess laitance deposits are best removed by grit blasting or wire brushing followed by vacuum cleaning to remove dust debris. All preparation equipment should be of a type approved by DCP.

1.1.4 Concrete surface should achieve a minimum surface roughness of (CSP 3 to 6), in accordance with the following ICRI recommendations:

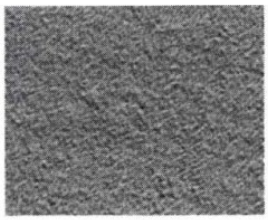

CSP 1
(acid etched)




CSP 2
(grinding)



CSP 3
(light shotblast)




CSP 4
(light scarification)

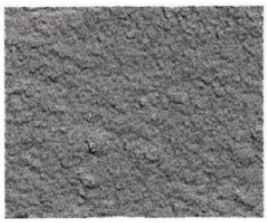


CSP 5
(medium shotblast)



CSP 6
(medium scarification)

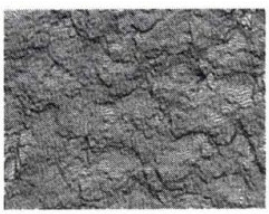

CSP 7
(heavy abrasive blast)

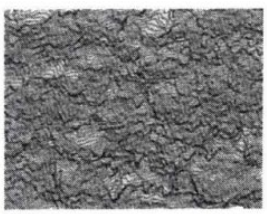

CSP 8
(scabbled)



CSP 9
(heavy scarification)

1.1.5 The processes to eliminate the laitance on the concrete and to open the pore of it, are:

- **Grinding/Milling:** Using a rotary machine with specialty grinding wheels with tungsten carbide; this method is suitable for removing concrete paste and other hard substances. It causes surface erosion by rubbing with stones or hard sanding discs. This removes the softest parts of the surface, for example, surface laitance, which sometimes occurs during concrete pouring or curing. But is not suitable for soft existing coatings or when the friction caused by heat meets this product.




- **Shot blasting:** involves the projection or direct impact of steel grit of different sizes on the concrete's surface. This process produces very little dust. Some water cleaning or vacuuming may be required after the use of this method. This is effective for the removal of concrete surface paste, sealers, and hard coatings. Speed and number of passes over an area determine the depth of removal. Edging and small spaces are not susceptible to this type of removal without small specially designed equipment.



- **Sandblasting:** It uses sand or a type of abrasive shot by compressed air through a nozzle. Sandblasting is recommended for horizontal, vertical, and overhead use. This method is recommended for the removal of the surface of concrete, existing sealers, and hard coatings. The creation of dust may be prohibited by environmental regulation. Vacuum mechanisms are available to remove dust from the air. Wet sandblasting is available that complies with environmental regulations. This method of surface preparation, while highly effective, has lost utility where environmental regulation has restricted its use.



- **Scarifying:** Generally, employs a rotary machine. This method utilizes specialty blades or impact devices to break the surface of concrete or coatings. Several passes over the same area may be required to remove the existing surface completely. In the case of elastomeric surface coatings, blade shaving may be the only effective method of removal where water use is a problem. Most sealers and coatings will not allow removal by acid etching. Most elastomeric coatings tend to "bounce" shot blasting.

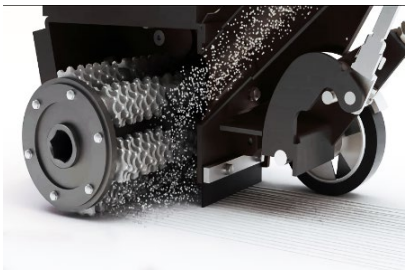

Notes:

- *Applicator must decide in each case the most suitable method, depending on the conditions of the substrate or surface or the desired result (always in combination with the primer to be used).*
- *To complete these processes prior to application, the substrate must be cleaned using aspiration equipment, thus avoiding the need to use water as this could hamper adherence of the membrane.*

1.1.6 A Surface defects and imperfections such as voids, small cracks, and blowholes should be repaired before application using **Quickmast 341** epoxy paste to prevent material flowing into them.



1.1.7 Substrate should be free of any standing water and does not suffer from conditions of rising damp, as this will negatively affect the membrane's adhesion.

1.1.8 If the substrate is known to suffer from rising damp, a damp-proof membrane should be used.

1.1.9 Concrete moisture content shall be verified prior to priming using a suitable test method approved by the Engineer. Where moisture exceeds the stated limit, consult DCP Technical Department for a suitable damp-tolerant primer system.

1.2 Metal Substrates


1.2.1 Most metallic surfaces will require blast cleaning using either a dry blast of silica sand or water/wet blasting.



1.2.2 Subsequent cleaning of these metals should be carried out using pressurized water or acetone-based solvents to simultaneously clean and remove any grease from the surface.

1.2.3 In many cases, surface passivation is required before application of the products.

1.2.4 All steel surfaces should be grit blasted to reach a bright, near white finish meeting the requirement of Swedish Standard SA 2 1/2 or according to the SSPC- SP10.

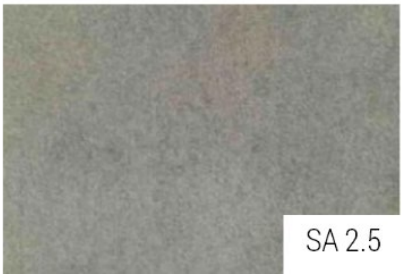

1.2.5 After the abrasion process, and before the waterproofing system application, it is necessary to apply corrosion inhibitor products.

1.3 Ceramic Substrates

1.3.1 A dry-cleaning method should be used to avoid water penetration inside the tiling, and between the intermediate layers, with which evaporation is very slow.

1.3.2 The ceramic floor surface is sanded to achieve open pores of the ceramic surface.

1.3.3 If water is used for cleaning, the humidity of the substrate or water retained inside the material's layers should be checked, to decide when to continue the application.

1.3.4 All tile joints or sores should be checked, grouted and repaired where required.

1.4 Joints and moving cracks:

1.4.1 **DonProof PU-P100** shouldn't be installed over any non-filled/sealed joints or moving cracks.

1.4.2 Open up and clean the existing joints between the concrete slab and vacuum thoroughly**.**

1.4.3 All dust, loose and friable material must be removed from all joint voids before application of any joint sealant.

1.4.4 All existing joints such as (expansion, isolation, construction, and control joints) as well as all moving cracks, must be sealed using **Flexseal PU425/PU440**.

2.0 Priming

2.1 Concrete Substrates [**DonProof Primer EP**]

2.1.1 Immediately prior to priming, the substrate should be thoroughly cleaned to remove any remaining traces of dust or other loose material.

2.1.2 Stir individual components of **DonProof Primer EP** and ensure that the bottom and sides are thoroughly scraped.

2.1.3 Transfer the entire content of the hardener into the base and mix for 2 - 3 minutes using a slow-speed mixer fitted with a suitable paddle.

2.1.4 Use brush or short hair lambs wool roller for application to the prepared surface.

2.1.5 Prime with **DonProof Primer EP** at a rate of (5 m^2/kg per coat) to achieve a dry film thickness of 200 microns per coat and allow to dry.

2.1.6 Allow to dry fully for 12 - 24 hours @ 25°C before applying **DonProof PU-P150**.

2.1.7 The primer should be protected from damp, condensation, and water for at least 24 hours.

2.1.8 If a second coat is required, apply a second coat of the primer within its overcoating time.

Note: Avoid any primer ponding on the floor.



2.2 Steel and Galvanized Steel Substrates [**DonProof Primer PU**]

2.2.1 Immediately prior to priming, the substrate should be thoroughly cleaned to remove any remaining traces of dust, rust, or other loose material.

2.2.2 Stir the product well before use.

2.2.3 Use brush or a roller for application to the prepared surface.

2.2.4 Prime with one coat or two successive coats of **DonProof Primer PU** at a rate of (5 - 10 m²/kg per coat) to achieve a dry film thickness of 40 - 80 microns per coat and allow to dry.

2.2.5 Allow to dry fully for 24 - 48 hours @ 25°C before applying **DonProof PU-P150**.

2.2.6 The primer should be protected from damp, condensation, and water for at least 24 hours.

2.2.7 If a second coat is required, apply a second coat of the primer within its overcoating time.

Note: Avoid any primer ponding on the floor.

Notes:

- *It is recommended to test the adhesion between the substrates and **DonProof PU-P150** on small area onsite prior to proceeding with the works in order to ensure that the substrate is well prepared and compatible with the product and primer.*
- *Contact DCP Technical Department for best priming options for non-porous substrates such as steel and ceramic tiles, as well as for other substrate types based on project conditions.*

3.0 Application

3.1 Stir Stir/mix component B (resin) well before using a drum stirrer to homogenize the pigment and disperse any settlement. Failing to do so may cause color variances, foaming, sticky coating, and negatively affect **DonProof PU-P150** performance.

3.2 Prevent exposing the material to moisture once opened.

Application machine:


DonProof PU-P150 is hot spray applied; the machine should have the below properties:

- Two components high-pressure heated spray machine (2.500 - 3.000 psi).
- Heater temperature of 70 – 75°C.
- Hose temperature of ±70°C.
- The material transfer pumps shall have 2 times the volume output of spray equipment/gun combination.

	Component A (Iso)	**Component B (Resin)**
Colour:	Clear brown	Coloured per request
Density: ISO 1675	1.10 ± 0.01 g/cm³	1.07 ± 0.01 g/cm³
Viscosity @ 23°C: N_2S_{50}	400 - 800 cps	400 - 800 cps
Mix ratio:		
by weight	1.03	1.00
by volume	1.00	1.00

Note: Consult DCP Technical Department for specific recommendations for the application machine.

3.3 Insert the pumps into the drums and connect the hoses to the equipment.

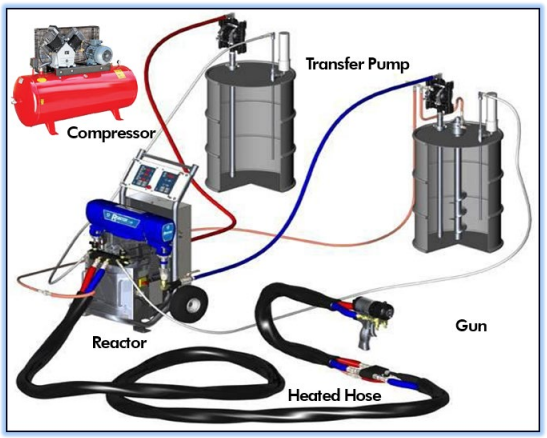

3.4 Set up the hoses and machine temperatures, both components must be heated up to approximately 75C.

3.5 Start the equipment following the spray machine manufacturer instructions.

3.6 **DonProof PU-P150** should always be spray applied perpendicular to the substrate regardless of whether the surface is horizontal or vertical. Otherwise, it will cause gaps in the layer and an incomplete seal. Apply crossed coat continuously as needed to achieve the desired thickness.

3.7 On horizontal surface applications, a texture "stipple" coat can be applied for non-skid purposes, after reaching the initial desired film thickness.

3.8 The use of wire or fiber trim tape shall be used to create straight edges when terminating the sprayed Polyurea.

3.9 Duct tape or masking tape can be used but must be removed immediately after spraying whilst the Polyurea is still gelling to form a defining straight edge.





3.10 Apply crossed coat continuously as needed to achieve the desired thickness according to the final use.

3.11 When utilizing a cross-hatch spray pattern, the minimum suggested application thickness for **DonProof PU-P150** is typically 1.4 mm.

3.12 Recommended consumption is approximate: 1.6 kg/m² to provide 1.5 mm dry film thickness.



3.13 All 90-degree internal corners shall be strip coated and allowed to gel prior to application of the finish coat of Polyurea

3.14 Apply the full DFT application immediately in any one work area before moving on to the next work section.

3.15 A visual inspection shall take place for any pinholes and or defects that will require repair by respraying.

3.16 Any defects found shall be identified by marking with marker pen (not wax crayon) and immediately spot resprayed with Polyurea.

3.17 This operation shall be done within a 4 hours window of initial application otherwise re priming will be a requirement.

3.18 After being applied, the material is suitable for light foot traffic after about 12 hours, and is completely functional after about 2 - 3 days according to the final use or technical requirements.



3.19 Quality Control

3.19.1 Dry film thickness shall be verified using a suitable gauge appropriate to the substrate, and material consumption reconciled against area covered.

3.19.2 The completed membrane shall be checked for continuity by visual inspection and, where specified, by holiday detection and/or flood testing.

3.19.3 Any non-conforming areas shall be marked, repaired in accordance with clauses 3.16 - 3.17, and re-tested.

3.19.4 A daily application log shall be maintained, recording environmental conditions, batch numbers, application parameters, thickness readings and any repairs.


4.0 Protection Coat Application

4.1 As with all aromatic coatings, **DonProof PU-P150** should be sealed with a suitable polyurethane protection coat to prevent yellowing due to UV rays exposure. However, this will not cause any negative effect on the physical properties of the product.


4.2 Consult DCP Technical Department for specific recommendations to guarantee the durability.

5.0 Application Details


Parapet Flashing

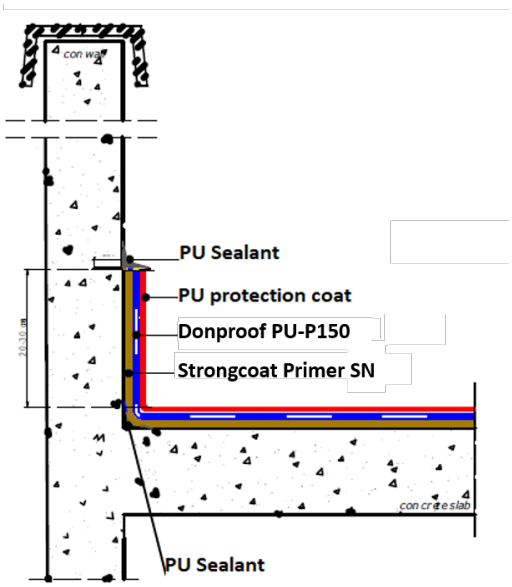


Rain Water Outlet

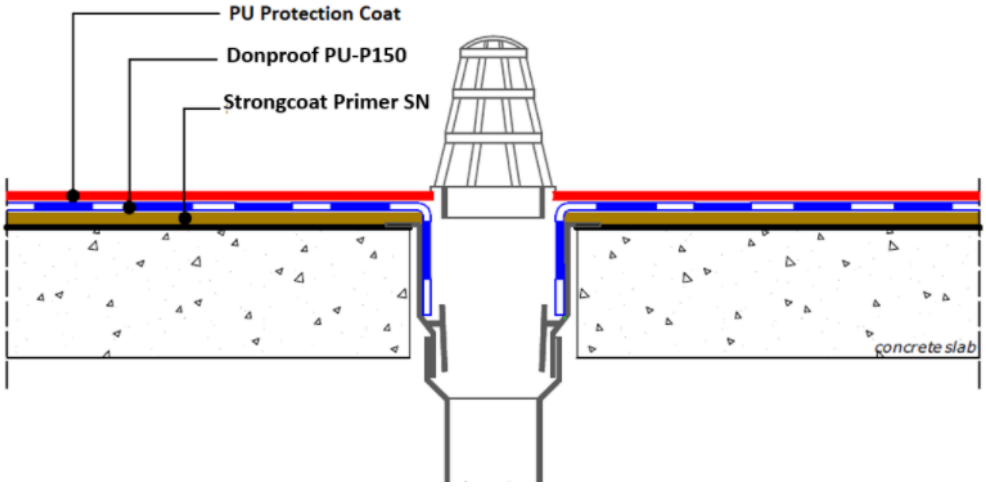


Concrete Surface

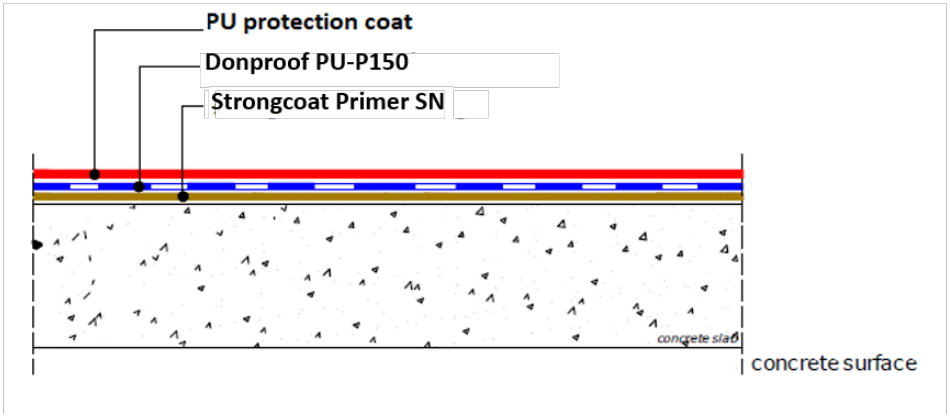


Green Roof

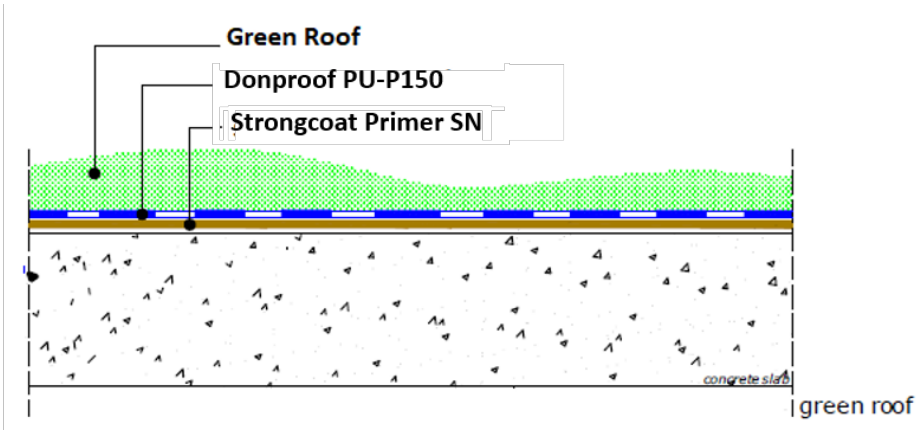


Joints

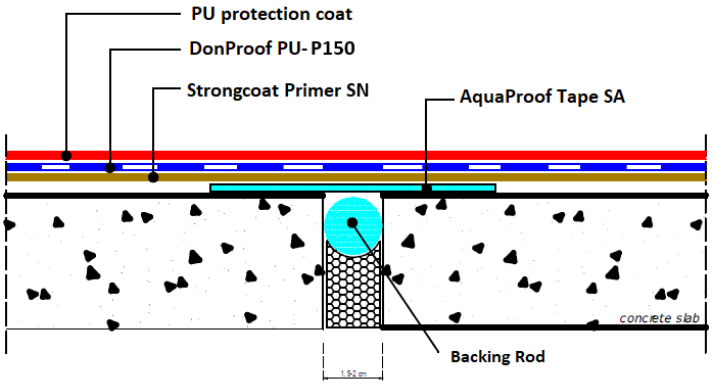

High Movement expansion Joints

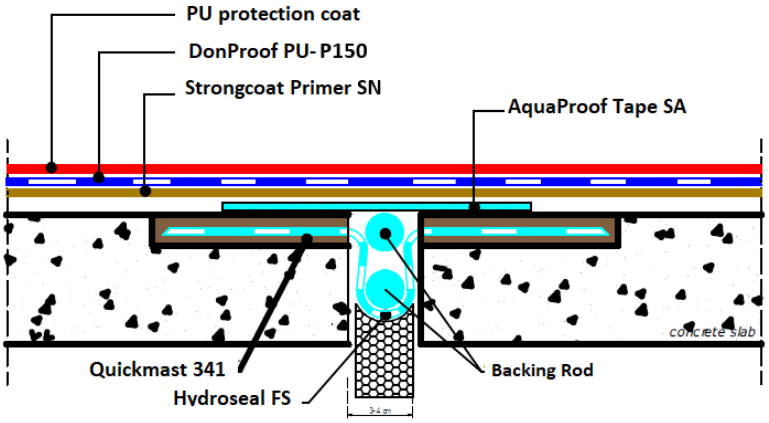

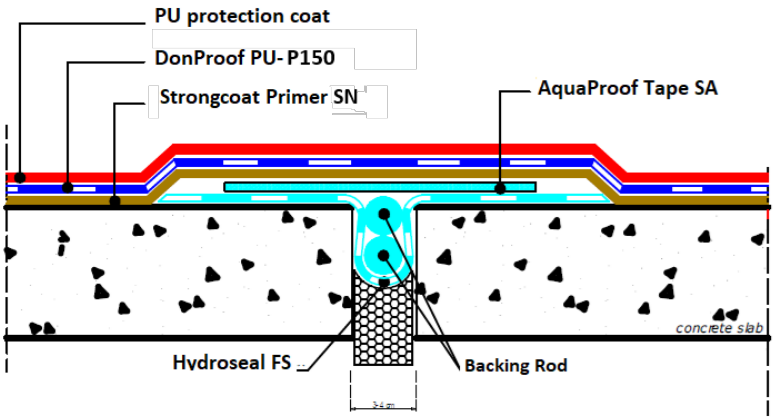

6.0 Cleaning

6.1 Tools and equipment can be cleaned with a suitable solvent and diluent, refer to the spray machine manufacturer for specific recommendations depending on the machine used.

7.0 Limitations

7.1 Special care should be taken to provide an unbroken coating at external corners and similarly exposed protrusions.

7.2 **DonProof PU-P150** doesn't require any special curing but must be protected from rain, and water until the coating has been cured.

7.3 Application should not be carried out when there is standing or running water.

Section C: Cautions

Health and safety

- Apply in well-ventilated areas. In closed areas use force ventilation and wear approved respirators when necessary.
- **DonProof PU-P150** should not come into contact with skin and eyes. In case of contact with eyes wash immediately with plenty of water and seek medical advice promptly.
- Vapor and atomized liquids are harmful.
- Use rubber gloves, remove them immediately after contamination. Wear clean body covering.
- Use respiratory protection when handling or spraying use an air-purifying respirator.
- Wash thoroughly with soap and water after work and before eating, drinking, or smoking.
- Wear safety goggles to prevent splashing and exposure to particles in the air.
- Waste generation should be avoided or minimized. Incinerate under controlled conditions in accordance with local laws and national regulations

Fire:

DonProof PU-P150 is nonflammable. Do not use near-high heat or open flame.

For further information on refer to the Material Safety Data Sheet.

Section D: Approval and Variations

This method statement is offered by DCP as a 'standard proposal' for the application of **DonProof PU-P150**. It remains the responsibility of the Engineer to determine the correct method for any given application. Where alternative methods are to be used, these must be submitted to DCP for approval, in writing, prior to commencement of any work. DCP will not accept responsibility or liability for variations to the above method statement under any other condition.