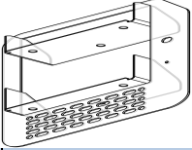
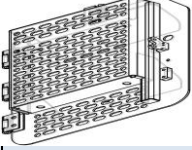
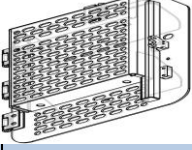
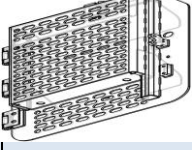
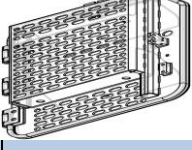
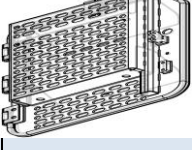


	A	B	C	D	E	F	G
1	Sub-Assembly Index						
2	Index	Operation	Part Name	Part No.	Rev.	Assembly Pic	Remarks
3	1	OP-10 A	SUB-ASSY -92187146-1 -Door WA,LH,952NX, Rev-C	92187146-1	C		
4	2	OP-10 B	SUB-ASSY -92187146-2 -Door WA,LH,952NX, Rev-C	92187146-2	C		
5	3	OP-20	Full Welding -92187146-Door WA,LH,952NX, Rev-C	92187146	C		
6	4	OP-30	Painting (DOOR, ASSY, LH, 952NX-92244728) (Power Tan -Std-86628042)	92244728			
7	5	OP-40	FINAL ASSEMBLY (92187158-DOOR, ASSY, LH, 952NX) Rev-C	92187158	C		
8	6	OP-50	FINAL INSPECTION (92187158-DOOR, ASSY, LH, 952NX) Rev-C	92187158	C		

	A	B	C	D	E	F	G	H	I	J	K	L	M	N	O	P	Q	R	
1		METALMAN AUTO PVT LTD.												Format No. : F/NPD/06					A
2		PLOT NO. 116, SECTOR-3 PITHAMPUR												Released on :-					
3		PROCESS FLOW DIAGRAM												Revised on :-					
4														Revision No. :-					
5	Part Description		DOOR PWRTAN, LH, 952NX			Part Number		92187158		Revision Number :-				Rev. Date		28-05-2026			
6	Core Team														Last Review Date		28-05-2026		
7	Operation No	OPERATION	MOVEMENT	INSPECTION	STORE	Operation Description	Machine, Device, Jig, Tools for mfg	List of Parts and Sub Assemblies				Evaluation and Analysis Methods							
8																			
9	OP-10A							SUB-ASSY -92187146-1 -Door WA,LH,952NX, Rev-C											
10	10	●				Child part collection	N/A	Part No. : 92187151 92187148 92187147				1.ENSURE ALL CHILD PARTS AVAILABILITY. 2.ENSURE ALL PARTS ARE OK							
11	20	●				Tack Welding	Welding Fixture (WF No. : MAPL-92187146-1-OP-10A)					1.ENSURE CLAMPING BEFORE WELDING 2.ENSURE WELDING PARAMETERS BEFORE STARTING WELDING 3.ENSURE WELDING TACK WILL DO IN SPECIFIED AREA AND DO NOT TACK IN NO WELD AREA. 4.OK PARTS MOVED FOR FULL WELDING 5.NOT OK MATERIAL TO BE REWORK AND THEN SEND FOR FULL WELDING 6.REJECTED MATERIAL TO BE REJECT AND THEN SEND IN SCRAP AREA.							
12	30	●				Full Welding	Welding Fixture (WF No. : MAPL-92187146-1-OP-10A)					1.ENSURE WELDING PARAMETERS BEFORE STARTING WELDING 2.OK MATERIAL MOVED FOR FINISHING 3. NOT OK MATERIAL TO BE REWORK AND THEN SEND FOR NEXT PROCESS 4. REJECTED MATERIAL TO BE REJECT AND THEN SEND IN SCRAP AREA.							
13	40	●				Finshing/Deburring	Grinder / Chise / Grinding Wheel					1.ENSURE PROPER FINISHING 2.OK MATERIAL MOVED IN NEXT PROCESS 3.NOT OK MATERIAL TO BE REWORK AGAIN AND THEN CHECK AND THEN SEND TO NEXT PROCESS.							
14	50		▶			Move for Next Process						MOVE SUB ASSEMBLY IN DECIDED STATION FOR NEXT PROCESS							
15	OP-10B							SUB-ASSY -92187146-2 -Door WA,LH,952NX, Rev-C											
16	10	●				Child part collection	N/A	Sub Assemblies : OP-10 A Part No. : 92281502 92187149 92187145 92218240 92218241 92217650 92217651 92217652 90451393 92281539				1.ENSURE ALL CHILD PARTS AVAILABILITY. 2.ENSURE ALL PARTS ARE OK							
17	20	●				Tack Welding	Welding Fixture (WF No. : MAPL-92187146-2-OP-10B)					1.ENSURE CLAMPING BEFORE WELDING 2.ENSURE WELDING PARAMETERS BEFORE STARTING WELDING 3.ENSURE WELDING TACK WILL DO IN SPECIFIED AREA AND DO NOT TACK IN NO WELD AREA. 4.OK PARTS MOVED FOR FULL WELDING 5.NOT OK MATERIAL TO BE REWORK AND THEN SEND FOR FULL WELDING 6.REJECTED MATERIAL TO BE REJECT AND THEN SEND IN SCRAP AREA.							
18	30	●				Full Welding	Welding Fixture (WF No. : MAPL-92187146-2-OP-10B)					1.ENSURE WELDING PARAMETERS BEFORE STARTING WELDING 2.OK MATERIAL MOVED FOR FINISHING 3. NOT OK MATERIAL TO BE REWORK AND THEN SEND FOR NEXT PROCESS 4. REJECTED MATERIAL TO BE REJECT AND THEN SEND IN SCRAP AREA.							
19	40	●				Finshing/Deburring	Grinder / Chise / Grinding Wheel					1.ENSURE PROPER FINISHING 2.OK MATERIAL MOVED IN NEXT PROCESS 3.NOT OK MATERIAL TO BE REWORK AGAIN AND THEN CHECK AND THEN SEND TO NEXT PROCESS.							
20	50		▶			Move for Next Process						MOVE SUB ASSEMBLY IN DECIDED STATION FOR NEXT PROCESS							
21	OP-20							Full Welding -92187146-Door WA,LH,952NX, Rev-C											

	A	B	C	D	E	F	G	H	I	J	K	L	M	N	O	P	Q	R
22	10	●				Child part collection	N/A	Sub Assemblies : OP-10 B				1.ENSURE ALL CHILD PARTS AVAILABILITY. 2.ENSURE ALL PARTS ARE OK						
23	20	●				Full Welding	Welding Fixture (WF No.: MAPL- 92187146-3-OP- 20)					1.ENSURE WELDING PARAMETERS BEFORE STARTING WELDING 2.OK MATERIAL MOVED FOR FINISHING 3. NOT OK MATERIAL TO BE REWORK AND THEN SEND FOR NEXT PROCESS 4. REJECTED MATERIAL TO BE REJECT AND THEN SEND IN SCRAP AREA.						
24	30	●				Finshing/Deburring	Grinder / Chise / Grinding Wheel					1.ENSURE PROPER FINISHING 2.OK MATERIAL MOVED IN NEXT PROCESS 3.NOT OK MATERIAL TO BE REWORK AGAIN AND THEN CHECK AND THEN SEND TO NEXT PROCESS.						
25	40		▶			Move for Next Process						MOVE SUB ASSEMBLY IN DECIDED STATION FOR NEXT PROCESS						
26	OP-30							Painting (DOOR, ASSY, LH, 952NX-92244728) (Power Tan -Std-86628042)										
27	10		▶			Transportation to pretreatment (Material through trolley)	Transport Trolly	Sub Assemblies : OP-10 B,OP-20-1Nos				USE METALIC TROLLY FOR DOOR MOVEMENTS						
28	20	●				Knock of Degrease	Tank					Chemical Name : 1. Bonderite AK - 5055 (Make-Henkel) 2. Bonderite C-AD 550 (Make-Henkel)						
29	30	●				Degrease	Tank					Chemical Name : 1. Bonderite AK - 5055 (Make-Henkel) 2. Bonderite C-AD 550 (Make-Henkel)						
30	40	●				Water Rinse 1	Tank					Chemical Name : Industrial Water (Make-AKVN)						
31	50	●				Water Rinse 2	Tank					Chemical Name : Industrial Water (Make-AKVN)						
32	60	●				Surface Activation	Tank					Chemical Name : 1. Bonderite AC 50 (Make-Henkel) 2. Neutralizer 565 (Make-Henkel) 3. DM Water						
33	70	●				Phosphate	Tank					Chemical Name : 1. Bonderite mad-131 (Make-Henkel) 2. Bonderite 2030 A (Make-Henkel) 3. Bonderite 2030 E (Make-Henkel) 4. Neutralizer 565 (Make-Henkel) 5. Bonderite C 16 (Make-Henkel)						
34	80	●				Water Rinse 03	Tank					Chemical Name : DM Water (Make-Inhouse)						
35	90	●				Water Rinse 04	Tank					Chemical Name : DM Water (Make-Inhouse)						
36	100	●				PTRCDM	Tank					Chemical Name : DM Water (Make-Inhouse)						

	A	B	C	D	E	F	G	H	I	J	K	L	M	N	O	P	Q	R
37	110	●				CED Coating	Tank					Chemical Name : 1. Additive - M (Make-Burger) 2. Additive - S (Make-Burger) 3. HG 350 E Pigment Paste F-1 (Make-Burger) 4. HG 350 E Resin Emulsion F-2 (Make-Burger)						
38	120	●				Ultra Filtration	Tank					Use DM Water to remove extra paint form part surfaces						
39	130	●				EDRCDM	Tank					Chemical Name : DM Water (Make-Inhouse)						
40	140	●				Unloading	Through Crane					UNLOADING THE DOOR AFTER CED COMPLITION.						
41	150	●				Baking	Ovan					Chemical Name : PNG (Make-Avantika)						
42	160	●				Putty Application & Finishing	Manual / Sander					PUTTY APPLICATION TO BE DONE FOR PROPER FINISHING OF THE DOOR SURFACES AND FINISH THE SURFACES WITH EMERY PAPER AND SANDERING						
43	170	●				Cleaning						1.AIR CLEANING 2.TAGORAT CLEANING						
44	180			■		Inspection (Quality Gate No.-2 & 3)						1. SEALANT APPLICATION INSPECTION. 2. BEFORE TOP COAT INSPECTION.						
45	190	●				Final Paint	Paint Spray Gun					1.APPROVED SOURCE PAINT WILL BE USED ONLY. 2.PAINT, HARDENER AND THINNER MIXTUR AS PER WORK INSTRUCTION						
46	200	●				Baking	Ovan					1.TEMPERATURE TO BE MAINTAIN AS PER WORK INSTRUCTION 2.BACKING TIME TO BE FOLLOWED AS PER WORK INSTRUCTION						
47	210			■		Inspection (Quality Gate No.-4)						AFTER TOP COAT INSPECTION						
48	220				▼	Storage	N/A					STORE ALL MATERIALS AT IDENTIFIED STORE LOCATION						
49	230		▶			Move to next process	N/A					MOVE SUB ASSEMBLY IN DECIDED STATION FOR NEXT PROCESS						
50	OP-40							FINAL ASSEMBLY (92187158-DOOR, ASSY, LH, 952NX) Rev-C										
51	10	●				Child part collection	N/A				Sub Assemblies : OP-30 Part No. : 92244737	1.ENSURE ALL CHILD PARTS AVAILABILITY. 2.ENSURE ALL PARTS ARE OK						

	A	B	C	D	E	F	G	H	I	J	K	L	M	N	O	P	Q	R	
52	20				▼	RUBBER TRACK, BEADING- ASSEMBLY	N/A					1.ENSURE RUBBER TRACK, BEADING PROPER FIT 3.ENSURE RUBBER TRACK, BEADING WILL DO IN SPECIFIED AREA. 4.OK PARTS MOVED FOR FINAL INSPECTION 5.NOT OK MATERIAL TO BE REWORK AND THEN SEND FOR FINAL INSPECTION 6.REJECTED MATERIAL TO BE REJECT AND THEN SEND IN SCRAP AREA.							
53	30		▶			Move for Next Process						MOVE SUB ASSEMBLY IN DECIDED STATION FOR NEXT PROCESS							
54	OP-50							FINAL INSPECTION (92187158-DOOR, ASSY, LH, 952NX) Rev-C											
55	10			■		Inspection (Quality Gate no.-5)	Check Sheets / Measuring Instruments					1. PART FITMENT INSPECTION OF THE DOOR ASSEMBLY.							
56	20	●				Finishing/Cleaning	Cleaner/Cloths					1.ENSURE NO EXTRA WELDING OR WELDING MISSING ON DOOR.							
57	30	●				PDI	PDI Check Sheet					1.FINAL INSPECTION OF THE DOOR AS PER PDI CHECK SHEET 2.PAST OK STICKER IN DOOR ASSY AND THEN MOVE THE DOOR FOR DISPATCH 3.NOT OK DOOR ASSY SEND FOR REWORK							
58	40		▶			Move To Dispatch	N/A					DOOR ASSY TO BE DISPATCH AS PER PACKAGING STANDARD							
59																			
60	CFT Team Members																		
61	Prepared By:		Development			Production			Quality			Purchase			Approved By :				
62																			
63																			
64	Revision History																		
65	Date		Revision Number		CHANGES						Prepared By			Approved By					
66	S				Initial for revision no.														
67	MAPL/PPW/CNH/PFD/92187158/SA							Note :- Refer next PFD's of Q - Sheetmetal Parts, R - Tubular Parts, S - Round Tube, Bars & Angles, T - BOP & Hardwares.											

	A	B	C	D	E	F	G	H	I	J	K	L	M	N	O	P	Q	R	S	T	U	V	W					
1		METALMAN AUTO PVT LTD.												Format No. : F/NPD/06														
2		PLOT NO. 116, SECTOR-3 PITHAMPUR												Released on :-														
3		PROCESS FLOW DIAGRAM												Revised on :-														
4														Revision No. :-														
5	DOOR PWRTAN, LH, 952NX		DOOR PWRTAL LH 952NX		Part Number		92187158		Revision Number :- "A"				Rev. Date		28-05-2026													
6	Core Team												Last Review Date		28-05-2026													
7																												
8																												
9	Operation No	OPERATION	MOVEMENT	INSPECTION	STORE	Operation Description	Machine, Device, Jig, Tools for mfg	List of Parts and Sub Assemblies						Evaluation and Analysis Methods														
10	10	●				Raw Material Procurement	N/A	Sheetmetal Parts : 92187151-1Nos 92187148-1Nos 92187147-1Nos 92281502-1Nos 92187149-1Nos 92187145-1Nos 92218240-1Nos 92218241-1Nos 92217650-1Nos 92217651-1Nos 92217652-1Nos 92281539-1Nos						1.BUGHT ALL MATERIALS FROM APPROVED SOURCE ONLY 2.APPROVED SOURCE MATERIAL WILL MOVE IN RQC FOR INSPECTION 3.REJECTED AND SEND BACK MATERIAL TO SUPPLIER AND INFORM TO PURCHASE IF ANY MATERIAL RECEIVED FROM NON-APPROVED SOURCE														
11	20			■		Incoming inspection	Measuring Instruments	Sheetmetal Parts : 92187151-1Nos 92187148-1Nos 92187147-1Nos 92281502-1Nos 92187149-1Nos 92187145-1Nos 92218240-1Nos 92218241-1Nos 92217650-1Nos 92217651-1Nos 92217652-1Nos 92281539-1Nos						1.INCOMING OF MATERIAL 2.MATERIAL OFFER TO RQC 3.QUALITY INSPECTION FOR INCOMING PARTS 4.OK MATERIAL MOVED TO STORE 5.REJECTED MATERIAL SEND TO SUPPLIER END 6.IF ANY REWORK FOUND THEN INFORM TO SUPPLIER FOR REWORK AND AFTER REWORK INSPECTION WILL BE DONE FOR 100% PARTS BY RQC														
12	30				▼	STORAGE		Parts List for Storage : 92187151-1Nos 92187148-1Nos 92187147-1Nos 92281502-1Nos 92187149-1Nos 92187145-1Nos 92218240-1Nos 92218241-1Nos 92217650-1Nos 92217651-1Nos 92217652-1Nos 92281539-1Nos						1.STORE ALL MATERIALS AT IDENTIFIED STORE LOCATION 2.ENSURE STORAGE AREA SHOULD BE FREE FROM MOISTURE AND DUST 3.FFO TO BE MAINTAIN														
13	40	●				Laser Cutting	Laser Cutting m/c	Laser Cutting Parts List : 92187151-1Nos 92187148-1Nos 92187147-1Nos 92281502-1Nos 92187149-1Nos 92187145-1Nos 92218240-1Nos 92218241-1Nos 92217650-1Nos 92217651-1Nos 92217652-1Nos						1.USE OF APPROVED DXF PROGRAM AS PER CURRENT REVISION LEVEL FOR LASERCUTTING. 2.LASERCUTTING MACHINE PM AS PER PM PLAN. 3.OK MATERIAL MOVED IN NEXT PROCESS. 4.MOVED REJECTED MATERIAL IN SCRAP AREA														
14	50	●				Oxy Cutting	Oxy Cutting m/c	Oxy / Plasma Cutting Parts List : 92281539-1Nos						1.USE OF APPROVED DXF PROGRAM AS PER CURRENT REVISION LEVEL FOR OXYCUTTING. 2.OXYCUTTING MACHINE PM AS PER PM PLAN. 3.OK MATERIAL MOVED IN NEXT PROCESS. 4.MOVED REJECTED MATERIAL IN SCRAP AREA														
15	60	●				Drilling	Drilling M/C	Drilling Parts List : 92187145-1Nos 92281539-1Nos						ENSURE DRILLING PARAMETERS BEFORE DRILLING														
16	70	●				Tapping	Tapping done by Manual	Tapping Parts List : 92187145-1Nos 92281539-1Nos						ENSURE TAPPING PARAMETERS BEFORE TAPPING														
17	80	●				Chamfer	Bevel Chamfering M/C	Chamfering Parts List :						ENSURE CHAMFERING PARAMETERS BEFORE CHAMFERING														
18	90	●				Straightening	Rolling M/C	Straightening Parts List :						ENSURE STRAIGHTENING SETTING IS OK														
19	100	●				Bending/ Forming	CNC Press Brake Bending /Roll Bending	Bending Parts List : 92187148-1Nos 92187147-1Nos 92281502-1Nos 92218240-1Nos 92217650-1Nos						1.BENDING MACHINE PM AS PER PM PLAN. 2.OK MATERIAL MOVED IN NEXT PROCESS. 3.NOT OK MATERIAL REWORK TO BE DONE AND THEN INSPECTION. 4.REJECTED MATERIAL MOVED IN SCRAP AREA														
20	110				▼	Storage	N/A	Parts List for Storage : 92187151-1Nos 92187148-1Nos 92187147-1Nos 92281502-1Nos 92187149-1Nos 92187145-1Nos 92218240-1Nos 92218241-1Nos 92217650-1Nos 92217651-1Nos 92217652-1Nos 92281539-1Nos						STORE ALL MATERIALS AT IDENTIFIED STORE LOCATION														
21	120		▶			Move for Next Process	N/A							MOVE ALL MATERIALS IN DESIDED STATION FOR WELDMENT ASSEMBLY														
22	CFT Team Members																											
23	Prepared By:		Development				Production				Quality				Purchase				Approved By :									
24																												
25																												
26	Revision History																											

	A	B	C	D	E	F	G	H	I	J	K	L	M	N	O	P	Q	R	S	T	U	V	W						
27	Date		Revision Number		CHANGES								Prepared By			Approved By													
28					Initial for revision no.																								
29	MAPL/PPW/CNH/PFD/92187158/Q							Note - Refer next PFD's of Q - Sheetmetal Parts, R - Tubular Parts, S - Round Tube, Bars & Angles, T - BOP & Hardware.																					

	A	B	C	D	E	F	G	H	I	J	K	L	M	N	O	P	Q	R	
1		METALMAN AUTO PVT LTD.												Format No. : F/NPD/06					A
2		PLOT NO. 116, SECTOR-3 PITHAMPUR												Released on :-					
3		PROCESS FLOW DIAGRAM												Revised on :-					
4														Revision No. :-					
5	Part Description		DOOR PWRTAN, LH, 952NX			Part Number		92187158		Revision Number :-			Rev. Date		28-05-2026				
6	Core Team														Last Review Date		28-05-2026		
7	Operation No	OPERATION	MOVEMENT	INSPECTION	STORE	Operation Description	Machine, Device, Jig, Tools for mfg	T - BOP & Hardwares											
8									Part Number	92187158									
9	10					Brought-out Material Procurement	N/A	BOP Part No. : 90451393-3Nos 92244737-2Nos		1.BUGHT ALL MATERIALS FROM APPROVED SOURCE ONLY 2.APPROVED SOURCE MATERIAL WILL MOVE IN RQC FOR INSPECTION 3.REJECTED AND SEND BACK MATERIAL TO SUPPLIER AND INFORM TO PURCHASE IF ANY MATERIAL RECEIVED FROM NON-APPROVED SOURCE									
10	20					INCOMING MATERIAL Standard Hardwares- Bolts/Screws/Rivits/Hinge)	Measuring Instruments	BOP Part No. : 90451393-3Nos 92244737-2Nos		1.INCOMING OF MATERIAL 2.MATERIAL OFFER TO RQC 3.QUALITY INSPECTION FOR INCOMING PARTS 4.OK MATERIAL MOVED TO STORE 5.REJECTED MATERIAL SEND TO SUPPLIER END. 6.IF ANY REWORK FOUND THEN INFORM TO SUPPLIER FOR REWORK AND AFTER REWORK INSPECTION WILL BE DONE FOR 100% PARTS BY RQC									
11						Sheet Metal	Measuring Instruments												
12	30						Storage	N/A	For all										
13	40						Move for Next Process	N/A	For all										
14																			
15	CFT Team Members																		
16	Prepared By:	Development				Production				Quality				Purchase		Approved By :			
17																			
18																			
19	Revision History																		
20	Date		Revision Number		CHANGES								Prepared By		Approved By				
21					Initial for revision no.														
22	MAPL/PPW/CNH/PFD/92187158/T							Note :- Refer next PFD's of Q - Sheetmetal Parts, R - Tubular Parts, S - Round Tube, Bars & Angles, T - BOP & Hardwares.											