

SAN TAN PROPERTY INSPECTIONS

Sample Property

Home Inspection Report · Tuesday, April 28, 2026

CLIENT Sample Client	INSPECTOR Jaren Drummond BTR #79346
DATE Tuesday, April 28, 2026	YEAR BUILT 2025
SQUARE FOOTAGE 2185 sq ft	WEATHER Clear · 65°F
ATTENDEES None	REPORT NUMBER #STI-2026-0010

CONDITION CODE LEGEND			
IN	Inspected — Component was inspected and observed.	OK	Satisfactory — No deficiencies noted at time of inspection.
MM	Marginal / Monitor — Minor issue; warrants attention.	RR	Repair / Replace — Deficiency requiring corrective action.
NI	Not Inspected — Could not be inspected due to a limitation.	NP	Not Present — Component is not present at this property.
X	Excluded — Excluded from this inspection.		

TABLE OF CONTENTS

Sample Property

General Summary

Section 1 – Roof

Section 2 – Exterior

Section 3 – Electrical System

Section 4 – Plumbing System

Section 5 – Basement, Foundation & Structure

Section 6 – Garage

Section 7 – Heating / Cooling

Section 8 – Doors, Windows & Interior

Section 9 – Insulation & Ventilation

Section 10 – Built-In Kitchen Appliances

Disclaimer & Inspection Summary

General Summary

Sample Property · Tuesday, April 28, 2026

16

REPAIR / REPLACE

17

MARGINAL / MONITOR

RR Roof

A roof penetration cover or boot is missing or improperly installed. An open or improperly sealed penetration allows water to enter the roof assembly directly. Repair by a licensed roofing contractor is recommended.



Roof west side

RR Exterior

The threshold at the door between the garage and the interior is loose. Recommend tightening by a qualified person.




Garage side entry door

RR Exterior


The sand between the pavers is low/missing. This can start to make the pavers come loose. Recommend repair by a qualified contractor.



Front patio

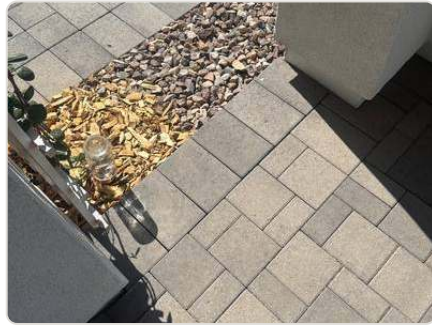

Front patio

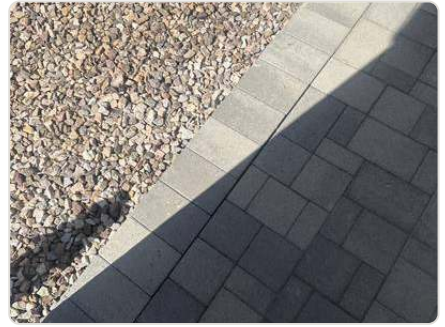

Front patio




Driveway

RR Exterior

East side

The ground does not slope away from the foundation at the indicated location, directing surface water toward the structure. Negative grading is a leading cause of foundation moisture problems. Regrading away from the structure by a licensed contractor is recommended.

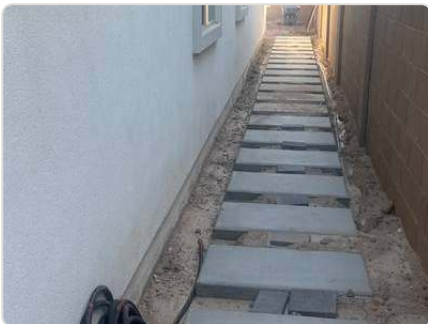

East side



North side



West side

Fence caps loose around perimeter. Recommend repair by a qualified contractor.



East side



East side



North side



North side

RR Plumbing System

Drain stop loose at the indicated area. Recommend repair by a qualified contractor.



Hallway half bathroom



Hallway full bathroom



Master left sink



Master right sink

RR Plumbing System

A faucet is loose or not properly secured at the fixture and won't retract properly. Repair by a qualified contractor is recommended.



Kitchen faucet

RR Garage

The threshold at the door between the garage and the interior is loose. Recommend tightening by a qualified person.



Garage door threshold

RR Garage

The weatherstripping at the occupant door to the garage from the interior of the home is loose and should be repaired. Recommend repair by a qualified contractor.



Garage occupant door

RR Heating / Cooling

Furnace door is missing a screw to hold down the door. Recommend repair by a qualified contractor.



Furnace

RR Heating / Cooling

The air filters are bent and dirty, restricting airflow, reducing efficiency, and shortening system life. The filter should be replaced immediately.

RR Doors, Windows & Interior

Drywall damaged at indicated area. Recommend repair by qualified contractor.



Front entry



Bedroom 2/3 hallway

RR Doors, Windows & Interior

Grout is damaged at the indicated area. Recommend repair by a qualified contractor.



Kitchen

RR Doors, Windows & Interior


Cabinet door is loose at the hinges. Recommend repair by a qualified contractor.



Kitchen

RR Doors, Windows & Interior


Interior door does not properly latch and sticks. Repair by a qualified contractor is recommended.

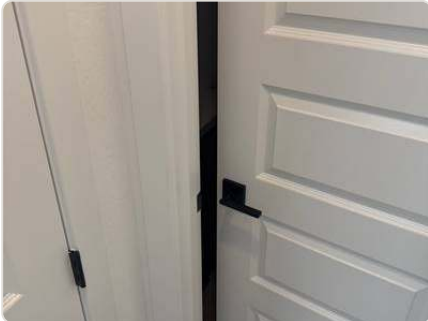

Hallway half bathroom

RR Insulation & Ventilation

The netting holding up the insulation is ripped or torn in areas around the attic. This can lead to the insulation falling over time. Recommend repair by a qualified contractor.

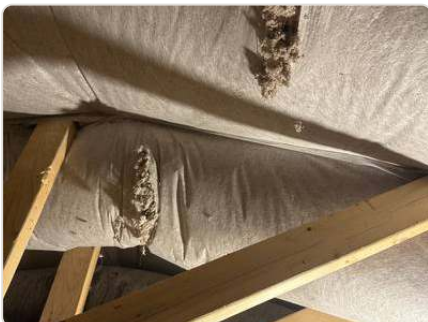

Attic



Attic



Attic

MM Exterior

Cracks are observed in the stucco exterior. Open cracks allow moisture infiltration behind the stucco, potentially causing rot of the wall sheathing and framing behind. Sealing and monitoring by a qualified contractor is recommended.



Garage side entry door



East side



NE corner



West side

MM Exterior

Extra stucco present on siding. Recommend removal and repair by a qualified contractor.



East side

MM Exterior

Paint on stucco is incomplete and does not completely cover the stucco. Recommend repair by a qualified contractor.



Front patio




Front patio

MM Exterior

Exterior door handle/lock not installed straight or is loose. Recommend repair by a qualified contractor.



Garage side entry door

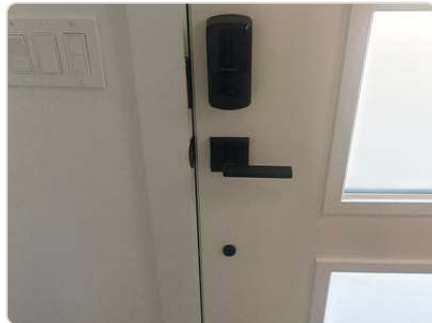

Front door handle

MM Exterior

A gap is present at the exterior door frame allowing air, water, and pest infiltration. Repair or weatherstripping replacement by a qualified contractor is recommended.



Backyard door

MM Exterior

Window screen damaged at indicated area. Recommend repair by a qualified contractor.



West side



West side



Back patio

MM Exterior

Window screen installed backwards. Pull tabs should be facing the inside. The pull tab is also damaged. Recommend repair by a qualified contractor.



North side

MM Exterior

Paint unfinished at the indicated area. Correction is needed by a qualified contractor.



Back porch

MM Exterior

Caulking damaged at the indicated area. Recommend repair by a qualified contractor.



Front patio



Above front door

MM Plumbing System

Shower faucet is loose or not properly secured at the fixture. Repair by a licensed plumber is recommended.



Hallway bathroom

MM Plumbing System

Water pressure is low at sink compared to other sinks in house. Evaluation by a qualified contractor is recommended.



Middle full bathroom

MM Plumbing System

Shower head continues to drip after use. Verify if this is normal for specific shower head or repair and replace as needed.



Master shower head

MM Plumbing System

All hose bib lack a vacuum breaker. Without backflow protection, a submerged hose can back-siphon contaminants from the ground into the potable water supply. Installation of vacuum breakers is recommended.




All exterior hose bibs

MM Basement, Foundation & Structure

Paint missing at stem wall around home. Paint protects the foundation from water. Recommend repair by a qualified contractor.



East side

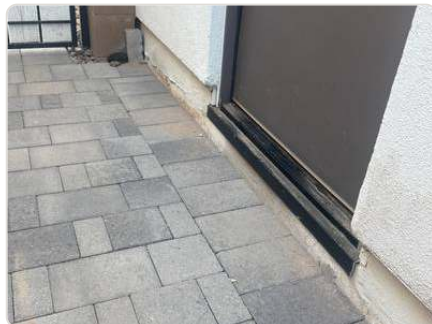

East side

MM Doors, Windows & Interior

A cabinet door or drawer is loose or not operating properly. Repair or replacement by a qualified contractor is recommended.



Kitchen

MM Doors, Windows & Interior

A toilet paper holder is loose at the wall. Re-securing with appropriate anchors by a qualified person is recommended.



Master bathroom

MM Built-In Kitchen Appliances

The garbage disposal produces excessive noise or vibration during operation. Evaluation and repair or replacement by a qualified technician is recommended.



Disposal

The inspector observed roof covering, gutters, downspouts, vents, flashings, skylights, chimneys, and other roof penetrations, and general structure from accessible panels or doors. This inspection was conducted in accordance with the Arizona Standards of Professional Practice for Home Inspectors. The inspector is not required to walk on any roof surface deemed unsafe, predict service life expectancy, or inspect antennae or lightning arresters.

STYLES & MATERIALS

Roof Covering	Concrete Tiles
Viewed Roof Covering From	Ground, Ladder, Binoculars
Roof Type	Gable, Hip
Roof Structure	Trusses, OSB Roof Deck
Method Used to Observe Attic	Partially Accessed

1.0 ROOF COVERINGS

IN OK

1.1 FLASHINGS

IN OK

1.2 SKYLIGHTS, CHIMNEYS AND ROOF PENETRATIONS

IN

RR

1.2(1)

RR



A roof penetration cover or boot is missing or improperly installed. An open or improperly sealed penetration allows water to enter the roof assembly directly. Repair by a licensed roofing contractor is recommended.



Roof west side

1.3 ROOF DRAINAGE SYSTEMS (Gutters and Downspouts)

NP

1.4 ROOF STRUCTURE AND ATTIC

IN

OK

The roof was inspected and reported with the above information. While every effort is made to find all areas of concern, some areas can go unnoticed. Roof coverings can appear intact during inspection and later develop leaks. Recommend a licensed roofer for all repair items.

Exterior

Section 2

The inspector observed wall cladding, flashings, trim, entry doors, windows, decks, balconies, stoops, steps, railings, eaves, soffits, fascias, vegetation, grading, drainage, driveways, patios, and walkways. The inspector is not required to inspect underground drainage, recreational facilities, outbuildings, or irrigation systems.

STYLES & MATERIALS

Siding Material	Stucco, Stone Veneer
Exterior Door Types	Sliding Glass, Metal clad, Metal clad with glass
Window Types	Dual Pane, Single Hung, Slider, Fixed
Driveway and Sidewalks	Concrete, Pavers

2.0(1)

MM



Cracks are observed in the stucco exterior. Open cracks allow moisture infiltration behind the stucco, potentially causing rot of the wall sheathing and framing behind. Sealing and monitoring by a qualified contractor is recommended.



Garage side entry door



East side



NE corner



West side



West side



West side



Front patio column



SW corner of house top of column

2.0(2)

MM



Extra stucco present on siding. Recommend removal and repair by a qualified contractor.



East side

2.0(3)

MM



Paint on stucco is incomplete and does not completely cover the stucco. Recommend repair by a qualified contractor.



Front patio



Front patio

2.1

EAVES, SOFFITS AND FASCIAS

IN

OK

2.2 DOORS (Exterior)

IN RR MM

2.2(1) RR ★

The threshold at the door between the garage and the interior is loose. Recommend tightening by a qualified person.



Garage side entry door

2.2(2) MM ★

Exterior door handle/lock not installed straight or is loose. Recommend repair by a qualified contractor.



Garage side entry door



Front door handle

2.2(3) MM ★

A gap is present at the exterior door frame allowing air, water, and pest infiltration. Repair or weatherstripping replacement by a qualified contractor is recommended.



Backyard door

2.3(1)

MM



Window screen damaged at indicated area. Recommend repair by a qualified contractor.



West side



West side



Back patio

2.3(2)

MM



Window screen installed backwards. Pull tabs should be facing the inside. The pull tab is also damaged. Recommend repair by a qualified contractor.



North side

2.4(1)

MM



Paint unfinished at the indicated area. Correction is needed by a qualified contractor.



Back porch

2.4(2)

MM



Caulking damaged at the indicated area. Recommend repair by a qualified contractor.



Front patio



Above front door

2.4(3)

RR ★

The sand between the pavers is low/missing. This can start to make the pavers come loose. Recommend repair by a qualified contractor.



Front patio



Front patio



Front patio



Driveway

2.5**VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, WALKWAYS AND RETAINING WALLS**


IN RR

2.5(1)

RR ★

East side

The ground does not slope away from the foundation at the indicated location, directing surface water toward the structure. Negative grading is a leading cause of foundation moisture problems. Regrading away from the structure by a licensed contractor is recommended.

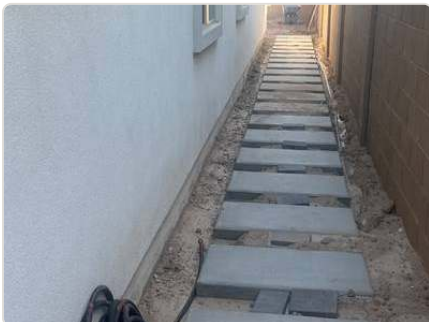

East side



North side



West side

2.6(1)

RR



Fence caps loose around perimeter. Recommend repair by a qualified contractor.



East side



East side



North side



North side



North side



NW corner



West side towards north



West side



West side

Exterior components were inspected as described. Recommend sealing observed cracks and monitoring for water intrusion. All exterior wood surfaces should be maintained with paint or sealant on an ongoing basis.

Electrical System

Section 3

The inspector observed service entrance conductors, service equipment, grounding equipment, main overcurrent devices, main and distribution panels, branch circuit conductors, a representative number of lighting fixtures and receptacles, GFCI/AFCI presence, and smoke/CO alarms. Conducted per AZ BTR Standards Section 8. Only visible and accessible wiring is inspected.

STYLES & MATERIALS

Electrical Service Conductors	Underground
Panel Ground	Present, UFER
Main Panel Capacity	200 Amps
Main Panel Location	SE corner of house
Main Panel Type	Circuit Breakers, Square D
Branch Wire 15 and 20 AMP	Copper
Wiring Methods	Romex (NM-B), Conduit (PVC)
Smoke Detectors	Present All Locations, Hardwired with Battery Backup

3.0 SERVICE ENTRANCE CONDUCTORS

IN OK

3.1 SERVICE GROUNDING AND BONDING

IN OK

3.2 MAIN PANEL AND OVERCURRENT PROTECTION

IN OK

3.4 BRANCH CIRCUIT WIRING

IN OK

3.5 RECEPTACLES – POLARITY AND GROUNDING

IN OK

3.6 GFCI PROTECTION

IN OK

3.7 AFCI PROTECTION

[IN](#)[OK](#)

3.8 LIGHTING FIXTURES AND SWITCHES

[IN](#)[OK](#)

3.9 SMOKE ALARMS

[IN](#)[OK](#)

3.10 CARBON MONOXIDE ALARMS

[IN](#)[OK](#)

The electrical system was inspected as described. Recommend evaluation of any flagged items by a licensed electrician. All electrical safety issues should be considered a priority.


Plumbing System

Section 4

The inspector observed interior water supply and distribution systems, fixtures, faucets, drain/waste/vent systems, hot water systems, fuel storage and distribution systems, and sump/ejector pumps. The inspector is not required to inspect water wells, water conditioning systems, fire sprinkler systems, irrigation systems, or private waste disposal systems. Conducted per AZ BTR Standards Section 7.

STYLES & MATERIALS

Interior Supply Piping	PEX, Copper
DWV Piping	ABS Plastic
Water Heater Type	Tankless Gas, Tankless Electric
Water Heater Manufacturer	Rinnai
Water Heater Manufacture Date	2024
Water Heater Location	Garage
Main Water Shutoff Location	SE corner of house
Main Gas Shutoff Location	SE corner of house

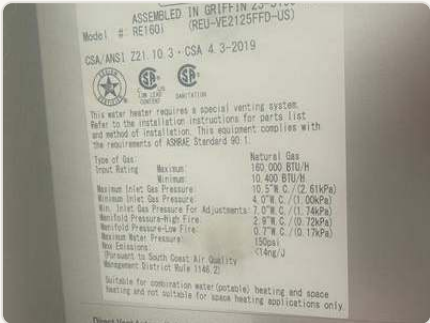

Water Heater Serial/Model Photo



Water Meter Photo

4.0(1)

RR



Drain stop loose at the indicated area. Recommend repair by a qualified contractor.



Hallway half bathroom



Hallway full bathroom



Master left sink



Master right sink

4.1(1)

INFO

Water pressure was tested and found within the acceptable range of 40-80 PSI at the time of inspection.



At main hose bib

4.1(1)

RR ★

A faucet is loose or not properly secured at the fixture and won't retract properly. Repair by a qualified contractor is recommended.



Kitchen faucet

4.1(2)

MM ★

Shower faucet is loose or not properly secured at the fixture. Repair by a licensed plumber is recommended.



Hallway bathroom

4.1(3)

MM



Water pressure is low at sink compared to other sinks in house. Evaluation by a qualified contractor is recommended.



Middle full bathroom

4.1(4)

MM



Shower head continues to drip after use. Verify if this is normal for specific shower head or repair and replace as needed.



Master shower head

4.2

HOT WATER SYSTEMS AND CONTROLS

IN

OK

4.3

CHIMNEYS, FLUES AND VENTS

IN

OK

4.4

TPR VALVE

IN

OK

4.5 CROSS CONNECTIONS

IN

MM

4.5(1)

MM



All hose bibs lack a vacuum breaker. Without backflow protection, a submerged hose can back-siphon contaminants from the ground into the potable water supply. Installation of vacuum breakers is recommended.



All exterior hose bibs

4.6 FUNCTIONAL FLOW AND DRAINAGE

IN

OK

4.7 WATER SHUTOFF VALVES

IN

OK

4.8 FUEL STORAGE, DISTRIBUTION AND GAS SHUTOFFS

IN

OK

The plumbing system was inspected as described. All plumbing fixtures and faucets were operated during the inspection. Recommend evaluation of any flagged items by a licensed plumber.

Basement, Foundation & Structure

Section 5

The inspector observed structural components including foundation, floors, walls, columns, ceilings, and roof structure. The inspector shall enter crawlspaces where accessible with minimum 16 by 24 inch clearance. The inspector is not required to provide engineering services or determine the adequacy of any structural system.

STYLES & MATERIALS

Foundation Type	Post Tension Slab
Floor Structure	Concrete Slab
Wall Structure	Wood Frame
Ceiling Structure	Wood Framed

5.0 FOUNDATION


IN MM

5.0(1) MM ★

Paint missing at stem wall around home. Paint protects the foundation from water. Recommend repair by a qualified contractor.



East side

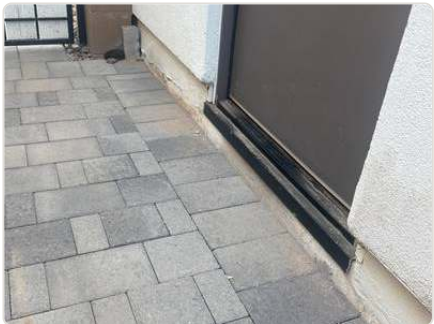

East side

5.1 FLOORS

IN OK

5.2 WALLS

IN OK

5.3 COLUMNS

IN OK

5.4 CEILINGS

IN OK

Structural components were inspected as described. Concealed conditions and latent defects are outside the scope of this visual inspection. Any concerns should be evaluated by a licensed structural engineer.

The inspector observed the garage structure, vehicle doors and operators, fire separation wall and door, occupant door, and electrical systems within the garage. Safety reversal of automatic garage door openers was tested.

STYLES & MATERIALS

Garage Type	Attached
Garage Door Material	Steel, Composite
Number of Stalls	2 Stalls
Extra Info	LiftMaster

6.0 ATTACHED GARAGE – STRUCTURE AND CONDITION

IN

OK

6.1 GARAGE DOOR AND AUTOMATIC OPERATOR

IN

OK

6.2 FIRE WALL AND SEPARATION

IN

OK

6.3 GARAGE-DWELLING OCCUPANT DOOR

IN

RR

6.3(1)

RR



The threshold at the door between the garage and the interior is loose. Recommend tightening by a qualified person.



Garage door threshold

6.3(2)

RR



The weatherstripping at the occupant door to the garage from the interior of the home is loose and should be repaired. Recommend repair by a qualified contractor.



Garage occupant door

6.4 GARAGE ELECTRICAL

IN

OK

Garage systems were inspected as described. The fire-rated separation between the garage and living space is a critical life-safety component and must be maintained without penetrations or gaps.

Heating / Cooling

Section 7

The inspector observed permanently installed heating and cooling systems including equipment, operating controls, safety controls, chimneys, flues, vents, distribution systems, air filters, and the presence of heat and cooling sources in each habitable space. Systems were operated using normal thermostat controls. Conducted per AZ BTR Standards Sections 9 and 10.

STYLES & MATERIALS

Heating Energy Source	Natural Gas
Heating Equipment Type	Gas Furnace
Heating Manufacture Date	2024
Heating Distribution Type	Forced Air Ducts
Cooling Energy Source	Electric
Cooling Equipment Type	Central Air Conditioner
Cooling Manufacture Date	2024
Cooling Distribution Type	Forced Air Ducts
HVAC Manufacturer	Lennox
AC Tonnage	4 TON



HVAC Serial/Model Photo

7.0 HEATING EQUIPMENT

[IN](#)[RR](#)

7.0(1)

[RR](#)

Furnace door is missing a screw to hold down the door. Recommend repair by a qualified contractor.



Furnace

7.1 HEATING OPERATING CONTROLS

[IN](#)[OK](#)

7.2 HEATING AUTOMATIC SAFETY CONTROLS

[IN](#)[OK](#)

7.3 HEATING CHIMNEYS, FLUES AND VENTS

[IN](#)[OK](#)

7.4 HEATING DISTRIBUTION SYSTEM

[IN](#)[OK](#)

7.5 AIR FILTERS

[IN](#)[RR](#)

7.5(1)

[RR](#)

The air filters are bent and dirty, restricting airflow, reducing efficiency, and shortening system life. The filter should be replaced immediately.

7.6 COOLING EQUIPMENT

[IN](#)[OK](#)

7.7 COOLING OPERATING CONTROLS

[IN](#)[OK](#)

7.9(1)

INFO

Temperature split was measured within the acceptable range of 14-22 degrees F at the time of inspection. The system is performing as intended.



Heating and cooling systems were operated using normal controls and inspected as described. Temperature split readings were taken where conditions permitted. Annual professional service of all HVAC equipment is strongly recommended.

Doors, Windows & Interior

Section 8

The inspector observed walls, ceilings, floors, steps, stairways, railings, balconies, counters, cabinets, a representative number of doors and windows, and signs of water penetration. Conducted per AZ BTR Standards Section 11.

STYLES & MATERIALS

Flooring Types	Carpet, Ceramic/Porcelain Tile
Wall/Ceiling Finish	Drywall
Interior Door Types	Hollow Core, Solid Core, Wood, Glass Shower Door
Window Types	Dual Pane, Single Hung, Fixed, Slider
Countertop Material	Laminate, Cultured Marble, Solid Surface
Cabinetry Material	Laminate

8.0 WALLS, CEILINGS AND FLOORS

IN RR

8.0(1) RR ★

Drywall damaged at indicated area. Recommend repair by qualified contractor.



Front entry



Bedroom 2/3 hallway

8.0(2) RR ★

Grout is damaged at the indicated area. Recommend repair by a qualified contractor.



Kitchen

8.2(1)

MM



A cabinet door or drawer is loose or not operating properly. Repair or replacement by a qualified contractor is recommended.



Kitchen

8.2(2)

RR



Cabinet door is loose at the hinges. Recommend repair by a qualified contractor.



Kitchen

8.2(3)

MM



A toilet paper holder is loose at the wall. Re-securing with appropriate anchors by a qualified person is recommended.



Master bathroom

8.3 DOORS AND WINDOWS (Representative)

IN

RR

8.3(1)

RR



Interior door does not properly latch and sticks. Repair by a qualified contractor is recommended.



Hallway half bathroom

8.4 SIGNS OF WATER PENETRATION

IN

OK

8.5 SECONDARY FIRE EGRESS FROM BEDROOMS

IN

OK

Interior components were inspected as described. A representative number of windows and doors were operated.

Insulation & Ventilation

Section 9

The inspector observed insulation and vapor retarders in unfinished spaces, ventilation of attics and foundation areas, and kitchen, bathroom, and laundry venting systems. Conducted per AZ BTR Standards Section 12.

STYLES & MATERIALS

Insulation Type	Cellulose, Blown, Faced insulation system
R-Value (Attic)	38 R-Value
Dryer Vent Material	Rigid Metal
Roof Ventilation	Soffit Vents, O'Hagin vents
Hood Exhaust Type	Vents to Exterior

9.0 ATTIC INSULATION AND VAPOR RETARDER

IN

9.0(1)

INFO

Attic insulation level was observed and appears to be at or near the recommended R-value for this area.




9.0(1)

RR



The netting holding up the insulation is ripped or torn in areas around the attic. This can lead to the insulation falling over time. Recommend repair by a qualified contractor.

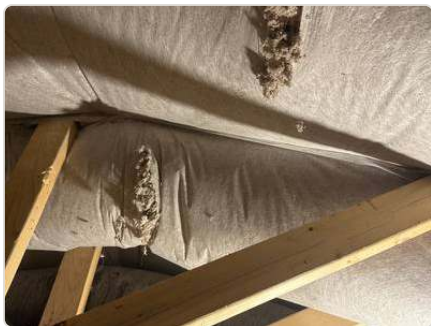

Attic



Attic



Attic

9.2 ATTIC VENTILATION

IN

OK

9.4

KITCHEN EXHAUST VENTILATION

IN

OK

9.5

BATHROOM EXHAUST VENTILATION

IN

OK

9.6

LAUNDRY AND DRYER EXHAUST VENTILATION

IN

OK

Insulation and ventilation systems were inspected as described. Recommended minimum attic insulation is R-38 or greater for extreme heat climates.

Built-In Kitchen Appliances

Section 10

Built-in kitchen appliances were activated using normal operating controls to test primary functions. Testing is limited to basic operation verification and does not include evaluation of all cycles, features, or efficiency. Oven thermostats, timers, and specialized cooking functions are not tested.

STYLES & MATERIALS

Range/Oven Type

Gas

10.0

OVEN AND RANGE

IN

OK

10.1

MICROWAVE (Built-In)

IN

OK

10.2

DISHWASHER

IN

OK

10.3(1)

MM



The garbage disposal produces excessive noise or vibration during operation. Evaluation and repair or replacement by a qualified technician is recommended.



Disposal

Appliances were tested as described at time of inspection. All appliances should be operated again during the final walkthrough prior to closing.

Inspection Disclaimer & Limitations

This report is prepared exclusively for the client named above and is based solely on observations made at the time of the inspection. The inspection is a visual, non-invasive evaluation of accessible systems and components of the property, conducted in accordance with the Arizona Standards of Professional Practice for Home Inspectors and the Arizona State Board of Technical Registration (BTR) requirements.

This report does not constitute a warranty or guarantee of any kind. The inspector makes no representations as to the future performance of any system or component. Systems and components that were not operating at the time of inspection, were not accessible, or were obstructed from view could not be evaluated and are excluded from this report.

This inspection is not a code compliance inspection. Items are reported as deficiencies based on the inspector's professional judgment and general building knowledge. The absence of a deficiency in this report does not guarantee that no deficiency exists. Hidden or concealed conditions, including those within walls, under flooring, or within sealed cavities, are outside the scope of this visual inspection.

Environmental hazards, including but not limited to asbestos, lead-based paint, mold, radon, or underground storage tanks, are outside the scope of this inspection unless specifically contracted as an add-on service. Pest, wood-destroying insect, and wood-destroying organism inspections are not included unless specifically noted.

All Repair / Replace (RR) items and Marginal / Monitor (MM) items should be evaluated by a licensed contractor in the appropriate trade before closing. The inspector is not responsible for costs or consequences arising from deferred maintenance, pre-existing conditions, or issues that develop after the date of inspection.

Inspector: Jaren Drummond
BTR #79346 · San Tan Property Inspections

Date of Inspection: Tuesday, April 28, 2026
Report for: Sample Client