irq: Waveform With the csrs mie Line Commented Out

PHASE	TEST	STATUS
Phase 2	**irq**	**DIAGNOSTIC (STILL FAILS)**

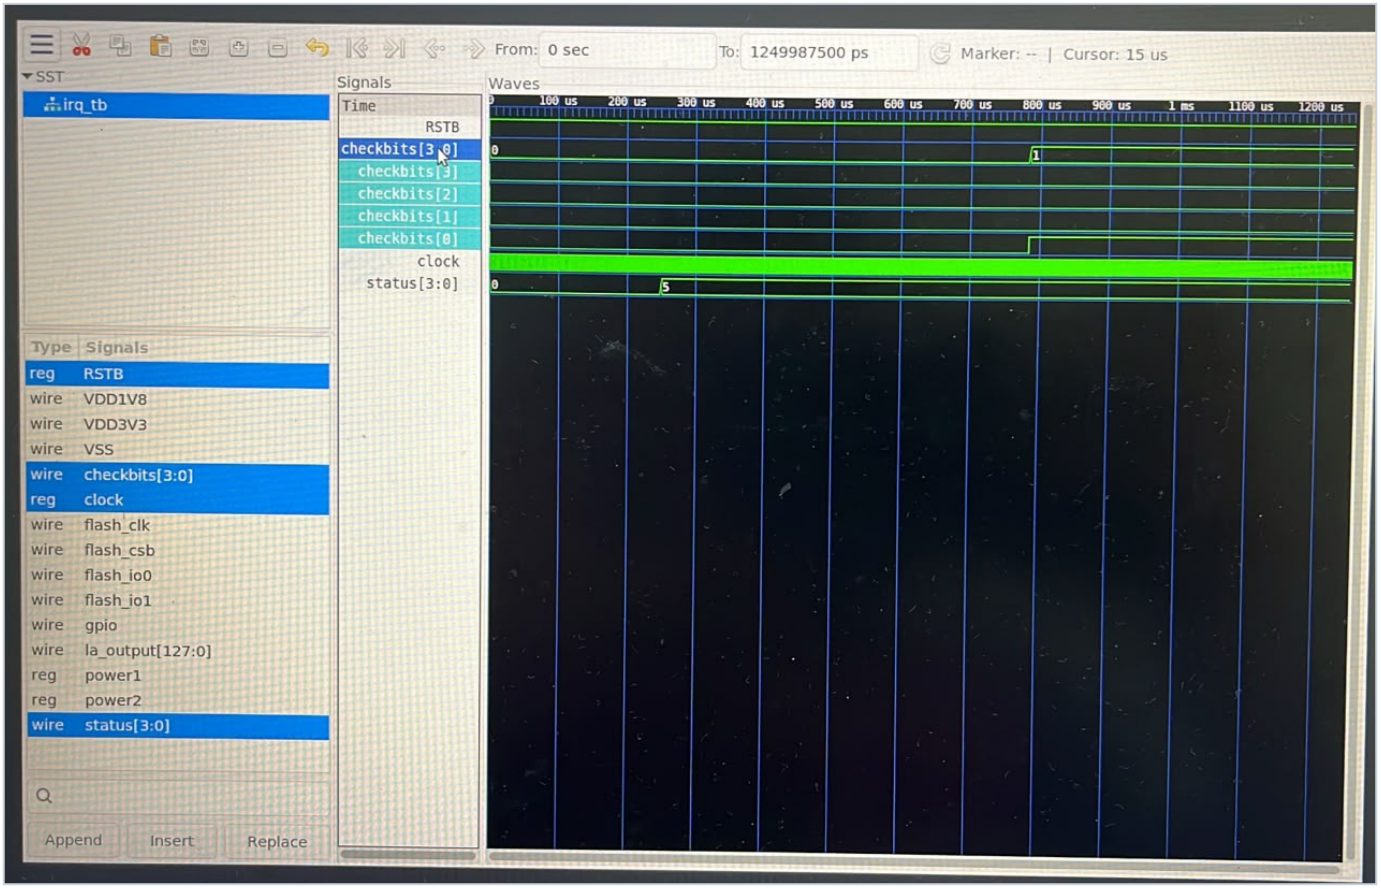


Figure 11. Backup copy of irq.c with the hand-added csrs mie line commented out

What this shows

- `checkbits` now becomes `1` at about 800 us: the firmware reaches the wait loop.
- It stays at `1` until the end: the interrupt is never handled, so the loop never ends and the test still fails.
- `isr.c` was checked: it sets the same `flag` that irq.c waits on, so the handler logic is not the cause.

> **Conclusion.** The extra line affected how far the firmware got, but it is not the full fix. Remaining suspects: `isr()` not called by the startup file, or the timer interrupt not firing.