LT Energy Services Site Report

23 Oct 2025 / 41661 / Homeland / 2.2 - Inverter Fault

Complete

Score	5 / 5 (100%)	Flagged items	1	Actions	0

Customer	Brighter Green Engineering
Site Name	Homeland
Prepared by	Luke Morris
Job Number	41661
Date of Visit	23 Oct 2025
Issue	2.2 - Inverter Fault
Is this part of a contract or chargeable?	Chargeable
Were other inverters within the station isolated during these works	Yes

2.03

Inspection	1 / 1 (100%)
Item(s) inspected on-site	Inverter
Location	2.2
Serial Number	180192621 SMA SC-xxxCP-10 Inverter - Homeland
Fault Code?	N/A
Issue Reported	Inverter tripping

Flagged items

1 flagged

Actions

Is the task complete?

No

Inspection	3 / 3 (100%)
Photo Evidence (before starting work)	
Photo of error codes, etc.	
Photo of areas affected	
Works Carried out on-site	3 / 3 (100%)
Describe works completed	Inverter inspected with various tests being carried out. Nothing obvious seen. After various attempts at generating with different combiner boxes, I found the root cause of the issue to be the filter choke. The inverter has been left isolated but with auxiliary power ON. Further works required to repair the inverter.
Was the power stage tested?	Yes
L1 Forward Bias BLACK	Pass
L1 Reverse Bias BLACK	321
L1 Forward Bias RED	321
L1 Reverse Bias RED	Pass
L2 Forward Bias BLACK	Pass
L2 Reverse Bias BLACK	321
L2 Forward Bias RED	320
L2 Reverse Bias RED	Pass
L3 Forward Bias BLACK	Pass
L3 Reverse Bias BLACK	321
L3 Forward Bias RED	321
L3 Reverse Bias RED	Pass
Overall Result	Pass
Inverter able to generate?	Yes

Photo Evidence (after completing work)

Photo of works carried out

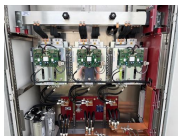
Photo 1

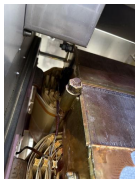
Photo 2

Photo 3

Actions	1 flagged
Is the task complete?	No

What other actions are required?

Replace choke

Other parts required?

Choke, lifting equipment

Any other relevant comments for the client?

None

Media summary

Photo 1

Photo 2

Photo 3