



LV Sewer Inspections

See What's Beneath the Surface.

123 Main St

Las Vegas, NV 89991

Property Photo

FRONT ELEVATION

REPORT NO.

LV-2026-0517

DATE OF INSPECTION

May 17, 2026

FILE NO.

FILE-2026-0517

INSPECTOR

Marcus R. Delgado

Don't Let Your Drain Be A Pain!

(702) 277-2566

www.LVSewerInspections.com



Table of Contents

PREAMBLE

Cover Page	01
Table of Contents	02
Disclosure, Scope & Point of Reference	03

INSPECTION DETAILS

Client & Site Information	04
Defect Severity Classification	05
Sewer Pipe Conditions — Camera Log	06

DEFECT FINDINGS

● Defect 01 — Root Intrusion — Fine Hairline	07
● Defect 02 — Offset Joint — Physical Lip	08
● Defect 03 — Fractured Pipe Wall — Structural Failure	09

SUMMARY & APPENDIX

Recommendations & Notes	10
Statement of Service	11
Understanding Sewer Materials & Defects	12
Meet Your Inspector	13



Sewer Line Inspection Disclosure

SECTION 01

This report is intended to be used only as a general guide in order to provide our clients with current condition of the home's and/or building's main sewer line. The report expresses the opinion of the inspector, based upon visual impressions of the conditions that existed at the time of the inspection only.

The inspection report should not be construed as a compliance inspection of any governmental or non-governmental codes or regulations. The report is not intended to be a warranty or guarantee of the present or future adequacy or performance of the sewer line.

LVSI certifies that our inspectors have no interest, present or contemplated, in the listed property or its improvement. Additionally, LVSI has no involvement with trade professionals or benefits derived from any sales, repairs, replacements, modifications or improvements from inspected sewer lines.

All repairs should be done by a competent licensed Plumber and any work requiring building permits should be obtained by the authority having jurisdiction (Local Building Department).

It is the client's sole responsibility to read this report in its entirety, not rely upon any verbal comments and to research any and all jurisdictional permits required by the local authorities regarding the property inspected.

Scope of the Sewer Inspection

A sewer inspection scan was requested of the main drain line from the structure to the city, private sewer connection, 150 feet or camera limitations (whichever comes first). The sewer line is to be accessed through a cleanout, roof vent (single story only) or other access point(s) to be determined best by the inspector. The camera inspection does not inspect all of the drain lines running under or within the structure. The following is a summative report of the findings.

Point of Reference


Statements made within this inspection report pertaining to left, right, front or rear were referenced by standing in front of and facing the structure from the street. Additionally, analogue clockface references may be utilized to pinpoint conditions found within the pipe; in this case the 12 o'clock position will be the topmost center of the pipe, the 6 o'clock position will be the bottom most center of the pipe and so on.



Client & Site Information

SECTION 02

FILE NO.	FILE-2026-0517
CLIENT NAME	Jennifer & Thomas Harlow
PROPERTY ADDRESS	123 Main St, Las Vegas, NV 89991
DATE OF INSPECTION	May 17, 2026
TIME OF INSPECTION	2:30 PM
INSPECTOR	Marcus R. Delgado — License #NV-SI-20891
PEOPLE PRESENT	Client, Home Inspector, Buyer's Agent
BUYER'S AGENT	Sarah K. Nguyen, Premier Realty
BUILDING OCCUPIED	Yes
WEATHER / SOIL	Clear / Dry Soil

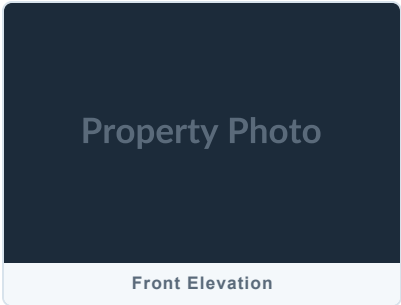

Sewer System Information

SECTION 03

CAMERA ENTRY / CLEANOUT	Rear of the home · 3" ABS
PIPE MATERIAL(S)	ABS Cast Iron
TOTAL RUN LENGTH	87 ft
CAMERA DIRECTION(S)	Main Line: Downstream from cleanout Branch: Kitchen lateral
INSPECTION VIDEOS	▶ Main Line Full Run



Defect Severity Classification Framework

SECTION 04



No Defect

Informational

No actionable deficiencies were observed. This classification documents baseline attributes and establishes a benchmark for future assessments.

Field Examples: Standard joint alignments, unobstructed flow, accessible cleanout.



Minor Defect

Monitor

An incidental finding that does not currently restrict flow or compromise structural integrity. Monitor at future inspections.

Field Examples: Fine hairline root intrusion, light tuberculation, minor surface pitting.



Moderate Defect

Recommended Action

A functional impairment that hinders optimal performance and creates catch points for debris. Scheduled repair is recommended.

Field Examples: Offset joints, moderate root masses, minor bellies with standing water.



Major Defect

Critical / Immediate Action

A severe structural failure posing immediate risk of sewage backup, environmental contamination, or soil erosion. Immediate professional intervention required.

Field Examples: Fractured or collapsed pipe walls, severe root blockages, broken fittings.



Suggested Maintenance

Preventative Care

The pipeline is structurally sound but preventative servicing is required to maintain flow mechanics.

Field Examples: Routine hydro-jetting for grease/sludge, chemical root treatment, descaling.



Sewer Pipe Conditions

SECTION 05 — CAMERA LOG

TIME	FEET	CONDITION	OBSERVATION
	23 ft	● Minor Defect	this is the observation note for the observation 
	45 ft	● Moderate Defect	this is the observation note for the observation 
	67 ft	● Major Defect	this is the observation note for the observation 
	89 ft	● Minor Defect	this is the observation note for the observation 
	111 ft	● Moderate Defect	this is the observation note for the observation 



Defect Findings

SECTION 06 — FINDING 01 OF 03

DEFECT 01

Root Intrusion — Fine Hairline

At 0:42 min / 12 ft

**Minor Defect**

Monitor

At approximately 0 min: 42 sec / 12 ft, fine hairline root intrusion was observed entering through the bell joint. The intrusion does not currently restrict hydraulic flow.

No Photo

PHOTO 1

No Photo

PHOTO 2

No Photo

PHOTO 3



Defect Findings

SECTION 06 — FINDING 02 OF 03

DEFECT 02

Offset Joint — Physical Lip

At 2:15 min / 38 ft



Moderate Defect

Recommended Action

At approximately 2 min: 15 sec / 38 ft, a measurable offset joint was identified creating a physical lip on the invert. Scheduled repair is recommended.

No Photo

PHOTO 1

No Photo

PHOTO 2



Defect Findings

SECTION 06 — FINDING 03 OF 03

DEFECT 03

Fractured Pipe Wall — Structural Failure

At 3:58 min / 61 ft

**Major Defect**

Critical / Immediate Action

At approximately 3 min: 58 sec / 61 ft, a circumferential fracture spanning 270° was observed. Structural integrity is critically compromised. Immediate intervention required.

No Photo

PHOTO 1

No Photo

PHOTO 2

No Photo

PHOTO 3



End of Report — Recommendations

SECTION 06

- 1 Immediate excavation and pipe replacement required at the 61 ft fracture within 48 hours.
- 2 Schedule professional hydro-jetting within 30–60 days to clear FOG buildup.
- 3 Re-inspect root intrusion at 12 ft in 12 months.



Statement of Service

LV Sewer Inspections was retained for a survey of the listed structure's main sewer line in an effort to identify any areas of suspect blockages, deficiencies or damage and to document the areas for further review and or action by associated trades professional. Further investigations into these areas or destructive testing may reveal additional conditions that were not readily visible at the time of inspection. This report is based on information obtained at the site at the given date and time of the inspection.

This report is for the exclusive use of our client and is not intended for any other purpose. The report is based on the information available to us at the time as described in the report. Should additional information become available at a later date, we reserve the right to determine the impact, if any, the new information may have on our discovery and recommendations and to revise our opinions and conclusions if necessary and warranted.

We recommend all areas we locate in this report showing anomalies should be evaluated further to find out the cause and be repaired. Our recommendations are not intended as criticisms of the structure, but rather as professional opinions regarding conditions that we observed at the time of our inspection.



Understanding Sewer Material & Defects

PIPE MATERIAL / TYPE	LIFE EXPECTANCY
Standard Dimensional Ratio (SDR)	50–500 years
Polyvinyl Chloride (PVC)	50–500 years
Acrylonitrile Butadiene Styrene (ABS)	50–500 years
Vitrified Clay Pipe / "Terracotta"	75–100 years
Cast Iron	75–100 years
Concrete	50–75 years
Transite / Asbestos Cement	40–60 years
Bituminous Fiber / "Orangeburg"	30–50 years
Cured in Place Pipe (CIPP)	40+ years
High Density Polyethylene (HDR)	50–500 years
Thin Walled PVC / "Genova"	40–70 years
Galvanized Steel	40–70 years
Lead	100+ years
Copper	50+ years
Stainless Steel	50+ years

*** NOTE ***

Life expectancy is for material alone and under ideal circumstances as intended from the manufacturer. Construction and repair practices, soil erosion, settling, and root intrusion can drastically reduce the expected timelines outlined above along with the overall performance of the sewer line.



Meet Your Inspector

Marcus R. Delgado — License #NV-SI-20891

Heath is the owner and operator of LV Sewer Inspections with training, certification, and degrees from a variety of organizations.

CERTIFICATIONS & TRAINING

- InternNACHI certified for Sewer Scopes/Inspections
- OSHA 10-hr, 30-hr, HAZWOPER 40-hr, OSHA 511, and OSHA 501
- Associate and bachelor's degree in occupational health and safety
- Lean Six SIGMA white, yellow and green belt certified
- Borescope Certified by the U.S Air Force since 2010

INDUSTRY EXPERIENCE

- Completed Sewer Inspections across three states spanning Alaska, California, and Nevada since 2021
- Owner and sole administrator of Sewer Scope Education and Training that Mentors 1,400+ plumbers and inspectors online

WAYS & MEANS

The reporting system LV Sewer Inspections utilizes is continually modernized as the industry and technology develops. The reporting system provides a state-of-the-art electronically produced inspection report that assures all inspections are complete, understandable, and includes digital photos along with a YouTube link to view every inspection. LV Sewer Inspections meets the financial responsibility expected in the property inspection profession by being covered by Errors & Omissions insurance and General Liability insurance.

LV Sewer Inspections

Proudly Serving Las Vegas & Henderson

(702) 277-2566

www.LVSewerInspections.com