

APPENDIX A: SITE INSPECTION CHECKLIST (NULINSPECTIE)

Project: Simonshaven DP2-4 (Nulinspectie)

Date 10 December 2025

Inspector: DNV – PJ Schutte

Evidence Mapping (Source: 01350-01-00075)

1. CDG - Roxtec Frames (Checklist A1)

Report Finding: Page 18, Finding 7 ("EM/LPZ zonering CDG")

Text: *"Het EMC invoerraam in de AC ruimte lijkt niet consistent te zijn toegepast. Er zijn geen aardverbindingen vanaf het frame... zichtbaar."* (The EMC frame in the AC room... no earth connections visible from the frame).

Photo: Page 33, **PH2-7231**.

2. CDG - Wall Penetrations (Checklist A2)

Report Finding: Page 18, Finding 8 ("EM/ LPZ zonering apparatuur ruimten")

Text: *"Ook zijn er in de VBS ruimte diverse boringen in de muren waar leidingen en kabels zonder EMC maatregel worden doorgevoerd."* (Various borings in walls where pipes/cables pass without EMC measures).

Photo: Page 37, **PH19-7255** (Shows pipes/cables going through the wall).

3. CDG - Cabinet Earthing "Pigtails" (Checklist A3)

Report Finding: Page 18, Finding 6 ("Aarding apparatuur kasten")

Text: *"...is de kast geaard d.m.v. VD50mm2 via de kastinvoer/brievenbus (PH32-7272)."* (Cabinet earthed via round wire [VD50mm2]...).

Photo: Page 40, **PH32-7272** (Look at the right side of the photo, the green/yellow wire).

4. Takhuisjes - Plastic Glands (Checklist B1)

Report Finding: Page 21, Finding 9 ("EMC maatregelen voedingskabels")

Text: *"...maar met kunststof wartels (PH29-7268 en PH30-7269)."* (...but with plastic glands).

Photo: Page 39, **PH29-7268** (Shows the grey cables entering through white plastic glands).

5. Takhuisjes - Wall Earth Bar (Checklist B2)

Report Finding: Page 20, Finding 5 ("Uitvoering EMC-net")

Text: *"Binnen de takhuisjes zijn geen verbindingen met het separaat aangebrachte EMC-net aangetroffen."* (Inside bay houses, no connections to the EMC mesh found).

Photo: Page 42, **PH41-7292** (Shows the copper bar on the wall; check if it connects to the concrete).

6. Takhuisjes - Missing PEC (Checklist B3)

Report Finding: Page 20, Finding 4 ("PEC's van buiten naar binnen")

Text: *"Aan de veldzijde is bij takhuisje 3 geen PEC gevonden."* (At field side bay house 3, no PEC found).

Photo: Page 42, **PH45-7291**.

7. Trenches - Missing PEC (Checklist C1)

Report Finding: Page 17, Finding 4 ("PEC's van buiten naar binnen")

Text: "Er is geen aardverbinding/PEC vanuit de kabelbak/goot van buiten naar binnen aangetroffen." (No earth connection/PEC from cable tray outside to inside found).

Photo: None in report (This is why you must take one).

1 1. CENTRAL SERVICE BUILDING (CDG)

Location: AC Room, DC Room, Telecom Room

ID	Item	What to Look For (The Defect)	Reference Photo (Paste from PDF 1)	Status (OK/NOK)
A1	Roxtec Frames (AC Room)	Defect: "Inconsistent application." No visible earth wire from the metal frame to the earth bar. Check: Is the frame bonded?	Paste Photo PH2-7231 (Page 33)Shows blue blocks, check frame edge for earth wire.	
A2	Cable Penetrations (VBS Room)	Defect: Cables/Pipes entering through drilled holes <i>without</i> EMC glands or frames. Check: Are these holes still open?	Paste Photo PH19-7255 (Page 37)Shows pipes/cables passing through ceiling/wall.	
A3	Cabinet Earthing (VBS/Telecom)	Defect: Use of long, round green/yellow wires ("Pigtails") instead of short, flat braids (Litze). Check: Has this been retrofitted to flat braid?	Paste Photo PH32-7272 (Page 40)Shows long green/yellow wire on right side.	
A4	Computer Floor (VBS)	Defect: Unclear bonding of the floor grid. Check: Look under the floor tiles. Is the pedestal grid connected to the ring earth?	Paste Photo PH7-7237 (Page 34)Shows floor pedestals.	

2 2. BAY HOUSES (TAKHUISJES)

Location: The small buildings in the field (Tak 1, Tak 2, etc.)

ID	Item	What to Look For (The Defect)	Reference Photo (Paste from PDF 1)	Status (OK/NOK)
B1	AC/DC Distribution Cabinets	Defect: MAJOR ISSUE. Plastic glands used instead of metal EMC glands. Check: Look at the bottom of the AC/DC cabinets. Are the glands grey (plastic) or metal?	Paste Photo PH29-7268 (Page 39)Shows grey cables entering via plastic glands.	
B2	Wall Earth Bar (Aardrail)	Defect: No visible connection to the wall reinforcement (EMC Mesh). Check: Follow the copper bar on the wall. Does it have taps going <i>into</i> the concrete wall?	Paste Photo PH41-7292 (Page 42)Shows the copper bar running along the wall.	

B3	Floor Entry Takhuisje 3(PEC)	Defect: PEC (Parallel Earth Conductor) status is not found. Check: Look at the floor entry. Do you see a thick copper wire (PEC) coming from the outside trench and connecting to the earth bar? Check cable trenches	Paste Photo PH45-7291 (Page 42)Shows the floor entry point.	
-----------	-------------------------------------	--	--	--

3 3. OUTDOOR / TRENCHES (BUITENTERREIN)

Location: Cable trenches and field assets

ID	Item	What to Look For (The Defect)	Reference Photo (Paste from PDF 1)	Status (OK/NOK)
C1	Trench PEC (The "Missing Link")	Defect: Report states PECs were missing in some sections. Check: ACTION: Lift a trench cover near the CDG. Is there a copper wire running parallel to the cables? Takhuisje 3	<i>NO PHOTO IN REPORT(You must take this photo)</i>	
C2	Portal Earthing	Check: Verify steel portals have 2x diagonal earth connections.	Paste Photo PH49-7300 (Page 43)Shows portal leg earthing.	
C3	Fence Earthing (Hekwerk)	Check: Are fence panels bonded with flexible straps?	Paste Photo PH58-CDG1 (Page 45)Shows fence detail.	

4 4. DP2-4 INTEGRATION (NEW SCOPE)

Location: Future location of Transformers & Bays 4-5

ID	Item	What to Look For	Status
D1	Spare Roxtec Frames	Identify the specific spare frames in the CDG wall allocated for DP2-4. Are they earthed?	
D2	New Earth Risers (Opstekers)	Locate the earth points in the field where the new DP2-4 equipment will connect. Are they visible and in good condition?	

A1 – AC ruimte	A2 Telecomruimte
 PH2-7231	 PH15-7251
A3 – Telecomruimte	A4 – VBS ruimte
	VBS-ruimte (overige centrale apparatuur)  PH7-7237
B1 – Takhuisje 3	B2

 PH29-7268  PH30-7269	No photo of mesh
B3 takhuisje 3	
 PH23-7261	
C2 - AIS earthing and steel structures	C3
	Check fence




PH49-7300




Bijlage A EM zone indeling SMH380


LEGENDA

- 2** = Apparatuur in takhuisjes en het CDG die beschermd wordt door extra afscherming, apparatuur in telecomruimte die geen industriële immuïteitsspecificaties heeft.
- 3** = industrieel, secundaire installatie in takhuisjes en CDG en langs hekwerken rond de AIS schakeltuin.
- 4** = locaties binnen de primaire schakeltuin, ter plaatse van railsystemen, schakelaars, scheiders, transformatoren, spoelen en kabeleindsluitingen.
- = EM/LPZ zone overgang d.m.v. kabelscherm aansluiting secundaire kabels bij invoer veldkasten, takhuisjes en CDG
- = Eindsluitingen HS kabels

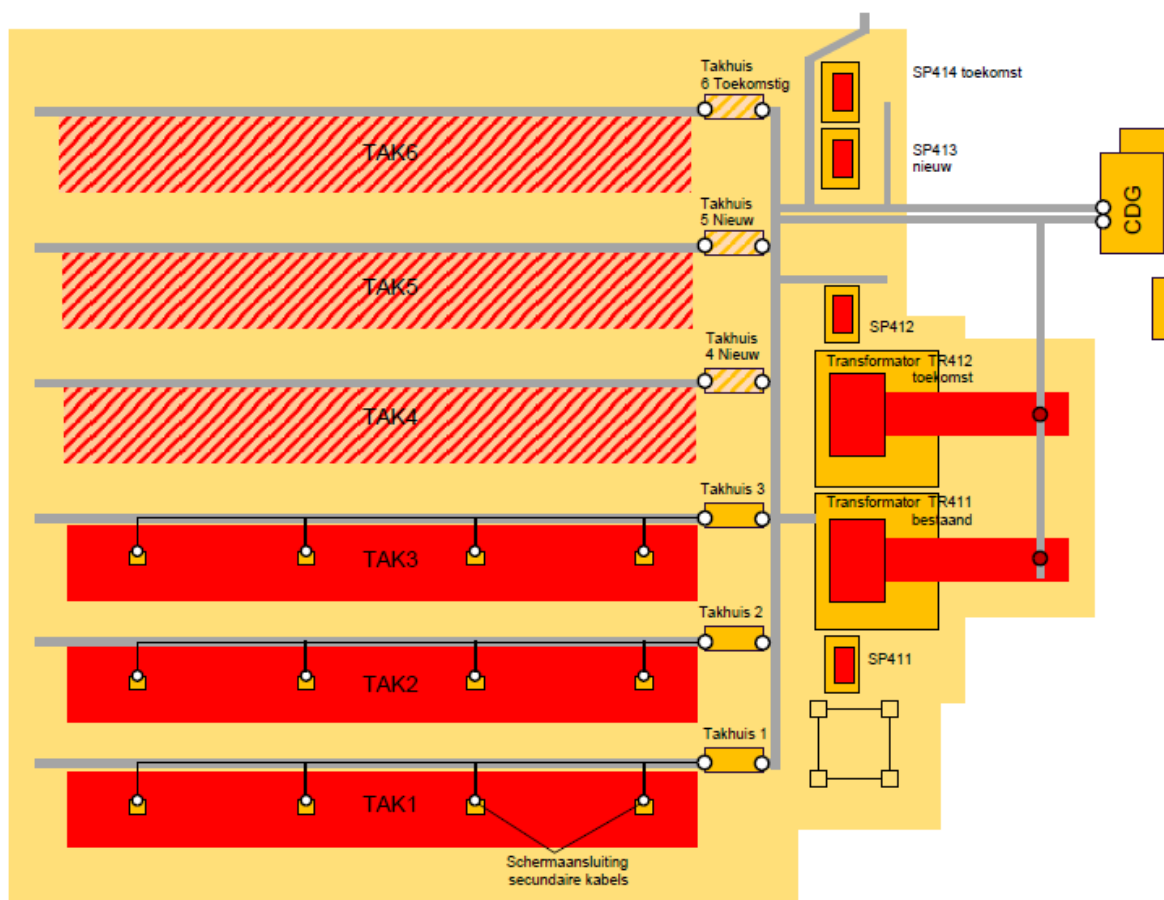

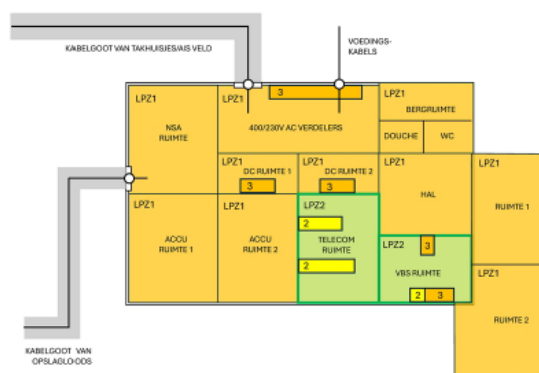


EM zonering CDG conform TenneT eisen

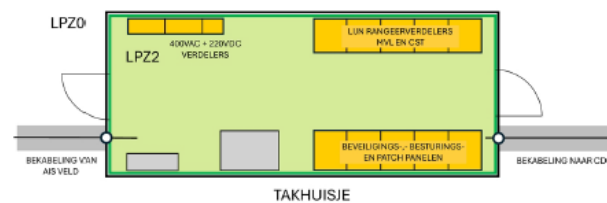


EM zonering takhuisje conform TenneT eisen

LEGENDA

- = LPZ1, afscherming door middel van betonwapening overeenkomend met EM3
- = LPZ2, afscherming door middel van EMC-net 30x30x3mm
- = EM2 apparatuur
- = EMC kabeldoorvoer met schermaansluiting

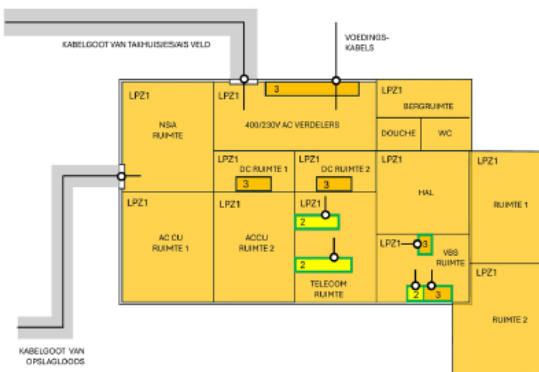

EM zonering CDG conform zoals uitgevoerd

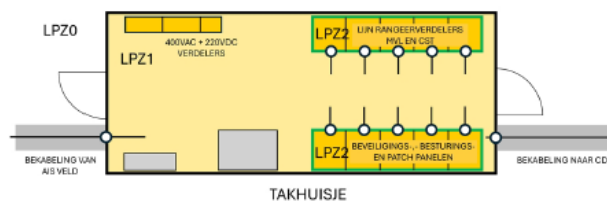

EM zonering takhuisje conform zoals uitgevoerd

Figuur A.2 EM en LPZ zone indeling CDG en takhuisjes

