NEW HOLLAND

Service Bulletin


FILING INSTRUCTIONS	
Binder: Ag Equipment Binder	Page: 1 of 4
Binder Section: Implements	Document No.: 0607-IM1
Mach Loc Code: 55 926	Supersedes:
Issued By: Technical Support Services	Date Issued: June 27, 2007

MODELS AFFECTED: CR9040, CR9060 and CR9070 Combines; CX8070, CX8080 and CX8090 Combines; TG215, TG245, TG275 and TG305 Tractors; TJ280, TJ330, TJ380, TJ430, TJ480 and TJ530 Tractors Equipped with a PLM Mapping or an IntelliSteer™ Auto-Steering System

SUBJECT: NH252 Receivers Cannot Receive L2 Signals


DESCRIPTION OF CONCERN

An internal connector defect in some NH252 receivers, can cause either a constant or an intermittent loss of L2 signal reception.

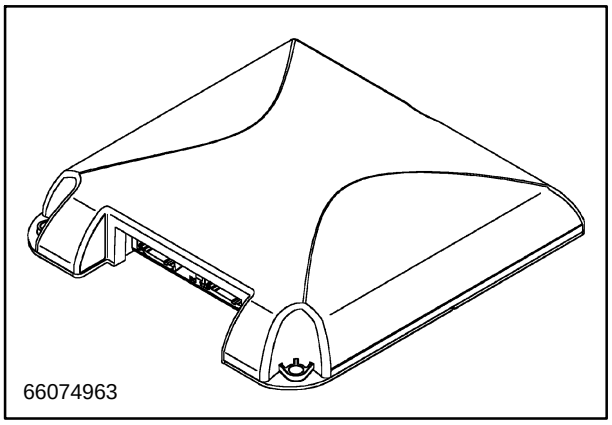

1

For an RTK NH252 receiver (part number 87367718), when the L2 signal is lost, the GPS status in the display does not show an RTK fix. In addition, when a laptop is connected to the NH252 receiver, 'ExitDGPS Stn', 1, appears on the AgRemote display screen.

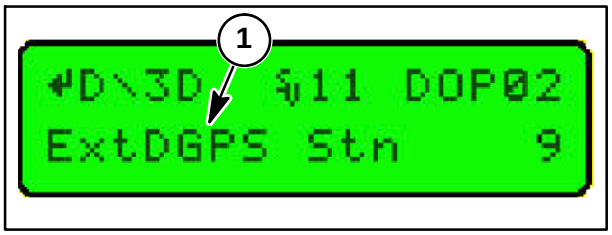

2

©2007 CNH America LLC. All rights reserved.

For a DGPS NH252 receiver (part number 87367722), when the L2 signal is lost, the NH252 receiver cannot converge on OmniSTAR XP/HP. OmniSTAR VBS is still received, however, if the NH252 receiver has a valid VBS subscription.

ACTION/CORRECTION

NA

Production:

The affected NH252 receivers (part number 87367718 or 87367722) have serial numbers from 0225110127 through 0225114635 and were shipped between January 17, 2007 and March 23, 2007.


Service:

If the NH252 receiver (part number 87367718 or 87367722) does not achieve an RTK fix or does not converge on OmniSTAR XP/HP, follow the procedure below to troubleshoot the NH252 receiver and confirm the loss of L2 signal reception.


Confirm the loss of L2 signal reception.

The AgRemote software and interface is used to perform this procedure. The AgRemote interface consists of:


- A display screen, 1.
- An escape button, 2.
- An enter button 3.
- An up arrow button, 4.
- A down arrow button, 5.
- A right arrow button, 6.
- A left arrow button, 7.

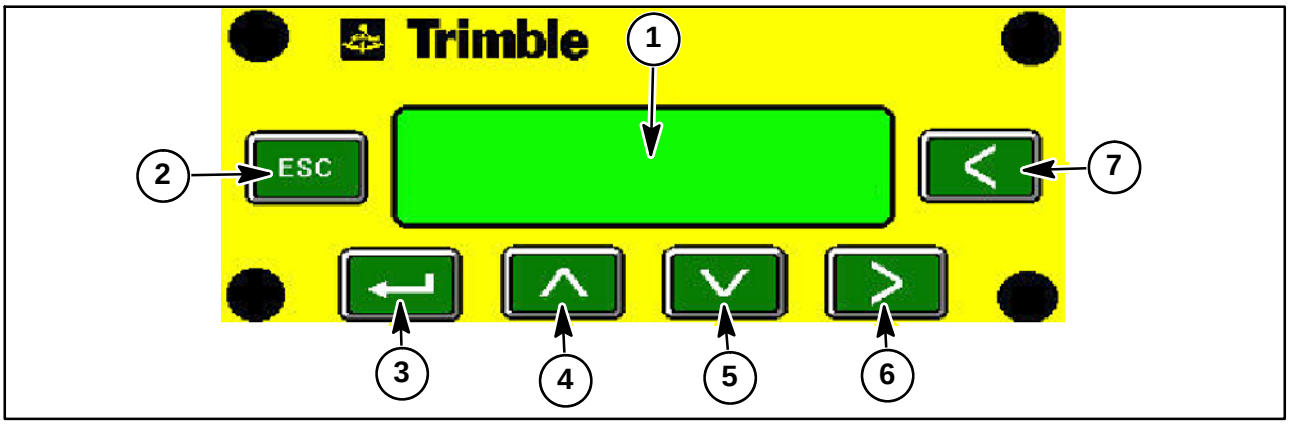

1. With the home screen displayed, Figure 4, press the right arrow button once to reach the Status screen, Figure 5.

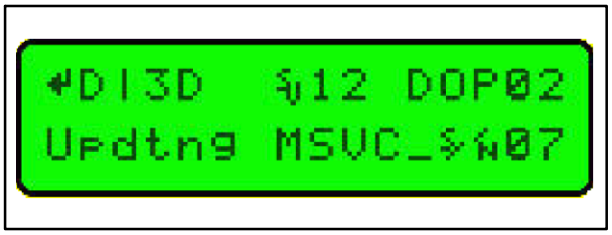

4

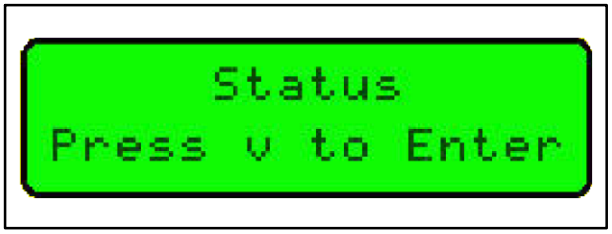

5

2. Press the down arrow button once to reach the GPS Status screen.




6

3. Press the down arrow button once to display the status of the L1 channel.
4. Wait three seconds and the screen displays the L2 channel signal-to-noise (SNR) information.

***NOTE**: The screen switches between L1 and L2 SNR every three seconds.*

5. If two dashes appear for the L2 SNR, 1, L2 signal loss is confirmed.
6. If a numerical value appears instead of two dashes for the L2 SNR, and if you still cannot obtain an RTK fix or converge on OmniSTAR XP/HP, then the NH252 receiver or the correction source may have a different issue. Further troubleshooting of the NH252 receiver or correction source is required.
7. When the loss of L2 reception is the reason that the NH252 receiver does not achieve an RTK fix, or does not converge on OmniSTAR XP/HP, contact the service provider below for instructions on how to return the NH252 receiver for repair.
   - For US dealers, contact AgExpress Electronics at 515-289-2746.
   - For Canadian dealers, contact PAT Inc at 204-523-4077.

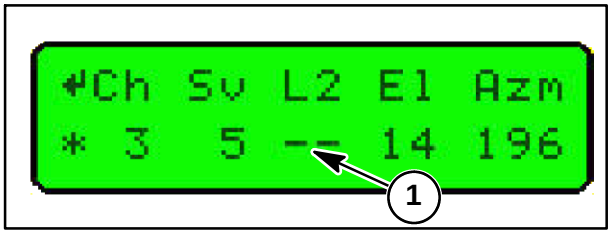

7

ADDITIONAL INFORMATION

NA

PARTS AFFECTED

***NOTE**: Defective receivers may not be limited to the part numbers listed below.*

Previous Part #	Qty	Description	Qty	New Part #	PAL Ref Number
87367718	1	Receiver, RTK	1	87367718	04-45
87367722	1	Receiver, DGPS	1	87367722	04-45

WARRANTY STATUS

This service bulletin is for informational purposes only and does not constitute warranty authorization to update units without a warrantable failure.