Marine Visit Report

KUWAIT PROSPERITY

March 19, 2026
Zhoushan(PRC)
Dani Bacic

Superintendent Marine Visit Report

Vessel :	KUWAIT PROSPERITY	**From Date :**	09/02/2026
Visit Type :	Sailing	**From Location :**	Yeosu(South Korea)
Report Date :	19/03/2026	**To Date :**	19/03/2026
Operation :	Dry dock repair	**To Location :**	Zhoushan(PRC)
Cargo on board :	No cargo on board		
Master :	Abashidze Jemal	**Assessed By :**	Captain Dani Bacic
		Assessor Qualifications & Pertinent seafaring experience :	Master Mariner with Command experience of 5.0 years

This report is based on the questions and the layout of OCIMF Vessel Inspection Questionnaire.The purpose of the ship visit was to verify that both the CSM Management System was being followed and implemented on board, and that industry requirements such as those of SIRE and CDI, as applicable, were being met. All suggestions and recommendations for improvements were discussed and agreed with the Master and Chief Engineer.

1. General Information

The vessel was taken over from the previous management on 09/02/2026 at 1700 hrs.
The Marine Superintendent embarked on 09/02/2026 at 1800 LT in Yeosu and disembarked on 19/03/2026 at 1330 hrs in Zhoushan.

General Information:
Ex Name: Front Spey
Call Sign: A8LB4
Flag: Liberia
Port of Registry: Monrovia
Official Number: 10885
IMO Number: 9722936
Class Society: BV
CONSTRUCTION
Keel Laid: 10 Nov 2015
Delivered: 13 May 2016
Builder: Hyundai Heavy Industries Co., Ltd., South Korea
Hull Number: 2728
Last Dry Dock: 02 Mar 2021
CLASS NOTATION
100A1, Double Hull Oil Tanker, CSR, ESP, ShipRight ACS (B,C), *IWS, LI, SMP4, ECO(TOC,BWT), LMC, IGS, UMS, BWTS
Descriptive Notes: COW, ShipRight (SCM, VECS, IHM-EU+, BWMP(S+F,T), SERS)
OWNERS / MANAGEMENT
Owners: Front Spey Inc., Majuro, Marshall Islands
Commercial Operator: HAUT BRION 5 S.A
Managers: Columbia Shipmanagement Ltd., Limassol, Cyprus
PRINCIPAL DIMENSIONS
LOA: 333.04 m
LBP: 322.04 m
Breadth (Moulded): 60.00 m
Depth (Moulded): 29.40 m
Max Height: 65.94 m
Draft (Moulded): 21.625 m
The initial list of recommendations was submitted to MM, TFM ,TSI and DPA on 26/03/2026.

1.1 History of previous inspections

Marine: NA/This is a takeover visit.
Technical: NA/ This is a takeover visit..

Internal Audit
ISM: NA/This is a takeover visit.
ISPS: NA/This is a takeover visit.

External Audit
ISM: 13.02.2026 \ Nil\ NA.
ISPS: 13.02.2026 \ Nil\ NA.
MLC: 13.02.2026 \ Nil\ NA.

Key Questions marked YES without comment.

2. Certification and Documentation

2.2.1 2.2.2 2.2.3 2.3.1 2.3.2 2.3.3 2.3.4 2.3.5 2.4.1 2.4.2 2.5.1 2.6.1 2.6.2 2.6.3 2.7.1 2.7.2 2.8.1 2.8.2

3. Crew Management

3.1.1 3.1.2 3.1.3 3.2.1 3.2.2 3.2.3 3.2.4 3.2.5 3.2.6 3.2.7 3.2.8 3.3.1 3.3.2 3.3.3 3.3.4 3.3.6 3.4.1 3.4.2 3.5.1 3.5.2 3.5.3

4. Navigation and Communications

4.1.1 4.1.2 4.1.3 4.1.4 4.1.5 4.1.6 4.1.7 4.1.8 4.1.9 4.1.10 4.1.11 4.1.14 4.1.15 4.2.1 4.2.2 4.2.3 4.2.4 4.2.5 4.2.6 4.2.7 4.3.1 4.3.2 4.3.3 4.3.4 4.4.1 4.4.2 4.4.3 4.4.4 4.4.5 4.4.6

5. Safety Management

5.1.1 5.1.2 5.1.3 5.1.4 5.1.5 5.1.6 5.1.7 5.1.8 5.1.9 5.1.10 5.1.11 5.1.12 5.1.13 5.1.14 5.1.15 5.1.16 5.1.17 5.1.18 5.2.1 5.2.2 5.2.3 5.2.4 5.2.5 5.2.6 5.2.7 5.2.8 5.2.9 5.2.10 5.2.11 5.2.12 5.2.13 5.2.14 5.2.15 5.2.16 5.3.1 5.3.2 5.3.3 5.3.4 5.3.5 5.4.1 5.4.2 5.4.3 5.4.4 5.4.5 5.4.6 5.4.7 5.4.8 5.4.9 5.5.1 5.5.2 5.5.3 5.5.4 5.5.5 5.5.6 5.6.1 5.6.2 5.6.3 5.6.4 5.6.5 5.6.6 5.7.1 5.7.2 5.7.3 5.7.4 5.7.5 5.7.6 5.7.7 5.7.8 5.8.1 5.8.2 5.8.3 5.8.4 5.8.5 5.8.6 5.8.7 5.9.1 5.9.2 5.10.1 5.10.2 5.10.3 5.10.4 5.10.5 5.10.6 5.10.7 5.11.1 5.12.1 5.12.2

6. Pollution Prevention

6.1.1 6.1.2 6.1.3 6.1.4 6.1.5 6.1.6 6.2.1 6.2.2 6.2.3 6.3.1 6.4.1 6.4.2 6.5.1 6.5.2 6.6.1 6.6.2

7. Maritime Security

7.1.1 7.2.1 7.2.2 7.3.1 7.4.1 7.5.1

8.1. Oil

8.1.1P 8.1.2P 8.1.3P 8.1.4P 8.1..5P 8.1.5P 8.1.8P 8.1.10P 8.1.11P 8.1.12P 8.1.13P 8.1.14P 8.1.15P

8.3. Oil and chemical

8.3.1PC 8.3.2PC 8.3.3PC 8.3.4PC 8.3.5PC 8.3.6PC 8.3.7PC 8.3.8PC 8.3.9PC 8.3.10PC 8.3.11PC 8.3.12PC 8.3.13PC 8.3.14PC 8.3.15PC 8.3.16PC 8.3.17PC 8.3.18PC 8.3.19PC 8.3.20PC 8.3.21PC 8.3.22PC 8.3.23PC 8.3.24PC 8.3.25PC 8.3.28PC 8.3.29PC 8.3.30PC 8.3.31PC 8.3.33PC 8.3.34PC 8.3.35PC 8.3.36PC 8.3.37PC 8.3.38PC 8.3.39PC

9. Mooring and Anchoring

9.1.2 9.2.1 9.3.1 9.4.1 9.4.2 9.5.1 9.5.2 9.6.1 9.6.2

10. Machinery Spaces

10.1.1 10.1.2 10.1.3 10.1.4 10.1.5 10.2.1 10.2.2 10.2.3 10.2.4 10.2.5 10.2.6 10.3.1 10.3.2 10.3.3 10.3.4 10.3.5 10.3.6 10.3.7 10.3.8 10.3.9 10.4.1 10.4.2 10.5.1 10.5.2 10.5.3 10.6.1 10.6.2 10.6.3 10.6.4 10.7.1 10.7.2 10.7.3 10.7.4

11. General Appearance and Condition - Photograph Comparison

11.1.1 11.1.8 11.1.13 11.1.14 11.1.15 11.1.16 11.1.17 11.1.18 11.1.20 11.1.21 11.1.22 11.1.23 11.1.24 11.1.26 11.1.27 11.1.28 11.1.29 11.1.30 11.1.31 11.1.32 11.1.33 11.1.40 11.1.41 11.1.42 11.1.50 11.1.61 11.1.62 11.1.70 11.1.71 11.1.72 11.1.80 11.1.81 11.1.82

Key Questions marked YES with comment

2. Certification and Documentation

The vessel was taken over under Company management on 09 February 2026, and subsequently, the vessel's name, port of registry, and Class were changed on 13 February 2026. Since takeover, the vessel has been operating in accordance with the Company's Management System, with all applicable procedures accessible through the AMOS QMS module. Documentation reviewed during the attendance reflected current CMS revisions, and records were maintained in an orderly and up-to-date manner. A cross-check of the filing structure confirmed alignment with GOPR 21.1 requirements, with documentation properly arranged and readily retrievable.

All statutory and trading certificates were examined and verified as updated, valid, appropriately endorsed, and within the applicable survey windows. The Class Survey Status Report dated 08 March 2026 confirmed that the vessel had no outstanding Conditions of Class or statutory remarks, and no Flag State dispensations were in place at the time of the visit. It is noted that new statutory certificates will be issued by Class during the upcoming dry dock. Insurance and financial security certificates were available on board and displayed in the designated crew areas. It is further noted, however, that DMLC Part I and Part II were not available on board at the time of inspection.

The Q88 and HVPQ were checked and confirmed updated, with the most recent HVPQ revision dated 20 February 2026. Standard photographic records required under SIRE 2.0 and PIQ were reviewed and found satisfactory.

It is further noted that internal inspections of cargo and ballast tanks are planned to be carried out during the upcoming dry dock scheduled on 25 March 2026 in Zhoushan.

One recommendation was issued.

3. Crew Management

The vessel was manned above the Minimum Safe Manning requirements, and the overall crew level was considered sufficient to ensure safe and efficient operations. All officers and ratings were holding valid certificates relevant to their rank, with flag endorsements and medical fitness confirmed prior joining. The Officer Matrix was verified as updated in the OCIMF database and cross-checked against individual certificates and sea service records, with no discrepancies identified.

The crew consisted of Georgian, Latvian and Indian nationalities. Throughout the attendance, no concerns related to behaviour, cooperation, or safety culture were observed or reported. English was effectively used as the working language on board, and crew members interviewed demonstrated clear understanding of their duties and safety procedures.

The Company's Drug and Alcohol Policy was well understood by the crew, and testing records were reviewed in line with company requirements. An onboard alcohol test was conducted on 14 March 2026, with all crew members tested and confirmed negative. On the same day, calibration of the breath analyser was carried out, and the device was verified as fully operational. The Dräger Alcotest 6510 was available on board with valid calibration arrangements in place.

Work allocation and planning were in line with rank and responsibilities. STCW hours of rest were reviewed and compared with supporting records. Although some isolated deviations had been noted in the previous period, there was no evidence of recurring issues or any impact on safe manning at the time of attendance.

Master and Chief Officer appraisals were conducted during the visit, with both officers demonstrating a professional attitude, good command presence, and appropriate conduct throughout.

4. Navigation and Communications

A Static and Dynamic Navigation Assessment was carried out during the attendance. The bridge team organization and overall effectiveness were reviewed, with duties clearly defined and bridge resource management applied in a structured and practical manner. The Master's Navigation Self-Assessment was reviewed and the findings were discussed with the bridge team to ensure alignment and shared understanding.

Voyage planning practices, including preparation for critical stages of the passage, were discussed with deck officers. It was verified that all navigating officers had completed the required ECDIS Type Specific training and onboard familiarization. The bridge layout was found to be well arranged, supporting effective lookout and situational awareness. Navigation and communication equipment were confirmed operational and maintained in accordance with PMS and manufacturer recommendations, with bridge officers demonstrating confident and competent use of the installed systems.

Three recommendations were issued.

5. Safety Management

Risk assessment practices, incident reporting, and investigation processes were reviewed with the Master and deck officers. Emergency preparedness was assessed through drill records and crew interviews, confirming that drills were carried out in line with Flag Administration requirements and Company procedures (GOPR-4.2). The most recent fire and abandon ship drill were conducted on 08 March 2026 and oil spill drill on 15 March 2026 Crew members interviewed demonstrated good understanding of their emergency roles and responsibilities.

Sufficient personal protective equipment was available on board. Records confirmed that the last lowering and manoeuvring of the lifeboat and rescue boat were carried out on 08 March 2026. Documentation related to LSA and FFE inspection, servicing, and maintenance was reviewed and found properly maintained and up to date.

During the attendance, functional tests were carried out on key emergency and safety systems, including the emergency generator, emergency steering, lifeboat engines, bosun store bilge, hospital spaces, and provision chambers, all with satisfactory results. The cargo tank overfill alarm system and oxygen content readings were also verified. Both the main and emergency fire pumps were tested and confirmed to deliver adequate pressure, as indicated on the bridge wing pressure gauge.

Company Policy Statements, including the “Open Reporting Procedure”, “I CARE” philosophy, and Company Vision, Mission, Policies, and Core Values, were displayed in designated locations on board.

Safety Officer documentation was reviewed, including Permit to Work, Enclosed Space Entry permits, and crew familiarization records, all found in good order. Muster Lists, Cabin Cards, SOLAS Training Manuals, “Shell Partners in Safety” materials, and training computers were available and properly maintained. Implementation of the AMOS QMS was verified during the attendance.

Safety meetings and discussions with the crew confirmed awareness of Company and charterer initiatives, including ongoing safety campaigns, fleet safety stand-downs, and the Stop Work Authority. Recent safety alerts, lessons learned, and observation lists were reviewed and discussed together with relevant fleet-wide learnings. Company initiatives related to crew mental health and wellbeing were also highlighted and acknowledged onboard.

6. Pollution Prevention

Pollution prevention equipment was inspected during the attendance and found to be operational, properly maintained, and ready for immediate use. Shipboard personnel demonstrated good familiarity with their SMPEP responsibilities and pollution response procedures, while the SMPEP documentation was confirmed to be updated with current emergency contact details. During deck rounds, scupper plugs were noted to be in good condition and correctly fitted.

The antipollution equipment inventory was verified as up to date. Records confirmed that the most recent oil spill drill was conducted on 15 March 2026 in line with the vessel’s drill programme, and previous Q.I. notification drill documentation was available for review. Environmental compliance equipment was found operational, with supporting documentation properly maintained.
It is noted that following a service report, the ODME was temporarily considered out of order. However, after additional testing and submission of supporting evidence by the crew, Class lifted the restriction and the system was reinstated for normal operation. An upgrade of the ODME system is under consideration and may be carried out during the upcoming dry dock, where the annual test will also be performed in the presence of TSI.

The six-monthly bilge holding tank cleaning was completed on 22 February 2026, with records available and verified.

Garbage management practices were observed to be effectively implemented. The garbage compactor was operational. Crew members demonstrated good awareness of garbage segregation procedures, and the Garbage Record Book was maintained up to date. Open Reporting System posters were displayed in common areas, and interviewed personnel showed clear understanding of reporting expectations and environmental protection requirements.

7. Maritime Security

The vessel was operating under MARSEC Level 1 during the attendance, with restricted areas controlled and secured in accordance with the Ship Security Plan. Crew members demonstrated good awareness of ISPS Code requirements and onboard security procedures. An Internal Security Audit was conducted during the marine visit, during which a non-conformity was raised.

While basic cyber security arrangements were in place, the overall level of protection was found not fully adequate. In particular, it was identified that USB security plugs (port blockers) were not fitted on board, leaving IT systems insufficiently protected against unauthorized external device access. Although IT and OT systems were generally identified and segregated, the absence of physical USB control measures represents a gap in cyber security implementation.

Crew members were familiar with cyber security procedures, and training programmes were in place, with additional onboard guidance provided during the attendance. Cyber security posters were displayed in designated areas, including accommodation and ECR; however, further improvement of practical protection measures is required to ensure full compliance with Company cyber security standards.

8.1. Oil

As part of the Marine Visit Inspection, and based on activities reviewed during the attendance, a Cargo, Ballast and Tank Cleaning Operation Audit was carried out. It is noted that no cargo operations were conducted during the attendance, and the review was limited to tank cleaning operations.

The Master and Chief Officer demonstrated good understanding of damage stability, including identification of critical cases which were readily available in both the CCR and on the bridge. Junior Officers were familiar with operational procedures within the CCR, while deck crew interviewed showed clear awareness of emergency stop arrangements.

During the attendance, it was identified that approximately 40% of the COW machines were not operational, and these defects require rectification. Notwithstanding this, the overall condition of cargo equipment was assessed as generally good, with no major technical failures observed.

Cargo and ballast procedures, including monitoring of hull stress and vessel stability, were implemented in line with Company requirements. Documentation related to operations was properly maintained, and tank cleaning plans were found complete and duly endorsed.

Pressure testing of cargo lines, COW lines and MARPOL lines did not meet the required criteria of 150% MAWP, as the target pressure could not be achieved using the Graco pump. It is considered that the condition of dresser couplings contributed to this limitation, and once repairs are completed, all lines are to be re-tested to confirm compliance with required pressure standards.

A Class-approved, vessel-specific Ballast Water Management Plan, valid International Ballast Water Management Certificate, and updated Ballast Water Record Book were available on board.

Lifting appliances were maintained in accordance with requirements. The hose handling crane, provision crane, and associated deck lifting equipment were found in good operational condition, with the latest annual survey completed without outstanding deficiencies.

One recommendation was issued.

8.3. Oil and chemical

No cargo operations were conducted during the attendance; therefore, all relevant observations and comments are detailed in Section 8.1.

9. Mooring and Anchoring

As part of the Marine Visit Inspection, mooring and anchoring arrangements were reviewed. During the attendance, mooring areas were properly maintained, with snap-back zones clearly identified and marked, and non-skid coating applied in working areas. Mooring lines were under continuous monitoring by the deck watch. Bitter end arrangements were confirmed clear and accessible, and the Emergency Towing Booklet was available near the forecastle entrance. Updated MSMP and LMP were available on board.

The vessel was fitted with 16 mooring lines on fixed drums .Accessible sections of mooring lines, tails, and connecting shackles were inspected and found in generally satisfactory condition. However, it is noted that mooring wires are over 10 years old and are planned to be replaced during the upcoming dry dock. Required spare mooring lines and tails were available on board in accordance with Company requirements.
Mooring equipment was overall in good operational condition. Hydraulic windlasses and winches were found operational, with no visible hydraulic leakage. Brake linings showed sufficient thickness, and clutch and gearing arrangements were properly greased. The last brake test was carried out on 25 November 2025 under previous management, with records available for verification. Annual brake holding capacity tests were conducted as required.
It is noted that the starboard windlass brake was not holding as required and requires rectification during the upcoming dry dock. In addition, the planetary gear mechanism is to be checked and overhauled, including verification on the port windlass, to ensure reliable operation.Deck fittings, including fairleads and rollers, were in good condition and free to rotate when tested. It is also noted that a spare anchor is available on deck, properly secured.

One recommendation was issued.

10. Machinery Spaces

The engine room was found to be in good overall condition, well organized, and maintained to a satisfactory standard. Engine room bilges were clean and tidy, reflecting good housekeeping practices. A joint inspection with the Chief Engineer confirmed that insulation, anti-splash protection, and other safety arrangements for hot surfaces were properly in place across identified hot spot areas.

All main and auxiliary machinery were operational, and the engine room monitoring and alarm system was functioning as intended. Emergency equipment had been tested at regular intervals in accordance with PMS requirements. Sea water pumps, sea chests, and associated fittings were found in good condition, without signs of corrosion or temporary repairs.

Procedures for UMS operation and entry into the engine room were properly followed, with supporting records maintained in both the Deck and Engine Log Books. Critical equipment and systems were clearly identified, and an approved list of critical machinery was available on board. The vessel maintained an updated Critical Spares Stock Control, confirming adequate spare parts availability.

The PMS, approved by Class and managed through the AMOS system, was effectively implemented. Work orders were reviewed and found up to date, with engine room officers demonstrating good familiarity with system use and maintenance planning.

Lifting equipment within the engine room was operational and maintained in line with company procedures. Pre-operational checks were carried out as required, with valid test records available and loose gear properly identified and controlled.

11. General Appearance and Condition - Photograph Comparison

The general condition of the hull, superstructure, deck areas, piping, and structural supports was reviewed during the attendance. The external hull coating was found in satisfactory cosmetic condition, with minor mechanical damage noted in way of fender contact areas. Vessel markings, including name, port of registry, IMO number, and draft marks, were clearly visible and correctly positioned. No abnormal marine growth was observed above the waterline.

Deck areas were coated in a light grey system which requires continuous upkeep; however, the overall condition remained satisfactory and in line with expectations for a vessel of similar age. Localized rust spots were identified in way of cargo tanks 1S to 3S and between 1P and 2P , which require further treatment and proper coating maintenance. Evidence of ongoing touch-up work was observed in several areas. The superstructure was in satisfactory condition, supported by visible maintenance efforts. External accommodation doors and openings were in good working order, ensuring proper sealing.

Pipelines and structural supports were generally in good condition; however, it was noted that hydraulic lines for deck machinery showed signs of corrosion, and additional attention is required to prevent potential leakage and deterioration. Deck fittings, cargo pipelines, and manifolds were properly marked and no active leakages were observed during the inspection.

Accommodation and living areas were generally clean and orderly, with hygiene standards maintained at a satisfactory level. Weekly inspection records were reviewed and found aligned with Company requirements. Public areas, sanitary spaces, cold rooms, laundry, mess rooms, and selected cabins were inspected and found in good condition overall.

Galley arrangements were generally acceptable in terms of cleanliness; however, it was observed that cooking utensils (pots) were in poor condition and require urgent replacement. Meals provided on board were adequate in quantity, though some concerns regarding food quality and portions were raised by crew members. These were discussed with the Master and Chief Cook and addressed during the HSE meeting for follow-up and improvement. Chopping knives and boards were colour coded and segregated.

Thirteen recommendations were issued.

Suggestions and recommendations for improvement

Dear Captain,
Dear Chief Engineer,

We would appreciate the following recommendations to be attended to:

1. Safety related issues must be corrected first and discussed by the next safety meeting.
2. The items shall be prioritized according to the spares / stores / manpower onboard availability. Specific stores and spares required for this work to be requisitioned as necessary and the deficiency number used to highlight the required item.
3. As the item is completed the superintendent is to be informed. The same completion date is to be noted on the ships copy and this is to be kept onboard as a reference.

No. 1	Category	Target Date	Responsibility	Close Out Date
VIQ 2.1.1	Process	30/04/2026	Master	06/04/2026

Finding

DMLC Part I and Part II not found on board during inspection.

Actions

Office to obtain and provide DMLC Part I and Part II on board.

No. 2	Category	Target Date	Responsibility	Close Out Date
VIQ 4.1.1	Equipment	30/04/2026	Master	06/04/2026

Finding

Risk assessment for ECDIS failure is generic, not ship specific.

Actions

2nd Officer and Master to prepare ship-specific risk assessment for ECDIS failure.

No. 3	Category	Target Date	Responsibility	Close Out Date
VIQ 4.1.12	Equipment	30/04/2026	Master	06/04/2026

Finding

Gyro and magnetic error not regularly calculated and recorded. Company Gyro Error Book not available on board.

Actions

Deck Officers to regularly calculate and record gyro and magnetic error. Maintain proper records. Ensure Gyro Error Book is available on board.

No. 4	Category	Target Date	Responsibility	Close Out Date
VIQ 8.1.2P-CA2	Equipment	30/04/2026	Master	

Finding

Approximately 40% of COW machines were not operational during tank cleaning operations.

Actions

Crew to identify all non-operational COW machines, check for blockages in lines and inspect machines for defects. Carry out cleaning, maintenance or replacement of spare parts as required. Ensure all COW machines are tested and confirmed fully operational prior next COW operation.

No. 5	Category	Target Date	Responsibility	Close Out Date
VIQ 9.1.4	Equipment	30/04/2026	Master	

Finding

Mooring wires are over 10 years in service.

Actions

Crew to arrange renewal of mooring wires as per company requirements.

No. 6	Category	Target Date	Responsibility	Close Out Date
VIQ 11.1.2	Equipment	30/04/2026	Master	

Finding

Rusty spots found between 1S COT and 3S COT.

Actions

Crew to clean, treat and paint rusty areas.

No. 7	Category	Target Date	Responsibility	Close Out Date
VIQ 11.1.3	Equipment	30/04/2026	Master	

Finding

Rusty spots found between 1P COT and 2P COT.

Actions

Crew to clean, treat and paint rusty areas.

No. 8	Category	Target Date	Responsibility	Close Out Date
VIQ 11.1.4	Equipment	30/04/2026	Master	

Finding

Cargo pipelines in front of accommodation have rusty spots.

Actions

Crew to clean, treat and paint affected pipelines.

No. 9	Category	Target Date	Responsibility	Close Out Date
VIQ 11.1.5	Equipment	30/04/2026	Master	

Finding

WBTS valves/wheels in front of accommodation found rusty.

Actions

Crew to clean, treat and paint affected valves.

Pictures Attached:

No. 10	Category	Target Date	Responsibility	Close Out Date
VIQ 11.1.6	Equipment	30/04/2026	Master	

Finding

Cargo overboard pipelines/valves on the Stbd side found with rusty spots.

Actions

Crew to clean, treat and paint affected pipelines.

No. 11	Category	Target Date	Responsibility	Close Out Date
VIQ 11.1.7	Equipment	30/04/2026	Master	

Finding

Gratings on both manifold drip trays found rusty.

Actions

Crew to clean, treat and paint gratings.

No. 12	Category	Target Date	Responsibility	Close Out Date
VIQ 11.1.9	Equipment	30/04/2026	Master	

Finding

STBD windlass brake does not hold properly.

Actions

Crew to inspect STBD windlass brake, check brake lining condition and adjust brake tension as required. If lining found worn, arrange renewal at earliest opportunity. After adjustment/repair, brake holding capacity to be tested and verified as satisfactory

No. 13	Category	Target Date	Responsibility	Close Out Date
VIQ 11.1.10	Equipment	30/04/2026	Chief engineer	

Finding

Hose handling crane(Port)has leakage on luffing cylinder seals.

Actions

Crew to inspect cylinder and repair leakage. Renew seals to be done.

No. 14	Category	Target Date	Responsibility	Close Out Date
VIQ 11.1.11	Equipment	30/04/2026	Master	

Finding

Forward fire wire reel found rusty.

Finding

Actions

Crew to clean, treat and paint fire wire reel. Ensure proper condition.

No. 15	Category	Target Date	Responsibility	Close Out Date
VIQ 11.1.12	Equipment	30/04/2026	Master	

Finding

Poop deck fire wire reel found rusty and brake lining to be renewed.

Actions

Crew to clean, treat and paint reel. Renew brake lining and test operation.

No. 16	Category	Target Date	Responsibility	Close Out Date
VIQ 11.1.19	Equipment	30/04/2026	Master	

Finding

Steam pipelines leaking on flange connections.

Actions

Crew to inspect flanges and stop leakage. Tighten bolts or renew gaskets as required.

Pictures Attached:

No. 17	Category	Target Date	Responsibility	Close Out Date
VIQ 11.1.25	Equipment	30/04/2026	Chief engineer	

Finding

Engine room dampers do not fully close.

Actions

Crew to inspect dampers, clean and adjust as required. Repair defects and ensure full closing.

No. 18	Category	Target Date	Responsibility	Close Out Date
VIQ 11.1.51	Equipment	30/04/2026	Master	

Finding

Cargo Stripping Pump(CSP) plunger rod stuffing box (gland packing) found with leakage.

Actions

Crew to inspect and repair leakage. Renew seals or parts as required.

Pictures Attached:

No. 19	Category	Target Date	Responsibility	Close Out Date
VIQ 11.1.60	Equipment	30/04/2026	Master	

Finding

Hydraulic lines for deck mooring winches throughout the vessel were observed to be corroded ,with potential risk of leakage.

Actions

Corroded sections to be cleaned,treated and recoated ,with any compromised parts replaced as necessary. System to be pressurized and monitored for leaks.

Pictures Attached:

Superintendent: Dani Bacic
Master: Abashidze Jemal

SPECIFIC ITEMS TO BE ADDRESSED DURING SHIP VISITS

Each element marked “No” require a comment.

ID	Name	Answer
2.1.1-SI1	Was the IHM (Inventory of Hazardous Material) was carried out? (Yes/No)(If yes, record date in comments)	Yes
	Comments/Findings: **Date of last certificate is 11.03.2021.** **Date of last verification is 27.03.2025.**	
2.1.1-SI2	Have all certificates been checked and there are no overdue statutory services such as 5 years service of LSA and FFE, regardless of validity of the Safety Equipment Certificate ?	Yes
	Comments/Findings:	
2.1.1-SI3	Has the check for annual endorsement of all Statutory Certificates by competent authority and on survey completion, has the "Dichiarazione ai fini", required to be endorsed from the flag authorities been completed. (Italian Flag only)	N/A
	Comments/Findings: **Only for Italian Flag vessels.**	
2.4.2-SI1	Are the Master and Chief Engineer fully familiar with 'GOPR-09.8 - Handling Defects'. Any mechanical malfunction or equipment failure which could lead to an adverse impact to HSSE, Energy, Operational Capability or Reliability, failure of critical equipment, CoC MUST be recorded as DEFECT in AMOS PMS.	Yes
	Comments/Findings:	
2.5.1-SI1	Are the Master and Chief Engineer fully familiar with 'GOPR-04.4 - Management of Change'. The vessel is confirmed to be free from unauthorised modifications, even minor, in any area on the vessel. Any modifications on board MUST authorised via MOC process and approved by the Company, Class as applicable.	Yes
	Comments/Findings:	
2.6.1-SI1	Is the Master and Chief Officer familiar with the Ballast Water Management Plan and Convention and handling ballast is conducted in accordance with the approved method?	Yes
	Comments/Findings:	
2.6.1-SI2	Are Ballast Water Record Books covering the period of the last 3 years available on board?	Yes
	Comments/Findings:	
2.6.3-SI1	Is the SEEMP Part I, Part II & Part III on board and are other Master and officers familiar with MARPOL Annex VI requirements and in particular to the CII?	Yes
	Comments/Findings:	
2.6.3-SI2	Is the approved EEXI Technical File is available on board for the ships constructed before 2013?	Yes
	Comments/Findings:	
3.2.4-SI1	Has the Navigation Self-Assessment been completed by the Master as per BOPR-7.1 and findings reviewed by the attending Marine Superintendent during the visit and discussed with the Master and deck officers?	Yes
	Comments/Findings:	
3.4.1-SI2	Are shipboard activities properly planned in accordance with GOPR-4.3, records of worked hours checked by senior officers and copy of completed monthly sheets retained by seafarers? In case of observed systematic violations, were they communicated to the responsible Technical Superintendent and was the response from the Technical Superintendent available on board including the agreed corrective actions?	Yes
	Comments/Findings:	
3.4.2-SI1	Are onboard alcohol tests carried out in accordance with the Company procedure, including unannounced testing of the Master upon office request and are the results of testing properly filed?	Yes
	Comments/Findings: **Last test done on 26.02.2026**	
3.4.2-SI2	Has an unannounced alcohol test been initiated and witnessed by the Marine Superintendent during the present visit? (Record date in comments)	Yes
	Comments/Findings: **Last test done on 26.02.2026.**	
4.1.11-SI3	Have recent significant incidents and LTBL promulgated during the last 12 months been discussed with the Master, Officers and crew? Are crewmembers familiar with Shell Reflective Learning and Learning Engagement Tool?	Yes
	Comments/Findings:	
5.1.12-SI1	Have the Fire and Life Boat drills been conducted during Marine Superintendent sailing visits?	Yes
	Comments/Findings: **Fire drill done on 08.03.2026** **Life boat drill done 08.03.2026**	

ID	Name	Answer
5.2.1-SI1	Have all Fire Pumps, General service pumps serving as fire pump and emergency fire pump been individually & satisfactory tested and all pumps are in good condition and free from any unauthorised modifications including pipework.	Yes
	Comments/Findings:	
5.2.7-SI1	Are all fire main isolating valves free to turn and during routine safety inspections are these valves always being operated under pressurised fire main to establish that the valve in fact is fully closed i.e. not passing water?	Yes
	Comments/Findings:	
5.5.1-SI1	Have Enclosed Space Entry permits been properly completed and supported with Atmosphere Check Records and Records of Personnel Entering Enclosed Space?	Yes
	Comments/Findings:	
5.5.1-SI2	Has Enclosed Space Entry Procedure been followed and Responsible Officer does not enter the Enclosed Space?	Yes
	Comments/Findings:	
5.5.2-SI1	Have Hot Work permits been properly completed and supported with Atmosphere Check Records and other relevant documentation (HW Plan, Risk Assessment, Company Approval)?	Yes
	Comments/Findings:	
5.6.1-SI1	Has the Draeger gas detection equipment, if provided, been inspected in accordance with the manufacturers recommendations by the attending Marine Superintendent?	Yes
	Comments/Findings:	
5.7.2-SI1	Has the vetting preparation self-inspection been carried out by the Master within two weeks after joining and reported to the Office (MIN02)?	Yes
	Comments/Findings:	
5.7.2-SI2	Has the attended MSI led by example in promoting safety culture and HSSE excellence by issuing a 'Safety Observation Note'. The note may be issued for the identified hazard or unsafe condition or unsafe act or near-miss or if stop work was exercised whilst observing safe-work practices on board. If Yes, the Master shall be instructed to submit such report via CAPE to the office with clearly identified name and rank of MSI.	Yes
	Comments/Findings: **One near miss has been issued by MSI.**	
5.7.2-SI3	Has on-job training for front line personnel been carried out focusing on safety awareness, familiarity with system requirements and effective barriers?	Yes
	Comments/Findings:	
5.7.3-SI1	Has the Safety Committee Meeting been held with all available crew and in the presence of the Marine Superintendent? (Record date in comments)	Yes
	Comments/Findings:	
5.7.6-SI1	Has the Engine Room fire-hazard Risk Assessment been conducted on board by the Chief Engineer and approved by the Technical Superintendent?	Yes
	Comments/Findings:	
5.10.1-SI2	Have the pilot ladders and man-ropes been maintained in good condition, are not overdue for inspection and retirement as applicable? Are Officers and Ratings familiar with correct methods of inspection, rigging and securing of pilot ladders, combination ladders and man-ropes, including stowage requirements?	Yes
	Comments/Findings:	
6-SI1	Is the Environmental Compliance properly implemented on board?	Yes
	Comments/Findings:	
6-SI2	Has the Environmental Compliance Assessment been completed at intervals required by GOPR-7.8?	Yes
	Comments/Findings:	
6-SI3	Are all Officers and Crew aware of the location of the digital EC Pocket Guide and can access the digital EC Pocket Guide?	Yes
	Comments/Findings:	
6-SI4	Have the Master, Chief Engineer, officers and crew completed the VGP training and are familiar with the VGP structure, eNOI, inspection, monitoring and record keeping requirements?	Yes
	Comments/Findings:	
6.1.2-SI1	Does the Master thoroughly review the Oil Record Books for correct entries before he signs them including comparison with ODME printout and OWS electronic memory, if provided?	Yes
	Comments/Findings:	
6.1.2-SI2	Are Oil Record Books Part I, Oil Record Books Part II, Cargo Record Books (as applicable) covering the period of the last 3 years available on board?	Yes

ID	Name	Answer
	Comments/Findings:	
6.1.3-SI1	Is the Electronic Oil Record Book in use, if provided? (If not provided mark this item as N/A)	N/A
	Comments/Findings: **Electronic ORB is not in use on board.**	
6.1.4-SI1	Is a Ship Execution Plan for Single Use Plastics (SUP) available and has an initial Inventory for SUPs completed and forwarded to the office? Are all crew members are fully aware of the actions necessary to achieve the objective?	Yes
	Comments/Findings:	
6.1.4-SI2	Are Garbage Record Books covering the period of the last 3 years available on board?	Yes
	Comments/Findings:	
6.5.1-SI1	Has the Environmental Seal through the flange bolts been fitted on every blank or potentially removable flange associated with any piping leading overboard?	Yes
	Comments/Findings:	
6.5.1-SI2	Has a List of Sealed Valves been prepared and was it readily available on board (deck + engine)?	Yes
	Comments/Findings:	
6.5.2-SI1	Are the Engineer Officers familiar with the company procedure for safe use of the incinerator and was the incinerator used in accordance with the company procedure? Particularly, the engineers shall be familiar with: - The checks that must be conducted before the incinerator is used on each occasion; - The PPE that must be used when loading garbage into the incinerator; - Effectiveness of the safety interlocks fitted to garbage loading chutes; - The company prohibition to inhibit any safety devices on incinerator.	Yes
	Comments/Findings:	
6.6.1-SI1	Are the Master and Engineers fully aware of Company procedures with respect to retention and disposal of sludge and bilge water?	Yes
	Comments/Findings:	
6.6.1-SI2	Have the Oily Water Separator and the Oil Content Monitor been made tamper secure in accordance with the Company procedures and are all affixed seals effective?	Yes
	Comments/Findings:	
6.6.1-SI3	Is the sample line from OWS discharge connection to sample/flush valve clearly visible on the entire length, free of any additional tees, connections or valves and is the sample line painted red? Has the inspection funnel been checked to ensure that there is no water leakage after the 3-way valve was completely shut?	Yes
	Comments/Findings:	
6.6.1-SI4	Has the OWS apparently free from any unauthorised modifications including pipework?	Yes
	Comments/Findings:	
9.4.1-SI1	Have the accessible areas of mooring lines, mooring tails and joining shackles been inspected and confirmed that they are in good order, not overdue for retirement as per Company procedure? Have the records of the mooring lines inspections been reviewed and any mooring lines which requires replacement recorded for follow up by the Marine Superintendent? Have all mooring winches been inspected and found in good order? Are all controls are in place, brakes band in satisfactory condition and condition of the brake drums satisfactory? Is the pressure gauge for calibration of BHC kit available and scale within working range of the BHC kit, as applicable for tankers and gas carriers?	Yes
	Comments/Findings:	
9.4.2-SI1	Has hands on training in safe mooring operations been provided to the relevant crew?	Yes
	Comments/Findings:	
10.2.4-SI1	Have all engine room piping systems been found in good condition and free of leaks and temporary repairs such as soft patches, bandages, clamps and doublers?	Yes
	Comments/Findings:	
10.3.2-SI1	Is the condition of bow thruster in working order and free from any leaks?	N/A
	Comments/Findings:	
10.3.5-SI1	Has the ER Alarm and monitoring system been checked and there are no any manually suppressed alarm recorded without authorisation by the Chief Engineer or MOC as applicable.	Yes
	Comments/Findings:	
10.5.1-SI1	Are HFO Service and Settling tanks being clean in required intervals?	Yes
	Comments/Findings: **The HFO tanks are scheduled to be cleaned during the dry docking period in April 2026.**	

ID	Name	Answer
10.7.2-SI1	Have the main & diesel engines fuel delivery pipes been inspected and are they adequately jacketed and screened? Are the exhaust lines and hot surfaces protected from spray and surrounding areas free from fuel and lube oil leakages? Are the Engineer Officers familiar with emergency actions in case of fuel or lube oil spray near hot surfaces?	Yes
	Comments/Findings:	

General view of the main deck from the monkey island

The sides of the accommodation (port)

The sides of the accommodation (stbd)

The accommodation front

The accommodation block aft part

The poop deck taken from above

Mooring winches aft

The Lifeboat(port)

The lifeboats(stbd)

The after end of the main deck,port side

The after end of the main deck,stbd side

The manifold area,port side

The manifold area,stbd side

The forward end of the main deck,port side

The forward end of the main deck, starboard side

Windlass ,port

Windlass,stbd

Forecastle space

Foreward Mooring Winch

AC and OX room

Foam Room

Paint Locker

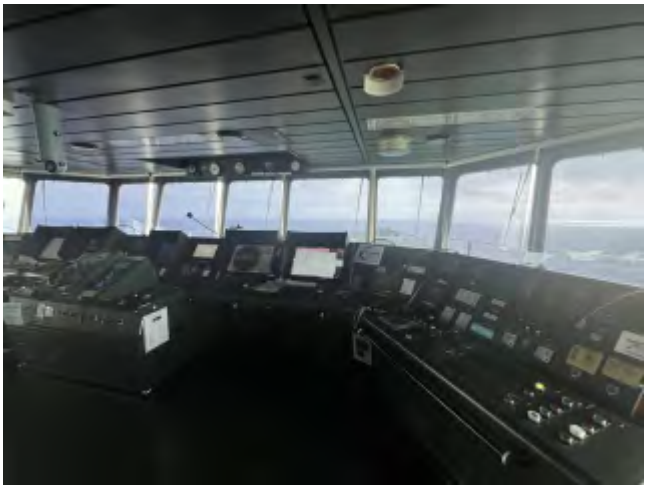

Bridge

Interior

Messroom

Hospital

Officer Recreation Room

CCR

Conference Room

ECR

General view of the compartment from the top platform

Bottom plates,port side

Bottom plates,stbd

Purifier Room

Disel Generators

Incinerator

Work shop and welding room

Boiler

Boiler flat

Emergency Fire Pump

Bilges

Steering Gear Compartment