



SIO cable — J_SIO1 → 130XE

11 wires · C070065/67 · solder to cap pads

PIN 9 = +5V Everything from pin 6 up shifts: IDC 6→SIO 7, 7→8, 8→9, 9→10, 10→11, 11→13.

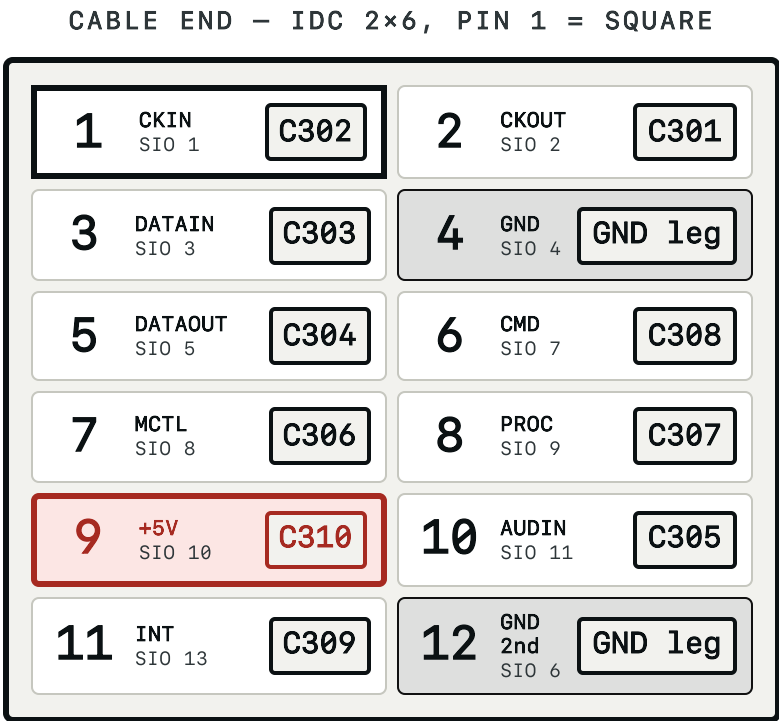

BOARD END — CONNECTOR AT TOP, PINS TOWARD YOU

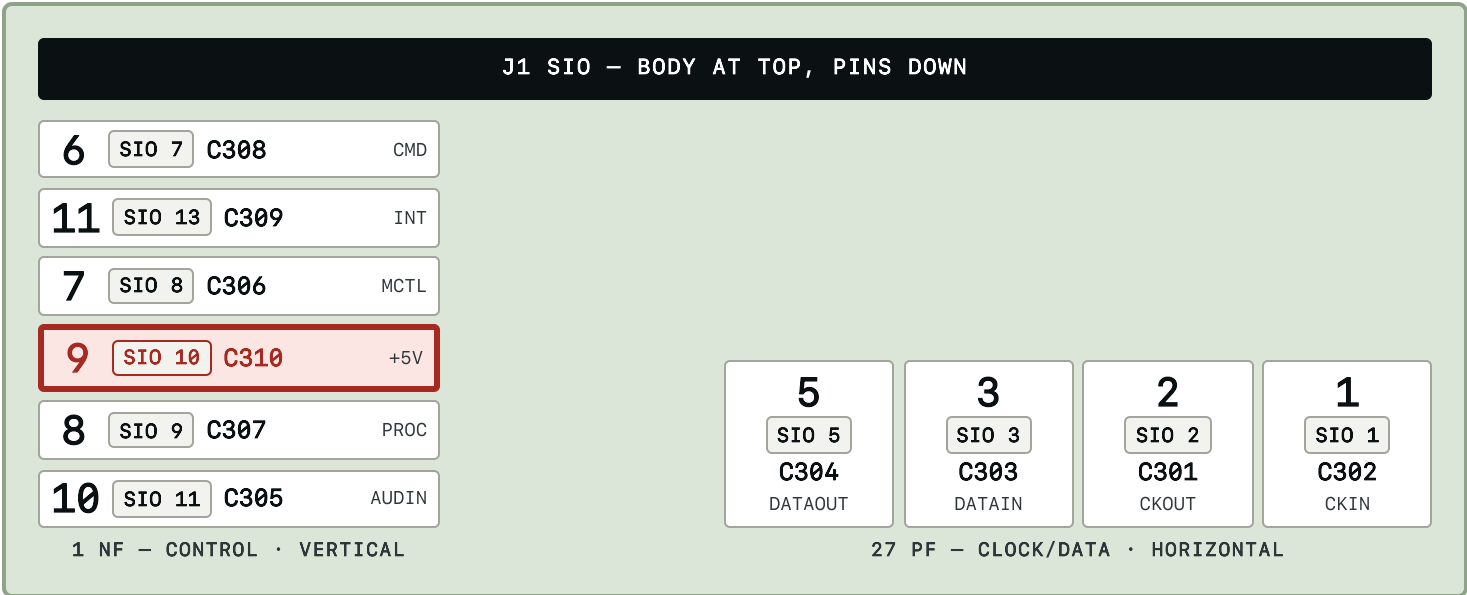


Big number = IDC pin · boxed = SIO jack pin. Other leg of every cap = GND. Go by silkscreen, not position.

JACK ORIENTATION



SD cable — J_SD1 → SD board J1

7-pin JST PH 2.00mm · straight through

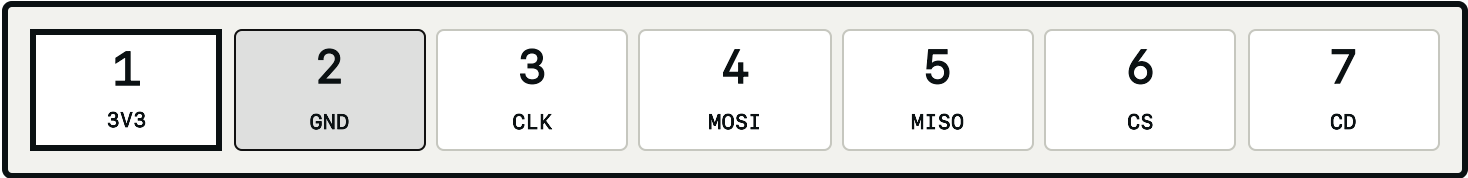

Pin 1 → pin 1. No crossover. Same connector both ends.

BEFORE POWER

- 1. Jumper across J_PWR1 or board is dead
- 2. Fit U.FL antenna (WROVER-IE)
- 3. USB-C first, then SIO
- 4. Buzz every pad to its jack pin before soldering