



URBANGRID REAL ESTATE CONSULTANCIES

HOME CONDITION AUDIT REPORT (SNAGGING)

Presented To

Mr. Rizwan
V085, Talia The Valley By Emaar
Al Ain Road, Dubai, U.A.E



Presented By

Shahabas Rahman

info@urbangrid.ae / +971585686852

21-October-2025

Table of Contents

Introduction	3
Report Overview	3
Scope of Inspection.....	4
Specialized Tools	6
Defect List	6
Summary of Findings.....	7
Conclusion.....	9
General Business Terms & Conditions	10
Appendix A : Schedule of Defects (Snagging)	13

Introduction

The snagging inspection for **V085, Talia The Valley By Emaar, Al Ain Road, Dubai, UAE** was conducted on **17th October 2025** by UrbanGrid Real Estate Consultancies for **Mr. Rizwan**. The objective was to assess the property for outstanding construction and finishing defects that require rectification before the final handover. This report outlines the identified issues, categorizing them based on severity, and provides recommendations for necessary corrective actions.

The purpose of this report is to assist the client in addressing identified issues, ensuring the property meets quality and safety standards, and is ready for handover.

Our commitment to quality, transparency, and innovation ensures that every project is completed to the highest standards, providing clients with the clarity and insight needed to make informed decisions. Whether you are looking to optimize building operations, maintain regulatory compliance, or future-proof your assets, UrbanGrid is your trusted partner in real estate consultancy.

Report Overview

This audit involved a detailed evaluation of the unit's condition, identifying defects in structural integrity, finishing quality, and operational performance of mechanical, electrical, and plumbing (MEP) systems. The assessment was carried out using industry-standard methodologies and best practices. The key focus areas of this inspection included:

- **Civil and Structural Elements:** Walls, ceilings, floors, doors, and window installations.
- **Mechanical, Electrical, and Plumbing (MEP) Systems:** Electrical fixtures, water fittings, and HVAC installations.
- **Joinery and Fit-out Works:** Cabinetry, countertops, and built-in storage units.
- **Sanitary Installations:** Bathrooms, vanity units, and related plumbing components.
- **Fire and Life Safety Compliance:** Fire extinguisher mounting and regulatory adherence.

Scope of Inspection

The home condition audit was conducted as a **comprehensive evaluation** of the unit's interior and exterior finishes, ensuring compliance with construction standards and safety regulations. The assessment included:

1. Structural and Architectural Elements:

- Evaluation of walls, ceilings, and floors for cracks, paint inconsistencies, undulations, and plaster defects.
- Inspection of doors, windows, and frames for alignment, hardware functionality, and sealing integrity.
- Assessment of tile installation, grout application, and floor slope for proper drainage.

2. Mechanical, Electrical, and Plumbing (MEP) Systems:

- Verification of electrical fixtures, switchboards, and panel boards for proper installation, alignment, and safety compliance.
- Inspection of visible wiring, socket placements, and concealed conduits for regulatory adherence and hazard prevention.
- Testing of plumbing fixtures, water flow, drainage efficiency, and sealant applications to prevent leaks and water damage.
- Assessment of HVAC system components, including vent placement, airflow, and thermostat functionality.

3. Joinery and Fit-out Works:

- Review of kitchen and bathroom cabinetry for gaps, scratches, misalignment, and operational efficiency.
- Examination of built-in wardrobes, shelving, and storage areas for proper installation and durability.
- Inspection of countertops, backsplash joints, and appliance accommodations for seamless integration and quality finishing.

4. Sanitary Installations & Fixtures:

- Checking of bathroom fittings, vanity units, and floor drains for proper sealing and stability.
- Assessment of silicon and grout finishes around wet areas to ensure waterproofing and prevent future deterioration.
- Testing of faucets, showerheads, and WC flushing systems for functionality and water pressure.

5. **Fire and Life Safety Compliance:**

- Verification of fire extinguisher mounting and inspection tags in accordance with UAE Fire and Life Safety Code regulations.
- Inspection of emergency exit paths, smoke detectors, and fire alarm panels (if applicable) for operational readiness.

6. **General Property Condition:**

- Evaluation of balcony structures, railings, and façade finishes for durability and compliance with design specifications.
- Identification of any general cleanliness or construction residue that may affect the final handover quality.

This structured methodology ensures a **detailed and systematic review** of the unit's readiness for occupancy, allowing for timely rectifications and quality assurance before final handover.

Specialized Tools

- A thorough visual inspection was conducted, covering both the interior and exterior areas of the property.
- The operational status of essential systems and equipment was visually assessed using specialized tools such as **thermal imaging cameras, moisture meters, hygrometers, socket testers e.t.c.** Some of these tools are displayed below.



Defect List

A detailed list of all identified defects within **V085, Talia The Valley By Emaar, Al Ain Road, Dubai, UAE** is provided in the Appendix A for reference. Each defect entry includes a description, location and severity level. This comprehensive list serves as a guide to address each issue systematically and ensure the unit meets the required quality standards.

Summary of Findings

A detailed inspection of **Villa V085, Talia – The Valley by Emaar**, located in **Al Yufra 1**, was carried out on **17 October 2025** for the client **Mr. Rizwan**. Civil and architectural finishing defects account for approximately **85% of the total findings**, demonstrating that **workmanship and surface quality control** require considerable improvement before handover. The most prevalent issues include:

- **Paintwork and Wall Finishes:**
Widespread inconsistencies in paint shade, visible brush strokes, patchy coverage, and paint splatter were noted across walls and ceilings throughout the villa, including the corridor, garage, balconies, and pump room. Several areas also exhibited paint overruns on tiles and aluminum surfaces, indicating lack of masking and inadequate finishing.
- **Grouting and Sealant Works:**
In many rooms, grout joints were found uneven, cracked, or poorly filled—especially around skirting tiles, architraves, and door or window frames. Silicon sealant lines were irregular and often incomplete, particularly at the base of doors, sliding frames, and shower enclosures.
- **Tile Works and Floor Levels:**
A significant number of floor tiles across bedrooms, corridors, and living spaces exhibited **stepping, hollow sound, and chipped corners**, suggesting insufficient sub-base leveling and weak tile bonding. Such issues are both aesthetic and structural, potentially leading to future delamination.
- **Joinery and Door Frame Finishes:**
Minor damages, scratches, and misalignments were observed on door frames, handles, and architraves. Several internal doors required excessive force to close, indicating misalignment or swelling. Entrance and garden doors showed surface discoloration and loose hardware components.
- **External Finishes:**
External areas such as the **garage, backyard, and façade** exhibited poor paint finishes, visible cracks in plaster, chipped tiles, and uneven wall textures. Missing weephole covers, poor grout detailing, and stains on aluminum elements were also observed.

2. Mechanical, Electrical, and Plumbing (MEP) Systems

Approximately **15% of the total defects** fall under the **MEP category**, encompassing operational, safety, and compliance concerns.

Electrical Systems

- Several sockets and switches were found **non-operational** or **misaligned**.
- Gaps around ceiling spotlights and loose switch controllers were common.
- Thermal imaging detected potential **overheating near ceiling lights**, which may indicate exposed or poorly insulated wiring.
- The **intercom system** was non-functional during inspection.

Mechanical Systems

- **AC units** (both indoor and outdoor) exhibited **dust accumulation**, visible stains, and **rusted screws** on external components.
- Gaps were found around AC grills, potentially compromising air distribution and aesthetics.
- Rust formation was observed on **solar panel gauges**, indicating a lack of corrosion protection.

Plumbing Systems

- **Water leakage and dampness** were observed in multiple areas, notably in the **master bathroom, powder rooms, and laundry room ceiling**, confirmed by **thermal imaging**.
- Loose installations of **bidet sprays, flush taps, and commode fittings** were observed.
- The **maid's bathroom floor** exhibited inadequate slope, leading to improper drainage and water stagnation.
- Missing **water tap handles** and poor sealant detailing were also noted in the service areas.

Fire and Safety

- The **fire extinguisher** and **fire blanket** were found stored inside a kitchen cabinet, which does not comply with **local civil defense requirements**. They must be wall-mounted and readily accessible.

3. Moisture Intrusion and Thermal Findings

The thermal imaging inspection revealed **moisture intrusion** and temperature anomalies in several locations, particularly in the **laundry room, master bedroom ceiling, and powder room ceiling**. These findings indicate possible water ingress from concealed plumbing or roof membrane defects. Moisture-related issues, if unaddressed, can lead to long-term deterioration, mold formation, and electrical hazards.

4. Health, Safety, and Hygiene Observations

- **Pest presence** (spiders and ants) was noted in the **laundry room**, highlighting the need for pest control and sealing of potential entry points.
 - Rust and corrosion on metallic components such as screws, handles, and AC units could compromise the longevity and appearance of fittings.
 - Improper storage of fire equipment and electrical anomalies present **safety risks** that require immediate correction.
-

5. Overall Workmanship and Quality Assessment

The general quality of workmanship was found to be **below the expected standards for Emaar residential properties**. Most defects stem from **inadequate supervision, insufficient surface preparation, and poor final detailing** rather than structural faults. While the villa is structurally sound and functionally complete, the **visual and finishing quality** currently falls short of handover expectations.

Recurring issues such as **inconsistent paint finishes, poor sealant lines, hollow tiles, and dampness** suggest a lack of final quality assurance prior to inspection.

Conclusion

The snagging inspection of **Villa V085, Talia – The Valley by Emaar** revealed a **large number of moderate to high-severity defects (Levels 2–4)** that require rectification before the villa can be deemed ready for handover. While the structure itself is satisfactory and no major structural failures were observed, the **finishing quality and MEP system performance** remain **substandard** in their current state.

Key areas requiring **immediate attention** include:

1. **Moisture intrusion and waterproofing repairs** in ceilings and wet areas.
2. **Rectification of electrical safety hazards** and re-testing of all sockets, switches, and intercom units.
3. **Reworking of tile installations** showing hollow sounds, uneven levels, or chipped edges.
4. **Reapplication of sealants and grouting** throughout skirting, frames, and sanitary fittings.
5. **Repainting and surface refinishing** to correct visible inconsistencies, stains, and poor detailing.
6. **Fire safety compliance** through proper mounting of firefighting equipment.
7. **Comprehensive cleaning, pest control, and final detailing** before reinspection.

Upon completion of all corrective measures, a **follow-up inspection** should be conducted to verify defect closures and confirm that all items meet Emaar's **handover quality standards**.

The complete defect list and photographic evidence are attached in the Appendix for reference, categorization, and follow-up action by the responsible parties.

For further clarifications or to schedule a follow-up inspection, please contact us at info@urbangrid.ae

General Business Terms & Conditions

These General Terms of Business are provided to clarify the basis on which we operate for our clients. They apply to all services offered by UrbanGrid Real Estate Consultancies L.L.C. ("UrbanGrid") and are to be read in conjunction with any appointment-specific correspondence, including any additional terms imposed by the relevant department handling your project. Any such additional terms will be provided to you before your instructions are confirmed.

These General Terms of Business, any additional terms, and the appointment correspondence will form the contract ("The Contract") between you and UrbanGrid unless amended in writing.

1. Our Relationship with You

1.1. In this document and elsewhere, "UrbanGrid", "we", "our", and "us" refer to UrbanGrid Real Estate Consultancies L.L.C. The term "partner" refers to a member of UrbanGrid and does not imply a legal partnership.

1.2. Your contract is solely with UrbanGrid, and no individual member, employee, agent, or consultant will assume personal legal liability for work performed. Any communication signed by individuals is done so on behalf of UrbanGrid, without assuming personal liability.

1.3. The services we provide are confidential and intended solely for you, the client, unless prior written consent is obtained to share this information. UrbanGrid will not be held liable to any third party for the work carried out on your behalf.

1.4. You are responsible for ensuring the accuracy of the information and documentation provided. UrbanGrid will not be liable for any losses or errors arising from false, incomplete, or misleading information supplied.

1.5. Upon completion of our services, relevant files may be stored for up to 12 years from the date of final invoicing. After this period, we retain the right to destroy these files unless otherwise agreed.

2. Responsibility for Work

2.1. We will provide our services with reasonable professional skill and care. A designated Client Partner will oversee your project, with work delegated as necessary to other qualified team members, ensuring efficiency and appropriate expertise.

3. Fees

3.1. Fees will be outlined in the appointment correspondence.

3.2. In addition to professional fees, you may be responsible for repaying disbursements and expenses incurred on your behalf. We may request an upfront payment or immediate reimbursement.

3.3. UrbanGrid does not pay interest on monies held for fees or disbursements.

3.4. Invoices are due upon receipt, and interest at 6% per month may be charged for non-payment after 45 days. Further work may be suspended until all outstanding amounts are paid.

3.5. Should legal action be required to recover outstanding fees, the client agrees to cover any reasonable costs incurred.

3.6. A charge of AED 500 will apply to any dishonoured cheque.

3.7. If fees are to be paid by a third party, you remain liable if they fail to pay within 30 days.

4. Data Protection

4.1. UrbanGrid complies with Data Protection legislation and ensures the confidentiality of our clients' affairs.

4.2. Client information may be shared within UrbanGrid to fulfil your instructions or for promotional purposes unless otherwise instructed.

5. Copyright

5.1. UrbanGrid retains the copyright and ownership of all documents, reports, and records produced in connection with your work.

6. Complaints Procedure

6.1. UrbanGrid follows a formal complaints procedure, details of which can be obtained from your Client Partner. We expect most issues to be resolved amicably.

7. Applicable Law & Jurisdiction

7.1. UAE law applies to all instructions, and UAE courts shall have jurisdiction over any disputes.

8. Liability

8.1. The maximum liability in relation to our work will be outlined in the appointment correspondence.

8.2. If no amount is specified, liability will be limited to outstanding fees and will not exceed USD 1 million.

8.3. These liability limits apply regardless of the number of individuals comprising our client for any instruction.

8.4. These limitations do not apply to deliberate or willful default, nor to damages for death or personal injury.

8.5. Claims may be brought only against UrbanGrid, not against individual employees, members, or agents of the company.

8.6. UrbanGrid will not be liable for any indirect, consequential loss or delay caused by events beyond our reasonable control.

8.7. Any liability will account for other parties' contributory negligence or responsibilities, regardless of those parties' financial status or liability limitations.

9. Regulation

9.1. We may be obliged to request evidence of identity for new clients under money laundering regulations.

9.2. UrbanGrid may be required to disclose information to regulatory authorities under certain conditions, without client notification.

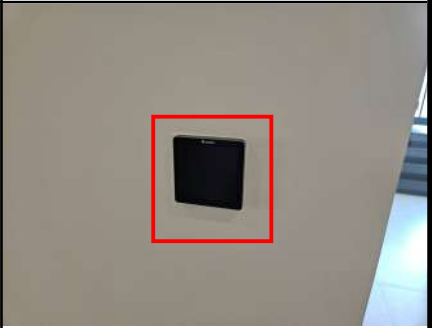
10. Miscellaneous

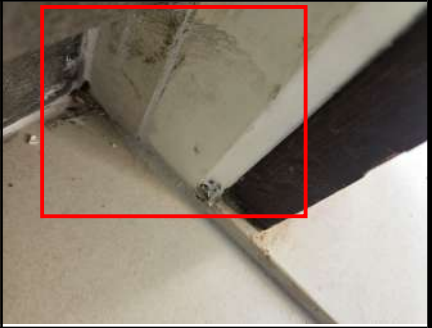
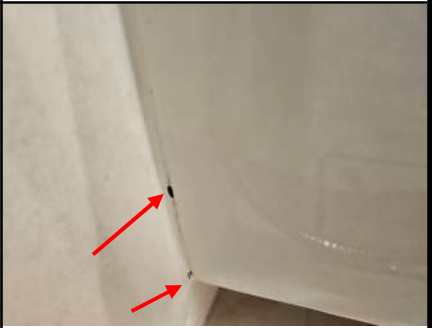
10.1. No variation to these terms shall be binding unless agreed in writing.

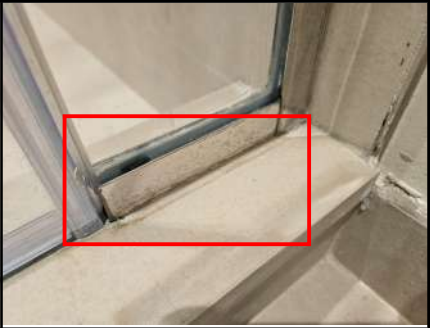
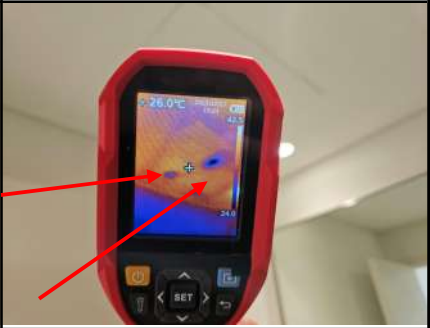
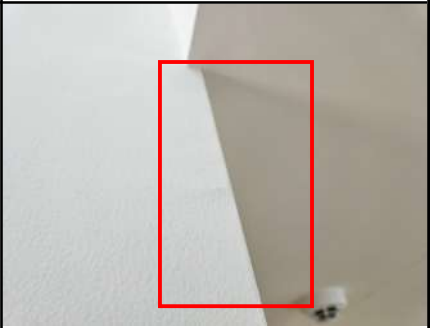
10.2. By instructing UrbanGrid, you acknowledge that you have not relied on any representations not explicitly provided in The Contract.

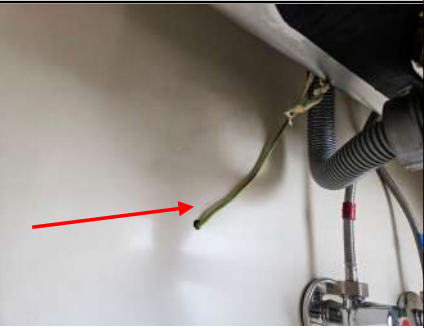
10.3. If any provision of The Contract is deemed invalid, the validity of the remaining terms will not be affected.

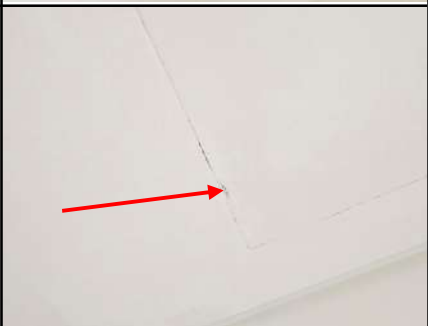
Appendix A : Schedule of Defects (Snagging)

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
1	Ground Floor Bedroom	Civil	Poor detailing of the silicon seal above the door frame	Open	2	
2	Ground Floor Bedroom	Civil	Scratches to the aluminum door frame	Open	2	
3	Ground Floor Bedroom	Civil	Poor application of grouting and sealant at the skirting level	Open	2	
4	Ground Floor Bedroom	Civil	Scuff and stain marks to the aluminum frame	Open	2	
5	Ground Floor Corridor	Civil	Inconsistent paint marks to the wall paint finish in the corridor	Open	2	
6	Ground Floor Corridor	Civil	The DB door was difficult to close and required excessive force to be fully shut	Open	2	
7	Ground Floor Corridor	Civil	The AC controller unit in the corridor was non-operational at the time of inspection	Open	4	
8	Entrance	Civil	Inconsistent paint marks to the wall paint finish	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
9	Entrance	Civil	Minor damage to the door frame surface finish	Open	2	
10	Entrance	Civil	Poor detailing of the silicon seal along the vertical line between the door frame and wall	Open	2	
11	Entrance	Civil	Sealant at door frame base was poorly finished	Open	2	
12	Entrance	Civil	The entrance door handle was slightly loose	Open	2	
13	Entrance	MEP	The intercom system was non-operational at the time of inspection	Open	4	
14	Ground Floor Bathroom	Civil	Visible gap between the door frame and skirting finish	Open	2	
15	Ground Floor Bathroom	Civil	Damaged silicon seal to the shower door	Open	3	
16	Ground Floor Bathroom	Civil	Incomplete silicon seal around the toilet with visible gaps	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
17	Ground Floor Bathroom	Civil	Shower door base was discolored. The area requires deep cleaning.	Open	1	
18	Ground Floor Bathroom	MEP	Heat spots detected near the ceiling light in the bathroom, indicating potential exposed wiring in the ceiling void	Open	3	
19	Ground Floor Bathroom	Civil	Paint touch ups to the ceiling access panel	Open	2	
20	Kitchen	Civil	Inconsistent wall paint finish	Open	1	
21	Kitchen	MEP	One electrical socket in the fridge area was non-operational as tested with the use of a socket tester	Open	4	
22	Kitchen	Civil	Minor stain marks to the wall paint near the kitchen cabinet	Open	2	
23	Kitchen	Civil	Discolored patch observed beneath cabinet cornice	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
24	Kitchen	Civil	The switch outlets were unclean and observed with stain marks	Open	1	
25	Kitchen	MEP	Fire extinguisher was placed inside the kitchen cabinet. Additionally, fire blanket was missing. They should both be available and wall mounted to comply with local regulations	Open	4	
26	Kitchen	MEP	Loose earthing wire observed below kitchen sink; connection to designated earthing point required and to be verified by a qualified electrician	Open	4	
27	Kitchen	Civil	Minor scratches to the kitchen extract hood	Open	1	
28	Kitchen	Civil	Wall width found inconsistent, appearing wider at the upper section. This is likely due to uneven plastering requiring surface correction and re-finishing.	Open	2	
29	Kitchen	Civil	Wall width found inconsistent, appearing wider at the upper section. This is likely due to uneven plastering requiring surface correction and re-finishing.	Open	2	
30	Kitchen	Civil	The electrical sockets and the fridge switch were not properly aligned at the same level, creating aesthetic issue	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
31	Laundry Room	Civil	Presence of small spiders and ants observed in laundry room. The area requires pest control treatment and sealing of possible entry points	Open	4	
32	Laundry Room	Civil	The ceiling paint finish was not properly detailed near the access panel	Open	2	
33	Laundry Room	Civil	Signs of dampness observed on laundry room ceiling paint. Thermal imaging confirmed moisture presence. Source to be identified and rectified before repainting.	Open	4	
34	Laundry Room	MEP	Signs of dampness observed on laundry room ceiling paint. Thermal imaging confirmed moisture presence. Source to be identified and rectified before repainting.	Open	4	
35	Living Room	Civil	Mesh screen door found damaged, with torn mesh and visible surface heavy scratches to the door frames. Replacement of complete mesh door unit is recommended to restore proper function and appearance.	Open	3	
36	Living Room	Civil	Mesh screen door found damaged, with torn mesh and visible surface heavy scratches to the door frames. Replacement of complete mesh door unit is recommended to restore proper function and appearance.	Open	3	
37	Living Room	Civil	Mesh screen door found damaged, with torn mesh and visible surface heavy scratches to the door frames. Replacement of complete mesh door unit is recommended to restore proper function and appearance.	Open	3	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
38	Living Room	Civil	Scratches to the garden door aluminum frame	Open	2	
39	Living Room	Civil	The garden door lock was non-operational	Open	3	
40	Living Room	Civil	The garden door lock was scratched and discolored	Open	2	
41	Living Room	Civil	The light switch controllers were loose and requires adjustments	Open	2	
42	Maid's Room	Civil	Scratches to the door frame surface finish	Open	2	
43	Maid's Room	Civil	Hairline crack observed on wall corner	Open	2	
44	Maid's Room	Civil	Maid's room door misaligned; door latch requires strong push to engage. Adjustment of lockset and door alignment recommended for smooth operation.	Open	3	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
45	Maid's Room	Civil	Loose application of the sealant to the door frame of the maid's bathroom	Open	3	
46	Maid's Room	Civil	Door handle plate was scratched	Open	2	
47	Maid's Room	Civil	Door latch plate scratched with chipped paint around fixing area	Open	2	
48	Maid's Room	Civil	Shower floor slope in maid's bathroom inadequate. The water not fully draining and accumulating near toilet area	Open	3	
49	Staircase	Civil	Poor detailing and finishes to the stair tread corner with chipped and stained surfaces	Open	2	
50	Staircase	Civil	Poor detailing and finishes to the stair tread corner with chipped and stained surfaces	Open	2	
51	Staircase	Civil	Poor detailing and finishes to the stair tread corner with chipped and stained surfaces	Open	2	
52	Staircase	Civil	Gap observed below stair tread and wall finish.	Open	3	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
53	Garage Area	Civil	Damaged pavement tile observed	Open	3	
54	Garage Area	Civil	Missing sand infill observed between pavement tiles. Recommended to infill the entire area once again.	Open	2	
55	Garage Area	Civil	Visible brush strokes observed on the wall and paint splatter observed on the floor	Open	2	
56	Garage Area	Civil	Missing sand infill observed between pavement tiles.	Open	2	
57	Garage Area	Civil	Poor wall paint finishes observed to garage wall	Open	2	
58	Garage Area	Civil	Minor chip observed on pavement tile	Open	2	
59	Garage Area	Civil	Visible paint marks on pavement tile	Open	2	
60	Garage Area	Civil	Uneven level observed to manhole cover	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
61	Garage Area	Civil	Visible crack marks observed around cement plaster around manhole	Open	2	
62	Garage Area	Civil	Uneven wall plaster finish observed on the wall	Open	3	
63	Garage Area	Civil	Uneven wall plaster finish observed on the wall	Open	2	
64	Garage Area	Civil	Poor wall paint finishes and paint splatter observed on the wall	Open	2	
65	Garage Area	Civil	Incomplete wall paint finishes noted to the façade	Open	3	
66	Garage Area	Civil	Visible paint stains and poor wall paint finishes noted	Open	2	
67	Garage Area	Civil	Poor wall paint finishes observed on the column	Open	3	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
68	Garage Area	Civil	Minor chip noted to wall tile	Open	2	
69	Garage Area	Civil	Minor chip noted to wall tile	Open	2	
70	Garage Area	Plumbing	Missing water tap handle installation spotted	Open	3	
71	Garage Area	Civil	Undulation observed to garage ceiling finish	Open	2	
72	Sidewalk	Civil	Visible stains observed to sidewalk paving	Open	2	
73	Sidewalk	Civil	Visible brush strokes observed on the wall	Open	2	
74	Sidewalk	Civil	Poor silicon detailing observed around glass panels	Open	2	

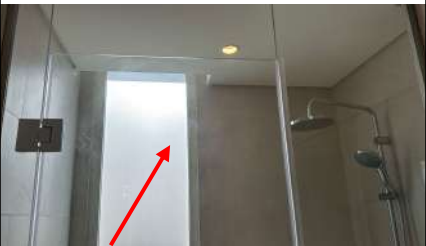
Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
75	Sidewalk	Civil	Ensure neat wall paint finishes	Open	2	
76	Pump Room	Civil	Visible brush strokes and patches observed on the wall	Open	3	
77	Pump Room	Civil	Visible brush strokes and patches observed on the wall	Open	3	
78	Pump Room	Civil	Poor wall paint finishes observed on the ceiling	Open	3	
79	Pump Room	Civil	Poor epoxy floor paint finishes observed to pump room flooring	Open	3	
80	Pump Room	Civil	Poor wall paint finishes observed near electrical installation	Open	2	
81	Pump Room	Civil	Poor paint finishes noted to floor near the pump room gate	Open	2	

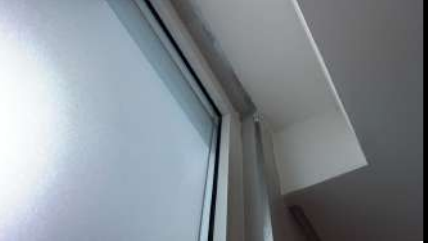
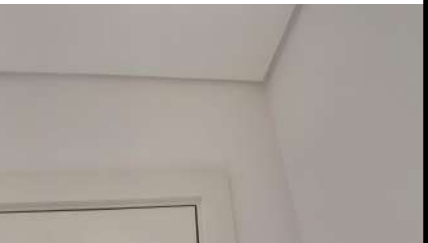
Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
82	Backyard	Civil	Stepping noted to flooring tiles in the backyard	Open	2	
83	Backyard	Civil	Improper grouting observed to floor tiles in the backyard	Open	2	
84	Backyard	Civil	Minor stains noted to sliding door frame	Open	2	
85	Backyard	Civil	Poor wall paint finishes observed in the window sill	Open	2	
86	Backyard	Civil	Poor paint finishes noted to soffit slab	Open	2	
87	Backyard	Civil	Missing weephole covers observed to aluminum window frame	Open	2	
88	Backyard	Civil	Missing grout detailing noted to wall tiles	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
89	Backyard	Civil	Poor wall paint finishes to window sill	Open	2	
90	Backyard	Civil	Visible stains noted to soffit	Open	2	
91	Backyard	Civil	Visible paint splatter observed on backyard gate	Open	2	
92	Backyard	Civil	Visible paint stains observed on the backyard aluminum works	Open	2	
93	First Floor Master Bedroom	Civil	Improper grout application observed on skirting tile to architrave	Open	2	
94	First Floor Master Bedroom	Civil	Chipped skirting tile corner	Open	2	
95	First Floor Master Bedroom	Civil	Chipped panel noted inside the wardrobe	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
96	First Floor Master Bedroom	Civil	Scratches on wardrobe hanging rod	Open	2	
97	First Floor Master Bedroom	Civil	Thermal imaging indicates the signs of water ingress on ceiling	Open	4	
98	First Floor Master Bedroom	Civil	Stains noted on panel inside the wardrobe	Open	2	
99	First Floor Master Bedroom	Civil	Remove all the unwanted screws which is stored inside the wardrobe	Open	1	
100	First Floor Master Bedroom	Civil	Hairline crack spotted on wall surface	Open	2	
101	First Floor Master Bedroom	Civil	Paint variation noticed on wall surface	Open	2	
102	First Floor Master Bedroom	Civil	Hairline crack spotted on wall surface	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
103	First Floor Master Bedroom	Civil	Hairline crack spotted on ceiling curtain partition panel	Open	2	
104	First Floor Master Bedroom (Balcony)	Civil	Dirt and scratches on balcony door glazing	Open	2	
105	First Floor Master Bedroom (Balcony)	Civil	Paint variation noticed on wall surface	Open	3	
106	First Floor Master Bedroom (Balcony)	Civil	Paint variation noticed on wall surface	Open	3	
107	First Floor Master Bedroom (Balcony)	Civil	Loose fixation of balcony door hinge cap cover	Open	2	
108	First Floor Master Bedroom (Balcony)	Civil	Rusted screws were noted on door stopper	Open	2	
109	First Floor Master Bedroom (Balcony)	Civil	Paint variation noticed on wall surface	Open	3	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
110	First Floor Master Bedroom (Balcony)	Civil	Paint variation noticed on wall surface	Open	3	
111	First Floor Master Bedroom (Balcony)	Civil	Missing sliding door weep hole covers	Open	2	
112	First Floor Master Bedroom (Bathroom)	Plumbing	Scratches on commode flush tap surface	Open	2	
113	First Floor Master Bedroom (Bathroom)	Civil	Damaged wall tile noted around the vanity sink drain pipe termination	Open	2	
114	First Floor Master Bedroom (Bathroom)	Civil	Remove all the wooden pieces near to vanity cabinet clamps	Open	2	
115	First Floor Master Bedroom (Bathroom)	Civil	Chipped panel edge observed on vanity cabinet	Open	2	
116	First Floor Master Bedroom (Bathroom)	Civil	Scratches on shower partition glass surface	Open	2	

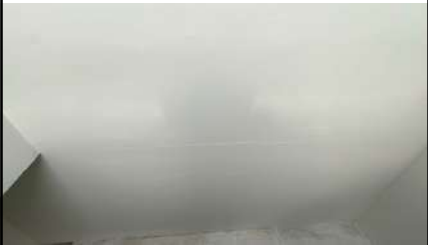
Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
117	First Floor Master Bedroom (Bathroom)	Civil	Paint overrun to wall tile	Open	2	
118	First Floor Master Bedroom (Bathroom)	Civil	Poor quality finishing observed on sealant application around the fixed glass frame	Open	2	
119	First Floor Master Bedroom (Bathroom)	Plumbing	Rusted bidet spray flexible hose connection wire	Open	2	
120	First Floor Master Bedroom (Bathroom)	Civil	Water leakage stains spotted on ceiling surface	Open	4	
121	First Floor Master Bedroom (Bathroom)	Electrical	Visible gaps were noted around the ceiling spotlights	Open	2	
122	Passage	Civil	Cracks were observed around the distribution board panel	Open	2	
123	First Floor Powder Room	Civil	Stains noted on wall surface	Open	2	

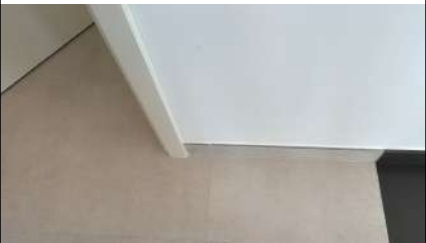
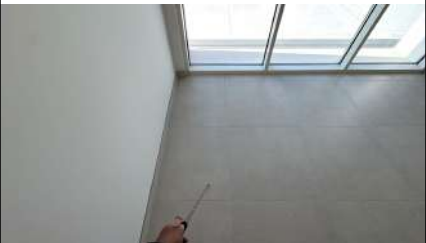
Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
124	First Floor Powder Room	Civil	Thermal imaging indicates the signs of water ingress on ceiling	Open	4	
125	First Floor Powder Room	Civil	Thermal imaging indicates the signs of water ingress on ceiling	Open	4	
126	First Floor Powder Room	Civil	Thermal imaging indicates the signs of water ingress on ceiling	Open	4	
127	First Floor Powder Room	Civil	Damaged paint on wall and paint paint overrun to wall tile noted on vanity cabinet	Open	2	
128	First Floor Powder Room	Civil	Stains on wall noted below the vanity cabinet	Open	2	
129	First Floor Powder Room	Civil	Damaged plastering observed on wall around the vanity mirror	Open	2	
130	First Floor Powder Room	Civil	Chipped wall termination	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
131	First Floor Powder Room	Plumbing	Loose installation of commode flush tap	Open	2	
132	First Floor Powder Room	Civil	Stepping spotted on wall tile	Open	2	
133	First Floor Bedroom 1	Civil	Crack noted around the architrave	Open	2	
134	First Floor Bedroom 1	Civil	Scratch or stains on wall surface	Open	2	
135	First Floor Bedroom 1	Civil	Paint variation noticed on wall surface	Open	2	
136	First Floor Bedroom 1	Civil	Paint variation noticed on wall surface and poor finishing noted around the architrave	Open	2	
137	First Floor Bedroom 1	Civil	Hairline crack observed on wall surface	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
138	First Floor Bedroom 1	Mechanical	Dust build-up on AC unit	Open	2	
139	First Floor Bedroom 1	Civil	Minor paint coating damage on window handle	Open	2	
140	First Floor Bedroom 1	Civil	Chipped wall edge noted above the wardrobe	Open	2	
141	First Floor Bedroom 1	Civil	Chipped skirting tile corner	Open	2	
142	First Floor Bedroom 2	Civil	Improper grout application observed on skirting tile to architrave	Open	2	
143	First Floor Bedroom 2	Civil	Crack observed on gypsum ceiling termination to wall	Open	2	
144	First Floor Bedroom 2	Civil	Scratch mark on wall surface	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
145	First Floor Bedroom 2	Civil	Undulation spotted on wall, possibly due to poor plastering finish	Open	2	
146	First Floor Bedroom 2	Civil	Paint variation noted on ceiling	Open	2	
147	First Floor Bedroom 2	Civil	Damaged fly net	Open	2	
148	First Floor Bedroom 2 (Balcony)	Civil	Paint variation noted on wall surface	Open	2	
149	First Floor Bedroom 2 (Balcony)	Civil	Paint variation and Improper paint application on wall termination	Open	2	
150	First Floor Bedroom 2 (Balcony)	Civil	Paint variation noted on wall surface above sliding frame	Open	2	
151	First Floor Bedroom 2 (Balcony)	Civil	Paint variation noted on wall surface above sliding frame	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
152	First Floor Bedroom 2 (Balcony)	Civil	Improper sealing noted on sliding frame	Open	2	
153	First Floor Bedroom 2	Civil	Poor sealant application noted around the architrave	Open	2	
154	Roof	Civil	Chipped gypsum roof hatch	Open	2	
155	First Floor Bedroom 1	Civil	Poor sealant application noted around the architrave	Open	2	
156	Roof	Civil	Crack and improper paint application on roof hatch	Open	2	
157	Roof	Civil	Crack noticed on roof hatch	Open	2	
158	Roof	Civil	Crack and improper finishing on roof hatch	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
159	Roof	Mechanical	Rusted screws noted	Open	2	
160	Roof	Mechanical	Dust build-up on Outdoor AC unit filters, clean all the AC filters	Open	3	
161	Roof	Mechanical	Rust formation spotted on solar panel gauge	Open	4	
162	First Floor Master Bedroom	Electrical	Misaligned switch board installation	Open	2	
163	Staircase	Civil	Misaligned skirting tile installation	Open	2	
164	First Floor Bedroom 1	Civil	Stepping noted on almost all floor tile	Open	2	
165	First Floor Bedroom 1	Civil	Hollow sound detected on floor tile	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
166	First Floor Bedroom 1	Civil	Chipped floor tile	Open	2	
167	First Floor Bedroom 1	Civil	Hollow sound detected on floor tile	Open	2	
168	First Floor Bedroom 1	Civil	Hollow sound detected on floor tile	Open	2	
169	First Floor Powder Room	Civil	Chipped floor tile around the floor drain	Open	2	
170	First Floor Powder Room	Civil	hollow sound detected on wall tile	Open	2	
171	First Floor Powder Room	Civil	hollow sound detected on wall tile	Open	2	
172	First Floor Bedroom 2	Civil	Insufficient epoxy application noted on floor tile	Open	2	

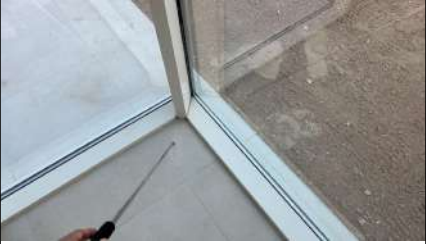
Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
173	First Floor Bedroom 2	Civil	Chipped floor tile and inmproper sealing noted on floor tile to sliding frame	Open	2	
174	First Floor Bedroom 2	Civil	Stepping noted on floor tile	Open	2	
175	First Floor Bedroom 2	Civil	Chipped floor tile	Open	2	
176	First Floor Bedroom 2 (Balcony)	Civil	Damaged floor tile	Open	2	
177	First Floor Bedroom 2 (Balcony)	Civil	Stepping noted on floor tile	Open	2	
178	First Floor Bedroom 2	Civil	Insufficient epoxy application noted on floor tile	Open	2	
179	First Floor Bedroom 2 (Balcony)	Civil	Hollow sound detected on all floor tiles	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
180	First Floor Bedroom 2	Civil	Stepping noted on floor tile	Open	2	
181	First Floor Bedroom 2	Civil	Stepping noted on floor tile	Open	2	
182	First Floor Bedroom 2	Civil	Stepping noted on floor tile	Open	2	
183	First Floor Bedroom 2	Civil	Stepping noted on floor tile	Open	2	
184	First Floor Bedroom 2	Civil	Chipped floor tile	Open	2	
185	First Floor Bedroom 2	Civil	Rust formation noticed on skirting tile steel frame	Open	2	
186	First Floor Bedroom 2	Civil	Hollow sound detected on floor tile	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
187	First Floor Master Bedroom	Civil	Hollow sound detected on floor tile	Open	2	
188	First Floor Master Bedroom	Civil	Hollow sound detected on floor tile	Open	2	
189	First Floor Master Bedroom	Civil	Hollow sound detected on floor tile	Open	2	
190	First Floor Master Bedroom	Civil	Hollow sound detected on floor tile	Open	2	
191	First Floor Master Bedroom (Balcony)	Civil	Improper sealing noted on floor tile to skirting tile	Open	2	
192	First Floor Master Bedroom (Balcony)	Civil	Paint variation noted on wall surface	Open	2	
193	First Floor Bedroom 2	Electrical	Remove all the plaster application noted on ceiling light	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
194	First Floor Bedroom 2	Electrical	Misaligned installation of switch board	Open	2	
195	Staircase	Civil	Improper grouting noted on floor tile to handrail frame	Open	2	
196	Staircase	Civil	Hollow sound detected on staircase tread	Open	2	
197	Staircase	Civil	Improper grout application observed on staircase skirting tile	Open	2	
198	Staircase	Civil	Visible gap noted on staircase handrail to wooden frame, check throughout the area	Open	2	
199	Staircase	Civil	Improper sealing noted on staircase rise joints	Open	2	
200	Staircase	Civil	Improper sealing noted on staircase rise joints	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
201	Staircase	Civil	Misaligned wall tile installation	Open	2	
202	Staircase	Civil	Improper grouting found below the staircase	Open	2	
203	Staircase	Mechanical	Stains were found on ceiling AC grill panel	Open	2	
204	Staircase	Electrical	Visible gaps were noted around the ceiling spotlights	Open	2	
205	Staircase	Mechanical	Gaps were found around the ceiling AC grill panel	Open	2	
206	Ground floor living area	Civil	Stepping noted on almost all floor tile	Open	2	
207	Guest room	Civil	Stepping noted on almost all floor tile	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
208	Guest room	Civil	Stepping noted on floor tile	Open	2	
209	Guest room	Civil	Stepping noted on floor tile	Open	2	
210	Maid Room (Bathroom)	Civil	Stepping noted on wall tile	Open	2	
211	Maid Room	Civil	Chipped floor tile	Open	2	
212	Ground floor living area	Civil	Hollow sound detected on floor tile	Open	2	
213	Guest room	Civil	Stains were found on skirting tile	Open	2	
214	Ground floor powder room	Civil	Stepping noted on wall tile	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
215	Ground floor powder room	Civil	Stepping noted on wall tile	Open	2	
216	Ground floor powder room	Civil	Hollow sound detected on wall tile	Open	2	