



URBANGRID REAL ESTATE CONSULTANCIES

HOME CONDITION AUDIT REPORT

Presented To

Mr. Raj Rawal
Unit 2504, MAG 5, Marina Square
Abu Dhabi, U.A.E



Presented By

Shahabas Rahman

info@urbangrid.ae / +971585686852

08-April-2026

Table of Contents

Introduction..... 3

Report Overview 3

Scope of Inspection 4

Specialized Tools 5

Defect List..... 6

Summary of Findings..... 6

Conclusion 8

General Business Terms & Condition..... 10

Appendix A : Schedule of Defects 13

Introduction

This report presents the findings of a detailed inspection conducted by **UrbanGrid** on **03rd April 2026** for **Unit 2504, MAG 5, Marina Square, Abu Dhabi, UAE**. The inspection was requested by **Mr. Raj Rawal** to evaluate the property's overall condition and identify defects or quality concerns prior to handover.

UrbanGrid's experienced team conducted a meticulous review of the property, focusing on civil works, mechanical, electrical, and plumbing (MEP) systems, fire safety compliance, and general finishes. This inspection follows industry best practices and UrbanGrid's high standards of quality assurance.

The purpose of this report is to assist the client in addressing identified issues, ensuring the property meets quality and safety standards, and is ready for handover.

Our commitment to quality, transparency, and innovation ensures that every project is completed to the highest standards, providing clients with the clarity and insight needed to make informed decisions. Whether you are looking to optimize building operations, maintain regulatory compliance, or future-proof your assets, UrbanGrid is your trusted partner in real estate consultancy.

Report Overview

This inspection report documents the findings from a detailed evaluation conducted by **UrbanGrid**. The inspection was carried out at the request of **Mr. Raj Rawal** to assess the property's readiness for handover, ensuring compliance with construction standards and identifying defects requiring rectification.

The evaluation included all major aspects of the property, such as structural integrity, mechanical, electrical, and plumbing (MEP) systems, fire safety compliance, and aesthetic finishes. Each defect was categorized by severity—high, medium, or low—and documented.

Scope of Inspection

UrbanGrid Real Estate Consultancies was commissioned to perform a comprehensive property inspection for **Unit 2504, MAG 5, Marina Square, Abu Dhabi, UAE** on behalf of **Mr. Raj Rawal**. The primary objective was to identify and document defects, inconsistencies, and incomplete works to ensure the property adheres to the highest quality standards and is ready for occupancy or final handover.

The scope of inspection included a systematic evaluation of:

1. External and Entrance Areas

- Inspection of door frames, shutters, and hardware for scratches, chips, and alignment issues.
- Review of entryways for paint defects and operational functionality of door locks and fittings.

2. Internal Finishes

- Examination of paint and plaster finishes on walls, ceilings, and joinery.
- Evaluation of tile installations, grouting quality, and overall alignment.

3. Mechanical, Electrical, and Plumbing (MEP) Systems

- Inspection of electrical fixtures, panels, and faceplates for scratches, alignment, and functionality.
- Assessment of plumbing installations for water ingress risks, debris in drains, and silicon finishes.

4. Kitchens, Bathrooms, and Specialized Areas

- Assessment of cabinetry, countertops, and backsplash detailing for gaps, stepping, or poor finishes.
- Inspection of sanitary fixtures, angle valves, and floor drains for operational effectiveness and workmanship.
- Review of bespoke elements like wardrobes, cabinets, and skirting for damage or misalignment.

5. Balcony and Structural Elements

- Evaluation of balcony parapet walls, floor drains, and aluminium frames for cracks, stains, and gaps in sealants.

- Inspection of doors, windows, and frames for scratches, redundant openings, and sealing integrity.

The inspection was conducted using a structured methodology, referencing applicable industry standards and contractual obligations to deliver an accurate and comprehensive assessment of the property's condition. This ensures the unit meets all quality expectations before final handover or occupancy.

Specialized Tools

- A thorough visual inspection was conducted, covering both the interior and exterior areas of the property.
- The operational status of essential systems and equipment was visually assessed using specialized tools such as **thermal imaging cameras, moisture meters, hygrometers, socket testers etc..** Some of these tools are displayed below.



Defect List

A detailed list of all identified defects within **Unit 2504, MAG 5, Marina Square, Abu Dhabi, UAE** is provided in the Appendix A for reference. Each defect entry includes a description, location and severity level. This comprehensive list serves as a guide to address each issue systematically and ensure the unit meets the required quality standards.

Summary of Findings

The home condition audit of Unit 2504 identified a significant number of defects across civil, mechanical, electrical, and plumbing elements. The observations indicate general wear and tear, poor maintenance, and multiple areas affected by moisture ingress and finishing deterioration. The unit overall is in a condition that requires substantial remedial attention prior to occupancy.

A major and recurring concern throughout the unit is **water leakage, dampness, and moisture-related deterioration**. Evidence of damp patches, water stains, and ceiling damage was observed in multiple areas including the master bedroom, all secondary bedrooms, living area, kitchen, store room, and bathrooms. Thermal imaging and moisture meter readings further confirmed the presence of moisture within wall and ceiling surfaces, indicating potential ongoing water ingress issues. In several areas, gypsum ceilings show staining, delamination, and cracking due to prolonged exposure to moisture.

The **master bedroom** exhibits multiple defects such as cracked walls, chipped paint, detached skirting, and deteriorated window fittings including rusted hinges and aged clamps. The ceiling shows clear signs of water damage. Electrical defects were also noted, including non-functional ceiling spotlights. The attached bathroom reflects similar concerns with water leakage, damaged sealants, rusted fixtures, slow drainage in the vanity sink, and deterioration of finishes including tiles and ceiling surfaces.

The **hallway and foyer areas** show general finishing defects including cracks at wall-to-ceiling junctions, loose hardware, chipped door edges, paint inconsistencies, and visible dirt accumulation. These defects are primarily cosmetic but widespread.

In **Bedroom 1**, the condition is notably impacted by moisture-related issues. Extensive dampness, leakage stains, and confirmed moisture presence within walls indicate a serious underlying issue. Ceiling cracks, delamination, and surface stains are evident. The attached bathroom is in poor condition, with damaged vanity cabinets, Mold growth on tiles, non-functional lighting, and defective plumbing fixtures including a non-functional shower head. Sealant deterioration and rusting of fittings are also prominent.

The **second bedroom** also presents ceiling undulations, surface damage, and efflorescence near window joints, indicating moisture penetration. Its bathroom has similar defects, including leakage stains, damaged finishes, rusted components, and drainage issues.

The **third bedroom** shows water leakage stains, cracks, and non-functional lighting fixtures. The attached bathroom inspection was partially restricted; however, thermal imaging suggests moisture presence in the ceiling, along with additional defects such as detached tiles and plumbing issues.

The **living area** is significantly affected by water ingress, with multiple locations showing leakage stains, damp patches, and confirmed moisture within walls. Additional issues include cracks, ceiling damage near curtain rails, and dirt marks on wall surfaces. Dust accumulation was also observed on AC grills.

The **kitchen** shows both civil and mechanical defects, including chipped wall edges, stains, dust accumulation, rusted ventilation components, and cabinet issues such as faulty operation and deteriorated hinges. Water leakage signs were identified on the ceiling, likely linked to the kitchen hood area.

In the **store room and maid's room**, defects include damp ceilings, rusted fixtures, surface damage, and dust accumulation. The maid's bathroom also shows leakage, damaged tiles, and corroded plumbing elements.

The **powder room** presents ceiling damage, water leakage evidence, missing fittings, and damaged tiles. Sealant deterioration and incomplete finishes were also noted.

Across the unit, **general issues such as cracked walls, chipped paint, damaged sealants, rusted fixtures, loose hardware, and dirt accumulation are widespread**. The condition of finishes indicates prolonged lack of maintenance.

Additionally, it is important to note that **the entire unit requires deep cleaning**, as dirt, stains, dust build-up, and hygiene concerns were observed in multiple areas including walls, ceilings, exhausts, AC components, and wet areas. Furthermore, due to extensive paint damage, stains, and surface inconsistencies, **repainting is required throughout the unit** to restore acceptable aesthetic and functional standards.

Overall, the findings indicate that the unit is not in a ready-to-occupy condition and requires comprehensive rectification works, particularly addressing moisture ingress issues, restoration of finishes, repair/replacement of damaged fixtures, and full cleaning and repainting.

Conclusion

Based on the home condition audit, Unit 2504 is currently **not in a habitable or move-in ready condition**. The inspection revealed a high volume of defects across all areas of the unit, with several classified under higher severity levels, particularly those associated with **water leakage, dampness, and moisture ingress**. These issues are widespread and affect critical areas such as bedrooms, living spaces, kitchen, and multiple bathrooms.

The presence of moisture within walls and ceilings, supported by thermal imaging and meter readings, indicates **potential ongoing water ingress**, which, if not addressed promptly, may lead to further structural deterioration, mold growth, and unhealthy indoor conditions. In addition, corrosion of fixtures, deterioration of sealants, and damage to gypsum ceilings and finishes suggest prolonged exposure to moisture and lack of maintenance.

Electrical and plumbing deficiencies, including non-functional light fixtures and slow drainage, further impact the functionality of the unit. Mechanical components such as ventilation systems and AC-related elements also show signs of dirt accumulation and wear.

Moreover, the overall internal condition reflects **poor upkeep**, with extensive paint damage, surface staining, and general wear and tear observed throughout. The unit also lacks proper cleanliness, with visible dust, dirt accumulation, and hygiene concerns in several areas.

In summary, the unit requires **comprehensive repair, rectification, and restoration works** before it can be considered suitable for occupancy.

Recommendations:

To restore the unit to an acceptable and safe living condition, the following actions are strongly recommended:

1. Rectification of Water Leakage and Moisture Issues (High Priority)

- Conduct a detailed investigation to identify the **source of water ingress** (e.g., plumbing lines, waterproofing failure, external façade, or AC drainage systems).
- Repair all leakage points and defective waterproofing systems.
- Remove and replace all **water-damaged gypsum ceilings, wall finishes, and affected materials**.
- Treat all damp and moisture-affected areas with **anti-fungal and anti-mold solutions** before reinstatement.

2. Civil Repair and Finishing Works

- Repair all **cracks, chipped surfaces, and delaminated areas** on walls and ceilings.
- Reinstall or replace **detached tiles, skirting, and damaged architraves**.
- Rectify all **sealant failures** in bathrooms, kitchens, and around fixtures.
- Replace or repair **damaged doors, cabinets, and hardware fittings** including hinges, handles, and stoppers.

3. Full Repainting of the Unit

- Carry out **complete repainting throughout the unit**, including walls, ceilings, doors, and trims.
- Ensure proper surface preparation, including crack filling, sanding, and application of primer before final coats.
- Use **moisture-resistant paint** in areas previously affected by dampness.

4. Deep Cleaning (Essential)

- Perform a **comprehensive deep cleaning of the entire unit**, including:
 - Floors, walls, and ceilings
 - All bathrooms and kitchen areas
 - AC grills, exhaust fans, and ventilation systems
 - Cabinets, fixtures, and fittings
- Remove all dirt, stains, dust build-up, and debris to restore hygiene standards.

5. Mechanical, Electrical, and Plumbing (MEP) Repairs

- Repair or replace all **non-functional light fixtures and electrical components**.
- Service and clean **AC systems and ventilation units**, ensuring proper operation.
- Rectify plumbing issues including **slow drainage, damaged fixtures, and corroded pipes or fittings**.
- Replace rusted components such as **hinges, screws, and metal fittings**.

6. Bathroom and Wet Area Refurbishment

- Replace or repair **damaged tiles, mold-affected surfaces, and deteriorated cabinetry**.
- Reapply **sealants and waterproofing** in all wet areas.
- Ensure proper slope and drainage to avoid water stagnation.

7. Final Inspection and Preventive Measures

- Conduct a **comprehensive re-inspection** after completion of all rectification works.
- Implement a **preventive maintenance plan**, particularly for plumbing and waterproofing systems, to avoid recurrence of moisture-related issues.

Overall Recommendation:

It is strongly advised that all the above rectification works be completed by qualified professionals before occupancy. Special attention must be given to **moisture and leakage issues**, as these are the most critical defects affecting the unit. Only after proper repairs, deep cleaning, and repainting should the unit be considered suitable for occupancy or habitation.

General Business Terms & Condition

These General Terms of Business are provided to clarify the basis on which we operate for our clients. They apply to all services offered by UrbanGrid Real Estate Consultancies L.L.C. ("UrbanGrid") and are to be read in conjunction with any appointment-specific correspondence, including any additional terms imposed by the relevant department handling your project. Any such additional terms will be provided to you before your instructions are confirmed.

These General Terms of Business, any additional terms, and the appointment correspondence will form the contract ("The Contract") between you and UrbanGrid unless amended in writing.

1. Our Relationship with You

1.1. In this document and elsewhere, "UrbanGrid", "we", "our", and "us" refer to UrbanGrid Real Estate Consultancies L.L.C. The term "partner" refers to a member of UrbanGrid and does not imply a legal partnership.

1.2. Your contract is solely with UrbanGrid, and no individual member, employee, agent, or consultant will assume personal legal liability for work performed. Any communication signed by individuals is done so on behalf of UrbanGrid, without assuming personal liability.

1.3. The services we provide are confidential and intended solely for you, the client, unless prior written consent is obtained to share this information. UrbanGrid will not be held liable to any third party for the work carried out on your behalf.

1.4. You are responsible for ensuring the accuracy of the information and documentation provided. UrbanGrid will not be liable for any losses or errors arising from false, incomplete, or misleading information supplied.

1.5. Upon completion of our services, relevant files may be stored for up to 12 years from the date of final invoicing. After this period, we retain the right to destroy these files unless otherwise agreed.

2. Responsibility for Work

2.1. We will provide our services with reasonable professional skill and care. A designated Client Partner will oversee your project, with work delegated as necessary to other qualified team members, ensuring efficiency and appropriate expertise.

3. Fees

3.1. Fees will be outlined in the appointment correspondence.

3.2. In addition to professional fees, you may be responsible for repaying disbursements and expenses incurred on your behalf. We may request an upfront payment or immediate reimbursement.

3.3. UrbanGrid does not pay interest on monies held for fees or disbursements.

3.4. Invoices are due upon receipt, and interest at 6% per month may be charged for non-payment after 45 days. Further work may be suspended until all outstanding amounts are paid.

3.5. Should legal action be required to recover outstanding fees, the client agrees to cover any reasonable costs incurred.

3.6. A charge of AED 500 will apply to any dishonoured cheque.

3.7. If fees are to be paid by a third party, you remain liable if they fail to pay within 30 days.

4. Data Protection

4.1. UrbanGrid complies with Data Protection legislation and ensures the confidentiality of our clients' affairs.

4.2. Client information may be shared within UrbanGrid to fulfil your instructions or for promotional purposes unless otherwise instructed.

5. Copyright

5.1. UrbanGrid retains the copyright and ownership of all documents, reports, and records produced in connection with your work.

6. Complaints Procedure

6.1. UrbanGrid follows a formal complaints procedure, details of which can be obtained from your Client Partner. We expect most issues to be resolved amicably.

7. Applicable Law & Jurisdiction

7.1. UAE law applies to all instructions, and UAE courts shall have jurisdiction over any disputes.

8. Liability

8.1. The maximum liability in relation to our work will be outlined in the appointment correspondence.

8.2. If no amount is specified, liability will be limited to outstanding fees and will not exceed USD 1 million.

8.3. These liability limits apply regardless of the number of individuals comprising our client for any instruction.

8.4. These limitations do not apply to deliberate or willful default, nor to damages for death or personal injury.

8.5. Claims may be brought only against UrbanGrid, not against individual employees, members, or agents of the company.

8.6. UrbanGrid will not be liable for any indirect, consequential loss or delay caused by events beyond our reasonable control.

8.7. Any liability will account for other parties' contributory negligence or responsibilities, regardless of those parties' financial status or liability limitations.

9. Regulation

9.1. We may be obliged to request evidence of identity for new clients under money laundering regulations.

9.2. UrbanGrid may be required to disclose information to regulatory authorities under certain conditions, without client notification.

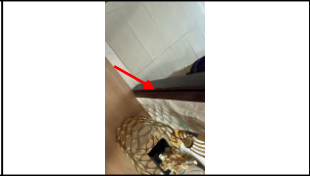
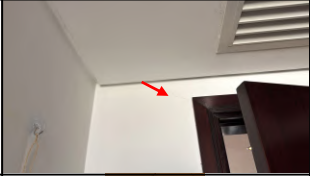
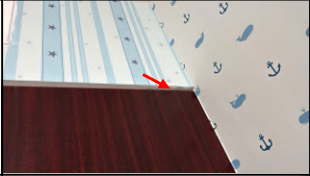
10. Miscellaneous

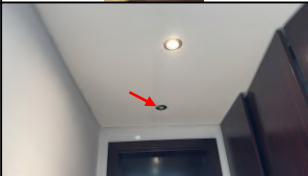
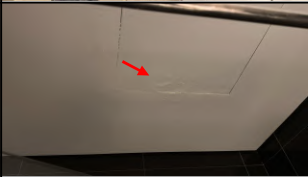
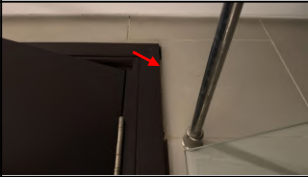
10.1. No variation to these terms shall be binding unless agreed in writing.

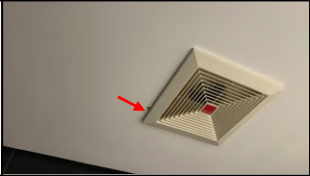
10.2. By instructing UrbanGrid, you acknowledge that you have not relied on any representations not explicitly provided in The Contract.

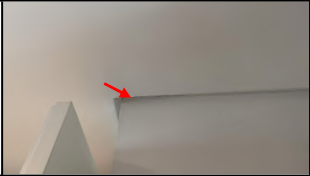
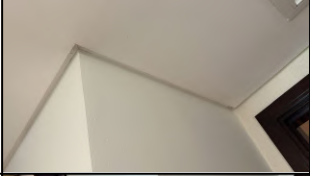
10.3. If any provision of The Contract is deemed invalid, the validity of the remaining terms will not be affected.

Appendix A : Schedule of Defects

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
1	Master bedroom	Civil	Chipping observed on architrave surfaces across multiple areas. The defect is widespread	Open	2	
2	Master bedroom	Civil	Chipping observed on architrave surfaces across multiple areas. The defect is widespread	Open	2	
3	Master bedroom	Civil	Damp patches and water leakage stains observed on the gypsum ceiling surface	Open	4	
4	Master bedroom	Civil	Hairline crack noted on wall surface	Open	2	
5	Master bedroom	Civil	Detached skirting tile	Open	2	
6	Master bedroom	Civil	Paint damage noted on wall surface	Open	2	
7	Master bedroom	Civil	Crack noted on wall to ceiling	Open	2	
8	Master bedroom	Civil	Window clamps appear aged and deteriorated	Open	2	
9	Master bedroom	Civil	Rusted window friction hinges	Open	2	
10	Master bedroom	Civil	Crack noted on wall surface	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
11	Master bedroom	Civil	Missing covers on door stopper	Open	2	
12	Master bedroom	Electrical	Non-functional ceiling spot lights	Open	4	
13	Master bedroom (Bathroom)	Civil	Damage noted to door surface	Open	2	
14	Master bedroom (Bathroom)	Civil	Damp patches and water leakage stains observed on the gypsum ceiling surface	Open	4	
15	Master bedroom (Bathroom)	Civil	Damp patches and water leakage stains observed on the gypsum ceiling surface	Open	4	
16	Master bedroom (Bathroom)	Electrical	Non-functional wall light fixture	Open	4	
17	Master bedroom (Bathroom)	Civil	Damaged sealant noted around the architrave	Open	2	
18	Master bedroom (Bathroom)	Civil	Damaged sealant noted around the commode	Open	2	
19	Master bedroom (Bathroom)	Civil	Rusted bidet spray hose connection and rusted floor drain cover	Open	2	
20	Master bedroom (Bathroom)	Civil	Rusted bidet spray holder	Open	2	

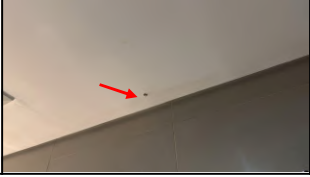
Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
21	Master bedroom (Bathroom)	Plumbing	Vanity sink exhibits slow drainage	Open	3	
22	Master bedroom (Bathroom)	Civil	Chipped gypsum ceiling surface around ceiling exhaust	Open	2	
23	Master bedroom (Bathroom)	Civil	Recessed wall tile noted	Open	2	
24	Master bedroom (Bathroom)	Civil	Insufficient epoxy application noted on wall tile	Open	2	
25	Master bedroom (Bathroom)	Civil	Stains and dirt accumulation noted around the glass partition frame	Open	2	
26	Master bedroom (Bathroom)	Civil	Rusted screws noted on glass partition frame hinge	Open	2	
27	Master bedroom (Bathroom)	Civil	Chipped floor tile	Open	2	
28	Hallway	Civil	Missing screws noted on door hinges	Open	2	
29	Hallway	Civil	Detached architrave panel	Open	2	
30	Hallway	Civil	Crack noted on wall to ceiling	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
31	Hallway	Civil	Crack noted on wall to ceiling	Open	2	
32	Hallway	Civil	Hairline crack noted on wall surface	Open	2	
33	Hallway	Civil	Loosen door handle plates	Open	2	
34	Hallway	Civil	Chipped door edge	Open	2	
35	Hallway	Civil	Stains and dirt accumulation noted on wall surface	Open	2	
36	Bedroom I	Civil	Chipping observed on architrave surfaces across multiple areas. The defect is widespread	Open	2	
37	Bedroom I	Civil	Crack noted on gypsum ceiling around the ceiling panel	Open	2	
38	Bedroom I	Civil	Crack noted on wall to ceiling	Open	2	
39	Bedroom I	Civil	Chipped wall edge and stains observed on wall surface	Open	2	
40	Bedroom I	Civil	Crack noted on gypsum ceiling surface	Open	2	

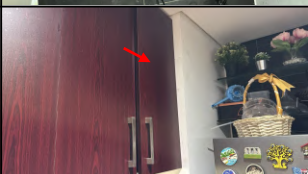
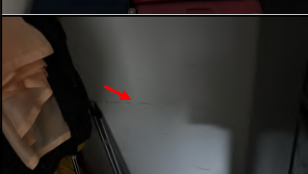
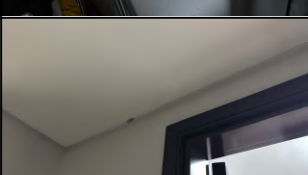
Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
41	Bedroom I	Civil	Water leakage stains were noted on gypsum ceiling surface	Open	4	
42	Bedroom I	Civil	Damp patches and water leakage stains observed on the gypsum ceiling surface	Open	4	
43	Bedroom I	Civil	Stains and dirt accumulation noted on wall surface	Open	2	
44	Bedroom I	Civil	Moisture meter readings indicates the presence of moisture within the wall surface, with visible damp patches observed. This suggests potential water ingress	Open	4	
45	Bedroom I	Civil	Moisture meter readings indicates the presence of moisture within the wall surface, with visible damp patches observed. This suggests potential water ingress	Open	4	
46	Bedroom I	Civil	Delamination noted on ceiling edge	Open	2	
47	Bedroom I	Civil	Stains noted on ceiling surface	Open	2	
48	Bedroom I	Civil	Hairline crack noted on wall surface	Open	2	
49	Bedroom I	Civil	Hairline crack noted on wall surface	Open	2	
50	Bedroom I	Civil	Crack noted around the fixed frame	Open	2	

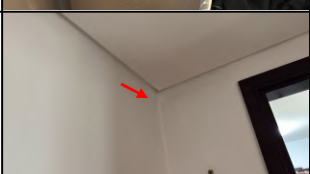
Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
51	Bedroom I	Civil	Minor damage noted on sealant around the fixed frame	Open	2	
52	Bedroom I	Civil	Window clamps appear aged and deteriorated	Open	2	
53	Bedroom I	Civil	Dirt accumulation noted on wall surface	Open	2	
54	Bedroom I (Bathroom)	Civil	Vanity cabinet shutters are extensively damaged with multiple chips and surface deterioration observed	Open	4	
55	Bedroom I (Bathroom)	Electrical	Non-functional ceiling spot lights	Open	4	
56	Bedroom I (Bathroom)	Civil	Damaged sealant noted around the commode	Open	2	
57	Bedroom I (Bathroom)	Civil	Dust build-up on ceiling exhaust panel	Open	2	
58	Bedroom I (Bathroom)	Civil	Mold growth observed on wall tile, indicating moisture accumulation or inadequate ventilation	Open	4	
59	Bedroom I (Bathroom)	Civil	Damp patches and water leakage stains observed on the gypsum ceiling surface	Open	4	
60	Bedroom I (Bathroom)	Civil	Stains noted on floor tile	Open	2	

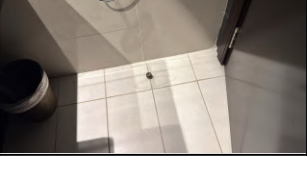
Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
61	Bedroom 1 (Bathroom)	Civil	Detached bathtub tile	Open	2	
62	Bedroom 1 (Bathroom)	Civil	Damaged epoxy noted on floor tile	Open	2	
63	Bedroom 1 (Bathroom)	Civil	Damaged sealant noted around the commode	Open	2	
64	Bedroom 1 (Bathroom)	Civil	Rusted screws noted on bidet spray holder	Open	2	
65	Bedroom 1 (Bathroom)	Civil	Rusted vanity cabinet hinges	Open	2	
66	Bedroom 1 (Bathroom)	Civil	Damaged panel noted inside the vanity cabinet	Open	2	
67	Bedroom 1 (Bathroom)	Civil	Detached bathtub tile	Open	2	
68	Bedroom 1 (Bathroom)	Plumbing	Non-functional bathtub shower head	Open	3	
69	Bedroom 1 (Bathroom)	Civil	Damaged sealant noted around the vanity sink	Open	2	
70	Bedroom 2	Civil	Undulation noted on ceiling surface	Open	2	

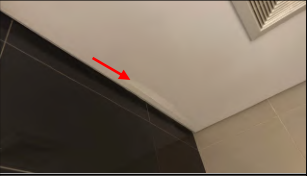
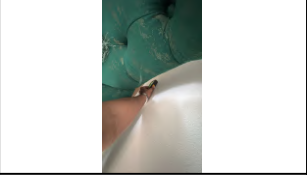
Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
71	Bedroom 2	Civil	Damage noted on ceiling surface	Open	2	
72	Bedroom 2	Civil	Undulation noted on ceiling surface	Open	2	
73	Bedroom 2	Civil	Efflorescence observed at the corner joints of the fixed window frame	Open	4	
74	Bedroom 1	Civil	Crack noted on wall corner	Open	2	
75	Bedroom 1	Civil	Minor delamination noted on wall surface	Open	2	
76	Bedroom 2 (Bathroom)	Civil	Damp patches and water leakage stains observed on the gypsum ceiling surface	Open	4	
77	Bedroom 2 (Bathroom)	Civil	Damaged sealant noted around the commode	Open	2	
78	Bedroom 2 (Bathroom)	Civil	Rusted screws noted on bidet spray holder	Open	2	
79	Bedroom 2 (Bathroom)	Civil	Missing covers on door stopper	Open	2	
80	Bedroom 2 (Bathroom)	Civil	Damage and water leakage stains observed on the gypsum ceiling surface	Open	4	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
81	Bedroom 2 (Bathroom)	Civil	Rust formation observed on glass partition frame	Open	2	
82	Bedroom 2 (Bathroom)	Civil	Detached floor tile	Open	2	
83	Bedroom 2 (Bathroom)	Civil	Vanity sink exhibits slow drainage	Open	2	
84	Bedroom 2 (Bathroom)	Civil	Rusted glass partition frame hinges	Open	2	
85	Bedroom 2 (Bathroom)	Civil	Damaged epoxy noted on floor tile	Open	2	
86	Kitchen	Civil	Chipped wall edge and stains observed on wall surface	Open	2	
87	Kitchen	Civil	Chipped wall edge and stains observed on wall surface	Open	2	
88	Kitchen	Civil	Dust build-up on ceiling exhaust panel	Open	2	
89	Kitchen	Civil	Thermal imaging indicates the signs of water spots on ceiling surface	Open	4	
90	Kitchen	Civil	Leakage stains observed on the ceiling, likely originating from the kitchen ventilation hood	Open	3	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
91	Kitchen	Mechanical	Stains noted on kitchen ventilation hood	Open	2	
92	Kitchen	Mechanical	Rust formation noted on kitchen stove ventilation unit	Open	2	
93	Kitchen	Civil	Plasters observed beneath the wall cabinet	Open	2	
94	Kitchen	Civil	Faulty noise observed on wall cabinet shutters while operation	Open	2	
95	Foyer	Civil	Paint variation noted on ceiling surface	Open	2	
96	Kitchen	Civil	Rusted base cabinet hinges	Open	2	
97	Store room	Civil	Rusted door handle	Open	2	
98	Store room	Civil	Damp patches and water leakage stains observed on the gypsum ceiling surface	Open	4	
99	Store room	Civil	Stains and scratches noted on wall surface	Open	2	
100	Store room	Civil	Crack noted on wall to ceiling	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
101	Maid room	Mechanical	Dust build-up on AC returning panel	Open	2	
102	Maid room	Civil	Visible holes noted on ceiling surface	Open	2	
103	Maid room (Bathroom)	Civil	Damaged sealant noted around the commode	Open	2	
104	Maid room (Bathroom)	Civil	Damp patches and water leakage stains observed on the gypsum ceiling surface	Open	4	
105	Maid room (Bathroom)	Civil	Chipped and detached wall tile	Open	2	
106	Maid room (Bathroom)	Civil	Rusted door strike plate	Open	2	
107	Maid room (Bathroom)	Civil	Rusted vanity sink drain pipe	Open	3	
108	Foyer	Civil	Paint variation noted on ceiling surface	Open	2	
109	Bedroom 3	Civil	Leakage stains were noted on wall surface	Open	4	
110	Bedroom 3	Electrical	Non-functional ceiling light fixture and undulation noted on ceiling surface	Open	4	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
111	Bedroom 3	Civil	Crack noted on wall surface	Open	2	
112	Bedroom 3 (Bathroom)	Civil	Inspection of the bathroom is restricted due to materials stored inside	Open	2	
113	Bedroom 3 (Bathroom)	Civil	Thermal imaging indicates the signs of water spots on ceiling surface	Open	4	
114	Bedroom 3 (Bathroom)	Civil	Detached wall tile	Open	2	
115	Bedroom 3 (Bathroom)	Civil	Vanity sink exhibits slow drainage	Open	2	
116	Bedroom 3 (Bathroom)	Civil	Damage noted to bidet spray hose connection steel wire	Open	2	
117	Bedroom 3 (Bathroom)	Civil	Chipped door edge	Open	2	
118	Powder room	Civil	Crack and stains noted around the ceiling exhaust panel	Open	2	
119	Powder room	Civil	Damaged sealant noted around the commode	Open	2	
120	Powder room	Civil	Missing covers on door stopper	Open	2	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
121	Powder room	Civil	Thermal imaging indicates the signs of water spots on ceiling surface	Open	4	
122	Powder room	Civil	Damp patches and water leakage stains observed on the gypsum ceiling surface	Open	4	
123	Powder room	Civil	Damage noted on wall tile	Open	2	
124	Powder room	Civil	Missing wall tile noted inside the vanity cabinet	Open	3	
125	Powder room	Civil	Crack and damaged gypsum ceiling	Open	3	
126	Living area	Civil	Unwanted holes were noted on wall surface	Open	2	
127	Living area	Civil	Damaged sealant noted around the AC grill panel	Open	2	
128	Living area	Mechanical	Dust build up on AC grill panel	Open	2	
129	Living area	Civil	Water leakage stains were noted on the wall surface	Open	4	
130	Living area	Civil	Moisture meter readings indicates the presence of moisture within the wall surface. This suggests potential water ingress	Open	4	

Sl. No	Location	Category	Defect	Status	Level of Severity	Reference
131	Living area	Civil	Water leakage stains were noted on the wall surface	Open	4	
132	Living area	Civil	Crack noted on wall surface	Open	2	
133	Living area	Civil	Water leakage stains were noted on the wall surface	Open	4	
134	Living area	Civil	Damage noted on ceiling near to curtain rails	Open	2	
135	Living area	Civil	Damp patches and water leakage stains observed on the gypsum ceiling surface	Open	4	
136	Living area	Civil	Foot print stains noted on wall surface	Open	2	