PART NUMBERS 139740-01K, F-139740-TL

Oversized Pressure Regulator Valve Kit

139740-01K


- Oversized Valve
- Spring



Tool Kit

F-139740-TL

- Reamer
- Reamer Jig
- Guide Pin

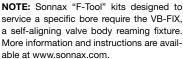



1. Disassemby

Remove and discard all components from the bore.

2. Bore Preparation

- a. Clean the bore thoroughly in a solvent tank.
- b. Generously lubricate the bore and reamer with cutting fluid (i.e. Mobilmet S-122, Lubegard Bio-Tap, Tap Magic™, etc.). For best results, provide a continuous flow of water-soluble cutting fluid (i.e. Mobilment S-122) during the reaming process.
- c. The reamers should be turned using a low RPM, high-torque air drill regulated to a maximum of 200 RPM.
- d. Examine the bore after cleaning for surface finish, debris and burrs. Flashing and burrs on the exit side of land and bores must be carefully removed. A small piece of Scotch-Brite™ material attached to a wire and powered with a drill motor is ideal for the task. Scotch-Brite™ is a very abrasive material and all residual must be cleaned to insure particles do not migrate or remain imbedded into the surface. Post cleaning involves several progressive steps with solvent on a lint-free rag.

CAUTIONS AND SUGGESTIONS:

©2010 Sonnax Industries, Inc.

- Turning the reamer backward will dull it prematurely.
- Pushing on the reamer will result in poor surface finish and inadequate and sporadic material removal.
- Never use a crescent wrench, ratchet or pliers to turn the reamer.
- A dull reamer will cut a smaller hole. Reamers can be sharpened, but should only be done by a
 professional tool sharpener. Actual life of a Sonnax reamer before resharpening or replacing
 averages 50-70 bores.




139740-01K Rev:- F-139740-TL Rev:-, 139740-01K-IN 09-10-10

PART NUMBERS 139740-01K, F-139740-TL

3. Bore Reaming

Use the associated "F-Tool" kit and VB-FIX reaming fixture as illustrated below to ream the bore.

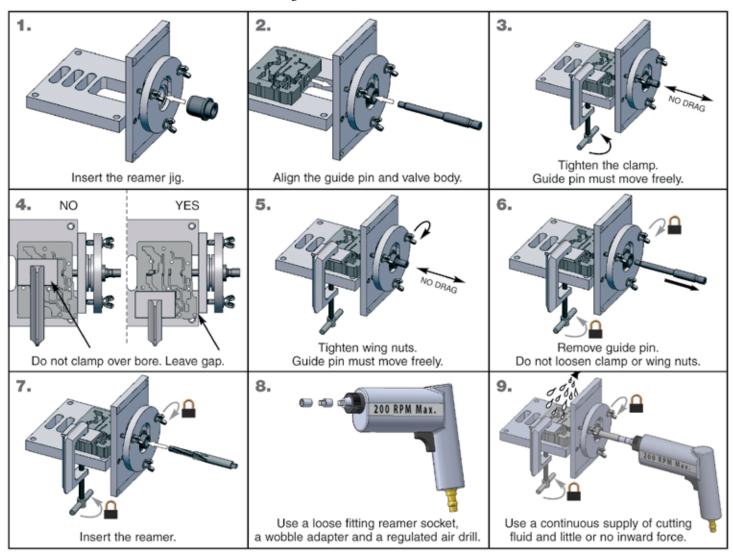

4. Installation & Assembly

- a. Install new Sonnax valve and spring.
- b. Reattach the valve body casting end plate.

5. Final Testing

A vacuum test at these ports should hold 16" of vacuum or more.

