
4T60-E ('97 BONNEVILLE)

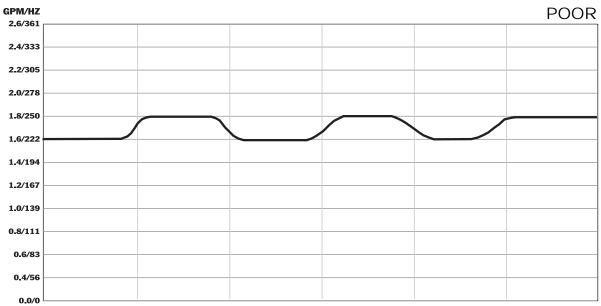

Event: Surging with TCC cycling in and out every few seconds. **Condition:** 45 mph steady load, very hot with TCC command on.

Correction: Replace worn TCC apply valve.

Notes: As temperature increased, TCC would cycle for longer times. When cooled, surge felt like engine miss.