
PART NUMBER 84754-30K

Boost Valve & Sleeve Kit

84754-30K

1 Boost Sleeve Assembly Note: U.S. Patent No. 6,832,632

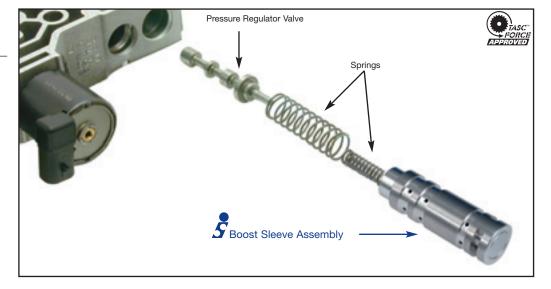

Before Installation

Remove the plug and line boost valve from one end of the sleeve and remove the reverse boost valve from the other end of the sleeve. Make sure that excess assembly lube or rough handling during shipping is not causing either valve to stick. Clean components as needed and reassemble components as shown in photo below. The line boost valve and plug are not directional. After installing all the parts, cover the sleeve ends with your fingers and shake the assembly lightly. You should hear/feel the line boost valve moving inside.

Installation Instructions

- 1. Remove and discard the OEM boost valve and sleeve assembly (reverse boost valve, line boost valve, and boost plug). Save the retainer clip, 2 springs and pressure regulator valve that reside in the valve body bore.
- 2. Install the Sonnax boost valve and sleeve assembly **84754-30K**.

Additional Information

Drivability complaints and code 1811 that can be addressed with this kit can also be created by a worn AFL bore (see part 84596-02K) and /or a sticking torque signal regulator valve. Check these circuits as well, before reinstalling the valve body.

