GRAND SLAM DIESEL SERVICES
757-931-3331
GRANDSLAMDIESEL@GMAIL.COM

2026 Engine Survey Report

BOAT NAME: *Intoxication*
BOAT MANUFACTURER: *Jefferson*

I. Propulsion

	PORT	STARBOARD
Model Number	8062-7409	8062-7403
Serial Number	6VF-207382	6VF-207378
Horsepower	550 BHP	550 BHP
Engine Hours	1,837	1,843
RPM Speed	2,300	2,300
Cylinders	6	6

II. Marine Gears

	PORT	STARBOARD
Manufacturer	DDA Twin disc	DDA Twin disc
Serial Number	3X0901	3X0902

III. Generator

	PORT	STARBOARD
Model Number	BTDA 15KW	
Serial Number	U2232-ED304	
Engine Hours	2,124	

IV. Sea Trial

Date of Trial	1/6/2026
Duration	3 Hours
Location	Severn Yachting Center
Weather Conditions	Clear

Additional Notes:

Haul out showed damage to both the port and starboard wheels which may have affected engine performance.

Gauges were inaccurate so correct pressure data could not be recorded on either engine.

V. Sea Trial Data

RPM	OIL PSI	ENG TEMP			
600	10/12	154/156			
1200	25/24	160/158			
1600	35/38	168/162			
1850	45/47	168/169			
2150	55/58	173/170			

VI. Evaluation

Port Engine ()

1. <u>Engine Findings & Recommendations</u>

-Emergency stop 12v relay is not operational recommend replacing relay
-Turbo drain line is leaking oil recommend replacing drain hose and gasket
-Alternator belt is loose and squeaking tensioner is at travel limit recommend replacing belt
- Transmission had a large amount of surface rust recommend converting and re painting to prevent further damage
-raw water pump had signs of leaking recommend rebuilding or replacing pump
-oil leak running down the flywheel housing recommend cleaning and running the boat to see where the leak is coming from to address
-All fuel and oil pressure lines are past their service life and need replaced
-Gauges are inaccurate recommend changing gauges and senders out

2. <u>Engine findings & Recommendations</u>

Stbd Engine

-Emergency stop 12v relay is not operational recommend replacing relay
-Alternator belt is loose and squeaking tensioner is at travel limit recommend replacing belt

- Transmission had a large amount of surface rust recommend converting and re painting to prevent further damage
-Raw water pump had signs of leaking recommend rebuilding or replacing pump
-All fuel and oil pressure lines are past their service life and need replaced
-Fuel priming pump smelled strongly of fuel while underway recommend replacing to prevent future potential fuel leak
-Raw water hose going into the fuel cooler is barely attached to the fuel cooler recommend taking the hose loose and moving it up to get a better seal
-gauges are inaccurate recommend replacing senders and gauges

Generator ()

3. Generator Findings & Recommendations

-Coolant was low and dirty recommend flushing and filling with new coolant
- Fuel Priming pump on generator was leaking fuel recommend taking off and resealing or replacing

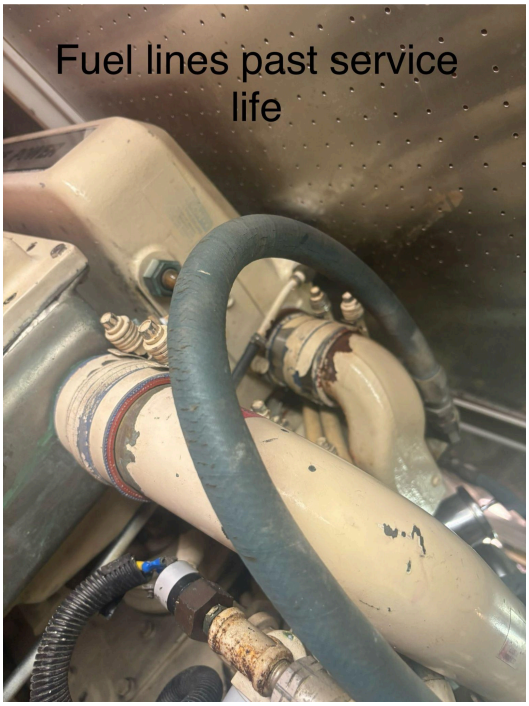
Fuel lines past service
life

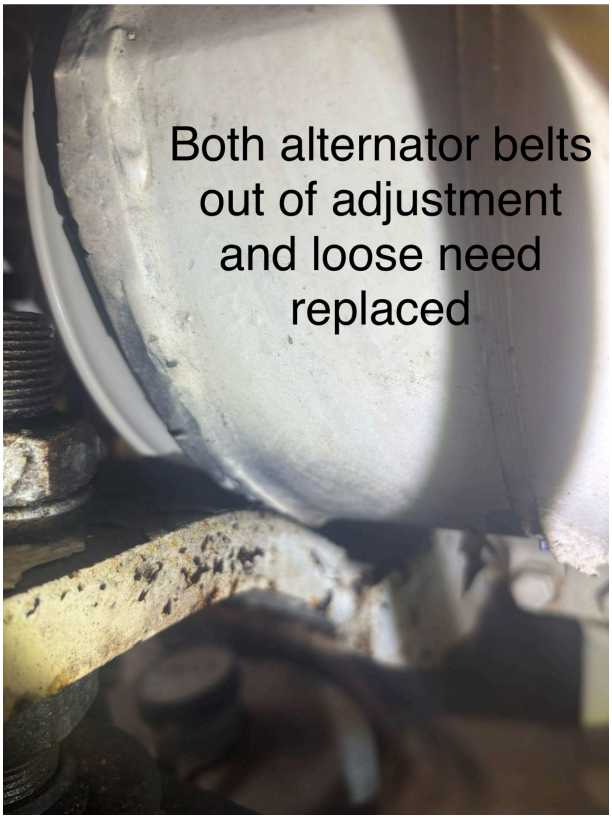
Both alternator belts
out of adjustment
and loose need
replaced

Oil leak on port
flywheel housing

Stbd raw water line
barely attached to
cooler needs
adjusted

Oil lines past useful service
life need replaced

Rust on port gear
needing
converted and re
painted

Port turbo oil drain
leaking

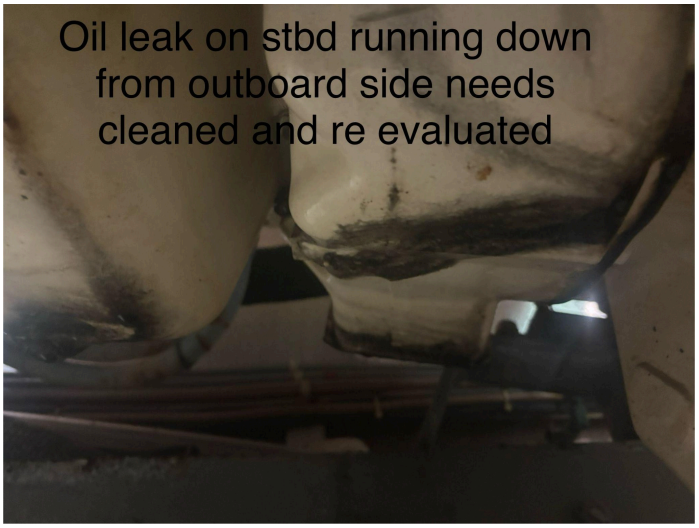
Oil leak on stbd running down
from outboard side needs
cleaned and re evaluated

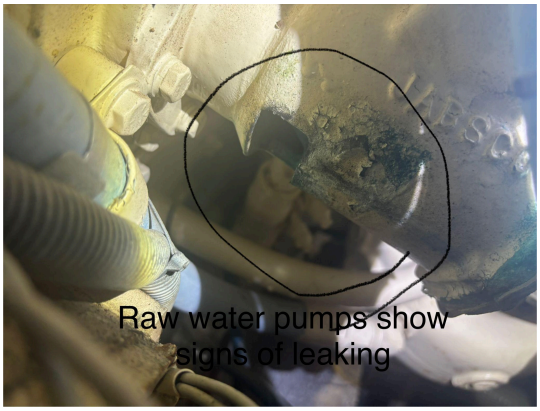
Raw water pumps show
signs of leaking

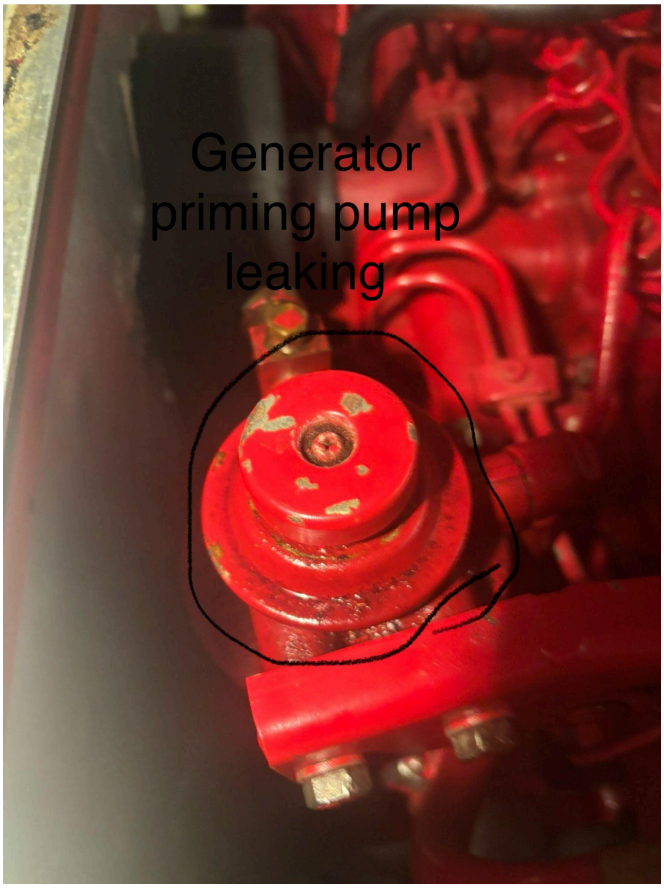
Generator
priming pump
leaking

Stbd priming
pump smelled
strongly of fuel