




SPK7858B ERGONOMIC WIRELESS MOUSE

Troubleshooting Guide

Quick Start | Connection | Control | KeyLink

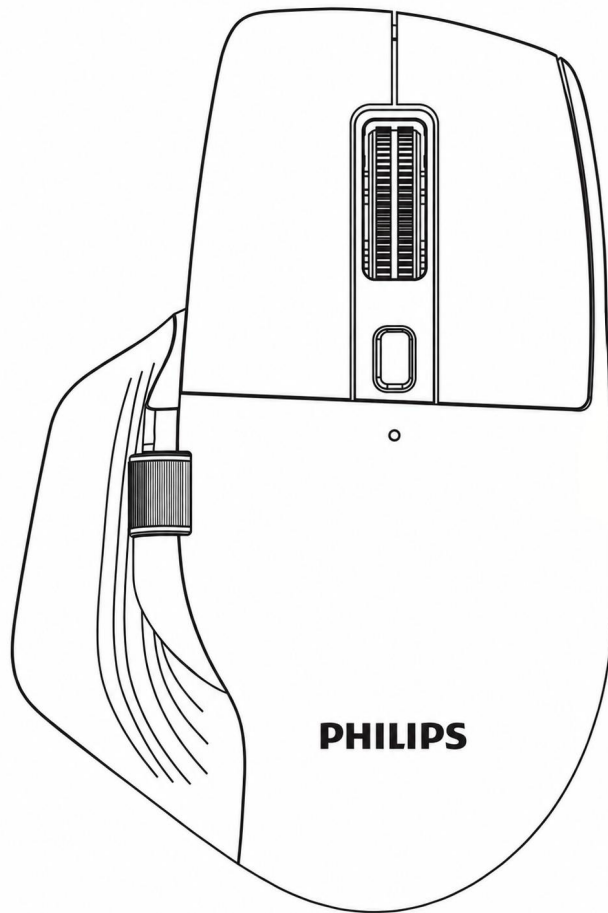

NEED HELP?

Use this guide to diagnose connection, charging, pointer, control, and KeyLink issues, with step-by-step checks and support guidance.

Customer Support: philips.us@top-support.net

Software Download (Scan): [PHILIPS U.S. Home & Office Mouse Support](#)





1. START HERE

Use the symptom index below, then complete the listed actions in order. After each action, test the mouse before continuing. Do not open the mouse or use an unverified receiver-pairing, firmware, or repair utility.

SYMPTOM	SECTION	CHECK FIRST
No response / stops after short use	2.1 / 3.1	Power, mode, battery
USB receiver not detected	2.2	Receiver and port
Bluetooth not found / disconnects	2.3 / 2.4	Pairing, distance
Mode will not reconnect	2.5	Correct host and mode
Pointer jumps, lags, or stops	3.2	Surface, battery
Buttons or wheels act incorrectly	3.3	App support, profile
30-SECOND CHECK 1) Power switch ON. 2) Select the intended mode. 3) Charge if the front indicator flashes red. 4) Reconnect the matching receiver or re-enter Bluetooth pairing. 5) Restart the host, then test on a clean matte surface.		

2. CONNECTION PROBLEMS

2.1 Mouse Does Not Respond

CHECK FIRST	Power switch, selected mode, battery level, surface, and whether the host is awake.
STEPS	1. Turn the power switch ON and select the intended mode. 2. Charge from a 5 V USB source for at least 30 minutes. 3. Restart the host, then test on a clean, matte, non-glass surface.
IF UNRESOLVED	Continue with the receiver or Bluetooth section for the selected mode. If the mouse fails on another compatible host, contact support.

2.2 USB-A or USB-C Receiver Is Not Detected

CHECK FIRST	Correct supplied receiver, matching receiver mode, direct host USB port, and visible receiver damage.
STEPS	1. Remove and reinsert the matching receiver. 2. Try another direct USB port, then restart the host. 3. Test the mouse and receiver on another compatible computer.
IF UNRESOLVED	Contact support with the receiver type and test results. The supplied receivers are factory paired; no user receiver re-pairing procedure is provided.

2.3 Bluetooth Device Does Not Appear

CHECK FIRST	Bluetooth selected, host Bluetooth enabled, and mouse within 1 m / 3 ft during pairing.
STEPS	1. Hold the mode button for more than 5 seconds to enter pairing mode. 2. Toggle host Bluetooth off/on and forget any old SPK7858 record. 3. Search again and select SPK7858.
IF UNRESOLVED	Restart the host and test with another compatible Bluetooth device. Contact support with the host model and operating-system version.

2.4 Bluetooth Connects but Repeatedly Disconnects

CHECK FIRST	Battery level, distance, nearby 2.4 GHz interference, and host sleep behavior.
STEPS	1. Charge the mouse and move closer to the host, away from interference. 2. Forget the old Bluetooth record and pair SPK7858 again. 3. Install current Bluetooth or OS updates if available.
IF UNRESOLVED	Test a supplied 2.4 GHz receiver mode. If receiver mode is stable but Bluetooth is not, contact support with the host and OS details.

2.5 Switching Modes Does Not Reconnect

CHECK FIRST	The intended host is awake and was previously connected to the selected mode.
STEPS	1. Select the intended mode and wait several seconds. 2. Receiver mode: confirm the matching receiver is connected. 3. Bluetooth mode: confirm SPK7858 is connected in the host Bluetooth list.
IF UNRESOLVED	Reconnect the affected mode using its original setup steps. Do not run an unverified receiver reset or pairing utility.

3. POWER, POINTER & CONTROLS

3.1 Low Battery or Mouse Does Not Charge

CHECK FIRST	Indicator status (flashing red: low battery; solid red: charging; solid green: fully charged), 5 V source, fully seated cable, and damage or debris at the USB-C port.
STEPS	1. Connect the supplied cable to a 5 V USB-A port or approved 5 V source. 2. Try another USB-A port or known-good USB-A to USB-C cable. 3. Charge for at least 30 minutes, then turn on and test.
IF UNRESOLVED	Stop immediately if the mouse, cable, or port is hot, swollen, damaged, wet, or produces an odor. Do not open the mouse or replace the built-in battery; contact support.

3.2 Pointer Jumps, Lags, or Stops

CHECK FIRST	Battery, distance, surface, interference, selected DPI, and sensor cleanliness.
STEPS	1. Clean the sensor and test on a clean, matte surface. 2. Move closer to the receiver or host and reduce interference. 3. Try another DPI setting, USB port, or compatible host.
IF UNRESOLVED	Contact support if the same behavior occurs on multiple suitable surfaces, hosts, or connection modes.

3.3 Buttons or Wheels Do Not Work as Expected

CHECK FIRST	Whether the issue occurs in every application, application support, OS settings, and active KeyLink profile.
STEPS	1. Test the control in a standard browser or file window. 2. Confirm the app supports the control, then test with KeyLink closed. 3. If using KeyLink, check the Global and app-specific profiles.
IF UNRESOLVED	Contact support with the affected control, application, operating system, connection mode, and whether default behavior works.
HORIZONTAL SCROLLING The horizontal thumb wheel works only in applications and views that support horizontal scrolling. A page with no horizontal content may show no response.	

4. PHILIPS KEYLINK PROBLEMS

4.1 KeyLink Does Not Detect SPK7858B

CHECK FIRST	Supported computer, current KeyLink version, and connection through a supplied 2.4 GHz receiver.
STEPS	1. Close and reopen KeyLink, then reconnect the receiver and select its mode. 2. Restart the computer. 3. Confirm requirements: Windows 10/11 x64 or macOS 12+ arm64, 4 GB RAM, 2 GB free space, and internet.
IF UNRESOLVED	If basic mouse operation works but KeyLink still cannot detect it, contact support with the KeyLink version, OS, and connection mode.

4.2 Custom Actions Do Not Work

CHECK FIRST	Correct Global or application profile, supported target application, and required system permissions.
STEPS	1. Select the intended profile and test in a supported application. 2. Windows: run KeyLink as administrator if needed; macOS: enable Accessibility. 3. Use KeyLink Settings > Factory reset, then configure the action again.
IF UNRESOLVED	Contact support. KeyLink Factory reset restores custom software settings; it is not a hardware or receiver-pairing reset.

4.3 CrossGlide Does Not Connect

CHECK FIRST	Both computers on the same local network, current KeyLink open on both, and CrossGlide enabled.
STEPS	1. Confirm both computers share the same network and enable CrossGlide on both. 2. Remove the disconnected device and connect it again. 3. Restart KeyLink on both computers.
IF UNRESOLVED	Contact support with both operating-system versions and KeyLink versions. Availability may depend on software and device support.



When to Stop Troubleshooting

- The product is damaged, swollen, unusually hot, wet, or emits smoke, sparks, or an odor.
- A connector, cable, battery, or housing is visibly damaged.
- The issue persists after the applicable troubleshooting steps have been completed.
- The next action would require disassembly, unauthorized repair, firmware recovery, or a non-approved tool.

Contact Customer Support

Prepare	Amazon order number, product model, serial number, host device, operating system, connection mode, issue description, and steps already tried
Evidence	Photos, video, screenshots, or logs only when reasonably needed
Warranty Handoff	For coverage, remedies, exclusions, or shipping terms, see the separate Limited Warranty.
Customer Support	philips.us@top-support.net
Support Hours	Mon–Fri, 6:30 PM–9:30 PM and 11:00 PM–4:00 AM (PT)
Website	Software Download
Country of Origin	Made in China

Document Information

Document Number	SPK7858B-TSG-US-EN
Version	1.0
Effective Date	August 21, 2026