


Technical Notice NT-018-WS




How WS works


When powered up, the WS displays its version:

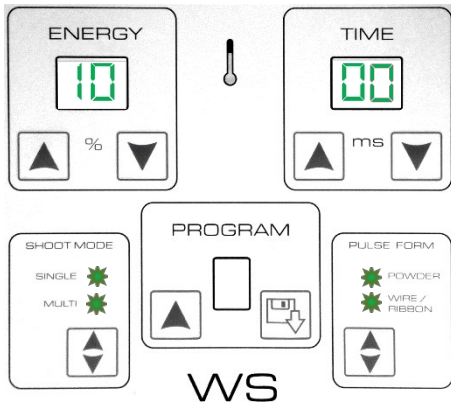


WS 1000S

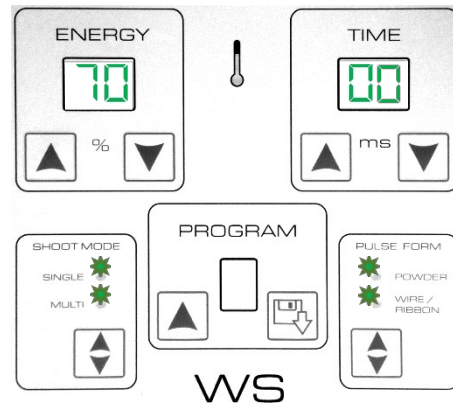

WS 7000S

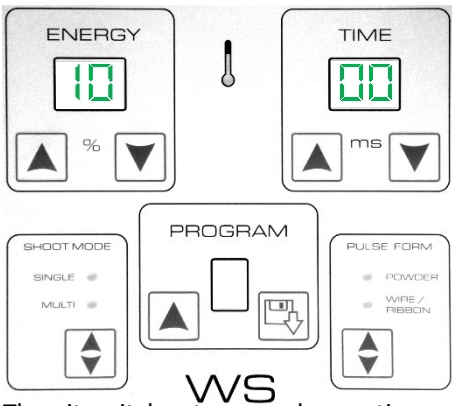


WS 10000

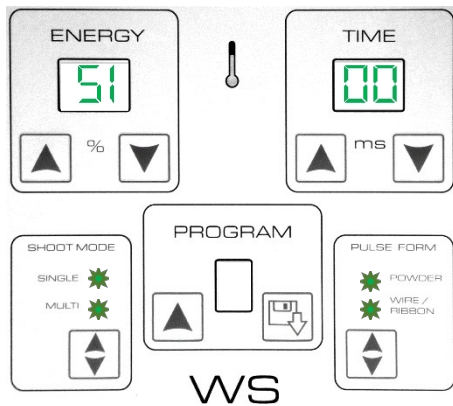


WS 5100S

Then it switches to normal operating mode.

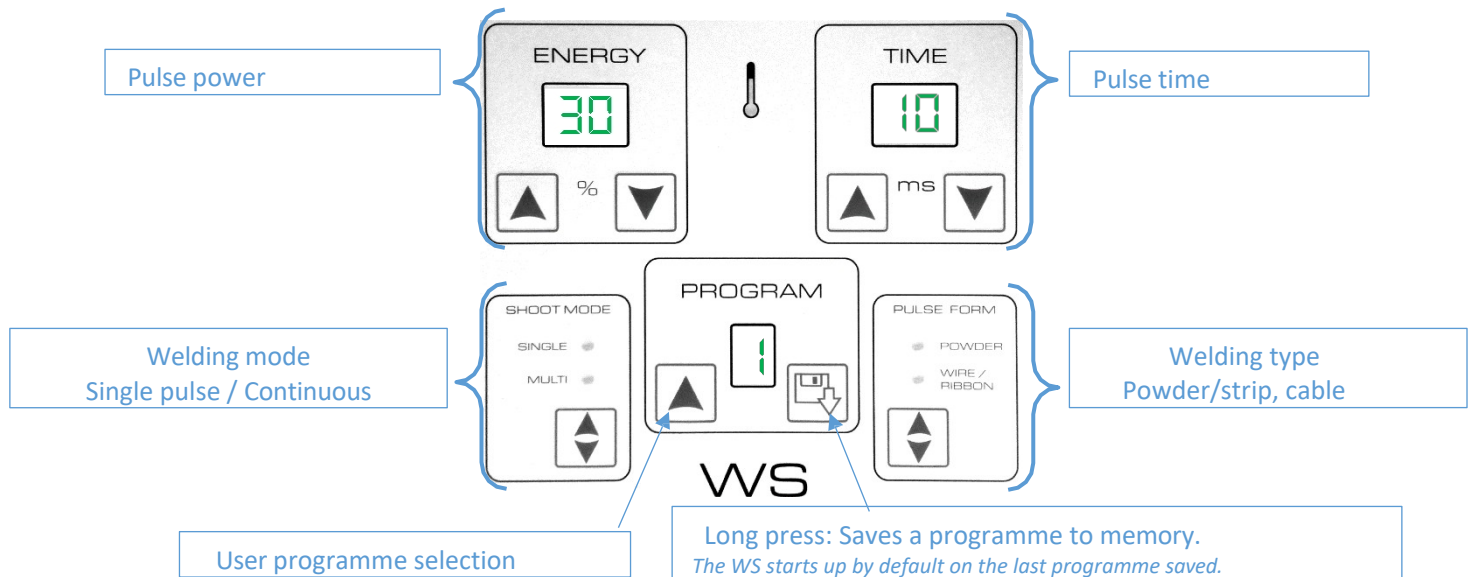

Factory reset


This procedure resets the WS
(user memories, user settings and factory settings).

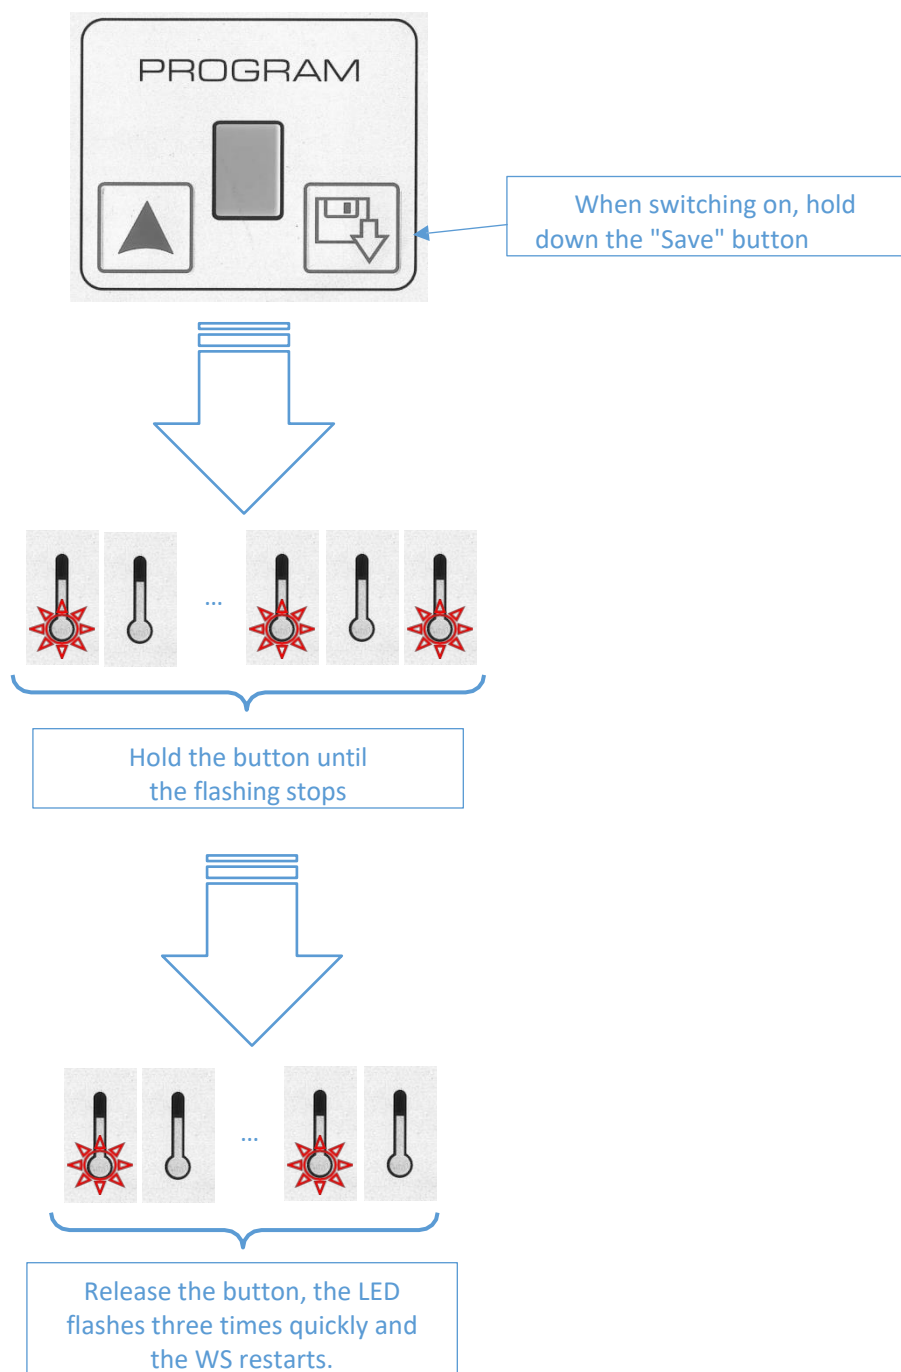


Advanced WS functions

Accessing advanced functions:

You can access the advanced functions at any time by pressing the "Programme selection" and "Save programme" buttons. To indicate that you have entered the advanced functions The red LED remains lit and the "PROGRAM" display shows "1" (for "Page 1").

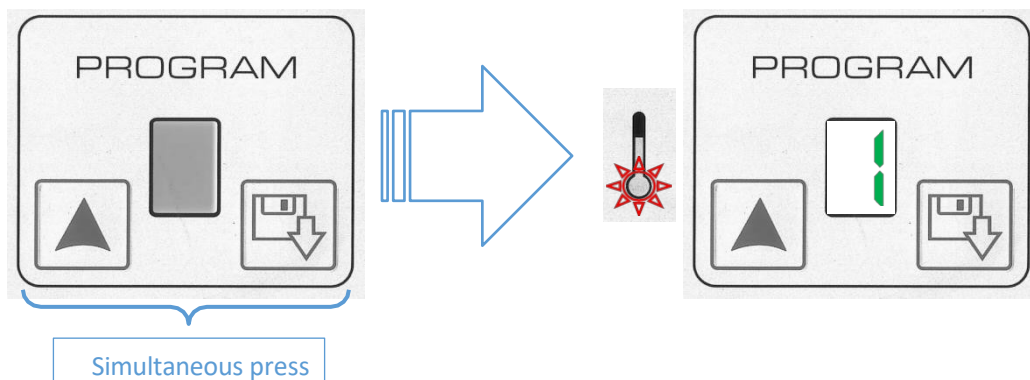


The advanced functions are organised into several pages. The selected page is shown on the "PROGRAM" display.

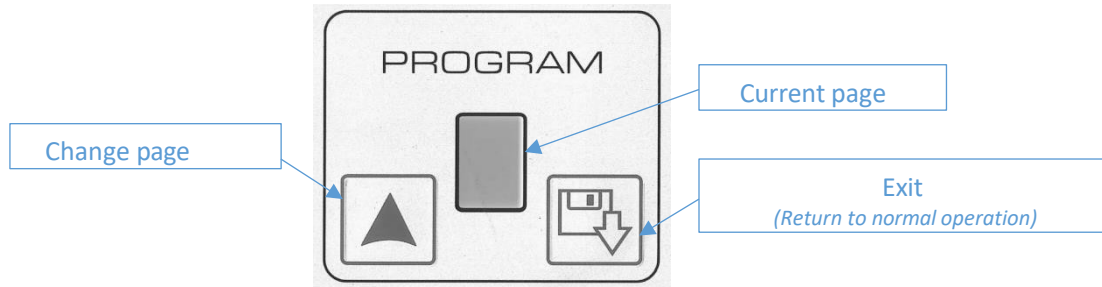

The WS has two pages of advanced functions.


Page	Functions
1	User settings
2	Diagnostics

Page 1: User settings

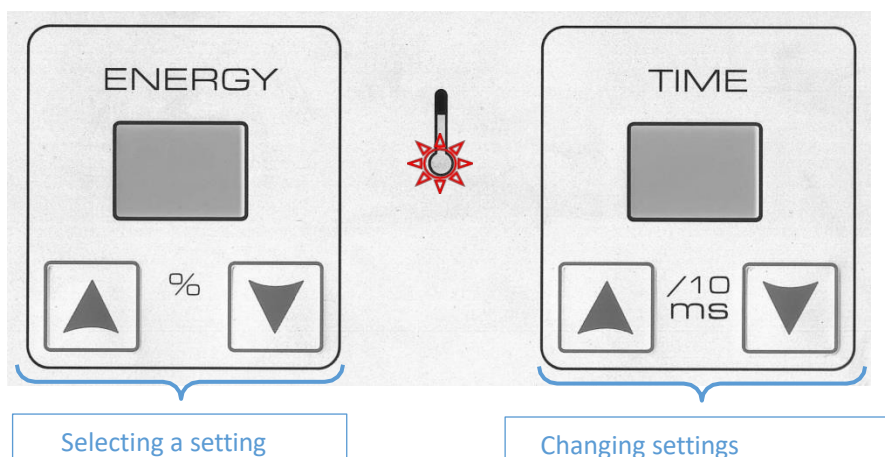

Settings		Description
1	Speed	Changes the pulse rate.
2	Number of shots (Powder)	Changes the number of pulses in powder mode.

Page 2: Diagnostics

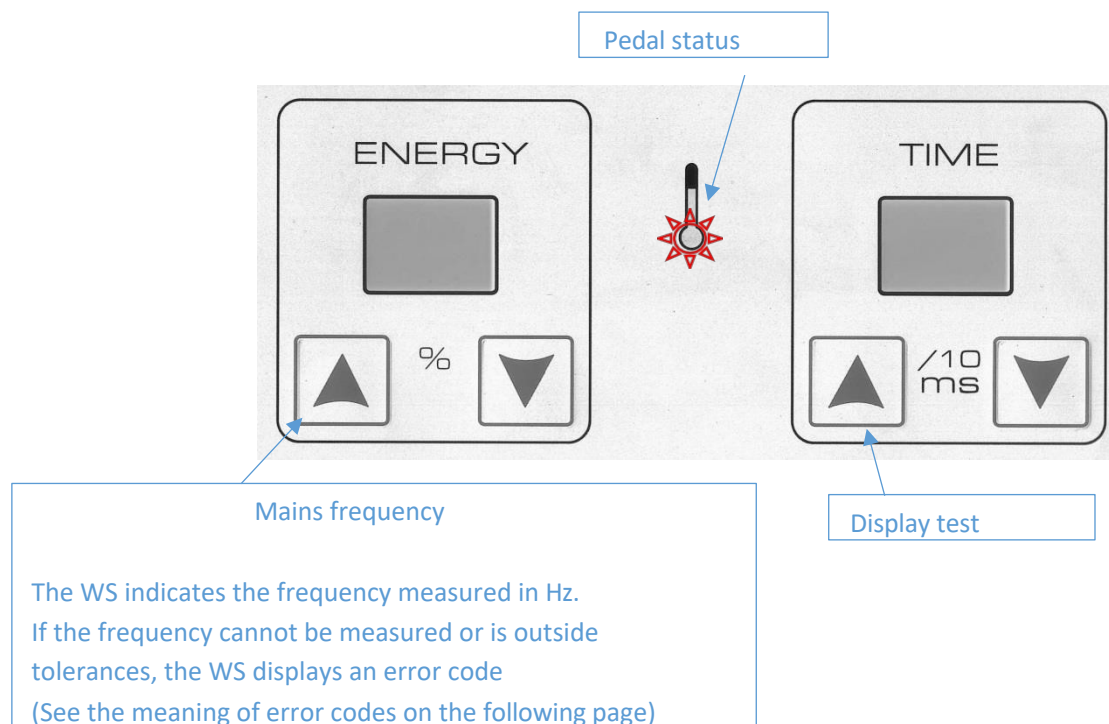

This mode allows you to quickly test various elements of the WS.

Error codes:

Error codes are displayed simultaneously on the "ENERGY" and "TIME" displays. They flash three times before returning control to the user.

Code	Meaning
01	Pedal engaged when power is turned on (This code does not disappear until the pedal is released)
02	Unable to measure mains frequency
03	Current limitation (WS protection) This error code appears when too much current is requested from the WS. The current requested may vary depending on: - The length of the torches, - The surface condition of the parts to be welded - Voltage present on the mains In general, to correct this error, the "ENERGY" setting must be lowered. <u>Note:</u> The WS is calibrated so that it can be set to full power with 1.50 m 70 mm ² torches manufactured by SST, on the French electrical network (230 VAC / 50 Hz).
04	The mains frequency is too low (<30Hz)
05	The mains frequency is too high (>70Hz)
Overheating	In the event of WS overheating, a 10-minute delay is activated. The countdown is shown on the displays: - "ENERGY" display for minutes. - "TIME" display for seconds.