


A PREPARE THE FILE

USB drawing → SheetCam → TAP file

1

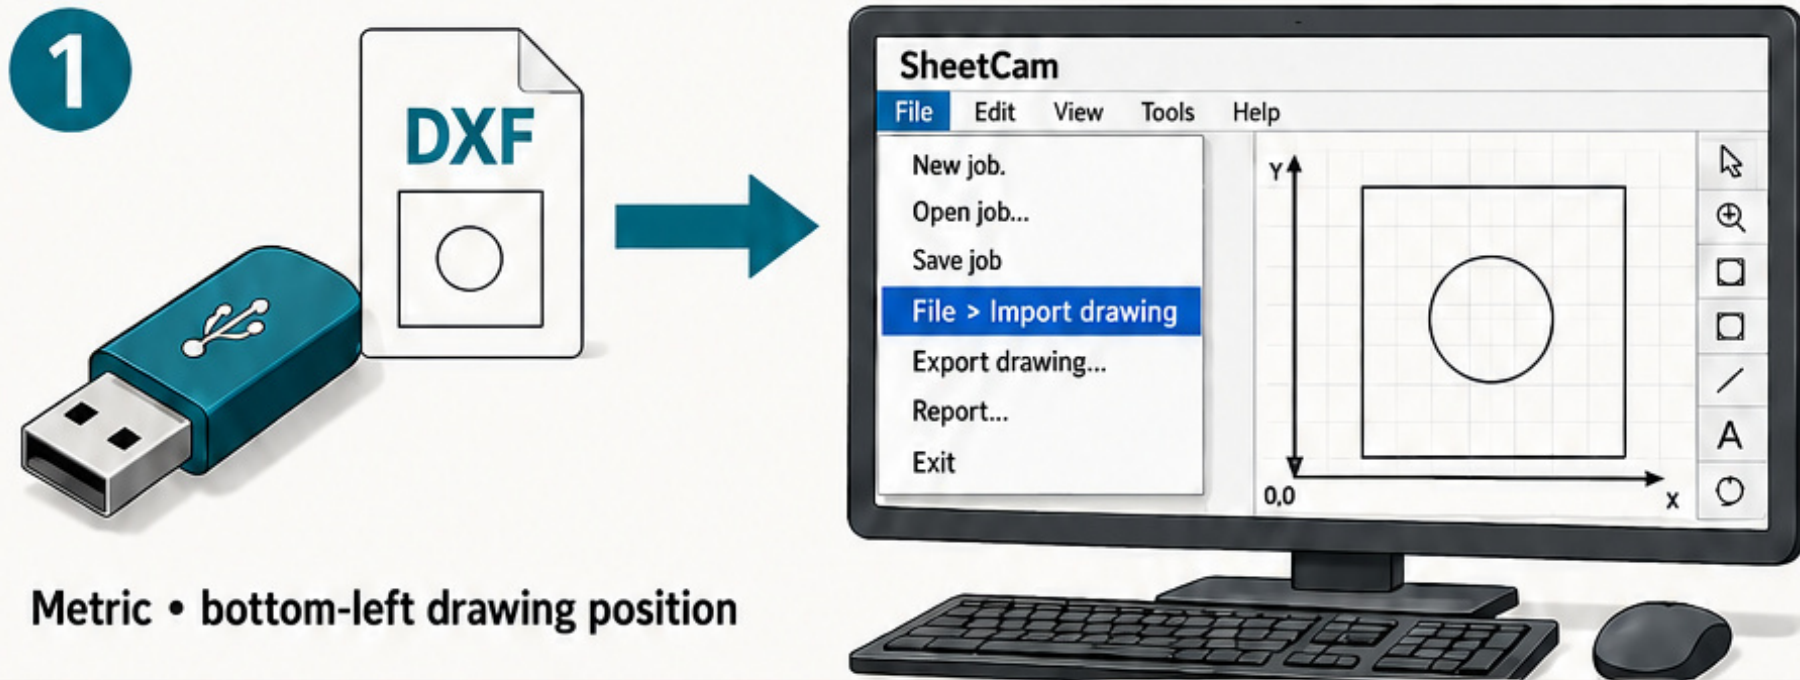


Metric • bottom-left drawing position

2

Check size and hole position

Use your drawing's hole diameter

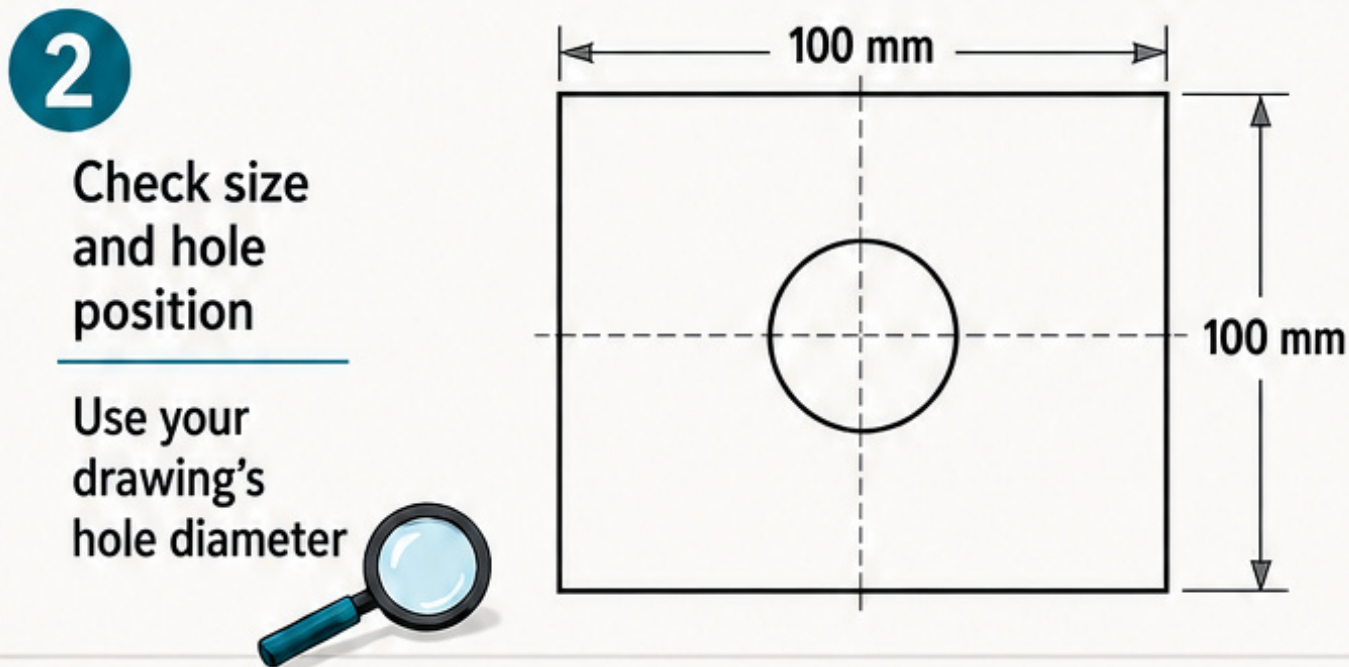


3

Recorded tool + checked paths

Run simulation

1 HOLE FIRST


2 OUTSIDE LAST

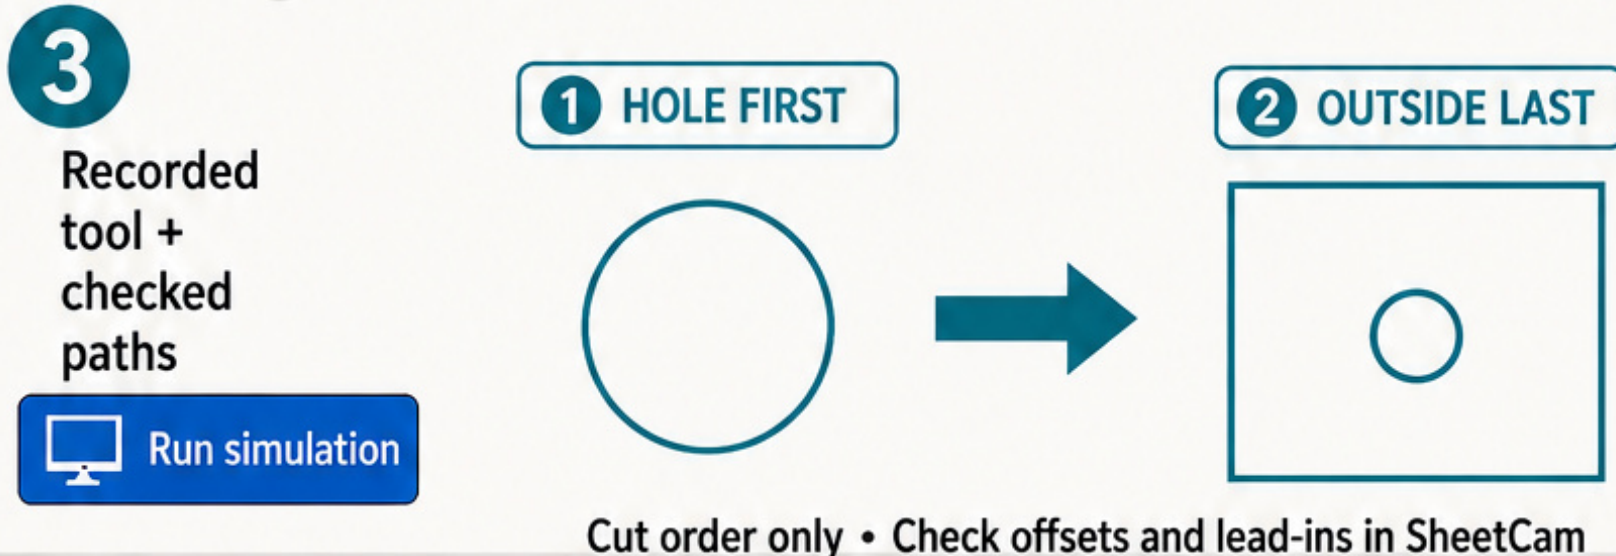

Cut order only • Check offsets and lead-ins in SheetCam

4

Saved SheetCam job (editable)

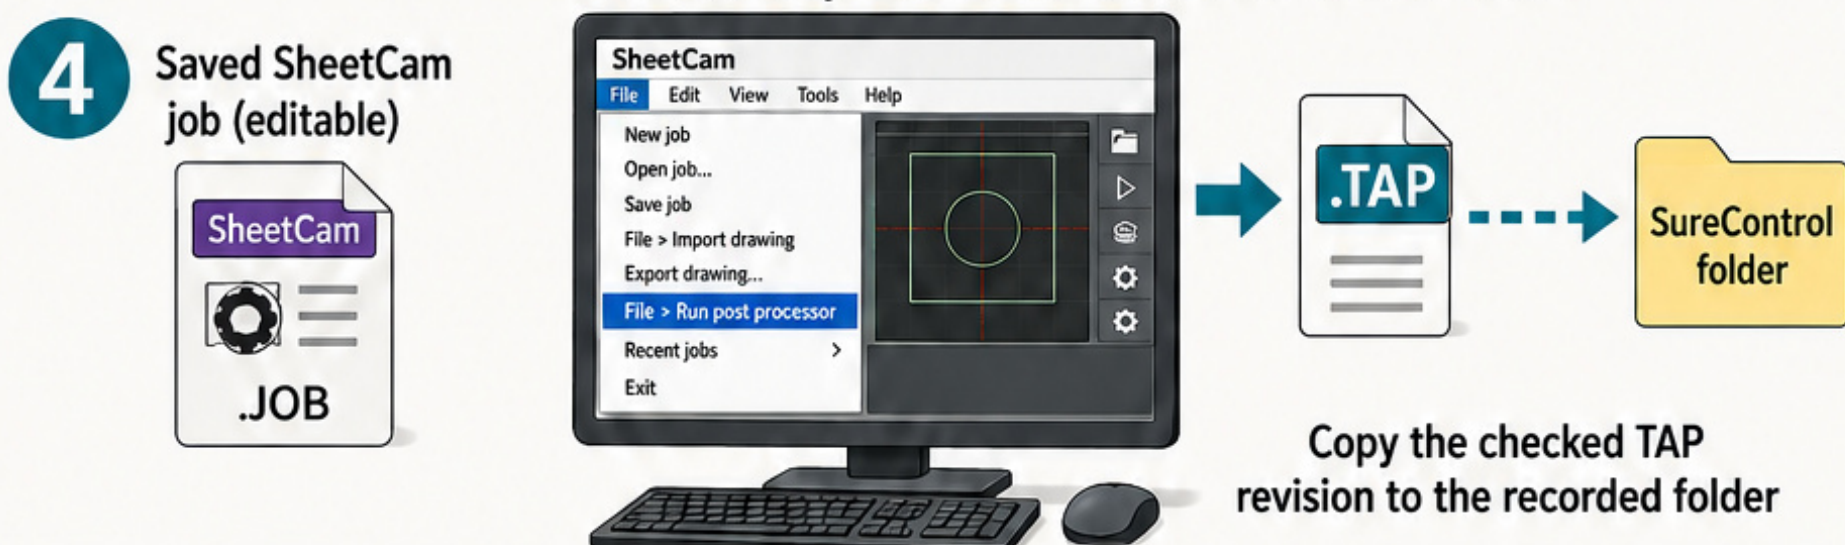

Copy the checked TAP revision to the recorded folder

COMPUTER PREPARATION ONLY

Visual reminder • Use the full guide and confirmed setup record

Illustrative screens • Match your installed software


B PREPARE THE MACHINE

Match the setup • Connect • Reference

1 SECURE THE AREA



2 MATCH THE RECORDED SETUP

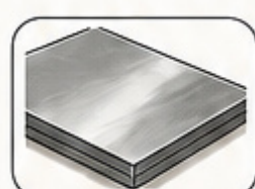

Material +
thickness



Correct
consumables



PHYSICAL
current



Recorded air
requirement



Work
return



CPC
checked


Follow the recorded power-on order • Run extraction

3 CONNECT SURECONTROL




Connect changes to Reset after connection

4 REFERENCE THE AXES

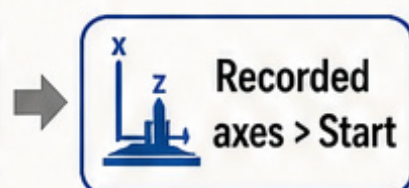

Real movement • Wait for normal completion

Referencing is not Set Origin

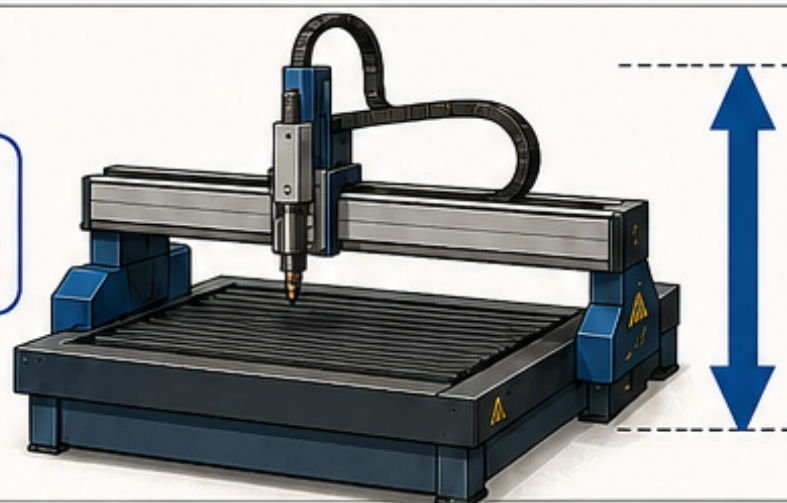

TRAINED, AUTHORISED TEACHERS ONLY



Visual reminder • Use the full guide and confirmed setup record

Illustrative equipment and controls • Match your installation

C LOAD, CHECK, POSITION



Correct file • Touch sensing • Part zero

1 LOAD THE CHECKED TAP

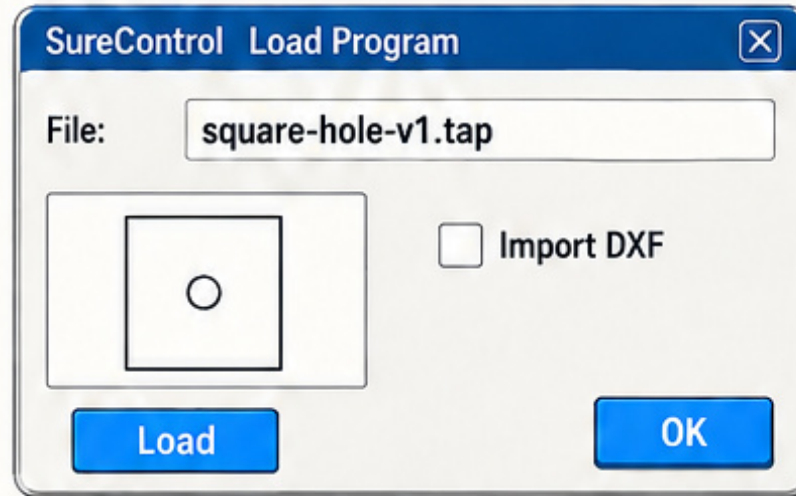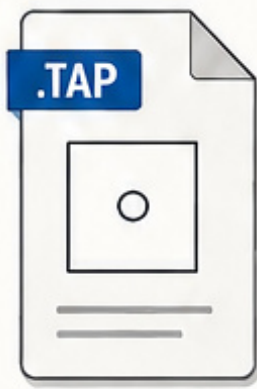

- Check filename and revision
- Import DXF stays unticked for this TAP route

2 VERIFY TOUCH SENSING

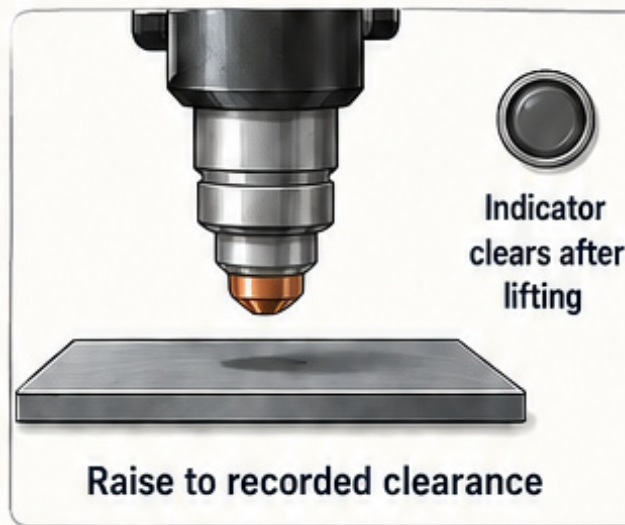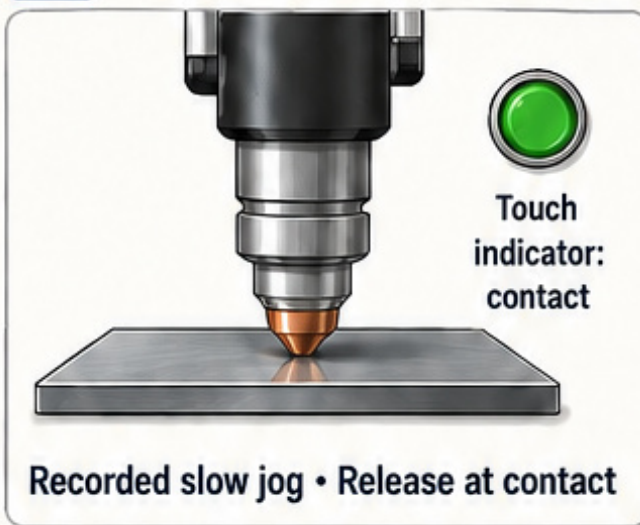

Slow Z-height movement



Option enables sensing; indicator reports contact

3 TORCH TEST ONLY IF RECORDED



Torch On/Off = REAL FIRING
Recorded test conditions only
Click to fire • Click again to stop
Verify arc out



OFF




ON



OFF

If explicitly not required, continue. Blank test record: STOP.

4 POSITION AND SET ORIGIN

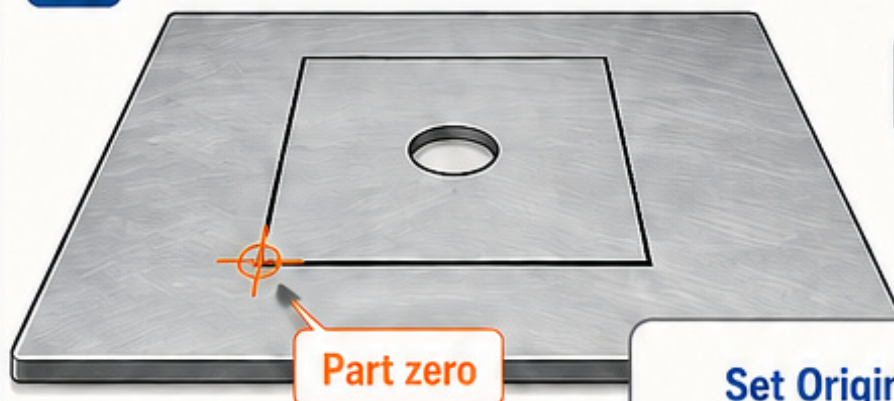

Slow X/Y positioning



Release jog keys, then Set Origin

- Allow space for kerf, lead-ins and travel

Set Origin = assign zero

Stores the current position as part zero

Origin = move to zero

Moves back to that SAME stored part zero


TRAINED, AUTHORISED TEACHERS ONLY
Visual reminder • Use the full guide and confirmed setup record

Illustrative controls • Match your installation

D DRY RUN, CUT, FINISH

Prove the path • Make the cut • Isolate

1 DRY RUN - NO ARC

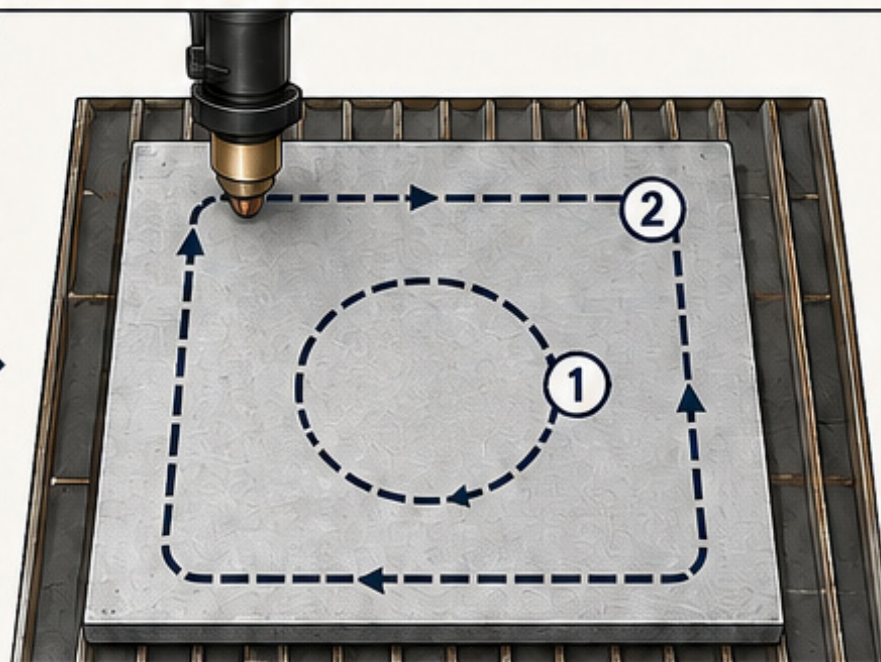

- Start from the beginning
- Real movement • No firing
- Check full travel and clearance

YES

ALL CHECKS PASS?

NO

STOP


2 DELIBERATE REAL CUT



Start from the beginning

FINAL CHECK

- ☒ File + origin
- ☒ Material + consumables
- ☒ Physical current + recorded recipe
- ☒ Extraction + secured access

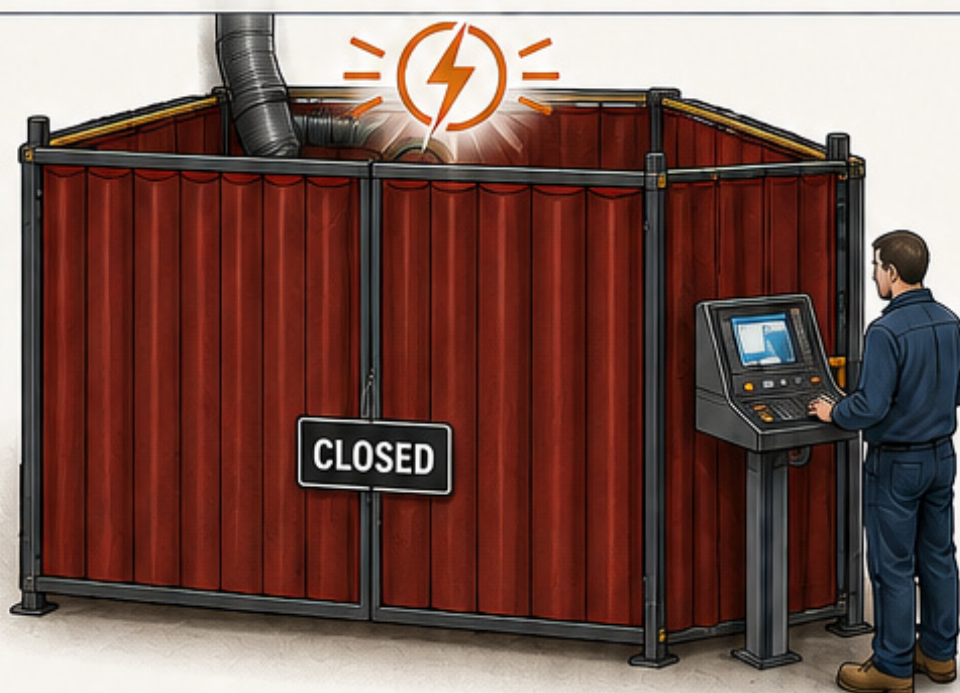

Screened operator position

3 FINISH, ISOLATE, RETRIEVE



Recorded cooling / shutdown



Verify electrical isolation



Retrieve safely • Measure • Record



Electrical isolation before student entry

FOR REAL CUTTING

Touch **ON** • Laser **OFF** • Online **ON** • Simul **OFF**

THC = recorded state • Kerf = recorded state

No double kerf compensation



Failed check or unsafe access? STOP.

TRAINED, AUTHORISED TEACHERS ONLY

Visual reminder • Full guide + confirmed setup record

Illustrative controls • Stop and Offline are not electrical isolation.