

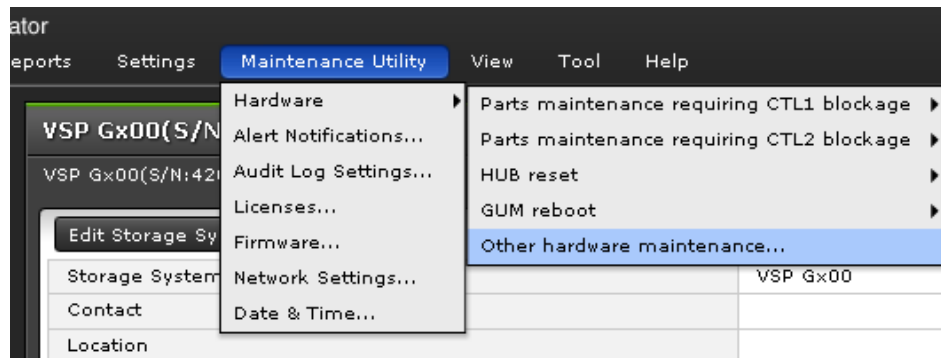
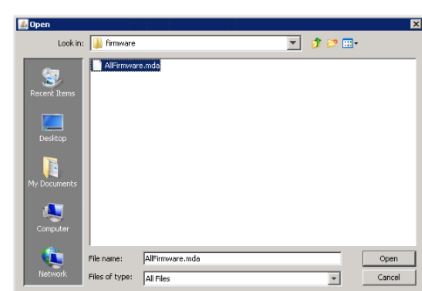
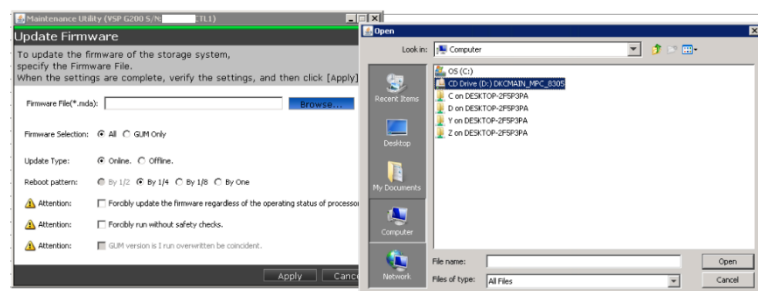


HITACHI Firmware Upgrade

5-1. Enter maintenance utility

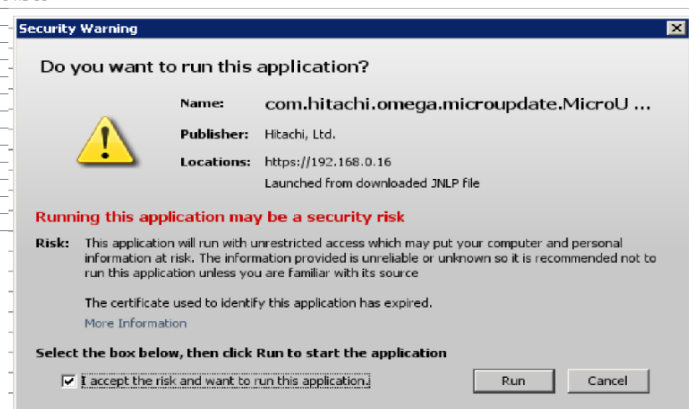


- Click firmware → update → later

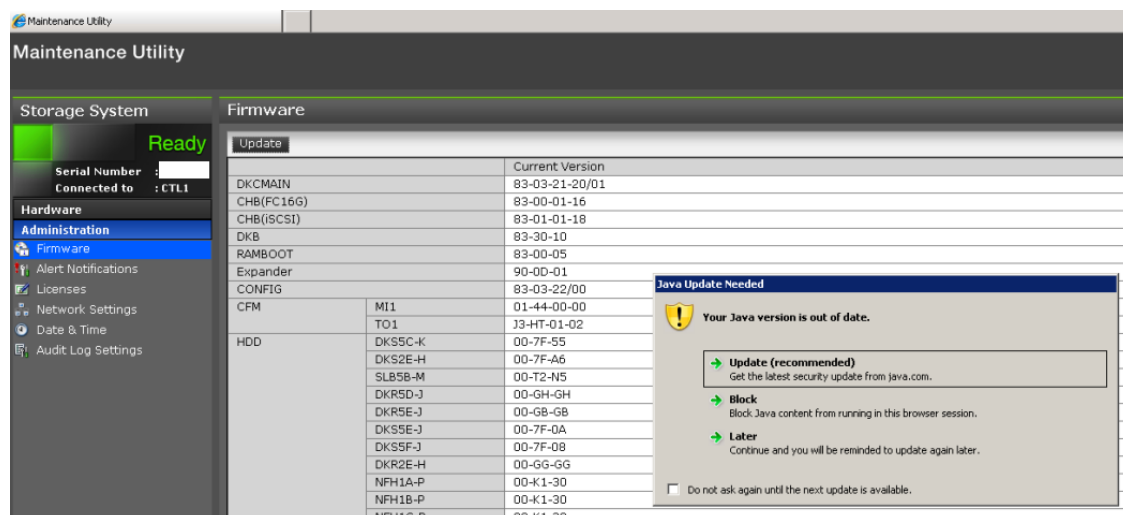


5-2. GUM Upgrade


After uploading the firmware file and clicking Apply, the screen shown below will appear; check only GUM to proceed with the upgrade first.

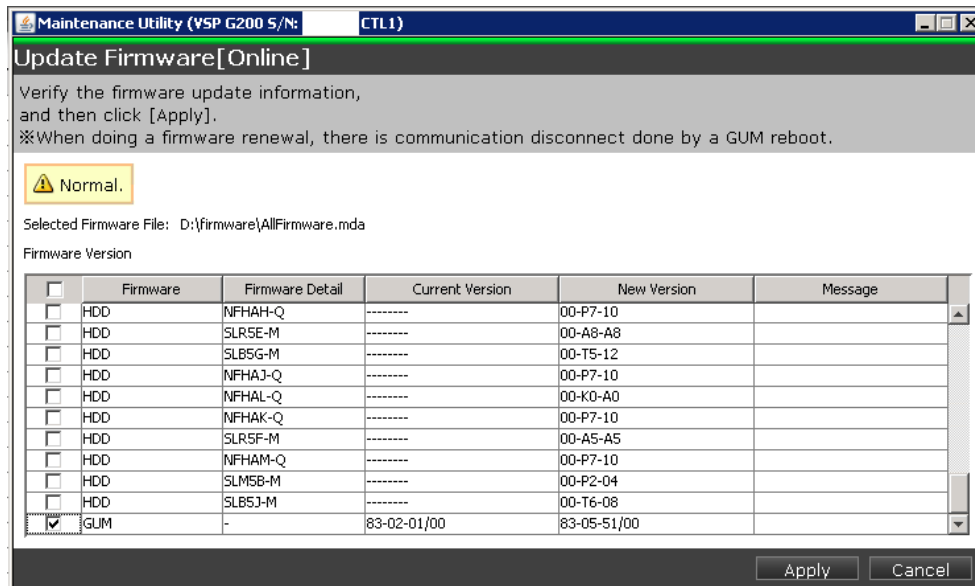

- Controllers reboot one by one during GUM upgrade (confirmed via ping)

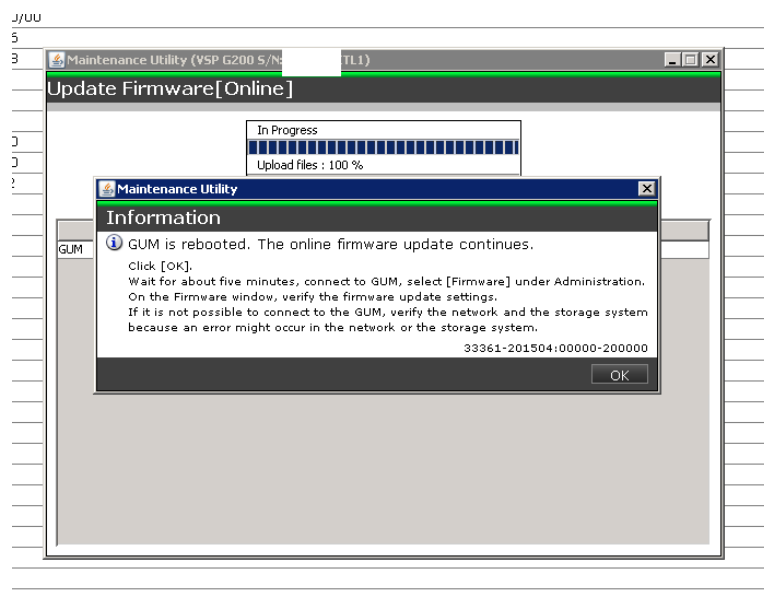



- GUM upgrade complete

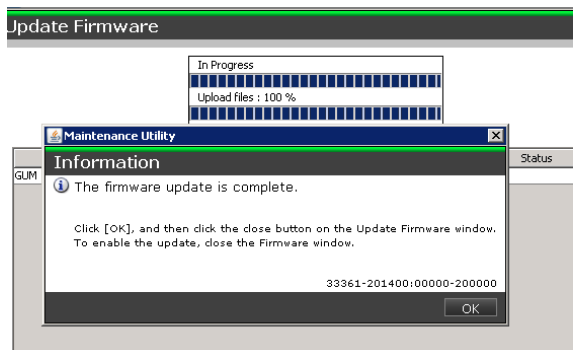


	DKR5C-K	00-GB-GB
	DKR5G-J	00-H8-H8
	DKS5D-K	00-7F-05
	SLR5D-M	00-A7-A7
	NFHAE-Q	00-E0-B0
	DKS5H-J	00-7F-A9
	SLB5C-M	00-T3-05
GUM		<u>83-05-51/00</u>

5-3. Remaining Upgrades

Uncheck only GUM and proceed with the rest of the upgrades.

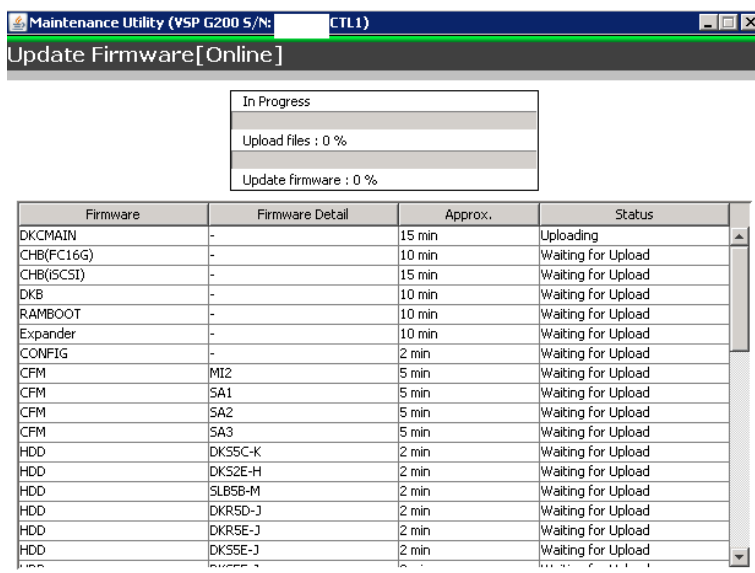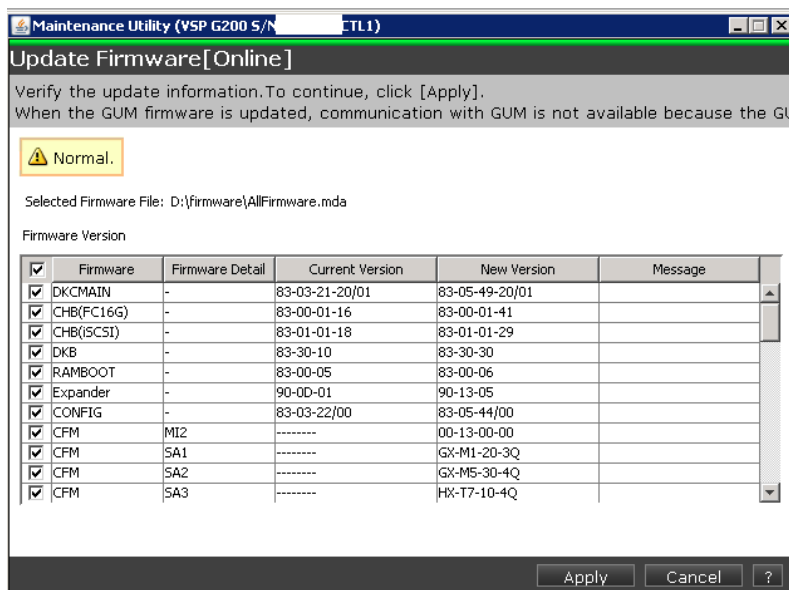


- Upgrade complete

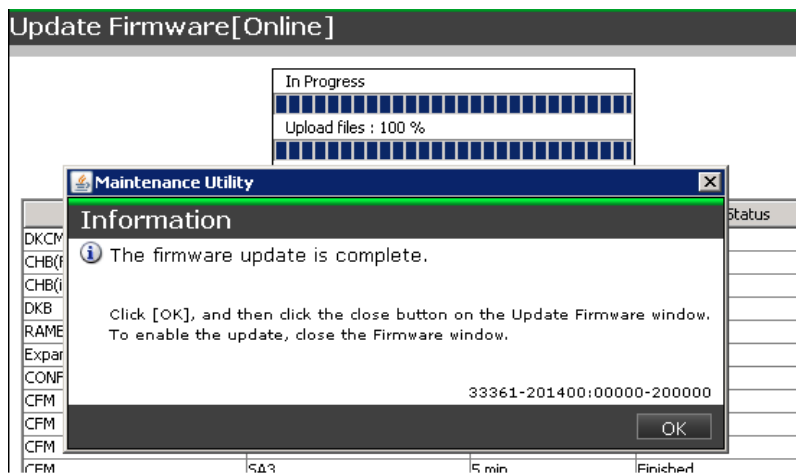

- Check firmware version afterwards

6. If there is an HDD warning

If a warning appears on the HDD as shown in the photo below

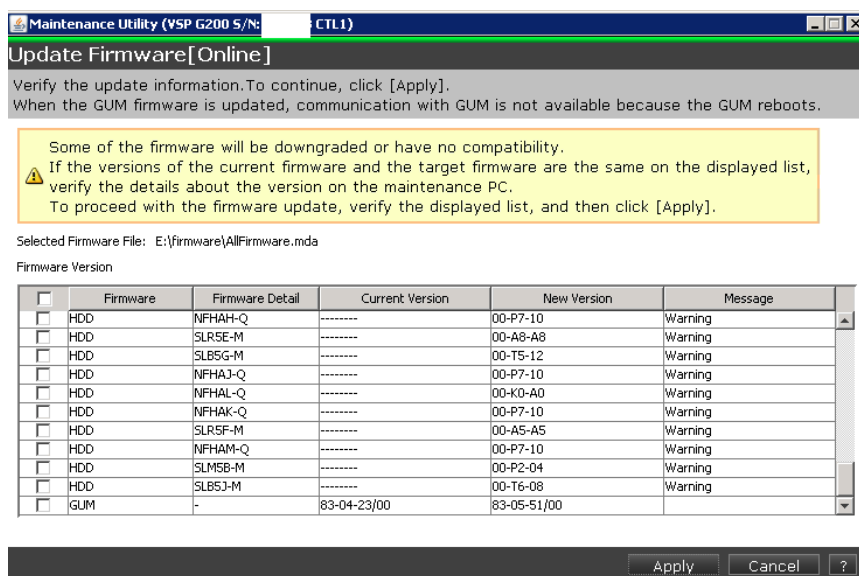

6-1. Upgrade GUM first

6-2. After the GUM upgrade is complete, remove the HDD and GUM and proceed with the upgrade.

Maintenance Utility (VSP G200 S/N: [redacted] CTL1)

Update Firmware[Online]

Verify the update information. To continue, click [Apply].
When the GUM firmware is updated, communication with GUM is not available because the GUM reboots.

Some of the firmware will be downgraded or have no compatibility.
 If the versions of the current firmware and the target firmware are the same on the displayed list, verify the details about the version on the maintenance PC.
 To proceed with the firmware update, verify the displayed list, and then click [Apply].

Selected Firmware File: E:\firmware\AllFirmware.mda

Firmware Version

☒	Firmware	Firmware Detail	Current Version	New Version	Message
☒	Expander	-	90-0E-01	90-13-05	
☒	CONFIG	-	83-04-23/00	83-05-44/00	
☒	CFM	MI2	00-13-00-00	00-13-00-00	
☒	CFM	SA1	GX-M1-00-3Q	GX-M1-20-3Q	
☒	CFM	SA2	-----	GX-M5-30-4Q	
☒	CFM	SA3	-----	HX-T7-10-4Q	
☐	HDD	DKS5C-K	00-7F-57	00-7F-5A	Warning
☐	HDD	DKS2E-H	00-7F-A6	00-7F-AB	Warning
☐	HDD	SLB5B-M	00-T2-N5	00-T2-N9	Warning
☐	HDD	DKR5D-J	00-GJ-GJ	00-GJ-GJ	Warning
☐	HDD	DKR5E-J	00-GC-GC	00-GC-GC	Warning

6-3. Once completed, it will return to normal, and then proceed with the HDD upgrade.

Maintenance Utility (VSP G200 S/N: [redacted] CTL1)

Update Firmware[Online]

Verify the update information. To continue, click [Apply].
When the GUM firmware is updated, communication with GUM is not available because the GUM reboots.

 Normal.

Selected Firmware File: E:\firmware\AllFirmware.mda

Firmware Version

☒	Firmware	Firmware Detail	Current Version	New Version	Message
☐	Expander	-	90-13-05	90-13-05	
☐	CONFIG	-	83-05-44/00	83-05-44/00	
☐	CFM	MI2	00-13-00-00	00-13-00-00	
☐	CFM	SA1	GX-M1-20-3Q	GX-M1-20-3Q	
☐	CFM	SA2	GX-M5-30-4Q	GX-M5-30-4Q	
☐	CFM	SA3	HX-T7-10-4Q	HX-T7-10-4Q	
☒	HDD	DKS5C-K	00-7F-57	00-7F-5A	
☒	HDD	DKS2E-H	00-7F-A6	00-7F-AB	
☒	HDD	SLB5B-M	00-T2-N5	00-T2-N9	
☒	HDD	DKR5D-J	00-GJ-GJ	00-GJ-GJ	
☒	HDD	DKR5E-J	00-GC-GC	00-GC-GC	

☐  Forcibly update the firmware even if the update results in version downgrade.