



FA report of Abnormal Display issue

JUNGLIM A070VW08 V2




AUO

Problem Statement

● General Information

Brand Customer	JUNGLIM	Defect Phenomenon	Abnormal Display
SI Customer	NA	Defect Rate or Q' ty	4pcs
AUO Model	A070VW08 V2	Defect Station	Line Reject
AUO S/N	<u>As below</u>	RMA No.	762512101089
Array/Cell/Beol/Module	S06	Chip ID	NA
Week Code	2420	Product Provider	YH Chuang
FMA analysis grade		Issue Date	2025/05/15

● Defect Panel S/N Picture

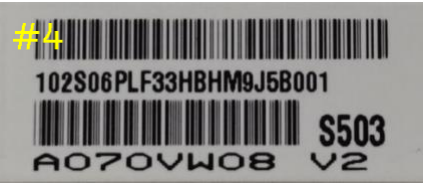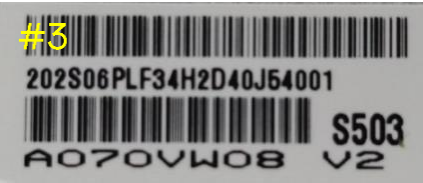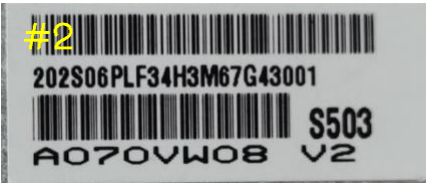


202S06PLF34H3M64E0B001
202S06PLF34H3M67G43001
202S06PLF34H2D40J54001
102S06PLF33HBHM9J5B001

Problem Statement

- Describe the phenomenon

- 1) JUNGLIM returned 4pcs A070VW08 V2 panel with Abnormal Display .
- 2) After checking the phenomenon, the symptom can be seen in AUO.

- Defect information

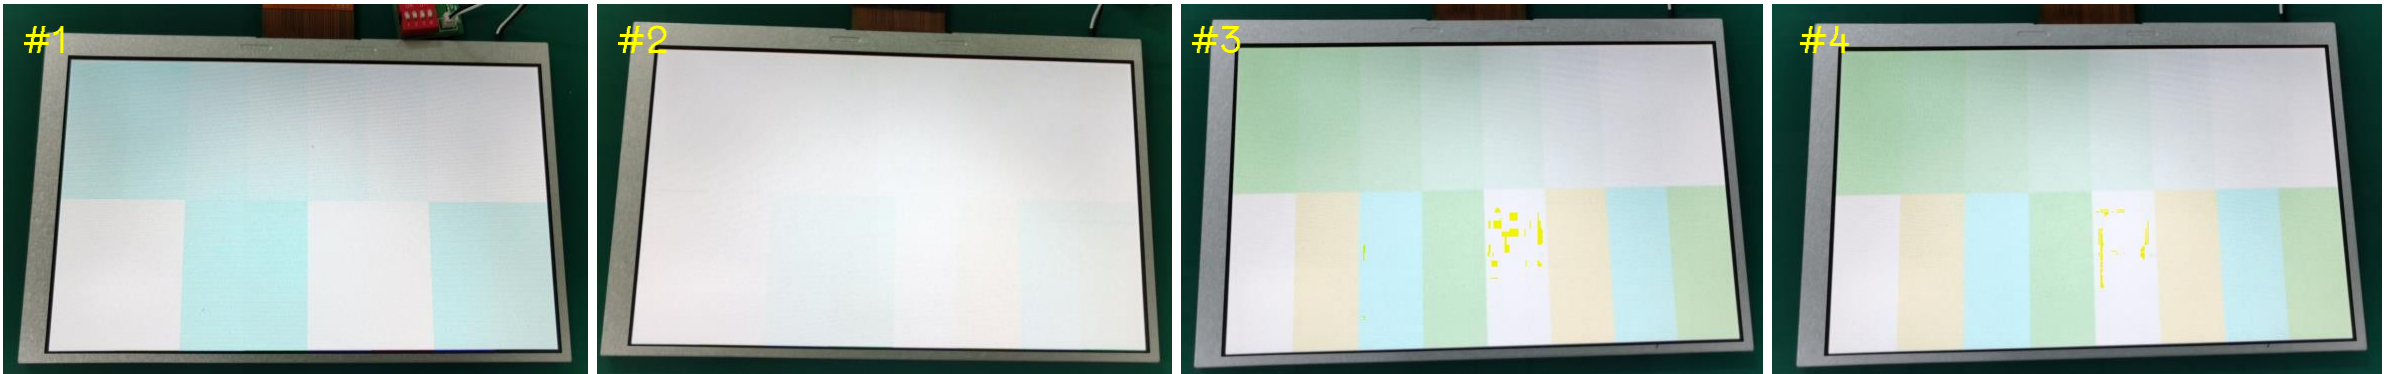

The 4 panels image are same pale




Root Cause Analysis

- Step1:measure the 4pcs NG panels voltage are equivalent with OK panels.

Test Item	#1	#2	#3	#4	OK panel
VGH	13.9	13.9	13.9	13.9	13.9
VGL	-14.09	-14.1	-14.09	-14.09	-14.07
VCOM	2.15	2.15	2.15	2.15	2.15


Root Cause Analysis

- Step2: There is no abnormality in the appearance of S-IC when observing the 4 panels, and the tuffy glue is also normal.

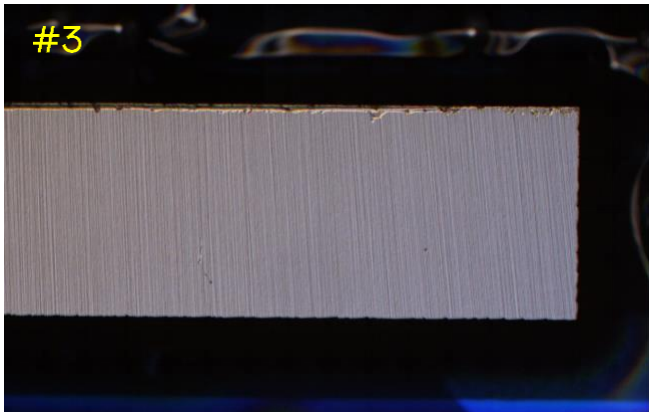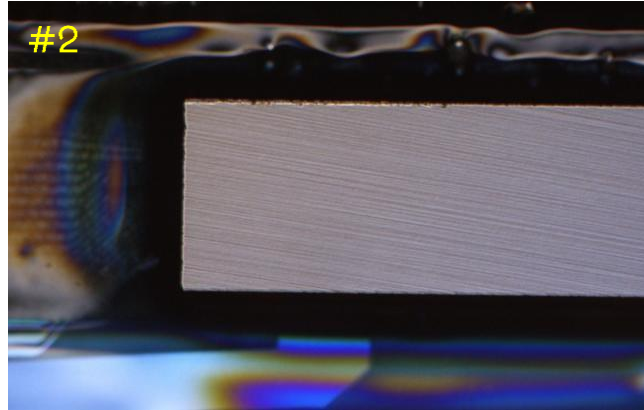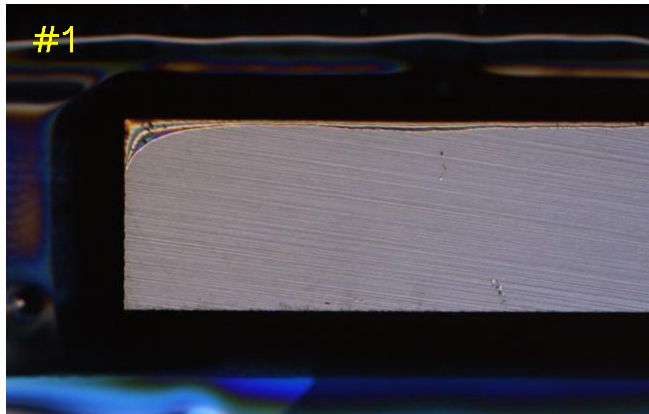

Root Cause Analysis




- Step5:random picked 2pcs and clean the tuffy, use OM check the SIC and ACF status are normal.

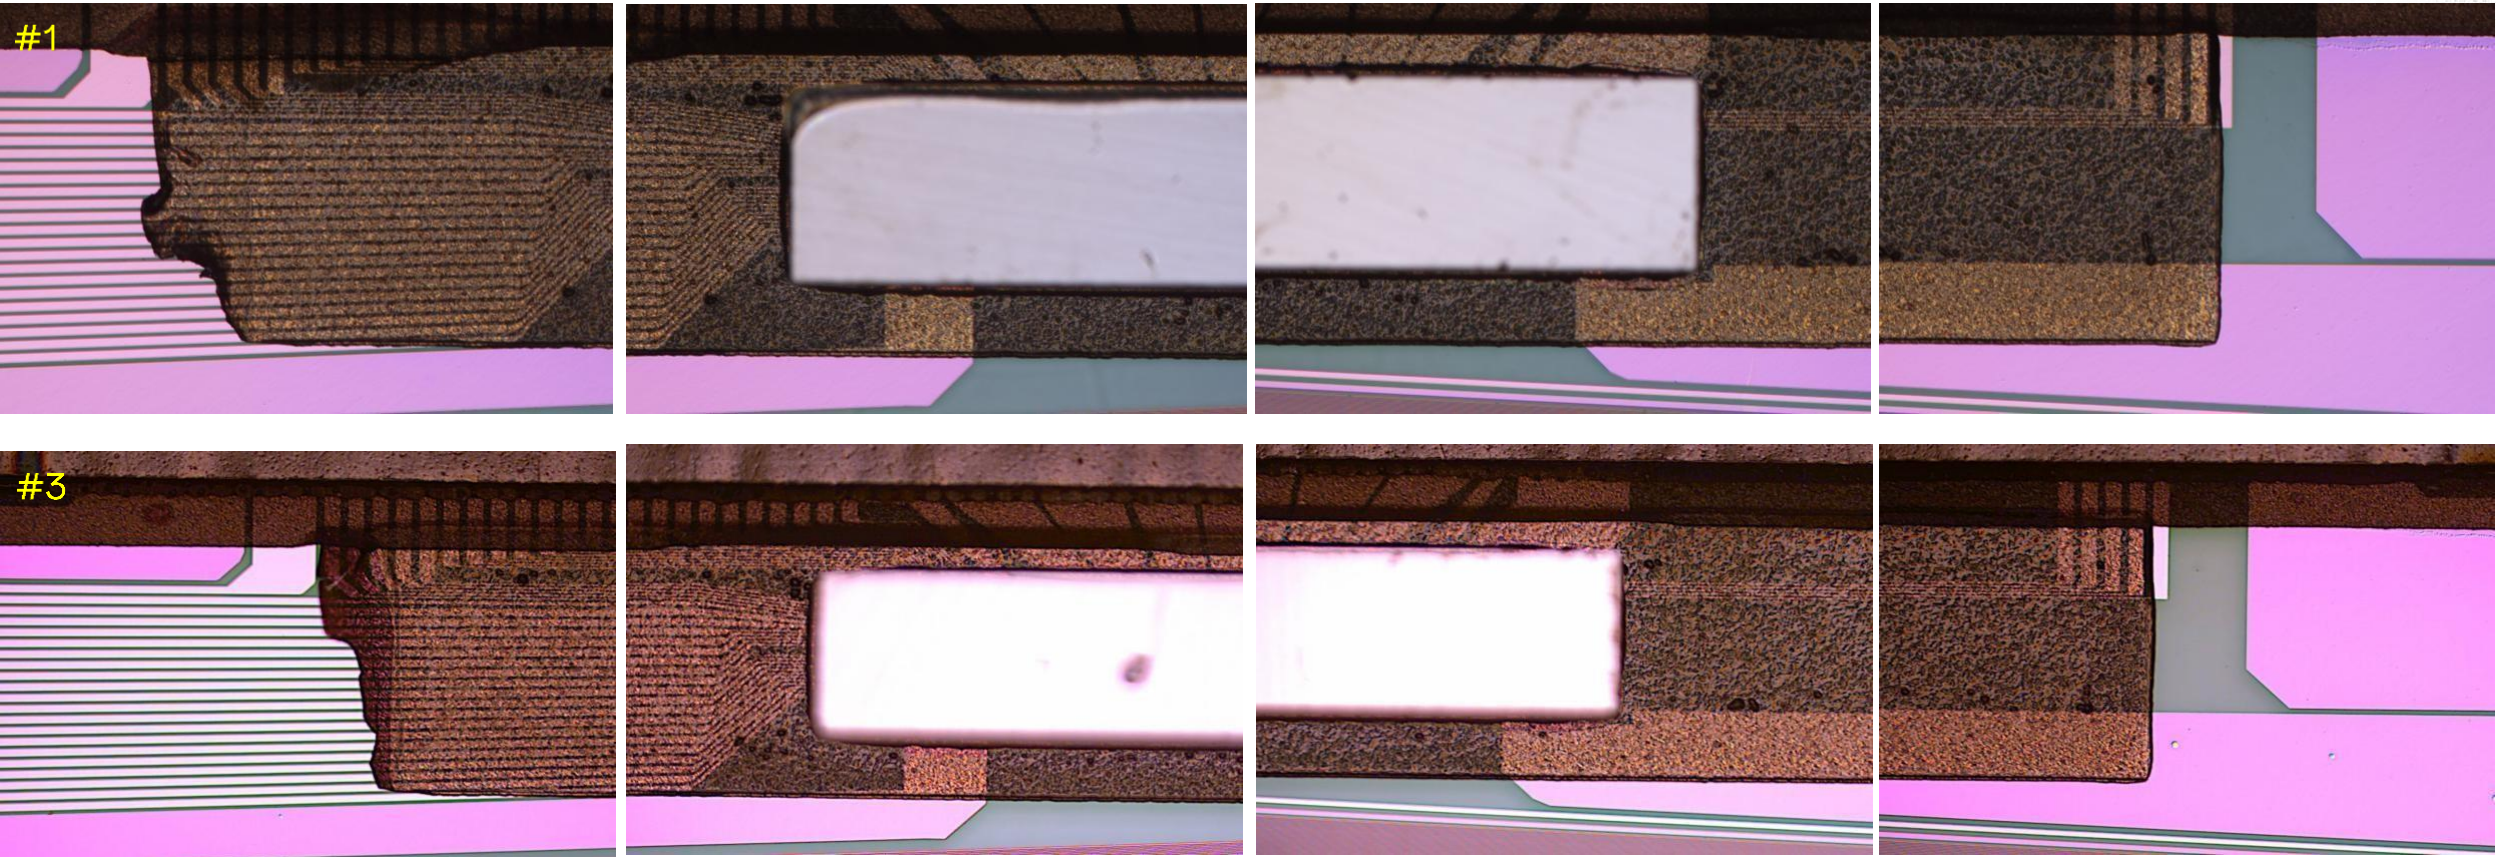

IC、ACF外围无异常






Root Cause Analysis

- Step6: Remove the #1 S/IC, use OM we see some smudge on the glass on the circuit

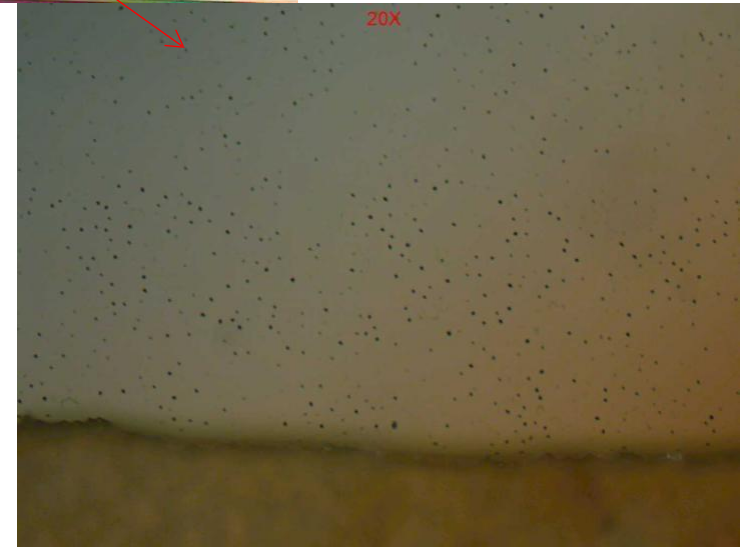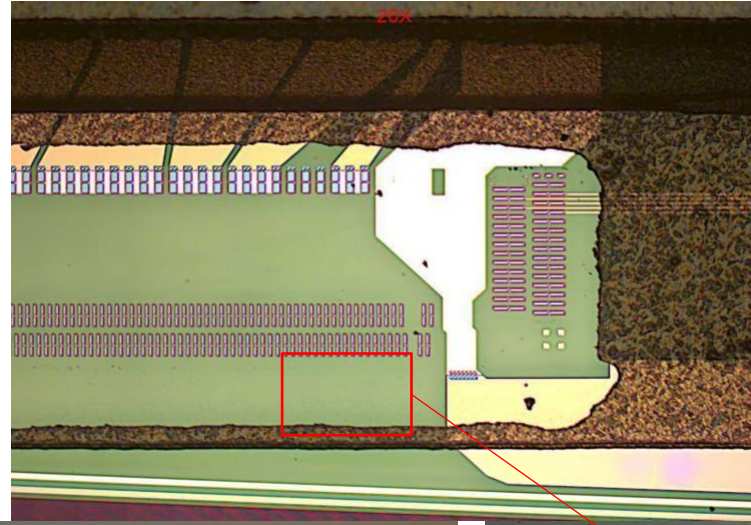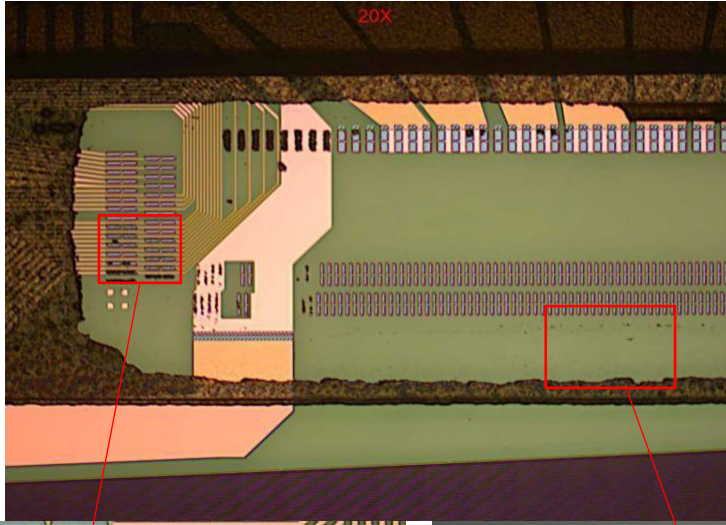



Root Cause Analysis

- Step7: Remove the #3 S/IC, use OM we also see some smudge on the glass on the circuit.

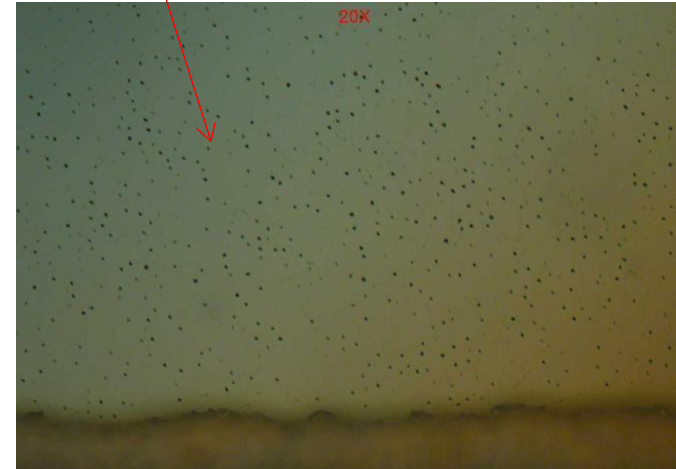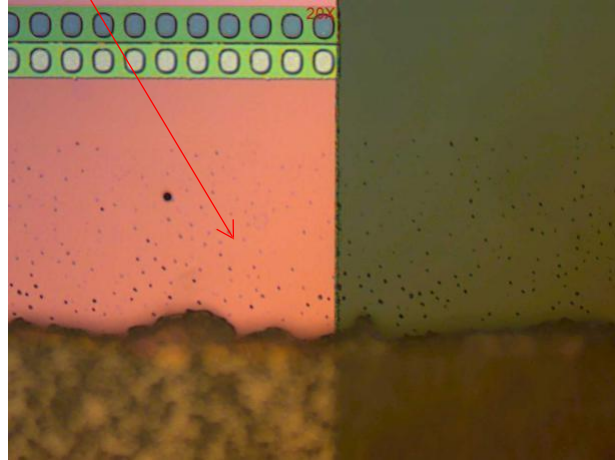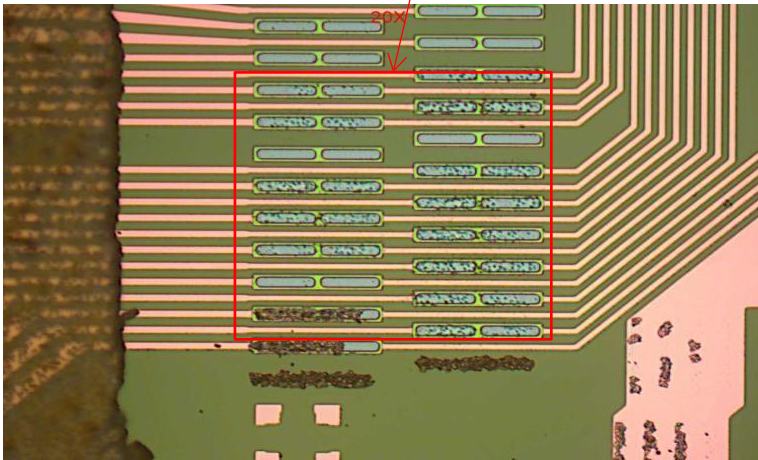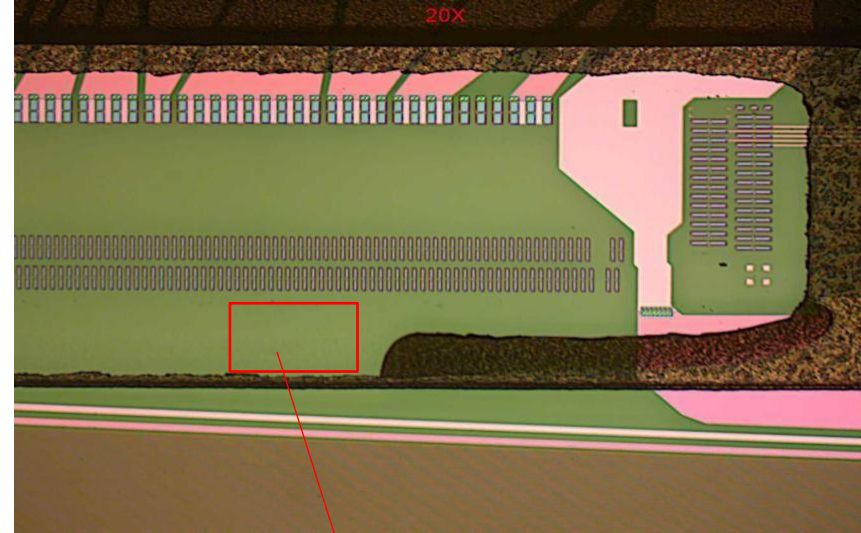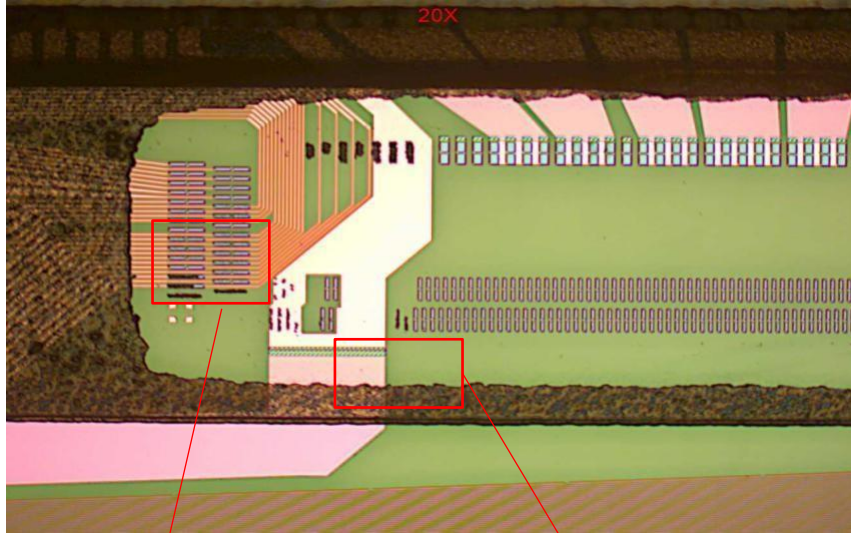

Root Cause Analysis

- Step8: The EDS show no abnormal element on the smudge, so the smudge should be composed of ACF&particle.

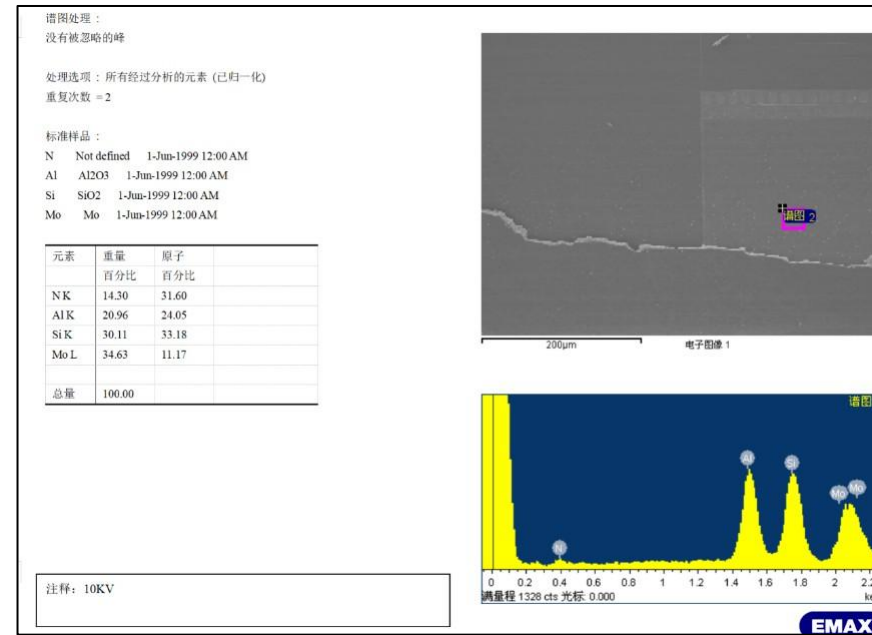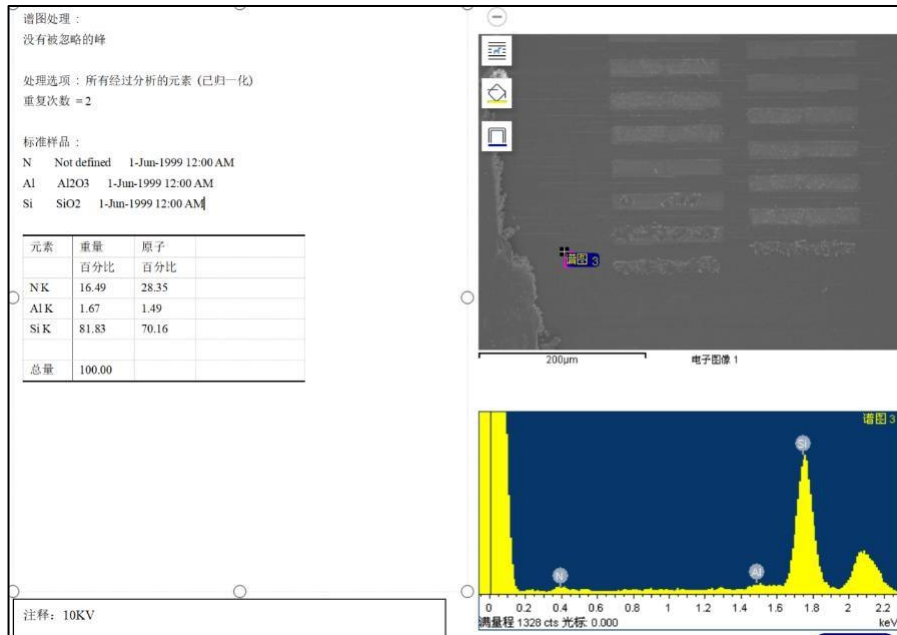

EDS result

Root Cause Analysis

- Step9 : Check the mfg. history of the feedback defect SN there is no repair record.

No repair record

LOT_NO	CELL_CHIP_ID	LOT_TYPE	REPAIR_COUNT	FINAL_GRADE	AREA	LINE	SHIFT	SHIFT_DATE	MODEL_NO	PART_NO	OP
LF33HBHM9J5B	LF33HBHM90T185B	N	0	P	JI_4A	S064AJI10	D	2024/3/5 0:00	A070VW08-2/01	97.07A19.201	COG
LF33HBHN2K36	LF33HBHN20T1936	N	0	P	JI_4A	S064AJI10	D	2024/3/5 0:00	A070VW08-2/01	97.07A19.201	COG
LF33HBHN5H0B	LF33HBHN50T170B	N	0	P	JI_4A	S064AJI10	D	2024/3/5 0:00	A070VW08-2/01	97.07A19.201	COG
LF33HCLH8218	LF33HCLH80T0218	N	0	P	JI_4A	S064AJI10	D	2024/3/5 0:00	A070VW08-2/01	97.07A19.201	COG
LF33HCMC7F45	LF33HCMC70T1545	N	0	P	JI_4A	S064AJI10	D	2024/3/5 0:00	A070VW08-2/01	97.07A19.201	COG
LF33HCMD5H08	LF33HCMD50T1708	N	0	P	JI_4A	S064AJI10	D	2024/3/5 0:00	A070VW08-2/01	97.07A19.201	COG
LF34H2BL4900	LF34H2BL40T0900	N	0	P	JI_4A	S064AJI10	D	2024/5/13 0:00	A070VW08-2/01	97.07A19.201	COG
LF34H2CW7158	LF34H2CW70T0158	N	0	P	JI_4A	S064AJI10	D	2024/5/13 0:00	A070VW08-2/01	97.07A19.201	COG
LF34H2CX0H00	LF34H2CX00T1700	N	0	P	JI_4A	S064AJI10	D	2024/5/13 0:00	A070VW08-2/01	97.07A19.201	COG
LF34H2D4082B	LF34H2D400T082B	N	0	P	JI_4A	S064AJI10	D	2024/5/13 0:00	A070VW08-2/01	97.07A19.201	COG
LF34H2D40J54	LF34H2D400T1854	N	0	P	JI_4A	S064AJI10	D	2024/5/13 0:00	A070VW08-2/01	97.07A19.201	COG
LF34H2D41L54	LF34H2D410T2054	N	0	P	JI_4A	S064AJI10	D	2024/5/13 0:00	A070VW08-2/01	97.07A19.201	COG
LF34H2D42D14	LF34H2D420T1314	N	0	P	JI_4A	S064AJI10	D	2024/5/13 0:00	A070VW08-2/01	97.07A19.201	COG
LF34H2D44301	LF34H2D440T0301	N	0	P	JI_4A	S064AJI10	D	2024/5/13 0:00	A070VW08-2/01	97.07A19.201	COG
LF34H2D4432B	LF34H2D440T032B	N	0	P	JI_4A	S064AJI10	D	2024/5/13 0:00	A070VW08-2/01	97.07A19.201	COG
LF34H2D46652	LF34H2D460T0652	N	0	P	JI_4A	S064AJI10	D	2024/5/13 0:00	A070VW08-2/01	97.07A19.201	COG
LF34H3LC763A	LF34H3LC70T063A	N	0	P	JI_4A	S064AJI10	D	2024/5/13 0:00	A070VW08-2/01	97.07A19.201	COG
LF34H3LC7810	LF34H3LC70T0810	N	0	P	JI_4A	S064AJI10	D	2024/5/13 0:00	A070VW08-2/01	97.07A19.201	COG
LF34H3LC7H33	LF34H3LC70T1733	N	0	P	JI_4A	S064AJI10	D	2024/5/13 0:00	A070VW08-2/01	97.07A19.201	COG
LF34H3M64E0B	LF34H3M640T140B	N	0	P	JI_4A	S064AJI10	D	2024/5/13 0:00	A070VW08-2/01	97.07A19.201	COG
LF34H3M64J04	LF34H3M640T1804	N	0	P	JI_4A	S064AJI10	D	2024/5/13 0:00	A070VW08-2/01	97.07A19.201	COG
LF34H3M65G05	LF34H3M650T1605	N	0	P	JI_4A	S064AJI10	D	2024/5/13 0:00	A070VW08-2/01	97.07A19.201	COG
LF34H3M66A41	LF34H3M660T1041	N	0	P	JI_4A	S064AJI10	D	2024/5/13 0:00	A070VW08-2/01	97.07A19.201	COG
LF34H3M67G43	LF34H3M670T1643	N	0	P	JI_4A	S064AJI10	D	2024/5/13 0:00	A070VW08-2/01	97.07A19.201	COG
LF34H3M6861A	LF34H3M680T061A	N	0	P	JI_4A	S064AJI10	D	2024/5/13 0:00	A070VW08-2/01	97.07A19.201	COG
LF34H3M70300	LF34H3M700T0300	N	0	P	JI_4A	S064AJI10	D	2024/5/13 0:00	A070VW08-2/01	97.07A19.201	COG
LF34H3M71H0A	LF34H3M710T170A	N	0	P	JI_4A	S064AJI10	D	2024/5/13 0:00	A070VW08-2/01	97.07A19.201	COG
LF34H3NP4758	LF34H3NP40T0758	N	0	P	JI_4A	S064AJI10	D	2024/5/13 0:00	A070VW08-2/01	97.07A19.201	COG
LF34H3NP4L10	LF34H3NP40T2010	N	0	P	JI_4A	S064AJI10	D	2024/5/13 0:00	A070VW08-2/01	97.07A19.201	COG

Root Cause Analysis

- Step10: Check the mfg history from the 2 week code, there is no system record bonding machine error.

3/5 no system automatic record bonding machine error

编号	机台代码	待修时间(分)	维修时间	维修人员	叫修原因描述	根本原因	维修注解	当机原因	机台原因描述	维修代码	维修代码描述	是否跟进	叫修时间	维修结束时间	修机报告
1	PFA_4A10	9	1	郝志鹏	CCD拍照异常	打标机软体修改	打标机软体修改	AN5066	CD拍照异常	AN5088	Others	N	24-3-5 10	24-3-5 10	点击查看
2	LC_4A10	25	2	陈忠良	机构异常	LC后电缸动作异常	后电缸断电原点,	AA0009	真空异常	AN5039	真空异常	N	24-3-5 15	24-3-5 15	点击查看
3	PCB_4A10	17	1	张树春	机构异常	吸取异常	调整交接位置	AN5017	7 (真空异常)	AR1033	(气管管路)	N	24-3-5 16	24-3-5 17	点击查看
4	PFA_4A10	7	2	郝志鹏	真空异常	先机出口移栽Z轴下降异常	轴下降气管中串接调节	AN5020	机构异常	AN5042	机构异常	N	24-3-5 16	24-3-5 17	点击查看
5	PFA_4A10	65	3	权兵雪	真空异常	贴付轴异常, 位置决无轴贴付补正角度, 0.1-		AN5057	伺服器异常	AN5035	伺服器异常	N	24-3-5 21	24-3-5 22	点击查看
6	PFA_4A10	55	3	陈强勇	机构异常	传输异常, 导致打标未出	话通知IT。与机台无	DN5001	机构异常	DN5002	更换材料	N	24-3-6 3	24-3-6 4	点击查看

5/13 no system automatic record bonding machine error


编号	机台代码	待修时间(分)	维修时间	维修人员	叫修原因	叫修原因描述	根本原因	维修注解	当机原因	当机原因描述	维修代码	维修代码描述	是否跟进	叫修时间	维修结束时间	修机报告
1	UV_4A10	63	3	李虎	AD1000	胶型不良	uv影像不佳	重新启动	AN1102	UV	AR1107	UV	N	2024-5-1	2024-5-1	点击查看

Root Cause Analysis

- Step11: Confirm the tooling and mfg status checklist there is no abnormality.

3/5 no tooling and mfg status abnormality found in checklist

Parameter
check list

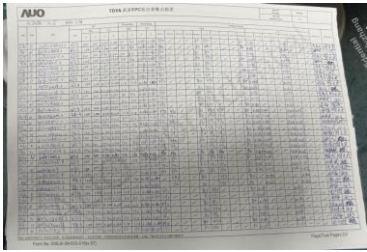A large, multi-column table with many rows, likely a checklist for parameters. It has a header section and several columns of data.

Pressure head
Flatness check list

A table with multiple columns and rows, featuring a prominent yellow vertical highlight on the left side. It appears to be a checklist for pressure head and flatness.

First panel
Status check list

A table with multiple columns and rows, likely a checklist for the first panel status. It has a header section and several columns of data.

Sampling
Status check list

A table with multiple columns and rows, likely a checklist for sampling status. It has a header section and several columns of data.

5/13 no tooling and mfg status abnormality found in checklist

Parameter
check list

A large, multi-column table with many rows, likely a checklist for parameters. It has a header section and several columns of data.

Pressure head
Flatness check list

A table with multiple columns and rows, featuring a prominent yellow vertical highlight on the left side. It appears to be a checklist for pressure head and flatness.

First panel
Status check list

A table with multiple columns and rows, likely a checklist for the first panel status. It has a header section and several columns of data.

Sampling
Status check list


A table with multiple columns and rows, likely a checklist for sampling status. It has a header section and several columns of data.

Root Cause Analysis

- According to the RMA/FMA history investigation, the same defect was also found in another customer last year.
- The panels found at the other customer also had week codes of 24/10 and 24/20.
- No abnormalities were found in the production history; however, based on feedback from another customer, it appears that there were issues with panels produced in Week 10 and Week 20 of 2024.


Root Cause Analysis

- Step12: The process that could cause smudges on the glass surface is the LCC cleaning process.

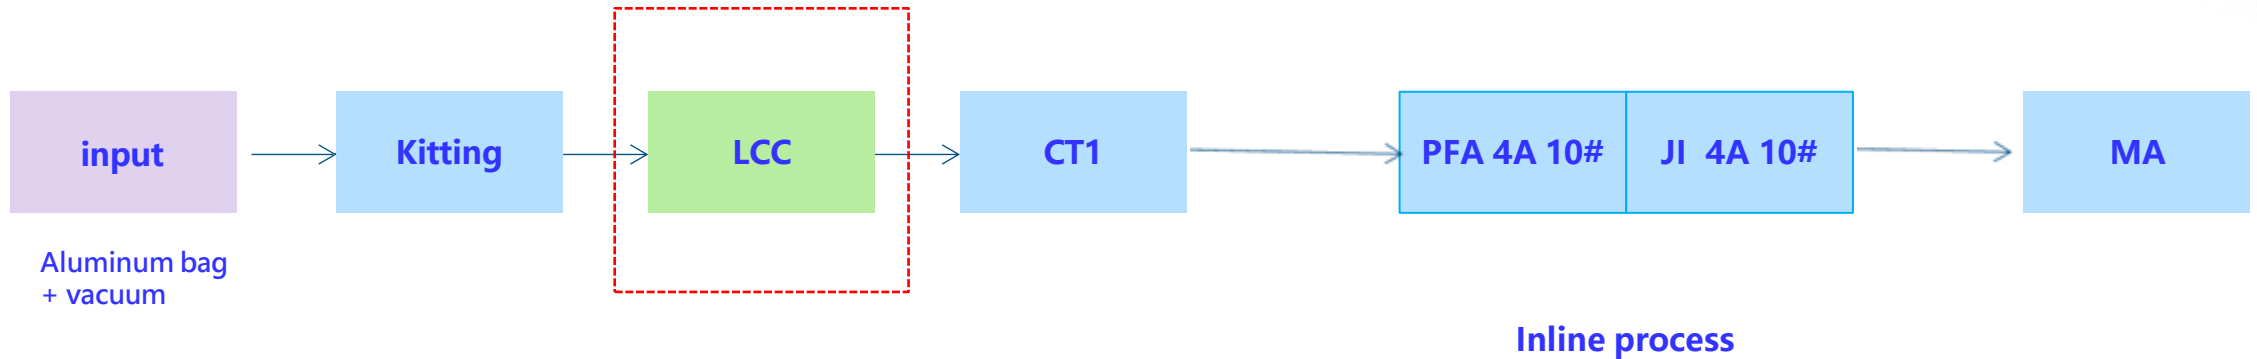

Improvement Action

- Modify the process of product -2024/8
- The LCC machine had been inhibited
- Add EC clean and Plasma to ensure the cleanness of the circuit area.

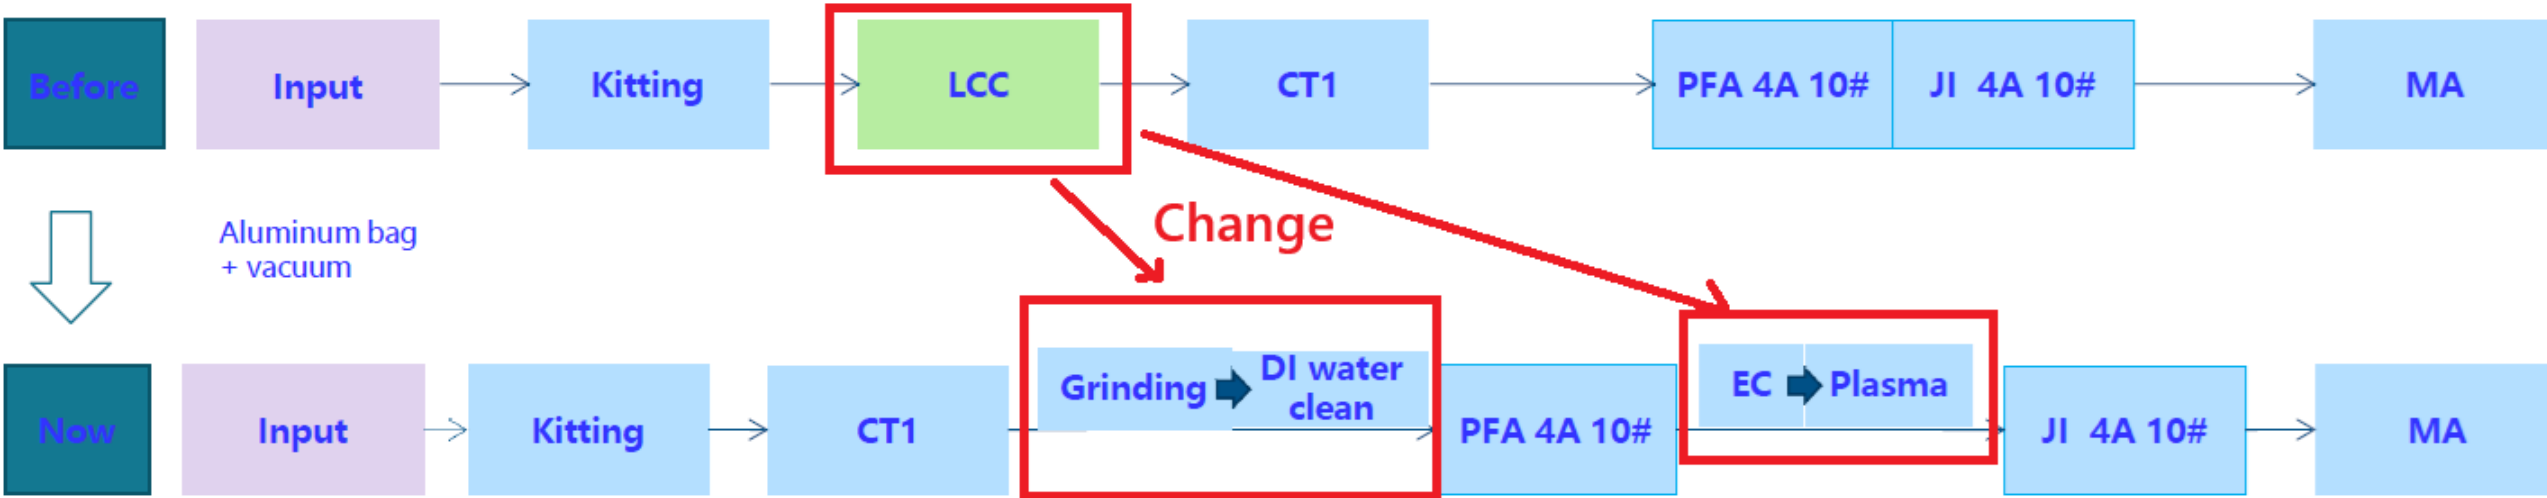



Tap Into The Possibilities

AUO