



FA FMA Analysis Report


Junglim-G154EVN01.0 Sandy Mura

Problem Statement



● General Information

Brand/Project	Junglim	Defect Phenomenon	Sandy mura														
AUO Model	G154EVN01.0	Defect Station	Line reject														
RMA No	702610100413	Issue Date	2026/02/12														
AUO S/N	415276H4DFZYZS0101	ES	莊淵翔														
Array/Module	<table><tr><th>Array</th><th>TP</th><th>CF</th><th>Cell FEOL</th><th>Cell BEOL</th><th>J1</th><th>MA / Lamination</th></tr><tr><td>L4A</td><td>N/A</td><td>C4A</td><td>L3C</td><td>S01</td><td>S01</td><td>S01</td></tr></table>			Array	TP	CF	Cell FEOL	Cell BEOL	J1	MA / Lamination	L4A	N/A	C4A	L3C	S01	S01	S01
Array	TP	CF	Cell FEOL	Cell BEOL	J1	MA / Lamination											
L4A	N/A	C4A	L3C	S01	S01	S01											


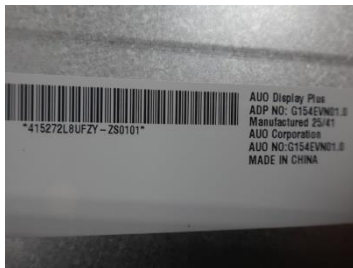


Problem Statement

- Describe the phenomenon at customer side

1) Customer reported defect: Sandy mura. °

- Defect Phenomenon

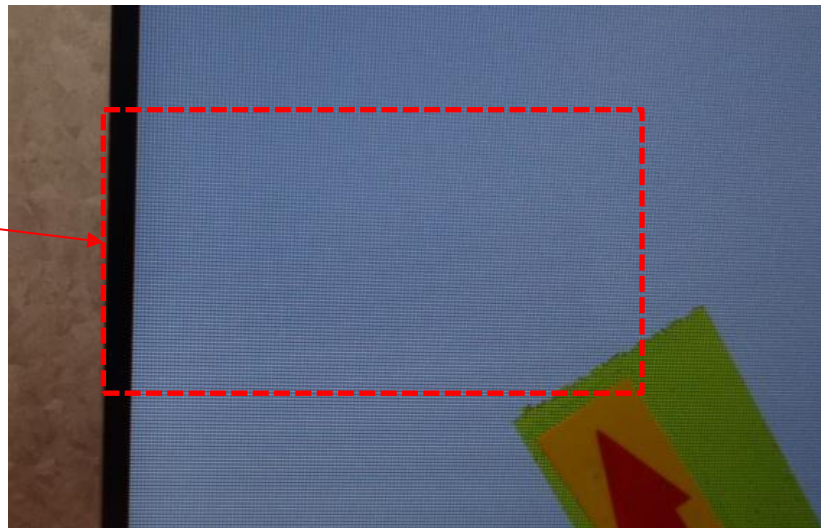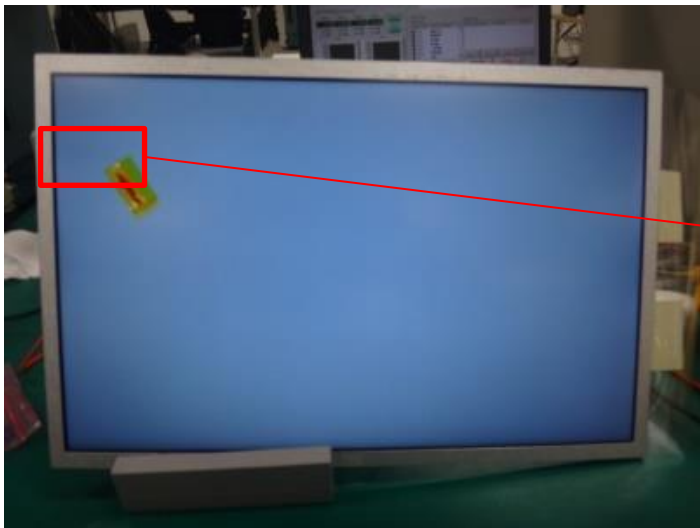

Root Cause Analysis

Step1: Adjust driving voltages to observe Mura behavior→

- **Varying VCOM does not change the Mura**


VCOM adjustment cannot eliminate the phenomenon, therefore cell issue can be ruled out.

- **Varying VGL shows no visible change the Mura**


No indication of TFT off-state / leakage-related issue.

- **Varying VGH affects the mura severity**


Lowering VGH makes the mura more noticeable; increasing VGH makes the mura lighter.

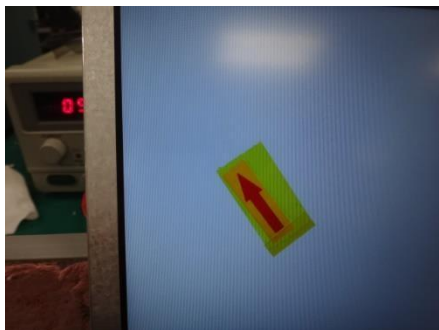


Varying VCOM does not change the Mura

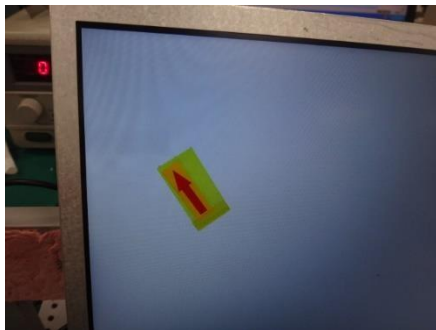

Varying VGL shows no visible change the Mura

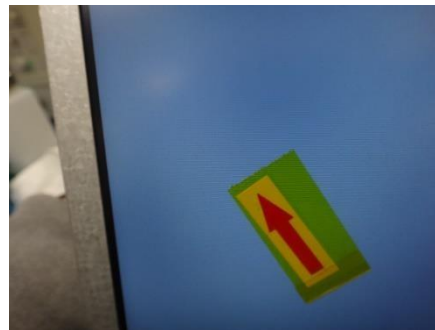





Lowering VGH makes the mura more noticeable;
increasing VGH makes the mura lighter.

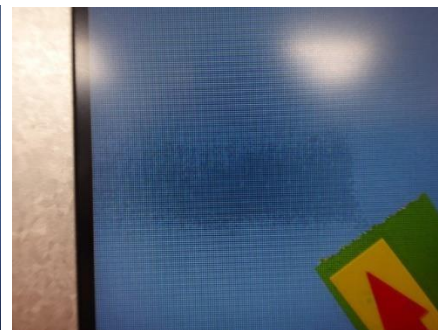

Voltage tune	VCOM	VGL	VGH
Higher	No Change	No Change	lighter
Lower	No Change	No Change	more noticeable

Root Cause Analysis

Step2: FIB check → No abnormality observed in PI / Via-PI interface

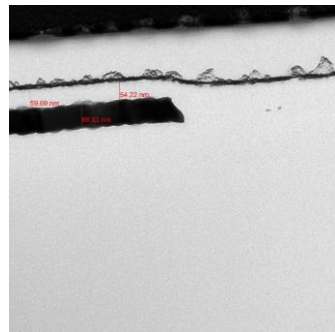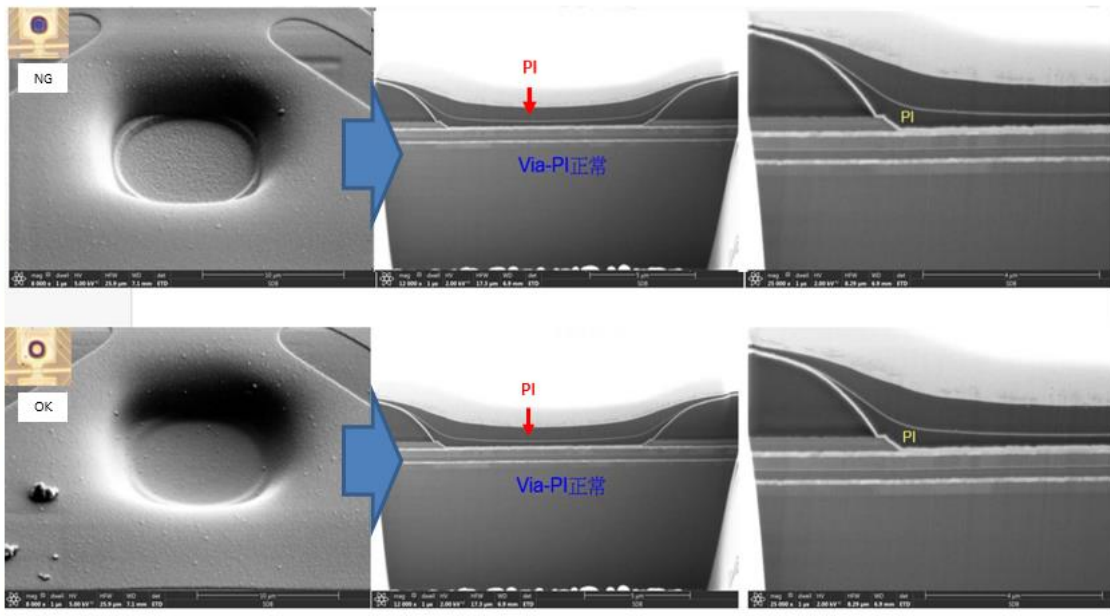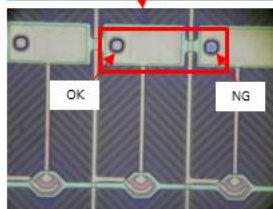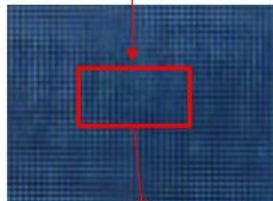

Conclusion



1. Adjustment of VGH shows a clear correlation with the mura visibility:
 - A. Increasing VGH reduces the mura severity.
 - B. Decreasing VGH makes the phenomenon more noticeable.
2. This behavior suggests that the phenomenon is related to the TFT on-state driving condition (drive margin variation), since VGH adjustment directly impacts the TFT turn-on characteristics.
3. No abnormality was observed in the PI/Via-PI structure from the FIB cross-sectional check in the examined samples.

亮麗創新  曼妙生活

Bright Innovation · Amazing Life



AUO

Innovating Life