

ILI2532 Touch function abnormal FA report

Content

- Sample Description
- Analysis
- Summary

For ICHIA Reference only

Sample description

- Customer : ICHIA (AUO)
- Device : ILI2532
- Defect phenomenon : TP function abnormal
- Fail rate : NA
- Failure Site : Production Line
- Return Quantity : PCBa 1 pcs
- Model : A2XI942CC-R
- Received date : 2026/3/16


Analysis - Appearance inspection

- No obvious abnormalities were found during visual inspection.



Analysis - Duplication phenomenon

- TP Short test results can be replicated to Y23 values, but anomalies exist.

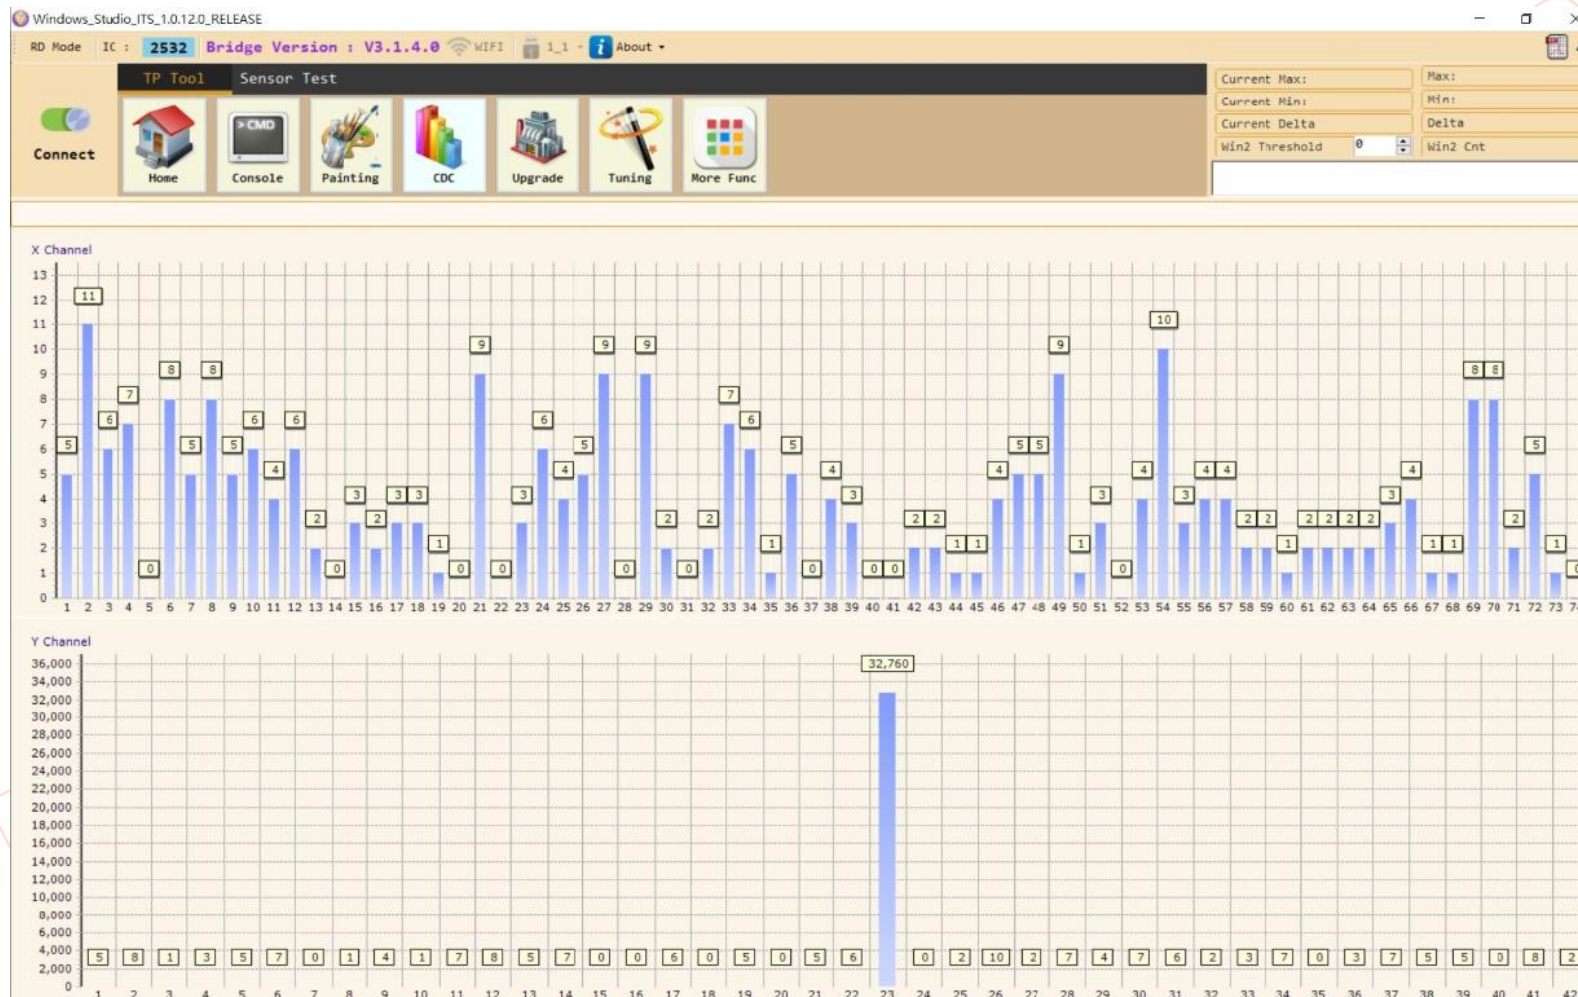

Analysis - Measurement

- Diode Voltage measurement results are as follows:
The diode voltage of TX23 to ground is lower than that of the adjacent Tx pin.

IC NO.	TX22-GND	TX23-GND	TX24-GND
#NG	0.735V	0.659V	0.735V



Summary: It is speculated that the Pin TX23 is damaged, causing the TP short test fail.

Summary

- NG IC can be copied to Y23 short test failed.
- The diode voltage of TX23 to ground is lower than that of the adjacent Tx pin.
We speculate that the TX23 diode is damaged, usually caused by abnormal voltage or current.

ILITEK

Enrich Visual Experience

For ICHIA Reference only