

Florida Inspection Associates Nationwide

vehicle
report #342620

PO Box 1308 Largo, FL 33779
ph: 727-588-0331 fax: 727-588-0580

Adjuster :

Warranty Company : GEICO

Repair Shop : Chevrolet of Wesley Chapel
26922 Wesley Chapel Blvd
Wesley Chapel, FL 33544-8409

Phone Number : (813) 279-7573

Contact : D 1 913 270 7573

Claim Number : 0620373550101048

Contract Number :

Insured : Nilamben Patel

Vehicle : 2017 CHEV CAMARO

Inspection Requested : 5/28/2024

Inspector Name : Ben S

Inspection occurred : 5-29-2024 ; 10:20 AM

Complete VIN : 1G1FB1RX7H0101065

Current Mileage : 67,686

Tag : ITY B20 Tag State: FL

Engine Oil : Drained ; Fair

Trans Fluid : N/A ; N/A

Coolant : Drained ; Fair

Power steering : Electric ; N/A

Brake fluid : Full ; Fair

Modifications : None, 245/40R20

Commercial Use : No

Impact damage : No

RO Number : 99843 Dated : 05-20-2024

Customer Complaint : Guest states tapping noise from engine when in gear since last oil change.

Labor rate is 220.00.

Driven

Eng Size : 2.0

Trans Type : AUTO RearWD

Overall Cond of Vehicle : Fair

Trailer Hitch : No

Related Service history : Not Available

Inspectors Report : Yes, the valve cover and front timing cover were removed.

I met with the tech. He reported a noise from the motor that would stop when the Intake VVT phaser control valve connector was unplugged. He has already removed the valve cover and timing cover to inspect for damage to the camshafts and timing chain components. He found NO damage to the camshafts, timing chain, timing chain tensioner, or guides. The tech reported that the intake VVT phaser has an internal failure and is the source of the noise. All other sources of noise in the front of the motor have been excluded. The motor oil was drained but the condition of the pooled oil on the front timing cover was good, no slugging or lubrication concerns were found.

Shop's notes:

No further failures noted.

Shop's opinion of cause : Failed VVT phasers

Inspector's opinion of cause: Suspected internal failure of the intake VVT phaser due to normal long-term use and wear.

Corrective Action Needed : Replace the intake VVT phaser and retest for noise.

Were Pix Taken? : Photos on Website

Shop Agree Sign Report? : Yes RJ Yensco

FIA Base Fee : \$120.00

Fuel Surcharge : \$0.00

FIA Special Charges :


Typed: Admin 5/30/2024

FIA Total Fee : **\$120.00**

FIA's TAX ID #59-3350686

FLORIDA INSPECTION ASSOCIATES, INC., SHOULD IT BECOME NECESSARY, RESERVES THE RIGHT TO REVIEW INFORMATION THAT MAY BECOME AVAILABLE, AS WELL AS ANY ADDITIONAL EVIDENCE OR RELATED INFORMATION, AND THE RIGHT TO AMEND THIS INSPECTION REPORT AND ITS FINDINGS.


©Flainspectors.com | #342620 | 5/29/2024 | Exterior overview

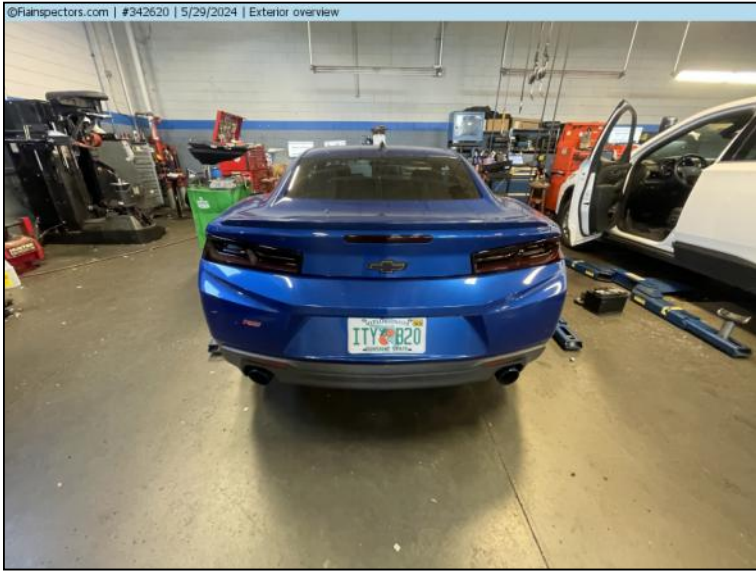

©Flainspectors.com | #342620 | 5/29/2024 | Tag



©Flainspectors.com | #342620 | 5/29/2024 | Exterior overview

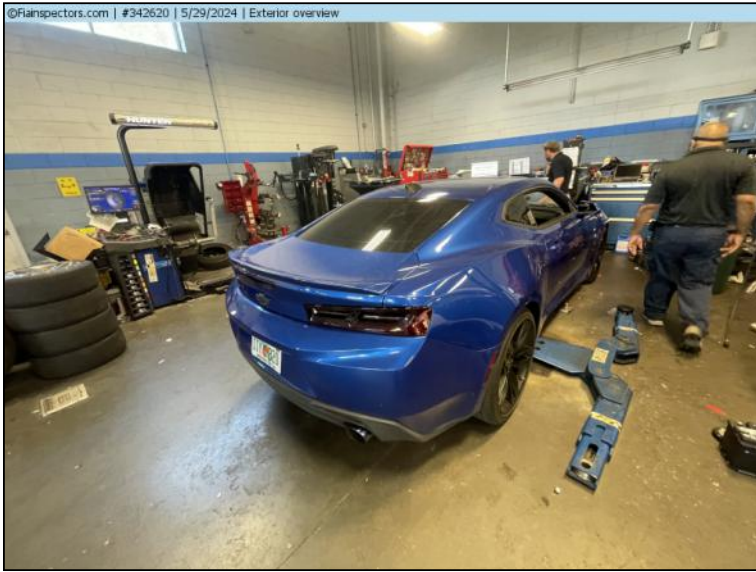

©Flainspectors.com | #342620 | 5/29/2024 | Exterior overview





©Flainspectors.com | #342620 | 5/29/2024 | LF



©Flainspectors.com | #342620 | 5/29/2024 | LR




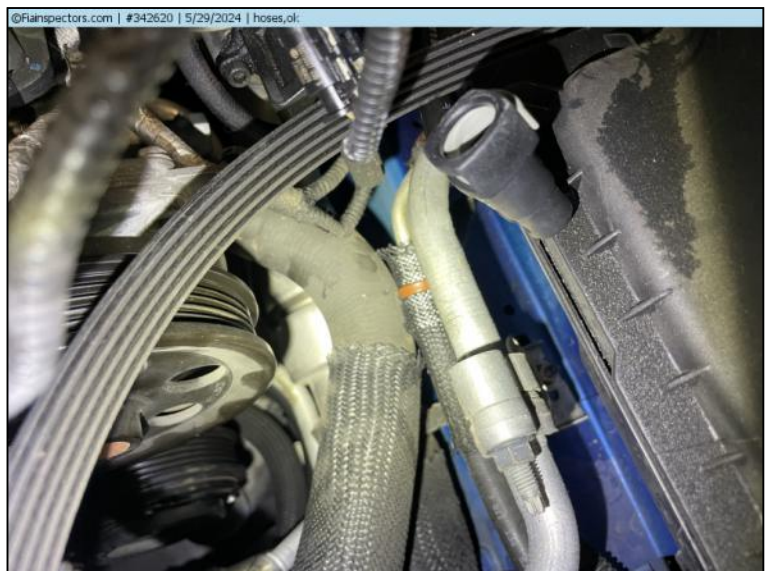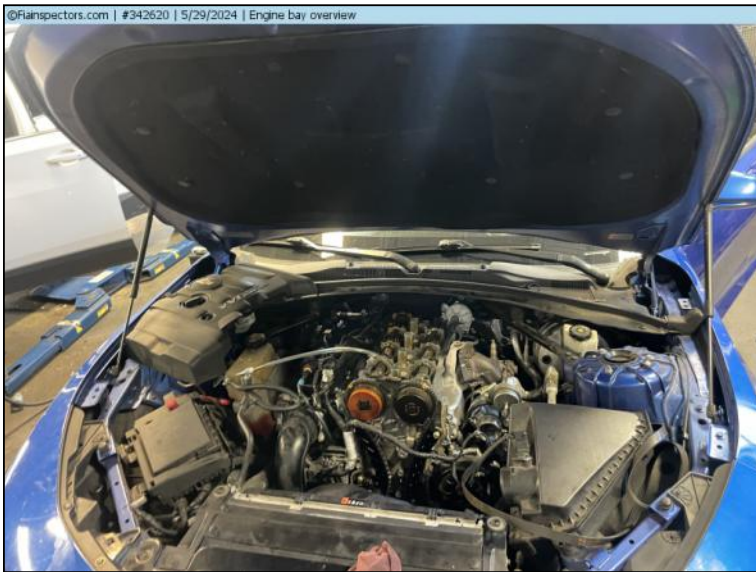


©Flanspectors.com | #342620 | 5/29/2024 | Coolant, drained, ok.



©Flanspectors.com | #342620 | 5/29/2024 | Motor label

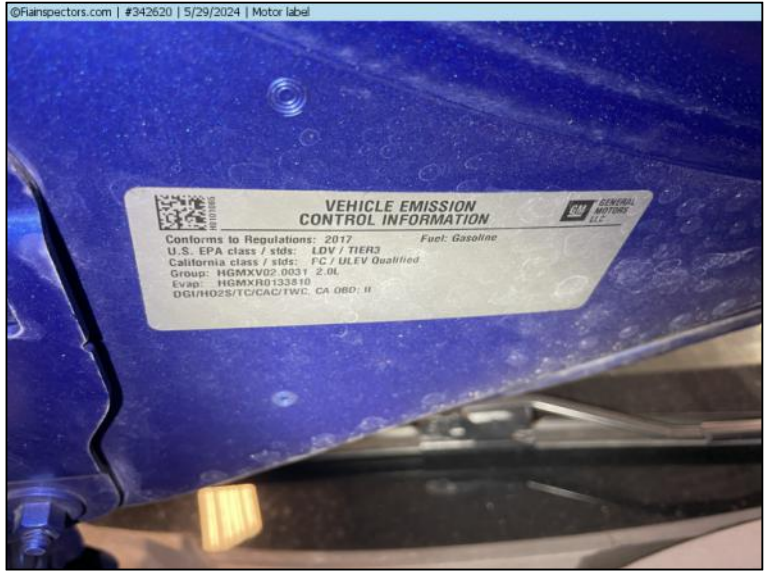


©Flanspectors.com | #342620 | 5/29/2024 | Motor, valve cover and timing cover removed.

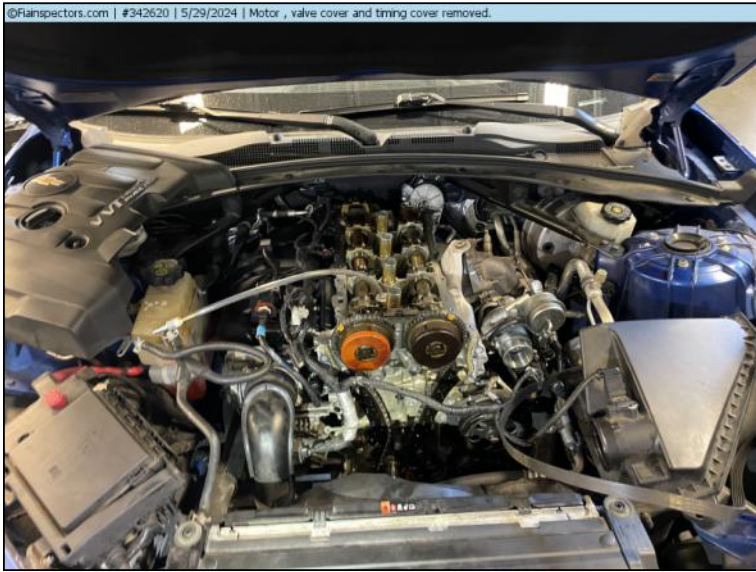


©Flanspectors.com | #342620 | 5/29/2024 | NO visible physical damage visible to the camshafts or timing components




©Flanspectors.com | #342620 | 5/29/2024 | NO visible physical damage visible to the camshafts or timing components

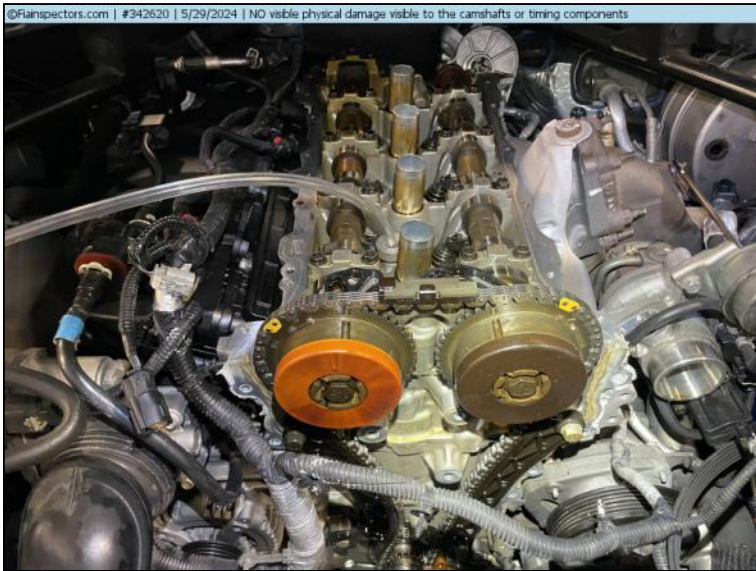

©Flanspectors.com | #342620 | 5/29/2024 | NO visible physical damage visible to the camshafts or timing components

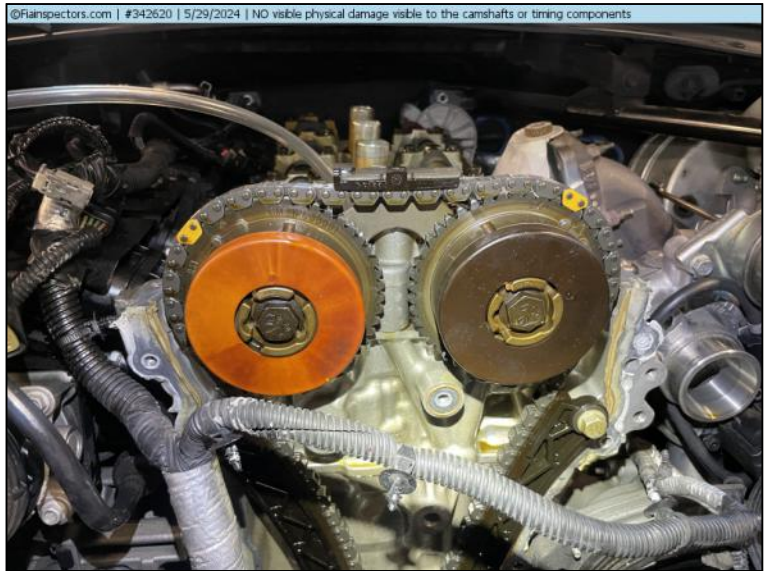

©Flanspectors.com | #342620 | 5/29/2024 | NO visible physical damage visible to the camshafts or timing components

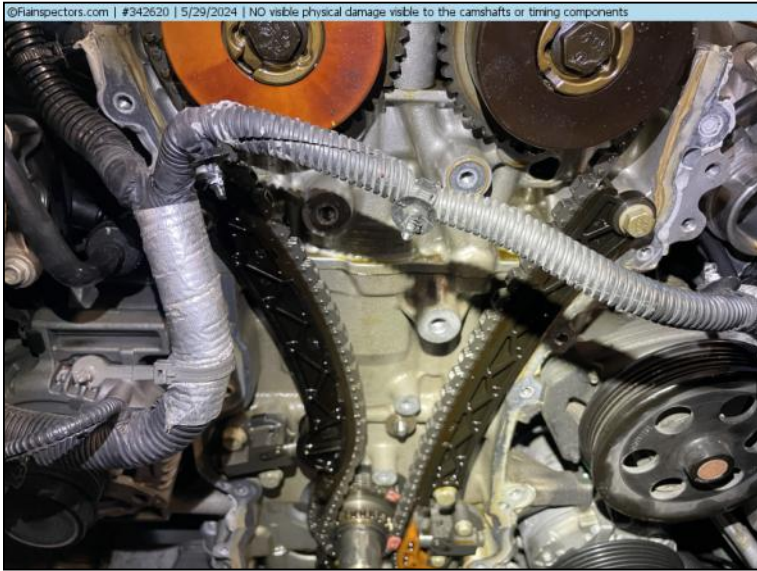


©Flanspectors.com | #342620 | 5/29/2024 | NO visible physical damage visible to the camshafts or timing components




©Flanspectors.com | #342620 | 5/29/2024 | NO visible physical damage visible to the camshafts or timing components




©Flanspectors.com | #342620 | 5/29/2024 | NO visible physical damage visible to the camshafts or timing components

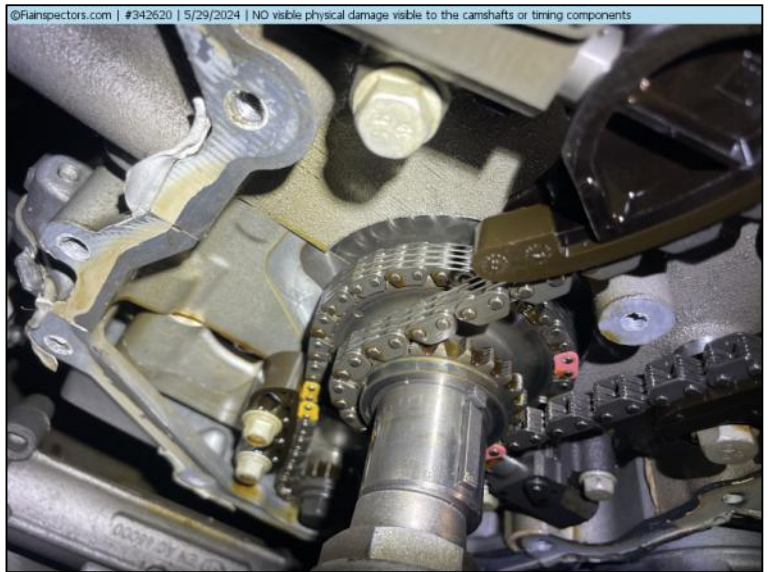


©Flanspectors.com | #342620 | 5/29/2024 | NO visible physical damage visible to the camshafts or timing components

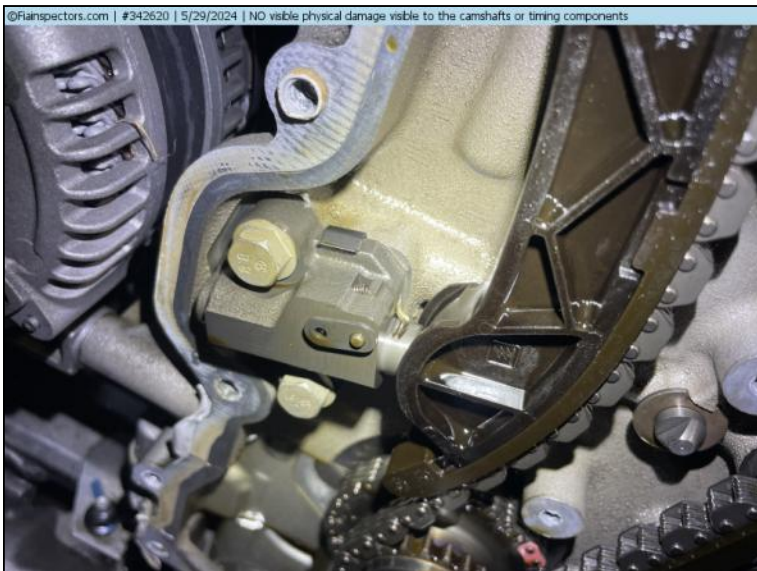

©Flanspectors.com | #342620 | 5/29/2024 | NO visible physical damage visible to the camshafts or timing components

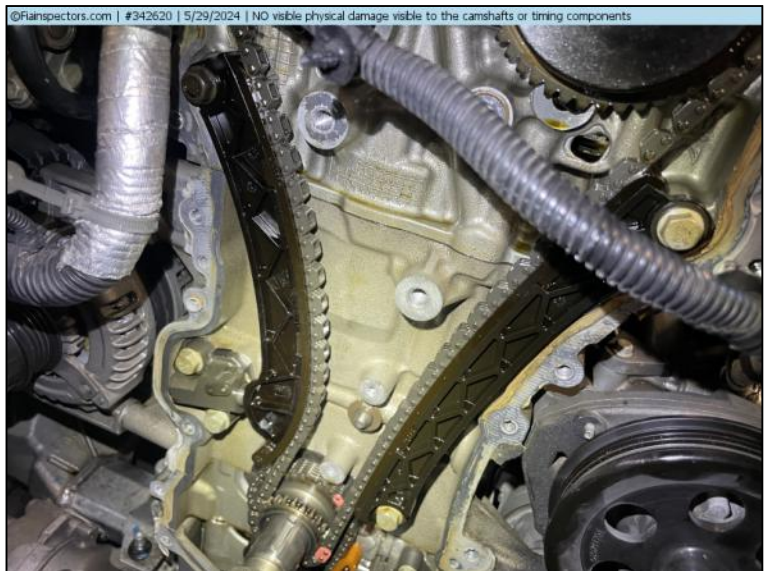


©Flanspectors.com | #342620 | 5/29/2024 | Interior overview

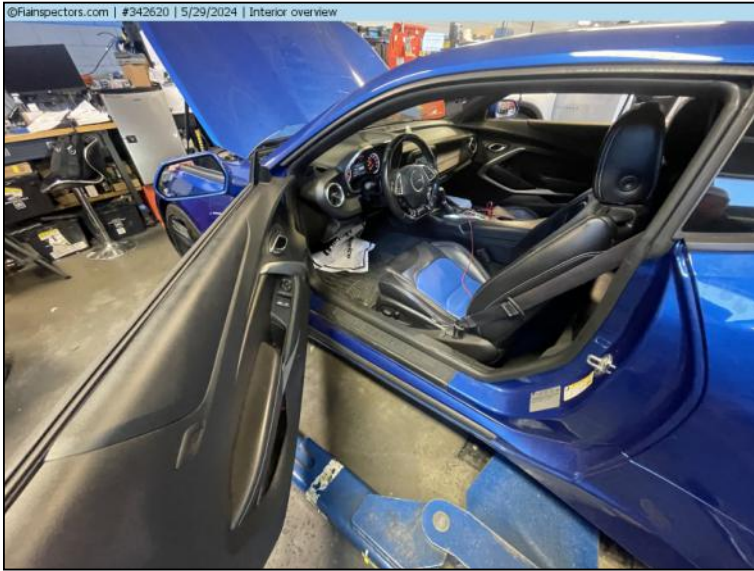


©Flanspectors.com | #342620 | 5/29/2024 | Interior overview



©Flanspectors.com | #342620 | 5/29/2024 | Tire label

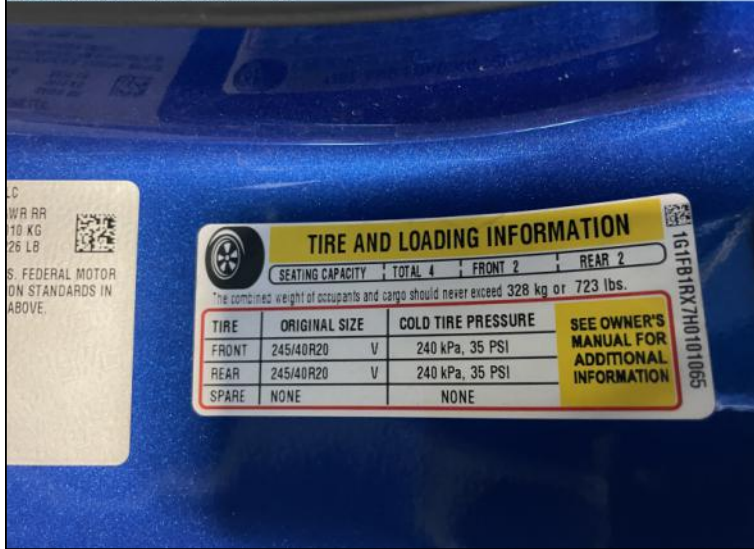

©Flanspectors.com | #342620 | 5/29/2024 | Vin label

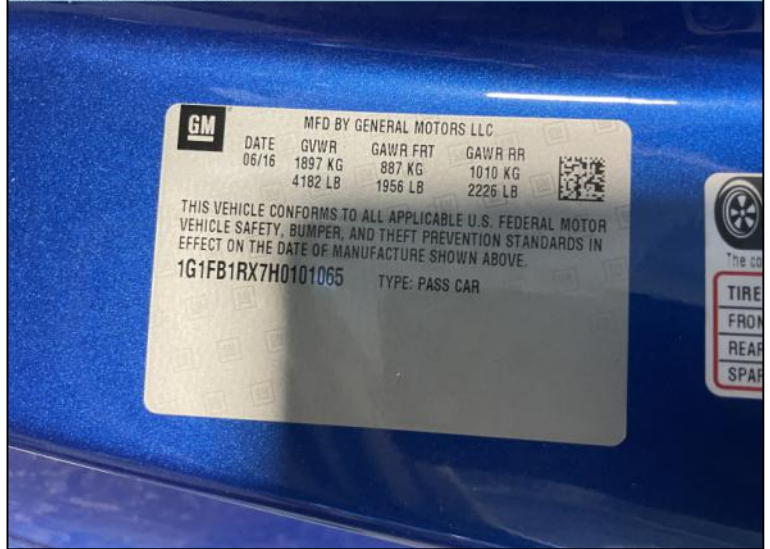


©Flanspectors.com | #342620 | 5/29/2024 | Mileage



©Flanspectors.com | #342620 | 5/29/2024 | Service sticker



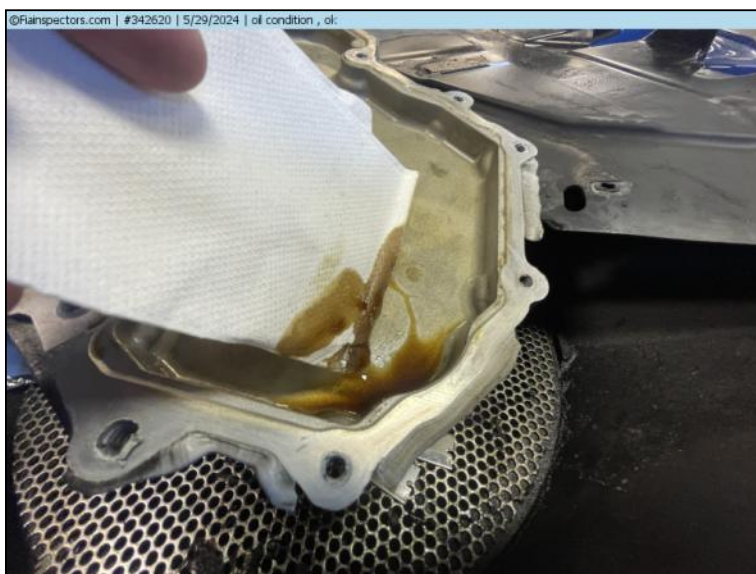

©Flanspectors.com | #342620 | 5/29/2024 | Code scan. all codes appear to be due to disassembly

Automatic Scan

Module	Code	Description	Status
Engine Control Module(ECM)	P0010-00	Intake Camshaft Position Actuator Solenoid Valve Control Circuit	Current
Engine Control Module(ECM)	P0013-00	Exhaust Camshaft Position Actuator Solenoid Valve Control Circuit	Current
Engine Control Module(ECM)	P2089-00	Intake Camshaft Position Actuator Solenoid Valve Control Circuit High Voltage	Current
Engine Control Module(ECM)	P2091-00	Exhaust Camshaft Position Actuator Solenoid Valve Control Circuit High Voltage	Current
Electronic Brake Control Module(EBCM)	C0040-18	Right Front Wheel Speed Sensor Circuit - Low Signal Amplitude	Current

©Flanspectors.com | #342620 | 5/29/2024 | Code scan. all codes appear to be due to disassembly

Automatic Scan

Module	Code	Description	Status
Engine Control Module(ECM)	P0010-00	Intake Camshaft Position Actuator Solenoid Valve Control Circuit	Current
Engine Control Module(ECM)	P0013-00	Exhaust Camshaft Position Actuator Solenoid Valve Control Circuit	Current
Engine Control Module(ECM)	P2089-00	Intake Camshaft Position Actuator Solenoid Valve Control Circuit High Voltage	Current
Engine Control Module(ECM)	P2091-00	Exhaust Camshaft Position Actuator Solenoid Valve Control Circuit High Voltage	Current
Electronic Brake Control Module(EBCM)	C0040-18	Right Front Wheel Speed Sensor Circuit - Low Signal Amplitude	Current
Body Control Module(BCM)	B3109-00	Keyless Entry Transmitter 1 Battery	Current

[illegible]

©Ranspectors.com | #342620 | 5/29/2024 | sign sheet.