

# Florida Inspection Associates Nationwide

vehicle  
report #342620

PO Box 1308 Largo, FL 33779  
ph: 727-588-0331 fax: 727-588-0580

Adjuster :

**Warranty Company** : GEICO

**Repair Shop** : Chevrolet of Wesley Chapel  
26922 Wesley Chapel Blvd  
Wesley Chapel, FL 33544-8409

**Phone Number** : (813) 279-7573

**Contact** : D 1 913 270 7573

**Claim Number** : 0620373550101048

**Contract Number** :

**Insured** : Nilamben Patel

**Vehicle** : 2017 CHEV CAMARO

**Inspection Requested** : 5/28/2024

**Inspector Name** : Ben S

**Inspection occurred** : 5-29-2024 ; 10:20 AM

**Complete VIN** : 1G1FB1RX7H0101065

**Current Mileage** : 67,686

**Tag** : ITY B20 Tag State: FL

**Engine Oil** : Drained ; Fair

**Trans Fluid** : N/A ; N/A

**Coolant** : Drained ; Fair

**Power steering** : Electric ; N/A

**Brake fluid** : Full ; Fair

**Modifications** : None, 245/40R20

**Commercial Use** : No

**Impact damage** : No

**RO Number** : 99843 Dated : 05-20-2024

**Customer Complaint** : Guest states tapping noise from engine when in gear since last oil change.

**Labor rate is** 220.00.

**Driven**

**Eng Size** : 2.0

**Trans Type** : AUTO RearWD

**Overall Cond of Vehicle** : Fair

**Trailer Hitch** : No

**Related Service history** : Not Available

**Inspectors Report** : Yes, the valve cover and front timing cover were removed.

I met with the tech. He reported a noise from the motor that would stop when the Intake VVT phaser control valve connector was unplugged. He has already removed the valve cover and timing cover to inspect for damage to the camshafts and timing chain components. He found NO damage to the camshafts, timing chain, timing chain tensioner, or guides. The tech reported that the intake VVT phaser has an internal failure and is the source of the noise. All other sources of noise in the front of the motor have been excluded. The motor oil was drained but the condition of the pooled oil on the front timing cover was good, no slugging or lubrication concerns were found.

Shop's notes:

No further failures noted.

**Shop's opinion of cause** : Failed VVT phasers

**Inspector's opinion of cause:** Suspected internal failure of the intake VVT phaser due to normal long-term use and wear.

**Corrective Action Needed** : Replace the intake VVT phaser and retest for noise.

**Were Pix Taken?** : Photos on Website

**Shop Agree Sign Report?** : Yes RJ Yensco

**FIA Base Fee** : \$120.00

**Fuel Surcharge** : \$0.00

**FIA Special Charges** :

**Typed:** Admin 5/30/2024

**FIA Total Fee** : **\$120.00**

**FIA's TAX ID #59-3350686**



FLORIDA INSPECTION ASSOCIATES, INC., SHOULD IT BECOME NECESSARY, RESERVES THE RIGHT TO REVIEW INFORMATION THAT MAY BECOME AVAILABLE, AS WELL AS ANY ADDITIONAL EVIDENCE OR RELATED INFORMATION, AND THE RIGHT TO AMEND THIS INSPECTION REPORT AND ITS FINDINGS.

©Fiainspectors.com | #342620 | 5/29/2024 | Parts est

©Fiainspectors.com | #342620 | 5/29/2024 | Parts est


©Fiainspectors.com | #342620 | 5/29/2024 | Parts est

©Fiainspectors.com | #342620 | 5/29/2024 | Exterior overview

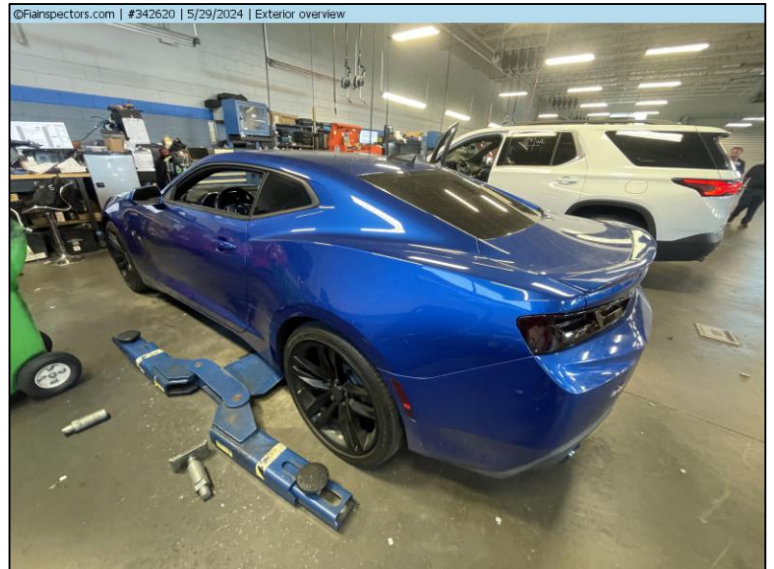





©Flainspectors.com | #342620 | 5/29/2024 | Exterior overview

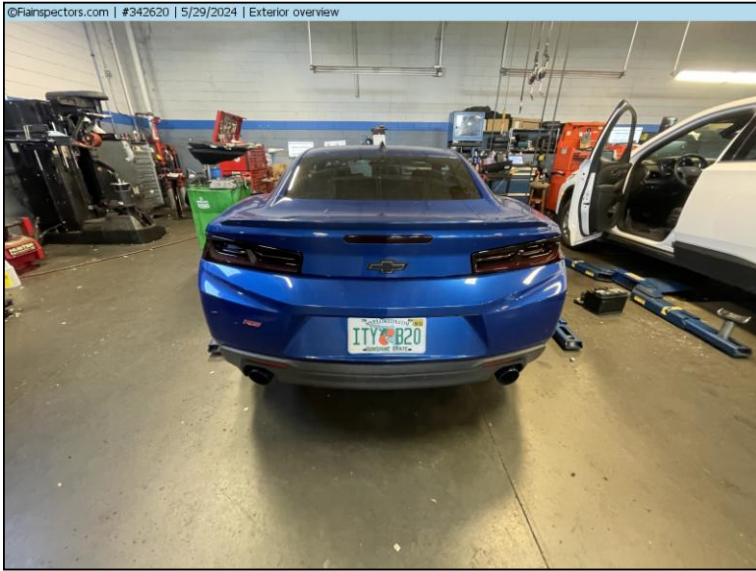


©Flainspectors.com | #342620 | 5/29/2024 | Tag

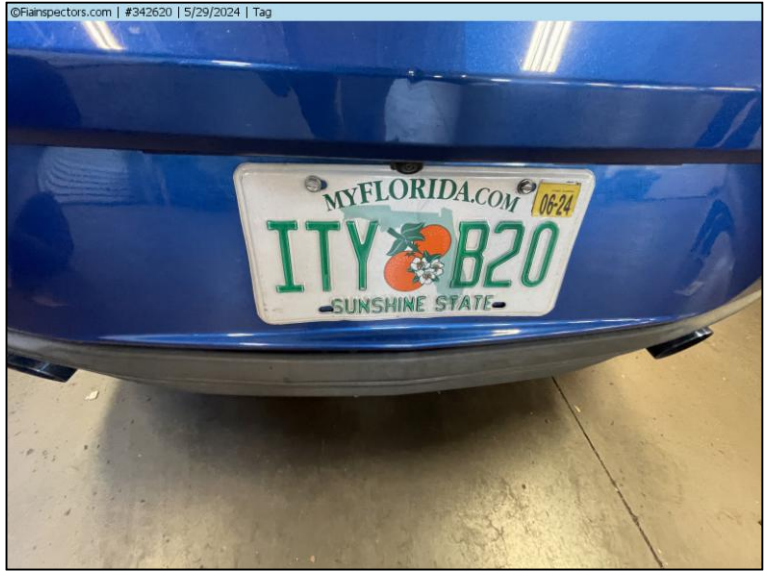

©Flainspectors.com | #342620 | 5/29/2024 | Exterior overview

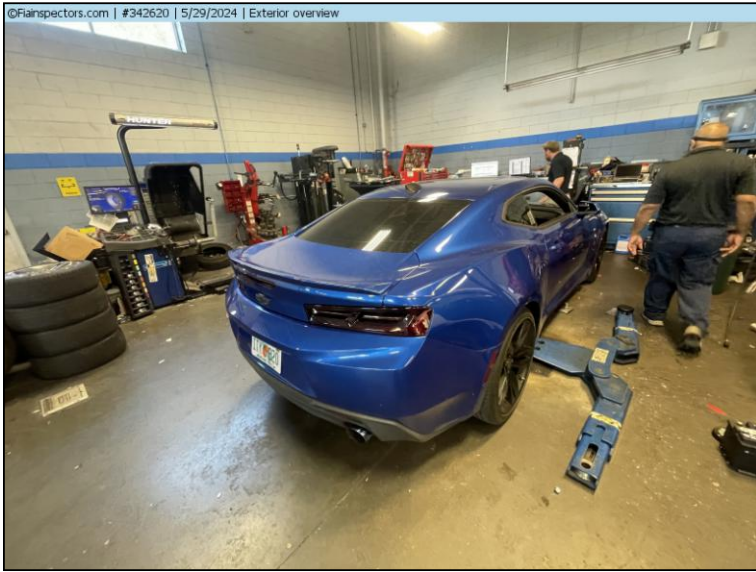

©Flainspectors.com | #342620 | 5/29/2024 | Exterior overview

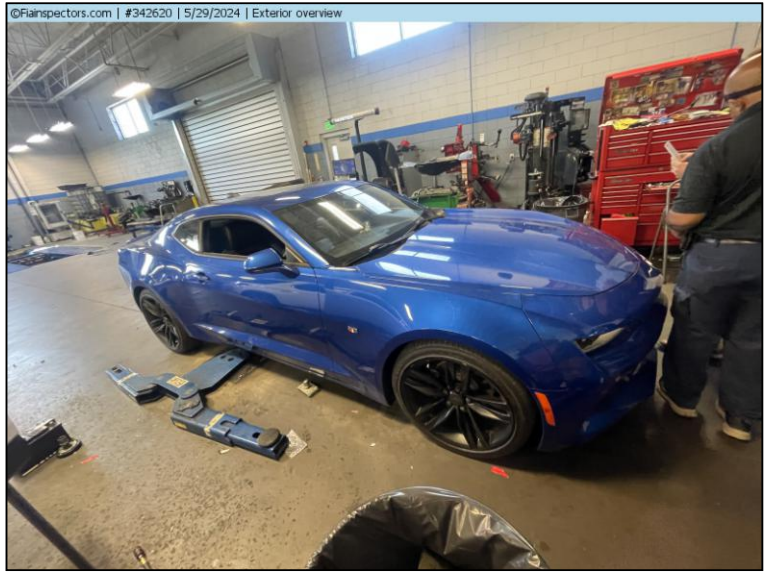

©Flainspectors.com | #342620 | 5/29/2024 | LF



©Flainspectors.com | #342620 | 5/29/2024 | LR







©Flainspectors.com | #342620 | 5/29/2024 | RR



©Flainspectors.com | #342620 | 5/29/2024 | RF

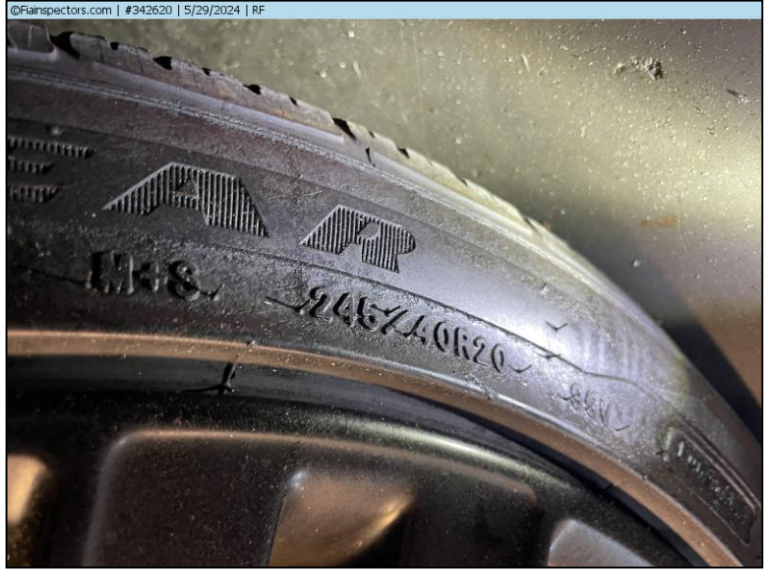

©Flainspectors.com | #342620 | 5/29/2024 | Engine bay overview

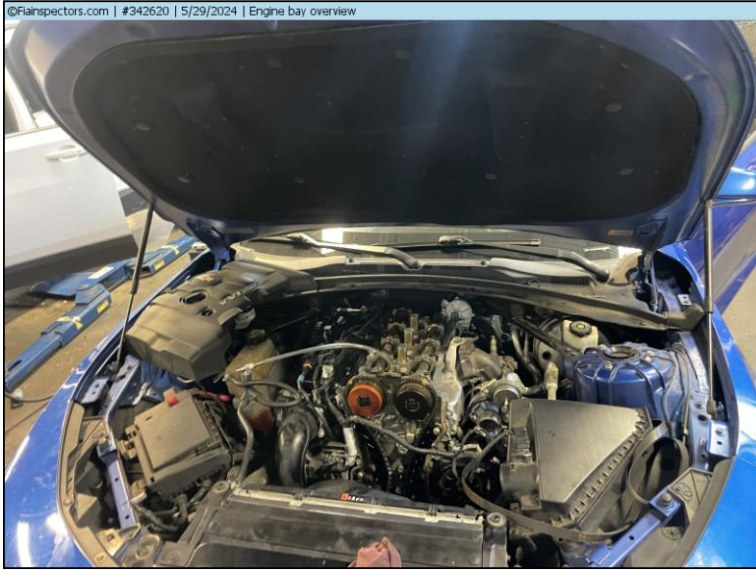


©Flainspectors.com | #342620 | 5/29/2024 | Brake fluid, full, ok



©Flainspectors.com | #342620 | 5/29/2024 | Belt, ok



©Flainspectors.com | #342620 | 5/29/2024 | hoses, ok

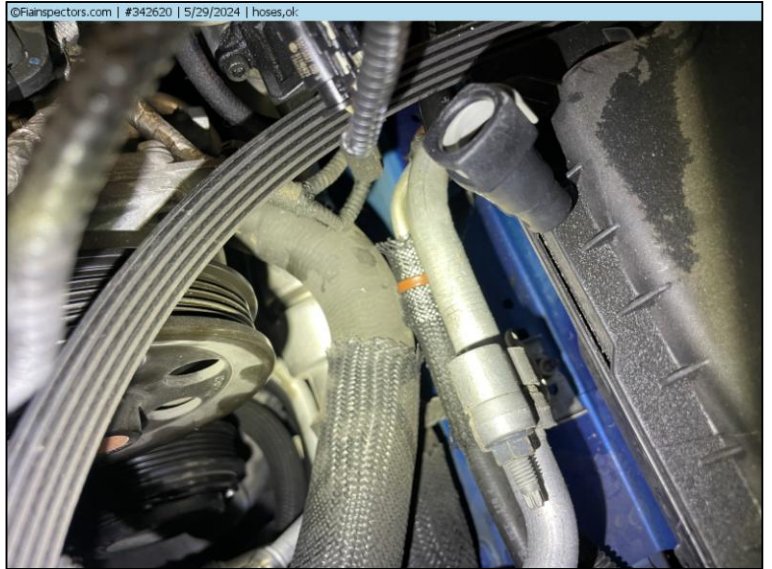





©Flanspectors.com | #342620 | 5/29/2024 | Coolant, drained ,ok:




©Flanspectors.com | #342620 | 5/29/2024 | Motor label

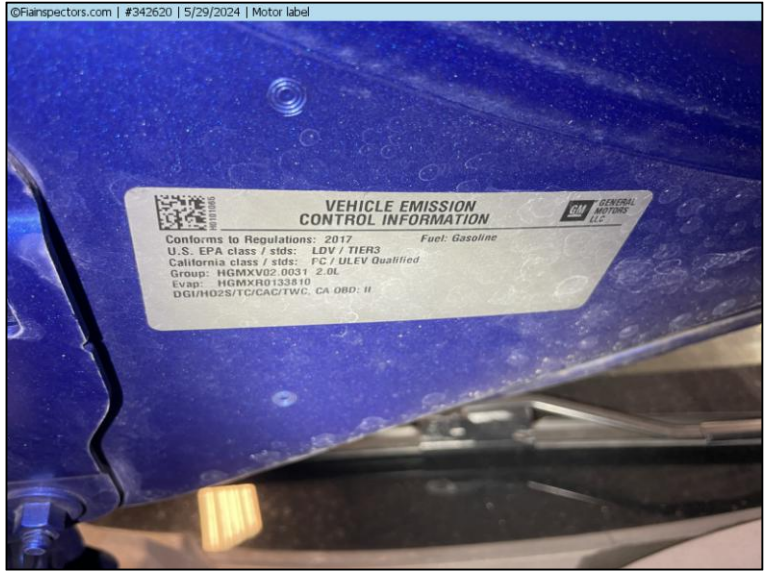


©Flanspectors.com | #342620 | 5/29/2024 | Motor , valve cover and timing cover removed.

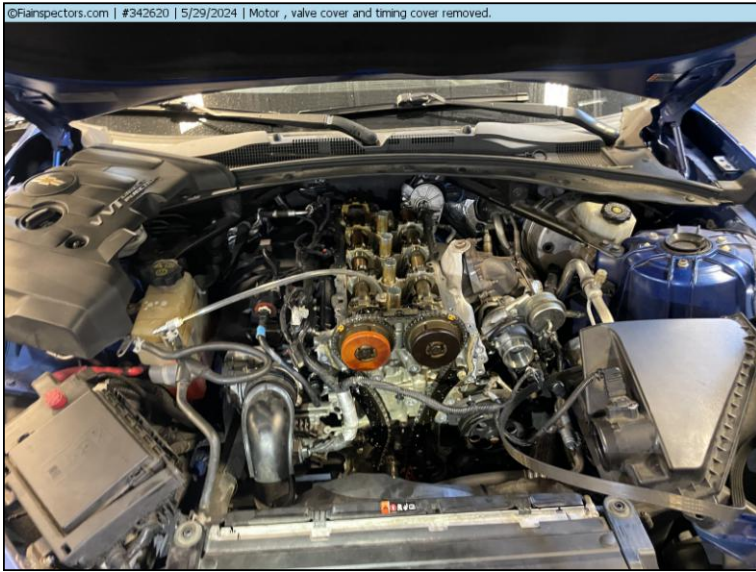


©Flanspectors.com | #342620 | 5/29/2024 | NO visible physical damage visible to the camshafts or timing components

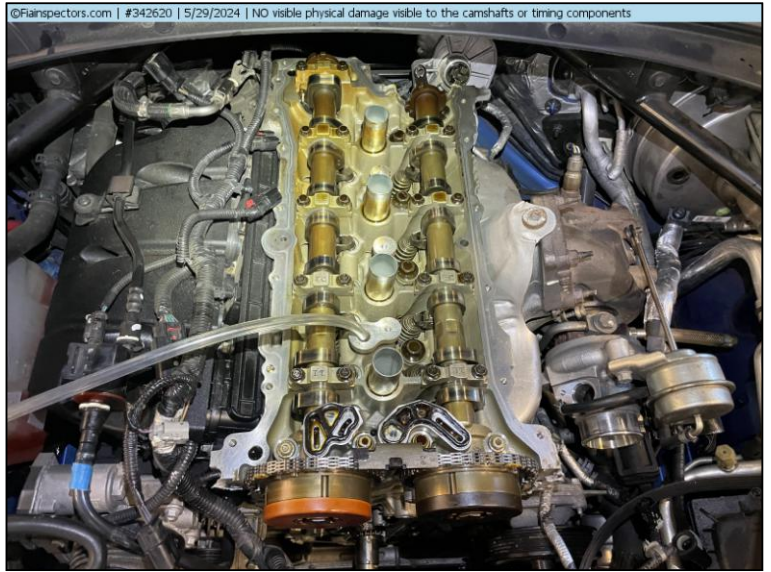

©Flanspectors.com | #342620 | 5/29/2024 | NO visible physical damage visible to the camshafts or timing components

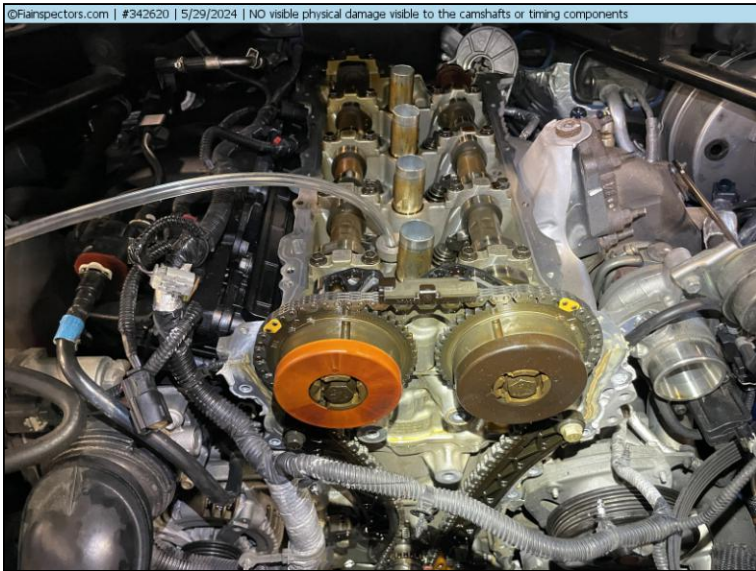


©Flanspectors.com | #342620 | 5/29/2024 | NO visible physical damage visible to the camshafts or timing components

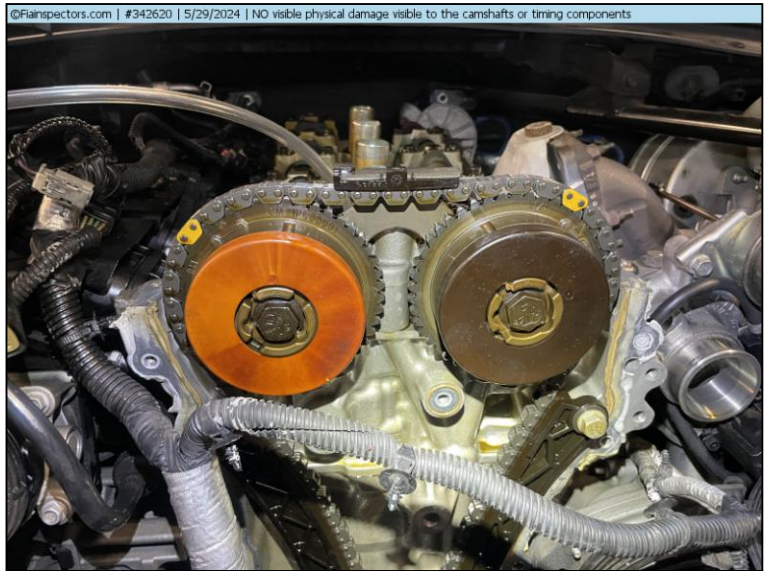




©Flanspectors.com | #342620 | 5/29/2024 | NO visible physical damage visible to the camshafts or timing components

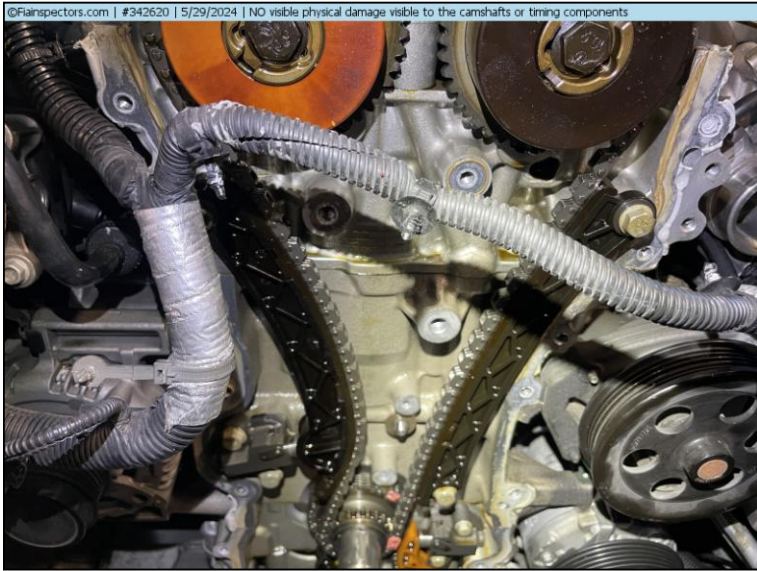


©Flanspectors.com | #342620 | 5/29/2024 | NO visible physical damage visible to the camshafts or timing components




©Flanspectors.com | #342620 | 5/29/2024 | NO visible physical damage visible to the camshafts or timing components

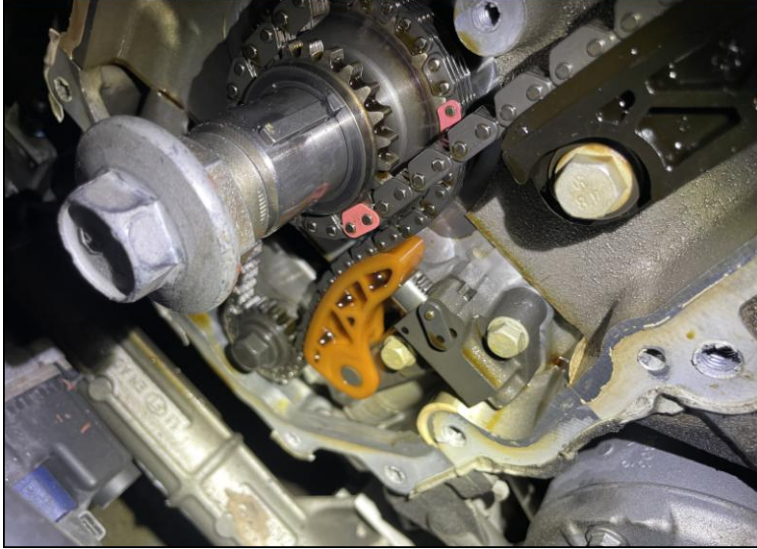


©Flanspectors.com | #342620 | 5/29/2024 | NO visible physical damage visible to the camshafts or timing components

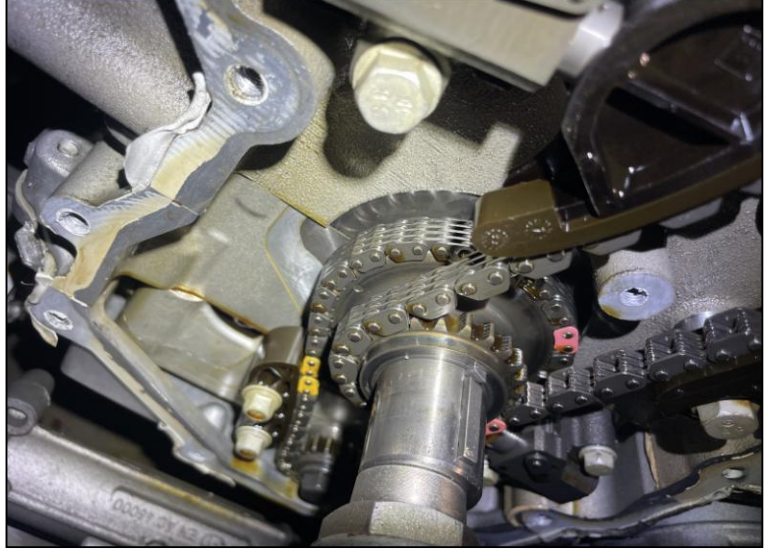

©Flanspectors.com | #342620 | 5/29/2024 | NO visible physical damage visible to the camshafts or timing components

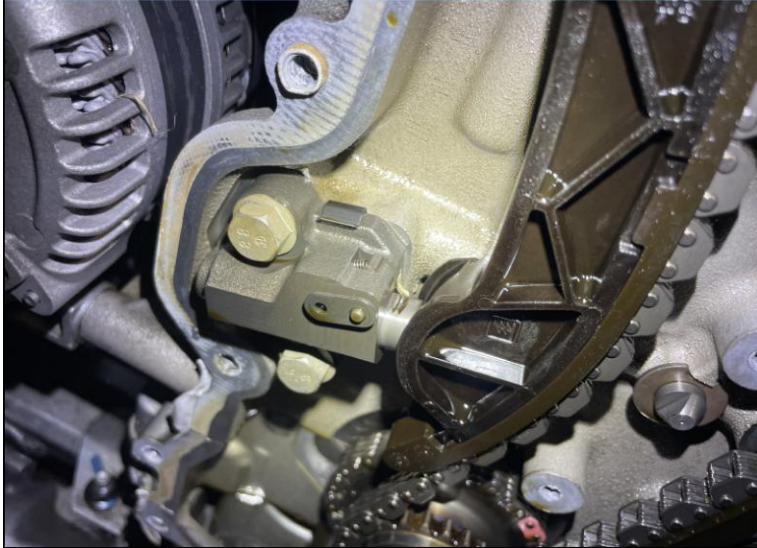


©Flanspectors.com | #342620 | 5/29/2024 | NO visible physical damage visible to the camshafts or timing components

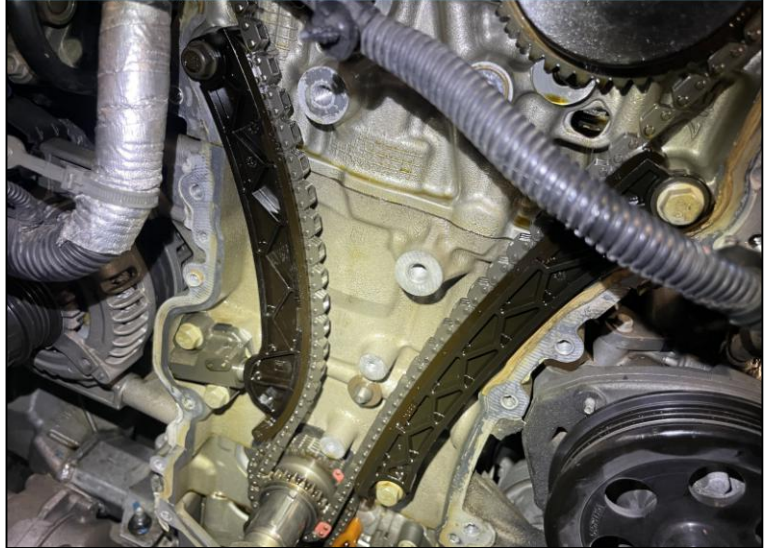




©Flainspectors.com | #342620 | 5/29/2024 | Interior overview

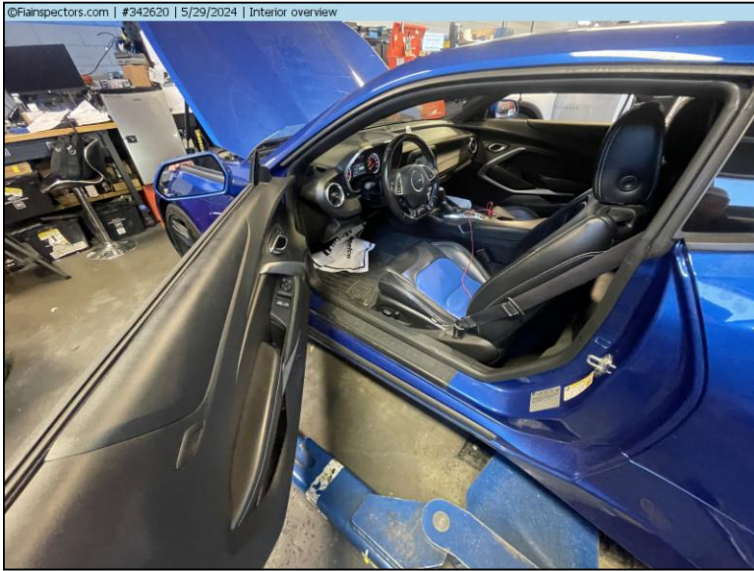


©Flainspectors.com | #342620 | 5/29/2024 | Interior overview



©Flainspectors.com | #342620 | 5/29/2024 | Tire label

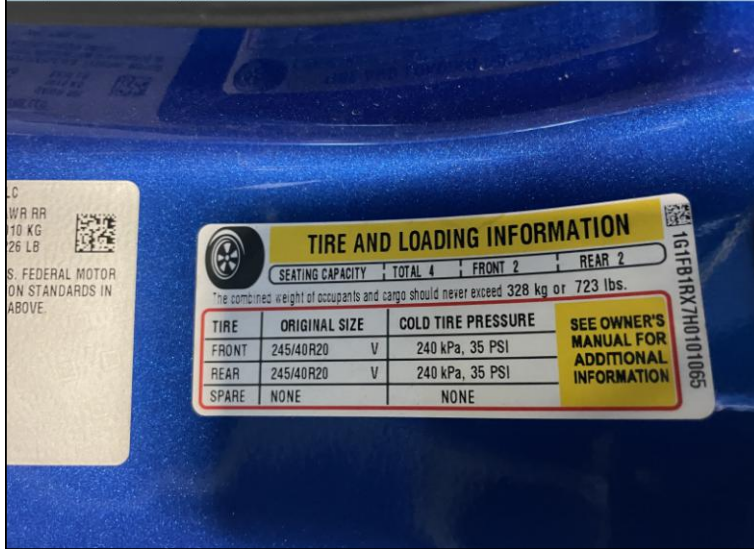


©Flainspectors.com | #342620 | 5/29/2024 | Vin label

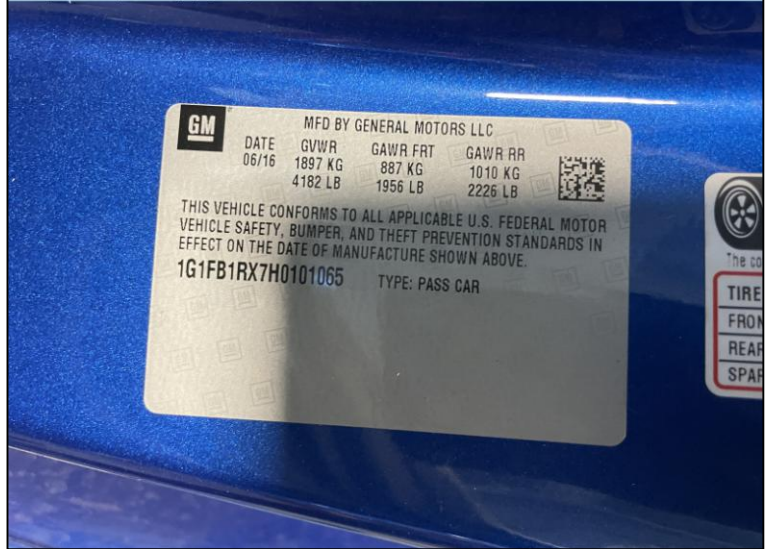



©Flainspectors.com | #342620 | 5/29/2024 | Mileage



©Flainspectors.com | #342620 | 5/29/2024 | Service sticker

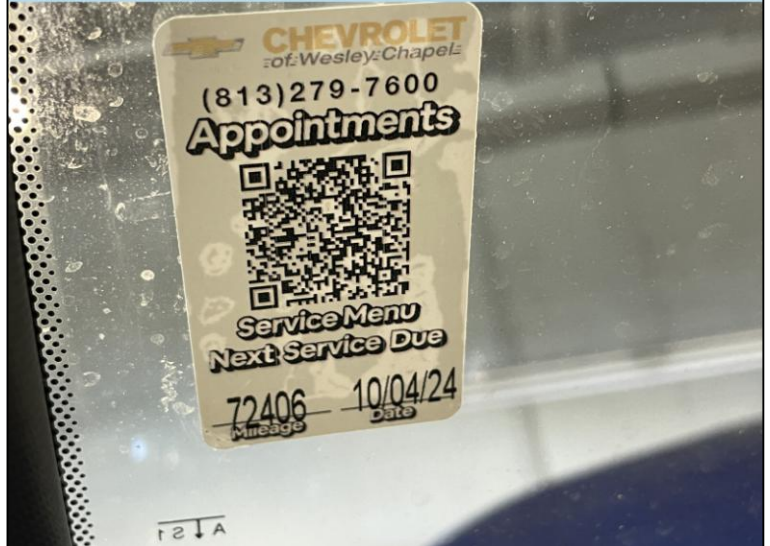



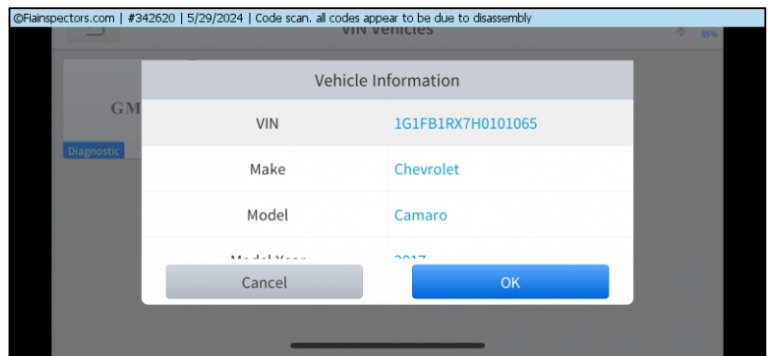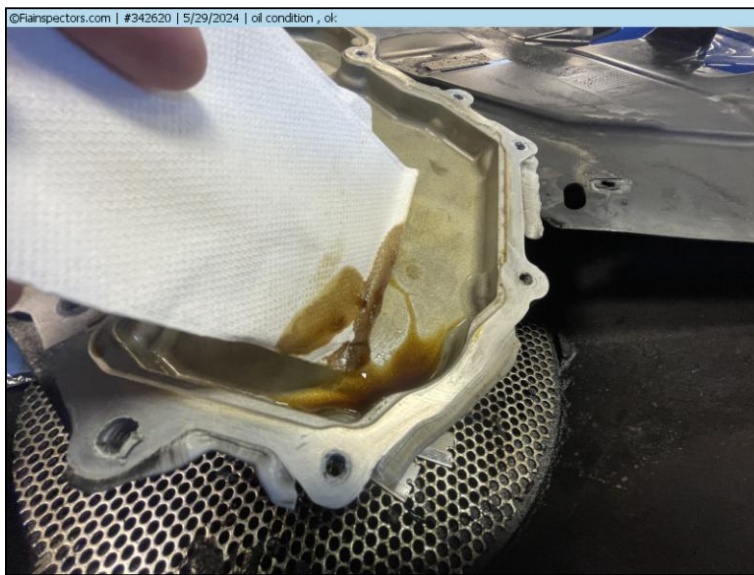

©Flainspectors.com | #342620 | 5/29/2024 | Code scan. all codes appear to be due to disassembly

Automatic Scan

| Module                                | Code     | Description                                                                    | Status  |
|---------------------------------------|----------|--------------------------------------------------------------------------------|---------|
| Engine Control Module(ECM)            | P0010-00 | Intake Camshaft Position Actuator Solenoid Valve Control Circuit               | Current |
| Engine Control Module(ECM)            | P0013-00 | Exhaust Camshaft Position Actuator Solenoid Valve Control Circuit              | Current |
| Engine Control Module(ECM)            | P2089-00 | Intake Camshaft Position Actuator Solenoid Valve Control Circuit High Voltage  | Current |
| Engine Control Module(ECM)            | P2091-00 | Exhaust Camshaft Position Actuator Solenoid Valve Control Circuit High Voltage | Current |
| Electronic Brake Control Module(EBCM) | C0040-18 | Right Front Wheel Speed Sensor Circuit - Low Signal Amplitude                  | Current |

©Flainspectors.com | #342620 | 5/29/2024 | Code scan. all codes appear to be due to disassembly

Automatic Scan

| Module                                | Code     | Description                                                                    | Status  |
|---------------------------------------|----------|--------------------------------------------------------------------------------|---------|
| GM V13.90                             |          |                                                                                |         |
| Engine Control Module(ECM)            |          | Solenoid Valve Control Circuit                                                 |         |
| Engine Control Module(ECM)            | P0013-00 | Exhaust Camshaft Position Actuator Solenoid Valve Control Circuit              | Current |
| Engine Control Module(ECM)            | P2089-00 | Intake Camshaft Position Actuator Solenoid Valve Control Circuit High Voltage  | Current |
| Engine Control Module(ECM)            | P2091-00 | Exhaust Camshaft Position Actuator Solenoid Valve Control Circuit High Voltage | Current |
| Electronic Brake Control Module(EBCM) | C0040-18 | Right Front Wheel Speed Sensor Circuit - Low Signal Amplitude                  | Current |
| Body Control Module(BCM)              | B3109-00 | Keyless Entry Transmitter 1 Battery                                            | Current |



Flanspectors.com | #342620 | 5/29/2024 | Repair order

©Flanspers.com | 5/29/2024 | sign sheet.

# PRE-EMPLOYMENT INVESTIGATIONS (signatures)

10/1/2024

7342620

Report Sheet: Chevrolet of Wesley Chapel

Investor: Williamson Paul

County Number: 0620373550101648

Contract Number:

State of Purchase: ☐ Fully Remote - 1st, New York

Timing: *Timing Change and Sales Change*

Inspector Report:

*Interviewed Timmy Clark, 400 Willie Day, Jr. Blvd, SE, Atlanta, GA 30316*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

*Interviewed VUT Police, 1500 Peachtree St. NE, Atlanta, GA 30309*

©Flanspers.com | 5/29/2024 | sign sheet.