



ROB 2040 and ROB 2140

FactoryTalk View Studio Machine Edition Procedures

IMPORTANT - IMPORTANT - IMPORTANT - IMPORTANT

See the procedures in [Appendix C](#) which apply when working with a **different FactoryTalk application** when:

- working with a **different FactoryTalk application** in the same session at the computer.
 - returning to the computer at a later date.
-

SECTIONS

CREATING A SHORTCUT	1
SHORTCUT ASSIGNMENT FOR OFFLINE TAG FILE FOR DEVELOPMENT.....	3
SHORTCUT ASSIGNMENT FOR DESIGN FOR TESTING	5
SHORTCUT ASSIGNMENT FOR RUNTIME.....	8
TESTING APPLICATION IN DESIGN.....	10
CREATE RUNTIME APPLICATION.....	11
Appendix A: DISPLAY TAG BROWSER FOR GRAPHIC OBJECT	13
Appendix B: STATION RUNTIME APPLICATION.....	15
Appendix C: OPENING PREVIOUSLY CREATED HMI.....	18


CREATING A SHORTCUT

Prior to Shortcut setup:



Studio 5000 program has been created and saved.


In the Explorer panel, expand **FactoryTalk Linx** and select **Communications Setup**.

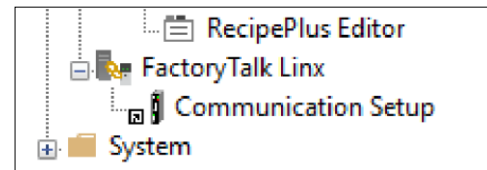


The RSLinx Enterprise Configuration Wizard will appear.

Select **Create a new configuration**.



Select the **Finish** button.

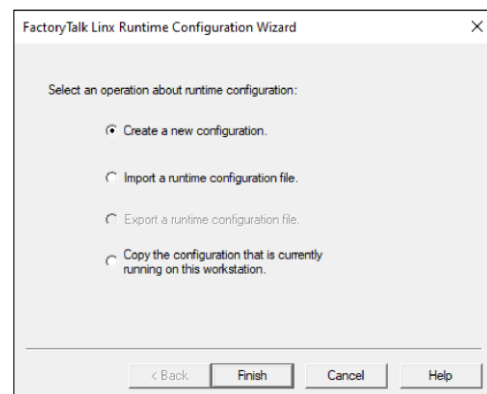

The Communications Setup panel will appear.

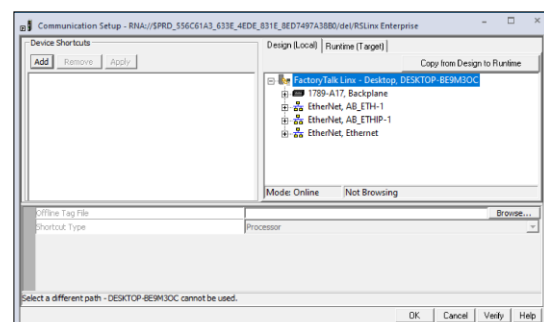


Select the **Add** button.

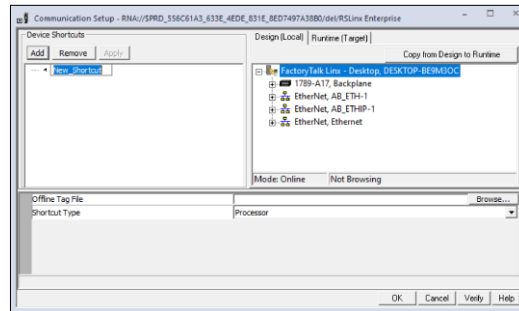


Type in a name for the New Shortcut.

Example: SS3

*If defined in the assignment
use that Shortcut name.*

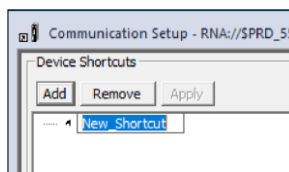

Press **Enter**.

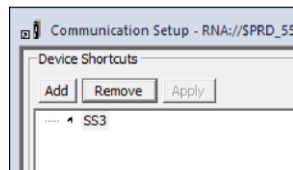

See: [SHORTCUT ASSIGNMENT FOR OFFLINE TAG FILE FOR DEVELOPMENT](#)

[Return to Table of Contents](#)

SHORTCUT ASSIGNMENT FOR OFFLINE TAG FILE FOR DEVELOPMENT


Prior to setup:




Studio 5000 program has been created and saved.

If **Communications Setup** is not open.



In the Explorer panel, expand **FactoryTalk Linx** and select **Communications Setup**.

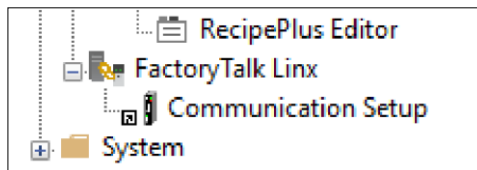

In the **Device Shortcut** panel, left click on the named Shortcut.


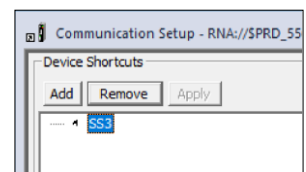


Select the **Browse** button, located on the right side of the lower panel.

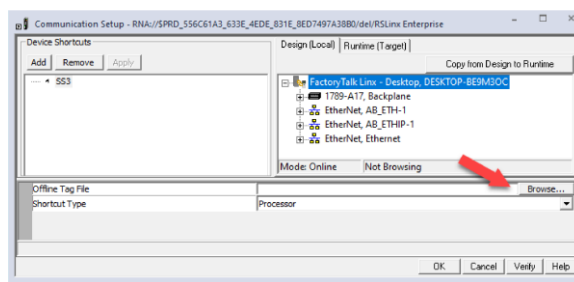


Navigate to the folder where the Studio 5000 program has been saved.

Select the Studio 5000 program and select the **Open** button.

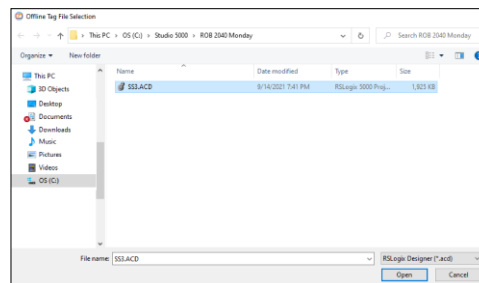

The offline file location will be listed.





In the Communications Setup Device Shortcuts panel, top-left, select the **Apply** button.




A confirmation dialog will appear.

Select the **Yes** button.

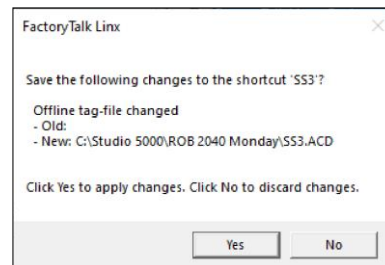



Select the **Verify** button at lower right.




In the Shortcut Verifier dialog, check for message:
'Offline tag file successfully imported.'

Select the **Close** button.

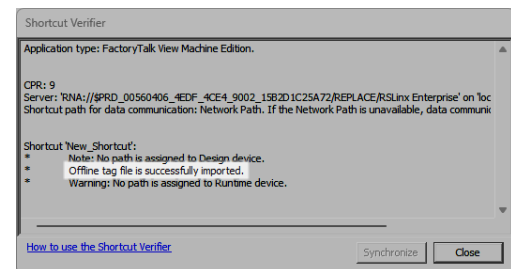

In the Communications Setup panel, select the **OK** button.



The offline processor program file can now be accessed to assign tags to the graphical Objects in the HMI project.

To assign Tags, See: [Appendix A: DISPLAY TAG BROWSER FOR GRAPHIC OBJECT](#)

[Return to Table of Contents](#)

SHORTCUT ASSIGNMENT FOR DESIGN FOR TESTING


Prior to setup:




Studio 5000 Emulate has been started.
Studio 5000 program Communication Path has been set.
Studio 5000 program has been downloaded.

If **Communications Setup** is not opened.


In the Explorer panel, expand
FactoryTalk Linx and select
Communications Setup.

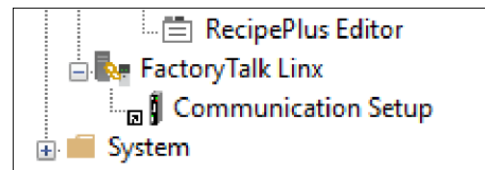

In the **Device Shortcut** panel, left click on the named Shortcut.

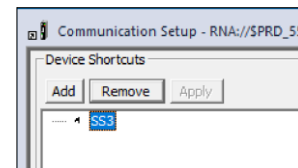


In the Design/Runtime panel, expand the
1789-A17, Backplane.

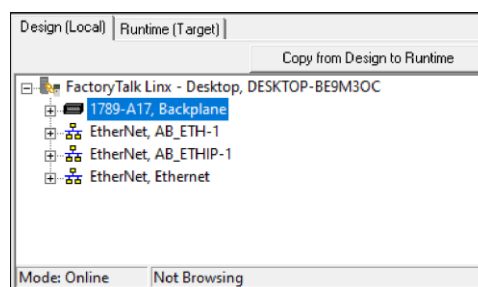

If the expanded Backplane is blank - OR - **does not list the processor**.

Right click on the **1789-A17, Backplane**
and then select **Start Browsing**.


The processor should then appear.

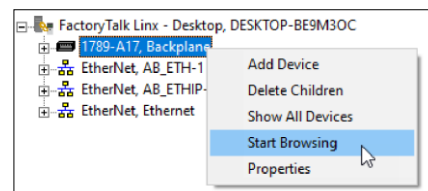


Select the processor in slot 2.

Note: The processor's name may be different.


Select the item with the processor icon.

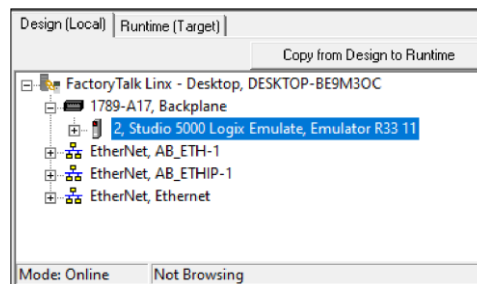

Check that the processor is selected.


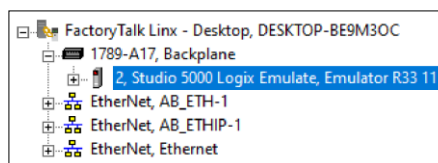


In the Communications Setup Device Shortcuts panel, top -left, select the **Apply** button.



A confirmation dialog will appear.

Select the **Yes** button.

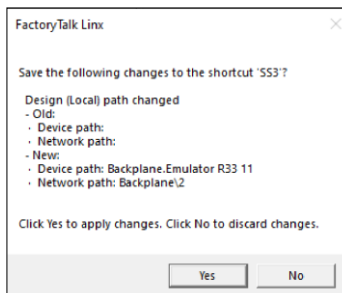


Select the **Verify** button at lower right.




In the Shortcut Verifier dialog, check for message:

'Note: Path to Design device [Logix Device].'

Select the **Close** button.



In the Communications Setup panel, select the **OK** button.

A rectangular button with a thin black border and the text "OK" in a sans-serif font.

To test in design, See: [TESTING APPLICATION IN DESIGN](#)

[Return to Table of Contents](#)

SHORTCUT ASSIGNMENT FOR RUNTIME


Prior to setup:



Studio 5000 Emulate has been started
Studio 5000 program Communication Path has been set.
Studio 5000 program has been downloaded.
Design shortcut assignment has been set and tested.


If **Communications Setup** is not opened.

In the Explorer panel, expand **FactoryTalk Linx** and select **Communications Setup**.

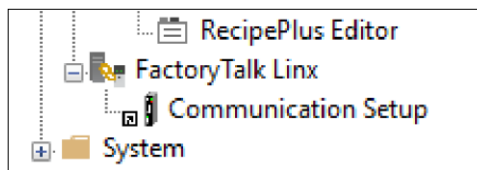



The Communications Setup panel will appear.

Select the **Copy from Design to Runtime** button.

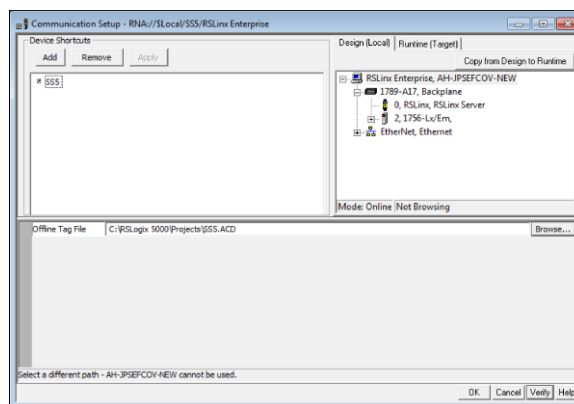

A prompt confirming the copy will appear.

Select the **Yes** button.

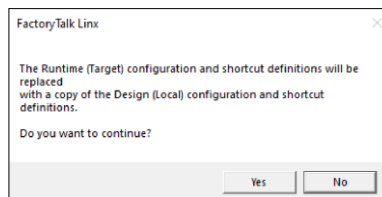



Select the **Verify** button at lower right.




In the Shortcut Verifier dialog, check for message:
'Note: Path to Runtime device [Logix Device].'

Select the **Close** button.

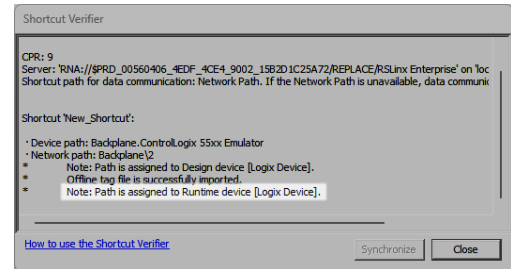

In the Communications Setup panel, select the **OK** button.



See: [CREATE RUNTIME APPLICATION](#)

[Return to Table of Contents](#)


TESTING APPLICATION IN DESIGN

Prior to testing:




Studio 5000 Emulate has been started.
Studio 5000 program Communication Path has been set.
Studio 5000 program has been downloaded.
Studio 5000 is in RUN mode.
FactoryTalk View Studio ME, Design shortcut assignment has been set.

In the Menu Bar select **Application - Test Application**.

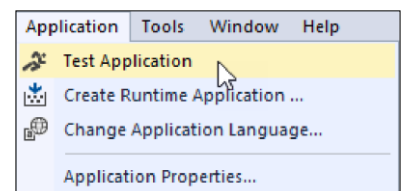

A Progress Bar will appear.

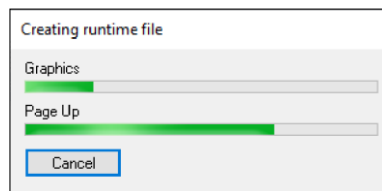


Application HMI will appear for testing.

To shut down the HMI, select the “X” in the upper right corner. “



Shutdown the application when done testing.

DO NOT exit FactoryTalk View Studio ME software while the HMI is running.

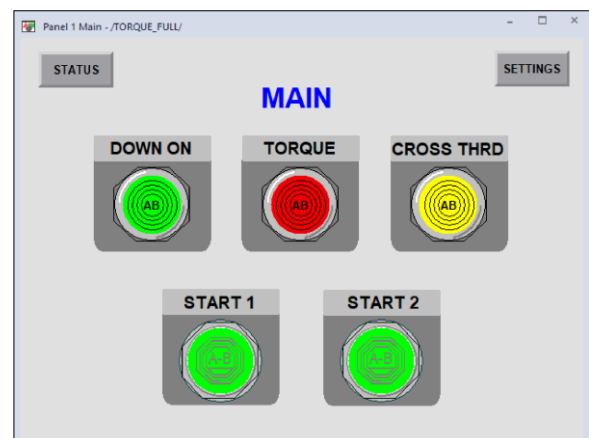

[Return to Table of Contents](#)



CREATE RUNTIME APPLICATION


Prior to creating:



FactoryTalk View Studio ME, Runtime shortcut assignment has been set.

If downloading to Lab HMI, See: Appendix B

On the menu bar select **Application**, then **Create Runtime Application....**


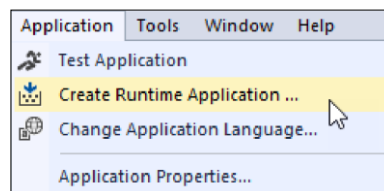


The Create Runtime Application dialog will appear.

Verify **File name:** is correct.


Extension for file is .mer

Select the **Save** button.

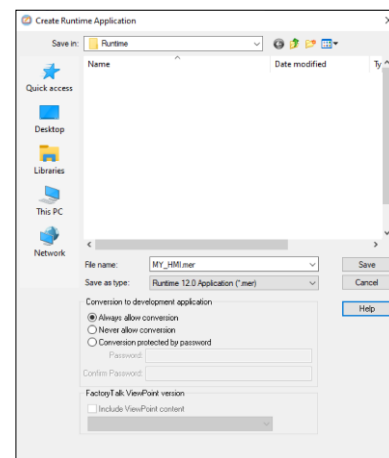


A progress dialog will appear.

See below if there is a problem.

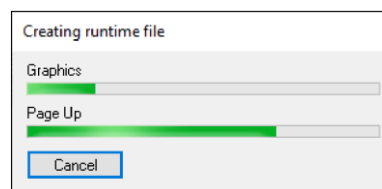


If there is a problem , the Process Output Validation window will appear.

Select the “X” to close.

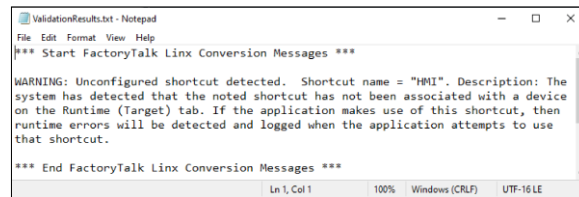

Correct the problem and attempt to create runtime application.

Runtime file is saved in the folder **Runtime** in the path shown below.

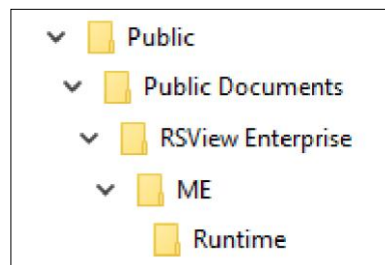


To test Runtime, See: [Appendix B: STATION RUNTIME APPLICATION](#)

[Return to Table of Contents](#)


Appendix A: DISPLAY TAG BROWSER FOR GRAPHIC OBJECT

When defining the first tag connection, the named shortcut folder may not be listed in the browser.

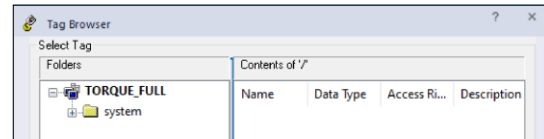


Select **Refresh All Folders** button.

Refresh All Folders

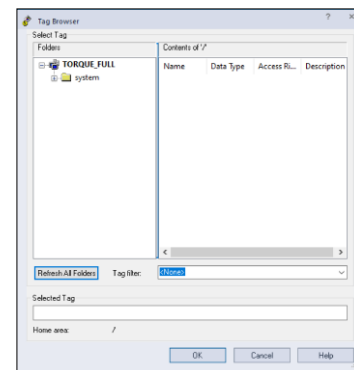


The named shortcut folder is listed.

*In this example, **HMI** is the Shortcut name.*

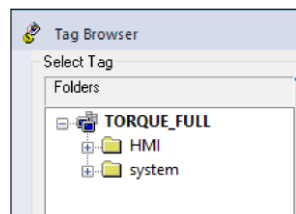


Expand the named **Shortcut** folder.

Expand the **Offline** folder.

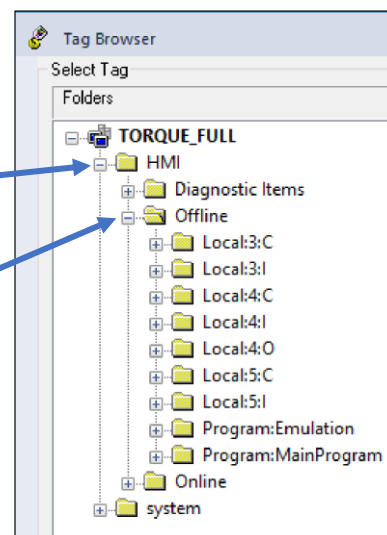


When the **Offline** folder is selected...

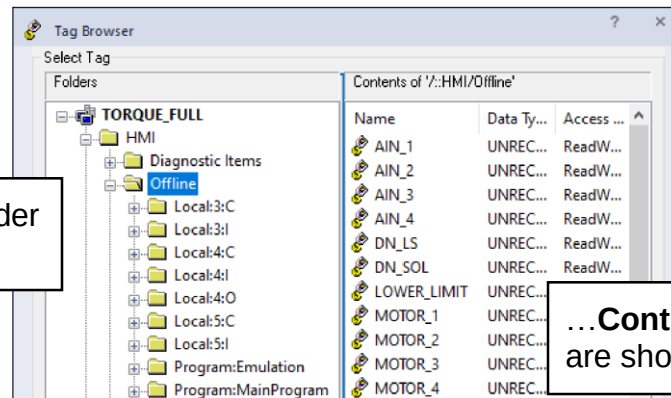


...**Controller Tags** are shown.

When a **Program** folder is selected...

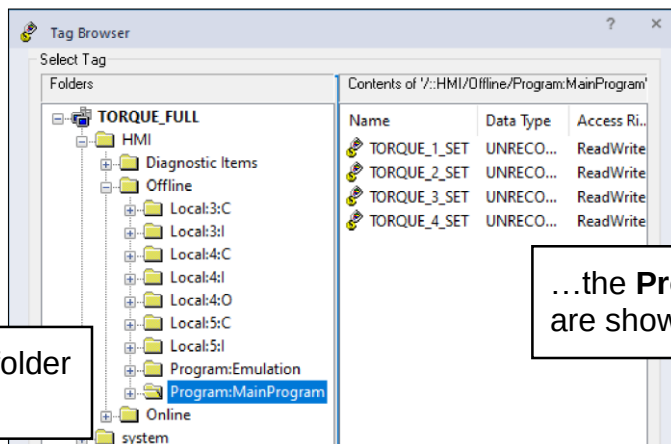

...the **Program Tags** are shown.

Timers and Counters Tags are in a Folder.

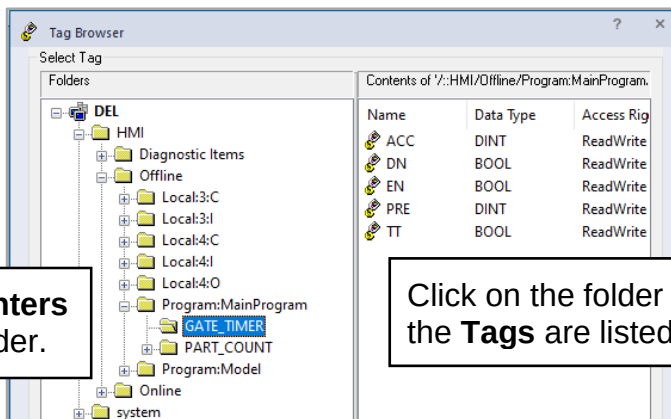

Click on the folder and the **Tags** are listed.

Note: **Timers** and **Counter** defined as **Controller Tags** will have their folder in the expanded **Offline** folder.

[Return to Table of Contents](#)



Appendix B: STATION RUNTIME APPLICATION

Prior to setup:




Studio 5000 Emulate has been started.
Studio 5000 program Communication Path has been set
Studio 5000 program has been downloaded.
Studio 5000 is in RUN mode.
FactoryTalk View Studio ME, Runtime Application created.

Double left click on the **FactoryTalk View ME Station** desktop icon.





FactoryTalk View ME Station dialog appears.

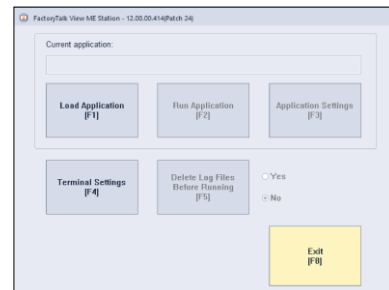


Left click on **Load Application [F1]** button.





At the **Select Application** dialog, left click on the application and then select the **Open** button.

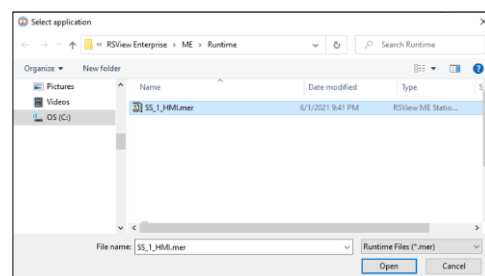


At Replace Communications Configuration prompt, select the **Yes [F7]** button.

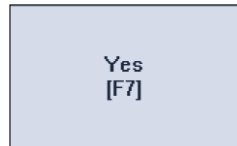

At the replace Local System Directory prompt, select the **Yes [F7]** button.

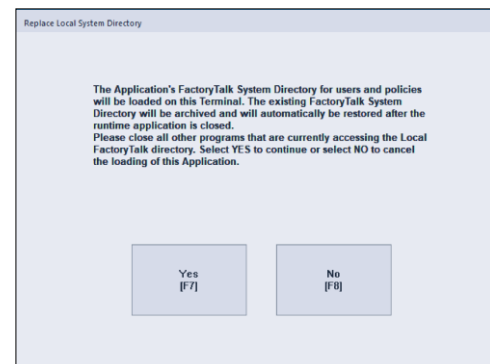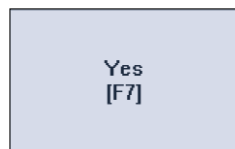

The Loading message will appear.

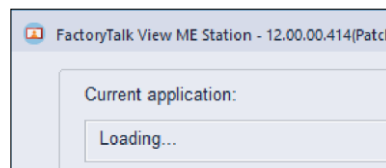

When the application loaded the filename is shown in the prompt.




Select **Run Application [F2]**

Run Application
[F2]

Prompt that application is starting will appear and then the HMI screen.

Starting application.
Please wait...

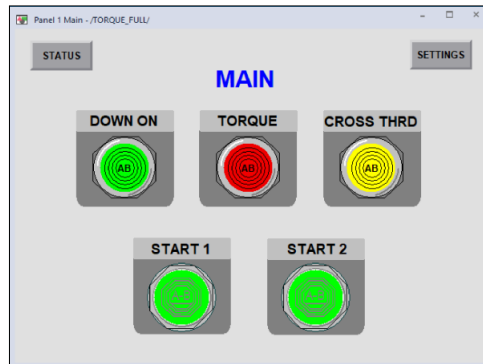

To shut down the HMI, select the "X" in the upper right corner.

[Return to Table of Contents](#)

Appendix C: OPENING PREVIOUSLY CREATED HMI


THIS PROCEDURE IS ONLY FOR FactoryTalk APPLICATIONS PREVIOUSLY CREATED.

The procedures applies when working with different FactoryTalk application when:

- working in the same session at the computer.
- returning to the computer at a later date.


In FactoryTalk View ME, after opening the application:

In the Explorer panel, expand **FactoryTalk Linx** and select **Communications Setup**.

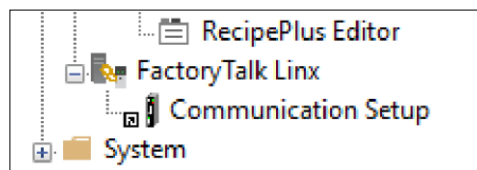

The Communications Setup panel will appear.


In the Device Shortcuts panel, left click on the named shortcut.

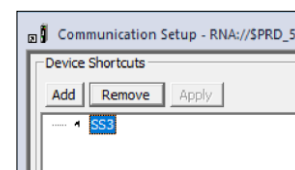

Select the processor in slot **2**.


Note: The name may be different.

Select the item with the processor icon.

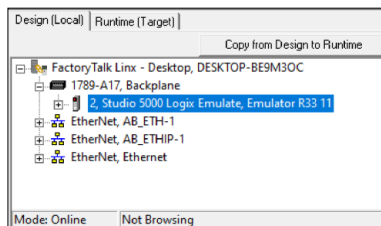


*If the **Apply** button is **not** highlighted, select the **Cancel** button to close Communications Setup. The shortcut is active*

If the **Apply** button is highlighted, press and follow prompts for confirmation.



Then **Verify**.



Select the **OK** button to close Communications Setup.



[Return to Table of Contents](#)

