

PROCEDURE FOR INSPECTION OF PISTONS & LINERS

PARTS I, II & III

Version 1.0 – November 2010

MAN | PrimeServ



SCOPE OF SCAVENGE PORT INSPECTIONS:

- The following shall be carried out during a scavenge port inspection:
- Visual examination in accordance with requirements of MAN *Inspection Through Scavenge Ports* form.
 - Measurement of the remaining depth of the pressure relief grooves (CL grooves), ring groove clearance and piston burn-away in accordance with *MAN Condition Monitoring Report (Port Inspection)* form.
 - Inspection of the cylinder liner running surface through the scavenge ports.
 - Photos taken of piston crown, top land, piston rings, piston skirt, piston rod, cylinder liner and scavenge receiver. Photos are required for any surfaces that are wiped down or cleaned, see taking photos section for details in Part II.
 - Inspection of non-return flaps.
 - Inspection of water mist catcher.

PRACTICES FOR SCAVENGE PORT INSPECTIONS

1. Always use MAN Diesel & Turbo sheets *Inspection through Scavenge Ports and Cylinder Condition Report* when submitting scavenge port inspection results. Blank inspection forms are available in APPENDIX.
2. Conduct scavenge inspections on a monthly or as soon thereafter basis.
3. Always pre-view the last scavenging port inspection prior to accomplishing a new port inspection.
4. Photos and comments in this booklet are an overview of the MAN Diesel & Turbo Instruction Manual Vol. 1, Operation Manual, Chapter 707. Refer to Chapter 707 for complete descriptions of procedures for scavenge port inspections, cylinder conditions, piston conditions, ring conditions, factors influencing cylinder wear, and cylinder lubrication.
5. The scavenge port inspection should be carried out at the first stop after a long voyage, e.g. by anchoring if possible, to obtain the most reliable result with regard to the effectiveness and sufficiency of the cylinder lubrication and the combustion cycle (complete or incomplete). A misleading result may be obtained if the scavenge port inspection is carried out after arrival at harbour, since manoeuvring and low speed running requires increased oil dosage.

*one star at a photo indicate a perfect condition.

**two stars at a photo indicate machining marks still invisible.

MAN B&W Two-Stroke Engines

PART I

Supplement to the MAN Diesel & Turbo
form titled
Inspection Through Scavenge Port

Version 1.0
November 2010

HOW TO USE THE MAN Diesel & Turbo FORM *Inspection through Scavenge Port*

The form on the next page is the MAN Diesel & Turbo form titled *Inspection through Scavenge Port*, a blank form is provided in the APPENDIX.

The left column on the MAN Diesel & Turbo form lists GENERAL CATEGORIES, the next column lists SPECIFIC CONDITIONS within each GENERAL CATEGORY. The scavenge port inspection involves the identification of SPECIFIC CONDITIONS within each of the GENERAL CATEGORIES.

Partial view of MAN form, full page view on opposite page

General Category	Condition and Symbol	Engine Part	Location
			1
	Intact - *	Piston crown	BU
	Burned - BU		
	Leaking oil - LO		
	Leaking water - LW		
Deposits	No deposit - *	Topland	MC
	Light deposit - LC	Kingland 1	LC
	Medium deposit - MC	Kingland 2	LC
	Excessive deposit - EC	Ringland 1	
	Polished deposit - PC	Ringland 2	

When conducting a scavenge port inspection on a unit, start by asking what is the status of each GENERAL CATEGORY in relationship to the SPECIFIC CONDITION. Once that determination has been made, write the symbol for that condition in the box that corresponds to the location, i.e. topland, ring land number or ring number.

Inspection through Scavenge Port																
General Category		Specific Conditions		Eng. builder:		Eng. no.:										
Wear per port call:	Normal service load (% of MCR)	Link. port load control:	Checked by:	Date (yy/mm/dd)												
Cyl. oil consum. (0.24 l/rpm)	at load %	Cyl. oil type:			Link. type:											
				Location		<input checked="" type="checkbox"/> Enh.	<input type="checkbox"/> Maintenance									
				Cylinder No.		2	3	4	5	6	7	8	9	10	11	12
Condition and Symbol		Engine Part														
Intact * Burned - BU Loose oil - LO Leaking water - LW		Future scores														
Deposits		No deposit - * Light deposit - LC Medium deposit - MC Extreme deposit - EC Pulverized deposit - PC		Todays												
Ring breakage		Intact - * Collapsed - C Broken opposite ring gap - BD Broken next gap - BN Severe pitting - SP Entirely missing - M		Ring 1												
Ring movement		Loose - * Slipper - SL Screwing - ST		Ring 2												
Surface condition		Graz, m. soot - * Brazing surface, black, wear - B Brazing surface, black, partly - B3 Black ring ends > 10 mm - BK Striations (vertical) - S Micro-seizures (local) - m. Micro-seizures (all over) - MZ Micro-seizures, still active - MAZ GM LZ - CZ Machine marks still visible - ** Wear edges on seat parts - WZ Screwing - SC Overhead wear - CL Holes sharp-edged TopBot - TBS		Ring 3												
Lubrication condition		Optimal - * Too much oil - O Slightly dry - D Very dry - DO Black oil - BO		Ring 4												
Deposits		No Sludge - * Sludge - S Much sludge - MS		Porta stat.												
		Intact - *		Porta rod.												
				Cylinder base oil/ seat parts.												
				Cylinder base seat/ seat parts.												
Please use last version!														Ref. 2009-02-13		

PART I

PART I of this booklet was developed to provide a photographic representation of each piston and liner condition listed on the MAN Diesel & Turbo *Inspection through Scavenge Port* form.

GENERAL CATEGORIES on the MAN form match the name on the tab at the bottom of each booklet page (black arrow).

SPECIFIC CONDITIONS on the form are represented by photographs (red arrow) in this booklet.

Inspection through Scavenge Port	
Model:	1000
Serial No.:	1000
Date of last inspection:	10/10/00
Condition:	Good
Comments:	
Condition and Number	Described
1	Excessive Deposit - EC
2	Excessive Deposit - EC (Close Up of Top Photo)
3	Polished Deposit - PC
4	Excessive Deposit - EC
5	Excessive Deposit - EC (Close Up of Top Photo)
6	Polished Deposit - PC
7	Excessive Deposit - EC
8	Excessive Deposit - EC (Close Up of Top Photo)
9	Polished Deposit - PC
10	Excessive Deposit - EC
11	Excessive Deposit - EC (Close Up of Top Photo)
12	Polished Deposit - PC
13	Excessive Deposit - EC
14	Excessive Deposit - EC (Close Up of Top Photo)
15	Polished Deposit - PC
16	Excessive Deposit - EC
17	Excessive Deposit - EC (Close Up of Top Photo)
18	Polished Deposit - PC
19	Excessive Deposit - EC
20	Excessive Deposit - EC (Close Up of Top Photo)
21	Polished Deposit - PC
22	Excessive Deposit - EC
23	Excessive Deposit - EC (Close Up of Top Photo)
24	Polished Deposit - PC
25	Excessive Deposit - EC
26	Excessive Deposit - EC (Close Up of Top Photo)
27	Polished Deposit - PC
28	Excessive Deposit - EC
29	Excessive Deposit - EC (Close Up of Top Photo)
30	Polished Deposit - PC
31	Excessive Deposit - EC
32	Excessive Deposit - EC (Close Up of Top Photo)
33	Polished Deposit - PC
34	Excessive Deposit - EC
35	Excessive Deposit - EC (Close Up of Top Photo)
36	Polished Deposit - PC
37	Excessive Deposit - EC
38	Excessive Deposit - EC (Close Up of Top Photo)
39	Polished Deposit - PC
40	Excessive Deposit - EC
41	Excessive Deposit - EC (Close Up of Top Photo)
42	Polished Deposit - PC
43	Excessive Deposit - EC
44	Excessive Deposit - EC (Close Up of Top Photo)
45	Polished Deposit - PC
46	Excessive Deposit - EC
47	Excessive Deposit - EC (Close Up of Top Photo)
48	Polished Deposit - PC
49	Excessive Deposit - EC
50	Excessive Deposit - EC (Close Up of Top Photo)
51	Polished Deposit - PC
52	Excessive Deposit - EC
53	Excessive Deposit - EC (Close Up of Top Photo)
54	Polished Deposit - PC
55	Excessive Deposit - EC
56	Excessive Deposit - EC (Close Up of Top Photo)
57	Polished Deposit - PC
58	Excessive Deposit - EC
59	Excessive Deposit - EC (Close Up of Top Photo)
60	Polished Deposit - PC
61	Excessive Deposit - EC
62	Excessive Deposit - EC (Close Up of Top Photo)
63	Polished Deposit - PC
64	Excessive Deposit - EC
65	Excessive Deposit - EC (Close Up of Top Photo)
66	Polished Deposit - PC
67	Excessive Deposit - EC
68	Excessive Deposit - EC (Close Up of Top Photo)
69	Polished Deposit - PC
70	Excessive Deposit - EC
71	Excessive Deposit - EC (Close Up of Top Photo)
72	Polished Deposit - PC
73	Excessive Deposit - EC
74	Excessive Deposit - EC (Close Up of Top Photo)
75	Polished Deposit - PC
76	Excessive Deposit - EC
77	Excessive Deposit - EC (Close Up of Top Photo)
78	Polished Deposit - PC
79	Excessive Deposit - EC
80	Excessive Deposit - EC (Close Up of Top Photo)
81	Polished Deposit - PC
82	Excessive Deposit - EC
83	Excessive Deposit - EC (Close Up of Top Photo)
84	Polished Deposit - PC
85	Excessive Deposit - EC
86	Excessive Deposit - EC (Close Up of Top Photo)
87	Polished Deposit - PC
88	Excessive Deposit - EC
89	Excessive Deposit - EC (Close Up of Top Photo)
90	Polished Deposit - PC
91	Excessive Deposit - EC
92	Excessive Deposit - EC (Close Up of Top Photo)
93	Polished Deposit - PC
94	Excessive Deposit - EC
95	Excessive Deposit - EC (Close Up of Top Photo)
96	Polished Deposit - PC
97	Excessive Deposit - EC
98	Excessive Deposit - EC (Close Up of Top Photo)
99	Polished Deposit - PC
100	Excessive Deposit - EC
101	Excessive Deposit - EC (Close Up of Top Photo)
102	Polished Deposit - PC
103	Excessive Deposit - EC
104	Excessive Deposit - EC (Close Up of Top Photo)
105	Polished Deposit - PC
106	Excessive Deposit - EC
107	Excessive Deposit - EC (Close Up of Top Photo)
108	Polished Deposit - PC
109	Excessive Deposit - EC
110	Excessive Deposit - EC (Close Up of Top Photo)
111	Polished Deposit - PC
112	Excessive Deposit - EC
113	Excessive Deposit - EC (Close Up of Top Photo)
114	Polished Deposit - PC
115	Excessive Deposit - EC
116	Excessive Deposit - EC (Close Up of Top Photo)
117	Polished Deposit - PC
118	Excessive Deposit - EC
119	Excessive Deposit - EC (Close Up of Top Photo)
120	Polished Deposit - PC
121	Excessive Deposit - EC
122	Excessive Deposit - EC (Close Up of Top Photo)
123	Polished Deposit - PC
124	Excessive Deposit - EC
125	Excessive Deposit - EC (Close Up of Top Photo)
126	Polished Deposit - PC
127	Excessive Deposit - EC
128	Excessive Deposit - EC (Close Up of Top Photo)
129	Polished Deposit - PC
130	Excessive Deposit - EC
131	Excessive Deposit - EC (Close Up of Top Photo)
132	Polished Deposit - PC
133	Excessive Deposit - EC
134	Excessive Deposit - EC (Close Up of Top Photo)
135	Polished Deposit - PC
136	Excessive Deposit - EC
137	Excessive Deposit - EC (Close Up of Top Photo)
138	Polished Deposit - PC
139	Excessive Deposit - EC
140	Excessive Deposit - EC (Close Up of Top Photo)
141	Polished Deposit - PC
142	Excessive Deposit - EC
143	Excessive Deposit - EC (Close Up of Top Photo)
144	Polished Deposit - PC
145	Excessive Deposit - EC
146	Excessive Deposit - EC (Close Up of Top Photo)
147	Polished Deposit - PC
148	Excessive Deposit - EC
149	Excessive Deposit - EC (Close Up of Top Photo)
150	Polished Deposit - PC
151	Excessive Deposit - EC
152	Excessive Deposit - EC (Close Up of Top Photo)
153	Polished Deposit - PC
154	Excessive Deposit - EC
155	Excessive Deposit - EC (Close Up of Top Photo)
156	Polished Deposit - PC
157	Excessive Deposit - EC
158	Excessive Deposit - EC (Close Up of Top Photo)
159	Polished Deposit - PC
160	Excessive Deposit - EC
161	Excessive Deposit - EC (Close Up of Top Photo)
162	Polished Deposit - PC
163	Excessive Deposit - EC
164	Excessive Deposit - EC (Close Up of Top Photo)
165	Polished Deposit - PC
166	Excessive Deposit - EC
167	Excessive Deposit - EC (Close Up of Top Photo)
168	Polished Deposit - PC
169	Excessive Deposit - EC
170	Excessive Deposit - EC (Close Up of Top Photo)
171	Polished Deposit - PC
172	Excessive Deposit - EC
173	Excessive Deposit - EC (Close Up of Top Photo)
174	Polished Deposit - PC
175	Excessive Deposit - EC
176	Excessive Deposit - EC (Close Up of Top Photo)
177	Polished Deposit - PC
178	Excessive Deposit - EC
179	Excessive Deposit - EC (Close Up of Top Photo)
180	Polished Deposit - PC
181	Excessive Deposit - EC
182	Excessive Deposit - EC (Close Up of Top Photo)
183	Polished Deposit - PC
184	Excessive Deposit - EC
185	Excessive Deposit - EC (Close Up of Top Photo)
186	Polished Deposit - PC
187	Excessive Deposit - EC
188	Excessive Deposit - EC (Close Up of Top Photo)
189	Polished Deposit - PC
190	Excessive Deposit - EC
191	Excessive Deposit - EC (Close Up of Top Photo)
192	Polished Deposit - PC
193	Excessive Deposit - EC
194	Excessive Deposit - EC (Close Up of Top Photo)
195	Polished Deposit - PC
196	Excessive Deposit - EC
197	Excessive Deposit - EC (Close Up of Top Photo)
198	Polished Deposit - PC
199	Excessive Deposit - EC
200	Excessive Deposit - EC (Close Up of Top Photo)
201	Polished Deposit - PC
202	Excessive Deposit - EC
203	Excessive Deposit - EC (Close Up of Top Photo)
204	Polished Deposit - PC
205	Excessive Deposit - EC
206	Excessive Deposit - EC (Close Up of Top Photo)
207	Polished Deposit - PC
208	Excessive Deposit - EC
209	Excessive Deposit - EC (Close Up of Top Photo)
210	Polished Deposit - PC
211	Excessive Deposit - EC
212	Excessive Deposit - EC (Close Up of Top Photo)
213	Polished Deposit - PC
214	Excessive Deposit - EC
215	Excessive Deposit - EC (Close Up of Top Photo)
216	Polished Deposit - PC
217	Excessive Deposit - EC
218	Excessive Deposit - EC (Close Up of Top Photo)
219	Polished Deposit - PC
220	Excessive Deposit - EC
221	Excessive Deposit - EC (Close Up of Top Photo)
222	Polished Deposit - PC
223	Excessive Deposit - EC
224	Excessive Deposit - EC (Close Up of Top Photo)
225	Polished Deposit - PC
226	Excessive Deposit - EC
227	Excessive Deposit - EC (Close Up of Top Photo)
228	Polished Deposit - PC
229	Excessive Deposit - EC
230	Excessive Deposit - EC (Close Up of Top Photo)
231	Polished Deposit - PC
232	Excessive Deposit - EC
233	Excessive Deposit - EC (Close Up of Top Photo)
234	Polished Deposit - PC
235	Excessive Deposit - EC
236	Excessive Deposit - EC (Close Up of Top Photo)
237	Polished Deposit - PC
238	Excessive Deposit - EC
239	Excessive Deposit - EC (Close Up of Top Photo)
240	Polished Deposit - PC
241	Excessive Deposit - EC
242	Excessive Deposit - EC (Close Up of Top Photo)
243	Polished Deposit - PC
244	Excessive Deposit - EC
245	Excessive Deposit - EC (Close Up of Top Photo)
246	Polished Deposit - PC
247	Excessive Deposit - EC
248	Excessive Deposit - EC (Close Up of Top Photo)
249	Polished Deposit - PC
250	Excessive Deposit - EC
251	Excessive Deposit - EC (Close Up of Top Photo)
252	Polished Deposit - PC
253	Excessive Deposit - EC
254	Excessive Deposit - EC (Close Up of Top Photo)
255	Polished Deposit - PC
256	Excessive Deposit - EC
257	Excessive Deposit - EC (Close Up of Top Photo)
258	Polished Deposit - PC
259	Excessive Deposit - EC
260	Excessive Deposit - EC (Close Up of Top Photo)
261	Polished Deposit - PC
262	Excessive Deposit - EC
263	Excessive Deposit - EC (Close Up of Top Photo)
264	Polished Deposit - PC
265	Excessive Deposit - EC
266	Excessive Deposit - EC (Close Up of Top Photo)
267	Polished Deposit - PC
268	Excessive Deposit - EC
269	Excessive Deposit - EC (Close Up of Top Photo)
270	Polished Deposit - PC
271	Excessive Deposit - EC
272	Excessive Deposit - EC (Close Up of Top Photo)
273	Polished Deposit - PC
274	Excessive Deposit - EC
275	Excessive Deposit - EC (Close Up of Top Photo)
276	Polished Deposit - PC
277	Excessive Deposit - EC
278	Excessive Deposit - EC (Close Up of Top Photo)
279	Polished Deposit - PC
280	Excessive Deposit - EC
281	Excessive Deposit - EC (Close Up of Top Photo)
282	Polished Deposit - PC
283	Excessive Deposit - EC
284	Excessive Deposit - EC (Close Up of Top Photo)
285	Polished Deposit - PC
286	Excessive Deposit - EC
287	Excessive Deposit - EC (Close Up of Top Photo)
288	Polished Deposit - PC
289	Excessive Deposit - EC
290	Excessive Deposit - EC (Close Up of Top Photo)
291	Polished Deposit - PC
292	Excessive Deposit - EC
293	Excessive Deposit - EC (Close Up of Top Photo)
294	Polished Deposit - PC
295	Excessive Deposit - EC
296	Excessive Deposit - EC (Close Up of Top Photo)
297	Polished Deposit - PC
298	Excessive Deposit - EC
299	Excessive Deposit - EC (Close Up of Top Photo)
300	Polished Deposit - PC



EXCESSIVE DEPOSIT - EC




EXCESSIVE DEPOSIT - EC (Close Up of Top Photo)



POLISHED DEPOSIT - PC


PISTON DEPOSITS

PHOTOGRAPHIC REPRESENTATIONS OF **SPECIFIC CONDITIONS** LISTED ON MAN DIESEL & TURBO FORM INSPECTION THROUGH SCAVENGE PORT

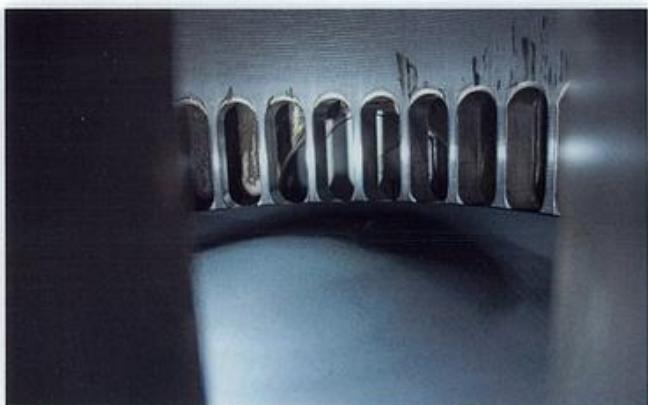

INTACT PISTON CROWN - *

An intact piston crown has a minor layer of carbon, no burn-away (elephant skin).

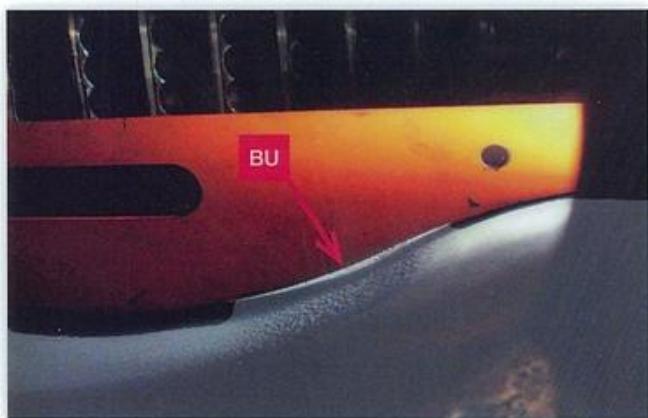

PISTON CROWN BURNING - BU

Further information concerning piston crown burning can be found in PART III.

PISTON CROWN



LEAKING OIL – LO

If oil is found on the piston, determine if it is fuel oil or lube oil. Fuel oil will be black and sticky, indicating a fuel valve is leaking. Lube oil will be brown and non-sticky, indicating it could be from an exhaust valve.



LEAKING WATER – LW

Water on a piston indicates a cooling system leak. If water is found, it is important to determine what the cause is.

Viewed by either a mirror or photo, does it appear the leak is from the cylinder head, exhaust valve, injectors or another source?

Keep cooling water and cooling oil circulating during inspection so possible leakages can be detected.

PISTON CROWN

CARBON DEPOSITS


Often some deposits will accumulate on the side of the top land. Carbon deposits on the ring lands indicate lack of gas sealing at the respective rings. If the deposits are thick, the surface may be smooth and shiny from rubbing on the cylinder wall. This contact may locally wipe away the oil film, resulting in micro-seizure and increased wear of liner and rings.



NO DEPOSIT - *

Running surfaces of piston rings will be worn bright. In addition, the rings will move freely in their grooves, be well oiled evenly around the circumference of the piston, and intact.

PISTON DEPOSITS

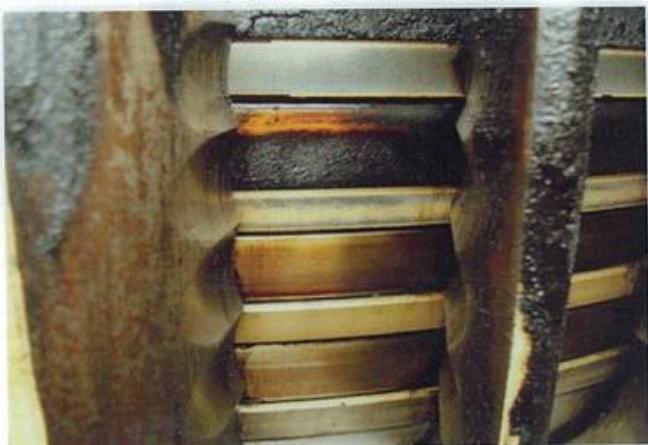


LIGHT DEPOSIT - LC




MEDIUM DEPOSIT- MC

PISTON DEPOSITS

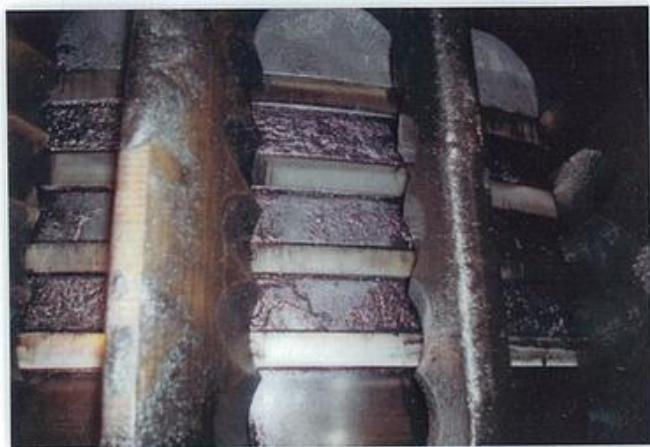

EXCESSIVE DEPOSIT – EC

Excessive carbon deposits are the result of over lubrication or improper combustion.

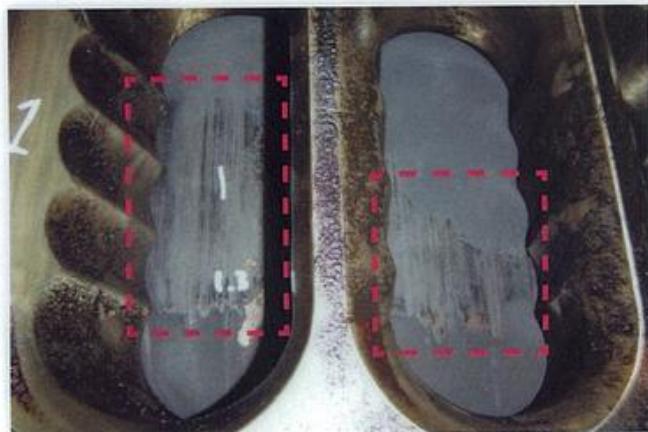

POLISHED DEPOSIT – PC

If the deposits are abnormally thick, the carbon deposits may be smooth and shiny from rubbing against the cylinder wall. This can result in locally wiping away the oil film, causing micro-seizures and increased wear of liner and rings.

In some instances, mechanical clover leafing (Surface Condition section, CL) can occur, visible as vertical grooves of slightly higher wear in between the lubricating quills.

PISTON DEPOSITS

RING BREAKAGE/COLLAPSE

IF PART OF A RING IS MISSING (Condition "M"), ATTEMPT TO FIND THE MISSING PART(S). IF THE MISSING BROKEN RING PART(S) CANNOT BE LOCATED, INSPECT THE EXHAUST GAS RECEIVER, THE SCAVENGE AIR RECEIVER AND THE SCAVENGE AIR BOX, IF STILL NOT FOUND, INSPECT THE TURBOCHARGER FOR MISSING PART(S) AND/OR DAMAGE.

During a scavenge port inspection, broken rings are identified by:

- Collapsed ring (C).
- Lack of "elastic tension" (SL and ST, *Ring Movement section*).
- Blackish appearance (B or (B), *Surface Condition section*).
- Fractured ring(s) (BO, BN or SP).
- Missing ring (M).



INTACT RING - *

Running surfaces of the rings are worn bright, smooth, clean, without scratches, move freely in the grooves and are well oiled.

RING BREAKAGE




COLLAPSED RING - C

Collapse occurs if the gas pressure behind the ring is built up too slowly. With inadequate outward pressure behind the ring, combustion gas can penetrate between the liner and the ring, violently forcing the ring inwards, into the ring groove. The sudden shock loading will eventually lead to fracture, particularly if the ring ends slam against each other.

The slow pressure build-up behind the rings can be due to:

- Carbon deposits in the ring groove (*MC and EC, Deposits section*).
- Insufficient vertical ring clearance (*PART III, Ring Groove Measurement*).
- Partial sticking (*ST, Ring Movement section*)
- Poor sealing between the ring and the ring groove floor.
- Clover-leaving (*CL, Surface Condition section*).
- Ring end chamfers.
- Too large ring-edge radii.
- Continual striking against wear ridges (*WR, Surface Condition section*), or other irregularities in the cylinder wall.

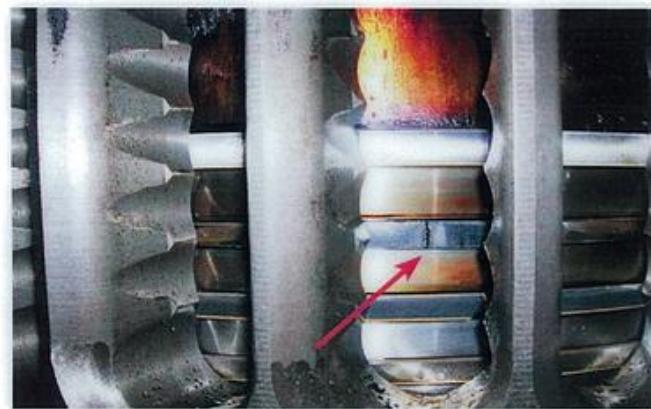

BROKEN OPPOSITE RING GAP - BO

Ring breakage opposite the ring gap is evidence of localized overstressing of the ring material during installation resulting in permanent deformation, causing blow-by and broken rings



BROKEN NEAR GAP - BN

If seen on topring female partbreakage often caused by turning edges in the liner top



SEVERAL PIECES - SP

RING BREAKAGE



ENTIRELY MISSING – M

If part of a ring is missing, attempt to find the missing part(s). If the missing broken ring part(s) cannot be located, inspect the exhaust gas receiver and the bottom of the scavenge air box, if still not found, inspect the turbocharger for missing part(s) and/or damage.

- 19 -

RING BREAKAGE

RING MOVEMENT

Piston rings provide a gas tight seal between the piston and cylinder liner wall. The seal occurs by gas pressure above and behind the piston ring forcing the ring down and out towards the cylinder wall. To create this seal, free ring movement is essential.


Ring movement is described as:

- Loose
- Sluggish
- Sticking




CHECKING RING MOVEMENT

Ring movement is checked by pressing on each ring with a wooden stick through a scavenge port. Turn the piston up and down. For large bore engines it can be necessary to use a wooden block and a hammer.

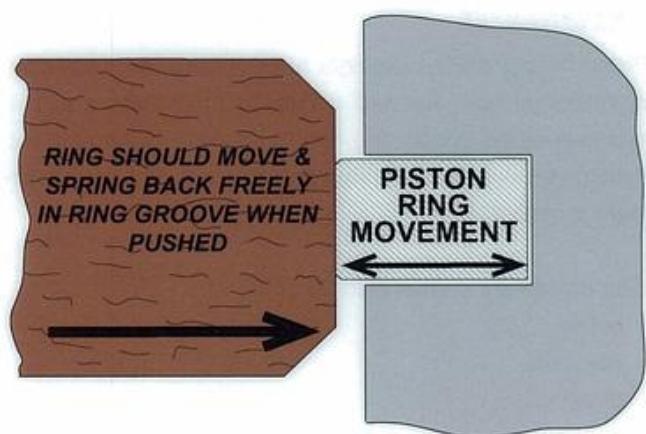



LOOSE - *

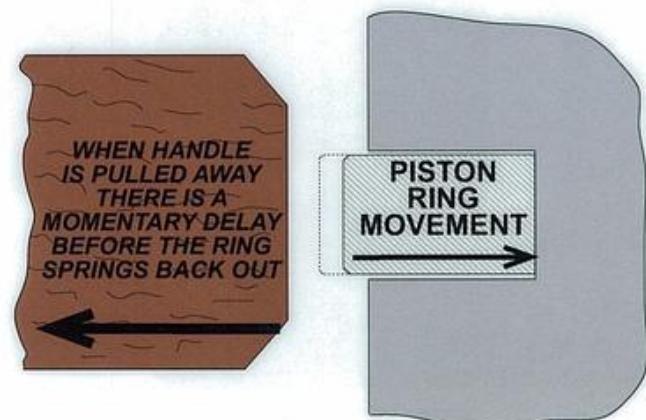

SLUGGISH - SL

RING MOVEMENT

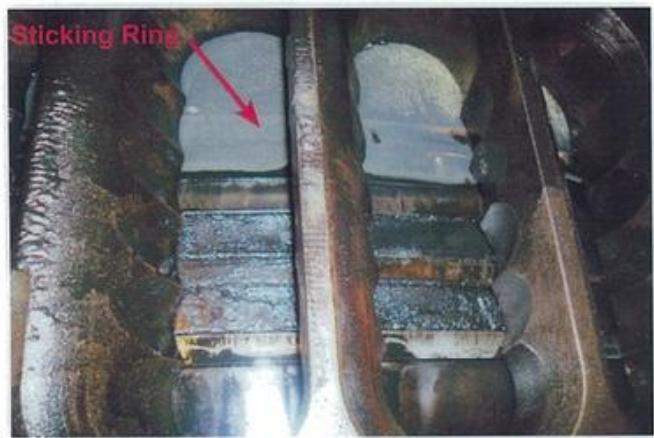

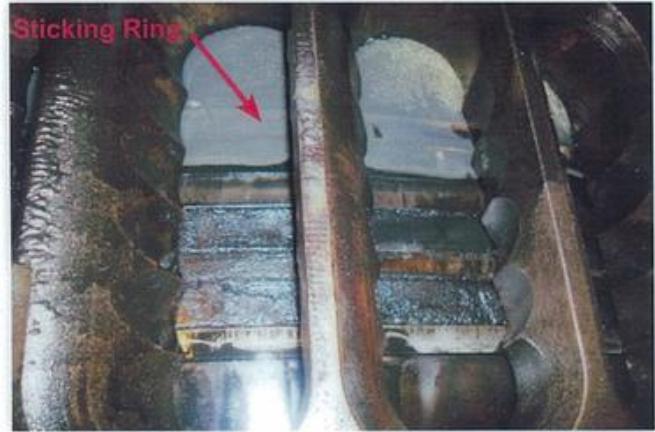

STICKING - ST

RING MOVEMENT



CLEAN, SMOOTH - *

Running surfaces of the piston rings and cylinder liner are worn bright, rings move freely in the grooves, are well oiled, and intact.

BLOW-BY:

Blow-by, the leakage of combustion gas past the piston rings, is the result of ring sticking, collapse or breakage. It is indicated by black, dry areas on the rings and by larger black dry zones on the upper part of the liner wall which can only be seen when overhauling the piston or when exchanging the exhaust valve. In this booklet, blow-by is indicated by the following conditions: BLACK OVERALL, BLACK PARTIALLY and BLACK RING ENDS.



RUNNING SURFACE, BLACK OVERALL - B



RUNNING SURFACE, BLACK PARTLY – (B)



BLACK RING ENDS >100MM – BR

SURFACE CONDITION

VERTICAL SCRATCHES



SCRATCHES (VERTICAL) – S

Scratching is caused by hard abrasive particles from the fuel oil, from a broken ring or from turbocharger intake. Scratches on the piston ring running surface is one of the first signs of abrasive particles, and can be observed during scavenge port inspections. Usually, micro-seizures do not occur from scratching, i.e., the ring surface remains soft. Hardness can be checked with a file, see *RECOGNIZING MICRO SEIZURES* in this section and *MAN Diesel & Turbo Plate 70704*.

Scratching damage is found on the top of the ring where the hard particles enter between the ring and the liner.

Because the top edge is the initial point of contact, particle wear primarily affects the upper ring face, horizontal ring surface and ring groove.



Face of Ring



Cross Section of Ring



SCRATCHES (VERTICAL) – S
Piston Skirt

MICRO-SEIZURES:

Micro-seizures are the result of break down of the lube oil film, causing metal to metal contact. The contact will cause a high friction and high temperature that will change the appearance of the ring surface. The cylinder oil film break down is in most cases caused by borepolish. May be due to overlubrication causing built up of deposits polishing the liner running surface.

LOCAL micro-seizures are limited to part of a ring circumference. However, because rings turn in their grooves, LOCAL micro-seizures on a ring can produce micro-seizures all the way around the cylinder liner as the ring rotates in the ring groove, creating a condition known as ALL OVER micro-seizures.


To identify LOCAL micro-seizures before they develop into ALL OVER micro-seizures, when conducting an inspection it is important to check the exhaust and cam (manoeuvring) sides as well as the forward and aft piston ring conditions using a mirror.

RECOGNIZING MICRO-SEIZURES

Micro-seizures on a running surface will have a vertically-striped appearance, and be relatively "hard", which refers to the result of a FILE TEST.

To conduct a file test, use a new, finely cut file to file across the hardened surface. If the file leaves almost no scratch, it indicates the surface is covered by a hard glaze, the result of micro-seizure hardening. See *MAN Diesel & Turbo Plate 70704* for additional information concerning the FILE TEST. The file test can of course only take place on a dismantled piston ring.

LOCAL & ALL OVER MICRO-SEIZURES

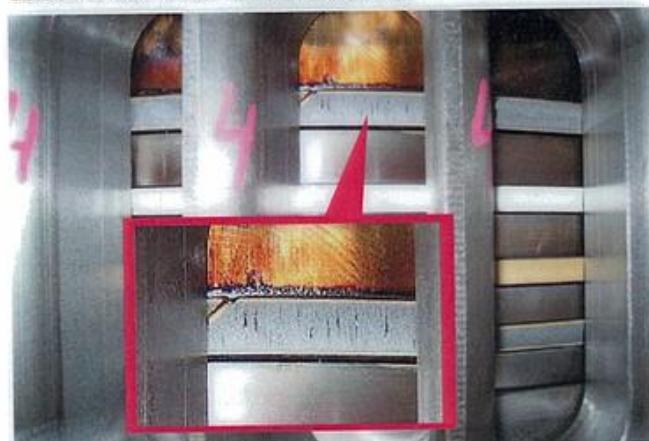


LOCAL MICRO-SEIZURES – mz




ALL OVER MICRO-SEIZURES – MZ

Notice in the top photo the micro-seizures are limited to the center scavenge port. In the bottom photo micro-seizures can be seen in all 3 scavenge ports. This is the distinction between LOCAL and ALL OVER micro-seizures.

ACTIVE & INACTIVE MICRO-SEIZURES

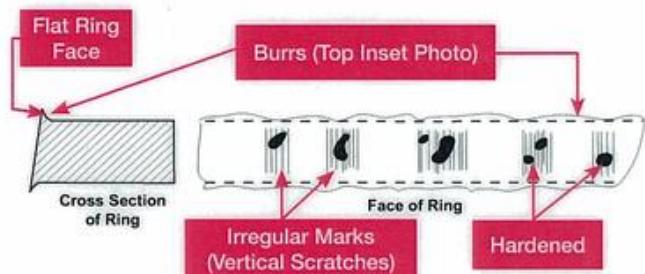

STILL ACTIVE MICRO-SEIZURES – MAZ

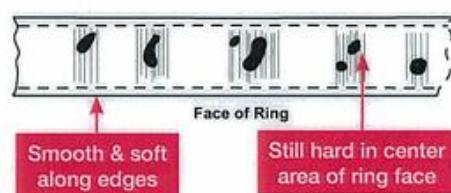

OLD MICRO-SEIZURES – OZ

SURFACE CONDITION

FACTORS INFLUENCING CYLINDER WEAR

It is vital that the system be free of condensation and water. Condensation produces sulphuric acid corrosion, water breaks down cylinder lubrication.

To minimize **condensation** observe the following best practices:

- Optimize the temperature of the liner wall by maintaining cooling water outlet temperatures within the specified limits.
- Keep cooling water temperature differences across the cylinder units between 12°-18°C at MCR.

To minimize **water** observe the following best practices:

- Check that the drain for the water mist catcher functions properly to prevent water droplets from entering the cylinders.
- Check water mist catcher for correct fitting according to Service Letter
- Check for free standing water in the mist catcher.

Whenever inspecting a cylinder liner, use a mirror and a bright light or a flash photo to inspect the condition of injectors, exhaust valve and cylinder head.

SCUFFING:

Scuffing is the result of oil film breakdown. With the cylinder walls no longer able to retain an oil film, frictional interaction between the cylinder wall and ring surfaces occurs. Due to the heat, ring and cylinder surfaces friction weld, harden, and seizures develop on both surfaces.



MACHINING MARKS STILL VISIBLE - **

A cylinder liner in good condition will have "wave-cut" machining marks visible on the complete running surface. The wave-cut surface is a single spiraled 0.01-0.02mm deep groove. The groove acts as a pocket for the cylinder lubricating oil to maintain a proper oil film so as the piston rings move across the groove, oil is deposited on the rings. If the wave cut pattern is worn away or the cylinder wall microstructure changes the cylinder liner will not properly distribute cylinder oil and scuffing can occur.



LINER SCUFFED - SC

SURFACE CONDITION



WEAR RIDGES NEAR SCAVENGER PORTS – WR

Ring breakage can occur by rings repeatedly moving across a wear ridge.



RINGS SCUFFING – SC




RINGS SCUFFING – SC (CLOSE-UP)


CLOVER LEAFING:

The clover-leaf formation in a liner is described by heavy wear patterns in the cylinder liner between the lubricating quills (between red lines), with less wear outside of the heavy wear areas (between red & yellow lines).


In extreme cases the liner bore may resemble a clover leaf, thus the name. Clover-leaving can be the result of micro-seizures, misalignment, polished deposits, improper lubrication or water disrupting the oil film on the cylinder wall.

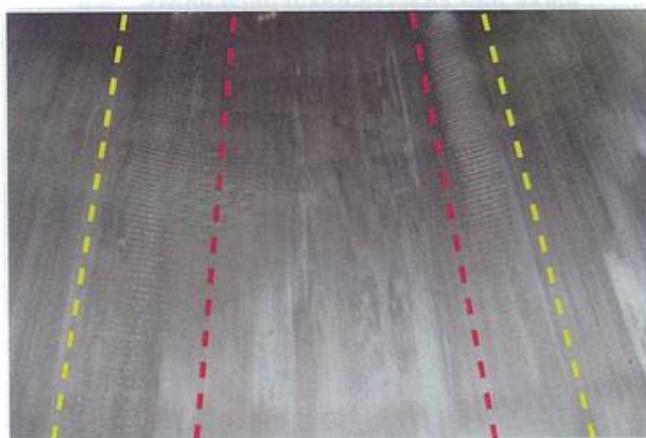

Cross section view looking down at a clover leafed cylinder liner

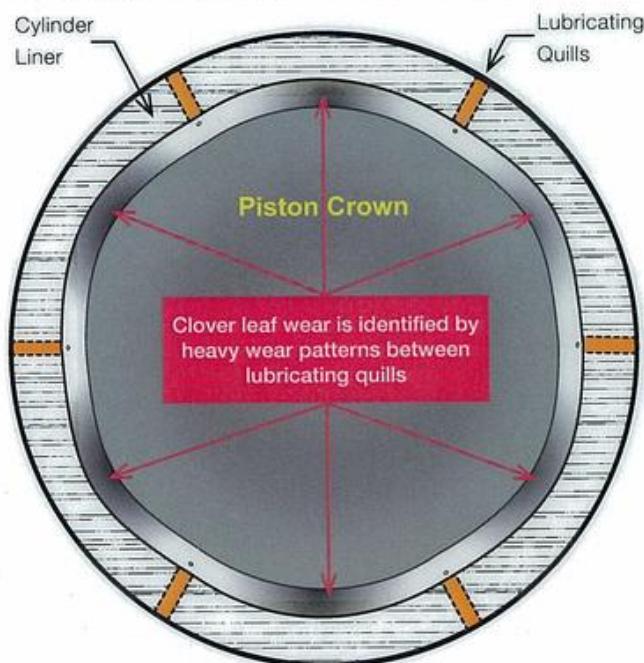

CLOVER LEAF WEAR – CL

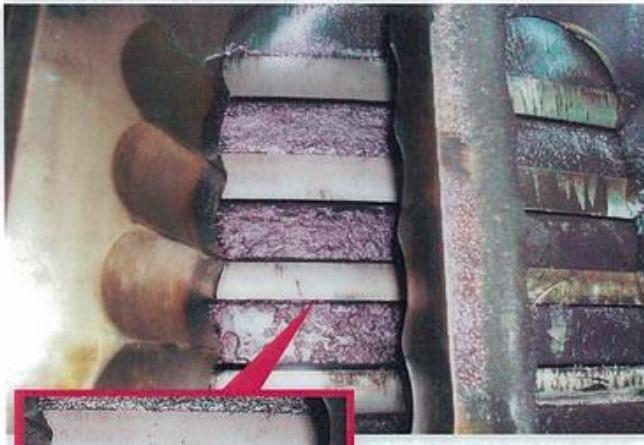

Rings with sharp edges.

RINGS SHARP EDGED

TOP & BOTTOM - T/B

Ring edges will be sharp when original roundings have been worn away, but without burrs.



RINGS WITH SOFT EDGES:

Ring roundings from start.


26-35 0,8 mm

42-50 1,2 mm

60-70 1,6 mm

80-98 2,0 mm

When the piston is positioned at approximately TDS, inspect the piston rod through the scavenge ports.

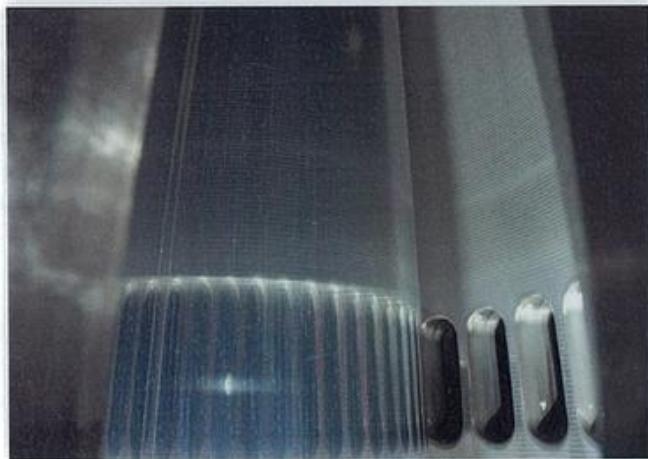

PISTON ROD, SMOOTH - *



PISTON ROD, CORROSION - CO



PISTON ROD (Close-Up), CORROSION - CO

SURFACE CONDITION



OPTIMAL - *

All piston rings have oil at the edges and the oil film is evenly dispersed around the circumference of the piston.




TOO MUCH OIL - O

Too much cylinder lubricating oil can create calcium deposits on the pistons, see photo below. Calcium deposits rubbing against the liner can lead to mechanical "bore polish" and destroy the oil film, leading to scuffing (SC, *Surface Condition* section). Over lubrication also suppresses corrosion completely. Controlled corrosion is necessary to continuously refresh the liner surface to counteract bore polish.



CALCIUM DEPOSITS

(Provided as a reference only, not a listed condition)

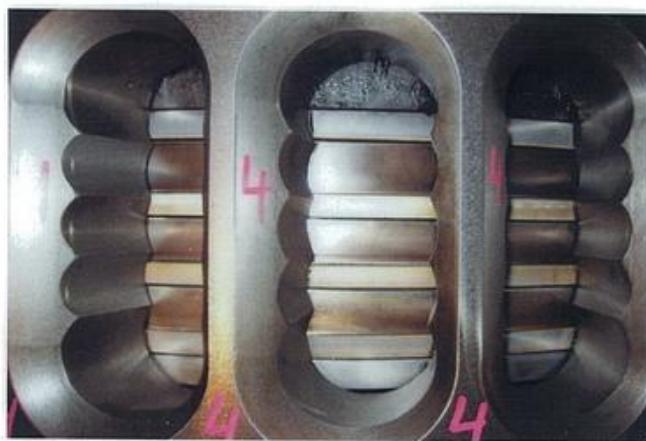

SLIGHTLY DRY - D

Running surface of piston rings dry but oil is still visible on ring lands.



VERY DRY - DO

Too little cylinder lubricating oil can result in break down of the oil film between the piston rings and the cylinder liner leading to adhesive contact and possible scuffing of rings and liner.



BLACK OIL - BO

Surfaces covered with black oil indicates poor combustion combined with excessive cylinder oil. Surfaces covered with black oil can also be the result of manoeuvring.

If cleaning scavenge boxes or air receiver, take photos both before and after cleaning.



Scavenger Box, NO SLUDGE - *



Scavenger Box, SLUDGE - S




Scavenger Box, MUCH SLUDGE - MS

- Too much sludge can contaminate system oil. Remove any oil sludge and carbon deposits in the scavenge air boxes.




Scavenge Receiver, NO SLUDGE – *

Alert: water washing from defect water mist catcher could cause a very clean scavenge air receiver.

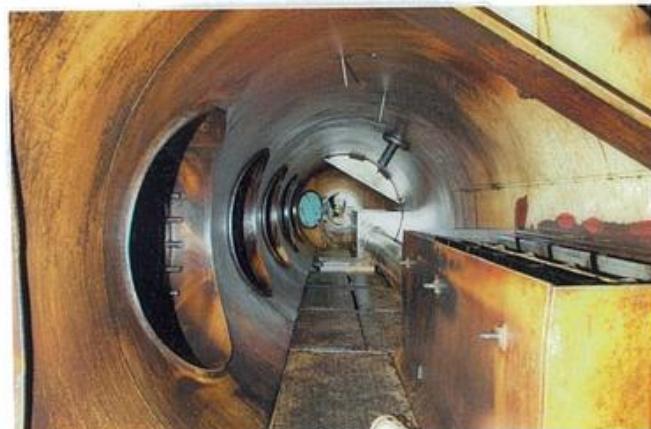

Scavenge Receiver, SLUDGE – S *

Normal picture. Indicate good cylinder condition.

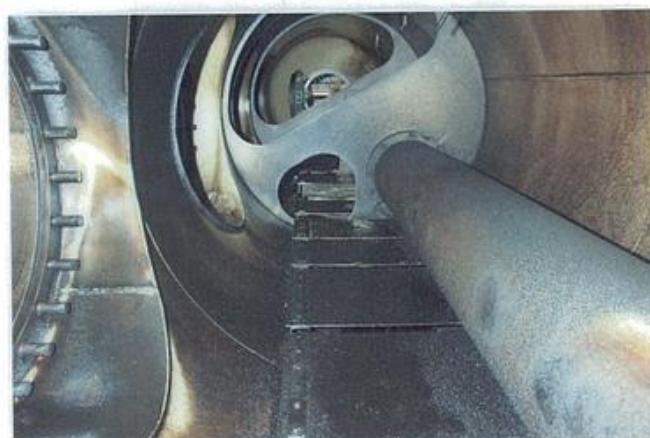

Scavenge Receiver, MUCH SLUDGE – MS

Remove any oil sludge and carbon deposits in scavenge receiver.



FLAPS (NON-RETURN VALVES), INTACT - *

Check the non-return valves (flap valves) for easy movement and damage.




FLAPS BENT

(Provided as a reference only, not a listed condition)



FLAPS, Move Freely

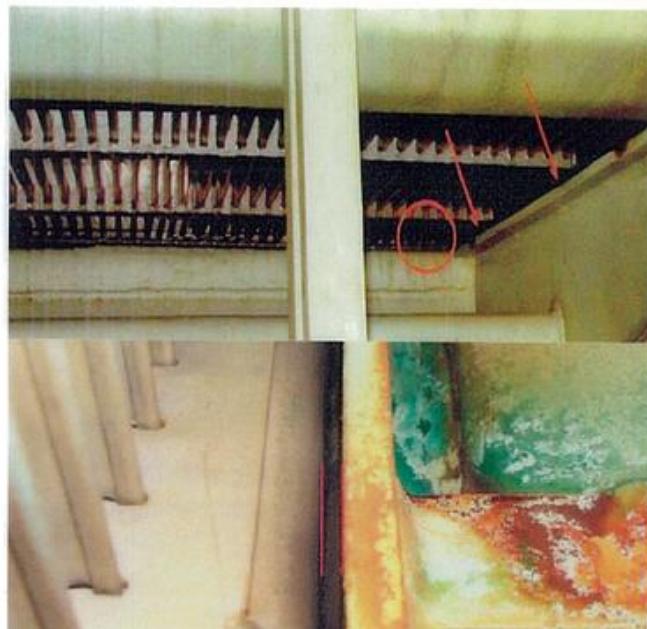

WATER MIST CATCHER, OUTLET SIDE

Check for gaps and missing bolts that cause gaps between the mist catcher and the casing. In the top photo the arrows indicate where to check for loose or missing bolts, the circle indicates where to check for gaps. In the lower photo a gap exists.



WATER MIST CATCHER

Depending on the temperature and humidity of the ambient air and the temperature of the cooling water, water may condensate on the coldest air cooler tubes of the air cooler. Water mist catchers are installed directly after the air coolers to prevent water droplets from entering the cylinders. If water enters the cylinders, the oil film on the cylinder liner can be ruptured, resulting in scuffing and cloverleafing on the liner surfaces.

Inspect the water mist catcher for cracks in the frame and correct mounting during scavenge port inspections. A broken or loose mounting may cause an upstream gap at the bottom of the water mist catcher elements. Air on the upstream side will short-circuit the element and cause water running down through the element to be sprayed downstream out through the water mist catcher. The water spray from the broken water mist catcher may enter the cylinder units.

It is very important that the water mist catcher drains function properly and that the water mist catcher is fitted correct in the frame. if any doubt remove the casing covers to check.



INTACT - *

Inspect the condition of the locking wire for the piston skirt bolts.
A loose locking wire can indicate one of the screws is loose or the
wire is broken.

PART II

**SCAVENGE PORT INSPECTION TOOLS &
TAKING PHOTOS**

Version 1.0
November 2010

SCAVENGE PORT INSPECTION TOOLS



From left, MAN Diesel & Turbo Piston Crown Template, Vernier Gauge, Soft Metal Drift, Camera, Feeler Gauge, Pencil, Marker, Mirror, Flashlight, Large Screw Driver, Mallet, Coating Layer Measuring Tool.

Also include clean rags for wiping down surfaces and two 20 liter (5 gl.) pails (1 to carry tools, the other for rags).



A bright light is not only used for general lighting, but also for taking close up photos of pistons and rings, see Taking Photos.

INSPECTION TOOLS



A mirror, with tiltable telescopic handle is used to inspect:

- Forward and aft scavenge port running surfaces.
- Cylinder wall above and below scavenge ports.
- Cylinder covers
- Injectors
- Exhaust valve
- Cylinder wall wear ridges

INSPECTION TOOLS

REQUIRED PHOTOS: Take photos of the following:

- | | | |
|----------------|------------------|---------------------|
| ■ Piston crown | ■ Piston skirt | ■ Scavenge box |
| ■ Top land | ■ Piston rod | ■ Scavenge receiver |
| ■ Piston rings | ■ Cylinder liner | ■ Damage |

Before and after photos are required for items that are wiped down during the inspection.



When taking close-up photos, use the camera's **MACRO** function and turn the camera's flash **OFF**. Use the work light as the camera's light source. This will eliminate reflection and glare from the camera's flash, see top photo on the next page.



The photo above was taken with the camera's flash switched **OFF** and using the work light as the camera's light source. The work light provides soft light for the photo, without the flash glare concealing details.

TAKING PHOTOS


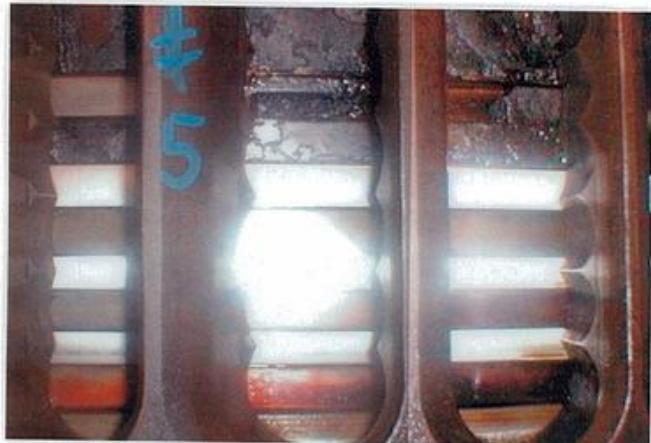


Photo taken with camera's flash switched **ON**. Since this photo includes a broken ring, carbon deposits and sharp edges on rings, details in the photo are important, but concealed by the glare from the camera's flash.

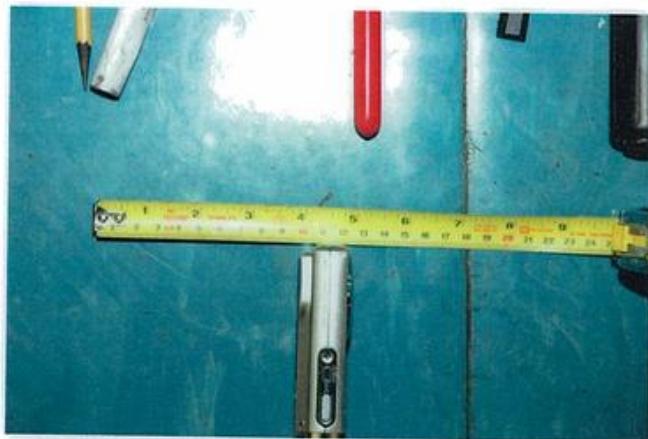

TAKING PHOTOS

Photos are a good method for detecting and documenting conditions such as machine marks (**), wear ridges (WR), clover leafing (CL), scuffing (SC), micro-seizures (MZ) and polishing.

If oil or water is found on top of a piston, use photos to document the condition of the exhaust valve, cylinder head and injectors.



Photo taken in figure above

TAKING PHOTOS

PART III


Supplement to the MAN Diesel & Turbo form
titled
**PISTON CONDITION MONITORING (Port
Inspection)**

Version 1.0
November 2010

PART III

PART III

In accordance with MAN Diesel & Turbo form, *Condition Monitoring Report (Port inspection)*, PART III of this booklet provides a pictorial description of measurement procedures pertaining to Pressure Relief Groove (CL groove) depth, ring groove clearance and piston crown burn-away.

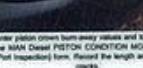Condition Monitoring Report (Port Inspection)	
Document No.	Date:
Customer Name:	Site No.:
Customer Address:	Site Address:
Customer Contact Person:	Site Contact Person:
Customer Phone No.:	Site Phone No.:
Customer Fax No.:	Site Fax No.:
Customer E-mail:	Site E-mail:
Description of Engine/Unit:	
Measurement Method:	
Measurement Units:	
Measurement Locations:	
Measurement Results:	
Comments:	
	
	
	
	
	
	
	
	
	
	
	
	
	
	
	
	
	
	
	
<img alt="Diagram showing a piston crown with a very deep crack." data	

PROPER SELECTION OF VERNIER GAUGE

Before measuring the depth of a Pressure Relief Groove (CL Groove), consider the width and shape of the vernier gauge's stem end (Fig. 1). If the stem is too wide (Fig. 2) the measurement will indicate the groove depth is less than the actual depth. For an accurate measurement, use a vernier gauge with a stem that will sit on the bottom of the groove (Figs. 3 & 5).



Fig. 1

When selecting a vernier gauge, verify that the stem end is not too wide for the Pressure Relief Groove (CL groove).

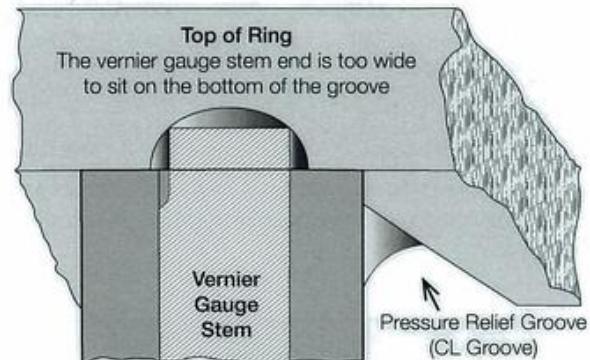


Fig. 2 - WRONG

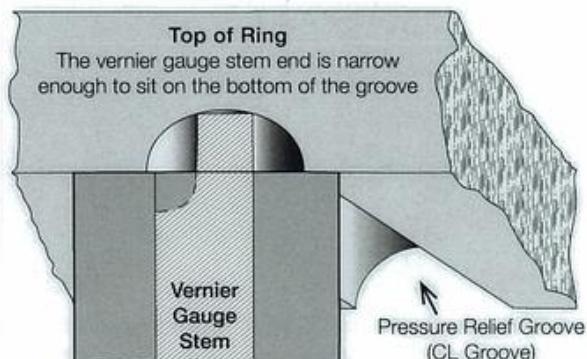


Fig. 3 - CORRECT

**PRESSURE RELIEF GROOVE (CL GROOVE)
DEPTH MEASUREMENT**

MEASURING PRESSURE RELIEF GROOVE (CL GROOVE) DEPTH



Fig. 4 Measure the depth of the pressure relief groove. The depth is an indicator of piston ring wear.



Fig. 5 When taking the measurement, verify that the stem of the vernier gauge is sitting on the bottom of the Pressure Relief Groove (CL Groove).



Fig. 6 The pressure relief groove depth shall not be less than stated on the Piston Data Plate. Enter all measurements on the MAN Diesel & Turbo PISTON CONDITION MONITORING (Port Inspection) form.

**PRESSURE RELIEF GROOVE (CL GROOVE)
DEPTH MEASUREMENT**


METHOD A, MEASURING RING GROOVE CLEARANCE

Prior to inspecting the ring groove clearance, review the vertical clearance specified on the Piston Data Plate.

The ring groove clearance measurement is an indicator of the wear taking place on the chromium plating in the ring groove. If the ring groove wear rate suddenly increases it could be due to a malfunction of the air cooler system causing water to enter the cylinder, a malfunction of the cylinder lube system or abrasive particles from fuel oil or scavenge air.




Using a feeler gauge, measure top and bottom clearances between the ring and the ring groove. The total of the top and bottom clearances must not exceed the value specified on the Piston Data Plate.

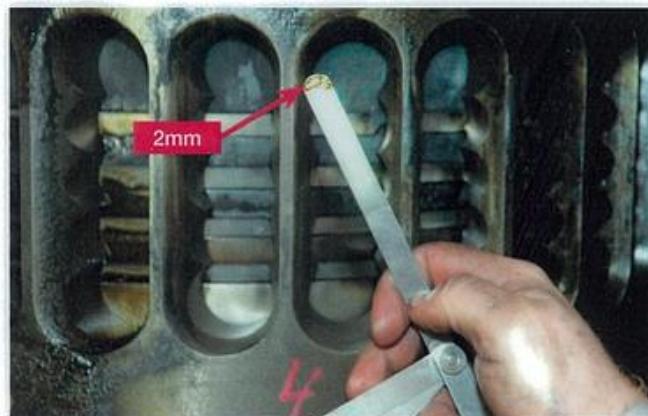

Ring grooves wear faster in two areas. 1)

The chromium plating on the floor of the ring groove. 2) The outer edge of the ring groove. To measure the ring groove clearance at the point of maximum wear, the feeler gauge is only inserted 2mm into the ring groove when measuring.

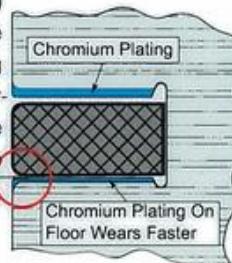

Enter the ring groove clearance depth on the PISTON CONDITION MONITORING (Port Inspection) form.


METHOD B, MEASURING RING GROOVE CLEARANCE




STEP 1: Run the turning gear so the piston is in the downstroke. If the rings have good movement, the rings will move to the top of the ring groove.

If the ring rests on the top of the groove, taking ring groove measurements are simplified by checking the top of the ring as seen in Step 2. Then, if the ring is actually resting against the top, feeler gauge measurements can be performed on the floor of the ring groove as illustrated in Steps 3 – 6. If not, feeler gauge measurements must be made at the top and the floor. The clearance will be the total of the two measurements.


STEP 2: Insert a thin feeler gauge between the top of the ring and ring groove to determine if the ring is resting against the top of the ring groove. If there is a clearance, follow STEPS 3 – 6 on top and bottom. The clearance is the total of both the top and floor (bottom) clearance measurements.

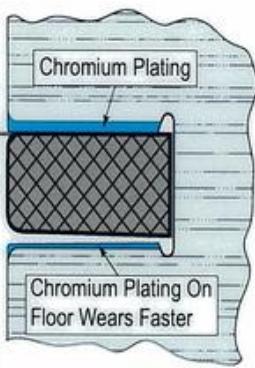

STEP 3: Insert a thin feeler gauge between the ring and the floor until a slight resistance is felt. The feeler gauge may go deep into the ring groove.

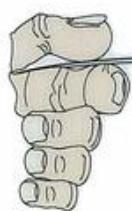


Do not try to force the feeler gauge into the groove. Use only light pressure.

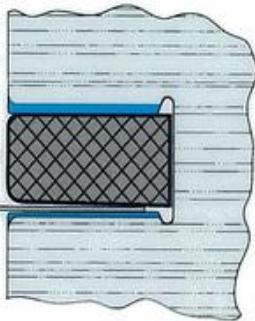


STEP 4: Insert a slightly thicker feeler gauge between the ring and the floor until a slight resistance is felt. The feeler gauge will not go into the ring groove as far.




STEP 5: How many times the groove is measured with the feeler gauge will vary depending on the condition of the ring

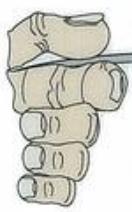


groove and the person doing the inspection.

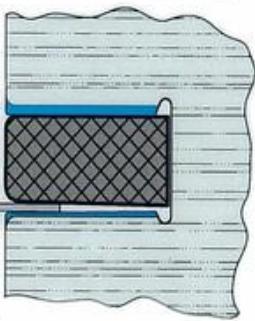

STEP 6: As the feeler gauge thickness increases, the depth to which the gauge can be inserted into the groove will decrease. Consider the measurement complete when the

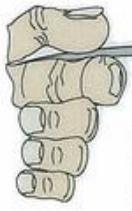

feeler gauge can only be inserted 2 – 4mm into the groove. At this point, the feeler gauge thickness is the ring groove clearance.

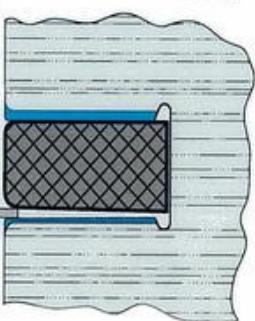

Enter the ring groove clearance depth on the PISTON CONDITION MONITORING (Port Inspection) form.

RING GROOVE CLEARANCE

Prior to inspecting the piston crowns, review the maximum permissible burn-away values on the Piston Data Plate.



Check for burn-away and cracks (elephant skin) around the entire circumference of the piston crown. If elephant skin is found, look at it from several angles and estimate the depth of cracks.



Enter piston crown burn-away values and locations on the PISTON CONDITION MONITORING (Port Inspection) form.

APPENDIX

Inspection Through Scavenge Port
Condition Monitoring Report (Port Inspection)

Inspection through Scavenge Port



Vessel:		IMO no.:		Eng. builder:		Engine no.:							
Number of cyl.:	Eng. type:	Mk.:	Eng. hrs.:	Checked by:		Date (yymmdd):							
Weeks per port calls:		Normal service load (% of MCR):		Lub. part load control:		Lub. type:							
Cyl. oil consump. (l/24 hrs):		at load %	Cyl. oil type:		Position:		<input type="checkbox"/> Exh.	<input type="checkbox"/> Manoeuvre					
	Condition and Symbol	Cylinder No.											
		Engine Part	1	2	3	4	5	6	7	8	9	10	11
	Intact - * Burning - BU Leaking oil - LO Leaking water - LW	Piston crown											
Deposits	No deposit - * Light deposit - LC Medium deposit - MC Excessive deposit - EC Polished deposit - PC	Topland											
		Ringland 1											
		Ringland 2											
		Ringland 3											
Ring breakage	Intact - * Collapsed - C Broken opposite ring gap - BO Broken near gap - BN Several pieces - SP Entirely missing - M	Ring 1											
		Ring 2											
		Ring 3											
		Ring 4											
		Ring movement	Loose - * Sluggish - SL Sticking - ST	Ring 1									
Surface condition	Clean, smooth - * Running surface, Black, overall - B Running surface, Black, partly - (B) Black ring ends > 100 mm - BR Scratches (vertical) - S Micro-seizures (local) - mz Micro-seizures (all over) - MZ Micro-seizures, still active - MAZ Old MZ - OZ Machining marks still visible - ** Wear-ridges near scav. ports - WR Scuffing - SC Clover-leaf wear - CL Rings sharp-edged Top/Bot. - T/B	Ring 1											
Lubrication condition	Optimal - * Too much oil - O Slightly dry - D Very dry - DO Black oil - BO	Ring 2											
Deposits	No Sludge - * Sludge - S Much sludge - MS	Ring 3											
	Intact - *	Ring 4											
		Piston skirt											
		Piston rod											
		Cylinder liner abv. scav. ports											
		Cylinder liner near scav. ports											
		Piston skirt											
		Piston rod											
		Cylinder liner											
		Flaps and non- return valves											

Hours since last overhaul

Condition Monitoring Report (Port inspection)



Vessel:	IMO no.:	Eng. builder:	Eng. no.:	Checked by:										
No. of cylinders:	Eng. type:	Mk.:	Eng. hrs.:	Date (yymmdd):										
Hours since last overhaul:														
Voyage info														
Weeks per port calls:	Normal service load (% of MCR):	Lub. part load control:	Lub. type:											
Cyl. oil consumption (l/24 hrs):	at load %:	Cyl. oil type:	Sulph. %:											
CL grooves														
Nominal CL depth, new ring, mm:	Minimum CL depth, mm:	No. of CL grooves:												
Cylinder No.	1	2	3	4	5	6	7	8	9	10	11	12	13	14
<i>(Where accessible)</i>	Depth, d (mm)													
CL groove no. 1														
CL groove no. 2														
CL groove no. 3														
CL groove no. 4														
CL groove no. 5														
CL groove no. 6														
Remaining round (Y/N)														
Piston Rings														
Ring hours														
	Coating thickness (1/1000 mm)													
Piston ring no. 1														
Piston ring no. 2														
Piston ring no. 3														
Piston ring no. 4														
Ring grooves & Piston crown														
Crown hours														
Ring groove clearance, H Measured at Exhaust side (Exh.) and/or Manoeuvre side (Man.)								Piston crown burning Measuring positions to be indicated in degrees (0° - 360°)						
Ring groove clearance, H (mm)														
Groove no. 1, Exh.														
Groove no. 1, Man.														
Groove no. 2, Exh.														
Groove no. 2, Man.														
Groove no. 3, Exh.														
Groove no. 3, Man.														
Groove no. 4, Exh.														
Groove no. 4, Man.														
Piston crown														
High topland (Y/N):				Oros piston (Y/N):				Bronze ring (Y/N):						
Max burning 1 (mm)														
Position 1 (degrees)														
Max burning 2 (mm)														
Position 2 (degrees)														
Max burning 3 (mm)														
Position 3 (degrees)														
Remarks:														

MAN Diesel & Turbo
PrimeServ Copenhagen
Teglholmsgade 41
2450 Copenhagen SV, Denmark
www.mandieselturbo.com

Technical Service
Phone +45 33 85 11 00
Fax +45 33 85 10 49
PrimeServ-cph@mandieselturbo.com
Emergency phone – after office hours:
+45 20 48 94 40

Ordering of this booklet (80€):
[Data-software@mandieselturbo.com](mailto>Data-software@mandieselturbo.com)